



P.O. BOX 41081, Ottawa, Ontario K1G 5K9  
Tel.: 613-731-5500 • Fax: 613-822-0463  
1-866-809-1504 • [www.aquadrain.ca](http://www.aquadrain.ca)

# **VIDEO CAMERA INSPECTION REPORT**

**YOUR HOME OTTAWA**

**JASON GREENER  
439 CHURCHILL AVENUE NORTH  
OTTAWA**

**FEB. 26, 2021  
SANITARY**



P.O. BOX 41081, Ottawa, Ontario K1G 5K9  
 Tel.: 613-731-5500 • Fax: 613-822-0463  
 1-866-809-1504 • www.aquadrain.ca

## CAMERA INSPECTION REPORT

CUSTOMER	YOUR HOME OTTAWA	START	MAIN CLEANOUT
		END	CONNECTION TO CITY SEWER
LOCATION	439 CHURCHILL AVENUE NORTH	C/O DISTANCE TO WALL:	0.6 M
	OTTAWA	PIPE DIAMETER (S)	100/150 mm
RESIDENT	JASON GREENER	PIPE MATERIAL (S)	CI/VCT/PVC
TELEPHONE. #:	613-818-1119	SEWER TYPE	SANITARY
DATE	February 26, 2021	FLOW:	DOWNSTREAM - CAMERA WITH FLOW
OPERATOR	SCOTT GALLANT		

INSPECTION DONE ON PULLBACK:	YES: <input checked="" type="checkbox"/>	NO: <input type="checkbox"/>	CODE DESCRIPTION
DISTANCE	CODE - DESCRIPTION		
(M)			
0.0	START OF INSPECTION: MAIN CLEANOUT		CRC - CIRCULAR CRACK
0.4	WYE - WYE CONNECTION TO MAIN SEWER		LGC - LONGITUDINAL CRACK BEG/END
2.4	MC/DC - PIPE CHANGES FROM 100 mm CI TO 150 mm VCT		FRC - FRACTURE BEG/END
3.4	OPJ/OFJ - OPEN & OFFSET JOINT		PFL - PARTIAL COLLAPSE
5.2	OPJ/BKJ - OPEN & BROKEN JOINT		CFL - COLLAPSE
6.3	MC - PIPE CHANGES MATERIAL FROM VCT TO PVC		PUN - PUNCTURE
6.3	OPJ/OFJ - OPEN & OFFSET JOINT AT MATERIAL CHANGE		MSP - MISSING PIPE BEG/END
16.4	LBD - LINE BENDS DOWN		BSG - START OF SAG
16.7	LBD - LINE BENDS DOWN		ESG - END OF SAG
17.1	END OF INSPECTION - CONNECTION TO CITY SEWER		OPJ - OPEN JOINT
			OFJ - OFFSET JOINT
			BKJ - BROKEN JOINT
			EXG - EXPOSED GASKET
			EXR - EXPOSED REBAR
			LBL - LINE BENDS LEFT
			LBR - LINE BENDS RIGHT
			LBD - LINE BENDS DOWN
			DEF - PIPE DEFORMAT'N/OVAL
			SC 3 - CONNECTION AT 3 O'CLOCK
			WYE 3 - WYE CONNECTION AT
			PSC - PROTRUDING CONNECTION AT
			AIF - ACTIVE INFILTRATION
			CAL - CALCITE, LT/MED/HVY
			DEB - DEBRIS, LT/MED/HVY
			GRS - GREASE, LT/MED/HVY
			RTS - ROOTS, LT/MED/HVY
			DC - PIPE DIAMETER CHANGE FROM _____ TO:
			MC - PIPE MATERIAL CHANGE FROM _____ TO:
			OBS - OBSTRUCTION IN PIPE
			C/O - CLEAN-OUT
			MAIN - MAIN SEWER IN BLDG.
			CITY - CITY SEWER
			FD - FLOOR DRAIN
			MH - MANHOLE

NOTES:  
 INSPECTION OF SANITARY LATERAL SEWER  
 INSPECTION FROM MAIN CLEANOUT IN FLOOR  
 OPEN & BROKEN JOINTS IN VITRIFIED CLAY TILE PIPE AS NOTED



Mar. 3, 2021

Your Home Ottawa

Attention: Jason Greener

Telephone: 613-818-1119

Email: greener.jay@gmail.com

Location: 439 Churchill Avenue North

On February 26, 2021, Aqua Drain Sewer Services Inc. provided a video inspection of the sanitary lateral from 439 Churchill Avenue North.

Following a review of the video and inspection report, the following issues were found.

In the vitrified clay tile (VCT) pipe, at 3.4 M there is an open and offset joint, at 5.2 M the open joint is cracked and broken and at 6.3 M at the change in pipe material from vitrified clay tile (VCT) pipe to polyvinyl chloride (PVC) pipe the joint is open and offset.

These deficiencies could permit root infiltration through these openings. In order to prevent future problems, a cast-in-place (CIPP) lateral liner should be installed. A quotation has been provided for this.

If you have any questions or concerns regarding the quotation please call Patrice Brule at 613-913-6095.

A handwritten signature in black ink, appearing to read "Mark Rogers".

Mark Rogers, B.A.Sc. (Civil Eng.)

Aquadrain Sewer Services Inc.

613-731-5500 ext 108