

NOTES:

The existing tree inventory was prepared by CSW Landscape Architects Ltd. The observations were noted on the basis of tree conditions at that time and may not be most recent when project construction starts. Contractor is to consult the Landscape Architect and City Forestry staff in case of any descripancies.

DBH are approximate.
 MS = Multi-stem specimen - sizes indicated are approximate and represent the range of trunk sizes.
 Extent of tree removals to be determined based on final build-outs.

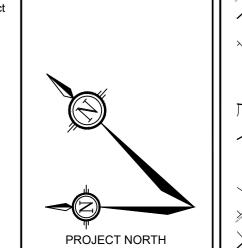

<u>NORTH</u>

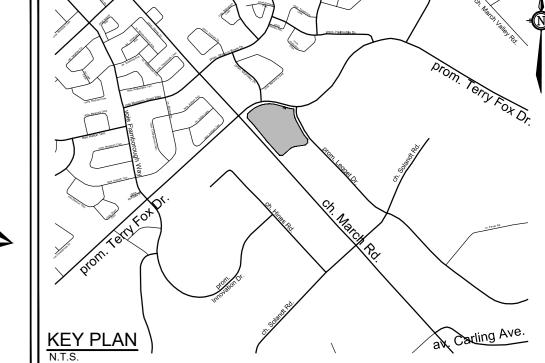

B - PARKING EAST

E - BUILDING WEST

No. Botanical Name

E1 Quercus rubra

E2 | Ulmus rubra

E4 Quercus rubra

|E6 | Picea pungens

E7 Pinus strobus

E10 *Crataegus sp.*

E13 Celtis occidentalis

E14 Ulmus americana

E15 Celtis occidentalis

E17 Acer ginnala

E20 large tree

E18 Group: +3 Ulmus

americanas

E16 Populus tremuloides

E19 Caragana arborescens

E21 | Rhamnus cathartica,

E24 | Ulmus americana

E25 Rhus aromatica

E26 | Acer saccharinum

E27 | large tree removed

E28 | Thuja occidentalis

E29 Lonicera sp.

E31 Taxus sp.

E30 | Picea glauca

E32 | Picea glauca

E33a | Picea glauca

E33b | Picea glauca

E33c | Picea glauca

E34 | Thuja occidentalis

E35 Acer x freemanii

E36 | Crataegus sp.

E38 Acer saccharum

E39 | Acer x freemanii

E40 Crataegus sp.

E41a | Pinus nigra

E41b *Pinus nigra*

E41c | Pinus nigra

E42a Picea glauca

E42b | Picea glauca

E44 Thuja occidentalis

E47 | Thuja occidentalis

E43 | Pinus nigra

E45 Pinus nigra

E46a | Pinus nigra

E46b *Pinus nigra*

E48a *Pinus nigra*

E48b Pinus nigra
E49 Picea glauca

E50 Pinus nigra

E37 | Pinus nigra

Lonicera sp. with vines

E11 | Pinus nigra

E5 | Pinus nigra

E3 Thuja occidentalis

Estern White Cedar

Red Oak

E8 Piceo pungens var. Glauco Colorado blue spruce

E12 | Piceo pungens var. Glauco | Colorado blue spruce

Group: Ulmus americana, Group: American Elm,

E22 | Picea pungens var. Glauca | Colorado blue spruce

E23 | Picea pungens var. Glauca | Colorado blue spruce |

Austrian Pine

American Elm

Amur Maple

Buckthorn,

Group: +3 American

Honeysuckle, with vines

Siberian Peashrub

large tree removed

Honeysuckle

White Spruce

White Spruce

Freeman Maple

Austrian Pine

Freeman Maple

Austrian Pine

Austrian Pine

Austrian Pine

White Spruce

White Spruce

Austrian Pine

Austrian Pine

Austrian Pine

Austrian Pine

Austrian Pine

Eastern White Cedar

Eastern White Cedar

Eastern White Cedar

Colorado Spruce

No.	Botanical Name	Common Name	DBH (cm)	CRZ (m)	Condition	Owner	Remarks	Recomm.
B38	Group: Rhamnus cathartica, Lonicera sp., Rhus typina, Syringa sp, Fraxinus sp.	Group: Buckthorn, Honeysuckle, Staghorn Sumac, Lilac, Ash	n/a	n/a	Poor	Client*	On the future development side	PROTECT
B39	Crataegus sp.	Hawthorne	MS +3 < 10	1.00	Moderate	Client		Remove
B40	Rhamnus cathartica	Buckthorn	MS +5 < 10	1.00	Moderate	derate Client		Remove
B41	Populus tremuloides	Trembling Aspen	25	2.50	Good	Client		Remove
B42	Salix sp.	Willow	25	2.50	Moderate	Client	Healthy, with poor form	PROTECT
B43	Salix sp.	Willow	35	3.50	Moderate	Client	Healthy, with poor form	PROTECT
B44	Quercus sp.	Oak	n/a	n/a	Dead	Client		PROTECT
B45	Thuja occidentalis	Eastern White Cedar	15	1.50	Good	Client		PROTECT
B46	Group: Rhamnus cathartica and Vines	Group: Buckthorn and Vines	n/a	n/a	Poor	Client		PROTECT
B47	Group: Thuja occidentalis	Group: Eastern White Cedar	n/a	n/a	Moderate- Good	Client	dense	PROTECT
B48	Corylus sp.	Hazel	n/a	n/a	Poor	Client	choked by Buckthorn	Remove
B49	Group: Rhamnus cathartica	Group: Buckthorn	n/a	n/a	Poor	Client	evidence of 2 large removed trees	Remove

| DBH (cm) | CRZ (m) | Condition | Owner | Remarks

Good Good

Good

20 | 2.00 | Modertae | Client | Salt damage

10 1.00 Good Client Multistem

MS3 5-15 | 1.50 | Good | Client | Leaning slightly

| 15-20 | 1.50 | Moderate | Client | Dense undergrowth

20 2.00 Good Client Lower limbs removed

15 | 1.50 | Good | Client

20 | 2.00 | Good | Client

40 | 4.00 | Good | Client

20 2.00 Good Client

n/a n/a Moderate Client

n/a n/a Moderate Client

n/a n/a Client

45 4.50 Good Client

<10 n/a Good Client

30 3.00 Good Client

| MS2 15 | 1.50 | Good | Client

20 2.00 Good Client

12 | 1.20 | Good | Client

30 3.00 Good Client

20 2.00 Good Client

12 | 1.20 | Good | Client

30 3.00 Good Client

25 | 2.50 | Good | Client

15 1.50 Good Client

MS2 20 | 2.00 | Good | Client

20 2.00 Moderate Client

15 1.50 Good Client

15 1.50 Moderate Client competing

12 | 1.20 | Moderate | Client | competing

20 2.00 Moderate Client competing

20 2.00 Poor Client sparse foliage

20 2.00 Poor Client topped

25 2.50 Poor Client Leaning severely possible Hazard PROTECT

n/a n/a Good Client dense

n/a n/a Good Client dense growth

n/a n/a Good Client dense planting

35 3.50 Moderate Client sparse foliage

n/a n/a Moderate Client shrubby

30 3.00 Moderate Client bowed

15 | 1.50 | Moderate | Client | one dead stem

25 2.50 Good Client competing with group

30 3.00 Good Client competing with group

30 3.00 Good Client competing with group

30 3.00 Poor Client significant dead limbs

45 4.50

Good Client

15 | 1.50 | Moderate | Client | Possible salt damage

20 | 2.00 | Poor-moderate | Client | Clorosis thoughout foliage

Client

Good Client Multistem

40 4.00 Moderate Client Sparse, possible salt damage

20 2.00 Poor Client competing and salt damage

na na Moderate Client Dense undergrowth

n/a n/a Good Client Dense massing of shrubs

n/a n/a Client dense growth of cedar Buckthorn and Sumac

40 4.00 Good Client Very mature, some reduced vigour Remove

PROTECT

PROTECT

PROTECT

PROTECT

PROTECT

PROTECT

Remove

PROTECT

PROTECT

PROTECT

PROTECT

PROTECT

PROTECT

|PROTECT |

PROTECT

PROTECT

PROTECT

PROTECT

PROTECT

PROTECT

PROTECT

PROTECT PROTECT

D - PARKING ISLANDS EAST

No.	Botanical Name	Common Name	DBH (cm)	CRZ (m)	Condition	Owner	Remarks	Recomm.
D1	Rhamnus cathartica	Buckthorn	n/a	n/a	n/a	Client		Remove
D2	Pinus strobus	White Pine	20	2.00	Good	Client		Remove
D3	Picea pungens var. Glauca	Colorado Blue Spruce	15	1.50	Good	Client	Colonized by vines	Remove
D4	Rhamnus cathartica	Buckthorn	n/a	n/a	n/a	Client		Remove
D5	Rhamnus cathartica	Buckthorn	n/a	n/a	n/a	Client		Remove
D6	Pinus nigra	Austrian Pine	25	2.50	Good	Client		Remove
D7	Crataegus sp.	Hawthorne	MS 2 5-15	1.50	Good	Client	Competing with Buckthorn	Remove
D8	Rhamnus cathartica	Buckthorn	n/a	n/a	n/a	Client		Remove
D9	Rhamnus cathartica	Buckthorn	n/a	n/a	n/a	Client		Remove
D10	Pinus strobus	White Pine	35	3.50	Good	Client		Remove
D11	Picea pungens var. Glauca	Colorado Blue Spruce	20	2.00	Moderate-Poor	Client	Topped, competing with Buckthorn.	Remove
D12	Pinus nigra	Austrian Pine	40	4.00	Good	Client		Remove
D13	Crataegus sp.	Hawthorne	MS4 15	1.50	Moderate	Client	Competing with Buckthorn	Remove
D14	Quercus macrocarpa	Burr Oak	20	2.00	Moderate	Small leaves, sparse foliage, good Client* form, On the future development part		PROTECT
D15	Pinus nigra	Austrian Pine	25	2.50	Good	Client*	On the future development side	PROTECT
D16	Rhamnus cathartica	Buckthorn	n/a	n/a	n/a	Client*	On the future development side	PROTECT
D17	Pinus nigra	Austrian Pine	35	3.50	Moderate-Good	Client*	On the future development side	PROTECT
D18	Pinus nigra	Austrian Pine	n/a	n/a	Dead	Client*	On the future development side	PROTECT

G - BUILDING EAST

G93	Group: Thuja occidentalis	Group: Eastern White Cedar	n/a	n/a	Moderate	Client	dense with buckthorn	Remove
G94	Ulmus americana	American Elm	20	2.00	Good	Client	asymmetrical canopy	Remove
G95	Pinus strobus	White Pine	20	2.00	Good	Client	buckthorn understory	PROTECT
G96	Group: Pinus nigra x2	Group: Austrian Pine x2	20	2.00	Good	Client	but crowded	PROTECT
G97	Group: Thuja occidentalis	Group: Eastern White Cedar	n/a	n/a	Good	Client	Dense, continues as understory in adjacent plantings	PROTECT
G98	Picea glauca	White Spruce	20	2.00	Good	Client	buckthorn understory	PROTECT
G99	Pinus nigra	Austrian Pine	20	2.00	Good	Client	buckthorn understory	PROTECT
G100	Pinus nigra x2	Austrian Pine x2	20	2.00	Good	Client	but crowded	PROTECT
G101	Group: Thuja occidentalis	Group: Eastern White Cedar	n/a	n/a	Moderate	Client	dense, with buckthorn and young ash throughout	PROTECT
G102	Pinus nigra	Austrian Pine	20	2.00	Good	Client		PROTECT
G103	Pinus nigra	Austrian Pine	15	1.50	Good	Client		PROTECT
G104	Pinus nigra	Austrian Pine	25	2.50	Good	Client		Remove
G105	Group: Thuja occidentalis	Group: Eastern White Cedar	n/a	n/a	Good	Client	dense	PROTECT
G106	Picea pungens var. Glauca	Colorado Blue Spruce	20	2.00	Good	Client		PROTECT
G107	Fraxinus sp.	Ash species	n/a	n/a	n/a	Client	dead and regenerating	PROTECT
G108	Group: Thuja occidentalis	Group: Eastern White Cedar	n/a	n/a	Good	Client	dense	PROTECT
G109	Picea pungense	Colorado Blue Spruce	15	1.50	Good	Client		PROTECT

E - BUILDING WEST

	JILDING WEST							
51a	Thuja occidentalis	Eastern White Cedar	30	3.00	Moderate	Client		PROTECT
51b	Thuja occidentalis	Eastern White Cedar	15	1.50	Moderate	Client		PROTECT
5 2	Picea glauca	White Spruce	20	2.00	Good	Client		PROTECT
E 53	Group: Thuja occidentalis	Group: Eastern White Cedar	n/a	n/a	Good	Client	dense	PROTECT
E 54	Group: Rhamnus cathartica and Lonicera sp.	Group: Buckthorn and Honeysuckle	n/a	n/a	n/a	Client	dense	PROTECT
E 55	Crataegus sp.	Hawthorne	MS 4 5-15	1.50	Good	Client		PROTECT
56	Acer saccharum	Sugar Maple	50	5.00	Good	Client		PROTECT
E 57	Picea glauca	White Spruce	40	4.00	Poor	Client	sparse foliage	PROTEC
E 58	Group: Thuja occidentalis x24	Group: Eastern White Cedar x24	10-35	3.00	Moderate- Good	Client	crowded, limbed up	PROTEC ⁻
E 59	Group: Picea glauca x6	Group: White Spruce x6	25	2.50	Moderate	Client	crowded, limbed up	PROTEC
E60	Picea pungens var. Glauca	Colorado blue spruce	15	1.50	Good	Client		PROTEC
61	Group: Thuja occidentalis	Group: Eastern White Cedar	n/a	n/a	Good	Client	dense	PROTEC [*]
62	Pinus nigra	Austrian Pine	20	2.00	Good	Client		PROTEC
E63	Acer saccharum	Sugar Maple	30	3.00	Good	Client		PROTEC
64	Crataegus sp.	Hawthorne	MS3 10- 15	1.50	Good	Client		Remove
E 65	Pinus nigra	Austrian Pine	10	1.00	Good	Client		PROTEC
E 66	Group: Thuja occidentalis	Group: Eastern White Cedar	10-20	1.50	Moderate	Client	crowded	PROTEC
- 67	Pinus strobus	White Pine	15	1.50	Poor	Client	crowded	PROTEC
E68	Crataegus sp.	Hawthorne	10	1.00	Moderate	Client	pruned	Remove
69	Crataegus sp.	Hawthorne	15	1.50	Moderate	Client		Remove
70	Crataegus sp.	Hawthorne	10	1.00	Good	Client		PROTEC
71	Crataegus sp.	Hawthorne	15	1.50	Good	Client		PROTEC
72	Acer negundo	Manitoba Maple	30	3.00	Moderate	Client	healthy but leaning	PROTEC
73	Picea glauca	White Spruce	20	2.00	Poor	Client	Possible salt damage	Remove
74	Crataegus sp.	Hawthorne	15	1.50	Good	Client		Remove
75	Crataegus sp.	Hawthorne	15	1.50	Moderate	Client	healthy but asymmetrical	Remove
76	Crataegus sp.	Hawthorne	10	1.00	Poor	Client	Very sparse foliage	Remove
77	Crataegus sp.	Hawthorne	10	1.00	Moderate	Client		Remove
78	Acer negundo	Manitoba Maple	30	3.00	Moderate	Client	healthy but leaning	Remove
79	Crataegus sp.	Hawthorne	MS6 5-30	2.50	Poor	Client	dead stems	Remove
.80	Crataegus sp.	Hawthorne	20	2.00	Good	Client		Remove
81	Thuja occidentalis	Eastern White Cedar	MS8 10- 20	1.50	Moderate	Client		Remove
82a	Pinus nigra	Austrian Pine	15	1.50	Good	Client		Remove
.82b	Pinus nigra	Austrian Pine	15	1.50	Good	Client		Remove
83	Crataegus sp.	Hawthorne	MS2 30	3.00	Moderate	Client		Remove
84	Crataegus sp.	Hawthorne	15	1.50	Poor	Client	sparse and leaning	Remove
85	Acer negundo	Manitoba Maple	20	2.00	Moderate	Client	healthy but leaning	Remove
.86	Crabapple	Crabapple	20	2.00	moderate	Client	Forum moderate Health moderate	Remove
87	Group: Thuja occidentalis	Group: Easter White Cedar	n/a	n/a	Good	Client	dense Hedge	PROTEC [*]
88	Group: Rhamnus cathartica	Group: Buckthorn	n/a	n/a	n/a	Client	dense	Remove
89	Crataegus sp.	Hawthorne	15	1.50	Poor	Client	competing with Buckthorn	Remove
90	Crataegus sp.	Hawthorne	MS 2 15	1.50	Good	Client		Remove
	large tree	large tree Group: Eastern White	n/a	n/a	n/a	Client	removed	Remove
92	Group: Thuja occidentalis	Cedar	n/a	n/a	Good	Client	dense	Remove
93	Picea pungens	Colorado Spruce	20	2.00	Good	Client	crowded/ bowed	Remove
94	Picea pungens	Colorado Spruce	20	2.00	Good	Client	bowed but vigorous	PROTEC
95	Group: Thuja occidentalis	Group: Eastern White Cedar	n/a	n/a	Good	Client	dense	PROTEC
96	Picea pungens	Colorado Spruce	20	2.00	Good	Client	bowed	Remove
97	Group: Thuja occidentalis	Group: Eastern White Cedar	n/a	n/a	Good	Client	dense	Remove
98	Picea pungens var. Glauca	Colorado Blue Spruce	20	2.00	Good	Client		Remove
99	Picea pungens var. Glauca	Colorado Blue Spruce	20	2.00	Good	Client		Remove
	Picea pungens var. Glauca	Colorado Blue Spruce	25	2.50	Good	Client		Remove

E - BUILDING WEST

No.	Botanical Name	Common Name	DBH (cm)	CRZ (m)	Condition	Owner	Remarks	Recomm
E101	Picea pungens var. Glauca	Colorado Blue Spruce	25	2.50	Good	Client		Remove
E102	Pinus nigra	Austrian Pine	20	2.00	Poor	Client	crowded/ salt damage	Remove
E103	Pinus nigra	Austrian Pine	20	2.00	Moderate	Client	topped	Remove
E104	Thuja occidentalis	Eastern White Cedar	15	1.50	Moderate	Client	crowded	Remove
E105	Pinus nigra	Austrian Pine	20	2.00	Moderate	Client		Remove
E106	Acer ginnala	Amur Maple	15	1.50	Moderate	Client		PROTECT
E107	Caragana arborescens	Siberian Peashrub	n/a	n/a	Moderate	Client	crowded	PROTECT
E108	Rhamnus cathartica	Buckthorn	n/a	n/a	n/a	Client		PROTECT
E109	Rhamnus cathartica	Buckthorn	n/a	n/a	n/a	Client		Remove
E110	Ulmus americana	American Elm	MS 2 20- 30	2.50	Good	Client		Remove
E111	Pinus nigras x2	Austrian Pines x2	30	3.00	Good	Client	Dense understory of immature Linden, Honeysuckle, Grapevine	Remove
E112	Group: Lonicera sp., immature Tilia cordata	Group: Honeysuckle, immature Linden	n/a	n/a	Moderate	Client		Remove
E113a	Picea glauca	White Spruce	45	4.50	Moderate	Client	moderate vigour, asymmetrical Crown	Remove
E113b	Picea glauca	White Spruce	20	2.00	Moderate	Client	asymmetrical crown	Remove
E114	Group: Rhamnus cathartica with Dead Fraxinus sp.	Group: Buckthorn with Dead Ash	n/a	n/a	n/a	Client		Remove
E115	Rhamnus cathartica	Buckthorn	n/a	n/a	n/a	Client		Remove
≣116	Rhamnus cathartica with two Dead Fraxinus sp./ Vitis	Buckthorn with two Dead Ash/ Grapevine	n/a	n/a	n/a	Client		Remove
Ξ117	sp. Sorbaria sorbifolia	False Spirea	n/a	n/a	Good	Client		Remove
E118	Sorbaria sorbifolia	False Spirea	n/a	n/a	Good	Client		Remove
E119	Sorbaria sorbifolia	False Spirea	n/a	n/a	Good	Client		Remove
E120	Group: x8 Picea glauca	Group: x8 White Spruce	30	3.00	Moderate	Client	crowded, one dead	Remove
E121	Group: Thuja occidentalis	Group: Eastern White Cedar	n/a	n/a	Good	Client	dense	PROTECT
E122	Group: x3 Picea glauca	Group: x3 White Spruce	20	2.00	Moderate	Client	overgrown with Grapevine Buckthorn one small Mulberry	Remove
E123	Group: Thuja occidentalis	Group: Eastern White Cedar	n/a	n/a	Good	Client	dense	Remove
E124	Rhamnus cathartica	Buckthorn	n/a	n/a	n/a	Client		Remove
E125	Group: Picea pungens x2	Group: Colorado Spruce	25	2.50	Good	Client		Remove
E126	Catalpa speciosa	x2 Catalpa	50	5.00	Good	Client		Remove
E127	Group: Thuja occidentalis	Group: Eastern White Cedar	n/a	n/a		Client		Remove
E128	Group: x6 Catalpa speciosa	Group: x6 Catalpa	15-40	3.00	Moderate- Good	Client	the larger specimens are in good condition, the smaller are somewhat crowded	Remove
E129	Catalpa speciosa	Catalpa	15	1.50	Good	Client	Somewhat Glowded	Remove
E130	Catalpa speciosa	Catalpa	50	5.00	Good	Client		Remove
E131	x2 Tilia cordata	x2 Linden European	10	1.00	Good	Client		Remove
E132	Group: Picea pungens x3	Group: Colorado Spruce	10	1.00	Good	Client		Remove
E133	Group: Thuja occidentalis	Group: Eastern White Cedar	n/a	n/a		Client	dense	Remove
E134	Group: juniper shrubs	Group: juniper shrubs	n/a	n/a		Client	dense	PROTECT
E135	x2 Picea pungens	x2 Colorado Spruce	15-35	3.00	Good	Client		Remove
E136	Picea glauca	White Spruce	25	2.50	Moderate	Client		Remove
E137	Group: Rhamnus cathartica with Thuja occidentalis and Ulmus americana	Group: Buckthorn with Eastern White Cedar and American Elm	n/a	n/a	Poor	Client	Trees are crowded and poorly formed, undergrowth is dense, burning bush at Edge	Remove
E138	Acer negundo	Manitoba Maple	MS2 20- 30	2.50	Poor	Client	moderate figure poor form leaning	Remove
E139	Acer negundo	Manitoba Maple	30	3.00	Poor	Client	moderate vigour, leaning	Remove
E140	Group: Thuja occidentalis	Group: Eastern White Cedar	n/a	n/a	Good	Client	dense	Remove
L 140	1	Group: 8 x White Spruce	20-30	2.50	Good	Client		PROTECT
	Group: 8 x Picea glauca			2.00	Good	Client		Remove
E141	Group: 8 x Picea glauca Picea pungens var. Glauca	Colorado Blue Spruce	20					
E141 E142	, ,	Colorado Blue Spruce Colorado Blue Spruce	20	2.00	Good	Client		Remove
E141 E142 E143	Picea pungens var. Glauca	·		2.00 2.50	Good Good	Client		Remove
E141 E142	Picea pungens var. Glauca Picea pungens var. Glauca	Colorado Blue Spruce	20					
E141 E142 E143 E144 E145 E146	Picea pungens var. Glauca Picea pungens var. Glauca Picea pungens var. Glauca Picea pungens var. Glauca Acer saccharum	Colorado Blue Spruce Colorado Blue Spruce Colorado Blue Spruce Sugar Maple	20 25 20 20	2.50 2.00 2.00	Good Good Poor	Client Client Client	dead stem, dead wood throughout	Remove Remove
E141 E142 E143 E144 E145 E146 E147	Picea pungens var. Glauca Picea pungens var. Glauca Picea pungens var. Glauca Picea pungens var. Glauca Acer saccharum Picea pungens var. Glauca	Colorado Blue Spruce Colorado Blue Spruce Colorado Blue Spruce Sugar Maple Colorado Blue Spruce	20 25 20 20 30	2.50 2.00 2.00 3.00	Good Good Poor Good	Client Client Client Client		Remove Remove Remove
E141 E142 E143 E144 E145 E146	Picea pungens var. Glauca Picea pungens var. Glauca Picea pungens var. Glauca Picea pungens var. Glauca Acer saccharum	Colorado Blue Spruce Colorado Blue Spruce Colorado Blue Spruce Sugar Maple	20 25 20 20	2.50 2.00 2.00	Good Good Poor	Client Client Client	dead stem, dead wood throughout salt damage salt damage	Remove Remove

E - BUILDING WEST

No.	Botanical Name	Common Name	DBH (cm)	CRZ (m)	Condition	Owner	Remarks	Recor
E151	Acer platanoides (red	Norway Maple (red	25	2.50	Moderate	Client	mild salt damage note Memorial	PROTI
E152	variety) Picea pungens	variety) Colorado Spruce	30	3.00	Poor	Client	tree	PROT
E153	Picea pungens var. Glauca	Colorado Blue Spruce	30	3.00	Good	Client	topped	Remo
E154	Picea pungens	Colorado Spruce	30	3.00	Poor	Client	topped	PROT
E155	Acer x freemanii	Freeman Maple	25	2.50	Moderate-Good	Client	topped	PROT
	Acer rubrum	Red Maple	20	2.00	Moderate	Client	possible salt damage	PROT
	Acer saccharum	Sugar Maple	25	2.50	Moderate	Client	poor vigour	PROT
E158	Quercus rubra	Red Oak	10	1.00	Poor	Client	insect damage and poor vigour	Remo
E159	Sorbus sp.	Mountain Ash	25	2.50	Moderate-poor	Client		Remo
E160	Quercus rubra	Red Oak	15	1.50	Good	Client	insect damage and signs of stress	Remo
							good condition Buckthorn and	
E161a	Picea pungens	Colorado Spruce	20	2.00	Moderate	Client	Vines crowding	PROT
E161b	Picea pungens	Colorado Spruce	25	2.50	Moderate	Client	good condition Buckthorn and Vines crowding	PROT
E162	Group: Thuja occidentalis	Group: Eastern White Cedar	n/a	n/a	Good	Client	dense	PROT
E163	Rhamnus cathartica	Buckthorn	n/a	n/a	n/a	Client		PROT
E164a	Picea pungens	Colorado Spruce	20	2.00	Good	Client		PROT
E164b	Picea pungens	Colorado Spruce	20	2.00	Good	Client		PROT
E165	Quercus macrocarpa	Burr Oak	20	2.00	Good	Client		Remo
E166	Group: 3 Picea pungens	Group: 3 Colorado	30	3.00	Good	Client		Remo
E167	Picea pungens	Spruce Colorado Spruce	20	2.00	Poor	Client	sparse foliage	Remo
	Group: x2 Picea pungens,	Group: x2 Colorado					-	
E168	x4 Picea glauca	Spruce, x4 White	20	2.00	Moderate-Poor	Client	crowding, buckthorn	Remo
E169	Picea pungens	Spruce Colorado Spruce	20	2.00	Good	Client		Remo
	Picea pungens	Colorado Spruce	20	2.00	Good	Client		Remo
		Group: Eastern White		_			4	
E171	Group: Thuja occidentalis	Cedar	n/a	n/a	Good	Client	dense	Remo
E172	Group: Rhamnus cathartica and Acer negundo	Group: Buckthorn and Manitoba Maple	n/a	n/a	Moderate	Client	Trees are somewhat sparse and typically poorly formed, crowded	
E173	Acer platanoides	Norway Maple	10	1.00	Poor	Client	Sparse, poorly formed	PROT
E174	Dead Fraxinus sp.	Dead Ash	n/a	n/a	a n/a Client regenerating		regenerating	Remo
E175	Group: Thuja occidentalis	Group: Eastern White Cedar	n/a	n/a	Good	Client	dense	Remo
E176	Group: 3 Picea pungens 3	Group: 3 Colorado	25-35	3	Good	Client	Overgrown with Grapevine	Remo
	Picea glauca Group: Rhamnus cathartica,	Spruce 3 White Spruce Group: 1 Hawthorne,						
E177	crataegus sp.	mostly Buckthorn	n/a	n/a	Poor	Client	Crowded	Remo
E178	Crataegus sp.	Hawthorne	MS3 15	1.5	Moderate-Good	Client	Grapevine	Remo
E179a	Group: x4 Picea pungens var. Glauca, x5 Picea pungens	Group: x4 Colorado Blue Spruce, x5 Colorado Spruce	MS 15-30	2.5	Moderate-Good	Client	1 Colorado Spruce is dead, 1 Colorado Spruce is topped. Dense understory of buckthorn throughout	Remo
E180	Group: x4 Picea glauca	Group: x4 White Spruce	22-30	3	Moderate	Client	crowding with Buckthorn	Remo
E181	Group: x10 Picea glauca	Group: x10 White Spruce	10-25	2.00	Good	Client	dense, crowded, with buckthorn	Remo
E182	Rhamnus cathartica	Buckthorn	n/a	n/a	n/a	Client		Remo
E183	Group: Thuja occidentalis	Group: Eastern White	n/a	n/a	Good	Client	dense	Remo
E184	Sorbaria sorbifolia	Cedar False Spirea	n/a	n/a	Good	Client		Remo
	large tree removed	large tree removed	n/a	n/a	n/a	Client		Remo
	Acer x freemanii	Freeman Maple	40	4.00	Good	Client		Remo
	Acer x freemanii	Freeman Maple	20-25	2.50	Good	Client		Remo
E188a E188b	Quercus rubra Picea glauca	Red Oak White Spruce	35 15	3.50 1.50	Good Good	Client*	On the future development side On the future development side	PROT
E189	Quercus rubra	Red Oak	25	2.50	Good	Client*	On the future development side	PROT
	Acer saccharum	Sugar Maple	35	3.50	Good	Client*	On the future development side	PROT
E191	Quercuz rubra	Red Oak	20	2.00	Good	Client*	On the future development side	PROT
E192	Picea pungens var. Glauca	Colorado Blue Spruce	20	2.00	Moderate	Client*	Memorial tree- nearby plaque, On the future development side	PROT
E193	Group: x3 Pinus strobus	Group: x3 White Pine	15-25	2.00	Moderate-Good	Client*	dense understory of buckthorn, On the future development side	PROT
E194	Catalpa speciosa	Catalpa	10	1.00	Poor-moderate	Client*	crowded, On the future development side	PROT
E195	Group: Rhamnus cathartica and Dead Fraxinus sp. with Vitis sp.	Group: Buckthorn and Dead ash with Grapevine	n/a	n/a	Poor	Client*	On the future development side	PROT
E196	Group: Thuja occidentalis	Group: Eastern White Cedars	n/a	n/a	Moderate	Client*	crowded with Grapevine, On the future development side	PROT
E197	Picea pungens var. Glauca	Colorado Blue Spruce	20	2.00	Moderate-poor	Client*	possible salt damage, On the future development side	PROT
E198 E199	Crataegus sp.	Hawthorne American Elm	15-20 40	2.00	Poor Good	Client*	On the future development side On the future development side	PROT PROT
E200	Ulmus americana Group: Thuja occidentalis	Group: Eastern White Cedards	10-15	7.00	dense	Client*	one small American Elm within grouping, On the future	PROT
E201	Quercus rubra	Red Oak	25-30	3.00		Client*	On the future development side	PROT
E202	Pinus strobus	White Pine	10-15		Good	Client*	On the future development side	PROT
E203	Group: Crataegus sp., Rhamnus cathartica, Acer negundo, Vitis sp.	Group: Hawthorne, Buckthorne, Manitoba Maple, Grapevine	n/a	n/a	Poor	Client	dense, crowded	PROT
		Group: Eastern White	n/a	n/a	Good	Client	dense	Remo
E204	Group: Thuja occidentalis	Cedar	1111	11172	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	t	lueuse	113

This drawing has been prepared in conjunction with CSW Landscape Architects Limited and is based on the Tree Information Report (TIR) completed by CSW dated 27th October 2022.

Information regarding tree removal and tree protection measures has been prepared by Novatech.

NOTE:
THE POSITION OF ALL POLE LINES, CONDUITS,
WATERMAINS, SEWERS AND OTHER
UNDERGROUND AND OVERGROUND UTILITIES AND
STRUCTURES IS NOT NECESSARILY SHOWN ON
THE CONTRACT DRAWINGS, AND WHERE SHOWN,
THE ACCURACY OF THE POSITION OF SUCH
UTILITIES AND STRUCTURES IS NOT GUARANTEED.
BEFORE STARTING WORK, DETERMINE THE EXACT
LOCATION OF ALL SUCH UTILITIES AND
STRUCTURES AND ASSUME ALL LIABILITY FOR


DAMAGE TO THEM.

OWNER INFORMATION
COLLIERS
181 BAY STREET
TORONTO, ONTARIO, M5J 2V1

AARON CLODD
PHONE: (647) 798-9534
EMAIL: Aaron.Clodd@colliers.com

NOT FOR CONSTRUCTION

				SCALE	DESIGN	
					T	СВ
\vdash				1:400	DRAWN	RGJ
4.	ADDRESS INSERTION ON TITLEBLOCK	DEC 21/23	RGJ			-CD
3.	REVISED PER CITY COMMENTS	DEC 05/23	RGJ	4.400	CHECKED	СВ
2.	REVISED PER CITY COMMENTS	NOV 08/23	RGJ	1:400 0 4 8 12 16		RGJ
1.	ISSUED FOR CITY REVIEW	OCT 02/23	RGJ		APPROVED	
No.	REVISION	DATE	BY		F	RGJ

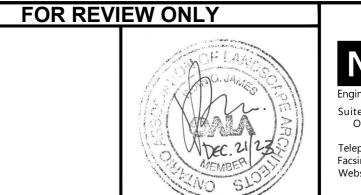



LOCATION
CITY OF OTTAWA
600 MARCH ROAD - NOKIA PARKING LOT EXPANSION

DRAWING NAME

PROJECT No.

Engineers, Planners & Landscape Architects
Suite 200, 240 Michael Cowpland Drive Ottawa, Ontario, Canada K2M 1P6

Telephone (613) 254-9643

REV 4

DRAWING No.

121334-TCR2