


Geotechnical Investigation

811 Gladstone Avenue Ottawa, Ontario

Ottawa Community Housing Corporation

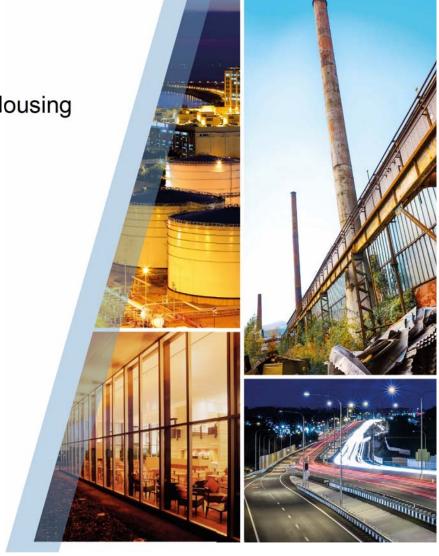

Y



Table of Contents

1.	Introd	duction		1								
2.	Site a	and Project	Description	1								
3.	Field	Investigati	on	2								
	3.1	Laborator	ry testing	3								
4.	Subs	urface Cor	nditions	3								
	4.1	Surface C	Covers	3								
	4.2	Surficial F	Surficial Fill									
	4.3	Buried Co	oncrete Structure	3								
	4.4	Sand and	I Gravel	3								
	4.5	Bedrock.		4								
5.	Grou	ndwater		4								
6.	Discu	ussion and	Recommendations	4								
	6.1	Site Prep	aration	6								
	6.2	Excavatio	on and Dewatering	6								
	6.3	Foundatio	ons	8								
	6.4	Frost Protection										
	6.5	Seismic S	Site Classification	9								
	6.6	Permane	nt Drainage	10								
		6.6.1 6.6.2	Townhouse Buildings Six-Storey Building									
	6.7	Floor Sla	bs	11								
	6.8	Corrosior	Potential of Soils	11								
	6.9	Building E	Backfill	12								
		6.9.1 6.9.2 6.9.2.1 6.9.2.2	Engineered Fill. Exterior Foundation Wall Backfill Townhouses Six-Storey Building	13 13								
	6.10	Lateral Ea	arth Pressure	13								
		6.10.1 6.10.2 6.10.3	Static Conditions Lateral Rock Pressures Dynamic Condition	14								
	6.11	Undergro	und Services	15								
		6.11.1 6.11.2	Bedding and Cover Service Trench Backfill									
	6.12	Pavemen	t Sections	16								
	6.13	Construct	tion Field Review	17								



	7.	Limitation of the Investigation	17
--	----	---------------------------------	----

Figure Index

- Figure 1 Site Location Plan
- Figure 2 Borehole Location Plan

Table Index

Table 5.1	Groundwater Observations	4
Table 6.1	Corrosion Parameter Results	11
Table 6.2	Classes of Exposure	12
Table 6.3	Soil Parameters and Earth Pressure Coefficients	14
Table 6.4	Recommended Pavement Structure	16

Appendix Index

Appendix A	Borehole Logs and Notes on Boreholes
Appendix B	MASW Test Results



1. Introduction

GHD was retained by Mr. Meyerhoffer and Mr. MacNeil of Ottawa Community Housing Corporation (OCHC or Client) to undertake a geotechnical investigation for a proposed new residential development hereafter referred to as the Site, located at 811 Gladstone Avenue, in Ottawa, Ontario.

The purpose of the investigation was to complete an evaluation of the subsurface stratigraphy on the proposed development site in order to summarize the subsurface conditions found at borehole locations, and based upon the data, provide recommendations concerning foundation type and associated bearing capacity, drainage requirements, as well as comment on excavation, backfill, pavement design and construction field review.

This report has been prepared with the understanding that the design will be as described in Section 2 and will be carried out in accordance with all applicable codes and standards. Any changes to the project described herein will require that GHD be retained to assess the impact of the changes on the report recommendations provided herein.

The scope of work for GHD consisted of the following activities:

- Underground Service Clearances
- Fieldwork | The proposed scope included advancement of a total of 11 boreholes within the property and installation of six monitoring wells to measure ground water level.
- Lab Testing | One chemical testing of groundwater for corrosion assessment for ductile iron and concrete.
- Reporting | Preparation of this Geotechnical Report which summarizes the findings of the fieldwork programs and presents recommendations for the design and construction of the structure.

2. Site and Project Description

The site at the time of the original investigation in August 2017 was developed with residential townhouses and associated access road and parking area. At the time of the additional fieldwork in April 2019, the townhouses had been demolished and the excavations backfilled with sand. The site is bounded by Balsam Street on the north, Rochester Street on the west, Gladstone Avenue on the south and by an Institutional property on the east. The site topography slopes down approximately 1.0 m from north to south as well as west to east.

We understand that two of the former buildings on the property had partial basement levels used for the mechanical utility rooms that supply services to all three buildings on the property. It is unknown at this time if the buildings, on adjacent sites, have basements.

It is our understanding that the proposed new development will consist of a new 6-storey residential building with a full basement for car parking garage and storage. The basement will be limited to the west 2/3 of the building and other 1/3 will be no basement. The depth of excavation to underside of footing required will be approximately 4 m below existing grades or elevation 62.2 m.



There will also be two 3-storey townhouses along the north portion of the property, that will have raised first floors and basement beneath. This design results in excavations of about 1.5 to 2 m below existing grades (underside of footing near 65.2 m). A mechanical corridor is located along the east- west centre line of the building and has foundations planned at approximately 1.5 m below the basement slab, or approximately 3 m below grade.

In addition to the three buildings, there will be a local subgrade storm water storage chamber on site and will require an excavation of about 2 m below existing grades or elevation 64 m at the deepest.

There will be associated surface parking areas, access roads and landscaped areas.

GHD has not been informed of any special slab on grade floor loading requirements for this residential development and therefore we are assuming 24 kPa floor loading for slab on grade for the residential buildings and a concrete floor in the car parking garage.

The location of the Site is shown on the Site Location Plan attached as Figure 1.

3. Field Investigation

The original fieldwork component in August, 2017 of this Geotechnical Investigation consisted of the advancement of eight boreholes BH1 to BH8, three of which were outfitted with wells. Three additional boreholes (MW4-19, MW5-19, and MW6-19) with wells were installed in April 2019 for hydrogeological testing purposes. Boreholes were advanced to depths varying between 2.6 to 10 m below the existing surface grade. A total of six monitoring wells were installed at locations BH1/MW1-17, BH2/MW2-17, BH5/MW3-17, MW4-19, MW5-19, and MW6-19. All monitoring wells were sealed within the bedrock. The location of the boreholes are shown in the Borehole Location Plan attached as Figure 2 at the end of this report.

The original borehole drilling fieldwork program was undertaken on August 22, 25, 28 and 29, 2017. The additional drilling for 3 wells was conducted on April 16, 2019. All drilling was performed with a truck mounted drill rig, as well as a specialized manual drill rig adapted for soil sampling and diamond coring of bedrock, under the supervision of GHD field staff. Boreholes were advanced into the overburden using Standard Penetration Tests (SPTs) at regular intervals using a 50 mm diameter split-spoon sampler and a 31.8 kg hammer for the manual drill rig and a 63.5 kg hammer for a truck mounted drill rig, free falling from a distance of 760 mm, to collect soil samples. The number of drops required to drive the sampler 0.3 m in manual drilling is corrected for a hammer weight of 63.5 kg and recorded on the borehole logs as "N" value. All boreholes were advanced into bedrock using HQ diamond coring equipment, in order to confirm the existence of bedrock and comment on rock quality (ASTM D2113). Boreholes without monitoring wells were backfilled with bentonite to the top of bedrock and then with silica sand and auger cuttings to the surface upon drilling completion.

The elevations of the boreholes were determined by GHD field staff using a laser level; and related to a benchmark provided on Architectural drawing No. A1.01 by Hobin Architecture, provided by the client. The benchmark was a catch basin at the northwest corner of the site within the eastbound lane of Balsam Street, and had a geodetic elevation of 66.20 m.



3.1 Laboratory testing

Analytical testing was carried out on a groundwater sample collected to determine corrosion potential within the subsurface to new ductile iron and buried concrete soils at the site. The results of the chemical analyses are discussed in Section 6.10.

4. Subsurface Conditions

In general, soils encountered at the borehole locations consisted of a grassed landscape or asphalt paved surface (fill material) followed by a layer of silty sand and gravel, underlain by limestone bedrock.

General descriptions of the subsurface conditions are summarized in the following sections, with a graphical representation of each borehole on the Borehole Logs. Notes on Boreholes are provided in Appendix A, at the end of this report.

4.1 Surface Covers

Boreholes BH1, BH2, BH3, BH4 and BH5 were drilled in a paved area which had an asphaltic concrete surface approximately 90 mm thick at the borehole locations and was followed by a basecourse crushed limestone fill material.

Boreholes BH5, BH6, BH7 and BH8 were located in a grass covered landscaped area of the Site. The grass was supported by a very thin topsoil layer.

Boreholes MW-4, MW-5, and MW-6 had a sand fill cover that was placed as part of the demolition of the previous buildings on the site.

4.2 Surficial Fill

A surficial fill material was observed in BH8 beneath the cover materials. The fill material was observed to have a thickness of approximately 2.1 m. The fill material was found to consist of sand and gravel. Fill material was loose in compactness condition and was recovered in moist condition.

4.3 Buried Concrete Structure

A buried concrete layer was found within the diamond coring sample beneath the fill material in borehole BH8 location. The concrete structure was found to be in direct contact with bedrock within the cored samples. The thickness of the concrete was found to be approximately 0.3 m.

4.4 Sand and Gravel

In all boreholes, except BH8, MW-4, MW-5, and MW-6, a layer of native silty sand and gravel underlay the surface cover. The layer was observed to have a thickness of approximately 0.1 to 0.9 m. The native material was loose to compact in compactness and was recovered in a damp to moist condition.



4.5 Bedrock

Practical refusal to auger advancement was encountered in all boreholes at shallow depths on bedrock, as confirmed by diamond coring methods. The depth to auger refusal ranged between 0.5 m at BH1 to 2.6 m at BH8. The bedrock deposit was a grey sedimentary rock (Limestone) at the borehole locations. The quality of this rock was generally weathered and fractured, very poor within the upper approximately 0.5 to 1.5 m of the bedrock, with measured Rock Quality Designation (RQD) values of 29 to 50. The quality improves becoming what is considered as good to excellent rock based upon higher RQD values.

5. Groundwater

Six monitoring wells were installed as part of the scope of work. Groundwater levels were measured on September 8, 2017, at the monitoring wells BH1, BH2, and BH5. Groundwater levels at the additional well locations, MW-4, MW-5, and MW-6, as well as BH1, were measured on April 25, 2019. BH2 and BH5 were not usable following the demolition work at the site. The following Table 5.1 shows the measured water levels.

Borehole Location	Depth of Water Below Existing Grade (m) (Sept. 8, 2017)	Depth of Water Below Existing Grade (m) (Apr. 25, 2019)	Depth of Water Below Existing Grade (m) (May 2, 2019)	Water Table Elevation (m) (May 2, 2019)
BH1/MW-1	1.9	0.9	1.5	64.5
BH2/MW-2	2.7	-	2.1	64.1
BH5/MW-3	2.2	-	2.6	64.5
MW-4	-	3.2	3.3	62.4
MW-5	-	4.6	4.6	61.4
MW-6	-	1.1	1.3	65.2

Table 5.1 Groundwater Observations

It should be noted that the groundwater table is subject to seasonal fluctuations and in response to precipitation and snowmelt events. Also, it would be expected that water may be perched within the fill materials or the very poor bedrock, especially during and following periods of precipitation and in the spring and fall or other wet seasonal periods. Further discussion of groundwater is presented in an associated hydrogeological report reported under separate cover by GHD which should be referenced.

6. Discussion and Recommendations

The recommendations in this report are based on GHD's understanding of the proposed development, which is outlined as follows:

• 6-storey Building - The proposed structure will consist of a 6-storey residential building, located along the southern portion of the site and will have one underground level for basement or underground parking within the west 2/3 of the building, and expected excavations in the order



of 4 to 5 m below existing grades. For practical design purposes, groundwater table is assumed to be elevation 65 m and therefore will be penetrated with the basement excavation.

- Townhouses Two 3-storey townhouses located at the northeast and northwest portions of the site with a raised first floor and a basement level. A founding depth for the foundations of about 1.5 to 2 m below current ground surface or elevation 64.4 to 65.16 m. A partial crawl space for the mechanical room will be located along the east-west centre line of the buildings. The foundation depth for the mechanical room at about 1.5 m below the basement slab or elevation approximately 62.9 m at the West Townhouse and 63.6 m at the East Townhouse.
- The storm water retention tank will have inverts near elevation 64 to 65 m.
- No information is available regarding the foundation depth/elevation of the previous buildings or of the off-site adjacent structures but designers and contractors should be aware of these.

Based on our understanding of the proposed structure, the subsurface conditions encountered in the boreholes, and assuming them to be representative of the subsurface conditions across the Site, the following recommendations are provided. The most important geotechnical considerations for the design of the proposed buildings are the following:

- Bedrock Excavation | Based on the proposed founding depth of foundations for the structures, bedrock excavation is expected. The upper 0.5 to 1.5 m of bedrock was found to be weathered and fractured; The bedrock becomes good to excellent quality with depth.
- Existing and Buried Structures | It is important to note that no information was provided regarding the founding depth of the previous building's. All foundations and buried structures associated with the previous buildings must be removed from the footprint of the proposed new buildings. Buried concrete was found in borehole BH8 location at about 2.3 m below existing grade. Deep fill layers and further buried structures may exist on site. Contractors and the designers should include some allowance regarding the removal of unknown buried structures or removal of fill materials.
- Frost Susceptibility of the Bedrock | Upper layers of the bedrock were found to be highly
 fractured and with the shallow groundwater the bedrock may be susceptible to frost action (frost
 heaving) and requires the same as typical 'soil' frost cover depths and protection. Should
 construction take place during winter, the exposed surfaces to support foundations must be
 protected by Contractors against freezing and foundations on bedrock should have adequate
 soil cover.
- Adjacent Structures Construction Activity Induced Vibrations | The excavation operations of bedrock will impart vibrations affecting the nearby below grade and above grade structures. The client, designers and contractors should implement measures to reduce risk and severity of vibrations and damage to adjacent structures.

Adjacent Structures - Excavation and Dewatering Influences | The presence of the shallow depths to bedrock and type of bedrock, will result in no off-site impact to adjacent buildings due to dewatering effects due to the new building as existing buildings are assumed to be founded on Bedrock. The excavation faces through the overburden depth will need to be adequately shored. Upper levels of weathered bedrock should be planned to be back sloped at 1:1. The underlying more sound bedrock should be able to be cut at near vertical.



• Pre-Construction surveys should be carried out and contractors should incorporate excavation methods to minimize damage to the adjacent structures. This is of particular importance for the institutional building to the east.

6.1 Site Preparation

Site preparation within the new building footprints will involve the removal or any foundations and buried structures associated with the previous buildings, removal of existing vegetation, topsoil and any existing fill materials to expose the bedrock.

In the proposed landscape and pavement areas the site preparation will involve removal of existing topsoil and asphaltic concrete. The environmental assessments completed for the site indicate that contaminated soils are present and will require removal. This is documented in other published reports. Following the required removals, if soils (fills or native) remain then these may be reviewed by the geotechnical Engineer to determine if they are suitable to remain in place for re-use for the particular area on site. Field verifications should be carried out by qualified geotechnical personnel during construction.

Bedrock removal is expected for underground services, tanks, basements and footing excavations. The excavation operations of bedrock is expected to impart vibrations. Contractors must use techniques and methods to prevent settlement of adjacent ground, structural damage to adjacent buildings and minimize aesthetic impacts (e.g., paint/drywall cracks, pavement cracking). It is recommended that the specifications require that pre-condition surveys of the adjacent structures be completed. Specifications and Tenders submitted by contractors of their proposed methods of excavations, blasting, vibration monitoring, and soil and groundwater management plans in the form of written plans are recommended to be requested by the owner's design consultant team prior to construction to allow adequate time for review and discussion.

6.2 Excavation and Dewatering

All excavations should be completed and maintained in accordance with the Occupational Health and Safety Act (OHSA) requirements. The following recommendations for excavations should be considered to be a supplement to, not a replacement of, the OHSA requirements.

Based on the results of the investigation, overburden soil material within excavation would be considered as 'Type 3 Soils', as defined by the OHSA Regulations for Construction.

Bedrock removal is expected since footing excavations are expected to penetrate to at least 1.5 to 3 m for the Townhouses, approximately 2 to 3 m for the Stormwater Storage chamber, and 4 to 5 m for the 6-storey building's basement.

The soil overburdens and some heavily weathered bedrock are considered to be type 3 Soils as per the Occupational Health and Safety Act and should be sloped back at 1:1 or supported by a shoring system. The less weathered rock may either be shored and contractors may take some risk but as a minimum the weathered rock should be planned to be cut back at a 30 degree from vertical and/or required support by shoring or a rock protection system of rock bolts-mesh-shotcrete.

Sound rock may be planned to be excavated at near vertical.



Alternatives to sloped or cut back overburden and weathered bedrock is the use of shoring. Shoring methods would be expected to vary from combinations and use of Soil Nailing, Shotcrete and rock bolts.

The more sound bedrock would be excavated at near vertical due to its quality and type of rock. However, other factors may require coverage of the rock face. For example, as excavations proceed local fractures, shear zones or weathered areas may require treatments ranging from rock bolting to rock bolting with mesh and shotcrete. The Tender and Specifications should allow for unit price submissions from contractors during the Tender and have allowances in the contract.

The excavation of the bedrock will require the use of line drilling in combination with pneumatic or hydraulic breakers such as hoe rams or heavy excavation equipment equipped for rock excavation. Excavation that may involve controlled blasting techniques and/or line drilling. Local by-laws should be confirmed that this will be allowed. Line drilling on a closely spaced pattern may also be an option to assist excavation methods and prevent over breakage issues, especially around the perimeter or to create local excavations for elevator pits, footings, etc. The use of cutter heads with assist is doing final "shaving" of the rock in areas that would be beneficial to have a smooth face.

Excavations must be planned in advance to ensure the foundations of the adjacent structures, and roadways are not undermined during excavation. Any excavation methodology is subject to the laws and blasting restrictions that are in effect for the area.

The excavation operations of bedrock will impart vibrations affecting the surrounding buildings. It is recommended that the specifications require pre-condition surveys as well as submittal of plans for excavations, blasting, vibration monitoring, and soil and groundwater management plans.

It is recommended that the client's design team include in the specification package, requirements for the successful contractor to submit written Plans for Excavation as well as Soil and Groundwater Management for review by the client design team.

Water quantities expected to enter open excavations during construction are discussed in a separate report submission and will depend on seasonal conditions, depth of excavations, and the duration that excavations are left open.

The excavation of the weathered bedrock may require pneumatic or hydraulic breakers such as hoe rams or heavy excavation equipment equipped for rock excavation. Excavation of more sound rock will require more rigorous methods that may involve controlled blasting techniques and/or line drilling. Line drilling on a closely spaced pattern in combination with the use of hoe ram or other breaking type equipment may also be an option. Any excavation methodology is subject to the laws and blasting restrictions that are in effect for the area.

The client's design team should provide vibration limits for the adjacent off-site residential and institutional buildings and underground structures. The contractors plan should include methodology for how they will control vibrations and adjust their excavation methodology in the event of vibration exceedances. Local municipal guidelines should act as a minimum standard but designers should determine if the standard's criteria is sufficient to protect the buildings.

Surface water and groundwater seepage is expected in the excavated areas, especially within the overburden and weathered rock. Water quantities will depend on seasonal conditions, depth of



excavations, and the duration that excavations are left open. Conventional construction dewatering techniques should be taken during construction, such as pumping from sumps and or ditches. Contractors will need to use techniques and methods to minimize disturbance to soils.

GHD completed a hydrogeological assessment of this site as part of the scope of work in April 2019. For details regarding the extent of dewatering activities and whether a Permit to take water (PTTW) or submission on the Ontario Environmental Activity and Site Registry (EASR) is required, refer to the Hydrogeological Investigation report.

6.3 Foundations

The Ontario Building Code (OBC 2012) requires buildings to be designed using Limit States Design values (LSD) of Serviceability Limit States (SLS) and Ultimate Limit States (ULS). It is expected that the foundation of the proposed residential building will be bearing on bedrock and will be supported by conventional spread footings.

Based on the recorded conditions within the boreholes, it is recommended that for the Townhouse buildings with partial basement, that the shallow pad and strip footings are expected to be set within the limestone bedrock. The recommended bearing pressures are 500 kPa under factored ULS conditions.

For the 6-story building, due to the deeper excavation and better bedrock conditions, higher bearing values for footings set within the sound bedrock are available. The recommended factored ULS value is 2000 kPa. The factored ULS value includes the geotechnical resistance factor (Φ) of 0.5. For the west end of the building that will have no basement and therefore foundations will near the bedrock interface, the same bearing pressure of 2000 kPa may be used provided the footings are set at least 0.75 m into bedrock based upon the bedrock quality.

For all footings set on bedrock, there is no corresponding SLS value, as settlement is considered to be nil for the footings founded on bedrock.

The minimum founding sizes should be 0.75 m for pad footings and 0.5 m widths for strip footings on bedrock using the bearing pressures noted above for the both the low rise and 6-story buildings.

Based on the existence of mud seam recorded in the coring of the bedrock, it is our recommendation that rock probing be completed at the time of construction to evaluate the bedrock for mud seams within the footing areas for the 6-storey building. The concern of the impact of mud seams is less of a concern for the foundations for the Townhouse complex due to the lower bearing pressure but should still be verified during construction by rock probing. One mud seam was found in borehole BH4. Mud seams can be inherent in the sedimentary type limestone depths. Based on the existence of mud seam layers in bedrock, it is our recommendation that rock probing be completed at the time of construction to evaluate the bedrock beneath footing subgrade for mud seams. This "probing" may consist of contractors being required to drill a 50 mm diameter hole, 1.5 m below the base of the footing subgrade. These probe holes should then be assessed by the Geotechnical Engineer to confirm the absence/presence of mud seams. If mud seams are verified then remedial options may include deepening the footings down to the underside of the mud seam if the mud seam is deemed significant by the Geotechnical Engineer. Structural engineers should determine the remedial approach for foundation support if this over excavation is required. Remedial approach options may include replacing the excavated rock with bulk concrete backfill, or extending



the foundation walls or piers or other structural solutions. Designers/Owners should account for this work and unit rates for over excavation and remedial approach in the Tender and Specification documents. If the mud seam are greater than 1 m below underside of footing level and/or thin enough then the Geotechnical assessment during construction may allow the mud seam to be left in-place.

Excavations for footings and other adjacent structures (sump pits, storm water tank, sewer trenches, etc.) set within bedrock at various levels, including step footings, should be positioned such that they do not encroach within the 1V:1H zone of influence of an adjacent footing. Step footings should be designed in a manner that the average slope of the benching is no steeper than 1V:2H along the length and the height of the bench is less than 0.3 m.

6.4 Frost Protection

The bedrock is a sedimentary rock with fracture and the water table is close to the surface therefore, the bedrock may be susceptible to frost action and frost heave. All exterior footings associated with the heated building must be provided with at least 1.5 m of soil cover or its equivalent in insulation, in order to provide adequate protection against detrimental frost action. This cover depth requirement must be increased to 1.8 m for footings for unheated or isolated structures such as signs, entrance canopy, or piers.

Should construction take place during winter, the subgrade surfaces must receive adequate temperature protection by Contractors to protect against freezing for the duration of the construction period.

6.5 Seismic Site Classification

In accordance with OBC-2012, the building and its structural elements must be designed to resist a minimum earthquake force. In order to provide a site class, a geophysical (MASW) testing program was performed that included the generation of dispersion curves, inversion of the obtained dispersion curves, and development of one dimensional (1-D) shear wave velocity profiles using SurfSeis[®] version 2.05. The dispersion curves, obtained from active data using short and long arrays along each investigation line, were investigated and integrated to obtain a combined dispersion curve.

In accordance with the requirements of OBC-2012, the variation of the measured shear wave velocity versus depth from 1.5 m below existing grade up to 31.5 m below existing ground elevation was obtained and results are summarized in the Seismic Site Classification attached as Appendix B, at the end of this report. The average shear wave velocity along each line was obtained utilizing the averaging scheme shown in sentence 4.1.8.4 (2) of Commentary J of National Building Code (NBC-2015) User's Guide.

Based upon the results of the geophysical testing program, the building can to be designed using a Seismic Site Class 'A' with respect to Table 4.1.8.4.A of the OBC-2012 subject to code requirements.

The results of the MASW data interpretation are provided in Appendix B.



In addition to the above geophysical testing program, it should be noted that no soil deposit with a thickness of 3.0 m or more, was found within the borehole locations which would be considered as "soft soils" as defined in Table 4.1.8.4.A of OBC-2012. In order to be considered as "soft soils" all of the following criteria must be satisfied:

- Plastic Index: Ip > 20 percent
- Moisture Content: w ≥ 40 percent
- Undrained Shear: Strength Su < 25 kPa

6.6 Permanent Drainage

Under floor and perimeter drains are considered necessary for all structures proposed, i.e., both townhouse and the 6-storey structure.

The drains should be connected to a frost-free outlets for year round drainage.

Elevator pits should have drainage weepers and waterproofing design measures. If drainage weepers are not practical then the pits will need to be designed to resist hydraulic buoyancy pressures.

If elevator pistons are used then the designers of these shafts and installations will need to also consider buoyancy issues. Installation of these will also need to consider groundwater control and buoyancy during installation. This may need additional investigation as the GHD mandate did not include deep enough boreholes to address the elevator piston shaft installation.

6.6.1 Townhouse Buildings

Both perimeter and under floor drainage is considered necessary for this structure with underground levels unless the building is treated to create a waterproofed "bathtub" in which case additional review and recommendations are required.

6.6.2 Six-Storey Building

It is recommended that Composite Drainage Blanket (CDB) or geodrain is used for the perimeter walls. There are several commercially available product liens available. The CDB should be connected by a collection piping system and drained to a frost-free outlet for year round drainage. The perimeter system should not be connected to the interior under-floor drainage system.

Underfloor drainage network is also recommended and should be connected to a frost free sump (separated from the perimeter drainage system and sump) with discharge to the municipal sewerage system.

As portions of the structure may be below the water table, it is also recommended that the exterior walls be protected with a waterproofing membrane applied to the wall in addition to the CDB.



6.7 Floor Slabs

Conventional slab-on-grade construction is considered suitable for the proposed building. We are assuming that the building will have light floor loadings only, i.e., considered to be less than 24 kPa. Higher loading requirements will require additional consultation and analysis.

Preparation of the subgrade as discussed in Section 6.1 and 6.2 would include removal of unsuitable overburden materials to expose suitable subgrade and/or the design subgrade level. The subgrade surface may need to be compacted following excavation. Any local weakened areas should be excavated and replaced with suitable fill and compacted. Field verification should be carried out by geotechnical personnel during construction.

A layer consisting of Granular 'A' at least 200 mm thick should be placed immediately below the floor slabs to support the slab-on-grade. This layer should be compacted to 100 percent of its SPMDD and placed on approved subgrade surfaces.

For the Townhouse structures slab-on-grades should an underfloor weeping tile and vapour barrier to be incorporated beneath the slab and should be specified by the architect.

For the 6-storey building with basement, a heavy duty vapor or waterproofing membrane should be incorporated as well as rigorous underfloor weeping tile network.

Underfloor weeping networks should be connected to dedicated sumps that are separate from perimeter weeping tile systems.

Floor toppings may also be impacted by curing and moisture conditions of the concrete. Floor finish manufacturer's specifications and requirements should be consulted and procedures outlined in the specifications should be followed.

Designers should consider concrete slab crack control measures and whether the slabs should be tied into the foundation walls. The designers and contractors must carefully plan the placement of construction and control joints in the concrete and should be in accordance with generally accepted practice.

6.8 Corrosion Potential of Soils

Analytical testing was carried out on a groundwater sample collected to determine corrosion potential of the subsurface soils at each site. The selected soil sample was tested for pH, resistivity, chlorides, and sulphides, sulphates, and redox potential. The test results are summarized in the following table.

Sample ID	Pre-Existing Well
рН	8.27
Resistivity (ohm-cm)	610
Sulphate (µg/L)	143
Chloride (µg/g)	163

Table 6.1 Corrosion Parameter Results



The American Water Works Association (AWWA) publication 'Polyethylene Encasement for Ductile-Iron Pipe Systems' ANSI/AWWA C105/A21.5-10 dated October 1, 2010 assigns points based on the results of the above tests. Soil that has a total point score of 10 or more is considered to be potentially corrosive to ductile iron pipe. Based on the results obtained for the sample submitted, the Site soils are considered to be potentially corrosive to cast iron pipe. Therefore protective measures, such as sacrificial cathode protection should be considered.

Table 3 of the Canadian Standards Association (CSA) document A23.1-04/A23.2-04 'Concrete Materials and Methods of Concrete Construction/Methods of Test and Standard Practices for Concrete' divides the degree of exposure into the following three classes:

· · · · ·	
Degree (Class) of Exposure	Water Soluble (SO4) in Soil Sample (%)
Very Severe (S-1)	>2.0
Severe (S-2)	0.20 - 2.0
Moderate (S-3)	0.10 - 0.20

Table 6.2 Classes of Exposure

A review of the analytical test results shows the sulphate content in the tested samples was found to be less than 0.02 percent. Based upon the test results, the degree of exposure of the subsurface concrete structures to sulphate attack is low. Therefore, normal General Use (GU) hydraulic cement can be used for the below grade concrete structures.

6.9 Building Backfill

The placement and compaction of the materials that will support the floor slabs, pavement or any interior backfill must be treated as Engineered Fill.

6.9.1 Engineered Fill

The fill operations for Engineered Fill must satisfy the following criteria:

- Engineered Fill must be placed under the continuous supervision of the Geotechnical Engineer.
- Prior to placing any Engineered Fill, all unsuitable fill materials must be removed, and the subgrade proof rolled, and approved. Any deficient areas should be repaired.
- Prior to the placement of Engineered Fill, the source or borrow areas for the Engineered Fill must be evaluated for its suitability. Samples of proposed fill material must be provided to the Geotechnical Engineer and tested in the geotechnical laboratory for Standard Proctor Maximum Dry Density (SPMDD) and grain size, prior to approval of the material for use as Engineered Fill. The Engineered Fill must consist of environmentally suitable soils (as per industry standard procedures of federal or provincial guidelines/regulations), free of organics and other deleterious material (building debris such as wood, bricks, metal, and the like), compactable, and of suitable moisture content so that it is within -2 to +0.5 percent of the Optimum Moisture as determined by the Standard Proctor test. Imported granular soils meeting the requirements of Granular 'A', or Type II OPSS 1010 criteria would be suitable.
- The Engineered Fill must be placed in maximum loose lift thicknesses of 0.2 m. Each lift of Engineered Fill must be compacted with a heavy roller to 100 percent SPMDD.



 Field density tests must be taken by the Geotechnical Engineer, on each lift of Engineered Fill. Any Engineered Fill, which is tested and found to not meet the specifications, shall be either removed or re-compacted and retested.

6.9.2 Exterior Foundation Wall Backfill

6.9.2.1 Townhouses

Conventional residential backfilling requirements are recommended for the Townhouse buildings. Any backfill placed against the foundation walls should be free draining granular materials meeting the grading requirements of OPSS 1010 for Granular 'B' Type I specifications up to within 0.3 m of the ground surface. The upper 0.3 m should be a low permeable soil to reduce surface water infiltration. Foundation backfill should be placed and compacted as outlined below.

- Free-draining granular backfill should be used for the foundation wall.
- Backfill should not be placed in a frozen condition, or placed on a frozen subgrade.
- Backfill should be placed and compacted in uniform lift thickness compatible with the selected construction equipment, but not thicker than 0.2 m. Backfill should be placed uniformly on both sides of the foundation walls to avoid build-up of unbalanced lateral pressures.
- At exterior flush door openings the underside of sidewalks should be insulated, or the sidewalk should be placed on frost walls to prevent heaving. Granular backfill should be used and extended laterally beneath the entire area of the entrance slab. The entrance slab should slope away from the building.
- For backfill that would underlie paved areas, sidewalks or exterior slabs-on-grade, each lift should be uniformly compacted to at least 98 percent of its SPMDD.
- For backfill on the building exterior that would underlie landscaped areas, each lift should be uniformly compacted to at least 95 percent of its SPMDD.
- In areas on the building exterior where an asphalt or concrete pavement will not be present adjacent to the foundation wall, the upper 0.3 m of the exterior foundation wall backfill should be a low permeable soil to reduce surface water infiltration.
- Exterior grades should be sloped away from the foundation wall, and roof drainage downspouts should be placed so that water flows away from the foundation wall.

6.9.2.2 Six-Storey Building

The client and designers have the option to pour the foundation walls against shoring or bedrock faces or alternatively allow for an offset or space sufficient to place backfill as outlined in Section 6.9.2.1.

6.10 Lateral Earth Pressure

Permanent basement/underground parking walls are to be considered as retaining walls and should be designed to withstand lateral earth pressures. It is assumed that hydraulic pressures are not applicable as drainage systems are proposed. If this changes the client and designers should seek



further advice from GHD. There may also be retaining walls at grade changes with adjacent properties. The walls should be designed for lateral pressures resulting from the following sources:

- Unit weight of the backfilled soil
- Temporary and permanent vertical loads on the completed ground surface

6.10.1 Static Conditions

The following soil parameters can be used for designing of the retaining walls for lateral earth pressures within the depth of any soil overburdens or if excavations result in the requirement to use soil/granular backfills to be placed. The weathered bedrock (i.e., top ~ 1 m) should be considered as part of the soil overburden when considering lateral earth pressures

Soil	Density 'γ' (kN/m ⁽³⁾)	Angle of internal Friction	Rankin Earth Pressure Coefficients ⁽¹⁾⁽²⁾						
		φ	Ka	Ко	Кр				
Compacted granular backfill such as an OPSS "Granular BI or BII" type product	21	32	0.31	0.47	3.3				
Notes:									

Table 6.3 Soil Parameters and Earth Pressure Coefficients

⁽¹⁾ Assumes level/flat backfill surface

⁽²⁾ If temporary soil support shoring is required, designers should refer to the CFEM for design assistance and to Section 6.7.3.

- For yielding walls the active earth pressure coefficients Ka is recommended to be used.
- For non-yielding wall the at-rest Ko should be used.

The resultant of the applicable static or at-rest force is assumed to act at 1/3H above the base of the wall where H is the height of the wall for the permanent wall with free drain backfill material.

It is noted that for the temporary shoring system that will support the existing fill and upper weather bedrock Section 26.10.3 of CFEM 2006 should be used by designers regarding the distribution of the forces. The soils encountered in the boreholes consist mainly of granular soils. If the shoring must support existing structures then the stiffness of the shoring system must be addressed by the designers and Ko is recommended. The contractor must also ensure installation procedures minimize risk of lateral movements especially where structures are being supported by the shoring system.

These statements are based on the assumption that there is a perimeter drainage system installed at the base of the retaining walls draining under gravity to a frost free outlet, to prevent the build-up of hydrostatic pressure behind the wall; hydrostatic pressures may not be included in the design.

6.10.2 Lateral Rock Pressures

The weathered bedrock (i.e., top \sim 1 m) should be considered as part of the soil overburden when considering lateral earth pressures.



The sound bedrock is predominantly sound limestone deposit with some shale interbeds. Typically the rock is expected to be fairly sound, competent bedrock below the upper weathered zone.

The sound bedrock would be able to be cut at near vertical and should stay stable. There was no reported fault or shear zones noted in the borehole logs.

The bedrock will be able to be cut near vertical.

The minimal depth into rock, it is typically considered that any in-situ stresses are released a short time following excavation. There will be nil to minimal pressures from the rock on the permanent walls for such shallow excavations into the bedrock. For this site and project as described above, regarding the pressure exerted on basement walls within the bedrock depth, it is recommended that K=0 (i.e., rock is self-supporting)

During construction, in spite of the quality of rock found within the boreholes, there may be local fissures and fractures oriented in such a way to create conditions of possible block failure. Some allowance should be included with the Project Specifications and Tender documents to allow for design and contractor installation of rock bolts for temporary excavation stability concerns during construction.

6.10.3 Dynamic Condition

These pressures are not considered for the structures under Part 9 of the Ontario Building, i.e., the Townhouse structures.

Also it is expected that the 6-storey structure will have basement walls, but will have not granular backfill and therefore these dynamic forces are not applicable. If backfill is used between the basement walls and bedrock, then GHD should be consulted for further advice and recommendations.

6.11 Underground Services

6.11.1 Bedding and Cover

The following are recommendations for service trench bedding and cover materials that may be associated with the development.

- Bedding for buried utilities should be OPSS Granular 'A', and placed in accordance with City of Ottawa specifications.
- The cover material should be a sand material or Granular 'A' and the dimensions should comply with City of Ottawa standards.
- The bedding material and cover materials should be compacted as per City of Ottawa standards and to at least 95 percent of its SPMDD.
- Compaction equipment should be used in such a way that the utility pipes are not damaged during construction.



6.11.2 Service Trench Backfill

Backfill above the cover for buried utilities should be in accordance with the following recommendations:

- For service trenches under pavement areas, the backfill should be placed and compacted in uniform thickness compatible with the selected compaction equipment and not thicker than 200 mm. Each lift should be compacted to a minimum of 95 percent SPMDD.
- The backfill placed in the upper 300 mm below a pavement subgrade elevation should be compacted to a minimum of 100 percent SPMDD.
- To reduce the potential for differential settlement and frost heave the excavation sides should have frost tapers as per OPSD 800 series which essentially indicates that there should be a back slope of 10:1 (H:V) within the frost zone below finished grade.

6.12 Pavement Sections

Access driveways and parking areas are expected to be constructed over existing fill or bedrock. In order to prepare the site for the pavement area, it is necessary that the area be stripped of any existing cover materials such as surficial topsoil and associated root-mat other deleterious materials deemed unsuitable by geotechnical personnel to expose a suitable subgrade. The exposed subgrade should be proof rolled in the presence of a Geotechnical Engineer. Any areas where "soft spots", rutting, local anomalies, or appreciable deflection are noted should be excavated and replaced with suitable fill, and use of geotextiles may be warranted for strength improvement. The fill should be compacted to at least 95 percent of its SPMDD.

The pavement sections described in the table below are recommended for areas subjected to parking lot and heavy truck traffic. Pavement materials and workmanship should conform to the appropriate Ontario Provincial Standard Specifications (OPSS).

Pavement Layer	Minimum Thickness	Heavy Duty (Access Roads)
HL3 Asphalt	50 mm	40 mm
HL8 Asphalt	n/r	50 mm
Granular 'A' Base Course	150 mm	150 mm
Granular 'B', Type II Sub-Base Course	300 mm	450 mm

Table 6.4 Recommended Pavement Structure

In order to accommodate the recommended thicknesses, designers will need to review grades and determine where stripping or filling is necessary. Pavement materials and workmanship should conform to the appropriate OPSS.

Minimum Performance Grade (PG) at 58 – 34 should be used at this site.

Drainage of the pavement layers is important. The subgrade surface and each layer of the pavement section should be provided with a suitable cross fall (approximately 2 percent) to prevent water from ponding on the pavement surface and beneath the pavement layers. Surface runoff should be directed to storm sewers, or allowed to flow into ditches.



Where the new pavement abuts existing and the subgrade levels vary between the two areas, then a frost transition should be integrated into the subgrade with a 10:1 slope in the subgrade. Sufficient field-testing should be carried out during construction to assess compaction of each lift of the pavement layers. This should be accompanied by laboratory testing of the granular and asphalt materials. All granular base course materials should be compacted to 100 percent of its SPMDD.

Annual or regular maintenance will be required to achieve maximum life expectancy. Generally, the asphalt pavement maintenance will involve crack sealing and repair of local distress.

It should be noted that the pavement sections described within this report represent end-use conditions only, which includes light vehicular traffic and occasional garbage or service trucks. It may be necessary that these sections be temporarily over-built during the construction phase to withstand larger construction loadings such as loaded dump trucks or concrete trucks.

6.13 Construction Field Review

The recommendations provided in this report are based on an adequate level of construction monitoring being conducted during construction phase of the proposed building. GHD requests to be retained to review the drawings and specifications, once complete, to verify that the recommendations within this report have been adhered to, and to look for other geotechnical problems. Due to the nature of the proposed development, an adequate level of construction monitoring is considered to be as follows:

- It is recommended that GHD be retained to review design drawings and specifications prior to the tender to ensure our recommendations have been interpreted and that there are no additional geotechnical recommendations required.
- Prior to construction of footings, the exposed foundation subgrade should be examined by a Geotechnical Engineer or a qualified Technologist acting under the supervision of a Geotechnical Engineer, to assess whether the subgrade conditions correspond to those encountered in the boreholes, and the recommendations provided in this report have been implemented.
- A qualified Technologist acting under the supervision of a Geotechnical Engineer should monitor placement of Engineered Fill underlying floor slabs.
- Backfilling operations should be conducted in the presence of a qualified Technologist on a part time basis, to ensure that proper material is employed and specified compaction is achieved.
- Placement of concrete should be periodically tested to ensure that job specifications are being achieved.

7. Limitation of the Investigation

This report is intended solely for Ottawa Community Housing Corporation (OCHC) and other party explicitly identified in the report and is prohibited for use by others without GHD's prior written consent. This report is considered GHD's professional work product and shall remain the sole property of GHD. Any unauthorized reuse, redistribution of or reliance on the report shall be at the Client and recipient's sole risk, without liability to GHD. Client shall defend, indemnify and hold GHD



harmless from any liability arising from or related to Client's unauthorized distribution of the report. No portion of this report may be used as a separate entity; it is to be read in its entirety and shall include all supporting drawings and appendices.

The recommendations made in this report are in accordance with our present understanding of the project, the current site use, ground surface elevations and conditions, and are based on the work scope approved by the Client and described in the report. The services were performed in a manner consistent with that level of care and skill ordinarily exercised by members of Geotechnical Engineering professions currently practicing under similar conditions in the same locality. No other representations, and no warranties or representations of any kind, either expressed or implied, are made. Any use which a third party makes of this report, or any reliance on or decisions to be made based on it, are the responsibility of such third parties.

All details of design and construction are rarely known at the time of completion of a geotechnical study. The recommendations and comments made in the study report are based on our subsurface investigation and resulting understanding of the project, as defined at the time of the study. We should be retained to review our recommendations when the drawings and specifications are complete. Without this review, GHD will not be liable for any misunderstanding of our recommendations or their application and adaptation into the final design.

By issuing this report, GHD is the Geotechnical Engineer of record. It is recommended that GHD be retained during construction of all foundations and during earthwork operations to confirm the conditions of the subsoil are actually similar to those observed during our study. The intent of this requirement is to verify that conditions encountered during construction are consistent with the findings in the report and that inherent knowledge developed as part of our study is correctly carried forward to the construction phases.

It is important to emphasize that a soil investigation is, in fact, a random sampling of a site and the comments included in this report are based on the results obtained at the 11 test hole locations only. The subsurface conditions confirmed at these eleven test locations may vary at other locations. Soil and groundwater conditions between and beyond the test locations may vary at other locations. Soil overtically from those encountered at the test locations and conditions may become apparent during construction, which could not be detected or anticipated at the time of our investigation. Should any conditions at the site be encountered which differ from those found at the test locations, we request that we be notified immediately in order to permit a reassessment of our recommendations. If changed conditions are identified during construction, no matter how minor, the recommendations in this report shall be considered invalid until sufficient review and written assessment of said conditions by GHD is completed.



All of Which is Respectfully Submitted,


GHD

Ryan Vanden Tillaart, EIT

B

Joseph B. Bennett, P. Eng.



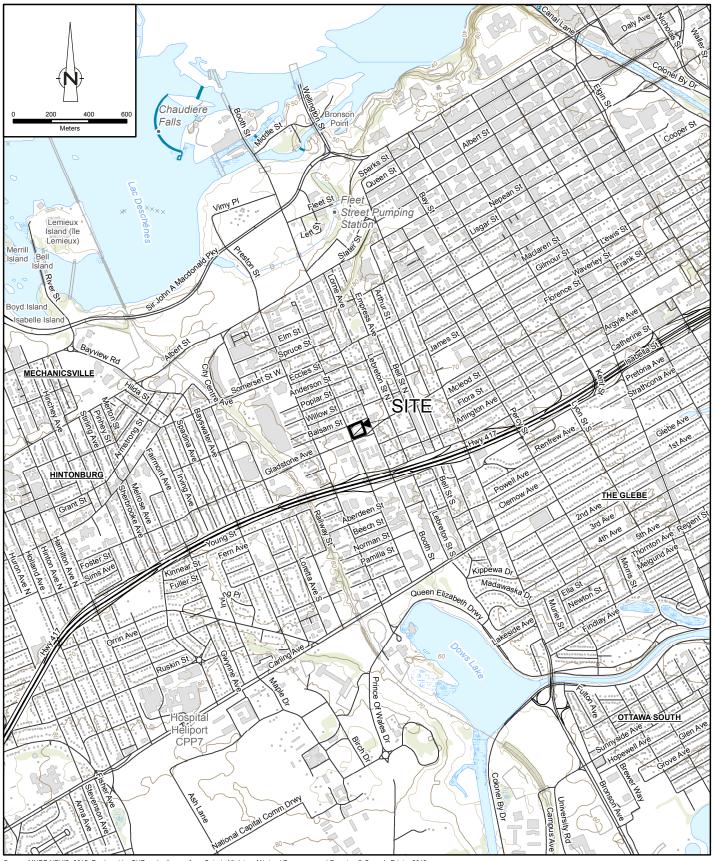


Source: MNRF NRVIS, 2015. Produced by GHD under licence from Ontario Ministry of Natural Resources and Forestry, © Queen's Printer 2019 Coordinate System: NAD 1983 UTM Zone 18N




OTTAWA COMMUNITY HOUSING 811 GLADSTONE AVENUE, OTTAWA, ON GEOTECHNICAL INVESTIGATION 11140575-A1 Apr 30, 2019

SITE LOCATION MAP

FIGURE 1

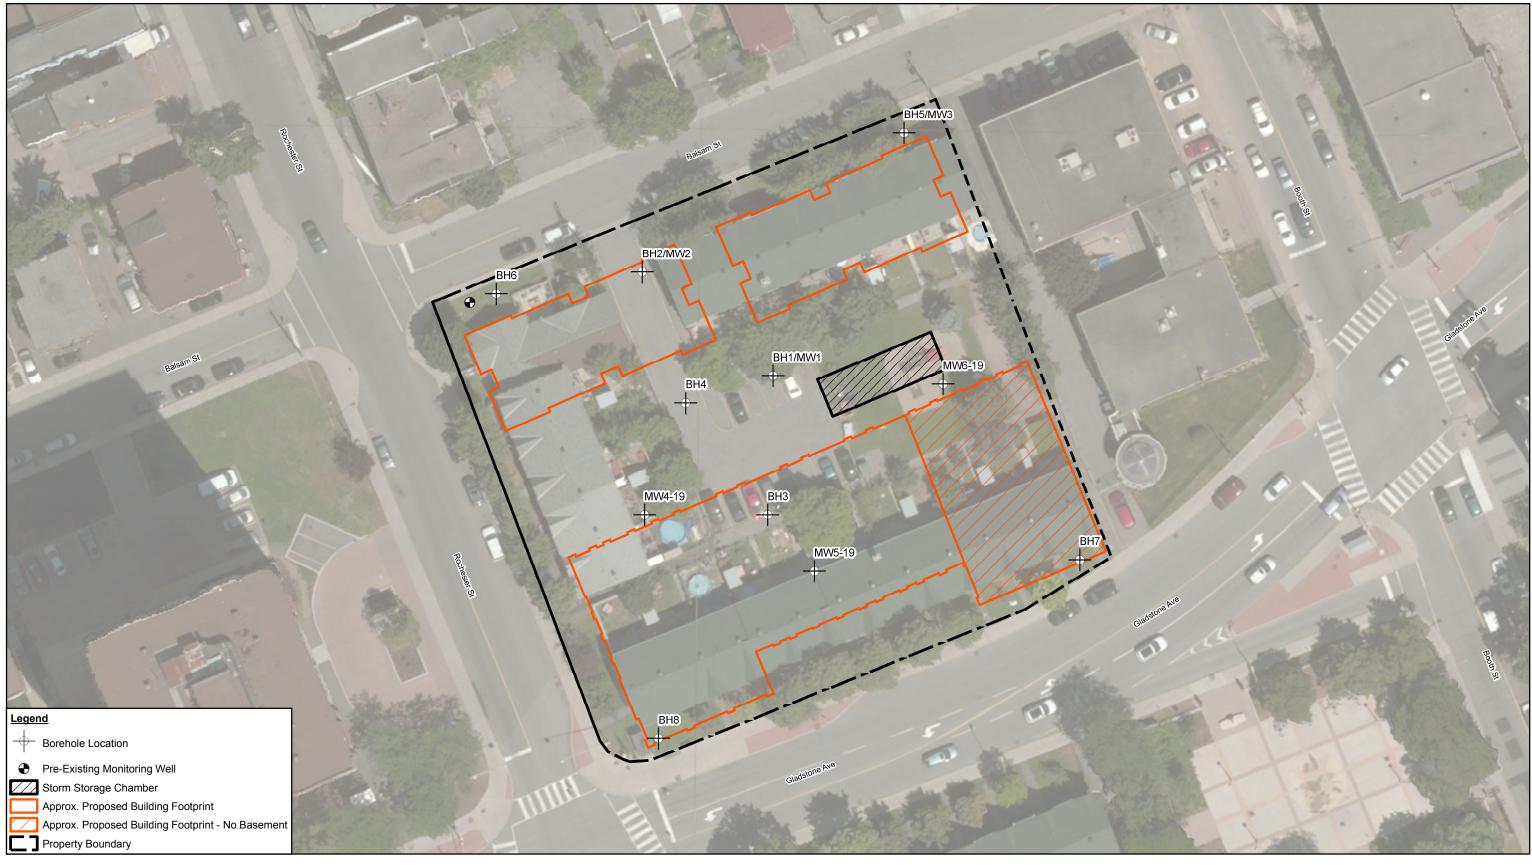

osoft Corporation, July 2013





OTTAWA COMMUNITY HOUSING 811 GLADSTONE AVENUE, OTTAWA, ON GEOTECHNICAL INVESTIGATION

BOREHOLE LOCATION PLAN

FIGURE 2

11140575-A1 May 6, 2019



GHD | Geotechnical Investigation | 11140575 (1)

Appendix A Borehole Logs and Notes on Boreholes

REFER	REFERENCE No.:11140575-E3												SURE	: No.:			1	
		C		BORE	EHOLE No.B	-11-17	/M	W1-17	7				BOF	REH	OL	ΕL	00	6
				ELEV	ATION:	66.0	00	m					Page	: _1	_ (of _	1	
CLIE	ENT: Ot	tawa (Community Housing Corp	oration									0.11		GEN	D		
PRC	JECT:	Geote	chnical Investigation									SS 💽						
LOC	ATION:	811 0	Gladstone Avenue, Ottaw	a, Ontario								ST 🖉	Shelt	y Tube	9			
				t CHECKED BY: S. Wallis						₹ o		r Level						
DAT	E (STAR	T):	22 August 2017	DATE (FINISH): 22 August 2017						⊷ • N	Atter	erg lim	nits (%)		lon			
SC	SCALE STRATIGRAPHY				MONITOR WELL			SAN				• N	Split Pene	Spoon : ration I	sample ndex b	e based		
Depth BGS	Elevation (m)	Stratigraphy	DESCRIPTION SOIL AND BEDR			State	Type and Number	Recovery	OVC	Penetration Index / RQD							Vane	
meters	66.00		GROUND SURF					_	%	ppm	Ν	50 10	SCALE	FOR 100kPa 40	TEST 150 50 6	RESU kPa <u>0 7(</u>	JLTS 200ki) <u>80</u>	Pa <u>90</u>
	65.9	\bigotimes	ASPHALT(Approximat	ely 0.1	0.05 -	П	M	Auger SS1	5/15									
0.5	65.6 65.5		FILL-Gravelly sand, de	ense,	0.66 —		Ħ							_				
E 1.0			grey, damp. SAND AND GRAVEL-	_oose,	0.66 =			RC1	36/41		60						_	
			brown, damp. *Auger refusal at 0.475	.	1.27 —			NOT			00							
- 1.5			continued with rock con	ing	1.48 WL 1.50													
2.0			LIMESTONE-Grey, we and fractured, fair qual	ty.	05/02/2019													
			Water level : 1.89 mbg *Becoming good	6				RC2	60/60		82							
2.5																		
- 3.0					Sand —									_				
3.5																		
					Screen —			RC3	57/60		89							
= 4.0																		
4.5																		
			*Becoming excellent															
5.0																		
- 5.5								RC4	60/60		93			_				
Eeo																		
_ 0.0	59.9		Borehole ended	at	6.05 — 6.15 ⁄													
6.5			approximately 6.15 limestone	m in														
= 7.0																		
2/19																		
													+				_	
													+					
5.5 6.0 6.5 7.0 6.5 7.0 7.5 8.0 8.5 8.0 9.0 9.5 10.0 10.0 10.0 10.0 10.0 10.0 10.0 10																		
≝⊨ ⊒ – 9.0													+	_			-	
H 9.5																		
⁸ 10.5																	_	
NOTES	5:																	
HOLE																		
BORE																		

	EFERENCE No.:11140575-E3											ENCLC					2			
		G		BORI	EHOLE No.BH	12-17	/M	W2-17	7			BOREHOLE LOG								
				ELEV	ATION:	66.2	21	m				Page: <u>1</u> of <u>1</u>								
CLIE	ENT: Ot	tawa (Community Housing Corr	oration																
PRO	JECT:	Geote	chnical Investigation									SS 💽 GS								
LOC	ATION:	811 (Gladstone Avenue, Ottaw	va, Ontario								🖾 sт								
			R. Vandentillaa									₹ o		r Level r contei						
DAT	E (STAR	T):	25 August 2017		DATE (FINISH):25 August 2017						• N	Atter	berg lin	nits (%		lon				
SCALE STRATIGRAPHY				MONITOR WELL			SAI		DATA		• N	Split Pene	Spoon tration I mic Co	sampl Index I	e based					
Depth BGS	Elevation (m)	Stratigraphy	DESCRIPTION SOIL AND BEDR			State	Type and Number	Recovery	ovc	Penetration Index / RQD	□ Cu S ▲	n Lab n	d Vane Vane							
meters	66.21		GROUND SURF	-					%	ppm	Ν	50 10	SCALI 0kPa 20 30	E FOR 100kPa 40	TEST 150 50 6	RESU)kPa <u>30 7(</u>	JLTS 200k <u>80</u>	Pa <u>90</u>		
È	66.1 65.8	\bigotimes	<pre>ASPHALT(Approximat _\m thick)</pre>	ely 0.1	0.05 -	ΠĨ	M	SS1	12/20		9									
0.5	65.6		FILL-Gravelly sand, logrey, damp.	ose,	Sand — 0.61 —		μ	001									_			
E 1.0			SILTY SAND-Some gra	avel,	Bentonite			RC1	23/23		65						-			
			compact, grey with reddish-brown staining	damp.	1.35 — Riser 1.55 —												+			
- 1.5			*Auger refusal at 0.6 m continued with rock cor	,	1.55 —															
2.0			LIMESTONE-Grey, we	athered	WL 2.10 -	Y		RC2	60/60		88									
2.5			and fractured, fair qual *Water was whiteish at		05/02/2019												_			
			transitioning to grey. Water level : 2.74 mbg	6			H								_		_			
3.0			*Becoming good *Becoming excellent		Sand —												_			
- 3.5			Decoming excellent					RC3	58/58		98						-			
E					Screen															
4.0																				
4.5															_		_			
5.0								RC4	52/52		100						_			
-																	-			
5.5							H								_		_			
E 6.0								RC5	28/28		100									
	60.0		Borehole ended	at	6.13 — 🔤 6.22 🗸		⊢∎													
6.5			approximately 6.2 limestone	m in																
7.0															_		_			
																	-			
													+				+			
5.5 6.0 6.5 7.0 7.5 8.0 8.5 9.0 9.5 10.0																				
															_		_			
9.0 															_		-+			
9.5													+	_			+			
													+				+			
													+				+			
10.5																				
7.5 8.0 9.0 9.5 10.0 NOTES	:																			
3																				

REFER	ENCE N	o.:	11140575-E3	-							ENCLOSURE No.: 3							
				BOREHOLE No.: BH3-17							BOREHOLE LOG							
		C	Ð	ELEVATION:							Page: <u>1</u> of <u>1</u>							
										LEGEND								
			Community Housing Corp							🖂 se		it Spoo	on					
	-		chnical Investigation Gladstone Avenue, Ottaw								GS Auger Sample							
		-		rt CHECKED BY:														
				DATE (FINISH):						° H		ter cor erberg						
	ALE	/		ATIGRAPHY			SAMPLE			• N	Per		on Ind	ex bas	ed on			
30		>	311							• N	Per	netratio	on Inde	, x base ample				
Depth	tion	raph	DES	SCRIPTION OF	1	and		0	RQD	_ ∆ Cı □ Cı	u She	ear Str	ength	based	on Fie on Lat	ld Van	ne e	
BGS	Elevation (m)	Stratigraphy		AND BEDROCK	ċ	Type and	Recovery	OVC	Penetration Index / RQD	S ▲	Ser She	nsitivity ear Str	y Valu ength	e of So based	oil			
		St				<u> </u>						ket Pe						
meters	65.80			OUND SURFACE		a	%	ppm	N	10	0kPa	100k	Pa) 50	150kPa 60	SULTS 2004 70 80	kPa <u>) 90</u>		
E	65.7 65.4		ASPHALT(Approximat FILL-Gravelly sand, lo			ss	1 11/2	5	9						+			
0.5	65.0		SILTY SAND-some gra	avel, compact, grey, moist.			1 11/2		5						++			
- 1.0	05.0			m, continued with rock coring athered and fractured, fair	/	RC	1 22/2	2	64						+	-		
			quality. *Becoming excellent		-													
_ 1.5 _			Becoming excellent															
2.0						RC	2 57/5	7	93									
2.5															++			
	63.1		Borehole ended at a	pproximately 2.7 m in limestor		L									++			
= 3.0											_		_		+	_		
3.5															+			
E																		
- 4.0																		
4.5															\square			
5.0															+			
5.0											_				+		_	
- 5.5															+			
6.0																		
E																		
6.5															\square			
7.0											_				+			
															+			
[≈] 7.5															+			
													+		+	+		
8.5																		
-											_							
9.0													_		+	_		
9.5															+		_	
													\rightarrow		+	+	-	
10.0													+		+	+		
10.5																		
	S:																	
3																		

REFER	ENCE N	o.:	11140575-E3							ENCLO	SURE	No.:			4	
				BOREHOLE No.:	BH4-	17					BOR	FH		FI	00	
		G	HD	ELEVATION:	65.80	m				•	Page:					•
												LEG				
			Community Housing Corp chnical Investigation								Split Sp	boon				
	-			a, Ontario							Auger Shelby		е			
				rt CHECKED BY: _						v ∑ u	Water					
				DATE (FINISH):						°	Water of Atterbe)		
	ALE			RATIGRAPHY			MPLE			• N • N	Penetra Split Sp	ation Ir	ndex l ample	based e		
Depth BGS	Elevation (m)	Stratigraphy		SCRIPTION OF AND BEDROCK	State	Type and Number	Recovery	ovc	Penetration Index / RQD	△ Cu □ Cu S	Dynam Shear Shear Sensiti Shear Pocket	ic Con Streng Streng vity Va Streng Penet	e sam th bas th bas lue of th bas trome	iple sed or sed or f Soil sed or ter	n Fiel n Lab n	Vane
meters	65.80		GR	OUND SURFACE			%	ppm	Ν	50 10	SCALE kPa 1 20 30	FOR T	EST 150		JLTS 200k	Pa
=	65.7	\times	ASPHALT(Approximat		/M	SS1	10/10		19			40 0				- 90
0.5	65.4 65.3		FILL-Gravelly sand, co	mpact, grey, damp. gravel, loose, greyish brown,	-/	331	10/16		19							
E ,	65.1		damp.	, continued with rock coring		RC1	27/27		78							
- 1.0				athered and fractured, good	/											
- 1.5			quality. Mudseam: 2.38 to 2.4n	1											_	
2.0						RC1	60/60	1	85							
2.5												_				
E	63.1		Borehole ended at a	pproximately 2.7 m in limeston	e											
3.0																
- 3.5																
E 4.0																
4.0																
4.5																
5.0												_				
															_	
5.5																
6.0																
=																
6.5												_				
7.0															-	_
7.5																
.)⊢ I																
8.5																
•											$\left \right $	-		-+	+	
ŝE														\neg	+	
9.5																
10.0																
												_				
= 10.5 NOTES	<u>.</u>															
۵ 🔔 🛁																

REFER	ENCE N	o.:	11140575-E3	_							ENCLC	SURE	No.: _		5	
		G	HD	BORI	EHOLE No.B	H5-17/	MW3-	17	-			BOR	EHO	LEL	-00	6
				ELEV	ATION:	67.0	6 m		-			Page:	_1	of _	1	
CLIE	ENT: O	ttawa (Community Housing Corr	oration							_		LEGE	IND		
			echnical Investigation									Split				
			Gladstone Avenue, Ottav									Shelby				
			R. Vandentillaa			_	S.	Wallis			Ţ	Water I	_evel			
			28 August 2017								°		content (rg limits	,		
SC	ALE		STRATIGRAPHY		MONITOR WELL	2		SAMPLE	DATA	•	• N • N	Split Sp Penetra	ation Ind boon sar ation Inde	nple ex basec		
Depth BGS	Elevation (m)	Stratigraphy	DESCRIPTION SOIL AND BEDR			i	Type and	Recovery	ovc	Penetration Index / RQD		Shear Shear Sensiti Shear Pocket	vity Valu Strength Penetro	based of based of e of Soil based of meter	l on	
meters	67.06		GROUND SURF	ACE	-			%	ppm	Ν	50 10	SCALE 0kPa 10 20 30	FOR TE	ST RES	ULTS 200kl	Pa
- 0.5	67.0 66.8		TOPSOIL-Silty sand, b loose, moist. (Approxin m thick)		0.05 -	Π	ss	1 7/24		15	•		40 30			
- 1.0	66.4		FILL-Sand and gravel, loose, damp.	1	0.61 — Bentonite —		Ĩ									
_ 1.5			Mudseam : 0.9 to 0.91 LIMESTONE-Grey, we and fractured, poor qua	athered	1.09 — Riser — 1.30 —		RC	1 60/60	5	50						
2.0			Water level : 2.17 mbg	S												
2.5			*Becoming good		WL 2.60 —	X	RC	2 30/30	5	80						
3.0			*Becoming excellent		05/02/2019 Sand —											
3.5					Screen —		RC	3 45/4	5	92						
4.0																
4.5								4 27/27		100						
5.0							RC	5 47/47	7	100						
6.0	61.2		Borehole ended	at	5.87 —											
6.5			approximately 5.87 limestone	' m in												
7.0																
DI 1/2/1 11/11/17.5																
BOREHOLE LOG 11140575-E3-BH LOGS GPJ INSPEC_SOL.GDT 7/5/19 0.0 0.0 0.0 0.0 0.0 0.0 0.0 0.0 0.0 0.0													+		$\left \right $	
															\square	
0.01													+	+	$\left \right $	
	·.															
의 NOTES 피아).															
BORE																
-																

REFER	ENCE N	o.:	11140575-E3							ENCLO	DSUF	RE N	o.: _		6		
				BOREHOLE No.:	BH6-	17					BO	RF	но	LEI	0	ì	
		C	HD	ELEVATION:6	6.42	m								of			
													EGE				
			Community Housing Corp chnical Investigation	oration						🖂 ss		it Spo	on				
	-			a, Ontario						📳 G:							
				rt CHECKED BY:						₹		ter Le					
				DATE (FINISH):						°			ntent (° limits	,			
	ALE			ATIGRAPHY			MPLE			• N • N	Per Spl	netratio	on Ind on sar	ex base			
Depth BGS	Elevation (m)	Stratigraphy		SCRIPTION OF AND BEDROCK	State	Type and Number	Recovery	OVC	Penetration Index / RQD	□ Cu S ▲	Dyr J She J She Ser She Poo	ear Str ear Str ear Str sitivity ear Str cket Po	Cone s rength rength y Valu rength enetro	sample based based e of So based meter	on Fie on Lat il on	o Van	e
meters	66.42		GR	OUND SURFACE			%	ppm	Ν	10 5	SCA	LE FC		ST RES 150kPa 60	ULTS	Pa	
_	66.2		TOPSOIL-Silty sand w	th organics (grass), very loose, proximately 0.18 m thick)	Ā	SS1	7/24		4								
0.5				organics, loose, dark brown,		SS1	5/20		4 22	•					$\left \right $		
= 1.0	65.3	¥XX	[_] ∖*Auger refusal at 1.1 m	, continued with rock coring		332	5/20		22								
- 1.5				athered and fractured, poor		RC1	25/25	5	30								
2.0			*Becoming excellent			-											
- 2.5						RC2	47/47		96		_				\square		
3.0	63.5		Developerated at a			_									\square		
3.5			Borenole ended at a	pproximately 2.9 m in limestone											\square		
																	_
- 4.0																	
4.5																	
Ē											_				\square		
- 5.0											_				\vdash		
5.5																	
6.0																	
=																	
6.5											_				\vdash		
															\vdash		
7.5																	
8.5 9.0 9.5															$\left \right $		
																	_
8.5																	
9.0																	
												$\left \right $	_	_	$\left - \right $	-+	_
												$\left \right $		+	$\left \right $	-	_
10.0													+	\top	\square	+	_
_ 10.5																	
	5:																
б																	

REFER		o.:	11140575-E3	-							ENCLO	DSUR	E No.	:		7	
				BOREHOLE No.:	BH7	-17						BOI	REF	IOL	EL	OG	
		G	HD	ELEVATION:	66.3	8 m								1			,
														GEN			
			Community Housing Corp chnical Investigation								🔀 ss		Spoor	1	-		
	-		Gladstone Avenue, Ottaw								🚺 GS						
				rt CHECKED BY:							⊻ 		er Leve				
				DATE (FINISH):							°			ent (%) mits (%	.)		
	CALE			RATIGRAPHY				/IPLE I			• N • N	Pene Split	etratior Spoor	Index sampl Index I	based e		
Depth	levation (m)	aphy	DES	SCRIPTION OF		0	and oer	'ery	0	ation RQD	Δ Cι	Dyna Shea	amic Co ar Strei	one san	nple ised or	n Field	d Vane
BGS	Eleva (m	Stratigraphy		AND BEDROCK	ė	State	Type and Number	Recovery	OVC	Penetration Index / RQD	S ▲	Sens Shea	sitivity ' ar Strei	Value o ngth ba	of Soil ised or		vane
meters	66.38		GRO	OUND SURFACE				%	ppm	N	5 10	SCAL	E FOR	TEST a 150 50 6	RESU	LTS 200kF	² a
-	66.3		TOPSOIL-Silty sand w	ith organics (grass), very loose proximately 0.1 m thick)	э, г		SS1	12/20	1	10		20 30		50 6			
0.5	65.7		FILL-Sand some grave	el. loose, light brown, moist.	/			,									
E 1.0	03.7			n, continued with rock coring athered and fractured, poor	_/T	F	RC1	14/19	1	29			_	_		\rightarrow	
			quality.	allered and fractured, poor	ŀ	H F	RC2	15/15		40			_		$\left - \right $	+	
- 1.5			*Becoming excellent		ŀ								+			+	
2.0																+	
2.5						F	RC3	57/56	i	93							
- 2.5													_			_	
- 3.0	63.4		Borehole ended at a	pproximately 2.9 m in limestor	ne								+	_		-	
- 3.5																	
4.0																_	
													_		\square	_	
4.5													-			_	
5.0																	
5.5																_	
6.0																_	_
6.5															\square	_	
7.0																	
7.5													_		\square	_	
																_	
																	_
																_	
																_	
BOREHOLE LOG 111406775-E3-BH LOGS.GPJ INSPEC_SOL.GDT 775/19 0.0 11140775-E3-BH LOGS.GPJ INSPEC_SOL.GDT 775/19 0.0 1140775-E3-BH LOGS.GPJ INSP												+	_	_	$\left \right $	+	+
^{10.5}																	
S NOTES	S:																
REHC																	
BC																	

REFEF	RENCE No	o.:	11140575-E3	_						ENC	LOS	URE N	lo.:			8	
				BOREHOLE No.:	BH8	-17					В	ORE	ΞНα	OI F	= 1 (OG	
		G	HD	ELEVATION:	65.37	7 m						Page:					
		town												END			
			Community Housing Corr									Split Sp					
	-		Gladstone Avenue, Ottav	va. Ontario								Auger S Shelby T		9			
				rt CHECKED BY:		S. V	Vallis			Ţ	١	Nater L	evel				
				DATE (FINISH):						° H		Nater co Atterber		• •			
SC	CALE		STI	RATIGRAPHY		SA	MPLE	DATA		•	S N F	Penetra Split Sp Penetrat	oon s ion In	ample dex ba	ased o		
Depth BGS	Elevation (m)	Stratigraphy		SCRIPTION OF AND BEDROCK	Ctoto Ctoto	Type and Number	Recovery	OVC	Penetration Index / RQD	∆ □ S	Cu S Cu S F	Dynamic Shear S Shear S Sensitiv Shear S Pocket F	treng treng ity Va treng Penet	th bas th bas lue of th bas romete	ed on ed on Soil ed on er	Lab '	Vane
meters	65.37		GR	OUND SURFACE			%	ppm	Ν	10	50kP	CALE F a 10 <u>30</u>	OR T DkPa	EST F 150k	RESUL	_TS 200kP 80	a 90
_	65.2	$\times \frac{1}{2}$	TOPSOIL- Silty sand w \brown, moist. (Approxi	ith organics (grass), loose, dat	rk	SS1	10/24		4								
- 0.5		\bigotimes		loose, dark brown, moist.	— / [10/24		4						\square		_
E 1.0	04.0	\bigotimes				ss2	6/24		10						_	_	
	64.3		FILL-Gravel some san greyish brown, damp.	d trace silt and clay, loose,	/										+	_	
= 1.5		\bigotimes	greyish brown, damp.			SS3	3/24		34			•				+	
= 2.0		\bigotimes			ĥ	ss4	3/18								-		
Ē	63.1		CONCRETE		— K	334	5/10									1	
2.5	62.8			athered and fractured, poor		RC1	12/24		25								
- 3.0			quality. *Becoming good		-										\square		
Ê			Becoming good			RC2	39/39	•	82			_			+	_	_
- 3.5												_			+	+	_
- 4.0	61.5		Borehole ended at a	pproximately 3.9 m in limestor	ne										-	+	
4.5																	
E																	
5.0																	
5.5															\rightarrow		_
E															_	_	
6.0																+	
6.5																	
1111002563-BH LOGS (BN INSPEC SOL (BT 7/6/19 0.0 0.7 0.7 0.7 0.7 0.7 0.7 0.7 0.7 0.7										$\left - \right $	_				+	+	+
BOREHOLE LOG 11140575-E3-BH LOGS GPJ INSPEC_SOL GDT 7/5/19 0.0 0.0 0.0 0.0 0.0 0.0 0.0 0.0 0.0 0.0															\mp	+	\mp
8.0																	
															_	-	_
8:69 9.0																	+
9.5												_			\square		_
										$\left - \right $					+	+	
															\mp	+	1
- 9 − 10.5 10.5	 S:																
	-																
BORE																	
ш с																	

REFERENC	E No.: _	11140575-E3									ENCLC	SUR	REN	0.: _				
			BOR	EHOLE No.:	MW	4- 1	9					во	RE	но	LE	LO	G	
	G	HD	ELEV	ATION:	65.6	6 I	m									_1		
	Ottown	Community Housing Corr												EGE				
		technical Investigation									🔀 ss							
		Gladstone Avenue, Ottav									I GS I ST							
		R. Vandentillaa					J. Ben	nett			₹ °		er Le					
DATE (S	TART):	16 April 2019		_ DATE (FINISH):			16 Apri	201	9		\square	Atte	rberg	ntent (9 limits	(%)			
SCALE		STRATIGRAPHY		MONITOR WELL			SAM	1PLE	DATA		• N • N	Spli [.] Pen	t Spoo etratio	on Inde on san on Inde Cone s	nple ex base	ed on		
Depth BGS BGS	(m) Stratigraphy	DESCRIPTION SOIL AND BEDR				State	Type and Number	Recovery	OVC	Penetration Index / RQD	S ▲	She She Sen She Poc	ar Str ar Str sitivity ar Str ket Pe	rength rength y Value rength enetro	based based e of So based meter	l on Fie l on La bil l on		
meters 65.	66	GROUND SURF						%	ppm	Ν	50 10	SCAL 0kPa 20 3	_E FC 100	OR TES	ST RE 150kPa 60	SULTS 200 70 8	S ikPa 1 <u>0 9</u> i	0
0.5		FILL- Sand, brown, me *Becoming Sand and g grey *Auger refusal at 0.86	gravel,	0.12-0.30-												<u> </u>		
1.0	.8 42	continued with rock contin	ring	Bentonite +			RC1	100		56						<u> </u>		
- 1.5		and fractured, poor to f quality, medium strong moderately close, close	fair , close to	1.78 — Riser —			RC2	100		48						+		
2.0 2.5		gapped joints, some fossiliferous beds throu 10 mm thick infilled sea	ughout	2.08-														
3.0		mbgs *Becoming good qualit		Sand —														
3.5		-		WL 3.30 — 05/02/2019 Screen —	Y		RC3	100		80						+		
4.0																		
4.5							RC4	100		87								
5.0 60	.5	Borehole ended	lat	5.13 -												<u> </u>		
5.5		approximately 5.1 limestone														+		
5.5 6.0																+		
6.5																		
.0 ₽																+		
																-		
BOREHOLE LOG 11140575-E3-BH LOGS GPU INSPEC_SOL.GDT 7/5/19 0.0 0.0 0.0 0.0 0.0 0.0 0.0 0.0 0.0 0.0																		
0⊔ 8.5 ≅																+		
9.0																		
9.5																+		
													\vdash			+		
9.5 1114022-63-63-61 10.0 10.5																\mp		
00 NOTES:																		
EHOLE																		
BOR																		

REFER		o.:	11140575-E3									ENCLO	DSUF	RE N	0.: _		1	10	
				BORI	EHOLE No.:	MW	5-19)					во	RE	HC	LE	EL(DG	i
		G		ELEV	ATION:	66.0)6 m										f _1		
CLIF		tawa (Community Housing Corp	oration											EG	END	,		
												Steel Steel							
	-		Gladstone Avenue, Ottaw																
			R. Vandentillaa					J. Ber	nnett			Ţ	Wa	ter Le	vel				
DAT	E (STAR	T):	16 April 2019		DATE (FINISH):		1	6 Apri	il 201	9		°	Atte	erberg	ntent (limits	(%)			
SC	ALE		STRATIGRAPHY		MONITOR WELL			SAM	MPLE	DATA		• N • N	Spli	t Spo	on sa	mple	ased o		
Depth BGS	Elevation (m)	Stratigraphy	DESCRIPTION SOIL AND BEDR				State	Type and Number	Recovery	OVC	Penetration Index / RQD	≙ Ըւ □ Ըւ Տ ▲	Dyr J She Ser She Poo	amic ear Str ear Str sitivit ear Str ket P	Cone rength rength y Valu rength enetro	samp base base e of \$ base omete	ed on ed on Soil ed on er	Field Lab \	
meters	66.06		GROUND SURF	-					%	ppm	Ν	10 5	SCA ^{j0kPa}	LE FC 100	DR IE kPa <u>0 5</u> 0	150kF 60	2801	15 200kP <u>80</u>	a 90
0.5			FILL- Sand, brown, mo	bist	0.15— 0.30—													_	
- 1.0	64.8		*Becoming Sand and g grey, damp *Auger refusal at 1.22 i	Г														+	
2.0			LIMESTONE - shale laminations, grey, weat	ing	Riser — 💌			RC1	91		66		-				+	+	
2.5			and fractured, fair qual medium strong, close t moderatly close, closed	ity, o													_	+	
3.0			gapped joints, some fossiliferous beds starti mbgs		Bentonite												_	+	
3.5			*Becoming good quality	У				RC2	100		76								
4.0																			
4.0			*Becoming excellent qu	uality													_	+	
5.0					WL 4.60 — 05/02/2019			RC3	100		98						_		
5.5																	_	+	_
6.0			*Becoming good qualit	y	6.02 — Sand — 6.32 —												_	_	
6.5								RC4	100		83							_	
			*Becoming excellent qu	uality												+	-	+	
					Screen			RC5	100		97						_	+	
																+	+	+	+
5.5 6.0 6.5 7.0 6.5 7.0 7.5 8.0 8.5 8.5 9.0 9.5 9.0 9.5								RC6	100		94						+	+	+
9.5									.00		54								
	56.1		Borehole ended	at	9.98 —		 ∎										\square	\square	
⁸ 			approximately 10.0 limestone										_				+	+	_
NOTES	S:		intestone																
RIGHT T.5 RIGHT T.5																			

BOREHOLE No: MW6-19 (ELVATION: BOREHOLE No: MW6-19 (a.5.4 m) BOREHOLE LOS CUENT: Ottawa Gommuthy Housing Corporation G.5.4 m Page: I all Good Apple Struck (Struck (REFER	RENCE N	o.:	11140575-E3									ENCLC	SUR	E N	o.: _		11		
ELEVATION: 66.54 m Page: 1 0 1 0 1 0 1 0 1 0 1 0 1 0 1 0 1 0					BORI	EHOLE No.:	MW	6-1	9					во	RE	но	LE	LO	G	
CLIENT: Ottawa Community Housing Corporation PROJECT: Geotechnical Investigation LOCATION: B11 Gladstone Avenue, Ottawa, Ontario DESCRIBED BY: R. Vandentillaart CHERKTART: 16 April 2019 DATE (STRAT): 16 April 2019 Depth			G		ELEV	ATION:	66.5	4 r	n											
PROJECT: Geotechnical Investigation LOCATION: B11 Gladstone Avenue, Ottawa, Ontario DESCRIBED BY: R. Vandentillaart CHECKED BY: J. Bennett DATE (START): 16 April 2019 DATE (FINISH): 16 April 2019 SCALE STRATIGRAPHY MONITOR SAMELE DATA Depth § © © © © © © © © © © © © ©			towo		oration															
LOCATION: 811 Gladstone Avenue; Ottawa, Ontario DESCRIBED BY: R. Vandentiliaar CHECKED BY: J. Bennett DATE (START): 16 April 2019 DATE (FINISH): 16 April 2019 SCALE STRATIGRAPHY MMINICR SAMPLE DATA Depth 50/200 500 DESCRIPTION OF BGS 500 DESCRIPTION OF SOIL AND BEDROCK THL-Sand, brown, moist DESCRIPTION OF SOIL AND BEDROCK Besoming Sand and gravel, grey, damp 0.10 56 1.0 65.5 'Auger refusal at 1.1 m, grey, damp 1.0 65.5 'Auger refusal at 1.1 m, grey, damp 3.0 'Auger refusal at 1.1 m, grey, damp Scale for the damp 3.0 'State for the damp Scale for the damp 3.0 'State for the damp Scale for the damp 3.0 'State for the damp Scale for the damp 3.0 'State for the damp Scale for the damp 3.0 'State for the damp Scale for the damp 3.0 'State for the damp Scale for the damp 3.0 'State for the damp Scale for the damp				· · · ·																
DESCRIBED BY: R. Vandentillaart CHECKED BY: J. Bennett DATE (START): 16 April 2019 DATE (FINISH): 16 April 2019 SCALE STRATIGRAPHY MONITOR SAMPLE DATA Depth 50/2 (E) 0 50/2 (E) 0																				
DATE (START): 16 April 2019 DATE (FINISH): 16 April 2019									J. Ben	nett			Ţ	Wat	er Le	vel				
SCALE STRATIGRAPHY MONITOR WELL SAMPLE DATA Split Spon sample Depth 50 80 80 80 80 80 80 80 80 80 80 80 80 80	DAT	TE (STAR	T): _	16 April 2019		DATE (FINISH):			16 Apri	201	9		—	Atte	rberg	limits	(%)			
Depth BGS B B BC DESCRIPTION OF SOIL AND BEDROCK DESCRIPTION OF SOIL AND BEDROCK Accusses Beam Accusses Beam<	SC	CALE		STRATIGRAPHY					SAM	1PLE				Split Pen	t Spor etratio	on san on Inde	nple ex base	ed on		
0.5 FIL-Sand, brown, moist 98coming Sand and gravel, grey, damp 1.0 65.5 *Auger refusal at 1.1 m, ontinued with rock coring 1.5 LIMESTONE - shale laminations, grey, weathered and fractured, poor to fair quality, medium strong, close to moderately close, closed to gapped joints 3.0 Sub-horizontal bedding from 2.0 3.0 Sub-horizontal bedding from 2.0 4.0 Screen 4.0 Screen 4.0 Borehole ended at approximately 5.1 m in limestone 6.0 6.5 7.0 Borehole ended at approximately 5.1 m in limestone		Elevation (m)	Stratigraphy					State	Type and Number	Recovery	OVC	Penetration Index / RQD	S ▲	She She Sen She Poc	ar Str ar Str sitivity ar Str ket Pe	ength ength Valu ength enetro	based based e of So based meter	on Fie on La oil on		
0.5 FIL-Sand, brown, moist 98coming Sand and gravel, grey, damp 1.0 65.5 *Auger refusal at 1.1 m, ontinued with rock coring 1.5 LIMESTONE - shale laminations, grey, weathered and fractured, poor to fair quality, medium strong, close to moderately close, closed to gapped joints 3.0 Sub-horizontal bedding from 2.0 3.0 Sub-horizontal bedding from 2.0 4.0 Screen 4.0 Screen 4.0 Borehole ended at approximately 5.1 m in limestone 6.0 6.5 7.0 Borehole ended at approximately 5.1 m in limestone	meters	66.54			-					%	ppm	Ν	50 1 <u>0</u>	SCAL ^{)kPa} 20 3	E FC 1004	R TE:	ST RE 150kPa <u>60</u>	SULTS 200 70 8	S lkPa 1 <u>09</u>	0
1.5 LIMESTONE - shale 1.5 LIMESTONE - shale 1.6 Iminations, grey, weathered and fractured, poor to fair 1.78 quality, medium strong, close to moderately close, closed to gapped joints Sub-horizontal bedding from 2.0 3.0 Becoming good quality 3.5 Screen 4.0 Screen 4.5 Screen 5.0 61.4 Borehole ended at approximately 5.1 m in limestone 6.0 6.5 7.0	E	65.5		*Becoming Sand and g grey, damp ^ *Auger refusal at 1.1 m	ravel,															
2.5 gaped joints 3.0 Sub-horizontal bedding from 2.0 3.5 Becoming good quality 3.5 Screen 4.0 Screen 4.5 Screen 5.0 61.4 Borehole ended at approximately 5.1 m in limestone 6.0 Screen				LIMESTONE - shale laminations, grey, weat and fractured, poor to f	hered	05/02/2019 1.78 — Riser			RC1	100		56								
3.5 4.0 4.5 5.0 61.4 Borehole ended at approximately 5.1 m in limestone 6.0 6.5 7.0 6.5				moderately close, close gapped joints Sub-horizontal bedding to 2.4 mbgs	ed to 1 from 2.0															
4.5 5.0 61.4 Borehole ended at approximately 5.1 m in limestone 5.13- RC3 100 73 73 73 73 73 73 73 73 73 100 <t< td=""><td>E</td><td></td><td></td><td>Doorning good quant</td><td>,</td><td>Screen</td><td></td><td></td><td>RC2</td><td>100</td><td></td><td>86</td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></t<>	E			Doorning good quant	,	Screen			RC2	100		86								
5.0 61.4 Borehole ended at approximately 5.1 m in limestone 6.0 6.5 7.0																				
5.5 approximately 5.1 m in limestone 6.0 6.5 7.0		61.4				5 13-			RC3	100		73								
6.0 6.5 7.0	5.5	0111		approximately 5.1		0.10						-								
	6.0			limestone																
	6.5																			
																	+	+		
8.0 8.5 9.0 10.0 <t< td=""><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></t<>																				
8.5 9.0 9.5 10.0 10.5																				
9.0 9.5 9.5 10.0 10.5														$\left \right $		-+	+	+		
	S.GP																			
																		\perp		
	9.5 9.5															_	+	-		
	0.01												_	$\left \right $		-+	+	+		
Ōluozzo	E 10.5															+	+	+		
	NOTES BOREHOLE LOC	3:					1					·				1				



Notes on Borehole and Test Pit Reports

Soil description :

Each subsurface stratum is described using the following terminology. The relative density of granular soils is determined by the Standard Penetration Index ("N" value), while the consistency of clayey sols is measured by the value of undrained shear strength (Cu).

Clay	Classification < 0.002 mm	(Unified system)		Termino	logy	
Silt	0.002 to 0.075 mm			"trace"	1-10%	
Sand	0.075 to 4.75 mm	fine 0.075 to 4.25 mm		"some"	10-20%	
		medium 0.425 to 2.0 mm		adjective (silty, sand	•	
		coarse 2.0 to 4.75 mm		"and"	35-50%	
Gravel	4.75 to 75 mm	fine 4.75 to 19 mm coarse 19 to 75 mm				
Cobbles Boulders	75 to 300 mm >300 mm					
	ve density of nular soils	Standard penetration index "N" value		Consistency of cohesive soils	Undraine strengt	
		(BLOWS/ft - 300 mm)			(P.S.F)	(kPa)
				Very soft	<250	<12
V	ery loose	0-4		Soft	250-500	12-25
	Loose	4-10		Firm	500-1000	25-50
0	Compact	10-30		Stiff	1000-2000	50-100
	Dense	30-50		Very stiff	2000-4000	100-200
Ve	ery dense	>50		Hard	>4000	>200
	Rock quality	designation] [STRATIGRAP	HIC LEGEND	
"RQI	D" (%) Value	Quality				<u>п т п</u>
	<25	Very poor			00	
	25-50	Poor	<u>10000</u>		Cobbles& boulders	
	50-75	Fair	Sa	nd Clavel	Cobbiesa boulders	Bedrock
	75-90	Good			$\sim \sim$	×××××
	>90	Excellent				
			S	ilt Clay	Organic soil	Fill
SS: Split spoon SSE, GSE, AGE Recovery	nple recovered is shown o		nelby tube ston sample (Osterberg)	A R G	G: Auger IC: Rock core IS: Grab sample	
RQD				·····		
	lity Designation" or "RQD	" value, expressed as percentage, is th	ne ratio of the total length of	f all core fragments of 4 inche	es (10 cm) or more to th	ne total length
IN-SITU TEST	TS:					
N: Standard per R: Refusal to pe			N _c : Dynamic cone pen Cu: Undrained shea Pr: Pressure r	ar strength	k: Permeat ABS: Absorption (F	
LABORATOR	RY TESTS:					
I · Plasticity inde	a v	H: Hydrometer analysis	A: Atterberg limits	C: Consolidat	ion	O.V.: Organio
I _p : Plasticity inde W _I : Liquid limit	5	H: Hydrometer analysis GSA: Grain size analysis	A: Atterberg limits w: Water content	CS: Swedish		vapor
Wp: Plastic limit	t	Co. a oran oleo unuiyolo	γ: Unit weight	CHEM: Chem		
			, -0-			

GHD PS-020.01-IA- Notes on Borehole and Test Pit Reports - Rev. 0 - 07/01/2015

Appendix B MASW Test Results

Apendix B

GHD

Summary of Shear Wave Velocity Measurements Seismic Site Class Determination Biomethane Processing Facility Enbridge Gas Distribution Inc. 35 Vanley Crescent, Toronto, Ontario

			Line 1						Line 2		
ayer No.	Depth (r	n bgs)	Thickness	Vs	d _i /V _{si}	Layer No.	Depth (r	n bgs)	Thickness	Vs	d _i /V _{si}
ayer NO.	From	То	m	m/s	u _i / v _{si}	Layer NO.	From	То	m	m/s	u _i / v _{si}
1	1.5	1.6	0.1	1194	0.0001	1	1.5	1.6	0.1	1321	0.0000
2	1.6	3.7	2.1	1943	0.0011	2	1.6	3.5	1.9	1746	0.0011
3	3.7	6.3	2.6	2066	0.0012	3	3.5	5.9	2.4	2126	0.0011
4	6.3	9.5	3.2	1875	0.0017	4	5.9	9.0	3.0	1941	0.0016
5	9.5	13.5	4.0	895	0.0045	5	9.0	12.7	3.8	931	0.0041
6	13.5	18.5	5.0	2033	0.0025	6	12.7	17.5	4.7	1247	0.0038
7	18.5	24.7	6.3	2767	0.0023	7	17.5	23.4	5.9	2762	0.0021
8	24.7	31.5	6.8	3180	0.0021	8	23.4	30.8	7.4	3520	0.0021
						9	30.8	31.5	0.7	3917	0.0002
	Total		30.0		0.0155		Total		30.0		0.0162
Avera	no Shoar W		ity Along the	l ine (m/s)	1941	Δυστο	no Shoar W		ity Along the	ino (m/c)	1857

Average VS₃₀ =

Recommended Site Class:

Subjected to Code requirements

m/s

1899

Α


Notes:

1 - The Seismic Site class is recommended in accordance to Table 4.1.8.4.A of the National Building code of Canada 2010 and based on the lowest measured average shear wave velocity measured along the investigated lines.

2 - VS30 is calculated based on the average shear wave velocity below the proposed founding elevation.

3 - Site Classes A and B are only applicable if footings are founded on bedrock or there is no more than 3.0 m of soil between founding elevation and bedrock.

4 - The recommended site class is only applicable if site conditions for Site Class F (liquefiable soil/soft soil layers more than 3.0 m thick) are not applicable.

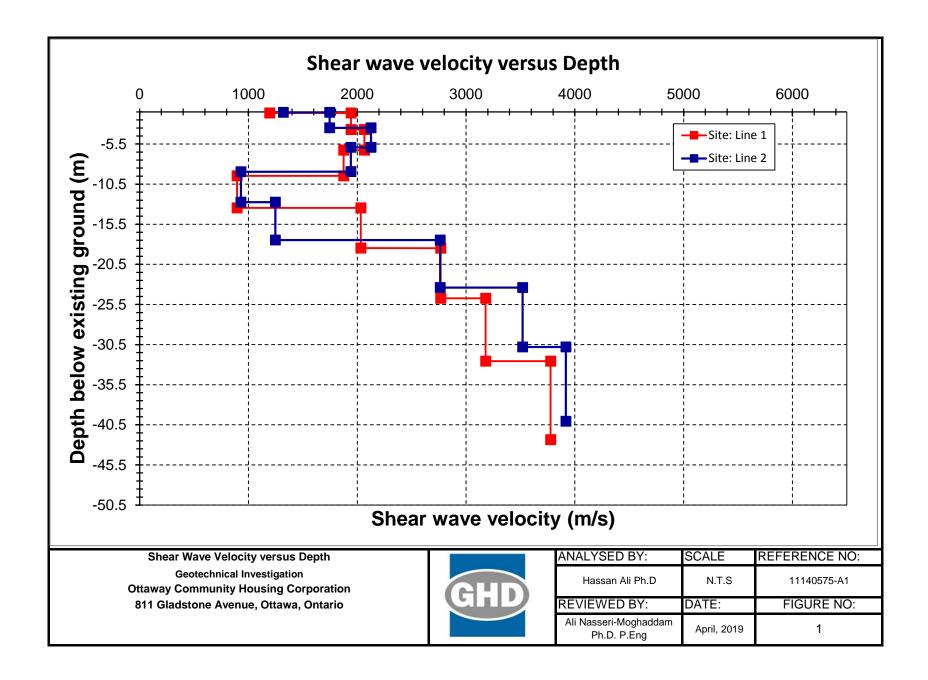



about GHD

GHD is one of the world's leading professional services companies operating in the global markets of water, energy and resources, environment, property and buildings, and transportation. We provide engineering, environmental, and construction services to private and public sector clients.

Ryan Vanden Tillaart Ryan.VandenTillaart@ghd.com 613.727.0510

Joseph Bennett Joseph.B.Bennett@ghd.com 613.727.0510

www.ghd.com