

REPORT

Phase One Environmental Site Assessment

411, 415, 419, 423, 425 & 431 Ravenhill Avenue, 566, 570 & 576 Byron Avenue, and 436 & 440 Roosevelt Avenue, Ottawa, Ontario


Submitted to:

Antilia Homes

326 Churchill Avenue Ottawa, Ontario K1Z 5B9

Submitted by:

Golder Associates Ltd.

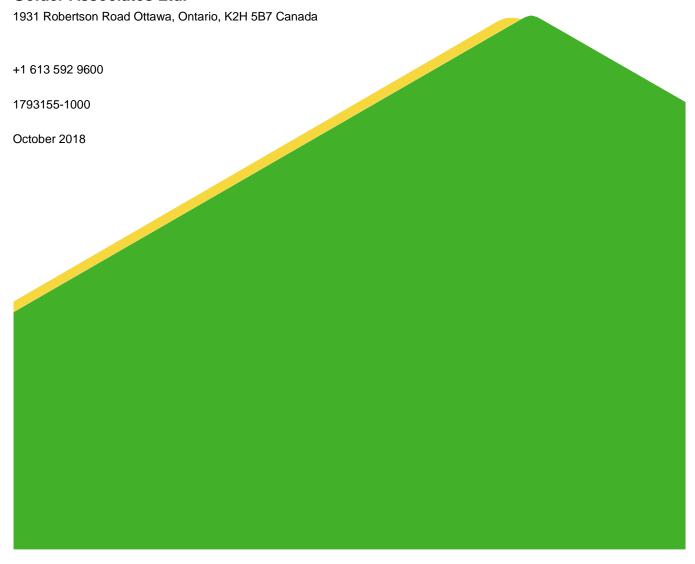

Distribution List

1 e-copy Antilia Homes

5 copies NOVATECH Engineers, Planners & Landscape Architects

1 e-copy Golder Associates Ltd.



į

Executive Summary

The Executive Summary highlights key points from the report only; for complete information and findings, as well as the limitations, the reader should examine the complete report.

Golder Associates Ltd. (Golder) was retained by the Client to conduct a Phase One Environmental Site Assessment (Phase One ESA) of a parcel of land consisting of multiple municipal addresses including 411, 415., 419, 423, 425 & 431 Ravenhill Avenue, 566, 570 & 576 Byron Avenue, and 436 & 440 Roosevelt Avenue in Ottawa, Ontario (the "Site" or "Phase One Property"). The Site location is provided on Figure 1. A Site plan is provided on Figure 2.

The Site currently consists of multiple municipal addresses with different owners and consists of mostly residential land uses with one commercial property as shown in table below.

The primary objective of the Phase One ESA was to identify, insofar as possible based on readily available information and without an intrusive investigation, former or current practices at the Site that may represent issues of actual or potential environmental concern. Golder understands that this Phase One ESA will be used for rezoning application with the City of Ottawa.

The Phase One ESA was completed in general accordance with Ontario Regulation 153/04 for the purpose of identifying actual and potential contamination at the Site. The Phase One ESA was not completed to support any potential future Record of Site Condition. Authorization to proceed with this investigation was received Mr. Ravi Shanghavi (President) of Antilia Homes on December 18, 2017 for 411, 415., 419, 423 & 425 Ravenhill Avenue, 566, 570 & 576 Byron Avenue, and 436 & 440 Roosevelt Avenue. Authorization to include 431 Ravenhill Avenue was provided by Mr. Shanghavi on August 29, 2018 (hereafter referred to as the "additional Site property"). This report contains the methodology and findings of the Phase I ESA. This Executive Summary should be read in conjunction with the complete Phase One ESA report.

During the Site visit, a heating oil aboveground storage tank (AST) (909L capacity) was observed on the exterior of the southwest corner of the commercial building on 566 Byron Avenue. The AST was installed in 2014 on a concrete pad and based on limited (due to snow cover on ground) visual observation, no evidence of stains or spills were observed in the vicinity of the AST; however, observations made during the follow-up Site visit did not indicate any evidence of stains or spills from this AST. In addition, no information about historical spills or leaks from this AST was available. As such, presence of this AST on-Site is considered a PCA; however, for the purposes of city re-zoning application is not considered to represent an APEC on the Site.

During the follow-up Site visit, an AST (620 L double walled non-metallic tank manufactured in 2017) for furnace oil storage was observed on the concrete basement floor of 431 Ravenhill Avenue. This AST appeared to be in good condition, consisted of a drip-tray and was located on concrete floor in good condition with no cracks in the vicinity of the AST; however, no information about use and/or removal of previous ASTs at this property were available. Although concrete floor near this AST appeared to be in good condition and no evidence of stains or spills were observed anywhere else in the basement of 431 Ravenhill Avenue, there is possibility of potential historical leaks and spills from previous ASTs and hence presence of this AST on-Site is considered a PCA. Since the property addressed 431 Ravenhill Avenue will be redeveloped as a multi-tenant residence, as indicated by the Site Representative, it will require excavation below current basement level which will indicate any impacted soil, if present. In addition, excavation for redevelopment purposes will also remove presence of any impacted soil from the Site. As such, presence of this AST on-Site is a PCA for the Site; however, it is not considered to represent an APEC on the Site.

Based on the information obtained as part of this Phase One ESA, none of the identified PCAs were considered to represent an APEC for the Site and a Phase Two ESA is not recommended.



Table of Contents

EXE	CUTIV	E SUMMARY	ii
1.0	INTR	ODUCTION	1
	1.1	Phase One Property Information	1
2.0	SCOF	PE OF INVESTIGATION	2
	2.1	General	3
	2.1.1	Phase One Study Area Determination	3
	2.1.2	First Developed Use Determination	3
	2.1.3	Fire Insurance Plans	3
	2.1.4	Chain of Title	3
	2.1.5	City Directories	4
	2.1.6	Environmental Reports	4
	2.2	Environmental Source Information	4
	2.2.1	Ministry of the Environment and Climate Change	4
	2.2.2	City of Ottawa	4
	2.2.3	Technical Standards and Safety Authority, Fuel Safety Division Records	5
	2.3	Physical Setting Sources	5
	2.3.1	Aerial Photographs	5
	2.3.2	Topography, Hydrology and Geology	7
	2.3.3	Fill Materials	8
	2.3.4	Water Bodies and Areas of Natural Significance	8
	2.3.5	Well Records	8
	2.4	Site Operating Records	9
3.0	INTE	RVIEWS	9
4.0	SITE	RECONNAISSANCE	9
	4.1	General Requirements	9
	4.2	Specific Observations at Phase One Property	9
	4.2.1	Enhanced Investigation Property	14



	4.3	Surrounding Land Use	14
	4.4	Written Description of Investigation	14
5.0	REVIE	EW AND EVALUATION OF INFORMATION	15
	5.1	Current and Past Uses of the Site	15
	5.2	Potentially Contaminating Activity	16
	5.3	Areas of Potential Environmental Concern	18
	5.4	Conceptual Site Model	18
	5.4.1	Uncertainty and Absence of Information	19
6.0	CONC	CLUSIONS	19
7.0	REFE	RENCES	20
8.0	LIMIT	ATIONS AND USE OF REPORT	21
9.0	CLOS	SURE	22

FIGURES

Figure 1: Key Plan

Figure 2: Site Plan

Figure 3: Topographic Map and Areas of Natural Significance

Figure 4: Surficial Geology

Figure 5: Bedrock Geology

Figure 6: Drift Thickness

Figure 7: Soil Survey Complex (Ontario Soils)

Figure 8: Physiography Map

APPENDICES

APPENDIX A

Regulatory Responses

APPENDIX B

EcoLog ERIS Report, City Directories

APPENDIX C

Site Photographs



1.0 INTRODUCTION

1.1 Phase One Property Information

Golder Associates Ltd. (Golder) was retained by the Client to conduct a Phase One Environmental Site Assessment (Phase One ESA) of a parcel of land consisting of multiple municipal addresses including 411, 415., 419, 423, 425 & 431Ravenhill Avenue, 566, 570 & 576 Byron Avenue, and 436 & 440 Roosevelt Avenue in Ottawa, Ontario (the "Site" or "Phase One Property"). The Site location is provided on Figure 1. A Site plan is provided on Figure 2.

The Site currently consists of multiple municipal addresses with different owners and consists of mostly residential land uses with one commercial property as shown in table below.

Address	Owned by	PIN	Description
411 Ravenhill Avenue	Caruso Investments Inc.	040090152	Residential apartment building
415 Ravenhill Avenue	Caruso Investments Inc.	040090151	Residential (redevelopment for residential apartment)
419 Ravenhill Avenue	Antilia Homes Corp.	040090149	Residential (redevelopment construction for residential apartment)
423 Ravenhill Avenue	Antilia Homes Corp.	040090150	Residential apartment building
425 Ravenhill Avenue	J & M Investment Ontario Inc.; JLG Development Inc.	040090017	Vacant (previously single-family residence)
431 Ravenhill Avenue	Wilson, Etta; Wilson, Gilbert	040090018	Single-Family Residence
566 Byron Avenue	Westboro Dental Centre Limited	040090025	Commercial (Dentist's Office)
570 Byron Avenue	Anderson, Josephine	040090024	Single-Family Residence
576 Byron Avenue	Falsetto Homes Inc.	040090023	Residential (redevelopment construction for residential apartment)
436 Roosevelt Avenue	Roca Land Holdings Inc.	040090026	Residential apartment building
440 Roosevelt Avenue	Lusk-Morin, Colleen	040090014	Single-Family Residence



Authorization to proceed with this investigation was received Mr. Ravi Shanghavi (President) of Antilia Homes on December 18, 2017 for 411, 415., 419, 423 & 425 Ravenhill Avenue, 566, 570 & 576 Byron Avenue, and 436 & 440 Roosevelt Avenue. Authorization to include 431 Ravenhill Avenue was provided by Mr. Shanghavi on August 29, 2018 (hereafter referred to as the "additional Site property"). The contact information for the Site is:

Client	Address	Contact Information
	326 Churchill Avenue	Mr. Ravi Shanghavi
Antilia Homes	Ottawa, Ontario	Cell: 613-261-3708
	K1Z 5B9	Email: ravi@antiliahomes.ca

2.0 SCOPE OF INVESTIGATION

A Phase One ESA is a preliminary qualitative assessment of the environmental condition of a property, based on a review of current activities and historical information for the Site and a review of relevant and readily available environmental information for the surrounding properties located within a 250 metre ("m") radius of the boundary of the Site (collectively referred to as the "Phase One Study Area"). The boundary of the Phase One Study Area is presented in Figure 2.

According to Ontario Regulation ("O.Reg.") 153/04 *Records of Site Condition*, the objectives of a Phase One ESA are to:

- 1) Develop a preliminary determination of the likelihood that one or more contaminants have affected any land or water on, in or under the Site;
- 2) Determine the need for a Phase Two Environment Site Assessment ("ESA");
- Provide a basis for carrying out a Phase Two ESA;
- 4) Provide adequate preliminary information about environmental conditions in the land or water on, in or under the Site for the conduct of a risk assessment following completion of a Phase Two ESA; and,
- 5) Identify and report on evidence of actual and/or potential contamination on the Site from current and historical activities at the Site or from adjacent properties.

Golder understands that this Phase One ESA will be used for re-zoning application with the City of Ottawa. In preparing this Phase I ESA, Golder has applied professional judgement in considering readily-available information and has relied in good faith on information provided by others. This level of effort is a method of risk reduction rather than risk elimination. This assessment included a cursory overview of the neighbouring land uses and does not constitute a complete assessment of neighbouring land uses. Further reductions in risk can be achieved through a program of intrusive testing at the Site, including sample collection and analysis.

Golder completed a Site visit on January 4, 2018 (hereafter referred to as the "initial Site visit") followed by a second Site visit on September 11, 2018 to visually inspect the additional Site property and note any materials changes to observation made at the time of the initial Site visit (hereafter referred to as the "follow-up Site visit").

2.1 General

2.1.1 Phase One Study Area Determination

For the purpose of this Phase One ESA, the Phase One Study Area is the area within a 250 m radius of the boundary of the Site. Based on Golder's review of the historical and current information compiled as part of this Phase One ESA for the area surrounding the Site and observations of neighbouring properties made during the Site visit, it was concluded that an assessment of information pertaining to properties within 250 m of the boundary of the Site was sufficient to achieve the objectives of the Phase One ESA.

2.1.2 First Developed Use Determination

The date of first developed use of the Phase One Property was determined based on review of the aerial photographs, fire insurance plans (FIPS), City of Ottawa HLUI and information provided by the Site representative. The Phase One Property was developed in 1920s for residential purposes. Therefore, primary land use for the Site since development has been residential with the one exception being the dental office at 566 Byron Avenue.

2.1.3 Fire Insurance Plans

A review of the FIP from 1956 was completed and is described below.

Phase One Property

1956: Site consisted of eight (8) residential homes with six detached car garages.

Surrounding Area

- 1956: the surrounding properties within the Phase One Study Area consists primarily of residential properties to the east, south and west sides with some commercial (auto repairs shops and printing shops) and community (churches and lawn bowling club) land uses. Properties to the north of the Site consists primarily of commercial land uses along Danforth Avenue and Richmond Road. Noteworthy commercial properties on the surrounding properties north and northeast of the Site are as follows:
 - An auto repair shop is located at 433 Roosevelt Avenue adjacent to the east of the Site (across Roosevelt Avenue);
 - An auto service garage with four associated fuel USTs is located at 424 Richmond Road, approximately
 60 m north of the Site;
 - A retail fuel outlet and autobody shop with six associated fuel USTs is located at 415 Richmond Road, approximately 100 m north of the Site;
 - Oil storage tanks is located at 382 Richmond Road, approximately 120 m northeast of the Site;

Based on the review of the FIPs, the former presence of automotive garages and retail fuel outlets with fuel USTs within the Phase One Study Area are off-Site PCAs, however are located downgradient or cross gradient to the Phase One Property with respect to groundwater flow and are also separated from the Site by roadways, as such are not considered to represent APECs to the Phase One Property.

2.1.4 Chain of Title

No chain of title was provided to Golder for review for this Phase I ESA.



2.1.5 City Directories

A significant amount of information for the Site and surrounding properties was obtained from the aerial photographs previously discussed and provided in the EcoLog ERIS report and the City of Ottawa Historical Land Use Inventory (HLUI) discussed in Sections 3.4 and 4.2, respectively. As such, street directories for the Site (with the exception of 566 Byron Avenue) and surrounding lands were not reviewed as they would not likely provide any further information.

A review of historical city directories for the years 1956, 1961, 1966, 1971, 1976, 1981-82, 1987, 1992, 1996-97, 2001-02, 2006-07, and 2011 was completed by ERIS (Appendix A) on behalf of Golder Associates for 566 Byron Avenue and indicates that 566 Byron Avenue has been used as Dental Office since 1961 (not listed in 1956).

2.1.6 Environmental Reports

No previous environmental reports related to the Phase One Study Area were available for review.

2.2 Environmental Source Information

2.2.1 Ministry of the Environment and Climate Change

The Ottawa District Office of the Ontario Ministry of the Environment and Climate Change ("MOECC") was asked to respond in writing to the following questions:

- Has the MOECC ever issued any approvals, permits or licences for the Site?
- Has the MOECC ever issued any control orders or violation notices with respect to the Site?

Responses from Jehanne Hurlbut (Administrative Assistant) of MOECC were received dated December 27, 2017 and September 26, 2018 which indicate that no active orders are outstanding for the Site. In addition, no Environmental Compliance Approvals (ECA) have been issued for the Site.

2.2.2 City of Ottawa

Golder completed a review of the City of Ottawa HLUI for the Site and surrounding area. Based on the review of the City of Ottawa HLUI, the noteworthy record for properties within 250 m of the Site are as follows:

- Retail fuel outlet at 372 Richmond Road between 1980 and 1994, located approximately 190 m northeast in a down and/or cross-gradient location;
- Retail fuel outlet at 415 Richmond Road, located approximately 100 m northeast in a down and/or cross-gradient location;
- Autobody repair shop located at 433 Roosevelt Avenue, adjacent to the east of the Site (across Roosevelt Avenue) in cross-gradient location;
- Commercial auto sales, servicing and repair shops on 382, 415, 416 and 424 Richmond Road (from 1940s to late 1990s) which consists of 10 USTs, located approximately 80 m to 130 m in a down and/or cross-gradient location;
- Palmer Cleaners (1980) at 384 Richmond Road, located approximately 130 m in a cross-gradient location;



Other commercial land uses included funeral services (2001 – present), plumbing and related mechanical work (2001), hardware and interior finishing work (1948-2005), agricultural supplies wholesale (2005); and,

Industrial properties consisted of activities including printing (1970-2001), hardware and office products (1930-2001) and rubber products (2001-2005):

The City of Ottawa HLUI review of the Site and surrounding area did not identify any on-Site PCAs; however, it did indicate off-Site PCAs related to former automotive garages and associated USTs located on Richmond Road and retail fuel outlets at 372 and 415 Richmond Road. Given the distance, underground infra-structure beneath roadways and hydraulically down/cross-gradient between the Site and above mentioned commercial/industrial land uses with respect to the Site, the likelihood of potential environmental concern for the Site is low and the off-site PCAs are not considered to contribute to APECs on the Site.

2.2.3 Technical Standards and Safety Authority, Fuel Safety Division Records

The Technical Standards & Safety Authority ("TSSA") Fuels Safety Division maintains records related to registered fuel storage tanks and other petroleum-related infrastructure. The TSSA was contacted on December 21, 2017 and on September 24, 2018 to identify whether any active, decommissioned, or in-service storage tanks were present on any of the municipal addresses associated with the Site, and to search for outstanding instructions, incident reports, spills, or contamination records.

Responses from TSSA on January 10, 2017 and September 25, 2018 indicated that the TSSA had no records of current or former fuel storage tanks in their database regarding the addresses provided. The responses from TSSA are included in Appendix B.

2.3 Physical Setting Sources

2.3.1 Aerial Photographs

Aerial photographs for 1928, 1958, 1965, 1976, 1999, 2002, 2005, 2007, 2008, 2011, 2014, 2015 and 2017 from the City of Ottawa geo-map (http://maps.ottawa.ca/geoOttawa/) were reviewed on-line. Golder selected aerial photographs based on availability and date intervals to help develop an understanding of the history of the development of the Phase One Property and Phase One Study Area. The information obtained from the aerial photographs was limited by the quality and scale of the available aerial photographs. The earliest aerial photograph available was from 1928.



Information obtained from the review of the aerial photographs is summarized in the following table:

Year	Site	Surrounding Area
	The Site is occupied by some building structures likely used for residential uses and vacant	North (across Byron Avenue): Primarily commercial buildings mainly located along Richmond Road and Danforth Avenue.
1928	land covered with trees in the northeast and southeast corners of the Site.	East (across Roosevelt Avenue): Primarily residential buildings with some commercial buildings.
		South (across Ravenhill Avenue): Primarily residential buildings with some community land uses (churches).
		West: Primarily residential buildings with a community land use (Highland Park Lawn Bowling Club).
	The Site is occupied by eight building structures likely used	North (across Byron Avenue): Similar to 1928 with increasing commercial developments.
	for residential purposes. Some of the residences consist of detached single car garages	East (across Roosevelt Avenue): Similar to 1928 with increasing residential and commercial developments.
1958	and grass covered front and backyards.	South (across Ravenhill Avenue): Similar to 1928 with increasing residential developments and two churches
	The dental office building at 566 Byron Avenue is first noted.	(Westminster Presbyterian Church and Highland Park Baptist Church).
		West: Similar to 1928 with increasing residential developments.
1965, 1976, 1999, 2002,	As per 1958.	North (across Byron Avenue): No major changes until 2011 when immediately adjacent properties were developed with residential apartments.
2005, 2008, 2011 and 2014		East (across Roosevelt Avenue): No major changes since 1958.
City of Ottawa geomaps		South (across Ravenhill Avenue): No major changes since 1958.
		West: No major changes since 1958.
2015	No significant changes with the	North (across Byron Avenue), East (across Roosevelt
City of Ottawa geomap	exception of 436 Roosevelt Avenue which is vacant land.	Avenue), South (across Ravenhill Avenue) and West: As per 2014.
2017	Construction of multi-tenant	North (across Byron Avenue), East (across Roosevelt
City of Ottawa geomap	residential homes on 436 Roosevelt Avenue, 415 and 419 Ravenhill Avenue.	Avenue), South (across Ravenhill Avenue) and West: No major changes since 2015.

Based on the aerial photographs, the Phase One Property appears to have been developed with eight building structures likely used for residential purposes in 1920s, some of which included detached single car garages. Additional residential developments on the Site is observed in 1958 aerial and it remains primarily unchanged till 2014, according to aerial photos from 1965, 1976, 1999, 2002, 2005, 2007, 2008 and 2011. Aerial photographs from 2015 and 2017 indicate re-developments of single-family homes into multi-tenant residences on 415 and 419 Ravenhill Avenue as well as 436 Roosevelt Avenue. The current commercial building housing the dental office at 566 Byron Avenue is first observed in 1958 which is consistent with the street directories.



The surrounding properties of the Site have been developed prior to 1928 and since development they have residential properties (east, south and west sides) and commercial properties that were mainly located along Richmond Road. Several retail fuel outlets and automotive garages were in operation on Richmond Road within Phase One Study Area from 1950s till early 2000s. The community land use in the form of Lawn Bowling Club is observed in the earliest available aerial photograph of 1928 and still remains in a similar footprint.

2.3.2 Topography, Hydrology and Geology

The following records were reviewed to identify topographic, geologic and hydrogeological conditions at the Site. A topographic map (Ontario Base Map) showing the Site and the Phase One Study Area and the location of any water bodies is provided in Figure 3. Additional information on Site features, as observed at the time of the Site visit, is provided in Section 6.

Topic	Conditions	Comment / Source
Topography of Site and Surrounding Area	The topography of the Site and surrounding area is sloped to the west.	Site and surrounding area observations and Figure 3 – Topographic Map and Areas of Natural Significance
Overburden Soils	Till: stone-poor, sandy silt to silty sand-textured till on Paleozoic terrain (<5 metres).	Bélanger, J. R. 2008 Urban Geology of the National Capital Area, Geological Survey of Canada, Open File 5311, 1 DVD.
Type of Bedrock	The Site primarily consists of Gull River Formation with limestone, with dolostone beds towards base with central portion consisting of Rockcliffe formation with sandstone, shale, limestone and dolostone.	Armstrong, D.K. and Dodge, J.E.P. 2007. Paleozoic Geology of Southern Ontario; Ontario Geological Survey, Miscellaneous Release – Data 219
Depth to Bedrock	The depth to bedrock is expected to be between 1 and 5 metres below ground surface (mbgs).	2010 Bélanger, J. R., Urban Geology of the National Capital Area, Geological Survey of Canada, Open File D3256, 2001
Inferred Near Surface Groundwater Flow	Local groundwater is anticipated to flow north towards the Ottawa River.	Site and surrounding area observations, Figure 1 – Key Plan and Figure 3 – Topographic Map and Areas of Natural Significance
Site Grade Relative to the Adjoining Properties	The Site appears to follow the topography of the area and inclines below the grade of the surrounding properties east of the Site, above the grade of the surrounding properties west of the Site and is generally at grade with surrounding properties north and south of the Site. During follow-up Site visit, 425 Ravenhill Avenue was excavated below grade for redevelopment purposes,	Site and surrounding area observations and Figure 3 – Topographic Map and Areas of Natural Significance
Depth to Groundwater	likely multi-tenant residential building. Not identified.	N/A



It should be noted that local groundwater flow may be influenced by underground utilities (i.e., service trenches) and building structures. For example, the gravel pack used around utilities, such as a water line, can act as interceptors and redirect groundwater flow along the direction of the pipe. If a more accurate description of geology, groundwater flow and groundwater quality is required, a subsurface investigation would be necessary.

2.3.3 Fill Materials

Topic	Conditions	Comment / Source
Fill Materials	No fill materials were observed or reported. No piles of fill material were observed on the Site. Fill material may have been used for construction purposes (backfill around residential building and parking lot sub-grade material). In addition, excavated property at 425 Ravenhill Avenue may have imported fill materials used for redevelopment purposes.	Site observations

2.3.4 Water Bodies and Areas of Natural Significance

Topic	Conditions	Comment / Source
Nearest Open Water Body	The nearest permanent watercourse is the Ottawa River located approximately 460 m northwest of the Site.	Site observations and Figure 1– Key Plan
Areas of Natural Significance	No areas of natural and scientific interest (ANSI) are known to be located on the Site or on the Phase One Study Area.	Figure 3 (Topographic Map and Areas of Natural Significance)

2.3.5 Well Records

Topic	Conditions	Comment / Source
Water Wells on Site (location, stratigraphy of the overburden, from ground surface to bedrock, depth to bedrock, depth to water table, drilling date, use)	No water wells were observed.	Site observations
Water Wells on the Neighbouring Properties (location, stratigraphy of the overburden, from ground surface to bedrock, depth to bedrock, depth to water table, drilling rate, use)	No water wells were observed.	Site observations



2.4 Site Operating Records

At the time of the Site visit, the Phase One Property was developed with residential buildings (single and multi-tenant), under-construction residential buildings and a commercial building (occupied by a Dentist's office). No Site operating records were provided to Golder for review.

3.0 INTERVIEWS

At the time of the Site visit, Golder conducted an interview with Mr. Ravi Shanghavi (President) of Antilia Homes (hereinafter referred to as the "Site Representative") to discuss information about the historical and current activities carried out on the Site.

Relevant information obtained during the interview and Site visit is provided in Section 6.0.

4.0 SITE RECONNAISSANCE

4.1 General Requirements

On behalf of Golder, Mr. Shihan Chowdhury visited the Site on January 4, 2018 and September 11, 2018 and on both occasions was accompanied Mr. Ravi Shanghavi of Antilia Homes (Site Representative). The Site visit consisted of a walk-around the Site along with a cursory inspection of surrounding properties from the Site and publicly accessible areas. Access to the interior of the buildings was only available for 431 Ravenhill Avenue (single-family home) and basement units of 411 and 423 Ravenhill Avenue (both multi-tenant residences); with information regarding the remaining interiors based on information provided from the Site Representative. The weather condition during initial Site visit was cloudy with a temperature of -10°C where as weather during follow-up Site visit was clear and 20°C. The Site consisted of all single-family and/or multi-tenant residential buildings with the exception of 566 Byron avenue which was occupied by a commercial property (a dentist's office).

Photographs of relevant features noted during the Site visit are provided in Appendix C.

4.2 Specific Observations at Phase One Property

The specific observations made during the Site visit are presented in the following sections.

Topic	Observations	Source
	411 Ravenhill Ave.: A three-storied multi-tenant residential building with one basement level observed on both Site visits (January 4 and September 11, 2018).	
Structures Number, Age and General Description of Buildings on the Site	415 and 419 Ravenhill Ave.: Two under-construction three-storied multi-tenant residential buildings with one basement level were observed during the initial Site visit; however, construction at these locations were completed at the time of the follow-up Site visit with a similar footprint to that completed on 423 Ravenhill Ave.	Site observations, FIP and aerial photographs
	423 Ravenhill Ave.: One three-storied multi-tenant residential building and one basement level. No changes were observed at the time of the follow-up Site visit.	



Topic	Observations	Source
	425 Ravenhill Ave.: During initial site, a single-family residence with detached car garage which was constructed in 1950s with frame structure and composite sidings was observed. However, during follow-up Site, all the structures on this portion of the Site had been demolished and excavation for redevelopment as a multi-tenant residential building was observed.	
	431 Ravenhill Ave.: A single-family residence with which was constructed prior to 1950s and consisted of landscaped and grass covered area to the south and north of the residence. In addition, a detached shed structure used for storage purposes was observed in the backyard, north of the residence.	
	436 Roosevelt Ave.: Two two-storied multi-tenant residential buildings constructed in December 2017 with municipal address 330,332, 334 and 336 Roosevelt Avenue. No changes were observed at the time of the follow-up Site visit.	
	440 Roosevelt Ave.: Single-family residence constructed in 1950s with attached double car garage. Construction consists of brick and rough cast concrete. No changes were observed at the time of the follow-up Site visit.	
	566 Byron Ave.: One storied commercial building occupied by dentist's office (Westboro Dental Center). No changes were observed at the time of the follow-up Site visit.	
	570 Byron Ave.: Single-family residence constructed with brick in 1920s and detached single car garage. No changes were observed at the time of the follow-up Site visit.	
	576 Byron Ave.: Two three-storied multi-tenant residential buildings under construction during initial Site visit; however, the construction was completed prior follow-up Site visit and the buildings were occupied by residential tenants.	
Building Areas	Not known at the time of the Site visit.	Site observations
Number of Floors (include all levels, whether above or below ground)	The single-family homes had three levels, two of which are aboveground and one of which is below ground. The multi-tenant residential buildings were three storied with a basement level partially below grade.	Site observations and Site Representative
	The commercial building was single storey.	



Topic	Observations	Source
Number, Age, and Depth of Levels Below Ground Level	The Site Representative indicated that the residential buildings have one level below ground (commercial property has no basement level).	Site observations and Site Representative
	There were one AST located on the outside at the southwest corner of the commercial building on 566 Byron Avenue. The Site Representative indicated that the AST was used as a heating source for backup power for the dentist's office. The AST was single wall non-metallic with a capacity of 909L and installed in 2014 (three-quarter full at the time of the Site visit) on a concrete pad. No evidence of stains or spills were observed in the vicinity of the AST based on limited visibility (snow cover on the ground). Furthermore, no such evidence of stain or spills during the follow up Site visit was observed in areas around the AST.	
Number and Details of all Aboveground Storage Tanks ("ASTs")	An AST (620 L double walled non-metallic tank manufactured in 2017) for furnace oil storage was on the concrete basement floor of 431 Ravenhill Avenue and consisted of a drip tray. This AST appeared to be in good condition; however, no information about use and/or removal of previous ASTs used for heating purposes at this property were available. Although no evidence stains, or spills were observed. In addition, vent and fill pipes associated with this AST was observed on the southeast corner of the building.	Site observations
	Two suspect vent pipes were observed off-Site at residential homes within the Phase One Study Area (located southwest of the Site) which may have been associated with a former AST in the basement of the building, likely installed on a concrete floor.	
	Based on the age of the buildings within the Phase One Study Area, there is a potential that they formerly had, or still have, fuel oil storage tanks that were most likely ASTs.	
Number and Details of all Underground Storage Tanks ("USTs")	No other evidence (fill/vent pipes extending through walls or slabs/ground surface, no staining or any obvious odours) was observed during the Site visit to indicate the current or former presence of fuel or chemical USTs on the Site. However, based on the age of the adjacent buildings within the Phase One Study Area, there is a potential that they formerly had, or may still have, fuel oil storage tanks. Although the storage tanks would have likely been ASTs, this could not be confirmed.	Site observations



Topic	Observations	Source
Polychlorinated Biphenyls (PCB) Containing Materials and Equipment	No evidence was observed during the Site visit to indicate the current or former presence of PCB containing materials or equipment. Two pole-mounted transformers were noted adjacent to Ravenhill Avenue within the Phase One Study Area. No evidence of spills or leaks was noted in the area of the transformers at the time of the Site visit. No labels indicating whether the transformers are PCB-containing or not were noted on any of the transformers.	Site observations
<u>Underground Utilities</u>	The Site is connected to the municipal water supply.	Site observations and
Potable and Non- Potable Water Sources	There were no non-potable water sources identified at the Site at the time of the Site visit.	Site Representative
Utility Lines Present (i.e. Electrical, Natural Gas, other)	Various running overhead electrical lines were present along Ravenhill Avenue and Roosevelt Avenue on the southern portion of the Site. It ran from a hydro pole located southwest of the Site.	Site observations
Sanitary/Process Wastewater Receptor	Sanitary wastewater is generated on-Site and discharged to the municipal sanitary sewer. No process wastewater is generated on-Site.	Site observations
Sanitary Sewer Connection	The Site is connected to the municipal sanitary sewer.	Site observations and Site Representative
Septic Systems	None identified.	Site observations and Site Representative
Storm Water Flow	Storm water run-off is through natural soil infiltration.	Site observations
Storm Sewer Connection	The Site is connected to the municipal storm sewer.	Site observations
Interior of Structures Entry and Exit Points for Site Buildings	The residential buildings have multiple entry and exit points as observed during the Site visit.	Site observations
Existing and Former Heating System(s) (include fuel type / source)	All the buildings on the Site is heated via natural gas and/or furnace oil.	Site observations and Site Representative
Existing and Former Cooling System(s) (include fuel type / source)	None identified.	Site observations
Drains, Pits, and Sumps (include current use, if any, and former use)	None identified.	Site observations
Unidentified Substances	None identified.	Site observations



Topic	Observations	Source
Floor Stains or Corrosion Located near a Potential Discharge Location	None identified.	Site observations
Miscellaneous Exterior		
Location of any Current and Former Wells	None identified.	Site observations
Ground Cover (i.e., grass, gravel, soil, or pavement, etc.)	The majority of the Site exterior consisted of asphalt and/or landscaped driveways and backyard with the exception of 570 Byron Avenue, 436 Roosevelt Avenue and 431 Ravenhill Avenue that also consisted of grass covered lawn areas on the exterior of the single-family homes.	Site observations
Current or Former Railway Lines or Spurs	None observed.	Site observations.
Presence of Stained Soil, Vegetation, or Pavement	None observed.	Site observations
Presence of Stressed Vegetation	None observed.	Site observations
Areas Where Fill and/or Debris Materials Appear to Have Been Placed	No piles of fill material or debris were observed during the Site visit.	Site observations
Potentially Contaminating Activity	A fuel oil AST was located on the exterior of the southwest corner of the commercial building on 566 Byron Avenue. Another furnace oil AST with associated vent/fill pipes for heating purposes was observed on concrete basement floor of 431 Ravenhill Avenue. The presence of these ASTs on the Phase One Property is considered to be on-Site PCAs.	Site observations and Site Representative
Unidentified Substances	None identified.	Site observations



4.2.1 Enhanced Investigation Property

The Site is occupied by three single-family residences, ten multi-tenant residential buildings, one under-construction multi-tenant residential building, a commercial building (occupied by a dental office) and a detached single car garage. The majority of the Site exterior consisted of asphalt and/or landscaped driveways and backyard with the exception of 570 Byron Avenue, 436 Roosevelt Avenue and 431 Ravenhill Avenue that also consisted of grass covered lawn areas on the exterior of the single-family homes. The Site has been developed in 1920s and since been used primarily for residential use. As such, the Site is not considered to be an enhanced investigation property as defined by O. Reg. 153/04.

4.3 Surrounding Land Use

During the Site visit, a visual reconnaissance of the outdoor operations in the Phase One Study Area was carried out from the Site and publicly accessible areas.

The properties surrounding the Site have various property uses including residential, commercial and community land.

The Site Assessor made the following observations of neighbouring properties:

West (inferred to be hydraulically cross-gradient of the Site): Immediately west of the Site is a multi-tenant residential home followed by Highland Park Lawn Bowling Club.

North (inferred down-gradient): Multi- tenant residential apartments across Byron Avenue. Further north on Richmond Road, properties included variety of commercial land uses including Tubman Funeral Services, TD Canada Trust and Starbucks Coffee.

South (inferred up-gradient): Residential homes (across Ravenhill Avenue) primarily consisting of single-family residences.

East (inferred cross-gradient): Residential land uses (across Roosevelt Avenue) consisting primarily of single-family homes and some apartment buildings.

4.4 Written Description of Investigation

The Site consists of a parcel of land which includes multiple municipal addresses (411-431 Ravenhill Avenue, 566-576 Byron Avenue and 436-440 Roosevelt Avenue) and is located to the west of Roosevelt Avenue between Byron Avenue and Ravenhill Avenue. At the time of the initial Site visit, conducted on January 4, 2018, the Site consisted of an irregular shaped parcel of land with area of 1.55 acres (0.63 hectares) that included several municipal addresses and consisted primarily of residential buildings (single-family and multi-tenant) and one commercial property (occupied by dentist's office) on 566 Byron Avenue. Three of the properties on the Site (415 and 419 Ravenhill Avenue as well as 576 Byron Avenue) were under construction to be redeveloped from single-family residences to multi-tenant residential buildings. The surrounding properties within the Phase One Study Area included residential, commercial and community (Highland Park Lawn Bowling Club) land uses.

During the follow-up Site visit, construction of the three properties on the Site (observed during initial Site visit) had been completed. In addition, the single-family home on 425 Ravenhill Avenue had been demolished and the property was excavated a few metres below grade in preparation for redevelopment as a multi-tenant residential building. No evidence of stains or potential issue of concern on the excavation floor or walls were observed.



During the initial Site visit, a fuel oil AST (909L capacity) was observed on the exterior of the southwest corner of the commercial building on 566 Byron Avenue. The AST was installed in 2014 on a concrete pad and based on limited visual observation, no evidence of stains or spills were observed in the vicinity of the AST; however, observations made during the follow-up Site visit did not indicate any evidence of stains or spills from the AST. In addition, no information about historical spills or leaks from this AST was available. As such, presence of this AST on-Site is considered a PCA; however, for the purposes of city re-zoning application is not considered to represent an APEC on the Site.

Another AST (620 L double walled non-metallic tank manufactured in 2017) for furnace oil storage was observed on the concrete basement floor of 431 Ravenhill Avenue. This AST appeared to be in good condition, consisted of a drip-tray and was located on concrete floor in good condition with no cracks in the vicinity of the AST; however, no information about use and/or removal of previous ASTs at this property were available. Although concrete floor near this AST appeared to be in good condition and no evidence of stains or spills were observed anywhere else in the basement of 431 Ravenhill Avenue, there is possibility of potential historical leaks and spills from previous ASTs and hence presence of this AST on-Site is considered a PCA. Since the property addressed 431 Ravenhill Avenue will be redeveloped as a multi-tenant residence, as indicated by the Site Representative, it will require excavation below current basement level which will indicate any impacted soil, if present. In addition, excavation for redevelopment purposes will also remove presence of any impacted soil from the Site. As such, presence of this AST on-Site is a PCA for the Site; however, it is not considered to represent an APEC on the Site.

5.0 REVIEW AND EVALUATION OF INFORMATION

5.1 Current and Past Uses of the Site

The following summarizes the current and past uses of the Phase One Property:

Year(s)	Name of Owner(s)	Description of Property Use	Property Land Use according to Reg.153/04	Other Observations from Aerial Photographs, Fire Insurance Plans, etc.
Prior to 1928	Unknown	Unknown	Agricultural or other use	No aerial or other information available.
1928 to 1958	Multiple owners	Residential dwellings	Residential and Commercial (566 Byron Avenue)	The Site consisted of 7 residential buildings with 6 detached parking garages.
1958 to Present (2018)	Currently owned by multiple enterprises listed in Section 1.1	Residential buildings (single-family and multi-tenant)	Residential and Commercial (566 Byron Avenue)	The Site consists primarily of residential homes and multi-tenant residences as well as one dentist office (commercial) at 566 Byron Avenue as listed since 1961.



5.2 Potentially Contaminating Activity

Potentially contaminating activities, which if currently or historically carried out at a Site, may contribute to an area of potential environmental concern (APEC). Based on the information obtained as part of this Phase One ESA, the following PCAs were identified within the Phase One Study Area:

Potentially Contaminating Activity	Information Source	Rationale for Potential Contribution of the PCA to an APEC	
Phase One Property			
#28. Gasoline and Associated Products Storage in Fixed Tanks – Fuel oil AST present on the Site, located southwest corner of commercial building on 566 Byron Avenue. (PCA 1)	Site observations and Site Representative	The PCA is located on the Phase One Property. However, given that the AST was located on a concrete pad floor in the exterior of the commercial building and that there are no documented and/or observed spills or leaks, it is not considered to represent an APEC on the Site.	
#28. Gasoline and Associated Products Storage in Fixed Tanks – Furnace oil AST with drip tray, located on the concrete basement floor of 431 Ravenhill Avenue. (PCA 2)	Site observations and Site Representative	The PCA is located on the Phase One Property. However, the AST was located on a concrete floor in good condition of the basement and there are no documented and/or observed spills or leaks associated with use of ASTs at this property historically. In addition, this AST will be removed, and property excavated in preparation for redevelopment which will remove any impacted soil from the Site. As such, this AST is not considered to represent an APEC on the Site.	
Phase One Study Area			
#28. Gasoline and Associated Products Storage in Fixed Tanks and #10. Commercial Autobody Shops – Former auto service garage at 424 Richmond Road and associated 4 USTs located approximately 60 m north of the Site in downgradient location. (PCA 3)	FIPs, City of Ottawa HLUI and aerial photographs	Given that this facility was located hydraulically down-gradient with respect to the Site and was separated from the Site by 60 m including Byron Avenue and its underlying services, it is not considered to be a PCA that will result in an APEC on the Site.	
#28. Gasoline and Associated Products Storage in Fixed Tanks and #10. Commercial Autobody Shops – Former auto service garage and retail fuel outlet at 415 Richmond Road and associated 6 USTs located approximately 100 m north of the Site in downgradient location. (PCA 4)	FIPs, City of Ottawa HLUI and aerial photographs	Given that this facility was located hydraulically down and cross-gradient with respect to the Site and was separated from the Site by Byron Avenue and Richmond Road along with its underlying services, it is not considered to be a PCA that will result in an APEC on the Site.	



Potentially Contaminating Activity	Information Source	Rationale for Potential Contribution of the PCA to an APEC
#10. Commercial Autobody Shops – Former presence of auto service garage located at 433 Roosevelt Avenue; adjacent to the east of the Site across Roosevelt Avenue. (PCA 5)	FIPs and City of Ottawa HLUI	No UST or AST was reported at this facility. Based on the amount of infrastructure between the Site and this facility as well as hydraulically crossgradient location with respect to the Site, it is not considered to be a PCA that will result in an APEC on the Site.
#28. Gasoline and Associated Products Storage in Fixed Tanks – Former presence of a gasoline UST located approximately 60 m north of the Site at 416 Richmond Road. (PCA 6)	FIPs and City of Ottawa HLUI	Given that this facility was located hydraulically down-gradient with respect to the Site and was separated from the Site by 60 m including Byron Avenue and its underlying services, it is not considered to be a PCA that will result in an APEC on the Site.
#28. Gasoline and Associated Products Storage in Fixed Tanks – Former presence of a gasoline storage tank located approximately 120 m northeast of the Site at 382 Richmond Road. (PCA 7)	FIPs and City of Ottawa HLUI	Given the distance and amount of infrastructure between the Site and this facility and that was it was located hydraulically cross-gradient with respect to the Site, it is not considered to be a PCA that will result in an APEC on the Site.
#37. Operation of Dry Cleaning Facility (where chemicals are used) – Former laundry and cleaning facility located approximately 115 m northeast of the Site at 384 Richmond Road. (PCA 8)	FIPs and City of Ottawa HLUI	Given the distance and amount of infrastructure between the Site and this facility and that was it was located hydraulically cross-gradient with respect to the Site, it is not considered to be a PCA that will result in an APEC on the Site.
#10. Commercial Autobody Shops – Former presence of auto service garage located at 567 Byron Avenue; adjacent to the north of the Site across Byron Avenue. (PCA 9)	FIPs and City of Ottawa HLUI	No UST or AST was reported at this facility. Based on the amount of infrastructure (underneath Byron Avenue) between the Site and this facility as well as hydraulically down and cross-gradient location with respect to the Site, it is not considered to be a PCA that will result in an APEC on the Site.
#18. Electricity Generation, Transformation and Power Stations – Two pole-mounted transformers were located southwest of the Site along Ravenhill Avenue. (PCA 10)	Site observations	No evidence of spills or leaks was noted in the area of the transformers at the time of the Site visit. Based on the age (reported as being installed in 2017) of the transformers, they are unlikely to be PCB containing. The presence of relatively new transformers is a PCA that will not result in and APEC on the Site.



5.3 Areas of Potential Environmental Concern

Based on the information obtained as part of this Phase One ESA, none of the PCAs identified were considered to represent an APEC on the Phase One Property.

5.4 Conceptual Site Model

A Conceptual Site Model of the Phase One Study Area (as required by O.Reg. 153/04) is presented in a series of Figures 1 to 8 (Figure 1: Key Plan, Figure 2: Site Plan, Figure 3: Topographic Map and Areas of Natural Significance, Figure 4: Surficial Geology, Figure 5: Bedrock Geology, Figure 6: Drift Thickness, Figure 7: Soil Survey Complex (Ontario Soils), and Figure 8: Physiography Map).

The combined set of figures shows:

- Existing buildings and structures;
- Water bodies and Areas of Natural Significance (if present) located in the Phase One Study Area;
- Drinking water wells on the Phase One Property;
- Roads (including names) within the Phase One Study Area;
- Uses of properties adjacent to the Phase One Property; and,
- Location of identified PCAs in the Phase One Study Area (including any storage tanks).

The following describes the Phase One ESA Conception Site Model (CSM) for the Site based on the information obtained and reviewed as part of this Phase One ESA:

- The Site consisted of 1.55 acres (0.63 hectare) irregular shaped parcel of residential and commercial land occupied by three single-family residences, eight multi-tenant residential buildings, one under-construction multi-tenant residential building, a commercial building and a detached single car garage. The single-family residences were constructed between 1920 and 1950 whereas the multi-tenant residential buildings were constructed in 2017 or later;
- No water wells were observed on the Site at the time of the Site visit. Also, since municipal water mains service the Site and surrounding properties within Phase One Study Area, it is unlikely that any water wells are present;
- One AST was located on-Site as part of the commercial land use (dentist's office) on 566 Byron Avenue. This AST was installed in 2014 on a concrete pad and based on observations made during the follow-up Site visit did not indicate any evidence of stains or spills from this AST. In addition, no information about historical spills or leaks from this AST was available. As such, presence of this AST on-Site is considered a PCA; however, for the purposes of city re-zoning application is not considered to represent an APEC on the Site.
- During the follow-up Site visit, an AST (620 L double walled non-metallic tank manufactured in 2017) for furnace oil storage was observed on the concrete basement floor of 431 Ravenhill Avenue. Although this AST appeared to be in good condition with no evidence of spills or stains in the vicinity, there is possibility of potential historical leaks and spills from previous ASTs and hence presence of this AST on-Site is considered a PCA. However, this property will be redeveloped as multi-tenant residence which will require excavation below current basement level that will likely indicate any impacted soil, if present. In addition, excavation for redevelopment purposes will also remove presence of any impacted soil from the Site.



As such, presence of this AST on-Site is a PCA for the Site; however, it is not considered to represent an APEC on the Site.

- No piles of fill were observed on the Site at the time of the Site visit;
- The nearest water body is the Ottawa River located approximately 460 m northwest of the Site;
- No areas of natural and scientific interest (ANSI) are known to be located on the Site or on the Phase One Study Area;
- At the time of the Phase One ESA, the surrounding properties within the Phase One Study Area were mainly comprised of residential and commercial land uses with some community land uses;
- The following roads were located within the Phase One Study Area at the time of the Site visit:
 - Dominion Avenue, Berkley Avenue, Winston Avenue, Richmond Road, Kenwood Avenue, Madison Avenue, Danforth Avenue, Byron Avenue, Ravenhill Avenue, Edison Avenue, Highland Avenue, Brierwood Avenue, Golden Avenue, Cole Avenue.
- Soil at the Site consists of till, plain with local relief (< 5 m) and the bedrock at the Site is primarily of the Gull River Formation with limestone, with central portion consisting of Rockcliffe formation with sandstone, shale, limestone and dolostone; and
- Groundwater is anticipated to flow north towards the Ottawa River.

5.4.1 Uncertainty and Absence of Information

At the time of preparation of this report, Golder was unable to access all of the interior portions of the on-site residential buildings during the Site visit. However, based on the body of information acquired, it is considered that the absence of this information should not likely affect the final conclusion of the Phase One ESA. There were no material deviations to the Phase One ESA requirements set out in O.Reg. 153/04 that would cause uncertainty or absence of information that would affect the validity of the Phase One Conceptual Site Model or the findings of this Phase One ESA.

6.0 CONCLUSIONS

Given that no APECs were identified on the Site during the Phase One ESA, a Phase Two ESA is not recommended to be carried out at the Site at this time.



7.0 REFERENCES

The following documents and/or data were cited in this report:

Source	Date
Previous Environmental Reports (refer to Section 3.1.6)	N/A
Ontario Regulation 153/04 as amended	October 31, 2011
Bélanger, J. R. 2008 Urban Geology of the National Capital Area, Geological Survey of Canada, Open File 5311, 1 DVD.	2008
Armstrong, D.K. and Dodge, J.E.P. 2007. Paleozoic Geology of Southern Ontario; Ontario Geological Survey, Miscellaneous Release—Data 219	2007
2010 Bélanger, J. R., Urban Geology of the National Capital Area, Geological Survey of Canada, Open File D3256, 2001	2010
Aerial Photograph Images – geoOttawa (http://maps.ottawa.ca/geoOttawa/)	1928, 1958, 1965, 1976, 1999, 2002, 2005, 2007, 2008, 2011, 2014, 2015 and 2017
Ontario Ministry of the Environment and Climate Change	December 27, 2017
Technical Standards and Safety Authority	January 10, 2018



8.0 LIMITATIONS AND USE OF REPORT

This report (the "Report") was prepared for the exclusive use of Antilia Homes, Falsetto Homes Inc., J&M Investments Inc. and Caruso Investments Inc. (the Client) for the express purpose of providing advice with respect to the environmental condition of the Site. In evaluating the Site, Golder Associates Ltd. ("Golder") has relied in good faith on information provided by others as noted in the Report. We have assumed that the information provided is factual and accurate. We accept no responsibility for any deficiency, misstatement or inaccuracy contained in this Report as a result of omissions, misinterpretations or fraudulent acts of persons interviewed or contacted, or incomplete or inaccurate historical information from the various agencies. Any use which a third party makes of this Report, or any reliance on or decisions to be made based on it, is the sole responsibility of such third party. If a third party requires reliance on this Report, prior written authorization from Golder is required. Golder disclaims any responsibility of consequential financial effects on transactions or property values, or requirements for follow-up actions and costs.

The scope and the period of Golder's assessment are described in this Report, and are subject to restrictions, assumptions and limitations. Except as noted herein, the work was conducted in accordance with the scope of work and terms and conditions of Golder's proposal. Golder did not perform a complete assessment of all possible conditions or circumstances that may exist at the Site referenced in the Report. Conditions may therefore exist which were not detected given the limited nature of the assessment Golder was retained to undertake with respect to the Site and additional environmental studies and actions may be required. In addition, it is recognized that the passage of time affects the information provided in the Report. Golder's opinions are based upon information that existed at the time of the writing of the Report. It is understood that the services provided for in the scope of work allowed Golder to form no more than an opinion of the actual conditions at the Site at the time the Site was visited, and cannot be used to assess the effect of any subsequent changes in any laws, regulations, the environmental quality of the Site or its surroundings. Asbestos and mould surveys were not performed. If a service is not expressly indicated, do not assume it has been provided.

The results of an assessment of this nature should in no way be construed as a warranty that the Site is free from any and all contamination from past or current practices.



9.0 CLOSURE

We trust that the information presented in this report meets your current requirements. Should you have any questions or concerns, please do not hesitate to contact the undersigned.

Golder Associates Ltd.

Shihan Chowdhury, EIT

Junior Environmental Consultant

Berend Velderman, M.Sc., P.Geo.


Principal


SAC/BJV/hw/sg


https://golderassociates.sharepoint.com/sites/22364g/deliverables/updated phase i esa- sep. 2018/1793155-001-r-rev1 ph i esa oct 2018_v2.docx


Golder and the G logo are trademarks of Golder Associates Corporation


Figures

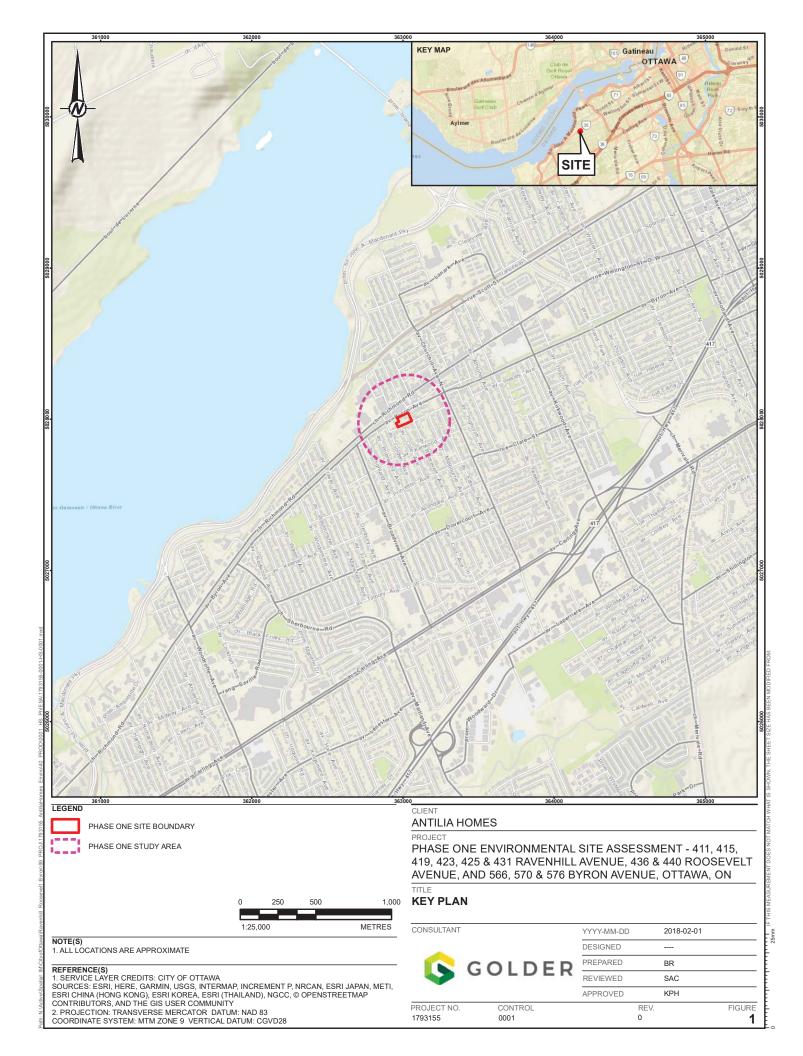


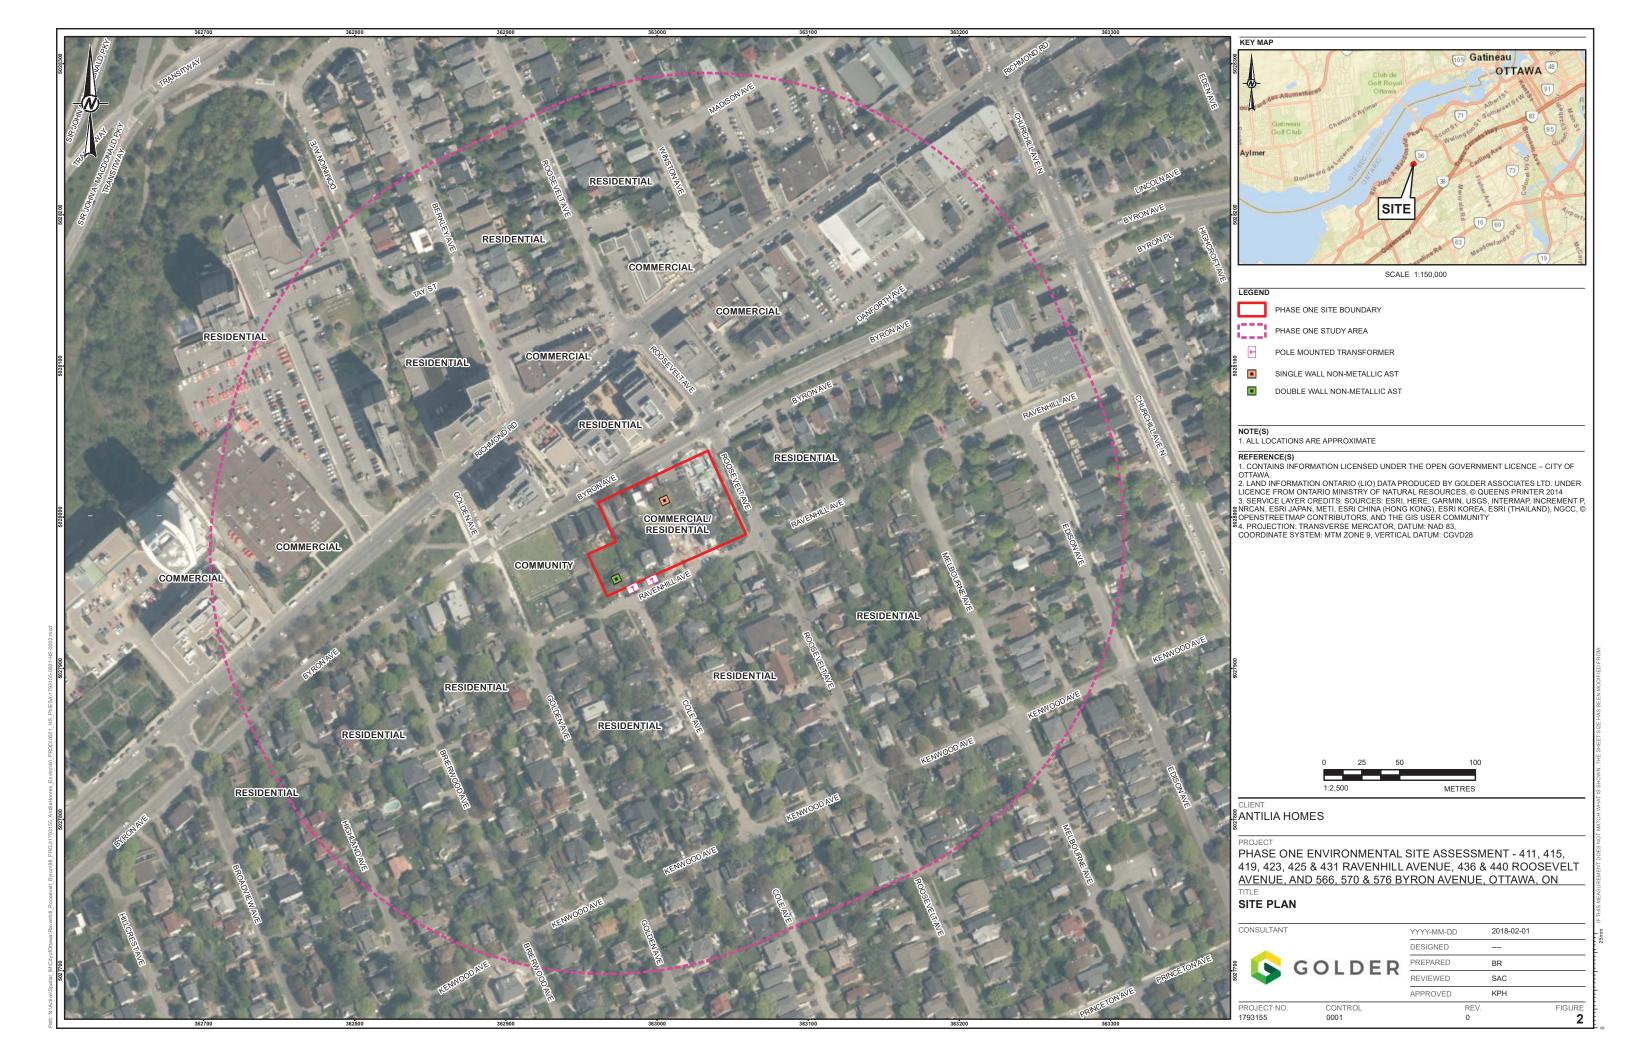


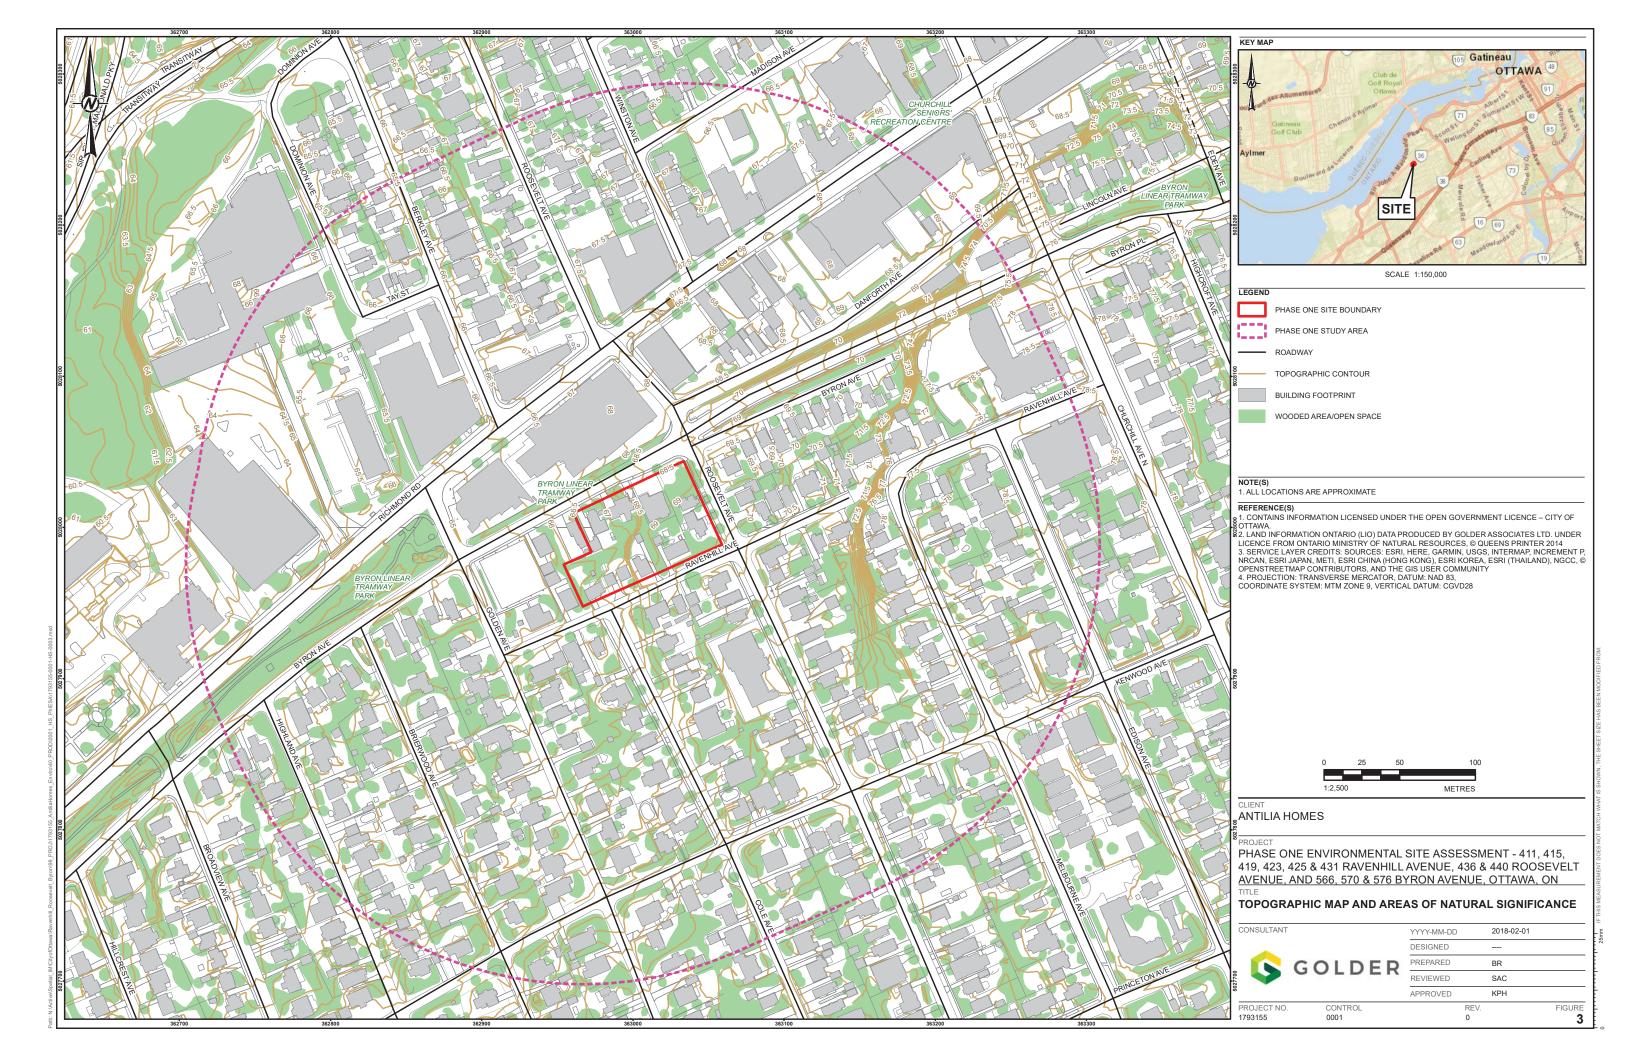


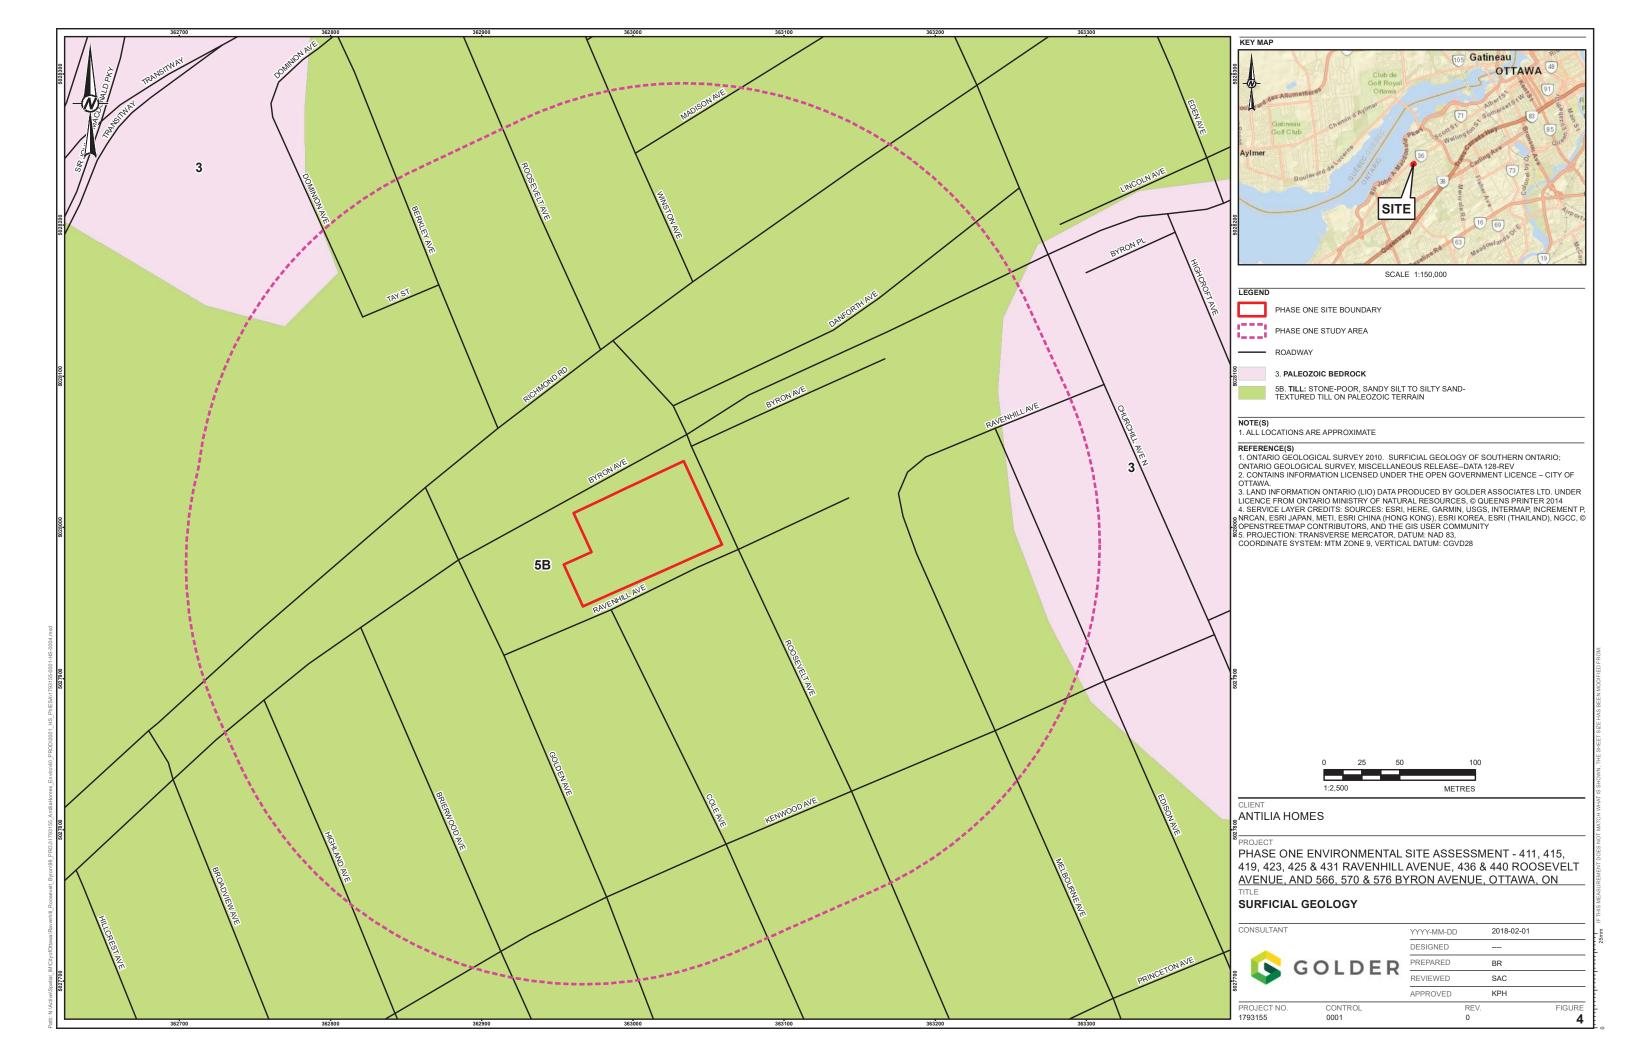

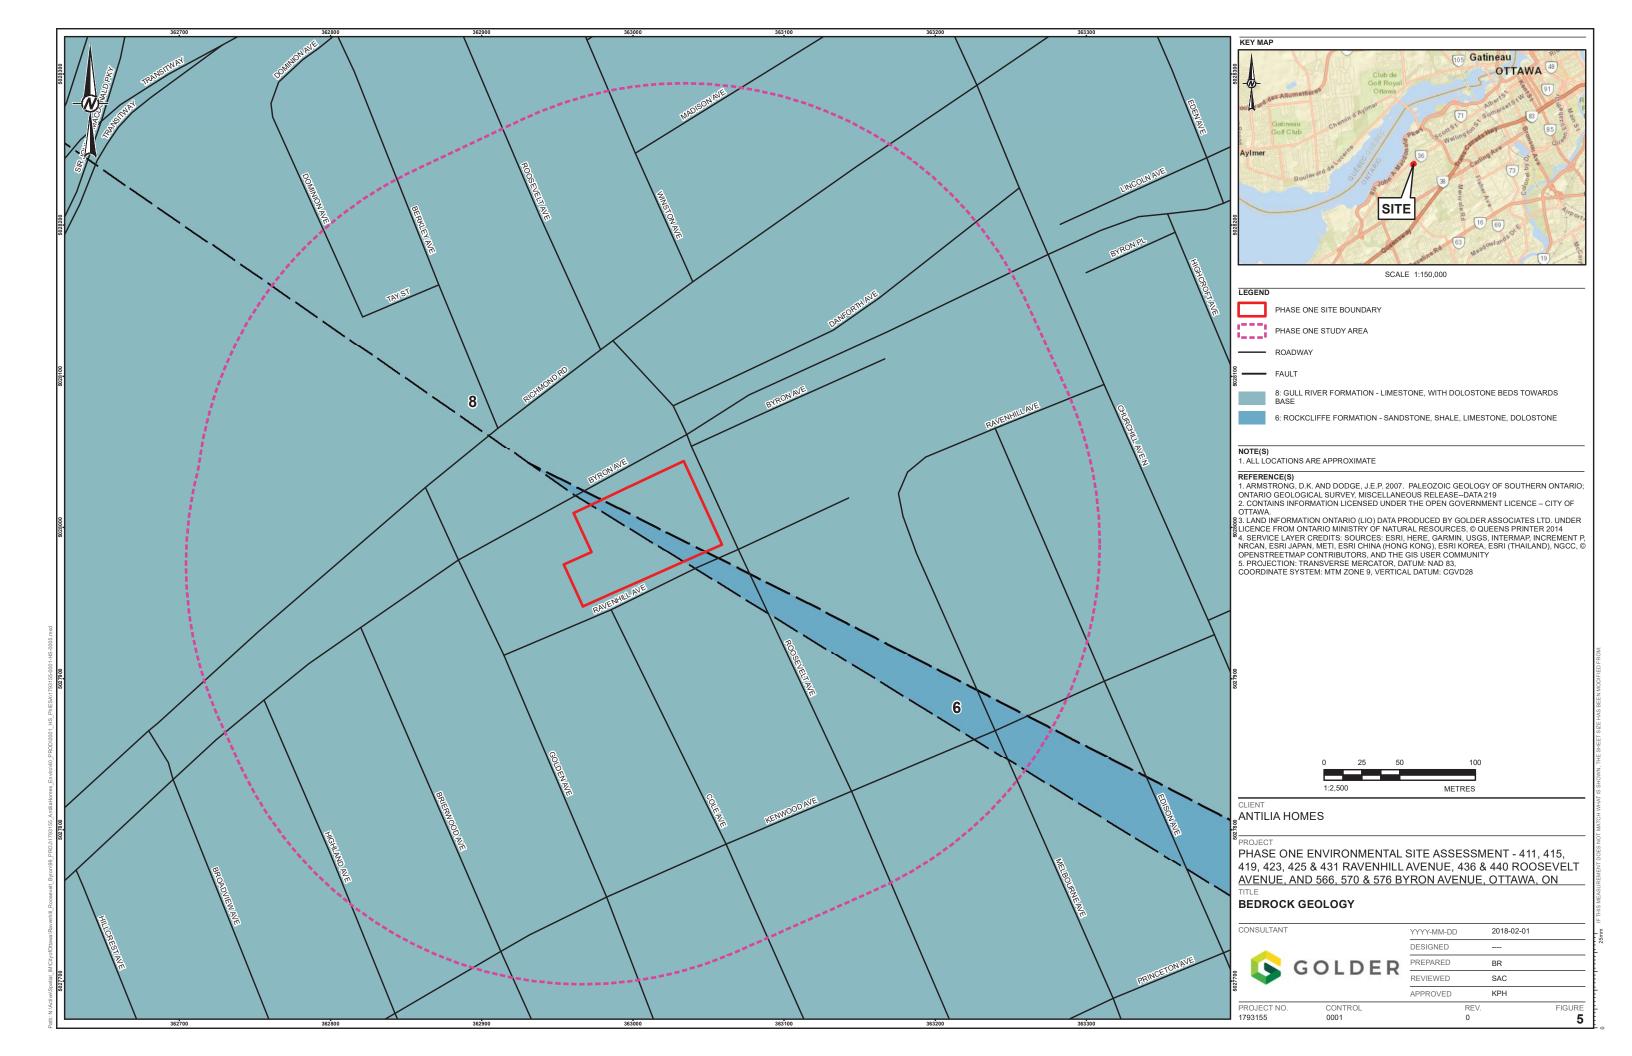

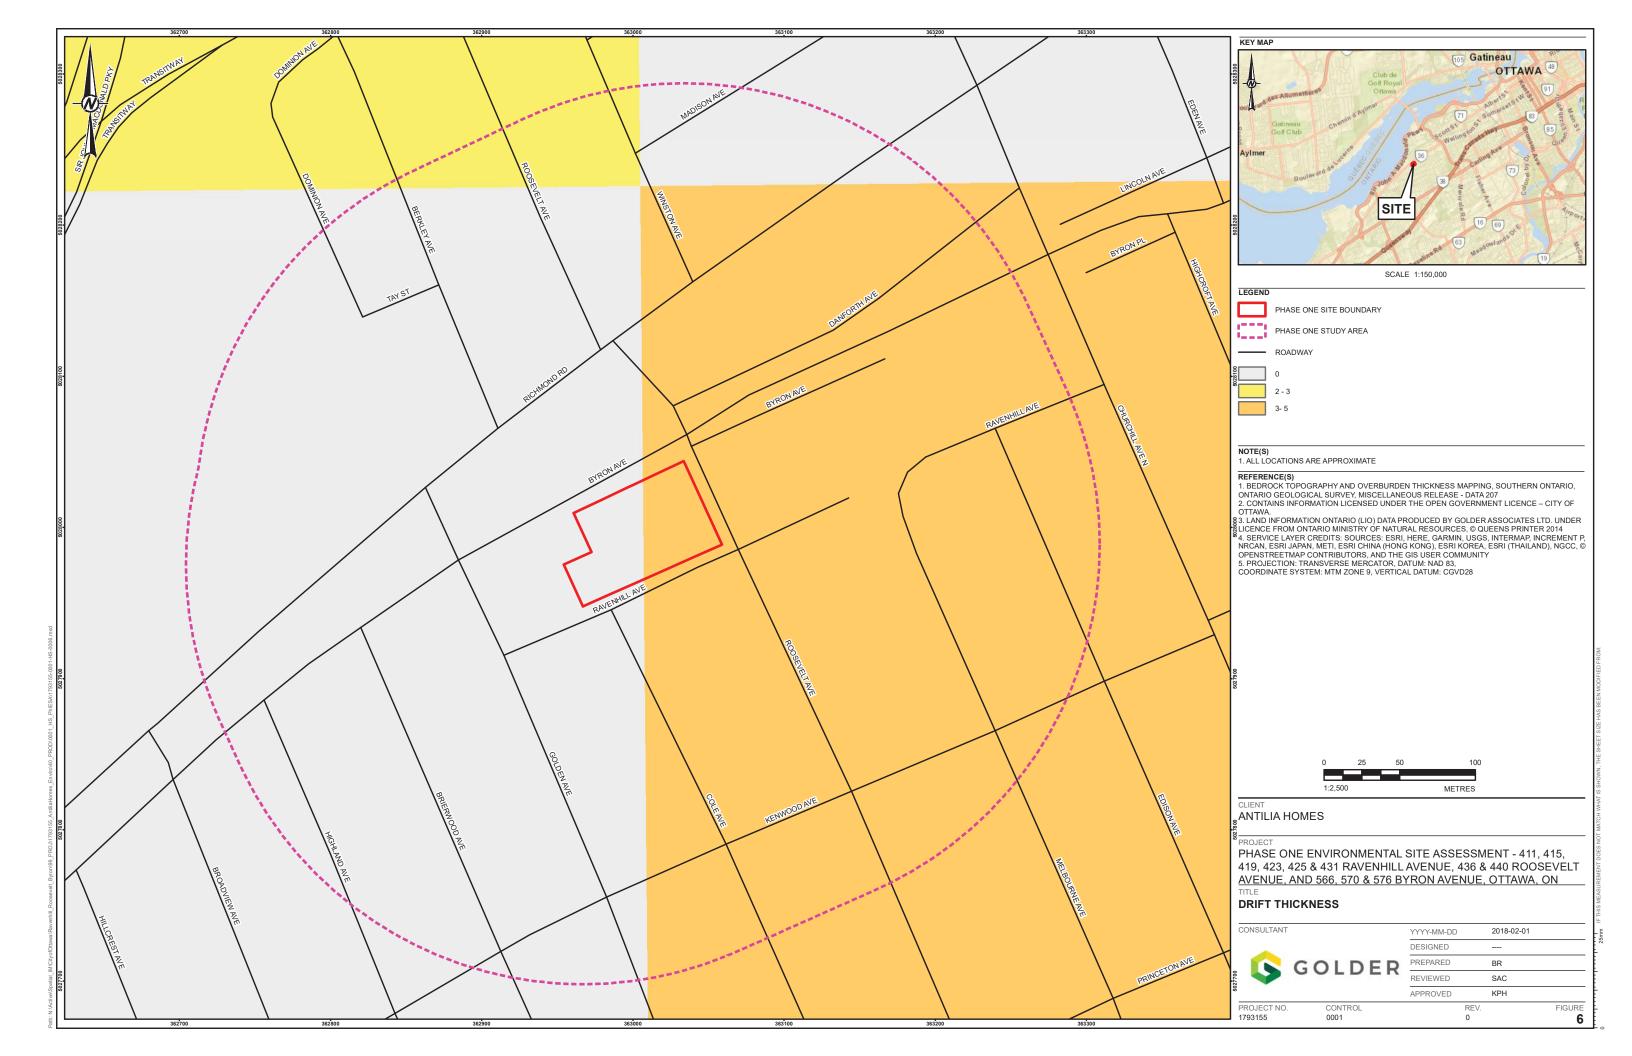

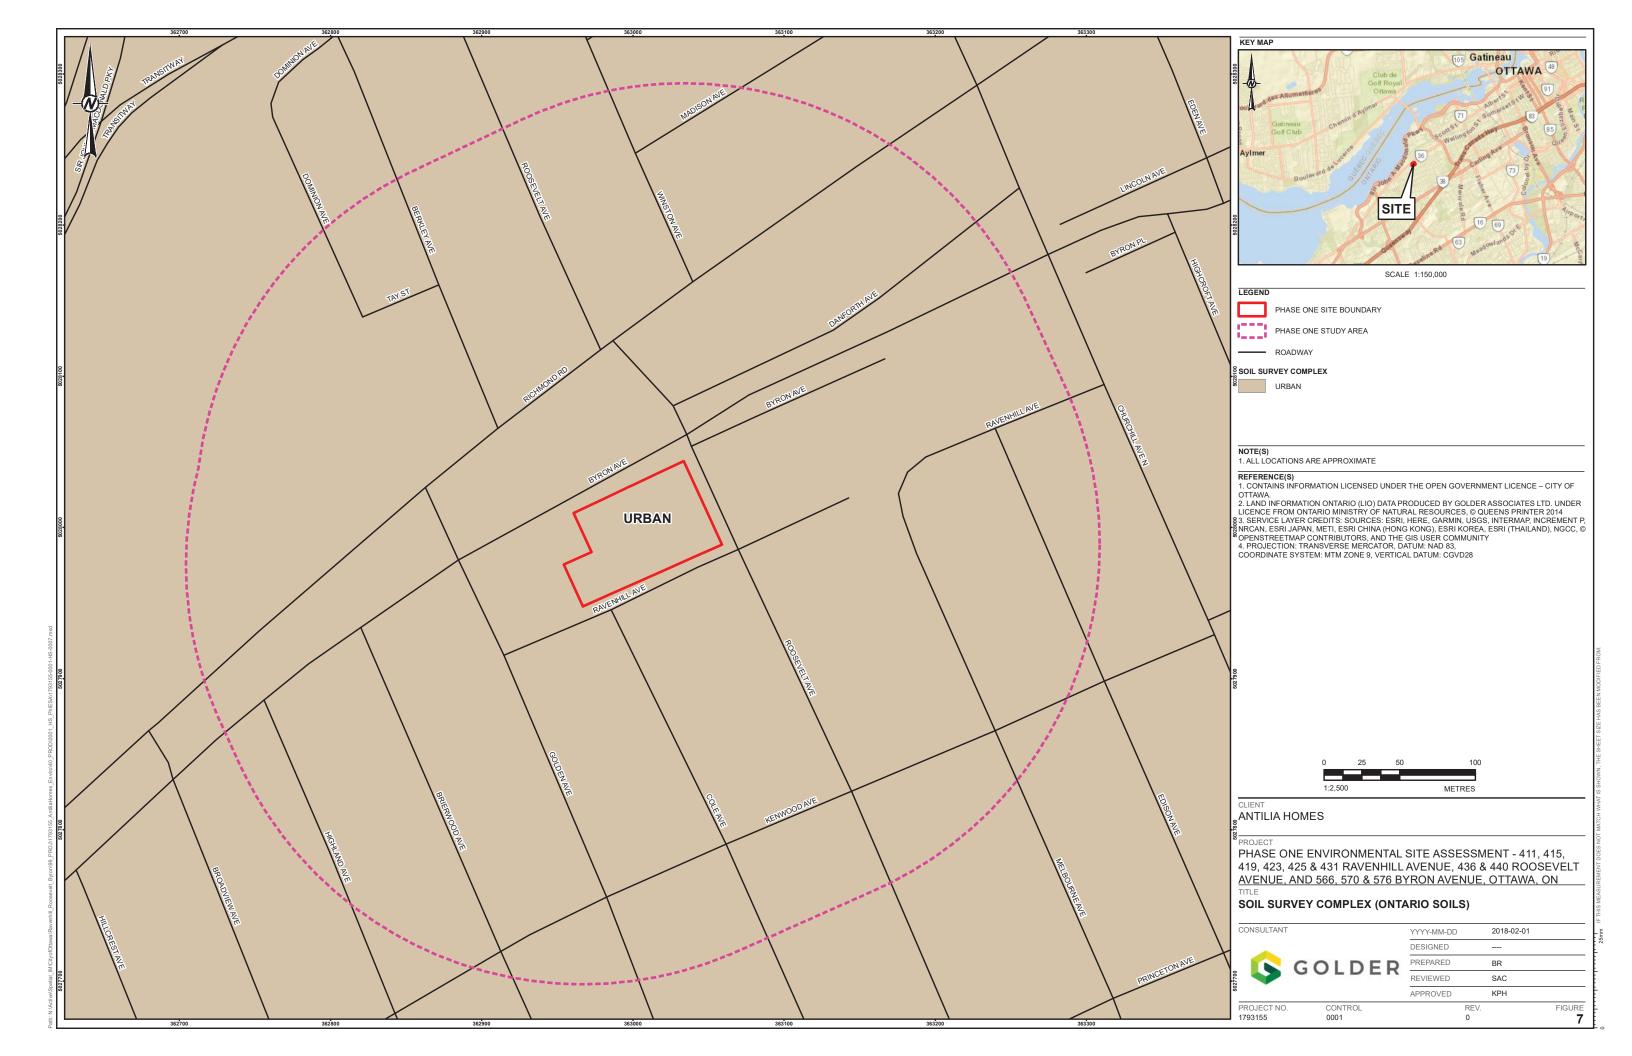

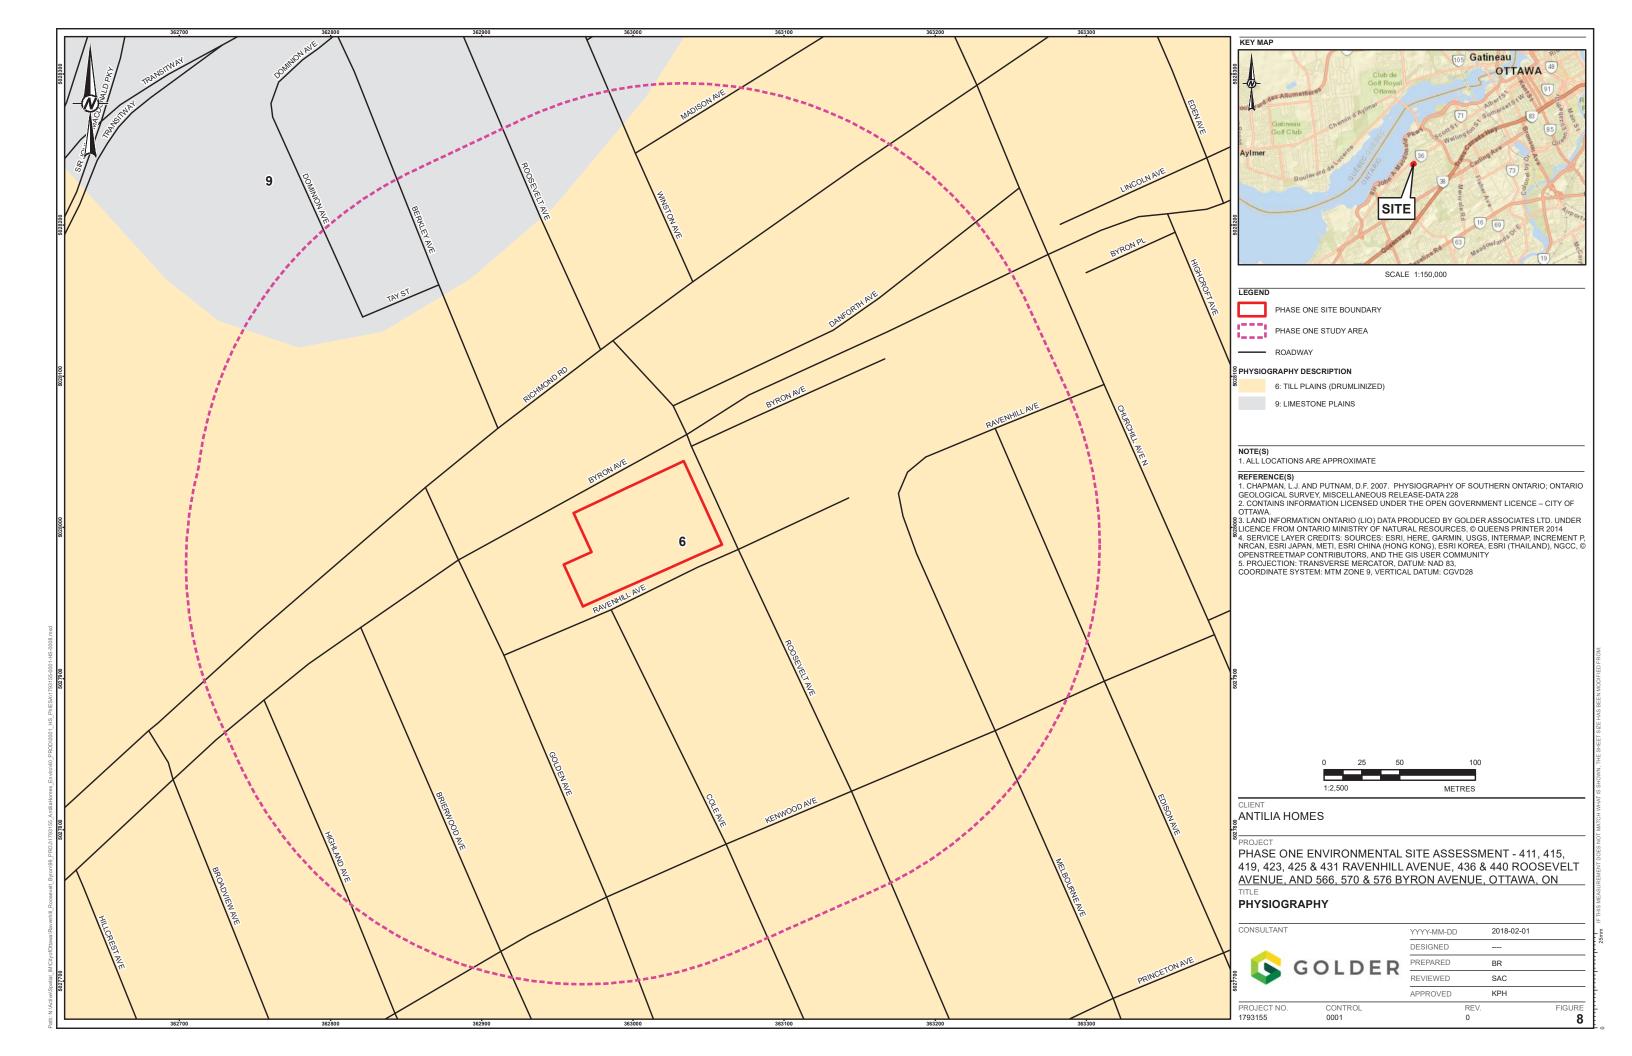

October 2018 1793155-1000

APPENDIX A

Regulatory Responses

Ministry of the Environment and Climate Change

Ottawa District Office 2430 Don Reid Drive, Suite 103 Ottawa Ontario

K1H 1E1

613-521-3450 or 1-800-860-2195

Fax: 613-521-5437

Ministère de l'Environnement et de l'Action en matière de changement climatique

Bureau du district d'Ottawa 2430, promenade Don Reid, Unité 103 Ottawa (Ontario)

K1H 1E1

613-521-3450 ou 1-800-860-2195

Téléc.: 613-521-5437



OTT File No: 91

INDEX REVIEW REPORT COMMERCIAL/INDUSTRIAL/AGRICULTURAL

Attention:

Shihan A. Chowdhury

Your File:

Golder Associates

Date Received: December 21, 2017

Thank you for your inquiry requesting a search of records from the Ministry of the Environment and Climate Change (ministry). The ministry encourages you to use the available on-line resources to access publically-available information which may assist with your inquiry.

PROPERTY OWNER AND LOCATION

Location:

Municipality:

Ottawa

Address:

411, 415, 419, 425 Ravenhill Avenue; 436, 440 Roosevelt

Avenue; 566, 570, 576 Byron Avenue

INDEX OF NAMES FOR ORDERS

We have searched the *Ottawa* District Index Record of Active Orders under the Environmental Protection Act (EPA), Ontario Water Resources Act (OWRA) and the Pesticides Act (PA) issued to: and the following information has been found:

 \boxtimes

No Active Orders are outstanding

Please Note: For information related to any ministry Orders issued to the property in question, please request this information from the property owner. If you would like further information regarding a specific Order issued, please contact the Ottawa District Office.

Date of Search: December 27, 2017

RECORD OF SITE CONDITION

For information on **Records of Site Condition** filed on the Environmental Site Registry since October 1, 2004, please use the following links:

For records of site condition filed between October 1, 2004 and June 30, 2011 https://www.lrcsde.lrc.gov.on.ca/besrWebPublic/generalSearch, and for records of site condition filed since July 1, 2011 https://www.ontario.ca/environment-and-energy/records-site-condition

INDEX OF NAMES FOR APPROVALS ISSUED SINCE 1999

A search of the Index Record of names of all persons to whom approvals have been issued, maintained by the Director, Approvals Branch and the Regional Director, *Eastern Region*, and the District Manager, *Ottawa District*, under Section 19 EPA and Section 13 OWRA and the following information has been provided:

<u>Type</u> <u>Number</u> <u>Issued To</u> <u>Issue Date</u>

Section 9 EPA (Air)

Section 39 EPA (Waste Management)

Section 52 OWRA (Water)

Section 53 OWRA (Municipal/Private/ Industrial Sewage)

Other

The **ministry's Access Environment** is an on-line, map-based search tool designed to allow the public, quick and easy access to the ministry approvals and registration information from December 1999 onward. Access Environment currently displays Environmental Compliance Approvals (ECA), Renewable Energy Approvals (REA) and registrations on the Environmental Activity and Sector Registry (EASR). ECAs include all Certificates of Approval (CofAs) previously issued under the Environmental Protection Act (EPA) and approvals previously issued under s.53 of the Ontario Water Resources Act (OWRA). You can access this information from the ministry website or at the following link.

www.accessenvironment.ene.gov.on.ca/AEWeb/ae/GoSearch.action?search=basic&lang=en

Copies of **ECAs issued before January 1, 2000** can be obtained by submitting a <u>Request for a Copy of an Environmental Compliance Approval</u>

Please Note:

The information provided above is based solely on the address(es) and name(s) of the present and past owners provided by you.

 The Index Record of Names to whom approvals have been issued, maintained by the Regional Director and District Manager, has been searched back to 1999.

3) A search of our records does NOT indicate whether there are:

- other uses for which an approval may have been required, nor

- other uses on the property or in the vicinity that may affect the suitability of the property, for the use proposed to be made of it.

If a comprehensive knowledge of the property and the nearby lands and their environmental condition is required, you must examine them and other relevant records yourself, with the aid of a qualified person, if needed.

Date of Search: December 27, 2017

Additional site information related to the location of landfill sites in the province can be found at the following link:

http://www.ontario.ca/environment-and-energy/small-landfill-sites

http://www.ontario.ca/environment-and-energy/map-large-landfill-sites

The ministry's Hazardous Waste Information Network (HWIN) can also be accessed to search for information on generators, carriers, and receivers of subject waste in the province at the following link: www.hwin.ca

The ministry's Environmental Compliance Reports provide information about contaminant discharges to water and emissions to air that exceed limits found in legislation, environmental approvals, orders and/or policies/guidelines and can be accessed at the following link: http://www.ontario.ca/environment-and-energy/environmental-compliance-reports

Information on Environmental Penalties, which are monetary penalties that can be imposed by the ministry for some industrial spills, can be assessed at the following link: https://www.ontario.ca/search/search-results?query=environmental%20penalties

Additional ministry information can be accessed through the Government of Ontario's Open Data Catalogue: http://www.ontario.ca/government/open-data-ontario

The ministry also encourages you to consider best practices and standards of care used within the legal community and through your associations as a guide to obtaining information related to specific property for any legal purpose.

We trust this information will help meet your requirements quickly and effectively.

Please advise your colleagues that responses to requests for searches always take some time. As a result the Ministry of the Environment and Climate Change may not be able to meet deadlines imposed by other parties on real estate and other transactions.

Thank you for your inquiry.

Signature:

Contact Name: Jéhanne Hurlbut

Title:

Administrative Assistant

Address:

Ministry of the Environment and Climate Change

2430 Don Reid Drive, Unit 103

Ottawa, ON K1H 1E1

Phone:

(613) 521-3450 Ext 221

Date:

December 27, 2017

E&OE

Please Note: If you would like to receive an email with all the environmental links above, please contact me at jehanne.hurlbut@ontario.ca and I will be pleased to send them to you.

Ministry of the Environment, Conservation and Parks

Ottawa District Office 2430 Don Reid Drive, Suite 103 Ottawa ON K1H 1E1 Tel.: 613-521-3450 or 1-800-860-2195

Fax: 613-521-5437

Ministère de l'Environnement, de la Protection de la nature et des Parcs

Bureau du district d'Ottawa 2430, promenade Don Reid, Unité 103 Ottawa ON K1H 1E1 Tél.: 613-521-3450 ou 1-800-860-2195

Téléc.: 613-521-5437



OTT File No: 91

INDEX REVIEW REPORT COMMERCIAL/INDUSTRIAL/AGRICULTURAL

Attention:

Shihan A. Chowdhury

Your File:

Golder Associates

Date Received: September 24, 2018

Thank you for your inquiry requesting a search of records from the Ministry of the Environment, Conservation and Parks (ministry). The ministry encourages you to use the available on-line resources to access publically-available information which may assist with your inquiry.

PROPERTY OWNER AND LOCATION

Location:

Municipality:

Address:

431, 435 Ravenhill Avenue, Ottawa, ON

Lot

Concession

Township

INDEX OF NAMES FOR ORDERS

We have searched the *Ottawa* District Index Record of Active Orders under the Environmental Protection Act (EPA), Ontario Water Resources Act (OWRA) and the Pesticides Act (PA) issued to: and the following information has been found:

No Active Orders are outstanding

Please Note: For information related to any ministry Orders issued to the property in question, **please request this information from the property owner.** If you would like further information regarding a specific Order issued, please contact the Ottawa District Office.

Date of Search: September 26, 2018

RECORD OF SITE CONDITION

For information on **Records of Site Condition** filed on the Environmental Site Registry since October 1, 2004, please use the following links:

For records of site condition filed between October 1, 2004 and June 30, 2011 https://www.lrcsde.lrc.gov.on.ca/besrWebPublic/generalSearch, and for records of site condition filed since July 1, 2011 https://www.ontario.ca/environment-and-energy/records-site-condition

INDEX OF NAMES FOR APPROVALS ISSUED SINCE 1999

A search of the Index Record of names of all persons to whom approvals have been issued, maintained by the Director, Approvals Branch and the Regional Director, *Eastern Region*, and the District Manager, *Ottawa District*, under Section 19 EPA and Section 13 OWRA and the following information has been provided:

Number

<u>Issued To</u> <u>Issue Date</u>

Section 9 EPA (Air)

Type

Section 39 EPA (Waste Management)

Section 52 OWRA (Water)

Section 53 OWRA (Municipal/Private/ Industrial Sewage)

Other

The **ministry's Access Environment** is an on-line, map-based search tool designed to allow the public, quick and easy access to the ministry approvals and registration information from December 1999 onward. Access Environment currently displays Environmental Compliance Approvals (ECA), Renewable Energy Approvals (REA) and registrations on the Environmental Activity and Sector Registry (EASR). ECAs include all Certificates of Approval (CofAs) previously issued under the Environmental Protection Act (EPA) and approvals previously issued under s.53 of the Ontario Water Resources Act (OWRA). You can access this information from the ministry website or at the following link:

www.accessenvironment.ene.gov.on.ca/AEWeb/ae/GoSearch.action?search=basic&lang=en

Copies of **ECAs issued before January 1, 2000** can be obtained by submitting a <u>Request for a Copy of an Environmental Compliance Approval</u>

Please Note:

- 1) The information provided above is based solely on the address(es) and name(s) of the present and past owners provided by you.
- The Index Record of Names to whom approvals have been issued, maintained by the Regional Director and District Manager, has been searched back to 1999.
- 3) A search of our records does **NOT** indicate whether there are:
 - other uses for which an approval may have been required, nor
 - other uses on the property or in the vicinity that may affect the suitability of the property, for the use proposed to be made of it. If a comprehensive knowledge of the property and the nearby lands and their environmental condition is required, you must examine them and other relevant records yourself, with the aid of a qualified person, if needed.

No Approvals have been issued.

Date of Search: September 26, 2018

Additional site information related to the **location of landfill sites** in the province can be found at the following link:

http://www.ontario.ca/environment-and-energy/small-landfill-sites

http://www.ontario.ca/environment-and-energy/map-large-landfill-sites

The ministry's Hazardous Waste Information Network (HWIN) can also be accessed to search for information on generators, carriers, and receivers of subject waste in the province at the following link: www.hwin.ca

The ministry's Environmental Compliance Reports provide information about contaminant discharges to water and emissions to air that exceed limits found in legislation, environmental approvals, orders and/or policies/guidelines and can be accessed at the following link: http://www.ontario.ca/environment-and-energy/environmental-compliance-reports

Information on Environmental Penalties, which are monetary penalties that can be imposed by the ministry for some industrial spills, can be assessed at the following link: https://www.ontario.ca/search/search-results?query=environmental%20penalties

Additional ministry information can be accessed through the Government of Ontario's Open Data Catalogue: http://www.ontario.ca/government/open-data-ontario

The ministry also encourages you to consider best practices and standards of care used within the legal community and through your associations as a guide to obtaining information related to specific property for any legal purpose.

We trust this information will help meet your requirements quickly and effectively.

Please advise your colleagues that responses to requests for searches always take some time. As a result the Ministry of the Environment and Climate Change may not be able to meet deadlines imposed by other parties on real estate and other transactions.

Thank you for your inquiry.

Signature:

Contact Name: Jéhanne Hurlbut

Title:

District Administrative Assistant

Address:

Ministry of the Environment, Conservation and Parks

2430 Don Reid Drive, Unit 103

Ottawa, ON K1H 1E1

Phone:

(613) 521-3450 Ext 221

Date:

September 26, 2018

E&OE

Please Note: If you would like to receive an email with all the environmental links above, please contact me at jehanne.hurlbut@ontario.ca and I will be pleased to send them to you. Ministry of the Environment, Conservation and Parks

Ottawa District Office 2430 Don Reid Drive, Suite 103 Ottawa ON K1H 1E1 Tel.: 613-521-3450 or 1-800-860-2195 Ministère de l'Environnement, de la Protection de la nature et des Parcs

Bureau du district d'Ottawa 2430, promenade Don Reid, Unité 103 Ottawa ON K1H 1E1 Tél.: 613-521-3450 ou 1-800-860-2195 Téléc.: 613-521-5437



OTT File No: 92

INDEX REVIEW REPORT COMMERCIAL/INDUSTRIAL/AGRICULTURAL

Attention:

Shihan A. Chowdhury

Your File:

Golder Associates

Date Received: September 24, 2018

Thank you for your inquiry requesting a search of records from the Ministry of the Environment, Conservation and Parks (ministry). The ministry encourages you to use the available on-line resources to access publically-available information which may assist with your inquiry.

PROPERTY OWNER AND LOCATION

Location:

Municipality:

Address:

578,580,582,586 Byron Avenue, Ottawa, ON

Lot

Concession

Township

INDEX OF NAMES FOR ORDERS

We have searched the *Ottawa* District Index Record of Active Orders under the Environmental Protection Act (EPA), Ontario Water Resources Act (OWRA) and the Pesticides Act (PA) issued to: and the following information has been found:

Please Note: For information related to any ministry Orders issued to the property in question, please request this information from the property owner. If you would like further information regarding a specific Order issued, please contact the Ottawa District Office.

Date of Search: September 27, 2018

RECORD OF SITE CONDITION

For information on **Records of Site Condition** filed on the Environmental Site Registry since October 1, 2004, please use the following links:

For records of site condition filed between October 1, 2004 and June 30, 2011 https://www.lrcsde.lrc.gov.on.ca/besrWebPublic/generalSearch, and for records of site condition filed since July 1, 2011 https://www.ontario.ca/environment-and-energy/records-site-condition

INDEX OF NAMES FOR APPROVALS ISSUED SINCE 1999

A search of the Index Record of names of all persons to whom approvals have been issued, maintained by the Director, Approvals Branch and the Regional Director, *Eastern Region*, and the District Manager, *Ottawa District*, under Section 19 EPA and Section 13 OWRA and the following information has been provided:

Type

Number

Issued To

Issue Date

Section 9 EPA (Air)

Section 39 EPA (Waste Management)

Section 52 OWRA (Water)

Section 53 OWRA (Municipal/Privatel Industrial Sewage)

Other

The ministry's Access Environment is an on-line, map-based search tool designed to allow the public, quick and easy access to the ministry approvals and registration information from December 1999 onward. Access Environment currently displays Environmental Compliance Approvals (ECA), Renewable Energy Approvals (REA) and registrations on the Environmental Activity and Sector Registry (EASR). ECAs include all Certificates of Approval (CofAs) previously issued under the Environmental Protection Act (EPA) and approvals previously issued under s.53 of the Ontario Water Resources Act (OWRA). You can access this information from the ministry website or at the following link:

www.accessenvironment.ene.gov.on.ca/AEWeb/ae/GoSearch.action?search=basic&lang=en

Copies of **ECAs issued before January 1, 2000** can be obtained by submitting a <u>Request for a Copy of an Environmental Compliance Approval</u>

Please Note:

- 1) The information provided above is based solely on the address(es) and name(s) of the present and past owners provided by you.
- The Index Record of Names to whom approvals have been issued, maintained by the Regional Director and District Manager, has been searched back to 1999.
- A search of our records does NOT indicate whether there are:
 - other uses for which an approval may have been required, nor
 - other uses on the property or in the vicinity that may affect the suitability of the property, for the use proposed to be made of it.

in a comprehensive knowledge of the property and the nearby lands and their environmental condition is required, you must examine them and other relevant records yourself, with the aid of a qualified person, if needed.

No Approvals have been issued.

Date of Search: September 27, 2018

Additional site information related to the location of landfill sites in the province can be found at the following link:

http://www.ontario.ca/environment-and-energy/small-landfill-sites

http://www.ontario.ca/environment-and-energy/map-large-landfill-sites

The ministry's Hazardous Waste Information Network (HWIN) can also be accessed to search for information on generators, carriers, and receivers of subject waste in the province at the following link: www.hwin.ca

The ministry's Environmental Compliance Reports provide information about contaminant discharges to water and emissions to air that exceed limits found in legislation, environmental approvals, orders and/or policies/guidelines and can be accessed at the following link: http://www.ontario.ca/environment-and-energy/environmental-compliance-reports

Information on Environmental Penalties, which are monetary penalties that can be imposed by the ministry for some industrial spills, can be assessed at the following link: https://www.ontario.ca/search/search-results?query=environmental%20penalties

Additional ministry information can be accessed through the Government of Ontario's Open Data Catalogue: http://www.ontario.ca/government/open-data-ontario

The ministry also encourages you to consider best practices and standards of care used within the legal community and through your associations as a guide to obtaining information related to specific property for any legal purpose.

We trust this information will help meet your requirements quickly and effectively.

Please advise your colleagues that responses to requests for searches always take some time. As a result the Ministry of the Environment and Climate Change may not be able to meet deadlines imposed by other parties on real estate and other transactions.

Thank you for your inquiry.

Signature:

Contact Name: Jéhanne Hurlbut

Title:

District Administrative Assistant

Address:

Ministry of the Environment, Conservation and Parks

2430 Don Reid Drive, Unit 103

Ottawa, ON K1H 1E1

Phone:

(613) 521-3450 Ext 221

Date:

September 27, 2018

E&OE

Please Note: If you would like to receive an email with all the environmental links above, please contact me at jehanne.hurlbut@ontario.ca and I will be pleased to send them to you.

Weeks, Heather

From: Chowdhury, Shihan

Sent: September-11-18 12:01 PM
To: 'jehanne.hurlbut@ontario.ca'

Subject: Request for Info on Properties in Westboro Area, Ottawa

Hi Jéhanne,

Hope this email finds you well.

I am working to complete a Phase I Environental Site Assessment for a location that includes multiple municipal addresses in Westboro Area, Ottawa. Requesting you to kindly check for any approvals and orders for these addresses listed below:

- 431 and 435 Ravenhill Avenue; and
- 578, 580, 582 and 586 Byron Avenue

Let me know if you have queries.

Appreciate your assistance in this regard.

Best regards,

Shihan A. Chowdhury, EIT | Junior Environmental Consultant | Golder Associates Ltd.
1931 Robertson Road, Ottawa, Ontario, Canada, K2H 5B7
T: +1 (613) 592 9600 | F: +1 (613) 592 9601 | C: +1 (613) 406-6892 | E: Shihan_Chowdhury@golder.comwww.golder.com

Work Safe, Home Safe

October 2018 1793155-1000

APPENDIX B

EcoLog ERIS Report, City Directories



Head Office: 80 Valleybrook Dr, Toronto, ON M3B 2S9
Physical Address: 38 Lesmill Rd, Toronto, ON M3B 2T5
Phone: 416-510-5204 • Fax: 416-510-5133
info@erisinfo.com • www.erisinfo.com

City Directory Information Source	
Vernon's Ottawa & Area, Ontario City Directory	

PROJECT NUMBER : 20180110165	
Site Address:	566 Byron Avenue, Ottawa, Ontario
Year: 2011	
Site Listing:	-Medical Office

PROJECT NUMBER : 20180110165	
Site Address:	566 Byron Avenue, Ottawa, Ontario
Year: 2006-07	
Site Listing:	-Medical Office

PROJECT NUMBER : 20180110165	
Site Address:	566 Byron Avenue, Ottawa, Ontario
Year: 2001-02	
Site Listing:	-Medical Office

PROJECT NUMBER : 20180110165	
Site Address:	566 Byron Avenue, Ottawa, Ontario
Year: 1996-97	
Site Listing:	-Medical Office

PROJECT NUMBER : 20180110165	
Site Address:	566 Byron Avenue, Ottawa, Ontario
Year: 1992	
Site Listing:	-Medical Office

PROJECT NUMBER : 20180110165	
Site Address:	566 Byron Avenue, Ottawa, Ontario
Year: 1987	
Site Listing:	-Westboro Dental Centre

PROJECT NUMBER : 20180110165	
Site Address:	566 Byron Avenue, Ottawa, Ontario
Year: 1981-82	
Site Listing:	-Westboro Dental Centre

PROJECT NUMBER: 20180110165	
Site Address:	566 Byron Avenue, Ottawa, Ontario
Year: 1976	
Site Listing:	-Westboro Dental Centre

PROJECT NUMBER : 20180110165	
Site Address:	566 Byron Avenue, Ottawa, Ontario
Year: 1971	
Site Listing:	-Dental Office

PROJECT NUMBER : 20180110165	
Site Address:	566 Byron Avenue, Ottawa, Ontario
Year: 1966	
Site Listing:	-Dental Office

PROJECT NUMBER: 20180110165	
Site Address:	566 Byron Avenue, Ottawa, Ontario
Year: 1961	
Site Listing:	-Dental Office

г

PROJECT NUMBER : 20180110165	
Site Address:	566 Byron Avenue, Ottawa, Ontario
Year: 1956	
Site Listing:	-Address Not Listed

⁻All listings for businesses were listed as they are in the city directory.

⁻Listings that are residential are listed as "residential" with the number of tenants. The name of the residential tenant is not listed in the above city directory

October 2018 1793155-1000

APPENDIX C

Site Photographs



Photo 1: Looking northwest at the Site, elevation of the buildings on Ravenhill Avenue (photo taken Jan 4, 2018).



Photo 2: Looking southwest at the Site, elevation of the buildings on Byron Avenue (photo taken Jan 4, 2018).



Photo 3: Looking southwest at the Site, elevation of the buildings on Roosevelt Avenue (photo taken Jan 4, 2018).



Photo 4: Looking northeast, construction of residential apartments on 415 and 419 Ravenhill Avenue (photo taken Jan 4, 2018).



Photo 5: Looking southwest, construction of residential apartments on 574-576 Byron Avenue (photo taken Jan 4, 2018).



Photo 6: Looking northeast, a typical residential home (425 Ravenhill Avenue) at the Site (photo taken Jan 4, 2018).



Photo 7: Looking northeast, a typical residential apartment (411 Ravenhill Avenue) at the Site (photo taken Jan 4, 2018).



Photo 8: Looking southeast, view of the commercial property (Dental Office) on Site located at 566 Byron Avenue (photo taken Jan 4, 2018).



Photo 9: View of the AST located southwest of the Dental Office building on 566 Byron Avenue (photo taken Jan 4, 2018).



Photo 10: View of the visible portion of the concrete pad underneath AST showing no evidence of stain/spills (photo taken Jan 4, 2018).

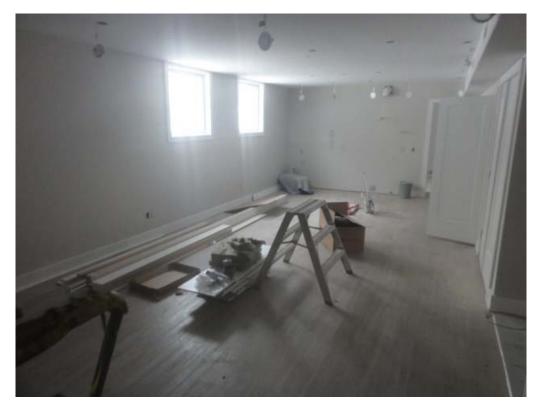


Photo 11: View of the under-construction basement of the ground floor unit in 411 Ravenhill Avenue (photo taken Jan 4, 2018).



Photo 12: View of an off-site pole mounted transformer to the southwest of the Site (photo taken Jan 4, 2018).



Photo 13: View of a pole mounted transformer on the southwest portion of the Site (photo taken Jan 4, 2018).



Photo 14: Looking northwest, at the residential apartments north of the Site (across Byron Avenue) (photo taken Jan 4, 2018).



Photo 15: Looking northeast, at the residential properties east of the Site (across Roosevelt Avenue) (photo taken Jan 4, 2018).



Photo 16: View of multi-tenant residential buildings northwest of the Site (578-586 Byron Avenue), looking southeast (photo taken Sep. 11, 2018).

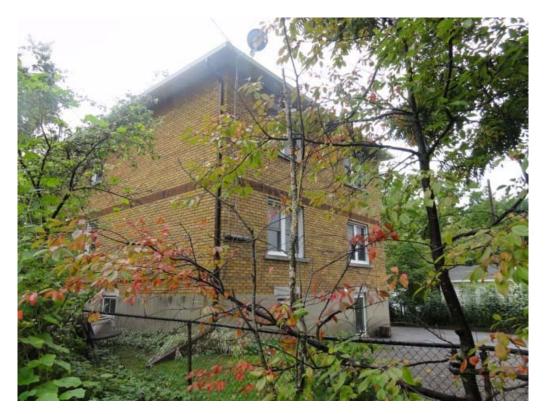


Photo 17: General view of the north and east elevation of the apartment building at 435 Ravenhill Avenue, located adjacent west of the Site (photo taken Sep. 11, 2018).



Photo 18: View of the south elevation of the residential home at 431 Ravenhill Avenue, located on the southwest portion of the Site (photo taken Sep. 11, 2018).



Photo 19: View of the double walled AST for furnace oil storage located in the basement of 431 Ravenhill Avenue (photo taken Sep. 11, 2018).



Photo 20: View of multi-tenant residential buildings on the northern portion of the Site (574-576 Byron Avenue), under construction during January site visit (photo taken Sep. 11, 2018).



Photo 21: View of excavation at 425 Ravenhill Avenue on southern portion of the Site, previously occupied by a single family residential home (photo taken Sep. 11, 2018).



Photo 22: General view of typical residential homes on Golden Avenue, located west of the Site (photo taken Sep. 11, 2018).



Photo 23 General view of the lawn bowling club at 439 Golden Avenue, located immediately west of the Site (photo taken Sep. 11, 2018).



golder.com