patersongroup

consulting engineers

re: Geotechnical Review - McKinnon's Creek Alterations Proposed residential Development Summerside West - Tenth Line Road - Ottawa

- to: David Schaeffer Engineering Limited Ms. Jennifer Ailey jailey@dsel.ca
- to: David Schaeffer Engineering Limited Mr. Steve Pichette spichette@dsel.ca
- to: Mattamy Homes Ms. Jillian Normand Jillian.Normand@mattamycorp.com
- date: October 30, 2018
- file: PG4049-MEMO.10 Revision 1

Further to your request and authorization, Paterson Group (Paterson) prepared the current memorandum to detail our geotechnical review of the McKinnon's Creek proposed alterations for the aforementioned site. It is understood that the creek alterations include a lowering of the channel bottom and steepening of the existing side slopes in several sections. Our review included a slope stability analysis of the proposed slope alterations based on the design drawing prepared by David Schaeffer Engineering Limited Drawing No. 1 - McKinnon's Creek, Proposed Alterations, Plan and Cross Sections, Project 15-766 dated October 11, 2018.

Slope Stability Analysis

The slope sections presented in the design drawing were reviewed by Paterson. Based on our review, Section C-C was noted to include a 2H:1V slope profile along the east side of the channel and a 3H:1V slope profile along the west side. The remainder of the proposed slope profiles were observed to be greater than 2H:1V. Therefore, Section C-C was analyzed to determine the global slope stability factor of safety as the worst case scenario for the proposed alterations. The slope stability analysis also considered a 2 m high preload above original ground surface. It should be noted that the assumed 2 m preload fill height is well above the design roadway and pathway grading adjacent to McKinnon's Creek along the west side and is approximately 0.5 m above anticipated lot grading for the lots adjacent to McKinnon's Creek along the east side of the alignment. It should also be noted that no preloading will be completed beyond the geotechnical limit of hazard lands. Also, it should be noted that a settlement surcharge program is not required for the lots, pathways or roadways adjacent to the subject alignment of McKinnon's Creek. Ms. Jillian Normand Page 2 PG4049-MEMO.10 Revision 1

The results of our analysis are presented in Figures 1a, 1b, 2a and 2b attached. Figures 1a and 1b present the results of our global slope stability analysis under static conditions for each side slope of the channel and Figures 2a and 2b present the analysis when considering the seismic loading. Based on our analysis results, Section C-C is considered stable with a global slope stability factor of safety of greater than 1.5 under static conditions and greater than 1.1 under seismic loading. Therefore, a slope stability setback is not required for the limit of hazard lands setback.

Limit of Hazard Lands

The subsurface profile along the subject alignment of McKinnon's Creek consists of a brown silty clay crust over a grey silty clay deposit based on the nearby boreholes along the alignment. Relevant borehole logs are attached to the present memorandum report. Based on our observations and soils along the slope profile, a 2 m toe erosion allowance is recommended for the subject alignment.

The limit of hazard lands designation line for the proposed McKinnon's Creek alterations consists of a 6 m erosion access allowance and a 2 m toe erosion allowance taken from the top of slope. Therefore, the limit of hazard lands setback consists of a 8 m setback from top of slope along both sides of the subject alignment of McKinnon's Creek.

We trust that this information satisfies your immediate requirements.

Best Regards,


Paterson Group Inc.


David J. Gilbert, P.Eng.





Paterson Group Inc.

Head Office and Laboratory 154 Colonnade Road South Ottawa - Ontario - K2E 7J5 Tel: (613) 226-7381 Fax: (613) 226-6344 Northern Office and Laboratory 63 Gibson Street North Bay - Ontario - P1B 8Z4 Tel: (705) 472-5331 Fax: (705) 472-2334 **St. Lawrence Office** 993 Princess Street - Suite 100 Kingston - Ontario - K7L 1H3 Tel: (613) 542-7381

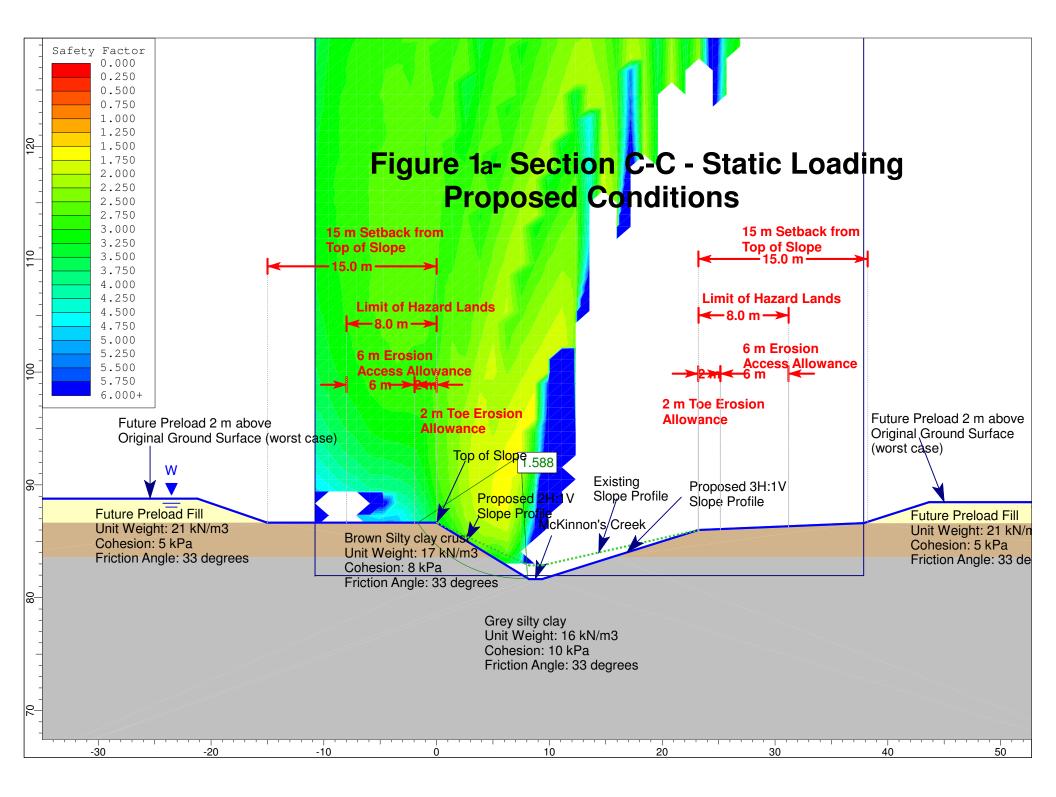

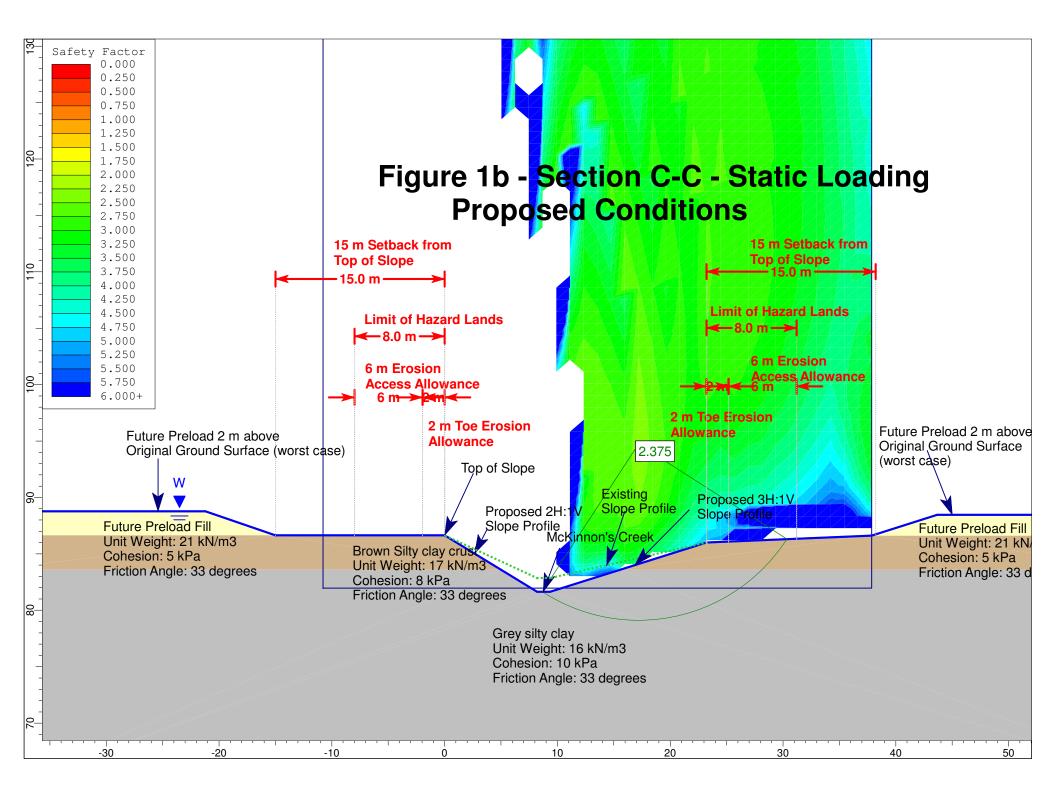

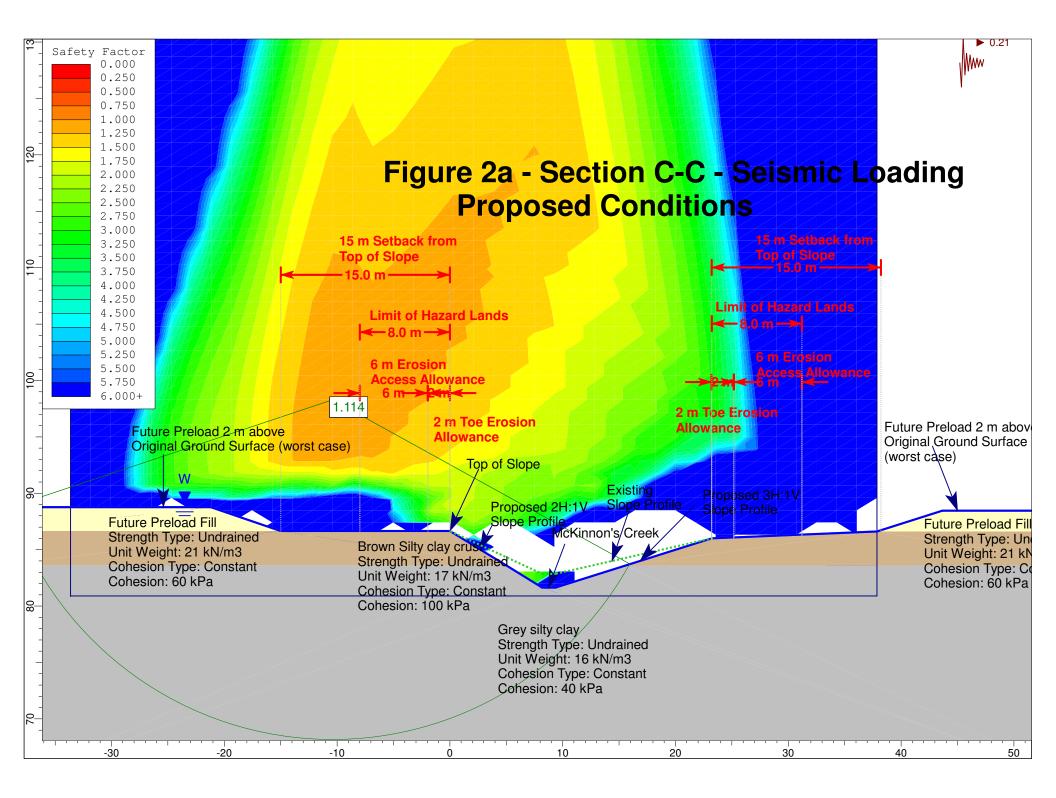

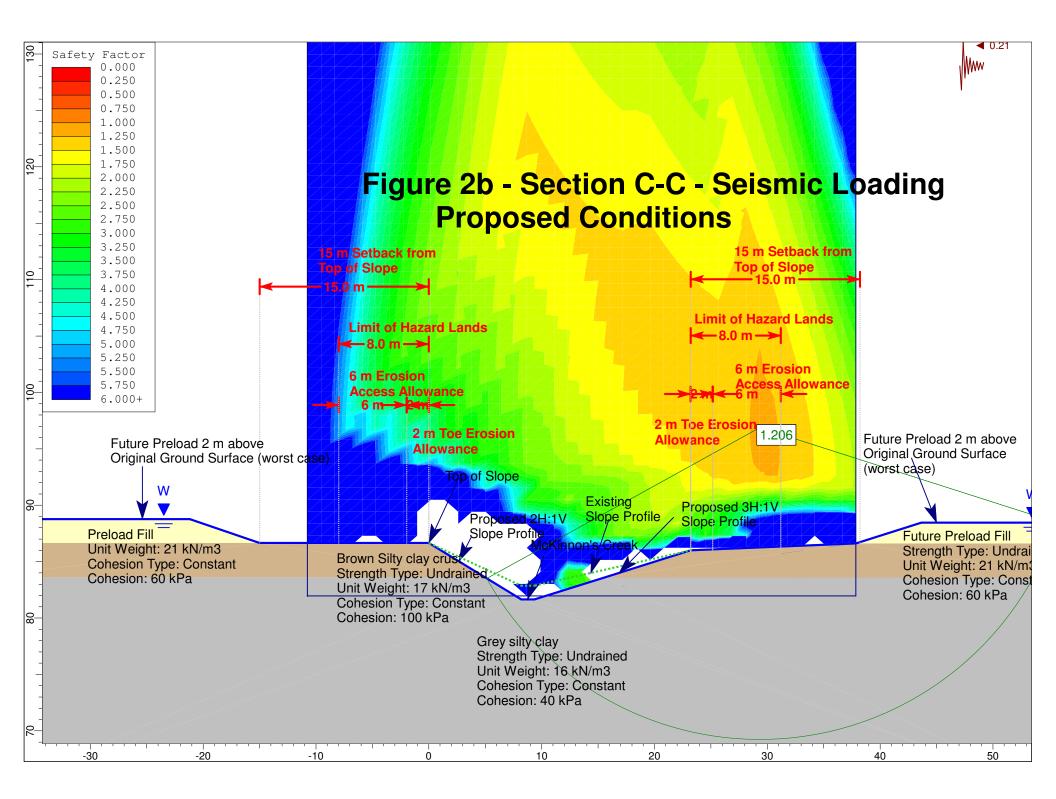

natoreonar		In	Con	sulting	1	SOI	L PRO	FILE AI	ND T	EST I	ΟΑΤΑ	
Patersongroup ^{Consulting} 154 Colonnade Road South, Ottawa, Ontario K2E 7J5				R	Geotechnical Residential Residential Development - Summerside West Phase 4 & 5 Tenth Line Road, Ottawa, Ontario							
DATUM Ground surface elevations				. Barn	_			ilawa, On	FILE		04040	
REMARKS									HOLI		G4049	
BORINGS BY CME 55 Power Auger		1		D	ATE	February	28, 2017	7		M	N 4A	
SOIL DESCRIPTION		SAMPLE				DEPTH	ELEV.	-	esist. Blows/0.3m 60 mm Dia. Cone			Nell D
	STRATA PLOT	ТҮРЕ	NUMBER	% RECOVERY	VALUE E ROD	(m) Manager Ma	(m)		Vater	Content	%	Monitoring Well Construction
GROUND SURFACE	ST	H	ŊŊ	REC	N O N U			20	40	60	80	Con
TOPSOIL		X AU	1			- 0-	-86.41			0		
Very stiff to stiff, brown SILTY CLAY, trace sand		ss	2	42	6	1.	-85.41	····	0 	<u>,</u>		ությունը ու հրագերությունը ու հրարերությունը ու ու հարերությունը ու հրարերությունը ու հրարերությունը ու հրարեր Խորունը ու հարերությունը ու հարերությունը ու հրարերությունը ու հետոներությունը ու հետոներությունը ու հետոներությ
2. <u>00</u>							-84.41 -83.41		/	/ 0 0		1 []
Firm, grey SILTY CLAY, trace sand						4	-82.41		0	0		
						5.	-81.41			Ó		
6.40 End of Monitoring Well (GWL @ 0.48m - May 2, 2017)						6	-80.41			0		
								20 Shea ▲ Undist		60 ength (kl △ Rem	Pa)	00

patersongroup Consulting 154 Colonnade Road South, Ottawa, Ontario K2E 7J5					SOIL PROFILE AND TEST DATA Geotechnical Residential Residential Development - Summerside West Phase 4 & 5 Tenth Line Road, Ottawa, Ontario							
REMARKS									HOLE	NO		
BORINGS BY CME 55 Power Auger				DA	TE	- ebruary	28, 2017	MW 6A			<u>бА</u>	
SOIL DESCRIPTION	PLOT		SAMPLE			DEPTH (m)	ELEV. (m)	Pen. Resist. Blows/0.3m • 50 mm Dia. Cone			<u> </u>	
	STRATA	ТҮРЕ	NUMBER	% RECOVERY	VALUE r RQD	ROD		• V	Vater Content %			
GROUND SURFACE	LS				N O L O			20	40	60 80	Monitoring W Construction	
TOPSOIL		au	1			- 0-	-86.17			0		
Very stiff to firm, brown SILTY CLAY, trace sand		SS	2	75	7	1-	-85.17		O. A		o Միկների հարերակուների հարերակութերութերությունը անդանդանդանդանդանդանդանդանդանդանդանդանդա	
<u>2.40</u>						2-	-84.17	4		2		
						3-	-83.17				0	
Firm, grey SILTY CLAY, trace sand						4-	-82.17				0	
						5-	-81.17				O	
End of Monitoring Well						6-	-80.17	<u> </u>			0	
(GWL @ 0.62m - May 2, 2017)												
								20 Shea ▲ Undist		60 80 ngth (kPa ∆ Remoul)	

SOIL PROFILE AND TEST DATA patersongroup Geotechnical Residential Residential Development - Summerside West Ph. 4 & 5 154 Colonnade Road South, Ottawa, Ontario K2E 7J5 Tenth Line Road, Ottawa, Ontario DATUM Ground surface elevations provided by J.D. Barnes Limited. FILE NO. **PG4049** REMARKS HOLE NO. **BH12-18** BORINGS BY CME 55 Power Auger DATE February 22, 2018 SAMPLE Pen. Resist. Blows/0.3m STRATA PLOT DEPTH ELEV. Piezometer Construction SOIL DESCRIPTION 50 mm Dia. Cone (m) (m) N VALUE or RQD RECOVERY NUMBER TYPE o/0 Water Content % Ο **GROUND SURFACE** 80 20 40 60 0 + 86.34TOPSOIL 0.28 AU 1 1+85.34 SS 2 5 58 A 2 + 84.34Very stiff to stiff, brown SILTY CLÁY, trace sand SS Ρ 3 100 - firm and grey by 2.3m depth 3+83.34 4+82.34 5 + 81.346+80.34 6.40 End of Borehole 20 40 60 80 100 Shear Strength (kPa) Undisturbed △ Remoulded

