



Geotechnical  
Engineering

Environmental  
Engineering

Hydrogeology

Geological  
Engineering

Materials Testing

Building Science

Archaeological  
Services

## Phase I Environmental Site Assessment

8 Withrow Avenue  
Ottawa, Ontario

Prepared For

Anglican Diocese of Ottawa

### Paterson Group Inc.

Consulting Engineers  
154 Colonnade Road South  
Ottawa (Nepean), Ontario  
Canada K2E 7J5

Tel: (613) 226-7381  
Fax: (613) 226-6344  
[www.patersongroup.ca](http://www.patersongroup.ca)

December 9, 2019

Report: PE4799-1

---

**TABLE OF CONTENTS**

EXECUTIVE SUMMARY.....ii

1.0 INTRODUCTION ..... 1

2.0 PHASE I PROPERTY INFORMATION..... 2

3.0 SCOPE OF INVESTIGATION..... 3

4.0 RECORDS REVIEW..... 4

    4.1 General..... 4

    4.2 Environmental Source Information ..... 5

    4.3 Physical Setting Sources ..... 7

5.0 INTERVIEWS ..... 9

6.0 SITE RECONNAISSANCE ..... 10

    6.1 General Requirements..... 10

    6.2 Specific Observations at the Phase I Property ..... 10

7.0 REVIEW AND EVALUATION OF INFORMATION ..... 13

    7.1 Land Use History ..... 13

    7.2 Conceptual Site Model..... 15

8.0 CONCLUSIONS ..... 17

9.0 STATEMENT OF LIMITATIONS..... 19

10.0 REFERENCES ..... 20

**List of Figures**

- Figure 1 - Key Plan
- Figure 2 - Topographic Map
- Drawing PE4799-1 – Site Plan
- Drawing PE4799-2 – Surrounding Land Use Plan

**List of Appendices**

- Appendix 1   Aerial Photographs  
                  Site Photographs
  
- Appendix 2   MECP Freedom of Information Request  
                  City of Ottawa HLUI Request  
                  Water Well Records  
                  TSSA Correspondence
  
- Appendix 3   Qualifications of Assessors

## **EXECUTIVE SUMMARY**

### **Assessment**

Paterson Group was retained by the Anglican Diocese of Ottawa to conduct a Phase I Environmental Site Assessment (Phase I-ESA) of 8 Withrow Avenue, in the City of Ottawa, Ontario. The purpose of this Phase I – Environmental Site Assessment was to research the past and current use of the site and study area and to identify any environmental concerns with the potential to have impacted the subject properties.

The subject site was first developed around 1955 with the church, hall and rectory. The subject site has remained largely unchanged since that date.

In the subject area, PCAs included various retail fuel outlets, garages and dry cleaners. Of these, three properties are believed to represent APECs and consist of two RFOs and a dry cleaners.

Following the historical review, a site visit was conducted. An underground storage tank, that stored fuel oil, is believed to be located towards the centre of the subject site and represents a PCA and an APEC.

### **Recommendations**

Based on the results of the Phase I - Environmental Site Assessment, it is our opinion that **a Phase II - Environmental Site Assessment is required for the subject site.**

Based on the age of the subject buildings, asbestos-containing materials (ACMs) are potentially present in the subject structures. These materials include drywall joint compound, plaster, stippled plaster, pipe insulation and vinyl tiles. Generally, these materials were in good condition with the exception of some of the pipe insulation. An asbestos survey of the building must be conducted in accordance with Ontario Regulation 278/05, under the Occupational Health and Safety Act, if one has not already been done.

Lead-based paint may be present on any remaining original surfaces within the buildings. It is recommended that original paint is tested for lead content prior to its disturbance. Major work involving lead-based paint or other lead-containing products must be done in accordance with Ontario Regulation 843, under the Occupational Health and Safety Act.

If the subject building is going to be demolished, the above-noted testing programs should be completed as part of a designated substance survey.

## **1.0 INTRODUCTION**

At the request of the Anglican Diocese of Ottawa, Paterson Group (Paterson) conducted a Phase I Environmental Site Assessment (Phase I ESA) for 8 Withrow Avenue, in the City of Ottawa, Ontario. The purpose of this Phase I ESA was to research the past and current use of the site and study area and to identify any environmental concerns with the potential to have impacted the subject property.

This report has been prepared specifically and solely for the above-noted project which is described herein. It contains all our findings and results of the environmental conditions at this site. Instruction to proceed was received from Ms. Anna Froehlich of CCOC Housing.

This Phase I-ESA report has been prepared in general accordance with the requirements of Ontario Regulation 153/04, as amended, under the Environmental Protection Act and also complies with the requirements of CSA Z768-01. The conclusions presented herein are based on information gathered from a limited historical review and field inspection program. The findings of the Phase I - ESA are based on a review of readily available geological, historical and regulatory information and a cursory review made at the time of the field assessment. The historical research relies on information supplied by others, such as local, provincial and federal agencies and was limited within the scope-of-work, time and budget of the project herein.

## 2.0 PHASE I PROPERTY INFORMATION

Address: 8 Withrow Avenue, Ottawa, Ontario.

Property Identification Number: 04689-0001.

Location: The subject site is situated on the western corner of the intersection between Withrow Avenue and Merivale Road, in the City of Ottawa. For the purpose of this report, Merivale Road is assumed to travel in a north-south direction.

Latitude and Longitude: 45° 21' 17" N, 75° 44' 12" W;

### **Site Description:**

Configuration: Irregular.

Site Area: 7,800 m<sup>2</sup> (approximate).

Zoning: AM10 – Arterial Main Street Zone  
I1B – Minor Institutional Zone.

Current Use: The subject site is currently occupied by a church fronting onto Merivale Road and a house (rectory) fronting on to Rossland Avenue.

Services: The subject site is located in a municipally serviced area.

### **3.0 SCOPE OF INVESTIGATION**

The scope of work for this Phase I – Environmental Site Assessment was as follows:

- Determine the historical activities on the subject site and study area by conducting a review of readily available records, reports, photographs, plans, mapping, databases and regulatory agencies;
- Investigate the existing conditions present at the subject site and study area by conducting site reconnaissance;
- Conduct interviews with persons knowledgeable of current and historic operations on the subject property and if warranted, neighbouring properties;
- Present the results of our findings in a comprehensive report in general accordance with the requirements of Ontario Regulation 269/11 amending O.Reg. 153/04 made under the Environmental Protection Act and in compliance with the requirements of CSA Z768-01;
- Provide a preliminary environmental site evaluation based on our findings;
- Provide preliminary remediation recommendations and further investigative work if contamination is suspected or encountered.

## 4.0 RECORDS REVIEW

### 4.1 General

#### Phase I-ESA Study Area Determination

A radius of approximately 250 m was determined to be appropriate as a Phase I ESA study area for this assignment. Properties outside the 250 m radius are not considered to have impacted the subject land, based on their significant distance from the site.

#### First Developed Use Determination

Based on the available sources, the property was first developed around 1955 as a church with a rectory.

#### Fire Insurance Plans

The fire insurance plans do not cover the area of the subject site.

#### City of Ottawa Street Directories

City directories at the National Archives were reviewed in approximate 10-year intervals from 1956 to 2011 as part of the Phase I ESA. A summary of PCAs in the Phase I study area is provided in the table below.

<b>Table 1: City Directories – Potentially Contaminating Activities (PCA) in Phase I Study Area</b>			
<b>Address</b>	<b>Listed Activity (years listed)</b>	<b>Distance / Orientation from site</b>	<b>APEC</b>
1528 Merivale Rd	Coin Laundry and King Cole Kleenette (1965 – 1975)	15 m north	Yes
1548 Merivale Rd	Shell RFO (2005) Merivale Service Centre (1984)	20 m south	Yes
1543 and 1545 Merivale Rd	Ultramar RFO (1996 – 2011) Spur Gas Bar (1975)	25 m east	Yes
1537 Merivale Rd	Sunoco RFO (1965 - 2005) Can Save RFO (1984)	55 m north	No
1533 Merivale Rd	Penzoil and Jiffy Lube (2011) Gulf Service Station (1984) Service Station (1965 – 1975)	90 m north	No
1523 Merivale Rd	Crown Cleaners (1996 - 2011) Spic Span Cleaners (1975)	160 m north	No
1529 Merivale Rd	Kwick Kopy (1996)	140 m north	No
1507 Merivale Rd	Garry's Service Station (1996)	250 m north	No

The site was first identified on the directory dating after 1970. No PCAs or APECs were identified on the subject site in the directories

Numerous PCAs were identified in the subject area. These consisted of RFOs, garages and dry cleaners. The King Cole Kleenette located north of the subject site and two of the RFOs are considered to represent APECs.

## **4.2 Environmental Source Information**

### **Environment and Climate Change Canada**

A search of the National Pollutant Release Inventory (NPRI) was conducted electronically on November 8, 2019. The subject site was not listed in the NPRI database. No records of pollutant release were listed in the database for properties located within the Phase I Study Area.

### **PCB Inventory**

A search of national PCB waste storage sites was conducted. No PCB waste storage sites were identified on the subject site or within a 250m radius.

### **Ontario Ministry of Environment (MECP) Instruments**

A request was submitted to the MECP Freedom of Information office for information with respect to certificates of approval, permits to take water, certificates of property use or any other similar MECP issued instruments for the site. At the time of the issuance of this report, a response had not been received. A copy of the response will be forwarded to the client, should it contain any pertinent information.

### **MECP Coal Gasification Plant Inventory**

The Ontario Ministry of Environment document titled "Municipal Coal Gasification Plant Site Inventory, 1991" was reviewed to reference the locations of former plants with respect to the site. No coal gasification plants were identified within the Phase I study area.

### **MECP Incident Reports**

A request was submitted to the MECP Freedom of Information office for information with respect to records concerning environmental incidents, orders, offences, spills, discharges of contaminants or inspections maintained by the MECP for the site or adjacent properties. At the time of the issuance of this report,



a response had not been received. A copy of the response will be forwarded to the client, should it contain any pertinent information.

### **MECP Waste Management Records**

A request was submitted to the MECP Freedom of Information office for information with respect to waste management records. At the time of the issuance of this report, a response had not been received. A copy of the response will be forwarded to the client, should it contain any pertinent information.

### **MECP Submissions**

A request was submitted to the MECP Freedom of Information office for information with respect to reports related to environmental conditions that have been submitted to the MECP. At the time of issuance of this report, a response had not been received. A copy of the response will be forwarded to the client, should it contain any pertinent information.

### **MECP Brownfields Environmental Site Registry**

A search of the MECP Brownfields environmental site registry was conducted electronically on November 11, 2019. Two (2) record of site condition (RSC) sites were listed in the database for properties within a 250 m radius of the subject site.

The nearest RSC property to the subject site is located at 1541 Merivale Road with the RSC filed on March 11, 2019. The property, located across Merivale Road from the subject site, was found to be impacted with PHC F1 and F2. Specifically, the soils and groundwater of the western portion of the 1541 Merivale Road property, closest to the subject site, were found to be impacted.

The other RSC was filed on June 20, 2011, for the property located at 1537 Merivale Road. The property was remediated, with validation sampling found to be in compliance with MECP standards.

### **MECP Waste Disposal Site Inventory**

The Ontario Ministry of Environment document titled "Waste Disposal Site Inventory in Ontario, 1991" was reviewed as part of the historical research. This document includes all recorded active and closed waste disposal sites, industrial manufactured gas plants and coal tar distillation plants in the Province of Ontario. No waste disposal sites were identified within the Phase I study area.

### **Areas of Natural and Scientific Interest (ANSI)**

A search for areas of natural significance and features within the Phase I study area was conducted on the web site of the Ontario Ministry of Natural Resources (MNR) on November 11, 2019. The search did not reveal any natural features or areas of natural significance within the Phase I study area.

### **Technical Standards and Safety Authority (TSSA)**

The TSSA, Fuels Safety Branch in Toronto, was contacted on November 12, 2019, to inquire about current and former underground/aboveground storage tanks, spills and incidents for the subject and neighbouring properties. The response details;

- five active and three expired records at 1548 Merivale Road,
- four expired records at 1537 Merivale Road,
- six active, three inactive and three expired reports at 1543 Merivale Road.

### **City of Ottawa Landfill Document**

The document entitled “Old Landfill Management Strategy, Phase I – Identification of Sites, City of Ottawa”, was reviewed. No former waste disposal sites were located within the Phase I study area.

### **City of Ottawa Historical Land Use Inventory**

A search of the City’s Historical Land Use Inventory (HLUI 2005) database for the subject property was conducted as part of the Phase I ESA. At the time of the issuance of this report, a response had not been received. A copy of the response will be forwarded to the client, should it contain any pertinent information.

### **Previous Engineering Reports**

No historical reports have been conducted at the subject site to our knowledge.

## **4.3 Physical Setting Sources**

### **Aerial Photographs**

Historical air photos from the National Air Photo Library were reviewed in approximate ten (10) year intervals. The review period dates back to the first available air photos for the site. Based on the review, the following observations have been made:

- |      |  |
|------|--|
| 1965 | A church occupies the central/eastern portion of the subject site at this time, while a dwelling occupied the western portion. The subject |
|------|--|

site occupies most of a city block between Withrow Avenue and Rossland Avenue and fronts onto Merivale Road. To the west of the subject site, the land appears to be residential in use while properties fronting onto Merivale Road appear to be mostly commercial.

- 1976      No significant changes have been made to the subject site. In the surrounding area, retail fuel outlets can be seen to the south, across Rossland Avenue and to the east across Merivale Road.
- 1991      No significant changes have been made to the subject site. In the subject area, retail fuel outlets can be identified immediately south of the subject site, to the east on the opposite side of Merivale Road and north of the intersection between Capilano Drive and Merivale Road. Significant commercial retail development has occurred east and north of the property.
- 2002      No significant changes have been made to the subject site or surrounding properties.
- 2011      The house on the western portion of the subject site was extended at this time. The RFO north of the intersection between Capilano Drive and Merivale Road was demolished at this time.
- 2017      No significant changes have been made to the subject site or surrounding properties.

Laser copies of selected aerial photographs reviewed are included in Appendix 1.

### **Topographic Maps**

Topographic maps were obtained from Natural Resources Canada - The Atlas of Canada website. The topographic maps indicate that the subject site and surrounding area slopes down gently to the south and southwest. An illustration of the referenced topographic map is present in Figure 2 - Topographic Map following the body of this report.

### **Physiographic Maps**

A Physiographic Map was reviewed from the Natural Resources Canada - The Atlas of Canada website. According to this physiographic map, the site is located in the St. Lawrence Lowlands. According to the mapping description provided: "The lowlands are plain-like areas that were all affected by the Pleistocene glaciations and are therefore covered by surficial deposits and other features associated with the ice sheets." The subject site is located in the Central St.

Lawrence Lowland, “where the land is rarely more than 150 m above sea level, except for the Monteregian Hills, which consist of intrusive igneous rocks”.

### **Geological Maps**

The Geological Survey of Canada website on the Urban Geology of the National Capital Area was consulted as part of this assessment. Based on the information from NRCAN, bedrock in the area of the site consists of dolostone and sandstone of the Beekmantown Group. Based on the maps, the thickness of overburden is anticipated to be around 1 m and consists of glacial till.

### **Water Well Records**

A search of the MECP’s web site for all drilled well records within 250 m of the subject site was conducted on November 8, 2019. The search identified 71 records in the subject area, dating from 1949 to 2016. Of these, 44 records detailed water supply wells with 27 recording monitoring wells.

Two wells were recorded on the subject site and consisted of water supply wells serving the rectory and church. These wells were drilled in 1955 and 1957. Given the municipally supplied area, potable water wells in the subject area are expected to be obsolete.

The well records on the subject site record a nominal thickness soil, if any, overlying limestone bedrock. Groundwater was encountered around 35 m depth.

### **Water Bodies and Areas of Natural Significance**

There are no waterbodies or areas of natural and scientific interest on the subject site or within the study area.

## **5.0 INTERVIEWS**

### **Property Owner Representative**

As part of this assessment, Mr. Stephen Lane, the church custodian, met with Paterson personnel to provide access and answer questions. Mr. Lane has been involved with the church since around 1980. Mr. Lane gave a detailed tour of the property, describing the history and use of each area of the buildings. He reported that the original church hall and rectory were constructed around 1955.

No major renovations have been completed in recent years. Mr. Lane pointed out the furnace and basement sump, explaining how it once drained to an external dry

well (the location of which is unknown) however, it now discharges to the city sewer. He also pointed out the location of the former underground storage tank (UST) that stored fuel oil for the furnace before it was converted to natural gas. The UST is reportedly still in place, however, it is understood to be empty.

Mr. Lane was unaware of any environmental issues with regard to the subject site.

## **6.0 SITE RECONNAISSANCE**

### **6.1 General Requirements**

The site assessment was conducted on November 19, 2019. Weather conditions were sunny, with a temperature of approximately -5 °C. Mr. Philip Price from the Environmental Department of Paterson Group conducted the site visit. In addition to the site, the uses of neighbouring properties within the Phase I study area were also assessed at the time of the site reconnaissance.

### **6.2 Specific Observations at the Phase I Property**

#### **Buildings and Structures**

The subject site is occupied by a multi-use institutional building, with space for worship, a community hall, kitchen, daycare/preschool, book shop, second-hand shop and storage/office spaces. A detached rectory was located to the rear of the subject site.

The church is constructed on with a basement level finished with concrete blockwork walls and poured concrete floor. The hall and southern portion of the property is partly underlain by the basement/tunnels and partly constructed on a slab-on-grade. The buildings are currently heated by natural gas-fired furnaces located in the basements, supplemented by electric baseboard heaters and radiators. Previously, the buildings were heated by oil-fired furnaces with a UST believed to be located outside the church hall. It is believed that the rectory was historically heated by an oil-fired furnace though no evidence of this was seen. The rectory is currently heated by a natural gas-fired furnace.

#### **Site Features**

The subject buildings occupy around 20% of the property with the remainder set to a mix of parking lots, landscaping and children's play area. Adjacent properties are approximately at grade with respect to the subject site. Site drainage consists of infiltration and runoff towards the adjacent roadways.

### **Below Ground Structures**

The general location of a historical UST was pointed out during the site visit which was reportedly located left of the porch towards the centre of the subject site. No vent or fill pipes could be identified to confirm the location.

The property is understood to have been on a private septic system prior to its connection to the city sewer. The exact location of the septic system was not known.

### **Potable Water Source**

The subject property is municipally serviced.

### **Potential Environmental Concerns**

#### **Waste Management**

Waste is stored at the rear (west) of the property and is collected by the city.

#### **Wastewater Discharge**

Wastewater is discharged to the municipal sewer system.

#### **Potable Wells**

No potable wells were observed on the subject site.

#### **Railway Lines**

No railway lines were observed on the subject site or within the Phase I ESA study area.

#### **Polychlorinated Biphenyls (PCBs)**

No transformers were observed on the subject site.

#### **Unidentified Substances**

There were no unidentified substances on the exterior of the subject property at the time of this assessment.

### **Interior Assessment**

A general assessment of the interior of the buildings is as follows:

- The floors consisted of concrete, several styles of vinyl tile, hardwood, carpet and terrazzo.
- The walls consisted of poured concrete, concrete block and drywall.
- The ceilings consisted of stippled plaster, plaster and suspended tiles.
- Lighting throughout the buildings was of incandescent and fluorescent fixtures.

### **Potentially Hazardous Building Products**

#### **Asbestos Containing Materials (ACMs)**

Based on the approximate age of the buildings (1955), asbestos-containing materials may have been used during construction and may still be present within the structures. These materials include drywall joint compound, plaster, stippled plaster, pipe insulation and vinyl tiles. Generally, materials were in good condition with the exception of some of the pipe insulation.

#### **Lead-Based Paint**

Based on the age of the buildings (1955), there is the potential for lead-based paints to be present. Painted surfaces were generally in good condition.

#### **Polychlorinated Biphenyls (PCBs)**

No potentially PCB containing materials were observed during our site inspection.

#### **Urea Formaldehyde Foam Insulation (UFFI)**

No signs of UFFI were noted at the time of the site visit, however it should be noted that interior wall and ceiling cavities were not inspected for insulation type at the time of the site visit.

### **Other Potential Environmental Concerns**

#### **Wastewater Drainage**

Wastewater drainage from the building is expected to drain into the City of Ottawa sewer system. Two sump pits were located in the basement. The water appeared clear with no sheen.

**☐ Ozone Depleting Substances (ODSs)**

Potential sources of ODSs observed on-site include fire extinguishers, coolers, refrigerators and air conditioning units. These appliances should be regularly serviced by a licensed contractor.

**Neighbouring Properties**

An inspection of the neighbouring properties was conducted from publicly accessible roadways at the time of the site inspection. Land use adjacent to the subject site was as follows:

- ☐ North - Withrow Avenue followed by residential and commercial retail land.
- ☐ East - Merivale Road with an Ultramar RFO and commercial retail land beyond.
- ☐ South - Rossland Avenue followed by a Shell RFO and school, with commercial retail land beyond.
- ☐ West - Residential land followed by St. Helen’s Place, with further residential land beyond.

Land use within the Phase I study area is shown on Drawing PE4799-2 - Surrounding Land Use Plan.

**7.0 REVIEW AND EVALUATION OF INFORMATION**

**7.1 Land Use History**

The following table indicates the current and past uses of the site dating back to the first developed use of the site.

<b>Table 2: Land Use History</b>			
<b>Time Period</b>	<b>Land Use</b>	<b>Potentially Contaminating Activities</b>	<b>Areas of Potential Environmental Concern</b>
1955 to present	Church/rectory	UST	UST

**Potentially Contaminating Activities (PCAs)**

The presence of the former heating oil UST is considered a PCA and APEC on the subject site. In the subject area, six PCAs were identified consisting of RFOs, dry



cleaners and vehicle maintenance garages. Of the PCAs, the King Cole Kleenette, located north of the subject site and two of the RFOs are considered to represent APECs on the subject site. These Potentially Contaminating Activities are shown on Drawing PE4799-2 Surrounding Land Use Plan.

**Areas of Potential Environmental Concern (APEC)**

<b>Table 3: Areas of Potential Environmental Concern</b>					
<b>Areas of Potential Environmental Concern</b>	<b>Location of APEC with respect to Phase I Property</b>	<b>Potentially Contaminating Activity</b>	<b>Location of PCA (on-site or off-site)</b>	<b>Contaminants of Potential Concern</b>	<b>Media Potentially Impacted</b>
Former heating oil UST	The central portion of the Phase I ESA property	Item 28 - Gasoline and Associated Products Storage in Fixed UST	On-Site	PHCs, BTEX	Soil and groundwater
King Cole Kleenette, 1528 Merivale Road	The northern portion of Phase I ESA property	Item 37 - operation of dry cleaning equipment	Off-Site	VOCs	Groundwater
Retail Fuel Outlet, 1548 Merivale Road	The southern portion of Phase I ESA property	Item 28 - Gasoline and Associated Products Storage in Fixed UST	Off-Site	PHCs, BTEX	Soil and groundwater
Retail Fuel Outlet, 1543 Merivale Road	Eastern portion of Phase I ESA property	Item 28 - Gasoline and Associated Products Storage in Fixed UST	Off-Site	PHCs, BTEX	Soil and groundwater

**Contaminants of Potential Concern (CPC)**

Based on the APECs, the following Contaminants of Potential Concern (CPCs) have been identified:

- Petroleum Hydrocarbons Fractions 1 through 4 (PHCs F1-F4) – this suite of parameters encompasses gasoline (Fraction 1), diesel and fuel oil (Fraction 2), and heavy oils (Fractions 3 and 4). PHCs F1-F4 were selected as CPCs for the Phase I property based on the presence of a fuel storage tank (UST) on site and at the neighbouring retail fuel outlets.
- Benzene, Toluene, Ethylbenzene, and Xylenes (BTEX) were selected as CPCs for the Phase I property based on the presence of a fuel storage tank (UST) on site and at the neighbouring retail fuel outlets.
- Volatile Organic Compounds (VOCs) were selected as CPCs for the Phase I property due to the historical offsite drycleaners.

## **7.2 Conceptual Site Model**

### **Geological and Hydrogeological Setting**

Based on the information from NRCAN, bedrock in the area of the site consists of dolostone and sandstone of the Beekmantown Group. Based on the maps, the thickness of overburden is anticipated to be around 1 m and consists of glacial till.

### **Contaminants of Potential Concern**

As per Section 7.1 of this report, CPCs identified on the subject site include PHCs and VOCs including BTEX.

### **Existing Buildings and Structures**

The subject site is occupied by church and rectory, first constructed around 1955.

### **Water Bodies**

There are no waterbodies on the subject property or within the Phase I ESA study area.

### **Areas of Natural Significance**

There are no areas of natural and scientific interest on the subject property or within the Phase I ESA study area.

### **Drinking Water Wells**

Records of 71 wells were found in the study area, consisting of 44 water supply wells and 27 observation/monitoring wells.

Two wells were recorded on the subject site and consisted of water supply wells serving the rectory and church. These wells were drilled in 1955 and 1957. Given the municipally supplied area, potable water wells in the subject area are expected to be obsolete.

### **Neighbouring Land Use**

Neighbouring land use in the Phase I study area consists of residential, institutional and commercial properties. Land use is shown on Drawing PE4799-2 Surrounding Land Use Plan.

## **Potentially Contaminating Activities and Areas of Potential Environmental Concern**

As per Section 7.1 of this report, Potentially Contaminating Activities and Areas of Potential Environmental Concern were identified within the Phase I ESA study area.

### **Assessment of Uncertainty and/or Absence of Information**

The information available for review as part of the preparation of this Phase I ESA is considered to be sufficient to conclude that there are areas of potential environmental concern on the subject site. The presence of potentially contaminating activities was confirmed by a variety of independent sources, and as such, the conclusions of this report are not affected by uncertainty which may be present with respect to the individual sources.

## 8.0 CONCLUSIONS

### Assessment

Paterson Group was retained by the Anglican Diocese of Ottawa to conduct a Phase I Environmental Site Assessment (Phase I-ESA) of 8 Withrow Avenue, in the City of Ottawa, Ontario. The purpose of this Phase I – Environmental Site Assessment was to research the past and current use of the site and study area and to identify any environmental concerns with the potential to have impacted the subject properties.

The subject site was first developed around 1955 with the church, hall and rectory. The subject site has remained largely unchanged since that date.

In the subject area, PCAs included various retail fuel outlets, garages and dry cleaners. Of these, three properties are believed to represent APECs and consist of two RFOs and a dry cleaners.

Following the historical review, a site visit was conducted. An underground storage tank, that stored fuel oil, is believed to be located towards the centre of the subject site and represents a PCA and an APEC.

### Recommendations

Based on the results of the Phase I - Environmental Site Assessment, it is our opinion that **a Phase II - Environmental Site Assessment is required for the subject site.**

Based on the age of the subject buildings, asbestos-containing materials (ACMs) are potentially present in the subject structures. These materials include drywall joint compound, plaster, stippled plaster, pipe insulation and vinyl tiles. Generally, these materials were in good condition with the exception of some of the pipe insulation. An asbestos survey of the building must be conducted in accordance with Ontario Regulation 278/05, under the Occupational Health and Safety Act, if one has not already been done.

Lead-based paint may be present on any remaining original surfaces within the buildings. It is recommended that original paint is tested for lead content prior to its disturbance. Major work involving lead-based paint or other lead-containing products must be done in accordance with Ontario Regulation 843, under the Occupational Health and Safety Act.

If the subject building is going to be demolished, the above-noted testing programs should be completed as part of a designated substance survey.

## 9.0 STATEMENT OF LIMITATIONS

This Phase I - Environmental Site Assessment report has been prepared in general accordance with O.Reg. 153/04, as amended, and meets the requirements of CSA Z768-01. The conclusions presented herein are based on information gathered from a limited historical review and field inspection program. The findings of the Phase I - ESA are based on a review of readily available geological, historical and regulatory information and a cursory review made at the time of the field assessment. The historical research relies on information supplied by others, such as local, provincial and federal agencies and was limited within the scope-of-work, time and budget of the project herein.

Should any conditions be encountered at the subject site and/or historical information that differs from our findings, we request that we are notified immediately in order to allow for a reassessment.

This report was prepared for the sole use of the Anglican Diocese of Ottawa. Permission and notification from the above-noted party and Paterson will be required to release this report to any other party.

### **Paterson Group Inc.**



Philip Price, BSc.



Mark S. D'Arcy, P.Eng., Q.P. ESA



### **Report Distribution:**

- Anglican Diocese of Ottawa
- Paterson Group

## **10.0 REFERENCES**

### **Federal Records**

Air photos at the Energy Mines and Resources Air Photo Library.  
National Archives.  
Maps and photographs (Geological Survey of Canada surficial and subsurface mapping).  
Natural Resources Canada – The Atlas of Canada.  
Environment Canada, National Pollutant Release Inventory.  
PCB Waste Storage Site Inventory.

### **Provincial Records**

MECP Freedom of Information and Privacy Office.  
MECP Municipal Coal Gasification Plant Site Inventory, 1991.  
MECP document titled “Waste Disposal Site Inventory in Ontario”.  
MECP Brownfields Environmental Site Registry.  
Office of Technical Standards and Safety Authority, Fuels Safety Branch.  
MNR Areas of Natural Significance.  
MECP Water Well Inventory.

### **Municipal Records**

The City of Ottawa Historical Land Use Inventory.  
The City of Ottawa geoOttawa website.

### **Local Information Sources**

Personal Interviews.

### **Public Information Sources**

Google Earth.  
Google Maps/Street View

# **FIGURES**

**FIGURE 1 – KEY PLAN**

**FIGURE 2 – TOPOGRAPHIC MAP**

**DRAWING PE4799-1 – SITE PLAN**

**DRAWING PE4799-2 – SURROUNDING LAND USE PLAN**



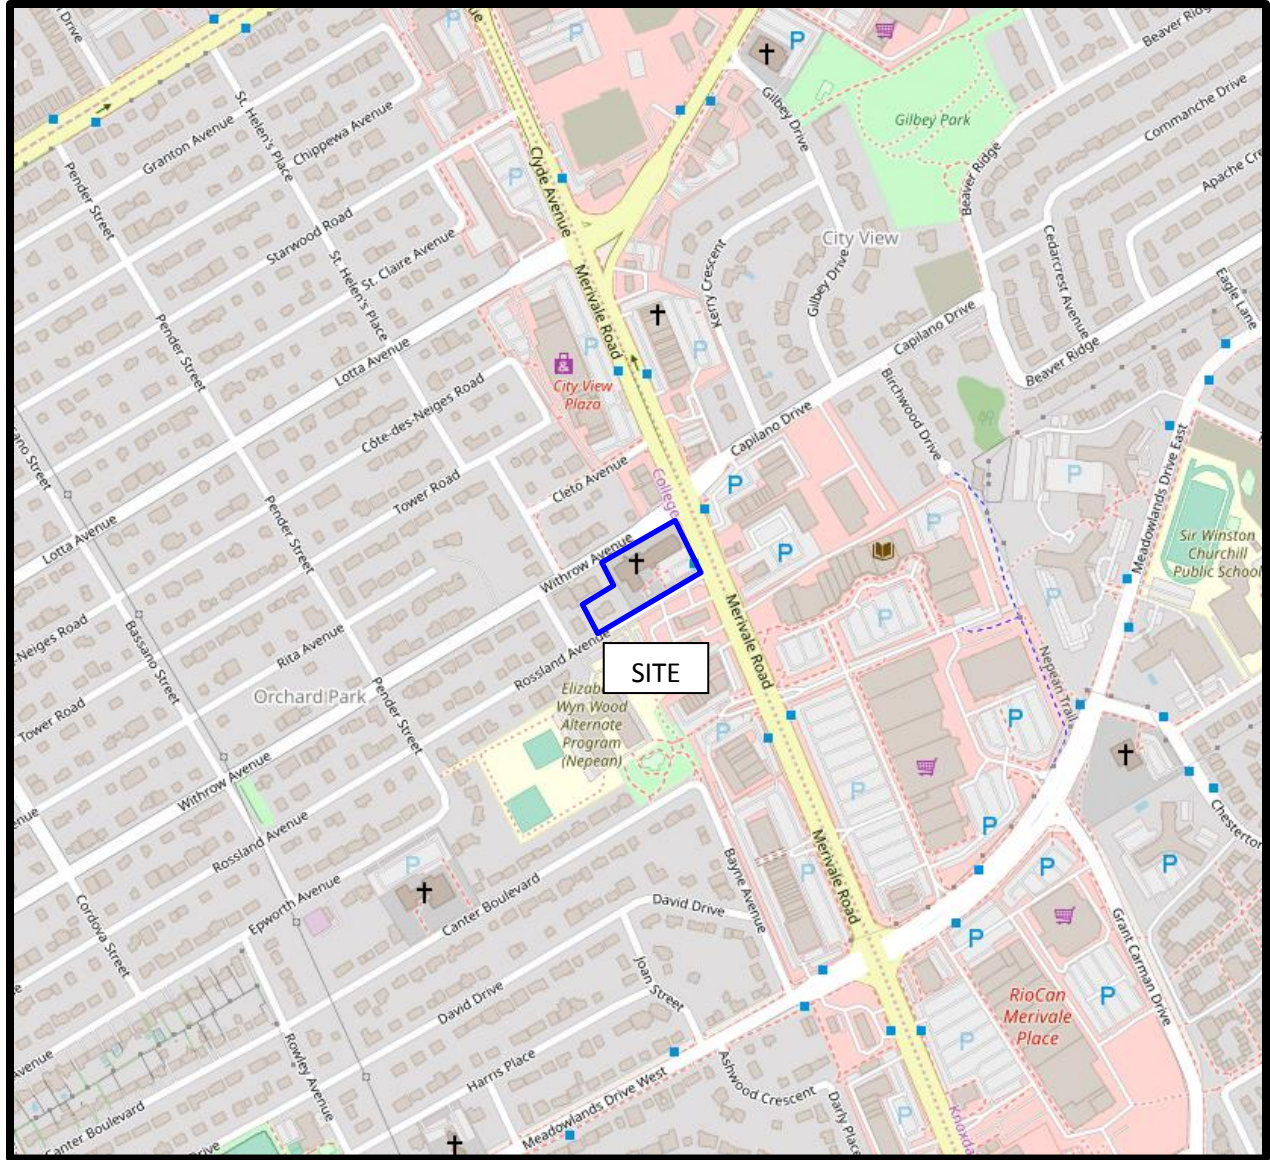


FIGURE 1  
KEY PLAN


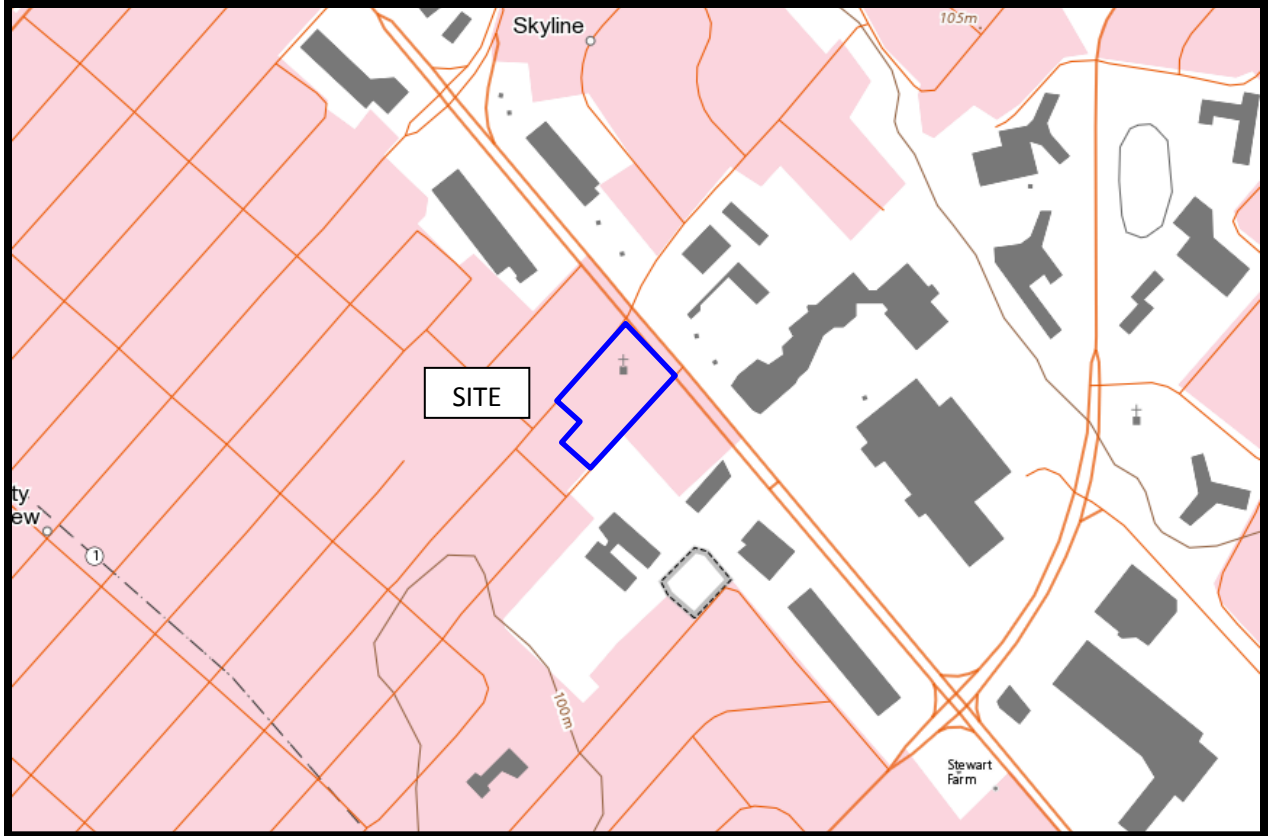


FIGURE 2  
TOPOGRAPHIC MAP

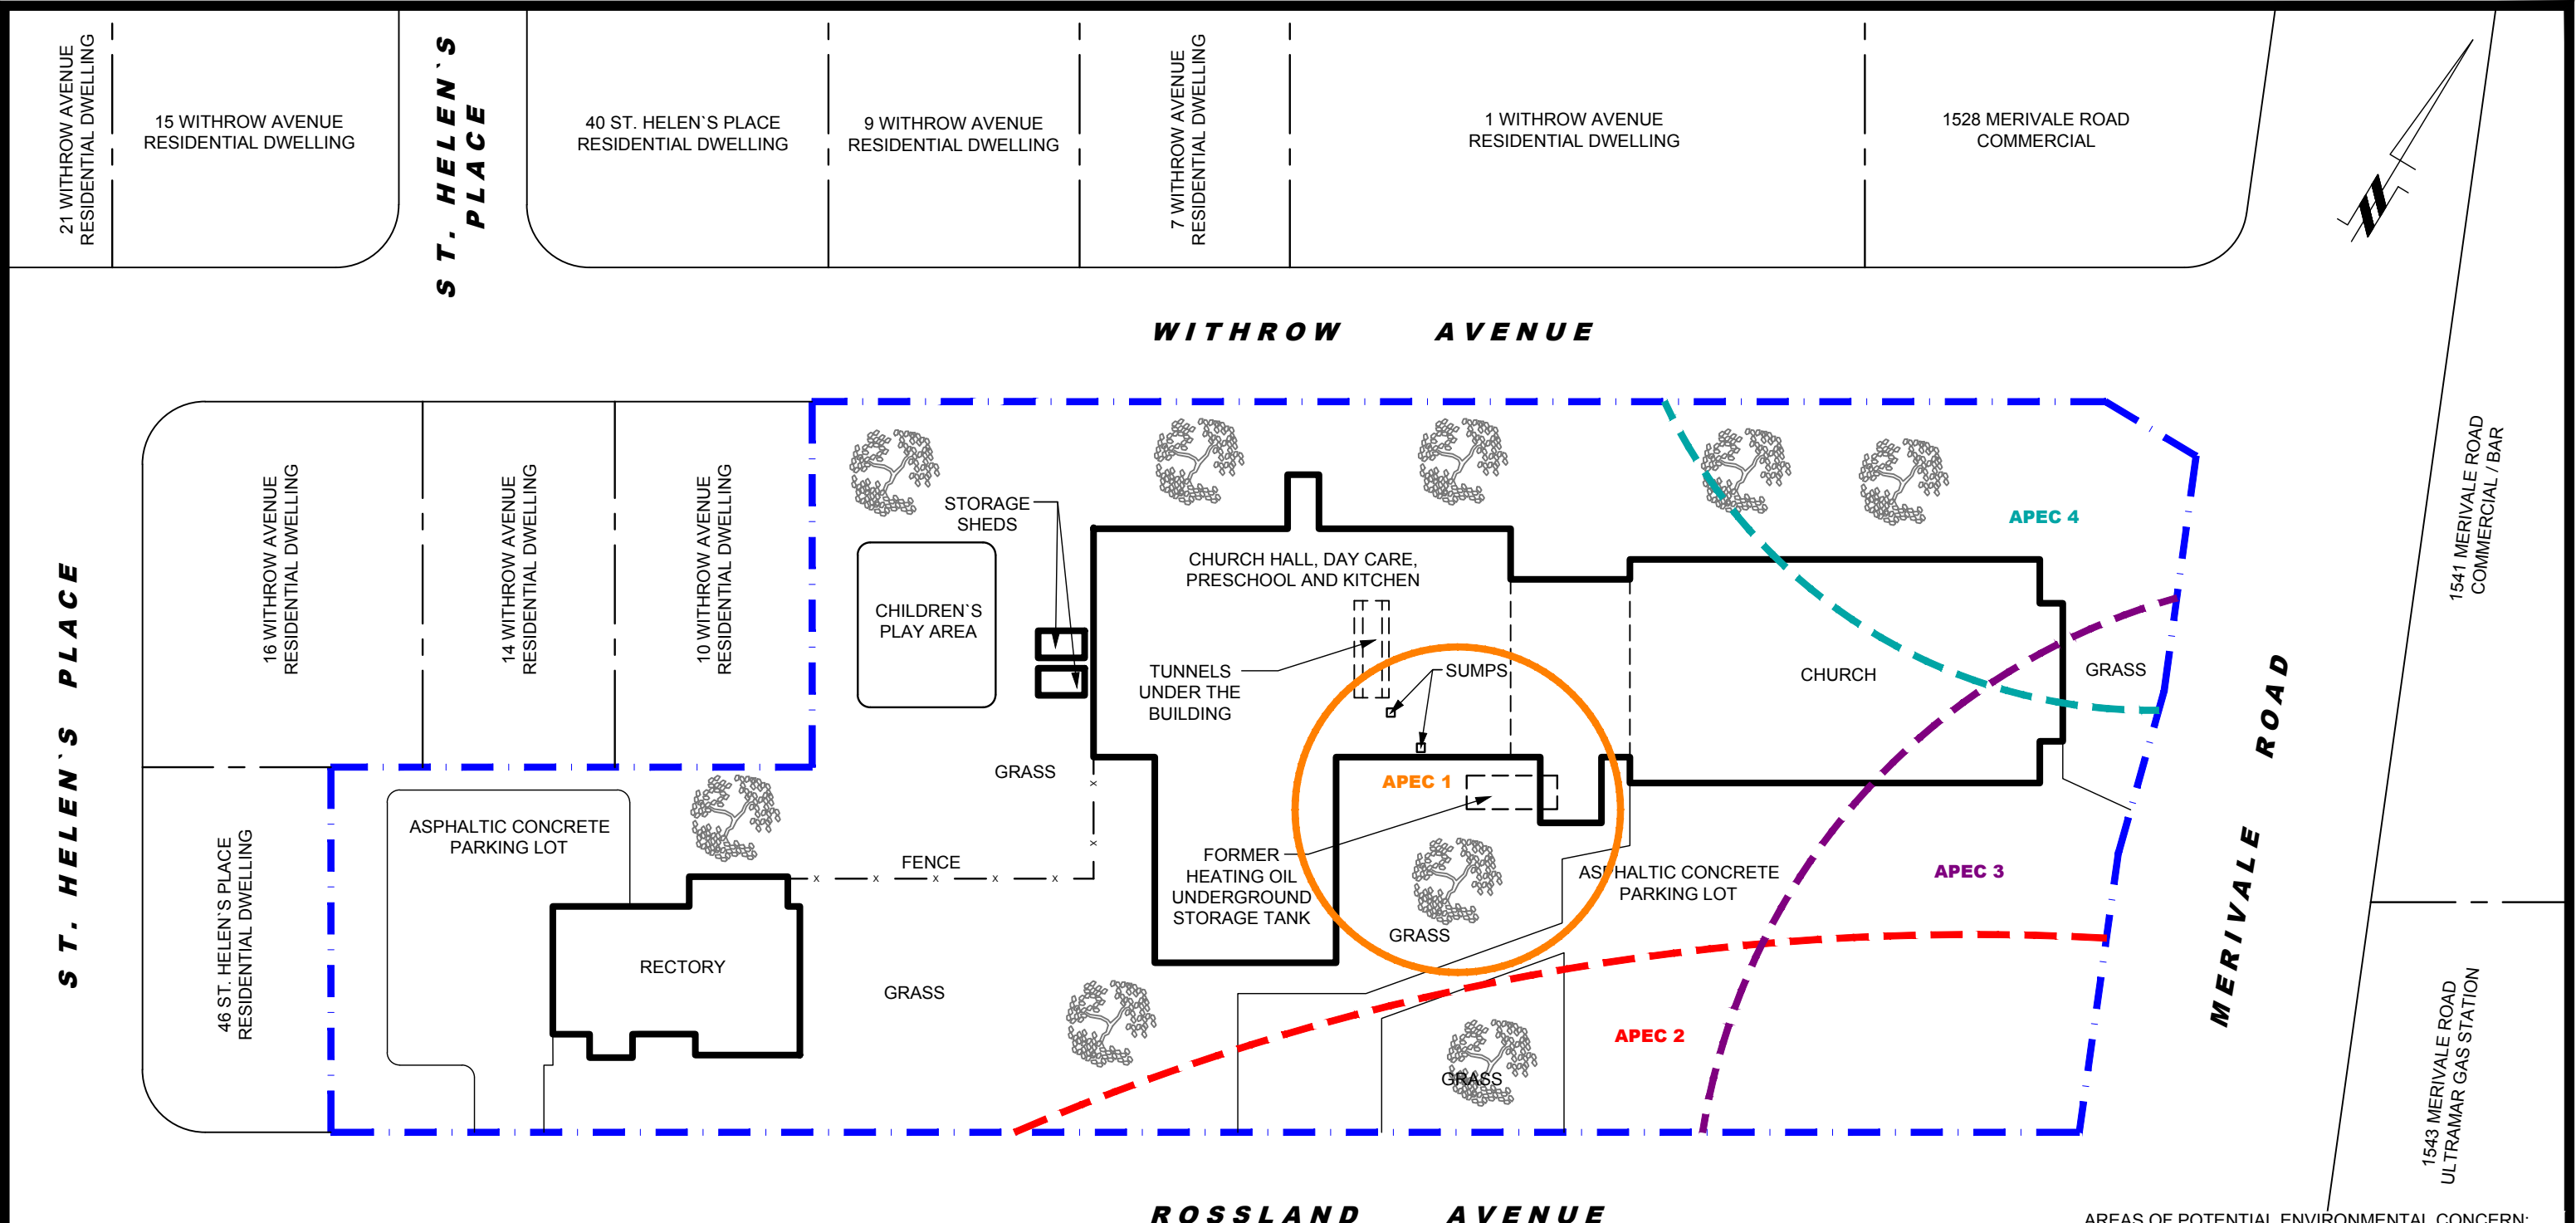

**AREAS OF POTENTIAL ENVIRONMENTAL CONCERN:**

- 1) 8 WITHROW AVENUE- HEATING OIL UNDERGROUND STORAGE TANK
- 2) RESULTING FROM SHELL SERVICE STATION ON 1548 MERIVALE ROAD
- 3) RESULTING FROM ULTRAMAR GAS STATION ON 1543 MERIVALE ROAD
- 4) RESULTING FROM FORMER KING COLE KLEENETTE ON 1528 MERIVALE ROAD

**patersongroup**  
consulting engineers

154 Colonnade Road South  
Ottawa, Ontario K2E 7J5  
Tel: (613) 226-7381 Fax: (613) 226-6344


NO.	REVISIONS	DATE	INITIAL

**ANGLICA DIOCESE OF OTTAWA**  
**PHASE I - ENVIRONMENTAL SITE ASSESSMENT**  
**8 WITHROW AVENUE**

OTTAWA, ONTARIO

**SITE PLAN**

Scale:	1:500	Date:	11/2019
Drawn by:	YA	Report No.:	PE4799-1
Checked by:	PP	Dwg. No.:	<b>PE4799-1</b>
Approved by:	MSD	Revision No.:	

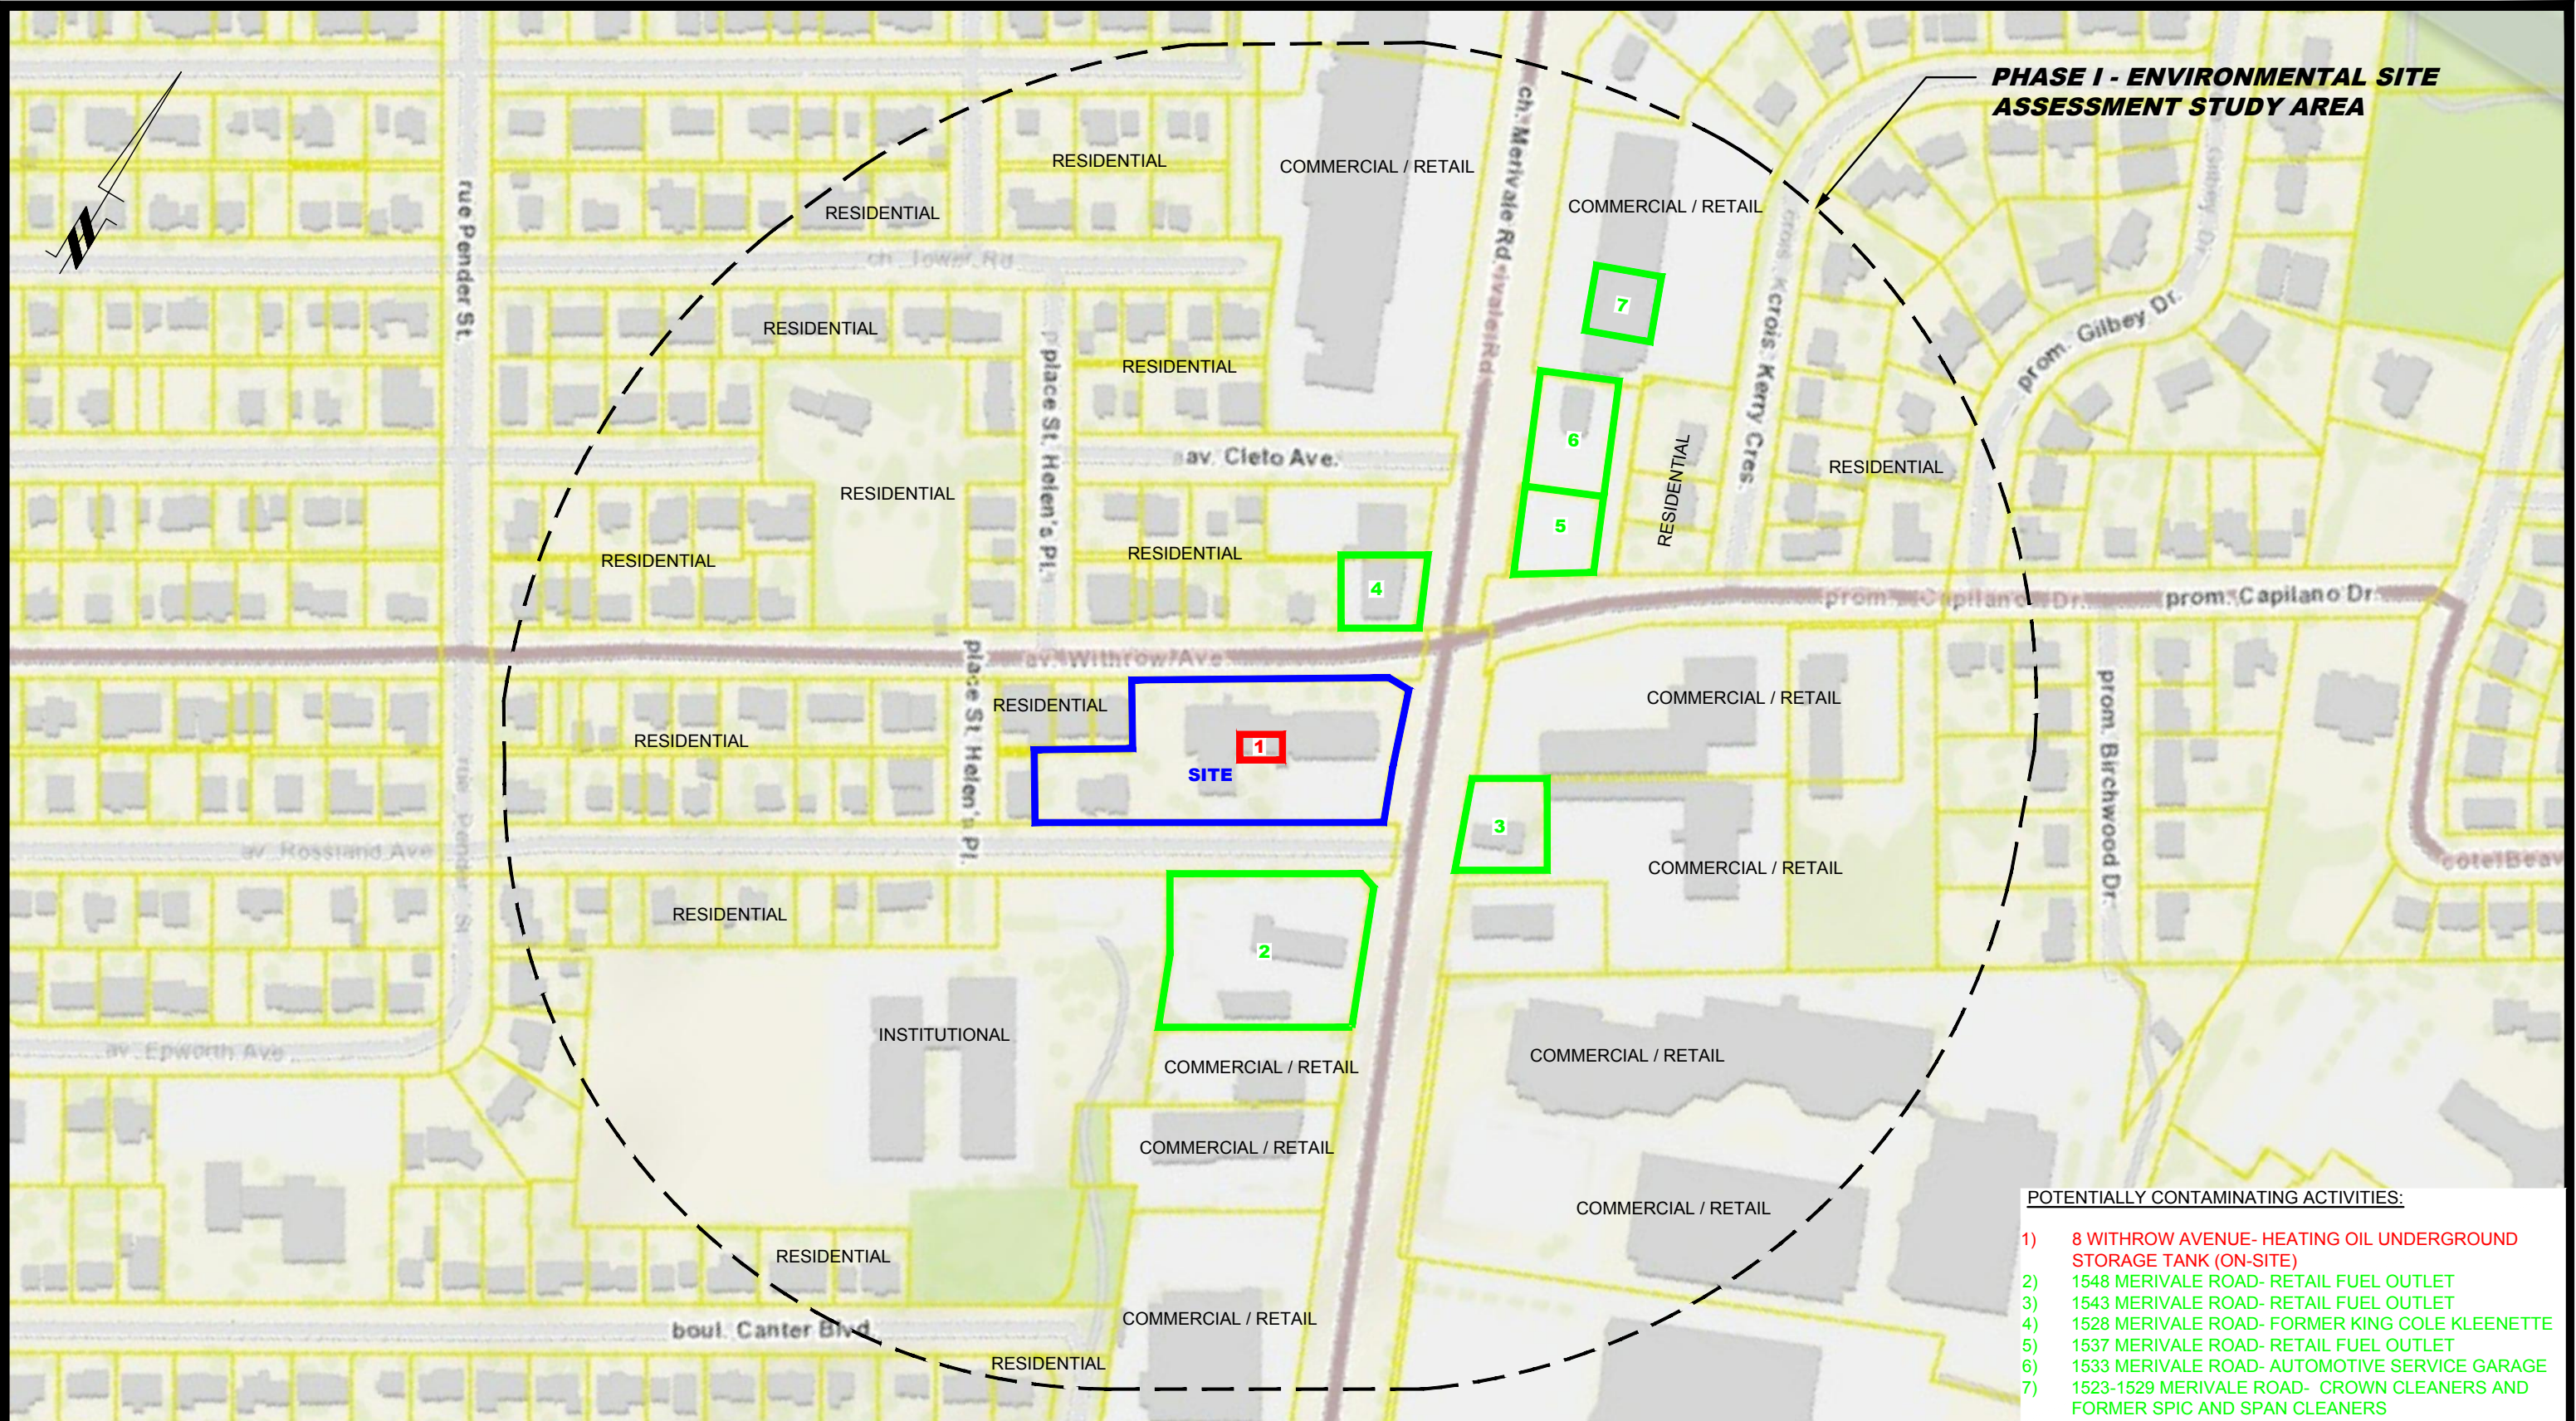

**PHASE I - ENVIRONMENTAL SITE ASSESSMENT STUDY AREA**

- POTENTIALLY CONTAMINATING ACTIVITIES:
- 1) 8 WITHROW AVENUE- HEATING OIL UNDERGROUND STORAGE TANK (ON-SITE)
  - 2) 1548 MERIVALE ROAD- RETAIL FUEL OUTLET
  - 3) 1543 MERIVALE ROAD- RETAIL FUEL OUTLET
  - 4) 1528 MERIVALE ROAD- FORMER KING COLE KLEENETTE
  - 5) 1537 MERIVALE ROAD- RETAIL FUEL OUTLET
  - 6) 1533 MERIVALE ROAD- AUTOMOTIVE SERVICE GARAGE
  - 7) 1523-1529 MERIVALE ROAD- CROWN CLEANERS AND FORMER SPIC AND SPAN CLEANERS

**patersongroup**  
consulting engineers

154 Colonnade Road South  
Ottawa, Ontario K2E 7J5  
Tel: (613) 226-7381 Fax: (613) 226-6344

NO.	REVISIONS	DATE	INITIAL

ANGELICAN DIOCESE OF OTTAWA  
PHASE I - ENVIRONMENTAL SITE ASSESSMENT  
8 WITHROW AVENUE  
OTTAWA, ONTARIO  
Title: **SURROUNDING LAND USE PLAN**

Scale:	1:2500	Date:	11/2019
Drawn by:	YA	Report No.:	PE4799-1
Checked by:	PP	Dwg. No.:	<b>PE4799-2</b>
Approved by:	MSD	Revision No.:	

p:\autocad drawings\environmental\pe4799-2\surrounding land use plan.dwg

# **APPENDIX 1**

**AERIAL PHOTOGRAPHS**

**SITE PHOTOGRAPHS**



AERIAL PHOTOGRAPH  
1965



AERIAL PHOTOGRAPH  
1976




AERIAL PHOTOGRAPH  
1991





AERIAL PHOTOGRAPH  
2002

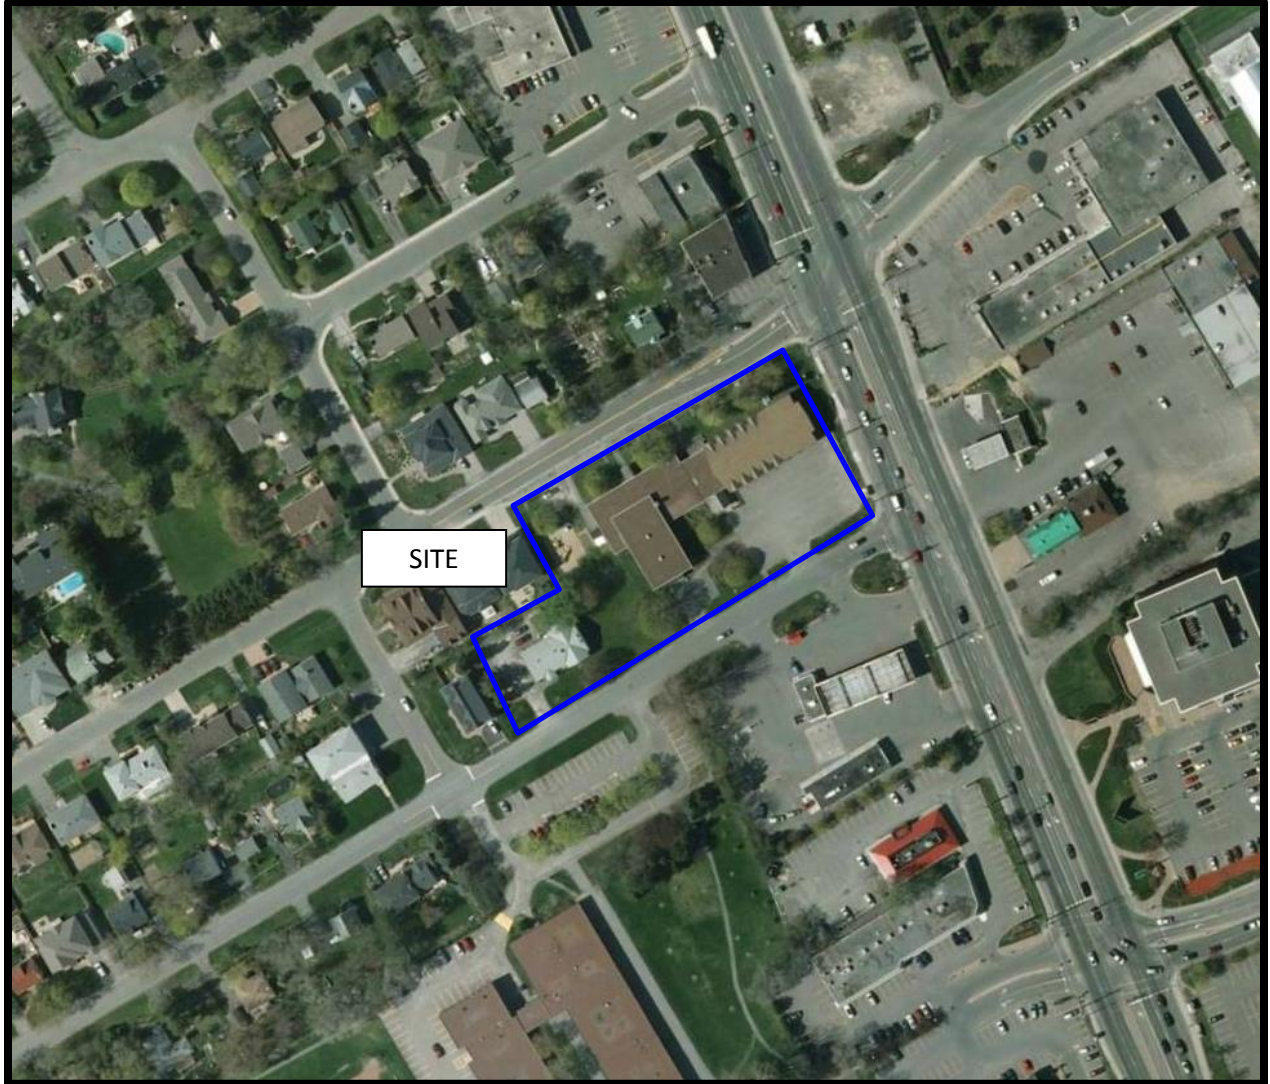

AERIAL PHOTOGRAPH  
2011



AERIAL PHOTOGRAPH  
2017

## Site Photographs

PE4799-1

8 Withrow Avenue, Ottawa

December 9, 2019



Photograph 1: Southern face of the building with the church to the right and church hall to the left. The UST was reportedly located left of the porch towards the centre of the photo.



Photograph 2: Pipe lagging in poor condition. Located in the church balcony floor panel.

## Site Photographs

PE4799-1

8 Withrow Avenue, Ottawa

December 9, 2019



Photograph 3 – Pipe lagging in poor condition located beside the basement sump pit.



Photograph 4 - Pipe lagging in poor condition located in the book shop.

## Site Photographs

PE4799-1

8 Withrow Avenue, Ottawa

December 9, 2019



Photograph 5 – Basement sump pit.



Photograph 6 – Gas-fired furnace.

# **APPENDIX 2**

**MECP FREEDOM OF INFORMATION REQUEST**

**CITY OF OTTAWA HLUI REQUEST**

**WATER WELL RECORDS**

**TSSA CORRESPONDENCE**

## Freedom of Information Request

This form is for requesting documents which are in the Ministry's files on environmental concerns related to properties. Please refer to the guide on completion and use of this form. Our fax no. is (416) 314-4285.

Requester Data			For Ministry Use Only	
Name, Company Name, Mailing Address and Email Address of Requester  Philip Price Paterson Group Inc. 154 Colonnade Road Ottawa, ON K2E 7J5 Email address: pprice@patersongroup.ca			FOI Request No.	Date Request Received
Telephone/Fax Nos. Tel. 613-226-7381 Fax 613-226-6344			Fee Paid <input type="checkbox"/> ACCT <input type="checkbox"/> CHQ <input type="checkbox"/> VISA/MC <input type="checkbox"/> CASH  <input type="checkbox"/> CNR <input type="checkbox"/> ER <input type="checkbox"/> NOR <input type="checkbox"/> SWR <input type="checkbox"/> WCR <input type="checkbox"/> SAC <input type="checkbox"/> IEB <input type="checkbox"/> EAA <input type="checkbox"/> EMR <input type="checkbox"/> SWA	
Your Project/Reference No. PE4799		Signature/Print /Name of Requester Philip Price		
Request Parameters				
Municipal Address / Lot, Concession, Geographic Township ( <b>Municipal address essential for cities, towns or regions</b> ) 8 Withrow Avenue, Ottawa, Ontario PIN - 04689-0001				
Present Property Owner(s) and Date(s) of Ownership Anglican Diocese of Ottawa				
Previous Property Owner(s) and Date(s) of Ownership				
Present/Previous Tenant(s), (if applicable)				
Search Parameters			Specify Year(s) Requested	
<i>Files older than 2 years may require \$60.00 retrieval cost. There is no guarantee that records responsive to your request will be located.</i>				
Environmental concerns (General correspondence, occurrence reports, abatement)			all	
Orders _____			all	
Spills _____			all	
Investigations/prosecutions ► Owner <b>AND</b> tenant information must be provided _____			all	
Waste Generator number/classes _____			all	
Certificates of Approval ► Proponent information must be provided				
1985 and prior records are searched manually. <b>Search fees in excess of \$300.00</b> could be incurred, depending on the types and years to be searched. Specify Certificates of Approval number(s) (if known). <b>If supporting documents are also required, mark SD box</b> and specify type e.g. maps, plans, reports, etc.				
			<b>SD</b>	<b>Specify Year(s) Requested</b>
air - emissions				1986-present
water - mains, treatment, ground level, standpipes & elevated storage, pumping stations (local & booster)				1986-present
sewage - sanitary, storm, treatment, stormwater, leachate & leachate treatment & sewage pump stations				1986-present
waste water - industrial discharges				1986-present
waste sites - disposal, landfill sites, transfer stations, processing sites, incinerator sites				1986-present
waste systems - PCB destruction, mobile waste processing units, haulers: sewage, non-hazardous & hazardous waste				1986-present
pesticides - licenses				1986-present

A \$5.00 non-refundable application fee, payable to the Minister of Finance, is mandatory. The cost of locating on-site and/or preparing any record is \$30.00/hour and 20 cents/page for photocopying and you will be contacted for approval for fees in excess of \$30.00.



Office Use Only

Application Number: _____	Ward Number: _____	Application Received: (dd/mm/yyyy): _____
Client Service Centre Staff: _____	Fee Received: \$	_____



# Historic Land Use Inventory

## Application Form

### Notice of Public Record

All information and materials required in support of your application shall be made available to the public, as indicated by Section 1.0.1 of *The Planning Act*, R.S.O. 1990, C.P.13.

### Municipal Freedom of Information and Protection Act

Personal information on this form is collected under the authority the *Planning Act*, RSO 1990, c. P. 13 and will be used to process this application. Questions about this collection may be directed by mail to Manager, Business Support Services, Planning Infrastructure and Economic Development Department, 110 Laurier Avenue West, Ottawa, K1P 1J1, or by phone at (613) 580-2424, ext. 24075

Background Information

\*Site Address or Location:

8 Withrow Avenue, Ottawa

\*Mandatory Field

### Applicant/Agent Information:

Name: Paterson Group

Mailing Address: 154 Colonnade Road South, Ottawa, ON, K2E 7J5

Telephone: 613-226-7381      Email Address: pprice@patersongroup.ca

### Registered Property Owner Information:

Same as above

Name: Julian of Norwich Anglican Church, Anglican Diocese Ottawa

Mailing Address: 8 Withrow Avenue, Ottawa, ON

Telephone: (613) 224-7178      Email Address: revmoniquestone@gmail.com

## Site Details

Legal Description  
and PIN:

PIN: 04689-0001

What is the land  
currently used for?

Church

Lot frontage:  m Lot depth:  m Lot area: \_\_\_\_\_ m<sup>2</sup>

OR Lot area: (irregular lot)  m<sup>2</sup>

Does the site have Full Municipal Services:  Yes  No

## Required Fees

Please don't hesitate to visit [the Historic Land Use Inventory website](#) more information. Fees must be paid in full at the time of application submission.

Planning Fee

\$105.00

## Submittal Requirements

The following are required to be submitted with this application:

- 1. Consent to Disclose Information:** Consultants and other third parties may make requests for information on behalf of an individual or corporation. However, if the requester is not the owner of the property, **the requester must provide the City of Ottawa with a 'consent to disclose information' letter, signed by the property owner.** This will authorize the City of Ottawa to release any relevant information about the property or its owner(s) to the requester. Consent for disclosure is required in the event that personal information or proprietary company information is found concerning the property and its owner. All consents must clearly indicate the name of the property owner as well as the name of the requester, and must be signed and dated.
- 2. Disclaimer:** Requesters must read and understand the conditions included in the attached disclaimer and submit a signed disclaimer to the City of Ottawa's Planning, Infrastructure and Economic Development Department. This disclaimer is related to the Historic Land Use Inventory and must be received by the City of Ottawa, signed and dated by the requestor, before the process can begin.
- 3. A site plan or key plan of the property, its location and particular features.**
- 4. Any significant dates or time frames that you would like researched.**

**Disclaimer**  
**For use with HLUI Database**

CITY OF OTTAWA ("the City") is the owner of the Historical Land Use Inventory ("HLUI"), a database of information on the type and location of land uses within the geographic area of Ottawa, which had or have the potential to cause contamination in soil, groundwater or surface water.

The City, in providing information from the HLUI, to Paterson Group \_\_\_\_\_ ("the Requester") does so only under the following conditions and understanding:

1. The HLUI may contain erroneous information given that such records and sources of information may be flawed. Changes in municipal addresses over time may have introduced error in such records and sources of information. The City is not responsible for any errors or omissions in the HLUI and reserves the right to change and update the HLUI without further notice. The City does not, however, make any commitment to update the HLUI. Accordingly, all information from the HLUI is provided on an "as is" basis with no representation or warranty by the City with respect to the information's accuracy or exhaustiveness in responding to the request.
2. City staff will perform a search of the HLUI based on the information given by the Requester. City staff will make every effort to be accurate, however, the City does not provide an assurance, guarantee, warranty, representation (express or implied), as to the availability, accuracy, completeness or currency of information which will be provided to the Requester. The HLUI in no way confirms the presence or absence of contamination or pollution of any kind. The information provided by the City to the Requester is provided on the assumption that it will not be relied upon by any person whatsoever. The City denies all liability to any such persons attempting to rely on any information provided from the HLUI database.
3. The City, its employees, servants, agents, boards, officials or contractors take no responsibility for any actions, claims, losses, liability, judgments, demands, expenses, costs, damages or harm suffered by any person whatsoever including negligence in compiling or disseminating information in the HLUI.
4. Copyright is reserved to the City.
5. Any use of the information provided from the HLUI which a third party makes, or any reliance on or decisions to be based on it, are the responsibilities of such third parties. The City, its employees, servants, agents, boards, officials or contractors accept no responsibility for any damages, if any, suffered by a third party as a result of decisions made as a result of an information search of the HLUI.
6. Any use of this service by the Requestor indicates an acknowledgement, acceptance and limits of this disclaimer.
7. All information collected under this request and all records provided in response to this request are subject to the provisions of the Municipal Freedom of Information and Protection of Privacy Act, R.S.O. 1990, c. M.56, as amended.

Signed: \_\_\_\_\_

Dated (dd/mm/yyyy): 11/11/2019 \_\_\_\_\_

Per: Philip Price  
\_\_\_\_\_  
(Please print name)

Title: Environmental Engineer  
\_\_\_\_\_

Company: Paterson Group  
\_\_\_\_\_

UTM 118 2 44 2 29 0 E

15 R 5 0 2 2 4 5 0 N

Elev. 4 R 0 3 2 0

Basin 25

Rideau front

Con I

10f 34



ONTARIO

The Water-well Drillers Act, 1954  
Department of Mines

15 No 5699  
GROUND WATER BRANCH  
AUG 19 1957  
ONTARIO WATER RESOURCES COMMISSION

NEPEAN

# Water-Well Record

County or Territorial District Carleton Township, Village, Town or City City View  
Con IRV Lot 24 Street and Number (if in Village, Town or City) Merivale Rd  
Owner St. Richards Church Address City View  
Date completed 27th May 1957  
(day) (month) (year)

## Pipe and Casing Record

## Pumping Test

Casing diameter(s) 2 1/2' Static level 13 1/2'  
Length(s) 5" Pumping rate 400 gph  
Type of screen XXX Pumping level 37'  
Length of screen XXX Duration of test 1hr


## Well Log

## Water Record

Overburden and Bedrock Record	From ft.	To ft.	Depth (s) at which water (s) found	No. of feet water rises	Kind of water (fresh, salty, or sulphur)
loam	0	2			
limestone	2	119	119	105 1/2	fresh

For what purpose(s) is the water to be used?  
church  
Is water clear or cloudy? clear  
Is well on upland, in valley, or on hillside?  
upland  
Drilling firm F.A. McLean & Son  
Address 185 James St.  
Name of Driller B. Foster  
Address .....

Location of Well  
In diagram below show distances of well from road and lot line. Indicate north by arrow.

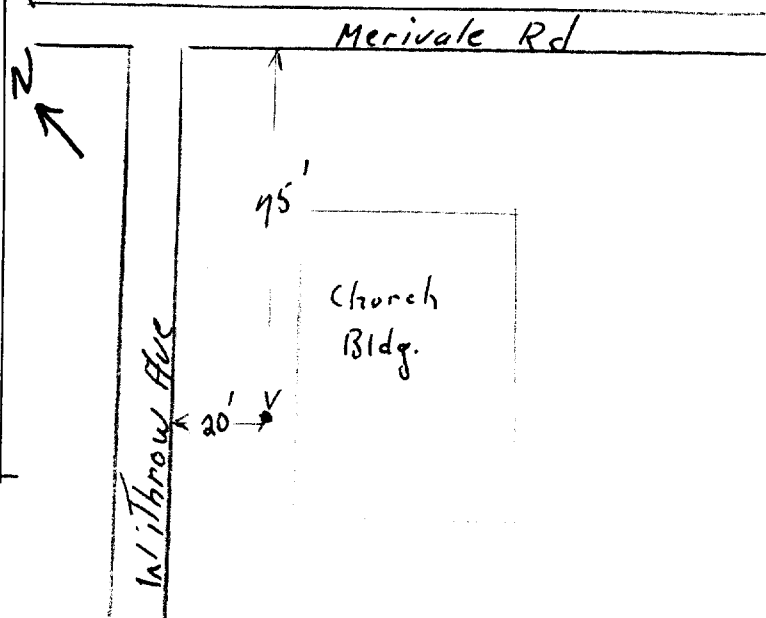

Licence Number.....  
I certify that the foregoing statements of fact are true.  
Date June 3, 1957  
Signature of Licensee

UTM 18 2 4 4 2 2 2 5 E 3125b  
5 R 5 0 2 2 3 6 1 0 N



ONTARIO

RECEIVED  
JAN 20 1954  
GEOLOGICAL BRANCH  
DEPARTMENT OF MINES

15 No 5808

Elev. 141R 10 3 20  
Basin 25  
Con -  
10+

The Water-well Drillers Act, 1954  
Department of Mines

# Water-Well Record

County or Territorial District... Carleton ... Township, Village, Town or City... Nepean ...  
Village, Town or City).....  
Address Rosland (St. Charles Gardens)  
(day) (month) (year)

### Pipe and Casing Record

### Pumping Test

Casing diameter(s) ..... 5" .....  
Length(s) ..... 22' .....  
Type of screen .....  
Length of screen .....

Static level ..... 16 1/2' .....  
Pumping rate ..... 300 GPM .....  
Pumping level ..... 35 1/2' .....  
Duration of test ..... 1/2 hr. .....

### Well Log

### Water Record

Overburden and Bedrock Record	From ft.	To ft.	Depth (s) at which water (s) found	No. of feet water rises	Kind of water (fresh, salty, or sulphur)
<u>Limestone Rock</u>	<u>0</u>	<u>101</u>	<u>85-101</u>	<u>20 ft.</u> <u>85</u>	<u>fresh</u>

For what purpose(s) is the water to be used? house  
Is water clear or cloudy? clear  
Is well on upland, in valley, or on hillside? hillside

Drilling firm Ben Sparks  
Address 4771 Evergreen

Name of Driller Ben Sparks  
Address .....


Licence Number 420

I certify that the foregoing statements of fact are true.

Date Dec 1/55 Ben Sparks  
Signature of Licensee

### Location of Well

In diagram below show distances of well from road and lot line. Indicate north by arrow.

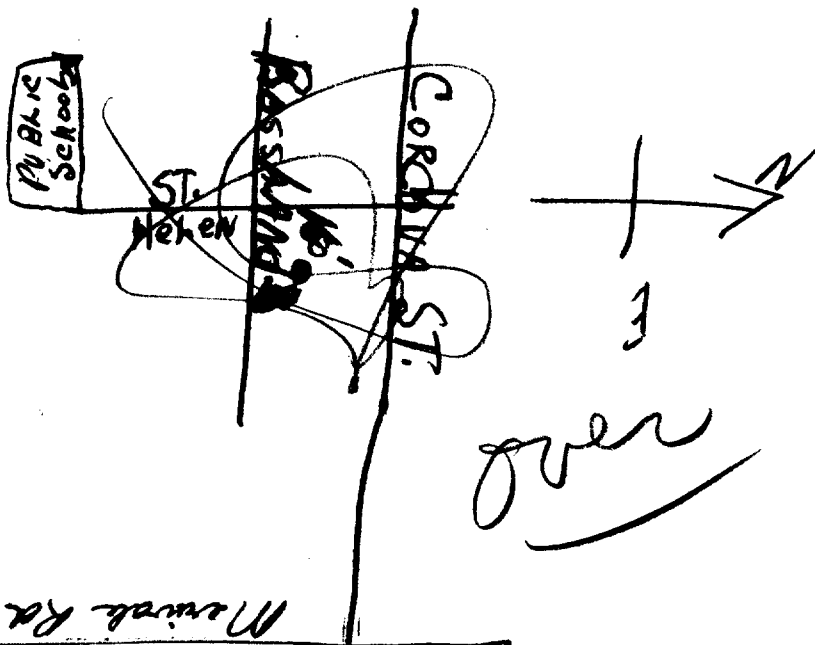

## Philip Price

---

**Subject:** TSSA Records Search, PE4799 - Ottawa, ON - Record Fuels

**From:** Public Information Services [mailto:publicinformationservices@tssa.org]

**Sent:** November-12-19 1:41 PM

**To:** Philip Price <PPrice@Patersongroup.ca>

**Subject:** RE: TSSA Records Search, PE4799 - Ottawa, ON - Record Fuels

Hello,

I have searched the below noted address (addresses) and I have located the following record:

Inst Number	Context	Address	City	Province	Postal Code	Status	Segment1
9190994	FS Facility	1548 MERIVALE RD	NEPEAN	ON	K2G 3J8	EXPIRED	FS GASOLINE STATION - SELF SERVE
9750264	FS Facility	1537 MERIVALE RD	NEPEAN	ON	K2G 3J3	EXPIRED	FS GASOLINE STATION - SELF SERVE
9800350	FS Facility	1543 MERIVALE RD	NEPEAN	ON	K2G 3J4	EXPIRED	FS GASOLINE STATION - FULL SERVE
9963601	FS Facility	1543 MERIVALE RD	NEPEAN	ON	K2G 3J4	EXPIRED	FS GASOLINE STATION - FULL SERVE
10060953	FS Facility	1548 MERIVALE RD	NEPEAN	ON	K2G 3J8	EXPIRED	FS GASOLINE STATION - SPLIT SERVE
10330614	FS Facility	1548 MERIVALE RD	NEPEAN	ON	K2G 3J8	Active	FS GASOLINE STATION - SELF SERVE
10382050	FS Facility	1548 MERIVALE RD	NEPEAN	ON	K2G 3J8	Active	FS CYLINDER EXCHANGE
64499806	FS Facility	1543 MERIVALE RD	NEPEAN	ON	K2G 3J4	Active	FS GASOLINE STATION - SELF SERVE
64763898	FS Facility	1543 MERIVALE RD	NEPEAN	ON	K2G 3J4	Active	FS GASOLINE STATION - SELF SERVE
10869866	FS Liquid Fuel Tank	1543 MERIVALE RD	NEPEAN	ON	K2G 3J4	Inactive	FS LIQUID FUEL TANK
10869882	FS Liquid Fuel Tank	1543 MERIVALE RD	NEPEAN	ON	K2G 3J4	Inactive	FS LIQUID FUEL TANK
10869903	FS Liquid Fuel Tank	1543 MERIVALE RD	NEPEAN	ON	K2G 3J4	Inactive	FS LIQUID FUEL TANK
11162399	FS Liquid Fuel Tank	1537 MERIVALE RD	NEPEAN	ON	K2G 3J3	EXPIRED	FS LIQUID FUEL TANK
11162408	FS Liquid Fuel Tank	1537 MERIVALE RD	NEPEAN	ON	K2G 3J3	EXPIRED	FS LIQUID FUEL TANK
11162418	FS Liquid Fuel Tank	1537 MERIVALE RD	NEPEAN	ON	K2G 3J3	EXPIRED	FS LIQUID FUEL TANK
11231456	FS Liquid Fuel Tank	1548 MERIVALE RD	NEPEAN	ON	K2G 3J8	Active	FS LIQUID FUEL TANK
11231476	FS Liquid Fuel Tank	1548 MERIVALE RD	NEPEAN	ON	K2G 3J8	Active	FS LIQUID FUEL TANK
11231495	FS Liquid Fuel Tank	1548 MERIVALE RD	NEPEAN	ON	K2G 3J8	Active	FS LIQUID FUEL TANK
64499807	FS Liquid Fuel Tank	1543 MERIVALE RD	NEPEAN	ON	K2G 3J4	EXPIRED	FS GASOLINE STATION - SELF SERVE
64537014	FS Liquid Fuel Tank	1543 MERIVALE RD	NEPEAN	ON	K2G 3J4	Active	FS LIQUID FUEL TANK

64537015	FS Liquid Fuel Tank	1543 MERIVALE RD	NEPEAN	ON	K2G 3J4	Active	FS LIQUID FUEL TANK
64763899	FS Liquid Fuel Tank	1543 MERIVALE RD	NEPEAN	ON	K2G 3J4	Active	FS LIQUID FUEL TANK
64763900	FS Liquid Fuel Tank	1543 MERIVALE RD	NEPEAN	ON	K2G 3J4	Active	FS LIQUID FUEL TANK

Effective November 1, 2017 TSSA requires that any requests for the release of public information, must complete the release for public information form. The release for public information form can be found at <https://www.tssa.org/en/about-tssa/release-of-public-information.aspx?mid=392>. Please complete the form (1 address per form) and email the completed form to [publicinformationservices@tssa.org](mailto:publicinformationservices@tssa.org) or through mail along with a fee of \$56.50 (including HST) per location. The fee is payable with credit card (Visa or MasterCard) or with a Cheque made payable to TSSA.

Although TSSA believes the information provided pursuant to your request is accurate, please note that TSSA does not warrant this information in any way whatsoever.

Thank you,

Roxana



**Public Information Agent**

Facilities and Business Services

345 Carlingview Drive

Toronto, Ontario M9W 6N9

Tel: +1-416-734-6222 | Fax: +1-416-734-3568 | E-Mail: [publicinformationservices@tssa.org](mailto:publicinformationservices@tssa.org)

[www.tssa.org](http://www.tssa.org)




---

**From:** Philip Price <[PPrice@Patersongroup.ca](mailto:PPrice@Patersongroup.ca)>

**Sent:** November 12, 2019 11:05 AM

**To:** Public Information Services <[publicinformationservices@tssa.org](mailto:publicinformationservices@tssa.org)>

**Subject:** TSSA Records Search, PE4799 - Ottawa, ON

Good morning,

Could you please conduct a search of your records for underground storage tanks, historical spills and other incidents/infractions for the following addresses for properties located in Ottawa, Ontario:

- 7 Withrow Avenue
- 7 Rossland Avenue
- 1548 Merivale Road
- 1545 Merivale Road
- 1543 Merivale Road
- 1541 Merivale Road
- 1537 Merivale Road
- 1528 Merivale Road
- 1526 Merivale Road
- 20 Rossland Avenue

Thank you very much,

Philip Price

**patersongroup**

**solution oriented engineering**

**over 60 years servicing our clients**

154 Colonnade Road South

Ottawa, Ontario, K2E 7J5

Tel: (613) 226-7381 Ext. 250

Cell: (343) 999 7255

This electronic message and any attached documents are intended only for the named recipients. This communication from the Technical Standards and Safety Authority may contain information that is privileged, confidential or otherwise protected from disclosure and it must not be disclosed, copied, forwarded or distributed without authorization. If you have received this message in error, please notify the sender immediately and delete the original message.



# **APPENDIX 3**

## **QUALIFICATIONS OF ASSESSORS**

Geotechnical  
Engineering

Environmental  
Engineering

Hydrogeology

Geological  
Engineering

Materials Testing

Building Science

Archaeological  
Services

## POSITION

Associate and Supervisor of the Environmental Division  
Senior Environmental/Geotechnical Engineer

## EDUCATION

Queen's University, B.A.Sc.Eng, 1991  
Geotechnical / Geological Engineering

## MEMBERSHIPS

Ottawa Geotechnical Group  
Professional Engineers of Ontario

## EXPERIENCE

*1991 to Present*

### **Paterson Group Inc.**

Associate and Senior Environmental/Geotechnical Engineer  
Environmental and Geotechnical Division  
Supervisor of the Environmental Division

## SELECT LIST OF PROJECTS

Mary River Exploration Mine Site - Northern Baffin Island  
Agricultural Supply Facilities - Eastern Ontario  
Laboratory Facility – Edmonton (Alberta)  
Ottawa International Airport - Contaminant Migration Study - Ottawa  
Richmond Road Reconstruction - Ottawa  
Billings Hurdman Interconnect - Ottawa  
Bank Street Reconstruction - Ottawa  
Environmental Review – Various Laboratories across Canada - CFIA  
Dwyer Hill Training Centre – Ottawa  
Nortel Networks Environmental Monitoring - Carling Campus – Ottawa  
Remediation Program - Block D Lands – Kingston  
Investigation of former landfill sites – City of Ottawa  
Record of Site Condition for Railway Lands – North Bay  
Commercial Properties – Guelph and Brampton  
Brownfields Remediation – Alcan Site - Kingston  
Montreal Road Reconstruction - Ottawa  
Appleford Street Residential Development - Ottawa  
Remediation Program - Ottawa Train Yards  
Remediation Program - Bayshore and Heron Gate  
Gladstone Avenue Reconstruction – Ottawa  
Somerset Avenue West Reconstruction - Ottawa

**Philip Price**  
BSc.  
FGS

**Environmental  
Engineering**

**Geotechnical  
Engineering**

**Materials Testing  
Quality Control**

**Building Sciences**

**Hydrogeology**

**Archaeological  
Services**

## **POSITION**

Intermediate Environmental Scientist

## **EDUCATION**

Kingston University, London, England, BSc (Hons), 2005  
Geology

## **EXPERIENCE**

*2018 - Present:*

**Paterson Group Inc.**

Consulting Engineers  
Environmental Division  
Intermediate Environmental Scientist

*2016 - 2018*

**Harrison Group Environmental Ltd.**

Consulting Engineers  
Senior Environmental Engineer

*2013 - 2016*

**Harrison Group Environmental Ltd.**

Consulting Engineers  
Environmental Engineer

*2009 – 2011*

**AP Geotechnics Ltd.**

Consulting Engineers  
Geotechnical Engineer

*2006 - 2009*

**Harrison Group Environmental Ltd.**

Consulting Engineers  
Junior Environmental Engineer

## **SELECT LIST OF PROJECTS**

Remediation Supervision – Residential Development, Arnprior  
Remediation Supervision – Residential Development, Ottawa  
Remediation Supervision – Commercial Development, Ottawa  
Phase I & II ESA – Commercial Development, Bells Corners, Ottawa  
Groundwater Monitoring and Sampling – Various Location, Ottawa  
Phase I ESA – Various Locations, Ontario