



Phase One Environmental Site Assessment

158 Cardevco Road
Ottawa, Ontario

Prepared for:

Whelan Truck Repair Inc.
112 John Cavanagh Drive
Carp, ON K0A 1L0

November 8, 2022

Pinchin File: 316252



Phase One Environmental Site Assessment

158 Cardevco Road, Ottawa, Ontario
Whelan Truck Repair Inc.

November 8, 2022
Pinchin File: 316252

Issued To: Whelan Truck Repair Inc.
Issued On: November 8, 2022
Pinchin File: 316252
Issuing Office: Kanata, ON

Author:

Alex Kelly, M.Sc.
Project Coordinator
613.592.3387
akelly@pinchin.com



Reviewer:

Scott Mather, P.Eng., QPESA
Director, Eastern Ontario
613.592.3387
smather@pinchin.com



TABLE OF CONTENTS

1.0	EXECUTIVE SUMMARY	1
2.0	INTRODUCTION.....	4
2.1	Phase One Property Information	4
3.0	SCOPE OF INVESTIGATION.....	5
4.0	RECORDS REVIEW	6
4.1	General	6
4.1.1	Phase One Study Area Determination	6
4.1.2	First Developed Use Determination	7
4.1.3	Fire Insurance Plans	7
4.1.4	Environmental Reports	7
4.1.4.1	Previous Environmental Report Summary	8
4.2	Environmental Source Information	8
4.2.1	Environmental Database Search – ERIS.....	8
4.2.1.1	National Pollutant Release Inventory	8
4.2.1.2	Ontario Inventory of PCB Storage Sites	8
4.2.1.3	National PCB Inventory	9
4.2.1.4	Certificates of Approval.....	9
4.2.1.5	Environmental Compliance Approvals, Permits To Take Water and Certificates of Property Use.....	9
4.2.1.6	Inventory of Coal Gasification Plants.....	10
4.2.1.7	Environmental Incidents, Orders, Offences and Spills	10
4.2.1.8	Waste Management Records	10
4.2.1.9	Fuel Storage Tanks	12
4.2.1.10	Notices and Instruments	13
4.2.1.11	Areas of Natural Significance	13
4.2.1.12	Landfill Information	13
4.2.2	Ministry of the Environment, Conservation and Parks Freedom of Information Search.....	13
4.2.3	Technical Standards and Safety Authority Search	14
4.2.4	Property Underwriters’ Reports and Plans	14
4.2.5	City Directories.....	15
4.3	Physical Setting Sources	16
4.3.1	Aerial Photographs	16
4.3.2	Topography, Hydrology and Geology	17
4.3.3	Fill Materials	17
4.3.4	Water Bodies, Areas of Natural Significance and Groundwater Information.....	17
4.3.5	Well Records.....	18
4.4	Site Operating Records	18
5.0	INTERVIEWS.....	18
6.0	SITE RECONNAISSANCE	19
6.1	General Requirements	19
6.2	Specific Observations at Phase One Property	19
6.2.1	Description of Buildings and Structures	19
6.2.2	Description of Below-Ground Structures	20
6.2.3	Description of Tanks	20
6.2.4	Potable and Non-Potable Water Sources.....	20



6.2.5	Description and Location of Underground Utilities.....	20
6.2.6	Details of Heating System.....	20
6.2.7	Details of Cooling System.....	21
6.2.8	Details of Drains, Pits and Sumps	21
6.2.9	Unidentified Substances within Buildings and Structures.....	21
6.2.10	Details of Staining and Corrosion	21
6.2.11	Details of On-Site Wells	21
6.2.12	Details of Sewage Works.....	21
6.2.13	Details of Ground Cover	21
6.2.14	Details of Current or Former Railways.....	22
6.2.15	Areas of Stained Soil, Vegetation and Pavement.....	22
6.2.16	Areas of Stressed Vegetation	22
6.2.17	Areas of Fill and Debris Materials	22
6.2.18	Potentially Contaminating Activities	22
6.2.19	Unidentified Substances Outside Buildings and Structures	22
6.2.20	Surrounding Land Uses	23
6.3	Enhanced Investigation Property.....	24
6.3.1	Site Operations	25
6.3.2	Hazardous Materials	25
6.3.3	Products Manufactured	25
6.3.4	By-Products and Wastes	25
6.3.5	Raw Materials Handling and Storage	25
6.3.6	Drums, Totes and Bins	26
6.3.7	Oil/Water Separators	26
6.3.8	Vehicle and Equipment Maintenance	26
6.3.9	Spills.....	26
6.3.10	Liquid Discharge Points	26
6.3.11	Processing and Manufacturing Operations/Equipment	27
6.3.12	Hydraulic Equipment.....	27
6.3.13	Potentially Contaminating Activities	27
6.4	Written Description of Investigation	27
6.4.1	Phase One Property	27
6.4.2	Phase One Study Area Outside of Phase One Property	28
7.0	REVIEW AND EVALUATION OF INFORMATION	31
7.1	Current and Past Uses	31
7.2	Potentially Contaminating Activities.....	31
7.3	Areas of Potential Environmental Concern	34
7.4	Phase One Conceptual Site Model	34
8.0	CONCLUSIONS	37
8.1	Signatures.....	38
8.2	Terms and Limitations	38
9.0	REFERENCES.....	39
10.0	APPENDICES	1



APPENDICES

APPENDIX A	Figures
APPENDIX B	Photographs
APPENDIX C	Opta Records
APPENDIX D	ERIS Report
APPENDIX E	MECP FOI Search Request
APPENDIX F	TSSA Search Request
APPENDIX G	Maps

FIGURES

Figure 1	Key Map
Figure 2	Phase One Study Area
Figure 3	Potentially Contaminating Activities
Figure 4	Areas of Potential Environmental Concern



1.0 EXECUTIVE SUMMARY

Pinchin Ltd. (Pinchin) was retained by Whelan Truck Repair Inc. (Client) to complete a Phase One Environmental Site Assessment (Phase One ESA) of the property located at 158 Cardevco Road in Ottawa, Ontario (hereafter referred to as the Site or Phase One Property). The Phase One Property is presently developed with a single-storey light industrial building (Site Building).

Pinchin conducted this Phase One ESA in accordance with Part VII and Schedule D of the Province of Ontario's *Environmental Protection Act R.S.O. 1990, c. E.19* and *Ontario Regulation 153/04: Records of Site Condition – Part XV.1 of the Act*, and last amended by Ontario Regulation 274/20 on July 1, 2020 (O. Reg. 153/04). The purpose of the Phase One ESA was to assess the potential presence of environmental impacts at the Phase One Property due to activities at and near the Phase One Property.

This Phase One ESA was conducted at the request of the Client as a condition for a Site Plan Approval (SPA) application with the City of Ottawa.

The scope of work for this Phase One ESA was consistent with O. Reg. 153/04 and was comprised of the following:

- **Records Review:** Reviewed available current and historical information sources pertaining to the Phase One Property and Phase One Study Area including the use of, but not limited to, aerial photographs, city directories, Property Underwriters' Reports and a regulatory data base search. Regulatory agencies were also contacted to identify if any records of environmental non-compliance or other information associated with the environmental condition of the Phase One Property exists, including searches of the Ministry of the Environment, Conservation and Parks and Technical Standards and Safety Authority records;
- **Interviews:** Conducted interviews with the Site Representatives (see Section 5.0) to determine if any current or historical operations have caused a concern with respect to the environmental condition of the Phase One Property and the surrounding properties within the Phase One Study Area;
- **Site Reconnaissance:** Completed a visual assessment of the Phase One Property and the surrounding properties within the Phase One Study Area (from publicly-accessible areas) including any associated buildings and/or facilities for the purpose of identifying the presence of potentially contaminating activities (PCAs);
- **Evaluation:** Evaluated the information gathered from the records review, interviews and Site reconnaissance;



- Reporting: Prepared a Phase One ESA report; and
- Submission: Submitted the Phase One ESA report to the Client.

The Phase One Property consists of one legal plot situated at the municipal address of 158 Cardevco Road, Ottawa, Ontario, which is currently owned by Whelan Truck Repair Inc. The Phase One Property is located immediately southeast of Cardevco Road, approximately 265 metres southwest of the intersection of Carp Road and Cardevco Road.

To the best of Pinchin's knowledge, the Phase One Property was developed between 1985 and 1991. A review of the aerial photographs, as well as an interview with the Site Representatives, determined that prior to 1991, the Phase One Property consisted of vacant undeveloped land. In the 1985 aerial photograph reviewed by Pinchin, the Phase One Property consisted of vacant undeveloped land, and in the 1991 aerial photograph reviewed by Pinchin, the present-day Site Building was evident on the Phase One Property. Therefore, it is Pinchin's opinion that the first developed use of the Phase One Property was developed between 1985 and 1991.

The date of the first developed use of the Phase One Property was determined through a review of aerial photographs, as well as an interview with the Site Representatives. No other information was reviewed by Pinchin during the records review, or obtained during the Site reconnaissance or interviews which would have resulted in a different interpretation of the date of first developed use of the Phase One Property.

Based on the findings of this Phase One ESA, Pinchin identified five PCAs at the Phase One Property (i.e., on-Site) and 21 PCAs within the Phase One Study Area outside of the Phase One Property (i.e., off-Site). Of the PCAs, 23 are not considered to result in areas of potential environmental concern (APECs) at the Phase One Property given no evidence of spills or historical spills (i.e., staining) observed in the vicinity of the transformers and no issues of potential environmental concern (i.e., spills) noted for the transformers within the Environmental Risk Information Services report and any maintenance/environmental issues associated with the transformers would be the responsibility of Hydro Ottawa. Based on the above-noted information, as well as no evidence of historical spills (i.e., staining) observed in the vicinity of the on-Site aboveground storage tanks (ASTs); the concrete floor in the vicinity of the ASTs and staining being in good condition (i.e., no cracking or pitting); the limited annual quantities of hazardous wastes; the distance between these properties and the Phase One property; and the inferred groundwater flow direction, it is Pinchin's opinion that these PCAs do not represent APECs for the Phase One Property. The remaining two on-Site PCAs and one off-Site PCA have resulted in three APECs at the Phase One Property. It is Pinchin's opinion that these PCAs may have impacted soil and groundwater quality at the Phase One Property and, as such, PCAs #1, 5 and 6 have resulted in APECs at the Phase One Property that warrants further investigation prior to the application of a Site Plan Approval application with the City of Ottawa.



Pinchin recommends that a Phase Two ESA be conducted at the Phase One Property as an “assessment of property conducted in accordance with the regulations by or under the supervision of a qualified person to determine the location and concentration of one or more contaminants in the land or water on, in or under the property”. Pinchin concludes that one or more contaminants originating from PCAs located on the Phase One Property and within the Phase One Study Area may have affected land or water on, in, or under the Phase One Property. Therefore, Pinchin recommends that a Phase Two ESA be conducted prior to the application of a Site Plan Approval application with the City of Ottawa.

It should be noted that the references and sources for the information used in evaluating the Phase One Property are provided in the relevant sections of this report. Specific references are also summarized in Section 9.0.

This Executive Summary is subject to the same standard limitations as contained in the report and must be read in conjunction with the entire report.



2.0 INTRODUCTION

A Phase One ESA is defined as a systematic qualitative process to determine whether a particular property is, or may be subject to, actual or potential contamination. Under the Province of Ontario's *Environmental Protection Act R.S.O. 1990, c. E.19* (EPA) and *Ontario Regulation 153/04: Records of Site Condition – Part XV.1 of the Act*, and last amended by Ontario Regulation 274/20 on July 1, 2020 (O. Reg. 153/04), the purpose of a Phase One ESA is two-fold:

- To obtain and review records that relate to the Phase One Property, and to the current and past uses of and activities at or affecting the Phase One Property, in order to determine if an area of potential environmental concern (APEC) exists and to interpret any APEC; and
- To obtain and review records that relate to properties in the Phase One Study Area, other than the Phase One Property, in order to determine if a potentially contaminating activity (PCA) exists and interpret whether any such PCA results in an APEC at the Phase One Property.

This Phase One ESA was conducted at the request of the Client as a condition for a Site Plan Approval application with the City of Ottawa.

A Phase One ESA does not include sampling or testing of environmental media or building materials. The study period for this assessment was during October and November 2022, which included the records review, Site reconnaissance, interviews and reporting.

2.1 Phase One Property Information

The Phase One Property consists of one legal plot situated at the municipal address of 158 Cardevco Road, Ottawa, Ontario, which is currently owned by Whelan Truck Repair Inc. The Phase One Property is located immediately southeast of Cardevco Road, approximately 265 metres (m) southwest of the intersection of Carp Road and Cardevco Road, as shown on Figure 1 (all Figures are provided in Appendix A and all appendices are provided in Section 10.0). A plan showing the Phase One Study Area for which this Phase One ESA applies to is outlined on Figure 2. PCAs identified within the Phase One Study Area are depicted on Figure 3. APECs identified within the Phase One Study Area are depicted on Figure 4. Photographs of the Phase One Property and surrounding properties are presented in Appendix B.



Pertinent details of the Phase One Property are provided in the following table:

Detail	Source / Reference	Information
Legal Description	Legal Survey Drawing provided by the Client	N/A
Municipal Address	Client	158 Cardevco Road, Ottawa, ON K0A 1L0
Parcel Identification Number (PIN)	Legal Survey Drawing provided by the Client	N/A
Current Owner	Client	Whelan Truck Repair Inc.
Current Occupants	Client	Light industrial building
Client	Authorization to Proceed, Limitation of Liability & Terms of Engagement Form	Whelan Truck Repair Inc.
Client Contact Information	Authorization to Proceed, Limitation of Liability & Terms of Engagement Form	Brian Kerr c/o Whelan Truck Repair Inc. 112 John Cavanagh Drive, Carp, ON K0A 1L0
Site Area	Site Representatives	0.49 hectares (1.21 acres)

3.0 SCOPE OF INVESTIGATION

Pinchin conducted this Phase One ESA in accordance with O. Reg. 153/04, in particular Part VII and Schedule D of O. Reg. 153/04. The Phase One ESA scope of work was comprised of the following:

- A Records Review: Reviewed available current and historical information sources pertaining to the Phase One Property and Phase One Study Area including the use of, but not limited to, aerial photographs, city directories, Property Underwriters' Reports and a regulatory data base search. Regulatory agencies were also contacted to identify if any records of environmental non-compliance or other information associated with the environmental condition of the Phase One Property exists, including searches of the Ministry of the Environment, Conservation and Parks (MECP) and Technical Standards and Safety Authority (TSSA) records;
- Interviews: Conducted interviews with the Site Representatives (see Section 5.0) to determine if any current or historical operations have caused a concern with respect to the environmental condition of the Phase One Property and the surrounding properties within the Phase One Study Area;



- Site Reconnaissance: Completed a visual assessment of the Phase One Property and the surrounding properties within the Phase One Study Area (from publicly-accessible areas) including any associated buildings and/or facilities for the purpose of identifying the presence of PCAs;
- Evaluation: Evaluated the information gathered from the records review, interviews and Site reconnaissance;
- Reporting: Prepared a Phase One ESA report; and
- Submission: Submitted the Phase One ESA report to the Client.

4.0 RECORDS REVIEW

4.1 General

Identified on and off-Site PCAs described in this and subsequent report Sections are depicted on Figure 3.

A Phase One ESA does not include sampling or testing of environmental media or building materials. The study period for this assessment was during October and November 2022, which included the records review, Site reconnaissance, interviews and reporting. A Site reconnaissance was completed on October 12, 2022, by a Pinchin representative under the direct supervision of a Qualified Person (QP). During the Site reconnaissance, Pinchin accessed the interior of the Site Building and all exterior areas of the Phase One Property. Pinchin did not access any areas within the surrounding Phase One Study Area with the exception of publicly-accessible roads and sidewalks. Select photographs taken during the Site reconnaissance of the Phase One Property and the surrounding properties within the Phase One Study Area are presented in Appendix B.

4.1.1 Phase One Study Area Determination

Based on a review of the available historical information and observations made during the Site reconnaissance for the properties greater than 250 m, but less than 1 kilometre (km), from the Phase One Property boundary, Pinchin did not note or observe any significant potentially contaminating properties that should be included as part of this assessment (e.g., landfills, large industrial manufacturers, etc.). As such, the Phase One Study Area consisted of the Phase One Property, as well as all properties situated wholly, or partly, within 250 m from the nearest point of a boundary of the Phase One Property, in order to meet the minimum requirements set forth in O. Reg. 153/04.



4.1.2 First Developed Use Determination

The first developed land use of the Phase One Property is defined by O. Reg. 153/04 to be the earlier of:

- The first use of a Phase One Property in or after 1875 that resulted in the development of a building or structure on the property; and
- The first potentially contaminating use or activity on the Phase One Property.

A review of the aerial photographs, as well as an interview with the Site Representatives, determined that prior to 1991, the Phase One Property consisted of vacant undeveloped land. In the 1985 aerial photograph reviewed by Pinchin, the Phase One Property consisted of vacant undeveloped land, and in the 1991 aerial photograph reviewed by Pinchin, the present-day Site Building was evident on the Phase One Property. Therefore, it is Pinchin's opinion that the first developed use of the Phase One Property was developed between 1985 and 1991.

The date of the first developed use of the Phase One Property was determined through a review of aerial photographs, as well as an interview with the Site Representatives. No other information was reviewed by Pinchin during the records review, or obtained during the Site reconnaissance or interviews which would have resulted in a different interpretation of the date of first developed use of the Phase One Property.

4.1.3 Fire Insurance Plans

Pinchin previously contacted Opta Information Intelligence (Opta) to obtain Fire Insurance Plans (FIPs) related to the Phase One Property and the Phase One Study Area. Responses were received from Opta, dated July 28, 2022, which indicated that no FIPs for the Phase One Property and Phase One Study Area were available. The Opta responses are provided in Appendix E.

4.1.4 Environmental Reports

The following previous environmental reports for the Phase One Property were reviewed by Pinchin:

- Report entitled "*Phase I Environmental Site Assessment, 158 Cardevco Road, Ottawa, Ontario*" prepared by Pinchin for 1496143 Ontario Ltd., and dated August 16, 2016 (2016 Pinchin Phase I ESA Report).

Pinchin reviewed the available soil and groundwater sample analytical data provided in the above-referenced reports to assess whether there are any known soil and groundwater impacts at the Phase One Property.

A summary of the salient information identified in the reports is provided below.



2016 Pinchin Phase I ESA Report

The Phase I ESA completed by Pinchin in August 2016 consisted of historical reviews, a review of surrounding properties, a regulatory database search, and interviews as well as an exterior assessment of the Site.

The results of the 2016 Pinchin Phase I ESA Report indicated that there were no significant potential environmental concerns associated with the current and historical use of the Site and adjacent properties and as such, no further environmental assessment work was recommended.

4.1.4.1 Previous Environmental Report Summary

Based on Pinchin's review of the above-referenced previous environmental reports, no PCAs were identified within the Phase One Study Area.

4.2 Environmental Source Information

Pinchin reviewed the historical use of the Phase One Study Area through the use of publicly available archives and databases, as well as through requesting information from regulatory agencies. The following provides a summary of the information obtained from these sources.

4.2.1 Environmental Database Search – ERIS

Pinchin retained Environmental Risk Information Services (ERIS) to search all available federal, provincial and private source databases for information pertaining to the Phase One Study Area. Unless otherwise noted, information obtained from the ERIS database search was reviewed for the entire Phase One Study Area. A copy of the ERIS report is provided in Appendix D and the results of the database search are described in the following sections.

4.2.1.1 National Pollutant Release Inventory

ERIS completed a search of the federal databases for information regarding the National Pollutant Release Inventory (NPRI). This database contains comprehensive national data regarding releases to air, water, or land, and waste transfers for recycling for more than 300 listed substances and identifies information such as the approximate location, type and quantity of contaminant, date of release, and media impacted.

Pinchin reviewed the ERIS report for NPRI information and found no records regarding the Phase One Study Area.

4.2.1.2 Ontario Inventory of PCB Storage Sites

The MECP's Waste Management Branch maintains an inventory of polychlorinated biphenyl (PCB) storage sites within Ontario. Ontario Regulation 11/82 and Ontario Regulation 347 (O. Reg. 347), made



under the EPA, require the registration of inactive PCB storage equipment and/or disposal sites of PCB waste with the MECP. This database contains information on waste quantities, major and minor sites storing liquid or solid waste, and a waste storage inventory.

ERIS completed a search of the Ontario Inventory of PCB Storage Sites for information regarding PCB storage and found no information regarding the Phase One Study Area.

4.2.1.3 National PCB Inventory

Environment Canada maintains an inventory of in-use PCB-containing equipment at federal, provincial and private facilities in Canada, and of out-of-service PCB-containing equipment and PCB waste owned by the federal government or federally regulated industries.

ERIS completed a search of the National PCB Inventory and found no information regarding the Phase One Study Area.

4.2.1.4 Certificates of Approval

ERIS completed a search of the MECP database for information regarding Certificates of Approval (Cs-of-A). The MECP maintains a database of approved Cs-of-A for Air & Noise, Industrial Sewage, Municipal & Private Sewage, Waste Management Systems and Renewable Energy Approvals. Prior to November 1, 2011, the MECP mandated that any facility that released emissions to the atmosphere, discharged contaminants to ground or surface water, provided potable water supplies, or stored, transported or disposed of waste, must have a C-of-A before it could operate lawfully. The MECP no longer issues Cs-of-A, which were replaced by Environmental Compliance Approvals (ECAs) as of November 1, 2011. O. Reg. 153/04 indicates that information from the C-of-A database only needs to be obtained for the Phase One Property and properties adjacent to the Phase One Property.

The ERIS search of the C-of-A database identified no information regarding Cs-of-A for the Phase One Property.

The ERIS search of the C-of-A database identified one C-of-A for properties adjacent to the Phase One Property. This C-of-A was for air emissions, sewage works and municipal water works and no Cs-of-A were identified for discharge to groundwater, which is considered the primary pathway of concern for contaminant impacts on the Phase One Property. As such, Pinchin does not consider the activities related to this C-of-A at the Phase One Property to represent a PCA.

4.2.1.5 Environmental Compliance Approvals, Permits To Take Water and Certificates of Property Use

ERIS completed a search of the MECP database for information regarding ECAs, permits including Permits To Take Water (PTTWs) and Certificates of Property Use (CPUs). O. Reg. 153/04 indicates that information from these databases only needs to be obtained for the Phase One Property and properties



adjacent to the Phase One Property. Details regarding these databases are provided in the ERIS report in Appendix D.

The ERIS database search identified no information regarding ECAs, PTTWs or CPUs for the Phase One Property and properties adjacent to the Phase One Property.

4.2.1.6 Inventory of Coal Gasification Plants

ERIS searched the following publications prepared for the MECP by Intera Technologies Inc. for information on industrial sites that formerly operated as coal gasification plants, and industrial sites that produced or used coal tar and other related tars:

- “*Inventory of Coal Gasification Plant Waste Sites in Ontario*”, dated April 1987; and
- “*Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario*”, dated November 1988.

The ERIS search yielded no records of former coal gasification plants or the production or use of coal tar and related tars within the Phase One Study Area.

4.2.1.7 Environmental Incidents, Orders, Offences and Spills

ERIS completed a search of the various provincial and federal databases for information regarding environmental incidents, orders, offences and spills. O. Reg. 153/04 indicates that information from these databases only needs to be obtained for the Phase One Property and properties adjacent to the Phase One Property. Details regarding the searched databases are provided in the ERIS report in Appendix D.

The ERIS database search revealed no records of environmental incidents, orders, offences or spills for the Phase One Property and properties adjacent to the Phase One Property.

4.2.1.8 Waste Management Records

Waste Generators

ERIS completed a search of the O. Reg. 347 Waste Generators database for information regarding waste generation. O. Reg. 347 defines a waste generation site as any site, equipment and/or operation involved in the production, collection, handling and/or storage of regulated wastes. A generator of regulated waste is required to register the waste generation site and each waste produced, collected, handled or stored at the site. This database contains the registration number, company name and address of registered generators including the types of hazardous wastes generated. It includes data on waste generating facilities such as drycleaners, waste treatment and disposal facilities, machine shops, electric power distribution, etc. The database search results provide a summary of available waste generation information for the registered sites for all years from 1986 to the present.



O. Reg. 153/04 indicates that information from the Waste Generator database only needs to be obtained for the Phase One Property and properties adjacent to the Phase One Property. However, in addition to the Phase One Property and adjacent off-Site properties, Pinchin reviewed the database for waste generators within 50 m transgradient and 100 m upgradient of the Phase One Property with respect to the inferred groundwater flow direction. The area reviewed will be referred to as the Waste Generator Database Review Area.

The ERIS search of the O. Reg. 347 Waste Generators database found the following information regarding the Waste Generator Database Review Area:

- The Phase One Property, S L Hodgins, had been registered with the MECP as a generator (Generator # ON2019300) of waste oils and lubricants from 1995 to 2001. Based on a review of Pinchin's in-house MECP Waste Generator database, approximately 910 kilograms (kg) of waste oils and lubricants were generated on-Site in 1997. Based on the limited annual quantities of hazardous wastes generated at the Phase One Property, it is Pinchin's opinion that this PCA does not represent an APEC at the Phase One Property;
- Thunderbolt Contracting, located at 153 Cardevco Road, had been registered with the MECP as a generator (Generator # ON9364148) of various hazardous wastes in 2014 and 2015. Based on a review of Pinchin's in-house MECP Waste Generator database, approximately 3,825 kg of various hazardous wastes were generated at this property in 2014 and 2015. This property is located approximately 20 m southwest of the Phase One Property. Based on the distance between this property and the Phase One Property, it is Pinchin's opinion that this PCA does not represent an APEC at the Phase One Property;
- Davey Tree Expert Co. of Canada Ltd., located at 196 Cardevco Road, has been registered with the MECP as a generator (Generator # ON1119201) of waste oils and lubricants since 1991. Based on a review of Pinchin's in-house MECP Waste Generator database, approximately 6,220 kg of waste oils and lubricants were generated at this property from 1991 to 1999. This property is located approximately 30 m northeast of the Phase One Property and is situated hydraulically down/transgradient of the Phase One Property relative to the inferred groundwater flow direction. Based on the distance between this property and the Phase One Property, as well as the inferred groundwater flow direction, it is Pinchin's opinion that this PCA does not represent an APEC at the Phase One Property; and



- 1043084 Ontario Inc., located at 142 Cardevco Road, has been registered with the MECP as a generator (Generator # ON3825812) of various hazardous wastes since 2011. Based on a review of Pinchin's in-house MECP Waste Generator database, approximately 2,739 kg of various hazardous wastes were generated at this property from 2011 to 2019. This property is located approximately 90 m southeast of the Phase One Property. Based on the distance between this property and the Phase One Property, it is Pinchin's opinion that this PCA does not represent an APEC at the Phase One Property.

Waste Receivers

ERIS completed a search of the O. Reg. 347 Waste Receivers database for information regarding waste receivers. O. Reg. 347 defines a waste receiving site as any site or facility to which waste is transferred by a waste carrier. A receiver of regulated waste is required to register the waste receiving facility. This database contains registered receivers of regulated wastes, identified by registration number, company name and address, and includes receivers of waste such as landfills, incinerators, transfer stations, PCB storage sites, sludge farms and water pollution control plants.

O. Reg. 153/04 indicates that information from the Waste Receivers database only needs to be obtained for the Phase One Property and properties adjacent to the Phase One Property. However, in addition to the Phase One Property and adjacent off-Site properties, Pinchin reviewed the database for waste receivers within 50 m transgradient and 100 m upgradient of the Phase One Property with respect to the inferred groundwater flow direction. The area reviewed will be referred to as the Waste Receivers Database Review Area.

The ERIS search of the O. Reg. 347 Waste Receivers database found no information regarding the Waste Receivers Database Review Area.

4.2.1.9 Fuel Storage Tanks

ERIS completed a search of various private, provincial and federal databases for information regarding chemical storage tanks, as well as private and retail fuel storage tanks. Details regarding the searched databases are provided in the ERIS report in Appendix D.

The ERIS search of the chemical and fuel storage tank databases found no information regarding the Phase One Property.

The ERIS search of the chemical or fuel storage tank databases identified the following other property within the Phase One Study Area with records of chemical and/or fuel storage tanks:

- 142 Cardevco Road (located approximately 90 m southeast of the Phase One Property).



The above-noted property was listed in the Fuel Storage Tanks database as possessing two 22,700-Litre (L) double-walled fibreglass gasoline aboveground storage tanks (ASTs), which were installed in 2002. Based on the distance between this property and the Phase One Property, it is Pinchin's opinion that this PCA does represent an APEC at the Phase One Property.

4.2.1.10 *Notices and Instruments*

ERIS completed a search of the provincial Environmental Registry for records pertaining to proposals, decisions, and exceptions regarding policies, Acts, instruments, or regulations that could significantly affect the environment. ERIS also searched the Record of Site Condition (RSC) database for filed RSCs.

The ERIS database search of the Environmental Registry and Record of Site Condition database found no records for the Phase One Property and the Phase One Study Area.

4.2.1.11 *Areas of Natural Significance*

ERIS reviewed available databases and records to assess whether any parks, wetlands, conservation areas, or other areas of natural significance, are located within the Phase One Study Area. The Area of Natural & Scientific Interest map is included in the ERIS report in Appendix D. In addition, Pinchin reviewed information provided on the Ministry of Natural Resources and Forestry's (MNRF) Natural Heritage Information Centre (NHIC) website. No areas of natural significance were identified within the Phase One Study Area from these information sources.

4.2.1.12 *Landfill Information*

ERIS reviewed available private and provincial databases for records of any current or inactive landfills and waste disposal sites within the Phase One Study Area. Details regarding the searched databases are provided in the ERIS report in Appendix D.

The ERIS search of the landfill and waste disposal sites databases found no information regarding the Phase One Study Area.

4.2.2 *Ministry of the Environment, Conservation and Parks Freedom of Information Search*

The MECP Freedom of Information and Protection of Privacy Office in Toronto, Ontario was contacted to determine if records exist for environmental matters such as orders, spills, previous investigations, prosecutions, registered PCB waste storage sites, waste generators, waste receivers, Cs-of-A and ECAs associated with the Phase One Property. A written correspondence with the MECP dated October 28, 2022 provided copies of an application for a provisional certificated for approval of a waste management system dated January 21, 1997, and an incident report detailing the storage of waste (i.e., large appliances, wood, paint cans, light bulbs, etc.) without approval on the Site dated July 8, 2008.



In addition, the MECP response provided a copy of an occurrence report detailing a spill of 150-L of diesel to the north portion of the Phase One Property during delivery to the Phase One Property on July 9, 1998. Based on the above-noted information, it is Pinchin's opinion that this PCA does represent an APEC at the Phase One Property. A copy of the MECP's response is provided in Appendix E of this report.

Pinchin conducted a search of the MECP Brownfield Environmental Site Registry as part of the searches completed. According to the search, an RSC has not been filed for the Site or neighbouring properties within a 150 m radius of the Site.

4.2.3 Technical Standards and Safety Authority Search

The TSSA is the regulatory body that governs the safe handling and storage of fuel in Ontario. All storage of gasoline, diesel and fuel oil is subject to the Technical Standards and Safety Act. The Technical Standards and Safety Act and its relevant documents and regulations (e.g., *Liquid Fuels Handling Code*, *Ontario Regulation 213/01 – Fuel Oil*, *Ontario Regulation 217/01 – Liquid Fuels*) require that all fuel storage devices such as ASTs and underground storage tanks (USTs) be registered with the TSSA.

Pinchin previously contacted the TSSA to determine whether any ASTs or USTs are, or were, registered for the Phase One Property. Letter responses were issued by the TSSA on August 3, 2016, indicating that following a search of the TSSA files, no outstanding instructions, incident reports, fuel oil spills or contamination records, or records of registered ASTs or USTs were found for the Phase One Property or the off-Site properties listed above. Copies of the TSSA responses are provided in Appendix F.

4.2.4 Property Underwriters' Reports and Plans

Property Underwriters' Reports (PURs) provide detailed information on a site-specific basis, including descriptions of building construction, heating sources, production processes, and the presence of any hazardous chemicals or materials which may have been historically stored on the Phase One Property. They also indicate the presence of environmental hazards such as electrical rooms, transformers, boilers and storage tanks. Information provided on Property Underwriters' Plans (PUPs) includes the location, capacity, and contents of ASTs, USTs, chemical storage and other forms of environmental hazards.

Pinchin contacted Opta to obtain copies of PURs and PUPs related to the Phase One Property. Opta provided Pinchin with a copy of a PUR dated 1997 (see Appendix C):

Based on Pinchin's review of the PUR, the following was noted:

- The Site Building was constructed in its current configuration in approximately 1991;
- The Site was occupied by S L Hodgins Equipment Ltd.; and
- Heating was provided by propane-fired infrared radiant heat.



4.2.5 City Directories

City directories for the years 1989 to 2011 were reviewed by Pinchin at the Library and Archives of Canada in Ottawa, Ontario. It should be noted that no city directories were available for the Phase One Property prior to 1989 or subsequent to 2011. A summary of information obtained with respect to the Phase One Property is provided in the following table:

Year(s)	Occupant Listings for Site Address
1989-2000.	Site not listed.
2001-2011.	TDL Spring and Suspension Specialists.

Based on Pinchin's review of the above-noted city directories, an automotive repair/servicing facility (i.e., TDL Spring and Suspension Specialists) was evident on the Phase One Property from 2001 to 2011. In addition, an automotive repair/servicing facility is still evident on the Phase One Property. Based on the above-noted information, it is Pinchin's opinion that the Phase One property is considered an Enhanced Investigation Property and that this PCA does represent an APEC at the Phase One Property.

In general, the city directories indicated that the properties in the Phase One Study Area outside of the Phase One Property have been historically occupied by commercial and light industrial land uses since 1989. No historical dry cleaning operations, RFOs or other operations of potential environmental concern were identified, with the exception of the following:

- RR Auto (i.e., an automotive repair/servicing facility) was listed at 164 Cardevco Road from approximately 2005 until 2011. An active automotive repair/servicing facility is still active on this property. This property is located adjacent to the northeast elevation of the Phase One Property, while the building associated with this property is located approximately 15 m southeast. In addition, this automotive repair/servicing facility is considered an Enhanced Investigation Property. Based on the above-noted information, it is Pinchin's opinion that this PCA does represent an APEC at the Phase One Property; and
- Ryan's Auto Centre (i.e., an automotive repair/servicing facility) was listed at 196 Cardevco Road in 1995. This property is located approximately 40 m northeast of the Phase One Property and is situated hydraulically down/transgradient of the Phase One Property relative to the inferred groundwater flow direction. Based on the short duration of operations, the distance between this property and the Phase One Property and the inferred groundwater flow direction, it is Pinchin's opinion that this PCA does not represent an APEC at the Phase One Property.



4.3 Physical Setting Sources

4.3.1 Aerial Photographs

Pinchin reviewed aerial photographs of the Phase One Property and surrounding properties within the Phase One Study Area to assess the potential for historical PCAs. Copies of aerial photographs dated 1945, 1954, 1967 and 1985 were obtained from the National Air Photo Library in Ottawa, Ontario and reviewed by Pinchin. In addition, copies of digital aerial photographs dated 1976, 1991, 2002, 2011 and 2021 were reviewed on the City of Ottawa e-map website (<https://maps.ottawa.ca/geoOttawa/>) by Pinchin. The 1945 aerial photograph was the earliest available aerial photograph of the Phase One Study Area.

Efforts were made by Pinchin to obtain aerial photographs that:

- Illustrated the period between initial development of the Phase One Property to the present;
- Identified buildings and structures present on the Phase One Property since initial development;
- Identified PCAs within the Phase One Study Area; and
- Identified APECs on the Phase One Property.

It should be noted that accurate details could not be determined from some of the aerial photographs due to the large reference scale and the low resolution of the photographs.

A summary of information obtained with respect to the Phase One Property from a review of the available aerial photography is provided in the following table:

Year of Photograph	Phase One Property
1945-1985.	The Phase One Property appeared to consist of vacant undeveloped land.
1991-2021.	A building that was similar in size and configuration to the present-day Site Building was evident on the Phase One Property.

Based on the aerial photographs reviewed for the Phase One Property and the surrounding area, it appears that the Phase One Property was developed between 1985 and 1991.

The aerial photograph review did not identify any PCAs within the Phase One Study Area, including the Phase One Property.



4.3.2 Topography, Hydrology and Geology

The elevation of the Phase One Property, based on information obtained from the Ontario Base Map series, is approximately 115 m above mean sea level (mamsl). The general topography in the local and surrounding area is generally flat and the Phase One Property is at a similar elevation to the adjacent/surrounding properties. No bedrock outcrops were observed on-Site or in the surrounding area.

A review of the available physiographical data indicates that the Phase One Property and the surrounding properties located within the Phase One Study Area are located within alluvial deposits consisting of stratified gravel, sand, silt and clay. Bedrock is expected to consist of sedimentary rocks consisting of limestone, dolomite, shale, argillite, sandstone, quartzite, and/or grit. The topography is considered to be mainly flat to rolling low local relief with dry surface water drainage conditions.

Based on general hydrogeological principles and Pinchin's familiarity with subsurface conditions at and near the Phase One Property and the surrounding properties within the Phase One Study Area, the unconfined groundwater beneath the Phase One Property is expected to flow in a northwest direction. The nearest surface water body is the Carp River located approximately 520 m north of the Phase One Property at an elevation of approximately 12 mamsl.

Copies of pertinent maps, illustrating local topographical, hydrogeological and drainage features are provided in Appendix G.

4.3.3 Fill Materials

The historical records review provided no information regarding the presence of fill material at the Phase One Property.

Although the Phase One ESA did not identify any historical or current fill material at the Phase One Property, potential future development plans should incorporate the appropriate procedures for the characterization of soils that may require off-Site disposal. Further assessment and/or costs may be incurred through re-development of the Phase One Property and/or change in land use scenarios.

4.3.4 Water Bodies, Areas of Natural Significance and Groundwater Information

The nearest surface water body is the Carp River located approximately 520 m north of the Phase One Property at an elevation of approximately 12 mamsl.

A review of the Area of Natural & Scientific Interest map prepared by ERIS (see Appendix D) and information provided on the MNR's NHIC website did not identify any provincial parks, wetlands, conservation areas, or other areas of natural significance, within the Phase One Study Area.



The records review did not identify the presence of wells within the Phase One Study Area that supply water for human consumption or for agricultural purposes. Details regarding these wells are provided in the ERIS report in Appendix D.

4.3.5 Well Records

A search of the Water Well Information System database by ERIS did not identify any water well records for the Phase One Property. The Water Well Information System database search identified 14 water well records within the Phase One Study Area outside of the Phase One Property. Details regarding these off-Site wells, including stratigraphic information, depth to bedrock and/or depth to the water table, are provided in the ERIS report included in Appendix D.

4.4 Site Operating Records

The Phase One Property is not an Enhanced Investigation Property (see Section 6.3). As such, Site operating records were not reviewed as part of the Phase One ESA.

5.0 INTERVIEWS

Pinchin interviewed individuals knowledgeable of the Phase One Property and its history to obtain or confirm information regarding the environmental condition of the Phase One Property. The following individuals provided information regarding the history of the Phase One Property and the surrounding properties within the Phase One Study Area to the best of their knowledge:

Person Interviewed	Relationship to Phase One Property	Date and Place of Interview	Interview Method
Greg Whelan	Co-owner of the Phase One Property	October 12, 2022 (Phase One Property)	In-person interview during Site reconnaissance
Ryan Whelan	Co-owner of the Phase One Property	October 12, 2022 (Phase One Property)	In-person interview during Site reconnaissance

Greg Whelan and Ryan Whelan were chosen to be interviewed given that they are most familiar with the recent operational history of the Phase One Property. These individuals are hereafter referred to as the “Site Representatives” and accompanied the Pinchin representative (Alex Kelly) during the Site reconnaissance.

Pinchin compared the information obtained from the interviews with information obtained from the historical records. The information provided by the interviewee was corroborated by the available historical records. As such, Pinchin has no concerns regarding the validity of the information provided by the individual interviewed for the Phase One ESA.



With respect to PCAs and APECs, no additional information was obtained from the interviews other than that documented elsewhere in this report.

6.0 SITE RECONNAISSANCE

6.1 General Requirements

A visual assessment of the Phase One Property and the surrounding properties within the Phase One Study Area was conducted for the purpose of identifying the presence of possible PCAs and associated APECs.

The Site reconnaissance was completed on October 12, 2022, by a Pinchin representative (Alex Kelly), under the direct supervision of Pinchin's QP overseeing this project. Pinchin visited the Phase One Property and surrounding properties within the Phase One Study Area to document environmental conditions. During the Site reconnaissance, Pinchin viewed all accessible areas within the Phase One Property, and viewed publicly-accessible portions of the adjacent lands for the presence of actual or potential issues of environmental concern.

The Site reconnaissance was conducted between the hours of 9:30 AM to 10:30 AM. During the Site reconnaissance, the ground surface was dry and the weather was overcast, and the ambient temperature was approximately 15° Celsius. The Phase One Property reconnaissance was conducted on foot. During the Site reconnaissance, Pinchin accessed the interior of the Site Building and all exterior areas of the Phase One Property. At the time of the Site reconnaissance, the Site Building on the Phase One Property was operating as a light industrial building. Further details regarding on-Site operations are provided throughout Section 6.2 of this report.

Photographs taken during the Site reconnaissance that illustrate the Phase One Property and Phase One Study Area are provided in Appendix B.

6.2 Specific Observations at Phase One Property

6.2.1 Description of Buildings and Structures

During the Site reconnaissance, Pinchin observed one building/structure on the Phase One Property. The building consisted of a single-storey light industrial building (Site Building) with a mezzanine level, possessing the municipal address of 158 Cardevco Road.

The portions of the Phase One Property outside of the Site Building are presently developed with gravel parking areas and landscaped areas.



6.2.2 Description of Below-Ground Structures

There were no below-ground structures present on the Phase One Property at the time of the Site reconnaissance.

6.2.3 Description of Tanks

During the Site reconnaissance, Pinchin observed the following tanks on the Phase One Property:

- One steel AST containing new oil with a capacity of 1,000-L that was installed in approximately 2017 according to the Site Representatives. The AST is located in the northeast corner of the Site Building; and
- One steel AST containing waste oil with a capacity of 1,000-L that was installed in approximately 2017 according to the Site Representatives. The AST is located in the northeast corner of the Site Building.

No spills or evidence of historical spills (i.e., staining) was observed in the vicinity of the ASTs. The interior floor slab was observed to be in good condition (i.e., no cracking or pitting), and no drains were present in the vicinity of the ASTs. Based on the above-noted information, the above-listed PCA at the Phase One Property does not represent an APEC.

6.2.4 Potable and Non-Potable Water Sources

No potable or non-potable water supply sources were observed at the Phase One Property, with the exception of a non-potable water supply well located on the southwest portion of the Phase One Property. According to the Site Representative, the well only supplies water to the washroom in the Site Building and is not used as a source of drinking water at the Phase One Property. It should be noted that this well was not identified in the ERIS report.

6.2.5 Description and Location of Underground Utilities

A number of underground utilities were observed at the Phase One Property, including natural gas, telephone and electrical lines.

The natural gas, telephone and electrical services enter the Site Building via underground lines. Storm water entering exterior roof drains runs overland to percolate naturally through the soil or enter the ditch on the north portion of the Phase One Property.

6.2.6 Details of Heating System

During the Site reconnaissance, Pinchin observed natural gas-fired radiant tube heaters and electrically-powered baseboard heaters.



6.2.7 Details of Cooling System

Cooling for the Site Building is provided by electrically powered window-mounted air conditioning units.

6.2.8 Details of Drains, Pits and Sumps

No pits or sumps were observed at the Phase One Property.

6.2.9 Unidentified Substances within Buildings and Structures

During the Site reconnaissance, Pinchin did not observe any unidentified substances or storage containers holding unidentified substances at the Phase One Property. Small volumes of various cleaning solutions were stored in their original containers on shelves throughout the Site Building. No bulk liquid storage was observed on-Site.

6.2.10 Details of Staining and Corrosion

Black (likely petroleum hydrocarbon (PHC)) staining was observed throughout the garage area. The concrete floor was observed to be in good condition (i.e., no cracking or pitting). Based on the above-noted information, it is Pinchin's opinion that this PCA does not represent an APEC at the Phase One Property.

6.2.11 Details of On-Site Wells

No potable or non-potable water supply sources were observed at the Phase One Property, with the exception of a potable water supply well located on the southwest portion of the Phase One Property. According to the Site Representatives, the well supplies drinking water to the Site Building. It should be noted that this well was not identified in the ERIS report.

6.2.12 Details of Sewage Works

During the Site reconnaissance, Pinchin observed a septic tank and associated septic bed located north of the Site Building. The septic bed encompasses the majority of the grassed area located north of the Site Building and the septic tank is reportedly situated within the southwest portion of the septic bed. Sewage generated by the Site Building is discharged to the septic bed via a sewer pipe that exits the north wall of the Site Building. According to the Site Representatives, only human waste has discharged to the septic bed and it is not considered a PCA at the Phase One Property.

6.2.13 Details of Ground Cover

During the Site reconnaissance, Pinchin visually inspected the Phase One Property ground cover. Any areas of the Phase One Property not covered by a structure are covered by asphalt-pavement and grassed/landscaped areas.



6.2.14 Details of Current or Former Railways

No current or former railway infrastructure was observed on the Phase One Property.

6.2.15 Areas of Stained Soil, Vegetation and Pavement

During the Site reconnaissance, Pinchin did not observe any areas of stained soil, vegetation or pavement on the Phase One Property.

6.2.16 Areas of Stressed Vegetation

During the Site reconnaissance, Pinchin did not observe any areas of stressed vegetation on the Phase One Property.

6.2.17 Areas of Fill and Debris Materials

No obvious areas where fill material or debris have been placed or graded were observed by Pinchin at the Phase One Property.

6.2.18 Potentially Contaminating Activities

A PCA is defined by O. Reg. 153/04 as a “use or activity set out in Column A of Table 2 of Schedule D that is occurring or has occurred in a Phase One Study Area” including the Phase One Property.

Pinchin identified the following PCAs at the Phase One Property during the Site reconnaissance:

- Black (likely PHC) staining was observed throughout the garage area; however, the concrete floor was observed to be in good condition (i.e., no cracking or pitting). Based on the above-noted information, it is Pinchin’s opinion that this PCA does not represent an APEC at the Phase One Property; and
- A steel gasoline AST containing new oil with a capacity of 1,000-L and a steel gasoline AST containing waste oil with a capacity of 1,000-L are located within the Site Building and were both reportedly installed in approximately 2017. No spills or evidence of historical spills (i.e., staining) was observed in the vicinity of the ASTs. The interior floor slab was observed to be in good condition (i.e., no cracking or pitting), and no drains were present in the vicinity of the ASTs. Based on the above-noted information, the above-listed PCA at the Phase One Property does not represent an APEC.

6.2.19 Unidentified Substances Outside Buildings and Structures

During the Site reconnaissance, Pinchin did not observe any unidentified substances or storage containers holding unidentified substances on the exterior of the Phase One Property.



6.2.20 Surrounding Land Uses

During the Site reconnaissance, Pinchin conducted a visual assessment of publicly-accessible portions of the Phase One Study Area for the presence of PCAs. The properties in the Phase One Study Area have various land uses, including commercial, vacant and light industrial. Land use types within the Phase One Study Area are presented on Figure 2.

The following table summarizes the land use on adjacent properties at the time of the Site reconnaissance:

Direction Relative to Phase One Property	Location Relative to Inferred Groundwater Flow Direction	Description of Property Use	Property Use	Potential Contribution to PCA and/or APEC
Northeast	Transgradient	An automotive repair/servicing facility and commercial buildings to beyond 200 m from the Phase One Property.	Automotive Repair and Servicing facility/ Commercial	Land uses are considered to represent PCAs.
Northwest	Upgradient	Commercial buildings, a steel fabricator operation, vacant undeveloped land and associated roadways to beyond 200 m from the Phase One Property.	Steel Fabricator/ Commercial/ Vacant	Land uses are considered to represent PCAs.
Southwest	Transgradient	Commercial buildings, a print shop, vacant undeveloped land and associated roadways to beyond 200 m from the Phase One Property.	Commercial/ Print Shop/ Vacant	Land uses are considered to represent PCAs.
Southeast	Downgradient	Commercial building, a powder coating operation and associated roadways to beyond 200 m from the Phase One Property.	Commercial/ Powder Coating Operation	Land uses are considered to represent PCAs.

Pinchin observed the following PCA at the time of the Site reconnaissance within the rest of the Phase One Study Area:

- An automotive repair/servicing facility is located adjacent to the northeast elevation of the Phase One Property, while the building associated with this property is located approximately 15 m southeast. In addition, this automotive repair/servicing facility is considered an Enhanced Investigation Property. Based on the above-noted information, it is Pinchin's opinion that this PCA does represent an APEC at the Phase One Property;



- A steel fabricator operation is located approximately 15 m northwest of the Phase One Property; however, the building associated with this property is located approximately 50 m northwest of the Phase One Property. In addition, this property is situated hydraulically down/transgradient of the Phase One Property. Based on the distance between the building associated with this property and the Phase One Property, as well as the inferred groundwater flow direction, it is Pinchin's opinion that this PCA does not represent an APEC at the Phase One Property;
- Numark Signs (a print shop) is located approximately 20 m southwest of the Phase One Property; however, the building associated with this property is located approximately 40 m southwest of the Phase One Property. Based on the distance between the building associated with this property and the Phase One Property, it is Pinchin's opinion that this PCA does not represent an APEC at the Phase One Property;
- A powder coating operation is located approximately 90 m southeast of the Phase One Property. Based on the distance between this property and the Phase One Property, it is Pinchin's opinion that this PCA does not represent an APEC at the Phase One Property; and
- A total of 35 pole-mounted oil-cooled transformers were observed within 250 m of the Phase One Property; however, no evidence of spills or historical spills (i.e., staining) was observed in the vicinity of these transformers and no issues of potential environmental concern (i.e., spills) were noted for these transformers within the ERIS report. In addition, any maintenance/environmental issues associated with these transformers would be the responsibility of Hydro Ottawa. Based on the above-noted information, as well as the distance between these transformers and the Phase One property, it is Pinchin's opinion that these PCAs do not represent APECs at the Phase One Property.

6.3 Enhanced Investigation Property

O. Reg. 153/04 defines an "Enhanced Investigation Property" as a property that is being used or has been used, in whole or in part, in the following manner:

- For an industrial use or;
- For any of the following commercial uses:
 - As a garage;
 - As a bulk liquid dispensing facility, including a gasoline outlet; or
 - For the operation of dry-cleaning equipment.



During this Phase One ESA, Pinchin observed that the Phase One Property is currently used as an automotive repair/servicing facility (i.e., garage) and is therefore considered an Enhanced Investigation Property. A Phase Two Environmental Site Assessment (Phase Two ESA) is automatically required at an Enhanced Investigation Property to support the filing of an RSC.

6.3.1 Site Operations

The Phase One Property is currently occupied by an automotive repair/servicing facility that has operated at the Phase One Property since at least 1999 to the present.

6.3.2 Hazardous Materials

The following hazardous materials were used or stored at the Phase One Property at the time of the Site reconnaissance:

- A steel gasoline AST containing new oil with a capacity of 1,000-L and a steel gasoline AST containing waste oil with a capacity of 1,000-L are located within the Site Building and were both reportedly installed in approximately 2017. No spills or evidence of historical spills (i.e., staining) was observed in the vicinity of the ASTs. The interior floor slab was observed to be in good condition (i.e., no cracking or pitting), and no drains were present in the vicinity of the ASTs.

6.3.3 Products Manufactured

No product manufacturing activities were observed at the Phase One Property during the Site reconnaissance.

6.3.4 By-Products and Wastes

The following by-products and wastes were noted at the Phase One Property at the time of the Site reconnaissance:

- Waste oil generated from vehicle maintenance activities was stored in a 1,000-L AST located within the Site Building and was reportedly installed in approximately 2017. No spills or evidence of historical spills (i.e., staining) was observed in the vicinity of the AST. The interior floor slab was observed to be in good condition (i.e., no cracking or pitting), and no drains were present in the vicinity of the AST.

6.3.5 Raw Materials Handling and Storage

No handling or storage of raw materials was observed at the Phase One Property during the Site reconnaissance.



6.3.6 Drums, Totes and Bins

The following drums were observed at the Phase One Property at the time of the Site reconnaissance:

- As noted above in Section 6.3.2, A steel gasoline AST containing new oil with a capacity of 1,000-L and a steel gasoline AST containing waste oil with a capacity of 1,000-L are located within the Site Building and were both reportedly installed in approximately 2017. No spills or evidence of historical spills (i.e., staining) was observed in the vicinity of the ASTs. The interior floor slab was observed to be in good condition (i.e., no cracking or pitting), and no drains were present in the vicinity of the ASTs.

6.3.7 Oil/Water Separators

A two-stage oil/water separator is located in the west portion of the Site Building. The oil/water separator was installed in 1991 and was reported to be of concrete construction. The oil/water separator contained oily water at the time of Pinchin's Site reconnaissance, and the concrete was observed to be in good condition (i.e., no cracking and/or pitting). The contents of the oil/water separator are removed for off-Site disposal every six months by Drain-All Ltd., an external licensed contractor.

6.3.8 Vehicle and Equipment Maintenance

At the time of the Site reconnaissance, the Site Building was used as a automotive repair/servicing facility for the service of automobiles. According to the Site Representative, the Phase One Property has been used as an automotive repair/servicing facility from approximately 1999 to the present. Vehicle maintenance occurs within the central portion of the Site Building, with the remainder used as office and storage space. New oil was stored in an 1,000-L AST located within the Site Building. Other automotive fluids (e.g., brake fluid, power steering fluid, antifreeze) were stored in plastic containers varying in size from one litre to 20 litres throughout the Site Building. As noted above in Section 6.3.4, waste oil generated from vehicle maintenance activities was stored in a 1,000-L AST located within the Site Building. No issues regarding the storage of the new oil, waste oil and automotive fluids were observed by Pinchin at the time of the Site reconnaissance.

6.3.9 Spills

Black (likely PHC) staining was observed throughout the garage area; however, the concrete floor was observed to be in good condition (i.e., no cracking or pitting).

6.3.10 Liquid Discharge Points

No liquid discharge points were observed at the Phase One Property during the Site reconnaissance.



6.3.11 Processing and Manufacturing Operations/Equipment

No processing or manufacturing operations or equipment were observed at the Phase One Property during the Site reconnaissance.

6.3.12 Hydraulic Equipment

One hydraulically-operated press was observed within the automotive repair/servicing within the Site Building. No other hydraulic equipment (e.g., elevators, loading docks) were observed by Pinchin at the time of the Site reconnaissance.

6.3.13 Potentially Contaminating Activities

Based on the information provided in Sections 6.3.1 to 6.3.12, no additional PCAs were identified during the Site reconnaissance that have not been described previously in this report.

6.4 Written Description of Investigation

The Phase One ESA completed by Pinchin included investigations of the Phase One Property and the Phase One Study Area outside of the Phase One Property pursuant to Sections 13 and 14 of Schedule D of O. Reg.153/04. The main objective of these investigations was to identify PCAs at the Phase One Property or within the Phase One Study Area outside of the Phase One Property that could have resulted in APECs at the Phase One Property.

6.4.1 Phase One Property

The investigation of the Phase One Property consisted of the following components:

- Review of available historical records, including ERIS regulatory search, Opta records, city directories and aerial photographs;
- A Site reconnaissance completed on October 12, 2022, by Alex Kelly of Pinchin that included an assessment of the structure at the Phase One Property and the exterior of the Phase One Property;
- Interviews with an individual knowledgeable of the history and operations at the Phase One Property; and
- Review of mapping provided by ERIS and information provided on-line by the MNRF for the presence of areas of natural significance.



Pinchin's investigation of the Phase One Property identified the following PCAs:

- PCA #1 (Item 10: Commercial Autobody Shops – an active automotive repair/servicing facility is located at the Phase One Property). Based on the above-noted information, it is Pinchin's opinion that the Phase One property is considered an Enhanced Investigation Property and that this PCA does represent an APEC at the Phase One Property;
- PCA #2 (Item 8 Chemical Manufacturing, Processing and Bulk Storage – the Phase One Property is located within the Waste Generator Database Review Area and was listed within the O. Reg. 347 Waste Generators database search results as a waste generator). Based on the limited annual quantities of hazardous wastes generated on-Site, it is Pinchin's opinion that this PCA does not represent an APEC at the Phase One Property;
- PCA #3 (Other – Black (likely PHC) staining was observed throughout the garage area). The concrete floor was observed to be in good condition (i.e., no cracking or pitting). Based on the above-noted information, it is Pinchin's opinion that this PCA does not represent an APEC at the Phase One Property;
- PCA #4 (Item 28: Gasoline and Associated Products Storage in Fixed Tanks – a steel gasoline AST containing new oil with a capacity of 1,000-L and a steel gasoline AST containing waste oil with a capacity of 1,000-L are located within the Site Building and were both reportedly installed in approximately 2017). No spills or evidence of historical spills (i.e., staining) was observed in the vicinity of the ASTs. The interior floor slab was observed to be in good condition (i.e., no cracking or pitting), and no drains were present in the vicinity of the ASTs. Based on the above-noted information, the above-listed PCA at the Phase One Property does not represent an APEC; and
- PCA #5 (Other – 150-L of diesel was spilled to the north portion of the Phase One Property on July 9, 1998. Based on the above-noted information, it is Pinchin's opinion that this PCA does represent an APEC at the Phase One Property.

No areas of natural significance were identified at the Phase One Property.

6.4.2 Phase One Study Area Outside of Phase One Property

The investigation of the Phase One Study Area outside of the Phase One Property consisted of the following components:

- Review of available historical records, including ERIS regulatory search, Opta documents, city directories and aerial photographs;
- Visual inspection of properties from publicly-accessible areas for evidence of PCAs and water bodies; and



- Review of mapping provided by ERIS and information provided on-line by the MNRF for the presence of areas of natural significance.

Pinchin's investigation of the Phase One Study Area outside of the Phase One Property identified the following PCAs:

- PCA #6 (Item 28: Gasoline and Associated Products Storage in Fixed Tanks – an automotive repair/servicing facility is located adjacent to the northeast elevation of the Phase One Property, while the building associated with this property is located approximately 15 m southeast). In addition, this automotive repair/servicing facility is considered an Enhanced Investigation Property. Based on the above-noted information, it is Pinchin's opinion that this PCA does represent an APEC at the Phase One Property;
- PCA #7 (Item 34: Metal Fabrication – a steel fabricator is located approximately 15 m northwest of the Phase One Property; however, the building associated with this property is located approximately 50 m northwest of the Phase One Property. In addition, this property is situated hydraulically down/transgradient of the Phase One Property). Based on the distance between the building associated with this property and the Phase One Property, as well as the inferred groundwater flow direction, it is Pinchin's opinion that this PCA does not represent an APEC at the Phase One Property;
- PCA #8 (Item 8: Chemical Manufacturing, Processing and Bulk Storage – the property located approximately 20 m southwest of the Phase One Property is located within the Waste Generator Database Review Area and was listed within the O. Reg. 347 Waste Generators database search results as a waste generator). Based on the distance between this property and the Phase One Property, it is Pinchin's opinion that this PCA does not represent an APEC at the Phase One Property;
- PCA #9 (Item 8: Chemical Manufacturing, Processing and Bulk Storage – the property located approximately 30 m northeast of the Phase One Property is located within the Waste Generator Database Review Area and was listed within the O. Reg. 347 Waste Generators database search results as a waste generator. Item 28: Gasoline and Associated Products Storage in Fixed Tanks – an automotive repair/servicing facility was located at this property in 1995). In addition, this property and is situated hydraulically down/transgradient of the Phase One Property relative to the inferred groundwater flow direction. Based on the distance between this property and the Phase One Property, the short duration of the automotive repair/servicing operations and the inferred groundwater flow direction, it is Pinchin's opinion that this PCA does not represent an APEC at the Phase One Property;



- PCA #10 (Item 31: Ink Manufacturing, Processing and Bulk Storage – a print shop is located on the property located approximately 40 m southeast of the Phase One Property). Based on the distance between this property and the Phase One Property, it is Pinchin's opinion that this PCA does not represent an APEC at the Phase One Property;
- PCA #11 (Item 8: Chemical Manufacturing, Processing and Bulk Storage – the property located approximately 90 m southeast of the Phase One Property is located within the Waste Generator Database Review Area and was listed within the O. Reg. 347 Waste Generators database search results as a waste generator. Item 28: Gasoline and Associated Products Storage in Fixed Tanks – this property was registered in the Fuel Storage Tanks database as possessing two 22,700-L double-walled fibreglass gasoline ASTs, which were installed in 2002. Item 33 – a powder coating operation is located at this property). Based on the distance between this property and the Phase One Property, it is Pinchin's opinion that this PCA does not represent an APEC at the Phase One Property; and
- PCAs #12-26 (Item 55: Transformer Manufacturing, Processing and Use – a total of 35 pole-mounted oil-cooled transformers are located within 250 m of the Phase One Property). However, no evidence of spills or historical spills (i.e., staining) was observed in the vicinity of these transformers and no issues of potential environmental concern (i.e., spills) were noted for these transformers within the ERIS report. In addition, any maintenance/environmental issues associated with these transformers would be the responsibility of Hydro Ottawa. Based on the above-noted information, as well as the distance between these transformers and the Phase One property, it is Pinchin's opinion that these PCAs do not represent APECs at the Phase One Property.

No areas of natural significance were identified within the Phase One Study Area outside of the Phase One Property.

The records review did not identify the presence of wells within the Phase One Study Area that supply water for human consumption or for agricultural purposes.

Based on a cursory review of the properties greater than 250 m (i.e., outside of the Phase One Study Area), but less than 1 km, from the Phase One Study Area, Pinchin did not note or observe any significant contaminating properties that should be included as part of this assessment (i.e., landfills, large industrial manufacturers, etc.).

Plans identifying the locations of the on and off-Site PCAs for this Phase One ESA are provided on Figure 3. Plans identifying the locations of the on and off-Site APECs for this Phase One ESA are provided on Figure 4.



7.0 REVIEW AND EVALUATION OF INFORMATION

7.1 Current and Past Uses

To the best of Pinchin's knowledge, the Phase One Property was developed between 1985 and 1991. A review of the aerial photographs, as well as an interview with the Site Representatives, determined that prior to 1991, the Phase One Property consisted of vacant undeveloped land. In the 1985 aerial photograph reviewed by Pinchin, the Phase One Property consisted of vacant undeveloped land, and in the 1991 aerial photograph reviewed by Pinchin, the present-day Site Building was evident on the Phase One Property. Therefore, it is Pinchin's opinion that the first developed use of the Phase One Property was developed between 1985 and 1991.

The date of the first developed use of the Phase One Property was determined through a review of aerial photographs, as well as an interview with the Site Representatives. No other information was reviewed by Pinchin during the records review, or obtained during the Site reconnaissance or interviews which would have resulted in a different interpretation of the date of first developed use of the Phase One Property.

7.2 Potentially Contaminating Activities

The following PCAs as defined by O. Reg. 153/04 were documented by Pinchin to have occurred on the Phase One Property:

- PCA #1 (Item 10: Commercial Autobody Shops – an active automotive repair/servicing facility is located at the Phase One Property). Based on the above-noted information, it is Pinchin's opinion that the Phase One property is considered an Enhanced Investigation Property and that this PCA does represent an APEC at the Phase One Property;
- PCA #2 (Item 8: Chemical Manufacturing, Processing and Bulk Storage – the Phase One Property is located within the Waste Generator Database Review Area and was listed within the O. Reg. 347 Waste Generators database search results as a waste generator). Based on the limited annual quantities of hazardous wastes generated on-Site, it is Pinchin's opinion that this PCA does not represent an APEC at the Phase One Property;
- PCA #3 (Other – Black (likely PHC) staining was observed throughout the garage area). The concrete floor was observed to be in good condition (i.e., no cracking or pitting). Based on the above-noted information, it is Pinchin's opinion that this PCA does not represent an APEC at the Phase One Property;



- PCA #4 (Item 28: Gasoline and Associated Products Storage in Fixed Tanks – a steel gasoline AST containing new oil with a capacity of 1,000-L and a steel gasoline AST containing waste oil with a capacity of 1,000-L are located within the Site Building and were both reportedly installed in approximately 2017). No spills or evidence of historical spills (i.e., staining) was observed in the vicinity of the ASTs. The interior floor slab was observed to be in good condition (i.e., no cracking or pitting), and no drains were present in the vicinity of the ASTs. Based on the above-noted information, the above-listed PCA at the Phase One Property does not represent an APEC; and
- PCA #5 (Other – 150-L of diesel was spilled to the north portion of the Phase One Property on July 9, 1998. Based on the above-noted information, it is Pinchin's opinion that this PCA does represent an APEC at the Phase One Property.

The following PCAs as defined by O. Reg. 153/04 were documents by Pinchin to have occurred within the Phase One Study Area, outside of the Phase One Property:

- PCA #6 (Item 28: Gasoline and Associated Products Storage in Fixed Tanks – an automotive repair/servicing facility is located adjacent to the northeast elevation of the Phase One Property, while the building associated with this property is located approximately 15 m southeast). In addition, this automotive repair/servicing facility is considered an Enhanced Investigation Property. Based on the above-noted information, it is Pinchin's opinion that this PCA does represent an APEC at the Phase One Property;
- PCA #7 (Item 34: Metal Fabrication – a steel fabricator is located approximately 15 m northwest of the Phase One Property; however, the building associated with this property is located approximately 50 m northwest of the Phase One Property. In addition, this property is situated hydraulically down/transgradient of the Phase One Property). Based on the distance between the building associated with this property and the Phase One Property, as well as the inferred groundwater flow direction, it is Pinchin's opinion that this PCA does not represent an APEC at the Phase One Property;
- PCA #8 (Item 8: Chemical Manufacturing, Processing and Bulk Storage – the property located approximately 20 m southwest of the Phase One Property is located within the Waste Generator Database Review Area and was listed within the O. Reg. 347 Waste Generators database search results as a waste generator). Based on the distance between this property and the Phase One Property, it is Pinchin's opinion that this PCA does not represent an APEC at the Phase One Property;



- PCA #9 (Item 8: Chemical Manufacturing, Processing and Bulk Storage – the property located approximately 30 m northeast of the Phase One Property is located within the Waste Generator Database Review Area and was listed within the O. Reg. 347 Waste Generators database search results as a waste generator. Item 28: Gasoline and Associated Products Storage in Fixed Tanks – an automotive repair/servicing facility was located at this property in 1995). In addition, this property is situated hydraulically down/transgradient of the Phase One Property relative to the inferred groundwater flow direction. Based on the distance between this property and the Phase One Property, the short duration of the automotive repair/servicing operations and the inferred groundwater flow direction, it is Pinchin's opinion that this PCA does not represent an APEC at the Phase One Property;
- PCA #10 (Item 31: Ink Manufacturing, Processing and Bulk Storage – a print shop is located on the property located approximately 40 m southeast of the Phase One Property). Based on the distance between this property and the Phase One Property, it is Pinchin's opinion that this PCA does not represent an APEC at the Phase One Property;
- PCA #11 (Item 8: Chemical Manufacturing, Processing and Bulk Storage – the property located approximately 90 m southeast of the Phase One Property is located within the Waste Generator Database Review Area and was listed within the O. Reg. 347 Waste Generators database search results as a waste generator. Item 28: Gasoline and Associated Products Storage in Fixed Tanks – this property was registered in the Fuel Storage Tanks database as possessing two 22,700-L double-walled fibreglass gasoline ASTs, which were installed in 2002. Item 33 – a powder coating operation is located at this property). Based on the distance between this property and the Phase One Property, it is Pinchin's opinion that this PCA does not represent an APEC at the Phase One Property; and
- PCAs #12-26 (Item 55: Transformer Manufacturing, Processing and Use – a total of 35 pole-mounted oil-cooled transformers are located within 250 m of the Phase One Property). However, no evidence of spills or historical spills (i.e., staining) was observed in the vicinity of these transformers and no issues of potential environmental concern (i.e., spills) were noted for these transformers within the ERIS report. In addition, any maintenance/environmental issues associated with these transformers would be the responsibility of Hydro Ottawa. Based on the above-noted information, as well as the distance between these transformers and the Phase One property, it is Pinchin's opinion that these PCAs do not represent APECs at the Phase One Property.



7.3 Areas of Potential Environmental Concern

The following PCAs as defined by O. Reg. 153/04 were documented by Pinchin to have occurred within the Phase One Study Area, and could represent APECs at the Phase One Property:

- PCA #1 (Item 10: Commercial Autobody Shops – an active automotive repair/servicing facility is located at the Phase One Property). Based on the above-noted information, it is Pinchin's opinion that the Phase One property is considered an Enhanced Investigation Property and that this PCA does represent an APEC at the Phase One Property;
- PCA #5 (Other – 150-L of diesel was spilled to the north portion of the Phase One Property on July 9, 1998. Based on the above-noted information, it is Pinchin's opinion that this PCA does represent an APEC at the Phase One Property; and
- PCA #6 (Item 28: Gasoline and Associated Products Storage in Fixed Tanks – an automotive repair/servicing facility is located adjacent to the northeast elevation of the Phase One Property, while the building associated with this property is located approximately 15 m southeast). In addition, this automotive repair/servicing facility is considered an Enhanced Investigation Property. Based on the above-noted information, it is Pinchin's opinion that this PCA does represent an APEC at the Phase One Property.

7.4 Phase One Conceptual Site Model

A conceptual site model (CSM) has been created to provide a summary of the findings of the Phase One ESA. The Phase One CSM is summarized in Figures 1 through Figure 3 which illustrate the following features within the Phase One Study Area, where present:

- Existing buildings and structures;
- Water bodies located in whole or in part within the Phase One Study Area;
- Areas of natural significance located in whole or in part within the Phase One Study Area;
- Drinking water wells located at the Phase One Property;
- Land use of adjacent properties;
- Roads within the Phase One Study Area;
- PCAs within the Phase One Study Area, including the locations of tanks; and
- APECs at the Phase One Property.

The following provides a narrative summary of the Phase One CSM:

- The Phase One Property consists of one legal plot situated at the municipal address of 158 Cardevco Road, Ottawa, Ontario, which is currently owned by Whelan Truck Repair



Inc. The Phase One Property is located immediately southeast of Cardevco Road, approximately 265 m southwest of the intersection of Carp Road and Cardevco Road. The Phase One Property is presently developed with a single-storey light industrial building (Site Building). There is no record of industrial use or of a commercial use (e.g., garage, bulk liquid dispensing facility or dry cleaner) that would require classifying the Phase One Property as an enhanced investigation property;

- The nearest surface water body is the Carp River located approximately 520 m north of the Phase One Property at an elevation of approximately 12 mamsl;
- No areas of natural significance were identified within the Phase One Study Area;
- One drinking water well is located on the southwest portion of the Phase One Property;
- The adjacent and surrounding properties in the vicinity of the Site consist of commercial, light industrial and vacant land uses. The properties located northeast of the Phase One Property consist of an automotive repair/servicing facility and commercial buildings to beyond 200 m from the Phase One Property; the properties located northwest of commercial buildings, a steel fabricator, vacant undeveloped land and associated roadways to beyond 200 m from the Phase One Property; the properties located southwest of the Phase One Property consist of commercial buildings, a print shop, vacant undeveloped land and associated roadways to beyond 200 m from the Phase One Property; and the properties located southeast of the Phase One Property consist of commercial building, a powder coating operation and associated roadways to beyond 200 m from the Phase One Property;
- Five PCAs were identified at the Phase One Property. Of the on-Site PCAs, three are not considered to result in APECs at the Phase One Property (i.e., the Phase One Property being located within the Waste Generator Database Review Area and listed within the O. Reg. 347 Waste Generators database search results as a waste generator; black (likely PHC) staining observed throughout the garage area; and a steel gasoline AST containing new oil with a capacity of 1,000-L and a steel gasoline AST containing waste oil with a capacity of 1,000-L located within the Site Building and both reportedly installed in approximately 2017). 21 PCAs were identified within the Phase One Study Area. Of the off-Site PCAs, 20 are not considered to result in APECs at the Phase One Property:
 - A steel fabricator located approximately 15 m northwest of the Phase One Property; however, the building associated with this property is located approximately 50 m northwest of the Phase One Property;



- The property located approximately 20 m southwest of the Phase One Property located within the Waste Generator Database Review Area and listed within the O. Reg. 347 Waste Generators database search results as a waste generator;
- The property located approximately 30 m northeast of the Phase One Property located within the Waste Generator Database Review Area and listed within the O. Reg. 347 Waste Generators database search results as a waste generator. In addition, this property possessed an automotive repair/servicing facility in 1995;
- A print shop located on the property located approximately 40 m southeast of the Phase One Property;
- The property located approximately 90 m southeast of the Phase One Property located within the Waste Generator Database Review Area and listed within the O. Reg. 347 Waste Generators database search results as a waste generator. In addition, this property was registered in the Fuel Storage Tanks database as possessing two 22,700-L double-walled fiberglass gasoline ASTs, which were installed in 2002, and this property is currently a powder coating operation; and
- A total of 35 pole-mounted oil-cooled transformers located within 250 m of the Phase One Property.

However, no evidence of spills or historical spills (i.e., staining) observed in the vicinity of the transformers and no issues of potential environmental concern (i.e., spills) were noted for the transformers within the ERIS report and any maintenance/environmental issues associated with the transformers would be the responsibility of Hydro Ottawa. Based on the above-noted information, as well as no evidence of historical spills (i.e., staining) observed in the vicinity of the on-Site ASTs; the concrete floor in the vicinity of the ASTs and staining being in good condition (i.e., no cracking or pitting); the limited annual quantities of hazardous wastes; the distance between these properties and the Phase One property; and the inferred groundwater flow direction, it is Pinchin's opinion that these PCAs do not represent APECs for the Phase One Property;

- Three PCAs (i.e., PCAs #1, 5 and 6) were identified within the Phase One Study Area that represents APECs for the Phase One Property (i.e., an active automotive repair/servicing facility is located at the Phase One Property; 150-L of diesel spilled to the north portion of the Phase One Property on July 9, 1998; and an active automotive repair/servicing facility is located adjacent to the northeast elevation of the Phase One Property). Based on the nature of these on and off-Site operations (i.e., automotive repair/servicing facilities), the quantity of the diesel spill and the close proximity of the off-



Site operation to the Phase One Property, it is Pinchin's opinion that the Phase One property, and the property located adjacent to the northeast elevation of the Phase One Property, are considered Enhanced Investigation Properties and that these PCAs do represent APECs at the Phase One Property. Figure 4 provides a detailed summary of the APECs;

- Underground utilities at the Phase One Property provide natural gas, electrical, telephone and cable services to the Site Building. These services enter the Site Building through subsurface conduits, with the exception of a pressurized natural gas line, which connects to meters located along the exterior of the Site Building;
- The Phase One Property and the surrounding properties located within the Phase One Study Area are located within alluvial deposits consisting of stratified gravel, sand, silt and clay. Bedrock is expected to consist of sedimentary rocks consisting of limestone, dolomite, shale, argillite, sandstone, quartzite, and/or grit; and
- The Phase One Property is relatively flat. Local groundwater flow is inferred to be to the east, based on the nearest surface water body.

There were no deviations from the Phase One ESA requirements specified in O. Reg. 153/04 or absence of information that have resulted in uncertainty that would affect the validity of the Phase One CSM.

8.0 CONCLUSIONS

Pinchin conducted this Phase One ESA in accordance with Part VII and Schedule D of O. Reg. 153/04. The purpose of the Phase One ESA was to assess the potential presence of environmental impacts at the Phase One Property due to activities at and near the Phase One Property in support of filing the potential Site Plan Approval application at the Phase One Property.

Based on the findings of this Phase One ESA, Pinchin identified five PCAs at the Phase One Property (i.e., on-Site) and 21 PCAs within the Phase One Study Area outside of the Phase One Property (i.e., off-Site). Of the PCAs, 23 are not considered to result in APECs at the Phase One Property given no evidence of spills or historical spills (i.e., staining) observed in the vicinity of the transformers and no issues of potential environmental concern (i.e., spills) noted for the transformers within the ERIS report and any maintenance/environmental issues associated with the transformers would be the responsibility of Hydro Ottawa. Based on the above-noted information, as well as no evidence of historical spills (i.e., staining) observed in the vicinity of the on-Site ASTs; the concrete floor in the vicinity of the ASTs and staining being in good condition (i.e., no cracking or pitting); the limited annual quantities of hazardous wastes; the distance between these properties and the Phase One property; and the inferred groundwater flow direction, it is Pinchin's opinion that these PCAs do not represent APECs for the Phase



One Property. The remaining two on-Site PCAs and one off-Site PCA have resulted in three APECs at the Phase One Property. It is Pinchin's opinion that these PCAs may have impacted soil and groundwater quality at the Phase One Property and, as such, PCAs #1, 5 and 6 have resulted in APECs at the Phase One Property that warrants further investigation prior to the application of a Site Plan Approval application with the City of Ottawa.

Pinchin recommends that a Phase Two ESA be conducted at the Phase One Property as an "assessment of property conducted in accordance with the regulations by or under the supervision of a qualified person to determine the location and concentration of one or more contaminants in the land or water on, in or under the property". Pinchin concludes that one or more contaminants originating from PCAs located on the Phase One Property and within the Phase One Study Area may have affected land or water on, in, or under the Phase One Property. Therefore, Pinchin recommends that a Phase Two ESA be conducted prior to the application of a Site Plan Approval application with the City of Ottawa.

It should be noted that the references and sources for the information used in evaluating the Phase One Property are provided in the relevant sections of this report. Specific references are also summarized in Section 9.0.

8.1 Signatures

This Phase One ESA was undertaken under the supervision of Scott Mather, P.Eng, QP_{ESA} in accordance with the requirements of O. Reg. 153/04 to support the future Site Plan Approval application at the Phase One Property. The conclusions and recommendations provided in this report represent the best judgement of the assessors based on the Site conditions observed on October 12, 2022, and a review of available historical information and information obtained from interviews.

We trust that the information provided in this report meets your current requirements.

8.2 Terms and Limitations

This Phase One ESA was performed in order to identify potential issues of environmental concern associated with the property located at 158 Cardevco Road, Ottawa, Ontario (Site), at the time of the Site reconnaissance. This Phase One ESA was performed in general compliance with currently acceptable practices for environmental site investigations, and specific Client requests, as applicable to this Site. This report was prepared for the exclusive use of Whelan Truck Repair Inc. (Client), subject to the terms, conditions and limitations contained within the duly authorized proposal for this project. Any use which a third party makes of this report, or any reliance on or decisions to be made based on it, is the sole responsibility of such third parties. Pinchin accepts no responsibility for damages suffered by any third party as a result of decisions made or actions conducted.



If additional parties require reliance on this report, written authorization from Pinchin will be required. Such reliance will only be provided by Pinchin following written authorization from the Client. Pinchin disclaims responsibility of consequential financial effects on transactions or property values, or requirements for follow-up actions and costs. No other warranties are implied or expressed. Pinchin will not provide results or information to any party unless disclosure by Pinchin is required by law.

The information provided in this report is based upon analysis of available documents, records and drawings, and personal interviews. In evaluating the Site, Pinchin has relied in good faith on information provided by other individuals noted in this report. Pinchin has assumed that the information provided is factual and accurate. In addition, the findings in this report are based, to a large degree, upon information provided by the current owner/occupant. Pinchin accepts no responsibility for any deficiency, misstatement or inaccuracy contained in this report as a result of omissions, misinterpretations or fraudulent acts of persons interviewed or contacted, or contained in reports that were reviewed. The scope of work for this Phase One ESA did not include a visual or intrusive investigation for designated substances (e.g., asbestos, mould, PCB-containing electrical equipment, etc.) and, therefore, these materials may be present at the Site.

Pinchin makes no other representations whatsoever, including those concerning the legal significance of its findings, or as to other legal matters touched on in this report, including, but not limited to, ownership of any property, or the application of any law to the facts set forth herein. With respect to regulatory compliance issues, regulatory statutes are subject to interpretation and these interpretations may change over time.

Ontario Regulation 153/04 does not apply to environmental auditing or environmental management systems. Therefore, with respect to Site operations and conditions, compliance with applicable federal, provincial or municipal acts, regulations, laws and/or statutes was not evaluated as part of the Phase One ESA.

9.0 REFERENCES

The following documents, persons or organizations provided information used in this report:

- Greg Whelan and Ryan Whelan, Co-owners of the Phase One Property [Site Representatives].
- ERIS reported entitled "158 Cardevco Road, Ottawa, Ontario", and dated October 12, 2022 (ERIS Project # 22100605450).
- Opta Information Intelligence.



Phase One Environmental Site Assessment

158 Cardevco Road, Ottawa, Ontario
Whelan Truck Repair Inc.

November 8, 2022

Pinchin File: 316252


- The Atlas of Canada – Surficial Materials:
<http://atlas.nrcan.gc.ca/site/english/maps/environment/land/surficialmaterials/1>.
- The Atlas of Canada – Bedrock Geology:
<http://atlas.gc.ca/site/english/maps/archives/3rdedition/environment/land/016?w=4&h=4&l=6&r=4&c=12>.
- Toporama – Topographic Maps:
<http://atlas.gc.ca/site/english/maps/topo/map>.
- Province of Ontario. Environmental Protection Act R.S.O. 1990, c. E.19 and Ontario Regulation 153/04: Records of Site Condition – Part XV.1 of the Act. Last amended by Ontario Regulation 333/13 on December 13, 2013.
- Canadian Standards Association (CSA) Standard. CSA Z768-01, Phase I Environmental Site Assessment, Canadian Standards Association International, November 2001, reaffirmed in 2012.
- Ministry of the Environment, Conservation and Parks.
- MECP Brownfields Environmental Site Registry.
- National Air Photo Library, Ottawa, Ontario.
- Technical Standards and Safety Authority.
- Intera Technologies Inc. *Inventory of Coal Gasification Plant Waste Sites in Ontario*. April 1987.
- Intera Technologies Inc. *Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario*. November 1988.
- “Phase I Environmental Site Assessment, 158 Cardevco Road, Ottawa, Ontario” prepared by Pinchin for 1496143 Ontario Ltd., and dated August 16, 2016.

\\pinchin.com\ott\Job\316000s\0316252.000 Pri-TecConst,158CardevcoRd,EDR,PhaseOne\Deliverables\316252 Phase One ESA 158 Cardevco Road Ottawa ON Pri-Tec.docx


Template: Master Report for RSC Phase One ESA Report, EDR, October 16, 2020

10.0 APPENDICES

APPENDIX A
Figures

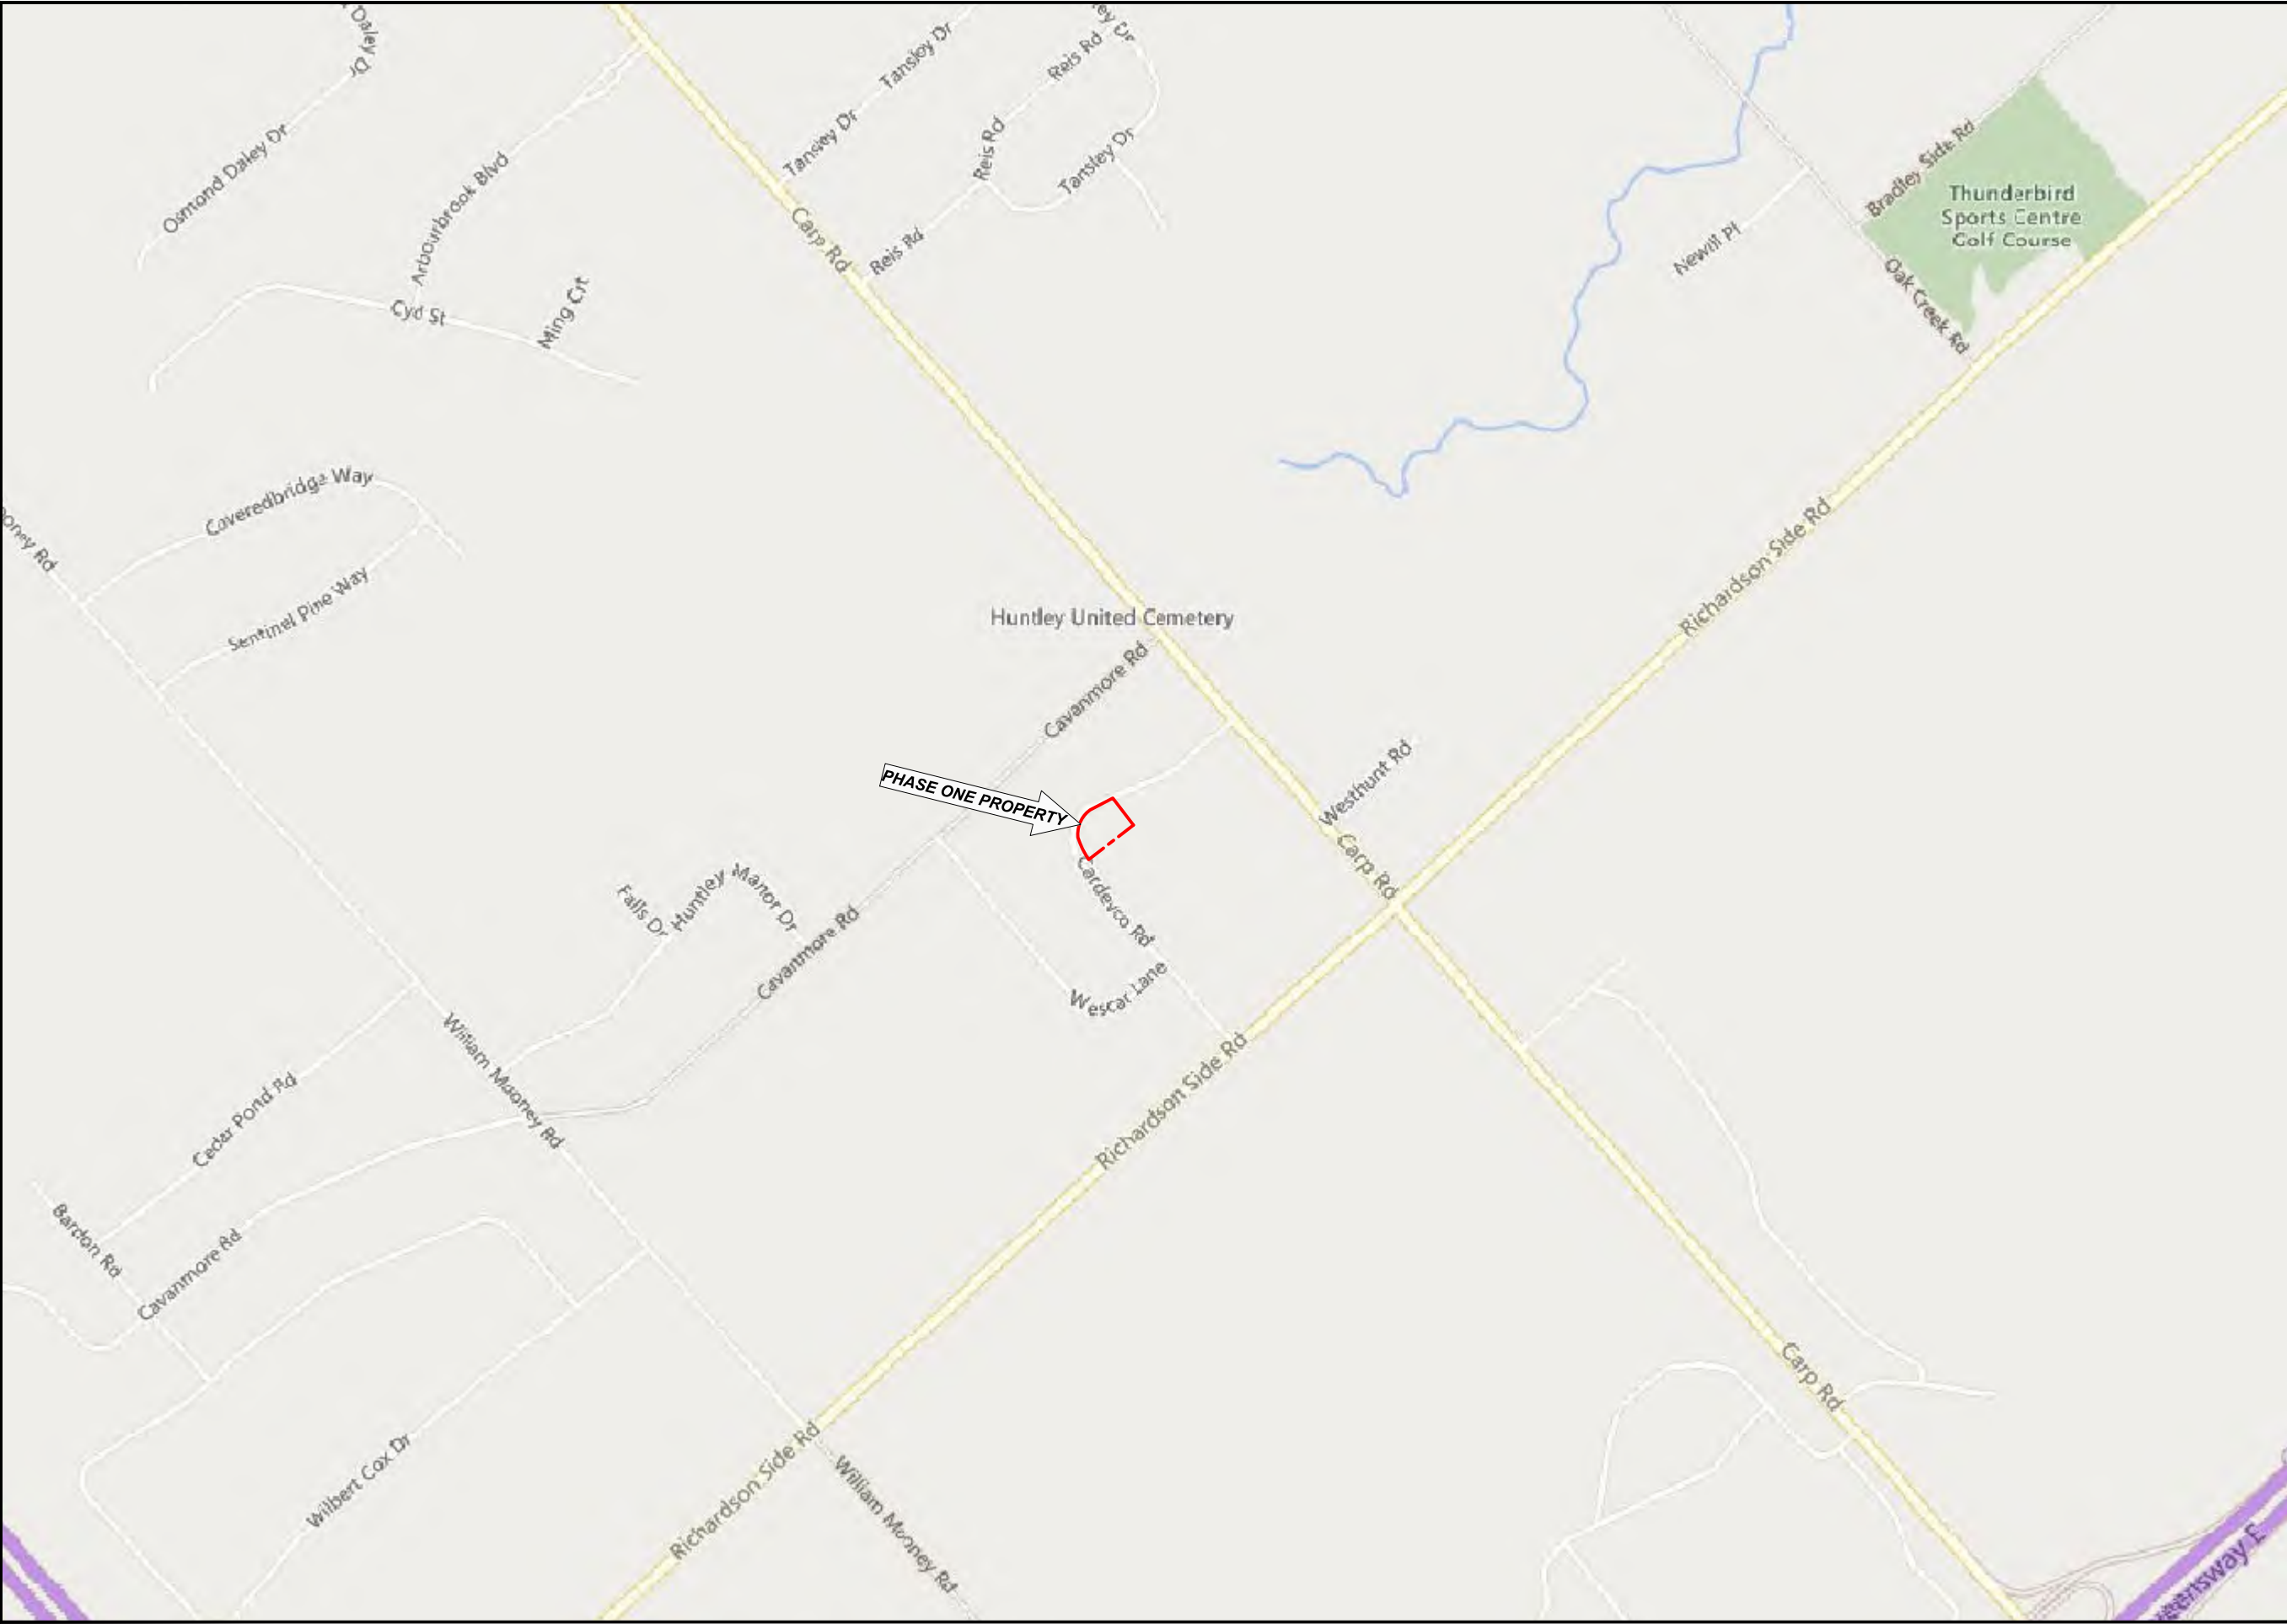

PROJECT NAME: PHASE ONE ENVIRONMENTAL SITE ASSESSMENT	
CLIENT NAME: WHELAN TRUCK REPAIR INC.	
PROJECT LOCATION: 158 CARDEVCO ROAD, OTTAWA, ONTARIO	
FIGURE NAME: KEY MAP	
PROJECT NUMBER: 316252	SCALE: AS SHOWN
DRAWN BY: KL	REVIEWED BY: AK
DATE: NOVEMBER 2022	FIGURE NUMBER: 1

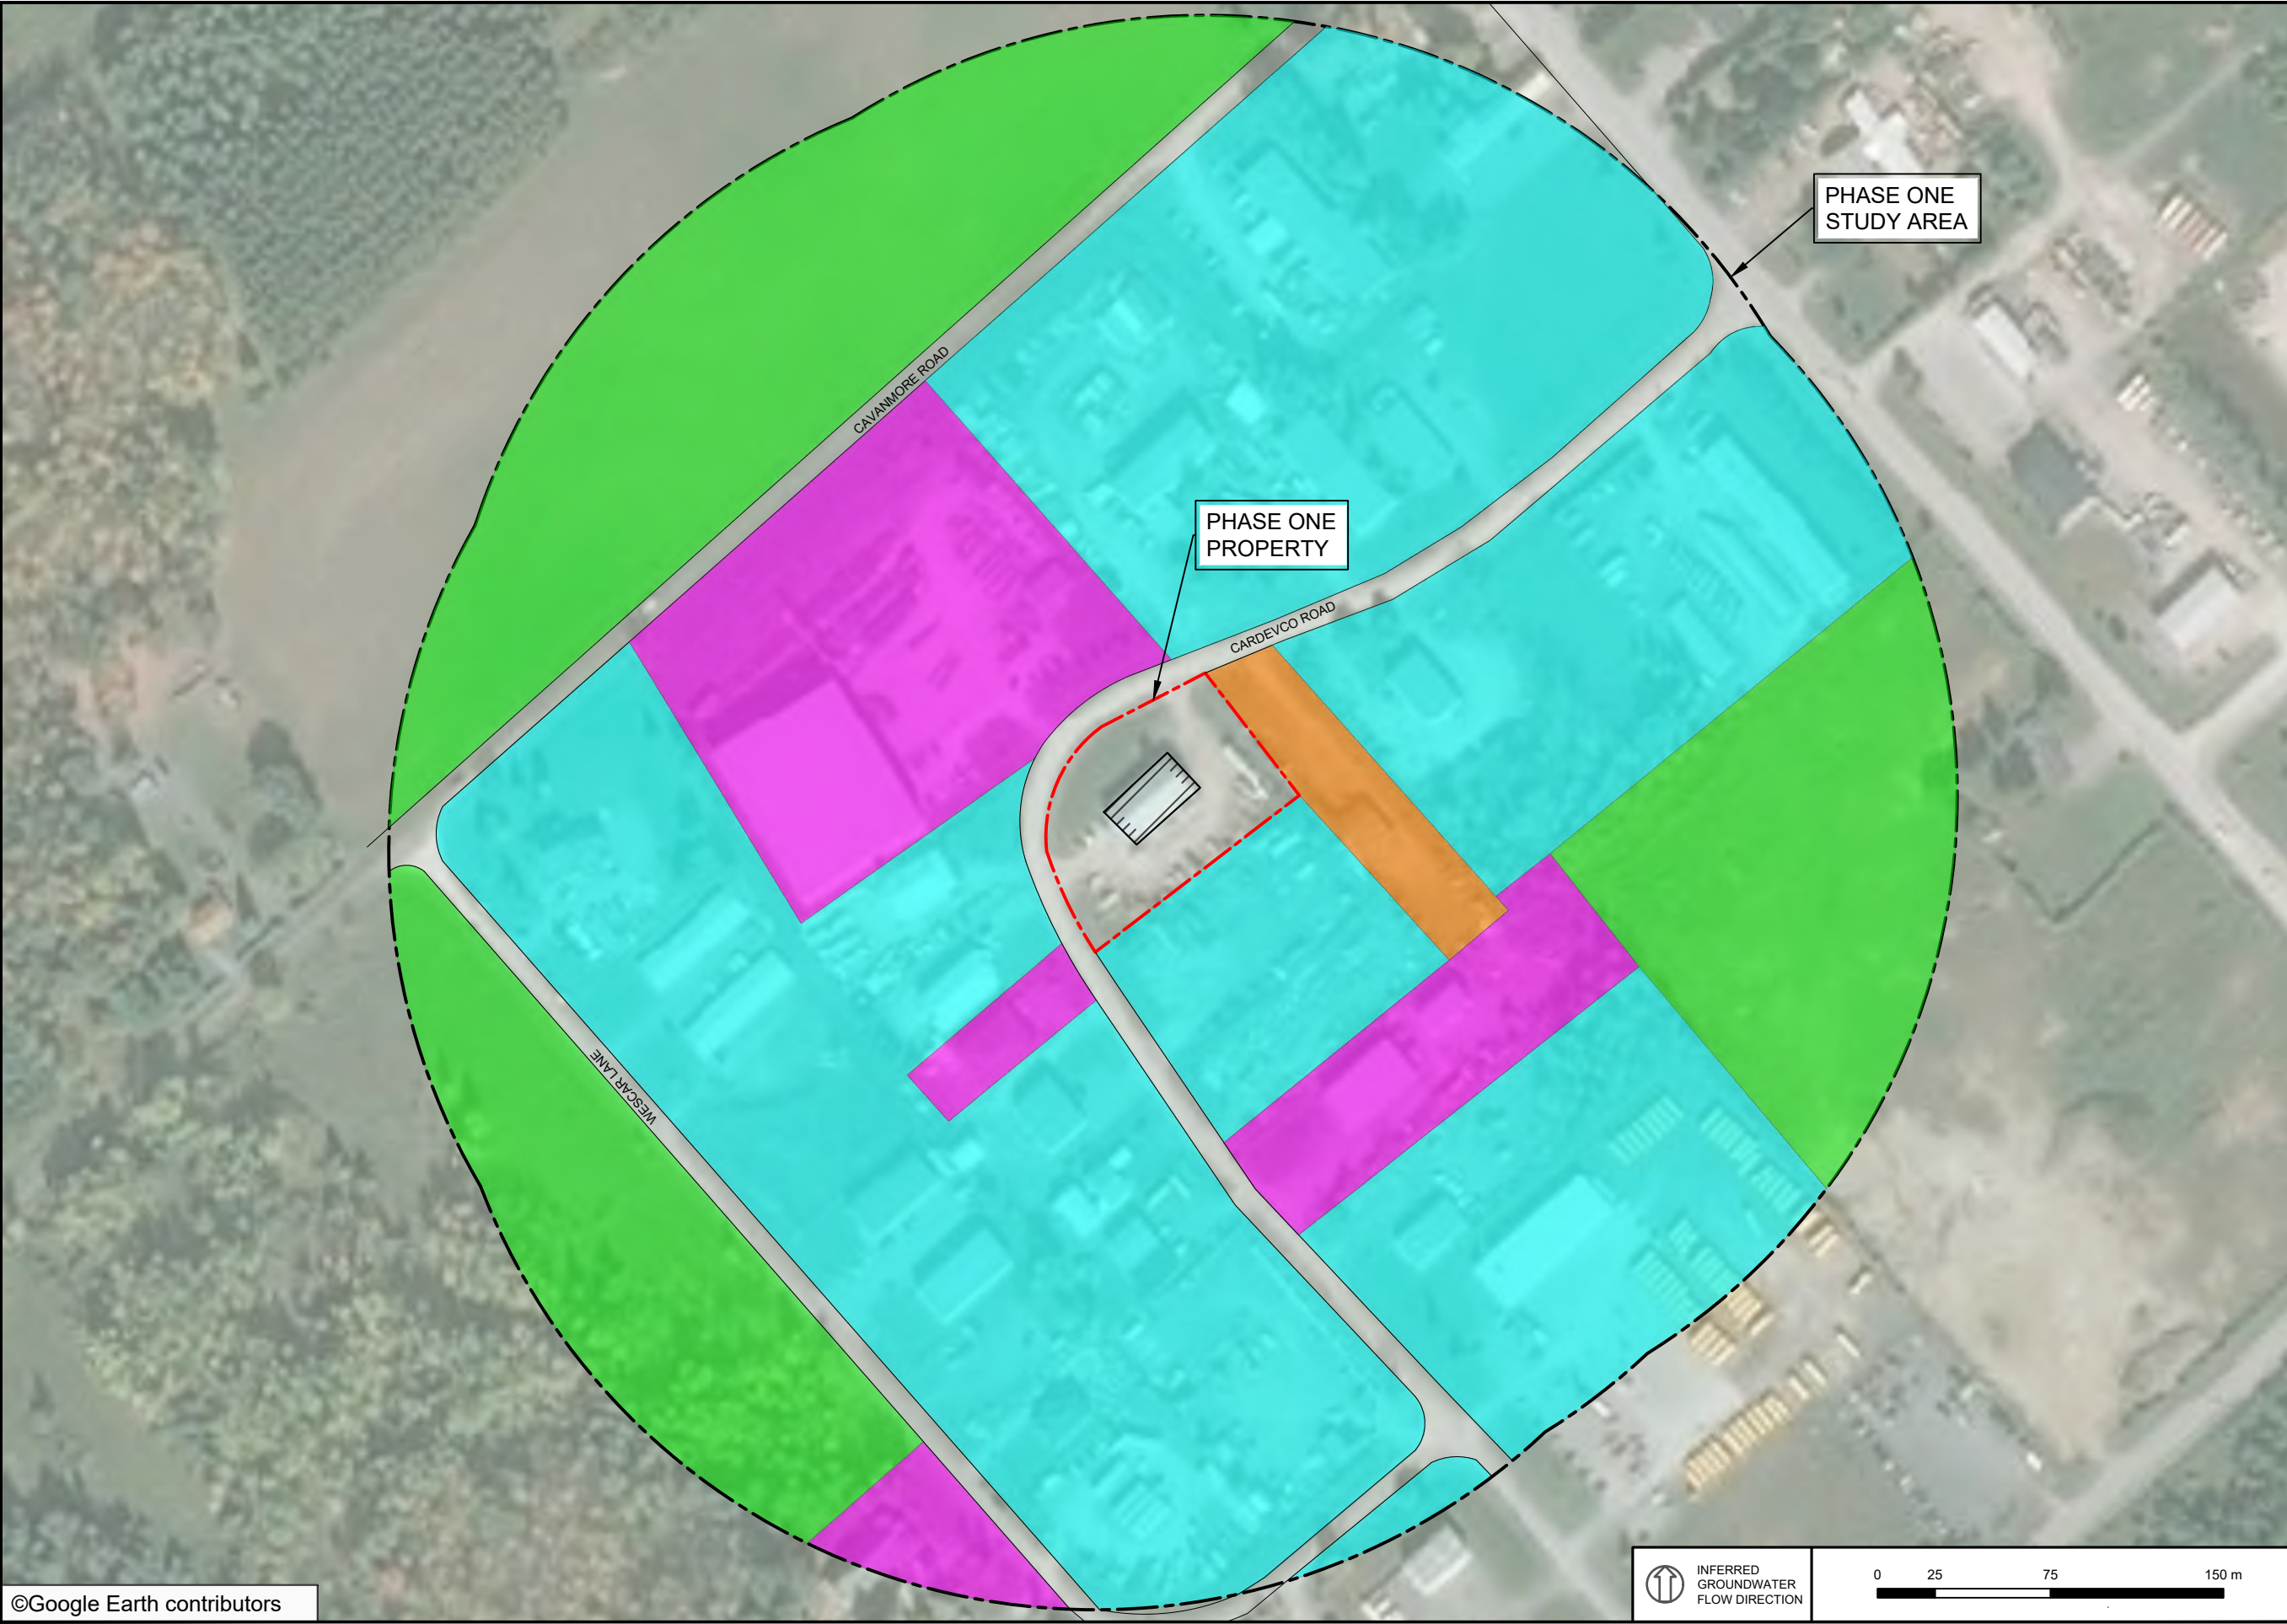

LEGEND

- SITE BOUNDARY
- SITE BUILDING
- COMMERCIAL
- VACANT
- LIGHT INDUSTRIAL
- AUTOMOTIVE REPAIR/SERVICING FACILITY

LEGEND IS COLOUR DEPENDENT.
NON-COLOUR COPIES MAY ALTER
INTERPRETATION.



PROJECT NAME:
PHASE ONE ENVIRONMENTAL SITE ASSESSMENT

CLIENT NAME:
WHELAN TRUCK REPAIR INC.

PROJECT LOCATION:
158 CARDEVCO ROAD,
OTTAWA, ONTARIO

FIGURE NAME:
PHASE ONE STUDY AREA

PROJECT NUMBER:
316252


SCALE:
AS SHOWN

DRAWN BY:
KL

REVIEWED BY:
AK


DATE:
NOVEMBER 2022

FIGURE NUMBER:
2



INFERRED
GROUNDWATER
FLOW DIRECTION

0 25 75 150 m

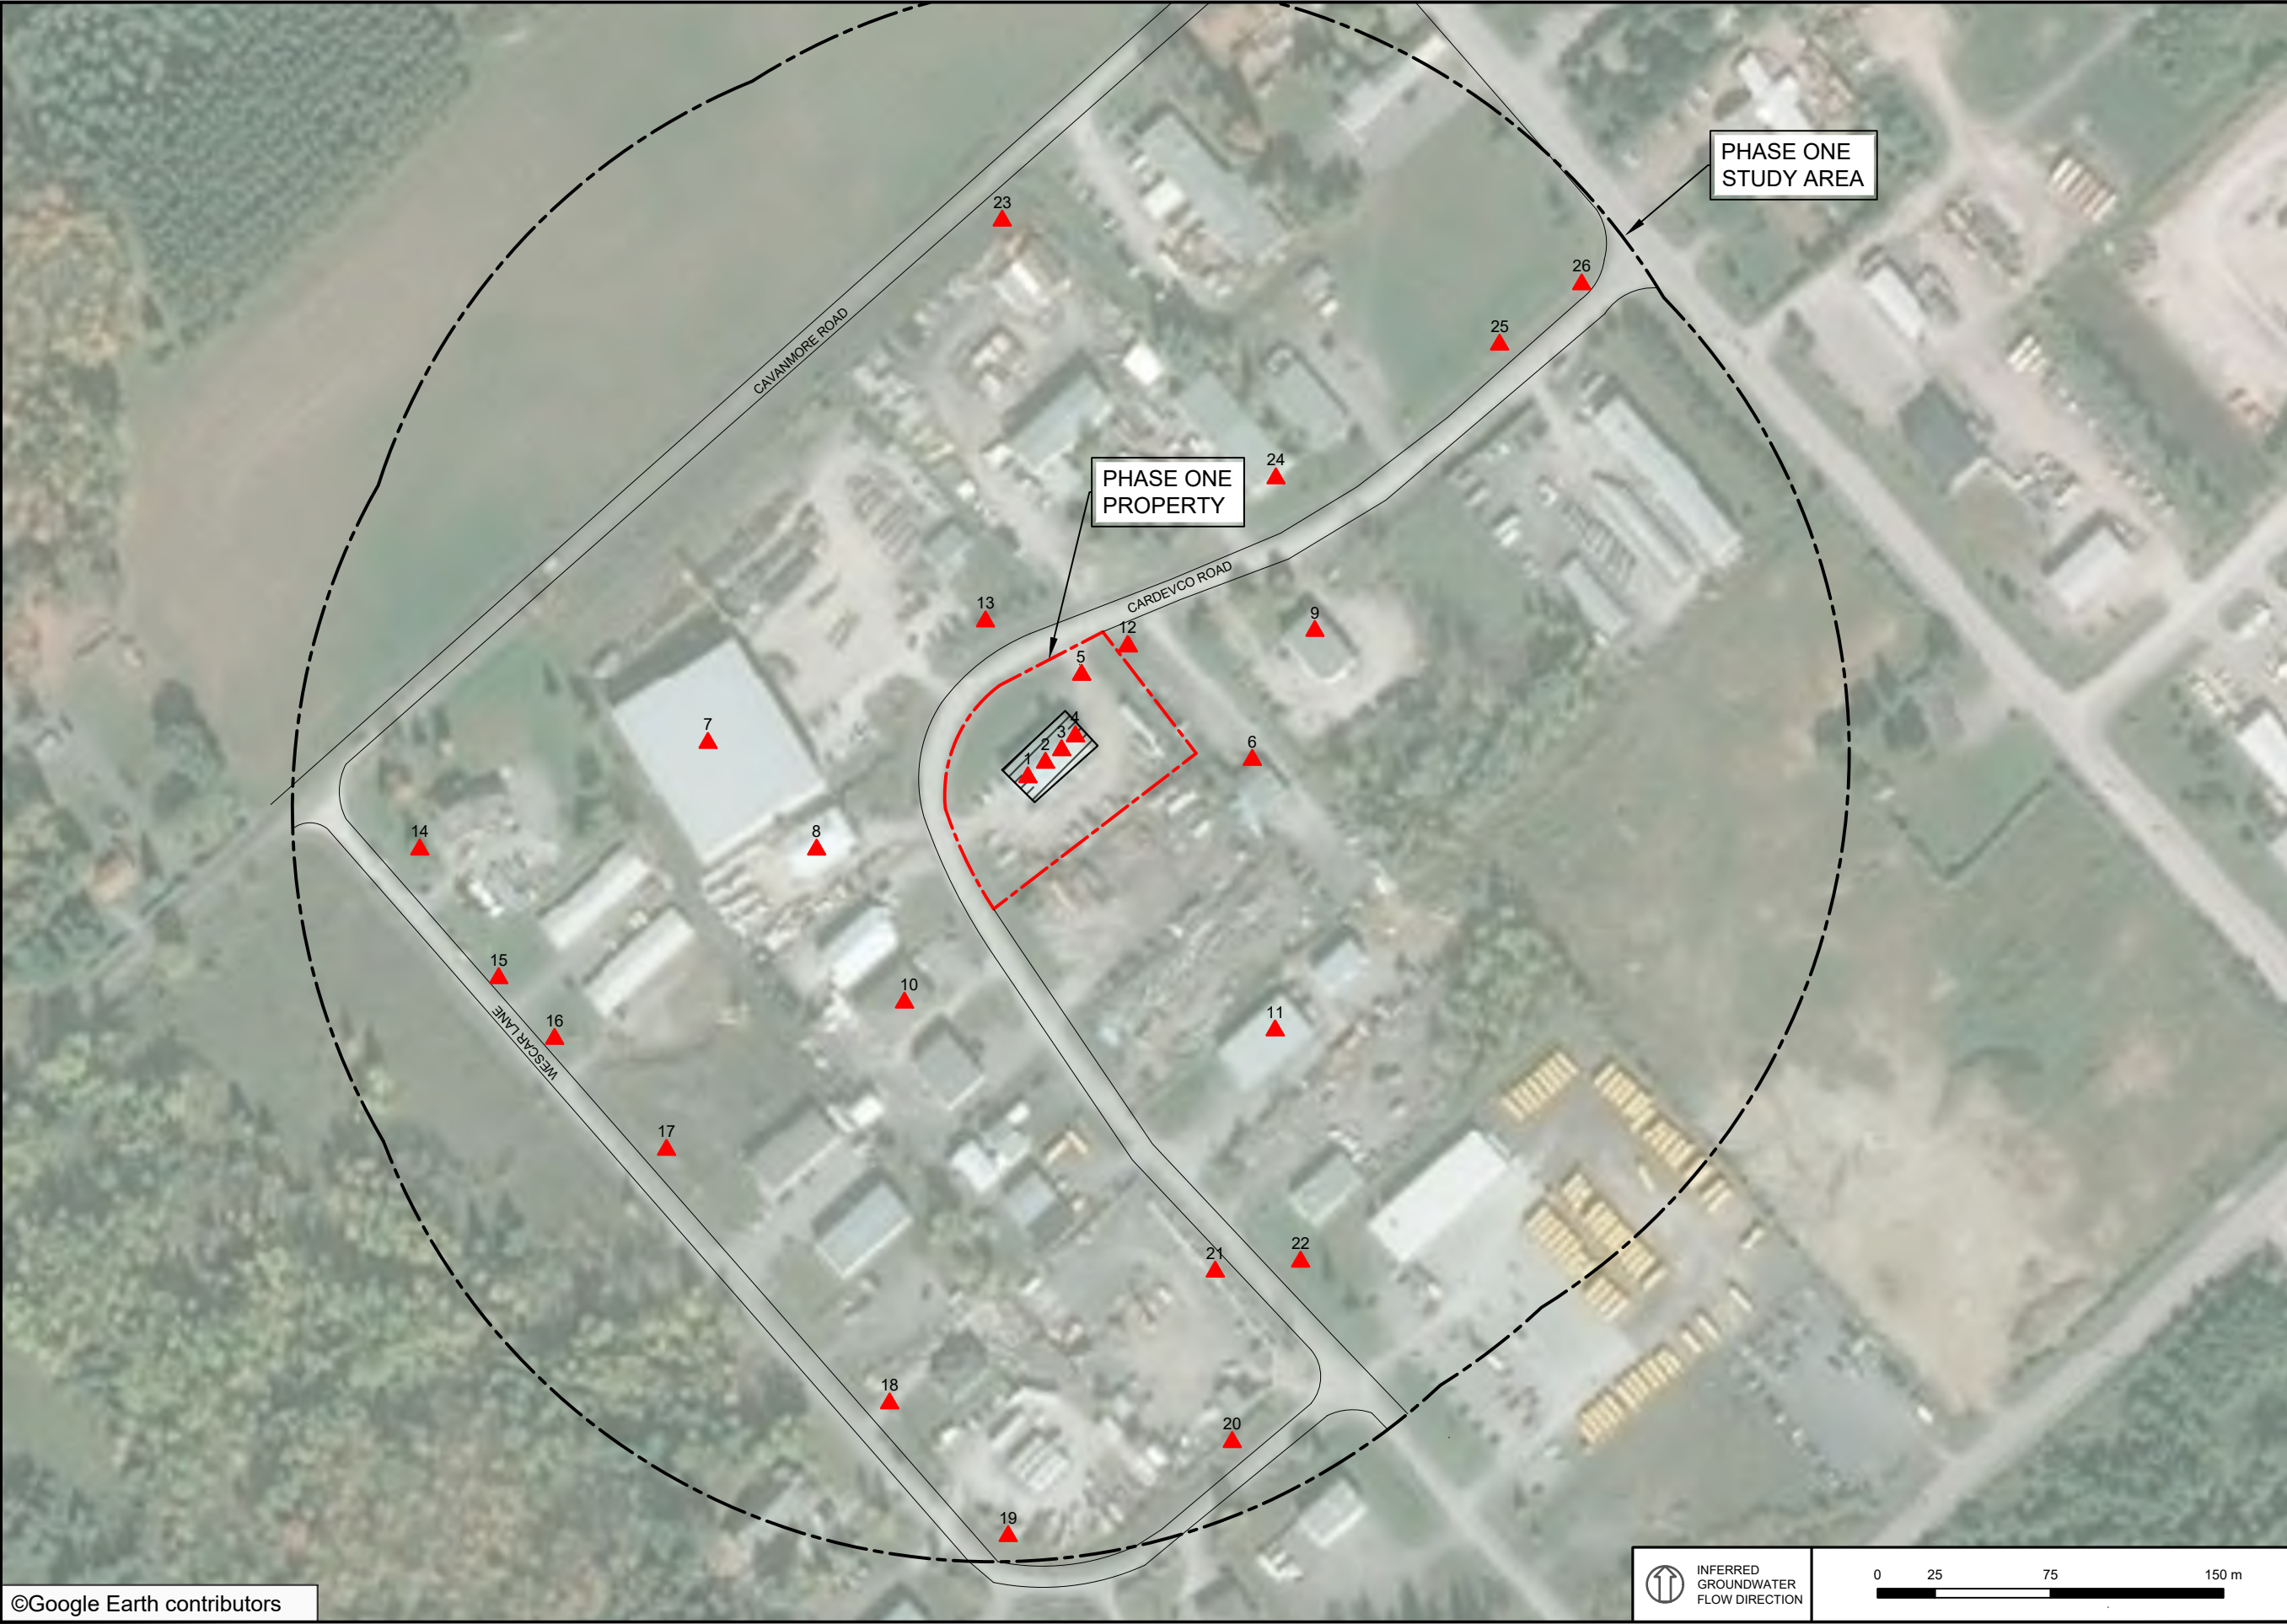

LEGEND

- SITE BOUNDARY
- SITE BUILDING
- PCA
- PCA POTENTIALLY CONTAMINATING ACTIVITY

LEGEND IS COLOUR DEPENDENT.
NON-COLOUR COPIES MAY ALTER
INTERPRETATION.



PROJECT NAME:
PHASE ONE
ENVIRONMENTAL SITE
ASSESSMENT

CLIENT NAME:
WHELAN TRUCK REPAIR INC.

PROJECT LOCATION:
158 CARDEVCO ROAD,
OTTAWA, ONTARIO

FIGURE NAME:
POTENTIALLY CONTAMINATING
ACTIVITIES

PROJECT NUMBER:
316252

SCALE:
AS SHOWN

DRAWN BY:
KL


REVIEWED BY:
AK

DATE:
NOVEMBER 2022

FIGURE NUMBER:
3



INFERRED
GROUNDWATER
FLOW DIRECTION





- LEGEND**
- SITE BOUNDARY
 - SITE BUILDING
 - APECs 1 and 2
 - APEC 3
 - APEC AREA OF POTENTIAL ENVIRONMENTAL CONCERN

LEGEND IS COLOUR DEPENDENT.
NON-COLOUR COPIES MAY ALTER
INTERPRETATION.




PROJECT NAME:
PHASE ONE
ENVIRONMENTAL SITE
ASSESSMENT

CLIENT NAME:
WHELAN TRUCK REPAIR INC.

PROJECT LOCATION:
158 CARDEVCO ROAD,
OTTAWA, ONTARIO

FIGURE NAME:
AREAS OF POTENTIAL
ENVIRONMENTAL CONCERN

PROJECT NUMBER: 316252	SCALE: AS SHOWN
DRAWN BY: KL	REVIEWED BY: AK
DATE: NOVEMBER 2022	FIGURE NUMBER: 4



APPENDIX B
Photographs



Photo 1 – Site Building (northwest elevation).



Photo 2 – Site Building (northeast elevation).



Photo 3 – Site Building (southeast elevation).



Photo 4 – Site Building (southwest elevation).



Photo 5 – Property located northwest of the Phase One Property.



Photo 6 – Properties located northeast of the Phase One Property.



Photo 7 – Property located southeast of the Phase One Property.



Photo 8 – Properties located southwest of the Phase One Property.

APPENDIX C
Opta Records



enviroscan



An SCM Company

175 Commerce Valley Drive W
Markham, Ontario L3T 7Z3

T: 905-882-6300
W: www.optaintel.ca

Report Completed By:
Catherine

Site Address:
158 Cardevco Rd ON Canada

Project No:
117492

Opta Order ID:
28559

Requested by:
Kurt Frommann
Pinchin Ltd.

Date Completed:
7/28/2016 12:58:08 PM



The blue-coloured flags represent inspection reports below that are hyperlinked to their location in this document.

Opta Historical Environmental Services EnviroscanTM Terms and Conditions

Report

The documents (hereinafter referred to as the "Documents") to be released as part of the report (hereinafter referred to as the "Report") to be delivered to the purchaser as set out above are documents in Opta's records relating to the described property (hereinafter referred to as the "Property"). Opta makes no representations or warranties respecting the Documents whatsoever, including, without limitation, with respect to the completeness, accuracy or usefulness of the Documents, and does not represent or warrant that these are the only plans and reports prepared in association with the Property or in Opta's possession at the time of Report delivery to the purchaser. The Documents are current as of the date(s) indicated on them. Interpretation of the Documents, if any, is by inference based upon the information which is apparent and obvious on the face of the Documents only. Opta does not represent, warrant or guarantee that interpretations other than those referred to do not exist from other sources. The Report will be prepared for use by the purchaser of the services as shown above hereof only.

Disclaimer

Opta disclaims responsibility for any losses or damages of any kind whatsoever, whether consequential or other, however caused, incurred or suffered, arising directly or indirectly as a result of the services (which services include, but are not limited to, the preparation of the Report provided hereunder), including but not limited to, any losses or damages arising directly or indirectly from any breach of contract, fundamental or otherwise, from reliance on Opta Reports or from any tortious acts or omissions of Opta's agents, employees or representatives.

Entire Agreement

The parties hereto acknowledge and agree to be bound by the terms and conditions hereof. The request form constitutes the entire agreement between the parties pertaining to the subject matter hereof and supersedes all prior and contemporaneous agreements, negotiations and discussions, whether oral or written, and there are no representations or warranties, or other agreements between the parties in connection with the subject matter hereof except as specifically set forth herein. No supplement, modification, waiver, or termination of the request shall be binding, unless confirmed in writing by the parties hereto.

Governing Document

In the event of any conflicts or inconsistencies between the provisions hereof and the Reports, the rights and obligations of the parties shall be deemed to be governed by the request form, which shall be the paramount document.

Law

This agreement shall be governed by and construed in accordance with the laws of the Province of Ontario and the laws of Canada applicable therein.

Page: 4

Project Name: 158 Cardevco
Road Ottawa ON

Project #: 117492

ENVIROSCAN Report

Report Index

Requested by:

Kurt Frommann

Date Completed: July 28, 2016 12:58:08



OPTA INFORMATION INTELLIGENCE

Page Report Title

5 (1997) Multirisk Report - 1997 S L HODGINS EQUIPMENT LTD 158 CARDEVCO RD WEST CARLETON TWP ON
K0A 1L0 Reference No: 70813557 (distance = 56 metres*)

This document is owned by
Opta Information Intelligence
Inc. and is subject to copyright
protection. Please see the
full Terms and Conditions at
the front of this document.



AIS Ref No.: 70813557

1997

This document is owned by
Opta Information Intelligence
Inc. and is subject to copyright
protection. Please see the
full Terms and Conditions at
the front of this document.

Ontario Branch
Confidential Report

MULTIRISK SURVEY

Insured: S L HODGINS EQUIPMENT LTD

Location Surveyed: 158 CARDEVCO RD
WEST CARLETON TWP, ONTARIO
K0A 1L0

Person Contacted: Joyce Dick
Telephone Number: (613) 831-9000

Policy Number: C981318CMP
AIS Reference: 70813557

Surveyed by: Donna Johnson
Date of Survey: 1997.10.17

Committed to Service Excellence



**Multirisk Report - 1997 S L HODGINS EQUIPMENT
LTD 158 CARDEVCO RD WEST CARLETON TWP ON
K0A 1L0 Reference No: 70813557****Requested by:**
Kurt Frommann

Date Completed: July 28, 2016 12:58:08



OPTA INFORMATION INTELLIGENCE

AIS Ref No.: 70813557

1997

This document is owned by
Opta Information Intelligence
Inc. and is subject to copyright
protection. Please see the
full Terms and Conditions at
the front of this document.

NOTE: The sole purpose of this report is to provide insurance pricing and underwriting information about the particular insured and location named. Only the person requesting this survey will receive a copy of the report, and IAO asks that it be kept strictly confidential. This report does not guarantee compliance with any standards or with any federal, provincial or municipal codes, ordinances or regulations. Tests of fire and other protection equipment have not been conducted or witnessed during this survey.

IAO reports, prepared in compliance with commonly accepted risk control standards existing at the time services are rendered, are developed from a survey of the premises and/or from data supplied by or on behalf of the Purchaser. IAO does not purport to list all hazards. While changes and modifications, referred to in the reports are designed to upgrade protection and loss prevention of the premises, IAO assumes no responsibility for management and control of these activities. IAO will not be responsible to the Purchaser for any loss or damages, whether consequential or other, however caused, incurred or suffered, as a result of the services being provided.



**Multirisk Report - 1997 S L HODGINS EQUIPMENT
LTD 158 CARDEVCO RD WEST CARLETON TWP ON
K0A 1L0 Reference No: 70813557**Requested by:
Kurt Frommann

Date Completed: July 28, 2016 12:58:08



OPTA INFORMATION INTELLIGENCE

AIS Ref No.: 70813557

1997

This document is owned by
Opta Information Intelligence
Inc. and is subject to copyright
protection. Please see the
full Terms and Conditions at
the front of this document.

Page: 1

S L HODGINS EQUIPMENT LTD
158 RD CARDEVCO; WEST CARLETON TWP, ONTARIO

M U L T I R I S K - F I R E , L I A B I L I T Y A N D
B A S I C C R I M E

OCCUPANCY:

The insured is an owner/occupant at this location. They have been in operation since 1970 and at this location for 6 year(s). They occupy 433 sq. m and are the major occupant, having 4 employees. The premises are in good condition. The insured is interested in loss prevention, however there have been losses during the last 3 years.

* Loss History

October 1996 - A theft occurred outside the building in which snow cleaning equipment and a snow blower were stolen. This loss is estimated at \$5,000.00.

No action has been taken to prevent further losses.

* Occupancy Description (Insured / major tenant if insured is non-occupant)

Storage and servicing of the Insureds own vehicles. The Insureds business is that of a trucking service with backhoe operations. The backhoe is rented to thers with an operator. The trucks are used both locally and for long haul.

The building has a four vehicle capacity. Equipment present includes a chop saw and oxy-acetylene welding equipment which is safely arranged. A 5HP compressor is also used. A propane fueled forklift is used within the building.

Approximately 200 litres of acrylic paint is stored on an open metal shelving unit. Used motor oil is contained in a 900 litre steel tank within the building. Nine fuel tanks are located outside the building. They are detached 16 metres from the building and contain diesel fuel. There are 3 - 900 litre tanks, 4 - 2,270 litre tanks and 2 - 4500 litre tanks. They are safely arranged.

* Other Classes of Occupants

Utility Pole Construction has an agreement with the Insured to service his vehicles within the building doing mechanical work. He is also permitted to park his vehicles on the lot.

* Undersirable Features

Portable fire extinguishers require servicing.

Inadequate door locks.

Fill and vent pipes for the waste oil tank are within the building.

No alarm system provided.



**Multirisk Report - 1997 S L HODGINS EQUIPMENT
LTD 158 CARDEVCO RD WEST CARLETON TWP ON
K0A 1L0 Reference No: 70813557**Requested by:
Kurt Frommann

Date Completed: July 28, 2016 12:58:08



OPTA INFORMATION INTELLIGENCE

AIS Ref No.: 70813557

1997

This document is owned by
Opta Information Intelligence
Inc. and is subject to copyright
protection. Please see the
full Terms and Conditions at
the front of this document.

Page: 2

S L HODGINS EQUIPMENT LTD
158 RD CARDEVCO; WEST CARLETON TWP, ONTARIO

Risk is Rateable under the Unprotected tariff.
It is recommended that this location be resurveyed in 1 year(s).

BUILDING:

- * Built - 1991 Height: Storey(s) (excluding basement) - 1=2
- * There are no additions.
- * There are no renovations.
- * Building condition - Good
- * Area: Ground Floor - 409 sq. m Total (including basement) - 433 sq. m

BASIC CONSTRUCTION:

- * Walls - 100% Wood Frame - Wood frame metal clad
- * Floors - (excluding basement) 94% Concrete; 6% Wood joist
- * Roof - 100% - Wood joist
 - Surface material(s) - Metal
 - Original roof.

INTERIOR FINISH:

- * Walls - 100% combustible - plywood sheathing
- * Ceilings - 100% non-combustible

BASEMENTS: None

VERTICAL OPENINGS:

- * Stairs - Protection open

MEZZANINE:

- * Construction - wood frame
- * Occupancy - lunch room and storage
- * Area - 24 sq. m

OUTBUILDINGS:

- * Construction - wood frame
 - Occupancy - storage shed
 - Condition - Good
 - Area - 11 sq. m



**Multirisk Report - 1997 S L HODGINS EQUIPMENT
LTD 158 CARDEVCO RD WEST CARLETON TWP ON
K0A 1L0 Reference No: 70813557**Requested by:
Kurt Frommann

Date Completed: July 28, 2016 12:58:08



OPTA INFORMATION INTELLIGENCE

AIS Ref No.: 70813557

1997

This document is owned by
Opta Information Intelligence
Inc. and is subject to copyright
protection. Please see the
full Terms and Conditions at
the front of this document.

Page: 3

S L HODGINS EQUIPMENT LTD
158 RD CARDEVCO; WEST CARLETON TWP, ONTARIO

HEATING:

- * Infrared radiant heat - 100% - Propane
 - Original installation.
 - Installation appears safe
 - * Heating appliances - All not enclosed in a separate room
 - * Combustible materials - Not stored in this room at time of survey
 - * Fuel Tanks/Supply:
 - Supply - Propane Cylinder
 - Fuel Tank Capacity - 4500
 - Location - Outside above ground
 - * Chimneys:
 - Unlabelled Prefabricated - Standard
-

ELECTRICAL:

- * Condition - Good and appeared safe at the time of the survey.
 - * Wiring - BX, Non-Metallic
 - * Overcurrent protection - Circuit Breakers.
 - * Electrical system - Original installation.
-

PLUMBING:

- * Condition - Good at the time of the survey.
 - * Piping is Copper
 - * Plumbing - Original installation.
-

EXPOSURES: (within 15m of the risk):

- * LEFT: OPEN
 - * RIGHT: OPEN
 - * FRONT: OPEN
 - * REAR: OPEN
-



AIS Ref No.: 70813557

Page: 4

S L HODGINS EQUIPMENT LTD
158 RD CARDEVCO; WEST CARLETON TWP, ONTARIO

1997

This document is owned by
Opta Information Intelligence
Inc. and is subject to copyright
protection. Please see the
full Terms and Conditions at
the front of this document.

MUNICIPAL PROTECTION:

- * The FUS Public Fire Protection Classification is 9
- * Responding (composite) fire department West Carleton Twp.
- * Distance from risk 5-8 km
- * Access via Paved roads. Year-round.

- * The building itself is easily accesible to the fire department.
- * No hydrants within 305m

PRIVATE PROTECTION at this location includes the following:

- * Non-standard extinguishers

- * An automatic sprinkler system is not present.



AIS Ref No.: 70813557

Page: 5

S L HODGINS EQUIPMENT LTD
158 RD CARDEVCO; WEST CARLETON TWP, ONTARIO

1997

This document is owned by
Opta Information Intelligence
Inc. and is subject to copyright
protection. Please see the
full Terms and Conditions at
the front of this document.

M U L T I R I S K - L I A B I L I T Y

OCCUPANCY - GENERAL INFORMATION

- * Neighbourhood is predominantly commercial
- * Insured - owner/occupant Area occupied - 433 sq. m
- * 1% accessible to public. Public access is considered light
- * Gross revenue - could not be determined at the time of the survey

PREMISES information at the time of this survey

- * The following appeared to be SATISFACTORY:

Stairs, ramps, handrails; Floor surfaces & coverings; Wall & ceilings;
Interior Lighting; Exterior Lighting; Interior Housekeeping; Exterior
Housekeeping; Washrooms; Sidewalks, Yards & Parking Lots; Snow & ice
removal; Signs & Awnings; Fire exits

- * Elevating devices in operation - none



AIS Ref No.: 70813557

Page: 6

S L HODGINS EQUIPMENT LTD
158 RD CARDEVCO; WEST CARLETON TWP, ONTARIO

1997

This document is owned by
Opta Information Intelligence
Inc. and is subject to copyright
protection. Please see the
full Terms and Conditions at
the front of this document.

M U L T I R I S K - B A S I C C R I M E

NEIGHBOURHOOD:

- * Predominantly commercial
- * Stable
- * Best described as having a moderate crime rate

BUSINESS:

- * Description - Truckman and equipment rentals
 - * Hours of Operation - irregular use of the building as required, Mon - Fri
 - * Typical Stock - Parts including small quantity of used tires for servicing
of own vehicles.
 - * Smash and Grab exposure is low
 - * There is no safe on the premises
-

GENERAL PROTECTION at the time of this survey:

- * The following appeared to be SATISFACTORY:

Exterior Lighting, Interior Lighting, Roof Accessability, Police Patrols

- * The following were found to be UNSATISFACTORY, (refre to the Remarks and
Recommendations for further details):

Outdoor stock protection

- * Security Alarm System - None
-

PHYSICAL PROTECTION (TENANT or OWNER/OCCUPANT):

- * The exterior locks at this location are spring, slide bolt
- * The windows are not barred

This report section is designed to provide basic crime information only. More
detailed crime information can be obtained by ordering an Expanded Crime
Supplement.



AIS Ref No.: 70813557

Page: 7

S L HODGINS EQUIPMENT LTD
158 RD CARDEVCO; WEST CARLETON TWP, ONTARIO

1997

This document is owned by
Opta Information Intelligence
Inc. and is subject to copyright
protection. Please see the
full Terms and Conditions at
the front of this document.

M U L T I R I S K
R E M A R K S / R E C O M M E N D A T I O N S

REMARKS:

- * Fire, Liability & Basic Crime - This is a well maintained building located just north of Highway 417 off the Carp Road. The Insured does not use the building on a regular basis as he is typically driving a truck for a customer or at a equipment rental work site. The Insured has a significant amount of equipment which is kept outside on the lot.

The contact was co-operative and is interested in loss prevention.



AIS Ref No.: 70813557

Page: 8

S L HODGINS EQUIPMENT LTD
158 RD CARDEVCO; WEST CARLETON TWP, ONTARIO

1997

This document is owned by
Opta Information Intelligence
Inc. and is subject to copyright
protection. Please see the
full Terms and Conditions at
the front of this document.

RECOMMENDATIONS:

- * 97-1 Fire, Liability & Basic Crime - All portable extinguishers should be serviced at least once a year and be tagged with the name of the servicing company and the date of service.
- * 97-2 Fire, Liability & Basic Crime - Locks on exterior doors should be upgraded to deadbolt type.
- * 97-3 Fire, Liability & Basic Crime - The fill and vent pipes of the waste oil tank should be extended to outside the building.
- * 97-4 Fire, Liability & Basic Crime - A basic alarm system should be considered for the building with alarms terminating at a recognized monitoring service or local police office.

Consideration should also be given to the installation of security gates and fencing to prevent ready access and exits from this site. This would provide protection for the equipment which is stored outside the building.



APPENDIX D
ERIS Report



DATABASE REPORT

Project Property: 158 Cardevco Road Ottawa ON
158 Cardevco Road Ottawa ON
Carp ON K0A 1L0

Project No: 316252

Report Type: Quote - Custom-Build Your Own Report

Order No: 22100605450

Requested by: Pinchin Ltd.

Date Completed: October 12, 2022

Table of Contents

Table of Contents.....	2
Executive Summary.....	3
Executive Summary: Report Summary.....	4
Executive Summary: Site Report Summary - Project Property.....	6
Executive Summary: Site Report Summary - Surrounding Properties.....	7
Executive Summary: Summary By Data Source.....	23
Map.....	43
Aerial.....	44
Topographic Map.....	45
Detail Report.....	46
Unplottable Summary.....	180
Unplottable Report.....	181
Appendix: Database Descriptions.....	186
Definitions.....	195

Notice: IMPORTANT LIMITATIONS and YOUR LIABILITY

Reliance on information in Report: This report DOES NOT replace a full Phase I Environmental Site Assessment but is solely intended to be used as a database review of environmental records.

License for use of information in Report: No page of this report can be used without this cover page, this notice and the project property identifier. The information in Report(s) may not be modified or re-sold.

Your Liability for misuse: Using this Service and/or its reports in a manner contrary to this Notice or your agreement will be in breach of copyright and contract and ERIS may obtain damages for such mis-use, including damages caused to third parties, and gives ERIS the right to terminate your account, rescind your license to any previous reports and to bar you from future use of the Service.

No warranty of Accuracy or Liability for ERIS: The information contained in this report has been produced by ERIS Information Limited Partnership ("ERIS") using various sources of information, including information provided by Federal and Provincial government departments. The report applies only to the address and up to the date specified on the cover of this report, and any alterations or deviation from this description will require a new report. This report and the data contained herein does not purport to be and does not constitute a guarantee of the accuracy of the information contained herein and does not constitute a legal opinion nor medical advice. Although ERIS has endeavored to present you with information that is accurate, ERIS disclaims, any and all liability for any errors, omissions, or inaccuracies in such information and data, whether attributable to inadvertence, negligence or otherwise, and for any consequences arising therefrom. Liability on the part of ERIS is limited to the monetary value paid for this report.

Trademark and Copyright: You may not use the ERIS trademarks or attribute any work to ERIS other than as outlined above. This Service and Report (s) are protected by copyright owned by ERIS Information Limited Partnership. Copyright in data used in the Service or Report(s) (the "Data") is owned by ERIS or its licensors. The Service, Report(s) and Data may not be copied or reproduced in whole or in any substantial part without prior written consent of ERIS.

Executive Summary

Property Information:

Project Property: 158 Cardevco Road Ottawa ON
158 Cardevco Road Ottawa ON Carp ON K0A 1L0

Project No: 316252

Coordinates:

Latitude: 45.2942644
Longitude: -75.97858
UTM Northing: 5,016,113.39
UTM Easting: 423,271.92
UTM Zone: 18T

Elevation: 383 FT
116.79 M

Order Information:

Order No: 22100605450
Date Requested: October 6, 2022
Requested by: Pinchin Ltd.
Report Type: Quote - Custom-Build Your Own Report

Historical/Products:

Aerial Photographs Aerials - National Collection
ERIS Xplorer [ERIS Xplorer](#)
Physical Setting Report (PSR) PSR
Topographic Map ANSI Map & Ontario Base Map (OBM)

Executive Summary: Report Summary

Database	Name	Searched	Project Property	Within 0.25 km	Total
AAGR	Abandoned Aggregate Inventory	Y	0	0	0
AGR	Aggregate Inventory	Y	0	0	0
AMIS	Abandoned Mine Information System	Y	0	0	0
ANDR	Anderson's Waste Disposal Sites	Y	0	0	0
AST	Aboveground Storage Tanks	Y	0	0	0
AUWR	Automobile Wrecking & Supplies	Y	0	0	0
BORE	Borehole	Y	0	0	0
CA	Certificates of Approval	Y	0	7	7
CDRY	Dry Cleaning Facilities	Y	0	0	0
CFOT	Commercial Fuel Oil Tanks	Y	0	0	0
CHEM	Chemical Manufacturers and Distributors	Y	0	0	0
CHM	Chemical Register	Y	0	0	0
CNG	Compressed Natural Gas Stations	Y	0	0	0
COAL	Inventory of Coal Gasification Plants and Coal Tar Sites	Y	0	0	0
CONV	Compliance and Convictions	Y	0	0	0
CPU	Certificates of Property Use	Y	0	0	0
DRL	Drill Hole Database	Y	0	0	0
DTNK	Delisted Fuel Tanks	Y	0	0	0
EASR	Environmental Activity and Sector Registry	Y	0	2	2
EBR	Environmental Registry	Y	0	0	0
ECA	Environmental Compliance Approval	Y	0	7	7
EEM	Environmental Effects Monitoring	Y	0	0	0
EHS	ERIS Historical Searches	Y	1	25	26
EIIS	Environmental Issues Inventory System	Y	0	0	0
EMHE	Emergency Management Historical Event	Y	0	0	0
EPAR	Environmental Penalty Annual Report	Y	0	0	0
EXP	List of Expired Fuels Safety Facilities	Y	0	0	0
FCON	Federal Convictions	Y	0	0	0
FCS	Contaminated Sites on Federal Land	Y	0	0	0
FOFT	Fisheries & Oceans Fuel Tanks	Y	0	0	0
FRST	Federal Identification Registry for Storage Tank Systems (FIRSTS)	Y	0	0	0
FST	Fuel Storage Tank	Y	0	2	2
FSTH	Fuel Storage Tank - Historic	Y	0	4	4
GEN	Ontario Regulation 347 Waste Generators Summary	Y	2	126	128
GHG	Greenhouse Gas Emissions from Large Facilities	Y	0	0	0
HINC	TSSA Historic Incidents	Y	0	0	0
IAFT	Indian & Northern Affairs Fuel Tanks	Y	0	0	0

<i>Database</i>	<i>Name</i>	<i>Searched</i>	<i>Project Property</i>	<i>Within 0.25 km</i>	<i>Total</i>
INC	Fuel Oil Spills and Leaks	Y	0	0	0
LIMO	Landfill Inventory Management Ontario	Y	0	0	0
MINE	Canadian Mine Locations	Y	0	0	0
MNR	Mineral Occurrences	Y	0	0	0
NATE	National Analysis of Trends in Emergencies System (NATES)	Y	0	0	0
NCPL	Non-Compliance Reports	Y	0	0	0
NDFT	National Defense & Canadian Forces Fuel Tanks	Y	0	0	0
NDSP	National Defense & Canadian Forces Spills	Y	0	0	0
NDWD	National Defence & Canadian Forces Waste Disposal Sites	Y	0	0	0
NEBI	National Energy Board Pipeline Incidents	Y	0	0	0
NEBP	National Energy Board Wells	Y	0	0	0
NEES	National Environmental Emergencies System (NEES)	Y	0	0	0
NPCB	National PCB Inventory	Y	0	0	0
NPRI	National Pollutant Release Inventory	Y	0	0	0
OGWE	Oil and Gas Wells	Y	0	0	0
OOGW	Ontario Oil and Gas Wells	Y	0	0	0
OPCB	Inventory of PCB Storage Sites	Y	0	0	0
ORD	Orders	Y	0	0	0
PAP	Canadian Pulp and Paper	Y	0	0	0
PCFT	Parks Canada Fuel Storage Tanks	Y	0	0	0
PES	Pesticide Register	Y	0	1	1
PINC	Pipeline Incidents	Y	0	0	0
PRT	Private and Retail Fuel Storage Tanks	Y	0	0	0
PTTW	Permit to Take Water	Y	0	0	0
REC	Ontario Regulation 347 Waste Receivers Summary	Y	0	0	0
RSC	Record of Site Condition	Y	0	0	0
RST	Retail Fuel Storage Tanks	Y	0	0	0
SCT	Scott's Manufacturing Directory	Y	0	12	12
SPL	Ontario Spills	Y	1	1	2
SRDS	Wastewater Discharger Registration Database	Y	0	0	0
TANK	Anderson's Storage Tanks	Y	0	0	0
TCFT	Transport Canada Fuel Storage Tanks	Y	0	0	0
VAR	Variances for Abandonment of Underground Storage Tanks	Y	0	0	0
WDS	Waste Disposal Sites - MOE CA Inventory	Y	0	0	0
WDSH	Waste Disposal Sites - MOE 1991 Historical Approval Inventory	Y	0	0	0
WWIS	Water Well Information System	Y	0	14	14
Total:			4	201	205

Executive Summary: Site Report Summary - Project Property

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev diff (m)</i>	<i>Page Number</i>
<u>1</u>	SPL		158 CARDEVCO RD \ WEST CARLETON TOWNSHIP ON	WNW/0.0	0.08	<u>46</u>
<u>1</u>	GEN	S L HODGINS	158 CARDEVCO CARP ON K0A 1L0	WNW/0.0	0.08	<u>46</u>
<u>1</u>	GEN	S. L. HODGINS	158 CARDEVCO CARP ON	WNW/0.0	0.08	<u>46</u>
<u>1</u>	EHS		158 Cardevco Rd Ottawa ON K0A1L0	WNW/0.0	0.08	<u>47</u>

Executive Summary: Site Report Summary - Surrounding Properties

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>2</u>	WWIS		lot 6 con 3 ON Well ID: 1532402	SSE/60.2	1.03	<u>47</u>
<u>3</u>	CA	Kris Jason Hodgins	154 Cardevco Dr Ottawa ON	SE/61.3	1.03	<u>50</u>
<u>3</u>	ECA	Kris Jason Hodgins	154 Cardevco Dr Ottawa ON K0A 1L0	SE/61.3	1.03	<u>51</u>
<u>4</u>	WWIS		lot 6 con 3 ON Well ID: 1532934	NE/90.5	-0.76	<u>51</u>
<u>5</u>	EHS		146 Cardevco Road Carp ON K0A 1L0	SE/104.8	1.08	<u>55</u>
<u>5</u>	EHS		146 Cardevco Road Carp ON K0A 1L0	SE/104.8	1.08	<u>55</u>
<u>6</u>	SCT	Prestige Fence	163 Cardevco Rd Carp ON K0A 1L0	WSW/105.2	2.14	<u>55</u>
<u>6</u>	EHS		163 Cardevco Road Carp ON K0A 1L0	WSW/105.2	2.14	<u>55</u>
<u>7</u>	CA	Andrew Ross McNeely	153 Cardevco Rd Ottawa ON	SW/120.3	2.05	<u>55</u>
<u>7</u>	ECA	Andrew Ross McNeely	153 Cardevco Rd Ottawa ON	SW/120.3	2.05	<u>56</u>
<u>7</u>	GEN	Thunderbolt Contracting	153 Cardevco Road, Unit 2 Carp ON K0A 1L0	SW/120.3	2.05	<u>56</u>
<u>7</u>	GEN	Thunderbolt Contracting	153 Cardevco Road RR#2 Carp ON K0A 1L0	SW/120.3	2.05	<u>56</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>8</u>	SCT	DAVTAIR INDUSTRIES INC.	197 CARDEVCO RD OTTAWA ON K1P	NE/120.9	-2.07	<u>57</u>
<u>8</u>	SCT	Davtair Industries Inc.	197 Cardevco Rd Carp ON K0A 1L0	NE/120.9	-2.07	<u>57</u>
<u>8</u>	GEN	DAVTAIR INDUSTRIES INC.	197 CARDEVCO ROAD CARP ON K2H 7V1	NE/120.9	-2.07	<u>58</u>
<u>8</u>	GEN	davtair industries inc	197 cardevco rd ottawa ON K2H 7V1	NE/120.9	-2.07	<u>58</u>
<u>8</u>	GEN	Davtair Industries Inc.	197 Cardevco Rd Ottawa ON K0A 1L0	NE/120.9	-2.07	<u>58</u>
<u>8</u>	GEN	Davtair Industries Inc.	197 Cardevco Rd Ottawa ON	NE/120.9	-2.07	<u>58</u>
<u>8</u>	GEN	Davtair Industries Inc.	197 Cardevco Rd Ottawa ON	NE/120.9	-2.07	<u>59</u>
<u>9</u>	GEN	DAVEY TREE EXPERT CO OF CANADA LTD	196 CARDEVCO RD. TWP OF WEST CARLETON C/O 3350 SOUTH SERVICE RD. BURLINGTON ON L7N 3M6	E/123.6	-0.97	<u>59</u>
<u>9</u>	GEN	DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD WEST CARLETON TWP. ON L7N 3M6	E/123.6	-0.97	<u>59</u>
<u>9</u>	GEN	DAVEY TREE EXPERT CO OF CANADA LTD12-353	196 CARDEVCO RD. TWP OF WEST CARLETON C/O 3350 SOUTH SERVICE RD. BURLINGTON ON L7N 3M6	E/123.6	-0.97	<u>60</u>
<u>9</u>	GEN	DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD CARP ON K0A 1L0	E/123.6	-0.97	<u>60</u>
<u>9</u>	GEN	DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD CARP ON K0A 1L0	E/123.6	-0.97	<u>60</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>9</u>	GEN	DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD CARP ON K0A 1L0	E/123.6	-0.97	<u>60</u>
<u>9</u>	GEN	DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD CARP ON K0A 1L0	E/123.6	-0.97	<u>61</u>
<u>9</u>	GEN	DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD CARP ON	E/123.6	-0.97	<u>61</u>
<u>9</u>	GEN	DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD CARP ON K0G 1L0	E/123.6	-0.97	<u>61</u>
<u>9</u>	GEN	DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD CARP ON K0G 1L0	E/123.6	-0.97	<u>62</u>
<u>9</u>	GEN	DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD CARP ON K0G 1L0	E/123.6	-0.97	<u>62</u>
<u>9</u>	GEN	DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD CARP ON K0G 1L0	E/123.6	-0.97	<u>62</u>
<u>9</u>	GEN	DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD CARP ON K0G 1L0	E/123.6	-0.97	<u>62</u>
<u>9</u>	GEN	DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD CARP ON K0G 1L0	E/123.6	-0.97	<u>63</u>
<u>9</u>	GEN	DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD CARP ON K0G 1L0	E/123.6	-0.97	<u>63</u>
<u>10</u>	EHS		149 Cardevco Rd. Ottawa ON	SSW/129.0	2.05	<u>63</u>
<u>10</u>	PES	THUNDERBOLT CONTRACTING INC.	149 CARDEVLO RD CARP ON KOA1LO	SSW/129.0	2.05	<u>63</u>
<u>10</u>	SCT	City Plastering	2-149 Cardevco Rd Carp ON K0A 1L0	SSW/129.0	2.05	<u>64</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>11</u>	FST	W.O. STINSON & SON LIMITED	142 CARDEVCO RD CARP K0A 1L0 ON CA ON	ESE/132.5	1.01	<u>64</u>
<u>11</u>	FST	W.O. STINSON & SON LIMITED	142 CARDEVCO RD CARP K0A 1L0 ON CA ON	ESE/132.5	1.01	<u>65</u>
<u>12</u>	WWIS		5630 OSGOODER MAIN STREET lot 6 con 3 OSGOODER ON Well ID: 7126803	WSW/133.6	2.78	<u>65</u>
<u>12</u>	WWIS		153 CARDEVCO ROAD lot 6 con 3 CARP ON Well ID: 7127022	WSW/133.6	2.78	<u>72</u>
<u>13</u>	EHS		145 Cardevco Road Ottawa (Carp) ON K0A 1L0	S/133.7	2.08	<u>79</u>
<u>14</u>	EHS		142 Cardevco Rd Ottawa ON	SE/135.2	1.65	<u>80</u>
<u>15</u>	CA	BOYER EQUIPMENT INC.	189 CARDEVCO RD., PT.BLK. 7 WEST CARLETON TWP. ON	N/135.6	-0.22	<u>80</u>
<u>15</u>	EHS		189 Cardevco Blvd Ottawa (Carp) ON	N/135.6	-0.22	<u>80</u>
<u>15</u>	GEN	TRUCK & TRACTOR EASTERN INC. 05-915	189 CARDEVCO ROAD WEST CARLETON ON	N/135.6	-0.22	<u>80</u>
<u>15</u>	GEN	BOYER EQUIPMENT INC. 05- 915	189 CARDEVCO STREET WEST CARLETON ON	N/135.6	-0.22	<u>81</u>
<u>15</u>	GEN	TRUCK & TRACTOR (SEE & USE ON2158207)	189 CARDEVCO ROAD WEST CARLETON ON	N/135.6	-0.22	<u>81</u>
<u>15</u>	GEN	ONTRAC EQUIPMENT SERVICES	189 CARDEVCO ROAD CARP ON K0A 1L0	N/135.6	-0.22	<u>81</u>
<u>15</u>	GEN	Nortrax Canada Inc.	189 Cardevco Road Carp ON K0A 1L0	N/135.6	-0.22	<u>82</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>15</u>	SCT	Nortrax Canada Inc.	189 Cardevco Rd RR 2 Carp ON K0A 1L0	N/135.6	-0.22	<u>82</u>
<u>15</u>	SPL	Nortrax Canada Inc.	189 Cardevco Rd RR#2, Carp Ottawa ON K0A 1L0	N/135.6	-0.22	<u>83</u>
<u>15</u>	GEN	Nortrax Canada Inc.	189 Cardevco Road Carp ON K0A 1L0	N/135.6	-0.22	<u>83</u>
<u>15</u>	GEN	Nortrax Canada Inc.	189 Cardevco Road Carp ON K0A 1L0	N/135.6	-0.22	<u>84</u>
<u>15</u>	GEN	Nortrax Canada Inc.	189 Cardevco Road Carp ON K0A 1L0	N/135.6	-0.22	<u>84</u>
<u>15</u>	GEN	Nortrax Canada Inc.	189 Cardevco Road Carp ON K0A 1L0	N/135.6	-0.22	<u>84</u>
<u>15</u>	GEN	Nortrax Canada Inc.	189 Cardevco Road Carp ON	N/135.6	-0.22	<u>85</u>
<u>15</u>	EHS		189 Cardevco Road Ottawa ON	N/135.6	-0.22	<u>85</u>
<u>15</u>	GEN	Nortrax Canada Inc.	189 Cardevco Road Carp ON K0A 1L0	N/135.6	-0.22	<u>85</u>
<u>15</u>	GEN	PCL CONSTRUCTION CANADA INC.	189 CARDEVCO ROAD CARP ON K0A 1L0	N/135.6	-0.22	<u>86</u>
<u>15</u>	GEN	PCL CONSTRUCTION CANADA INC.	189 CARDEVCO ROAD CARP ON K0A 1L0	N/135.6	-0.22	<u>86</u>
<u>15</u>	GEN	Nortrax Canada Inc.	189 Cardevco Road Carp ON K0A 1L0	N/135.6	-0.22	<u>86</u>
<u>15</u>	GEN	PCL CONSTRUCTION CANADA INC.	189 CARDEVCO ROAD CARP ON K0A 1L0	N/135.6	-0.22	<u>87</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>15</u>	GEN	PCL CONSTRUCTION CANADA INC.	189 CARDEVCO ROAD CARP ON K0A 1L0	N/135.6	-0.22	<u>87</u>
<u>15</u>	GEN	PCL CONSTRUCTION CANADA INC.	189 CARDEVCO ROAD CARP ON K0A 1L0	N/135.6	-0.22	<u>88</u>
<u>15</u>	GEN	PCL CONSTRUCTION CANADA INC.	189 CARDEVCO ROAD CARP ON K0A 1L0	N/135.6	-0.22	<u>89</u>
<u>16</u>	SCT	Harris Rebar - Div. of Harris Steel Limited	171 Cardevco Rd Ottawa ON K1G 1L0	W/135.7	1.39	<u>89</u>
<u>16</u>	SCT	Harris Rebar - Div. of Harris	171 Cardevco Rd Carp ON K0A 1L0	W/135.7	1.39	<u>89</u>
<u>16</u>	ECA	Harris Steel ULC	171 Cardevco Rd Part of Block 9, 12, 28, 31, Ref. Plan 4R10176, 4R-15838 Ottawa ON	W/135.7	1.39	<u>90</u>
<u>16</u>	GEN	harrisrebar	171 Cardevco road carp ON K0A 1L0	W/135.7	1.39	<u>90</u>
<u>16</u>	GEN	harrisrebar	171 Cardevco road carp ON K0A 1L0	W/135.7	1.39	<u>90</u>
<u>16</u>	GEN	Harris Rebar Company	171 Cardevco Road Ottawa ON	W/135.7	1.39	<u>90</u>
<u>16</u>	GEN	Harris Rebar Company	171 Cardevco Road Ottawa ON	W/135.7	1.39	<u>91</u>
<u>16</u>	GEN	Harris Rebar - Harris Steel ULC	171 Cardevco Road Ottawa ON K0A 1L0	W/135.7	1.39	<u>91</u>
<u>16</u>	GEN	Harris Rebar - Harris Steel ULC	171 Cardevco Road Ottawa ON K0A 1L0	W/135.7	1.39	<u>91</u>
<u>16</u>	GEN	Harris Rebar Company	171 Cardevco Road Ottawa ON K0A 1L0	W/135.7	1.39	<u>92</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>16</u>	GEN	Harris Rebar - Harris Steel ULC	171 Cardevco Road Ottawa ON K0A 1L0	W/135.7	1.39	<u>92</u>
<u>16</u>	GEN	CQS Electric	171 Cardevco Road Ottawa ON K0A 1L0	W/135.7	1.39	<u>92</u>
<u>16</u>	GEN	Harris Rebar - Harris Steel ULC	171 Cardevco Road Ottawa ON K0A 1L0	W/135.7	1.39	<u>92</u>
<u>16</u>	GEN	Harris Rebar - Harris Steel ULC	171 Cardevco Road Ottawa ON K0A 1L0	W/135.7	1.39	<u>93</u>
<u>16</u>	GEN	Harris Rebar - Harris Steel ULC	171 Cardevco Road Ottawa ON K0A 1L0	W/135.7	1.39	<u>93</u>
<u>17</u>	SCT	Bytown Mouldings Inc.	142 Cardevco Rd Carp ON K0A 1L0	SE/136.3	1.65	<u>94</u>
<u>17</u>	FSTH	W O STINSON & SON LTD	142 CARDEVCO CARP ON K0A 1L0	SE/136.3	1.65	<u>94</u>
<u>17</u>	FSTH	W O STINSON & SON LTD	142 CARDEVCO CARP ON K0A 1L0	SE/136.3	1.65	<u>94</u>
<u>17</u>	CA	1043084 Ontario Inc.	142 Cardevco Road Carp Carleton Ottawa ON	SE/136.3	1.65	<u>95</u>
<u>17</u>	GEN	2299663 Ontario Ltd	142 Cardevco Road Carp ON K0A 1L0	SE/136.3	1.65	<u>95</u>
<u>17</u>	GEN	2299663 Ontario Ltd	142 Cardevco Road Carp ON K0A 1L0	SE/136.3	1.65	<u>95</u>
<u>17</u>	GEN	2299663 Ontario Ltd	142 Cardevco Road Carp ON	SE/136.3	1.65	<u>95</u>
<u>17</u>	ECA	1043084 Ontario Inc.	142 Cardevco Road Carp Carleton Ottawa ON K2S 1B6	SE/136.3	1.65	<u>96</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>17</u>	GEN	2299663 Ontario Ltd	142 Cardevco Road Carp ON K0A1L0	SE/136.3	1.65	<u>96</u>
<u>17</u>	GEN	2299663 Ontario Ltd	142 Cardevco Road Carp ON K0A1L0	SE/136.3	1.65	<u>96</u>
<u>17</u>	GEN	2299663 Ontario Ltd	142 Cardevco Road Carp ON K0A1L0	SE/136.3	1.65	<u>97</u>
<u>17</u>	GEN	2299663 Ontario Ltd	142 Cardevco Road Carp ON K0A1L0	SE/136.3	1.65	<u>97</u>
<u>17</u>	GEN	2299663 Ontario Ltd	142 Cardevco Road Carp ON K0A1L0	SE/136.3	1.65	<u>98</u>
<u>17</u>	GEN	2299663 Ontario Ltd	142 Cardevco Road Carp ON K0A1L0	SE/136.3	1.65	<u>98</u>
<u>18</u>	EHS		189 Cardevco Rd Carp ON K0A 1L0	N/138.2	-0.25	<u>99</u>
<u>18</u>	EHS		189 Cardevco Rd Carp ON K0A 1L0	N/138.2	-0.25	<u>99</u>
<u>19</u>	WWIS		lot 6 con 3 ON Well ID: 1532757	S/141.0	2.06	<u>99</u>
<u>20</u>	EHS		145 Cardevco Road Carp ON K0A 1L0	S/150.7	2.54	<u>103</u>
<u>21</u>	GEN	2299663 Ontario Ltd	142 Cardevco Road Carp ON K0A1L0	SSE/164.0	2.08	<u>103</u>
<u>22</u>	EHS		197 Cardevco Road Carp ON K0A 1L0	NE/167.8	-2.61	<u>103</u>
<u>22</u>	EHS		197 Cardevco Road Carp ON K0A 1L0	NE/167.8	-2.61	<u>104</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>23</u>	EASR	CAPITAL DEDICATED LOGISTICS INC.	135 CARDEVCO RD CARP ON K0A 1L0	S/174.5	2.39	<u>104</u>
<u>24</u>	EHS		135 Cardevco Road Carp ON K0A 1L0	S/174.5	2.39	<u>104</u>
<u>24</u>	EHS		135 Cardevco Road Ottawa ON	S/174.5	2.39	<u>104</u>
<u>24</u>	GEN	Capital Dedicated Logisics	135 Cardevco Carp ON K0A 1L0	S/174.5	2.39	<u>104</u>
<u>24</u>	GEN	Capital Dedicated Logisics	135 Cardevco Carp ON K0A 1L0	S/174.5	2.39	<u>105</u>
<u>24</u>	GEN	Capital Dedicated Logisics	135 Cardevco Carp ON K0A 1L0	S/174.5	2.39	<u>105</u>
<u>24</u>	EHS		135 Cardevco Rd Ottawa ON K0A1L0	S/174.5	2.39	<u>105</u>
<u>24</u>	EHS		135 Cardevco Rd Ottawa ON K0A1L0	S/174.5	2.39	<u>105</u>
<u>24</u>	GEN	Premier Bus Lines Inc. Carp	135 Cardevco Rd Carp ON K0A 1L0	S/174.5	2.39	<u>106</u>
<u>24</u>	GEN	Premier Bus Lines Inc. Carp	135 Cardevco Rd Carp ON K0A 1L0	S/174.5	2.39	<u>106</u>
<u>24</u>	GEN	Premier Bus Lines Inc. Carp	135 Cardevco Rd Carp ON K0A 1L0	S/174.5	2.39	<u>106</u>
<u>24</u>	GEN	Premier Bus Lines Inc. Carp	135 Cardevco Rd Carp ON K0A 1L0	S/174.5	2.39	<u>106</u>
<u>25</u>	SCT	Kerr Design Ltd.	168 Wescar Lane RR 2 Carp ON K0A 1L0	WSW/180.2	2.78	<u>107</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>25</u>	SCT	Competition Composites Inc.	168 Wescar Lane Unit 3 Carp ON K0A 1L0	WSW/180.2	2.78	<u>107</u>
<u>25</u>	CA	Competition Composites Inc.	168 Wescar Lane Carp Ottawa ON	WSW/180.2	2.78	<u>107</u>
<u>25</u>	SCT	Competition Composites Inc.	3-168 Wescar Lane Carp ON K0A 1L0	WSW/180.2	2.78	<u>108</u>
<u>25</u>	ECA	Competition Composites Inc.	168 Wescar Lane Carp Ottawa ON K0A 1L0	WSW/180.2	2.78	<u>108</u>
<u>25</u>	GEN	Competition Composites	168 Wescar Lane Carp ON K0A 1L0	WSW/180.2	2.78	<u>108</u>
<u>25</u>	GEN	Competition Composites	168 Wescar Lane Carp ON K0A 1L0	WSW/180.2	2.78	<u>109</u>
<u>26</u>	WWIS		123 CARDEVCO ROAD lot 6 con 3 CARP ON Well ID: 7210658	S/180.9	2.39	<u>109</u>
<u>27</u>	EHS		217 Cardevco Rd Carp ON K0A 1L0	NE/181.2	-2.61	<u>116</u>
<u>27</u>	EHS		217 Cardevco Rd Carp ON K0A 1L0	NE/181.2	-2.61	<u>117</u>
<u>28</u>	EHS		154 Wescar Lane Ottawa ON K0A1L0	SW/182.6	3.08	<u>117</u>
<u>29</u>	WWIS		135 CARDEVCO RD CARP ON Well ID: 7186867	S/184.3	3.08	<u>117</u>
<u>30</u>	GEN	6920055 Canada Inc.	1 - 144 Wescar Lane Carp ON K0A 1L0	SW/188.9	3.08	<u>124</u>
<u>30</u>	GEN	6920055 Canada Inc.	1 - 144 Wescar Lane Carp ON K0A 1L0	SW/188.9	3.08	<u>124</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>30</u>	GEN	6920055 Canada Inc.	1 - 144 Wescar Lane Carp ON K0A 1L0	SW/188.9	3.08	<u>124</u>
<u>30</u>	GEN	6920055 Canada Inc.	1 - 144 Wescar Lane Carp ON K0A 1L0	SW/188.9	3.08	<u>124</u>
<u>30</u>	GEN	6920055 Canada Inc.	1 - 144 Wescar Lane Carp ON K0A 1L0	SW/188.9	3.08	<u>125</u>
<u>30</u>	GEN	6920055 Canada Inc.	1 - 144 Wescar Lane Carp ON	SW/188.9	3.08	<u>125</u>
<u>30</u>	GEN	6920055 Canada Inc.	1 - 144 Wescar Lane Carp ON K0A 1L0	SW/188.9	3.08	<u>125</u>
<u>30</u>	GEN	6920055 Canada Inc.	1 - 144 Wescar Lane Carp ON K0A 1L0	SW/188.9	3.08	<u>125</u>
<u>30</u>	GEN	6920055 Canada Inc.	1 - 144 Wescar Lane Carp ON K0A 1L0	SW/188.9	3.08	<u>126</u>
<u>30</u>	GEN	6920055 Canada Inc.	1 - 144 Wescar Lane Carp ON K0A 1L0	SW/188.9	3.08	<u>126</u>
<u>30</u>	GEN	6920055 Canada Inc.	1 - 144 Wescar Lane Carp ON K0A 1L0	SW/188.9	3.08	<u>126</u>
<u>31</u>	GEN	G P SERVICE STATION MAINTENANCE	132 CARDEVCO OFF CARP ROAD C/O P. O. BOX 657 STITTSVILLE ON K0A 3G0	SE/197.1	1.08	<u>127</u>
<u>31</u>	GEN	G.P. SERVICE STATION MAINTENANCE	132 CARDEVCO ROAD CARP ON K0A 1L0	SE/197.1	1.08	<u>127</u>
<u>31</u>	GEN	G P SERVICE STATION MAINTENANCE 16-270	132 CARDEVCO OFF CARP ROAD C/O P. O. BOX 657 STITTSVILLE ON K2S 1A7	SE/197.1	1.08	<u>127</u>
<u>31</u>	GEN	G. P. SERVICE STATION MAINTENANCE	QUEENSWAY CARP INDUSTRIAL PARK 132 CARDEVCO ROAD CARP ON K0A 1L0	SE/197.1	1.08	<u>128</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>31</u>	GEN	634833 ONTARIO INC.	132 CARDEVCO RD CARP ON K0A 1L0	SE/197.1	1.08	<u>128</u>
<u>31</u>	GEN	634833 ONTARIO INC.	132 CARDEVCO RD CARP ON K0A 1L0	SE/197.1	1.08	<u>128</u>
<u>31</u>	GEN	634833 ONTARIO INC.	132 CARDEVCO RD CARP ON K0A 1L0	SE/197.1	1.08	<u>128</u>
<u>31</u>	GEN	634833 ONTARIO INC.	132 CARDEVCO RD CARP ON K0A 1L0	SE/197.1	1.08	<u>129</u>
<u>31</u>	GEN	634833 ONTARIO INC.	132 CARDEVCO RD CARP ON K0A 1L0	SE/197.1	1.08	<u>129</u>
<u>31</u>	GEN	634833 ONTARIO INC.	132 CARDEVCO RD CARP ON	SE/197.1	1.08	<u>129</u>
<u>31</u>	GEN	1850795 Ontario Inc.	132 CARDEVCO RD CARP ON K0A 1L0	SE/197.1	1.08	<u>130</u>
<u>31</u>	GEN	1850795 Ontario Inc.	132 CARDEVCO RD CARP ON K0A 1L0	SE/197.1	1.08	<u>130</u>
<u>31</u>	GEN	1850795 Ontario Inc.	132 CARDEVCO RD CARP ON K0A 1L0	SE/197.1	1.08	<u>130</u>
<u>31</u>	GEN	1850795 Ontario Inc.	132 CARDEVCO RD CARP ON K0A 1L0	SE/197.1	1.08	<u>131</u>
<u>31</u>	GEN	Tarstone Canada Limited	132 Cardevco Road Carp ON K0A1L0	SE/197.1	1.08	<u>131</u>
<u>32</u>	GEN	NU-TEK SIGNS INC.	162 WESCAR LANE CARP ON K0A 1L0	WSW/197.3	3.08	<u>131</u>
<u>32</u>	EHS		162 Wescar Lane Carp ON K0A 1L0	WSW/197.3	3.08	<u>131</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
32	EHS		162 Wescar Lane Carp ON K0A 1L0	WSW/197.3	3.08	132
33	WWIS		171 CARDENCO lot 6 con 3 CARP ON <i>Well ID:</i> 7191739	WNW/198.3	3.08	132
34	WWIS		128 Cardevco Rd Carp ON <i>Well ID:</i> 7344968	ESE/199.9	1.12	139
35	GEN	ONTRAC EQUIPMENT SERVICES	139 CARDEVCO ROAD CARP ON K0A 1L0	SSE/202.2	2.08	143
36	WWIS		132 WESCAR LANE lot 6 con 3 CARP ON <i>Well ID:</i> 1536824	SSW/202.4	3.08	143
37	GEN	ALLEREX LABORATORY LTD.	180 WESCAR DRIVE CARP ON K0A 2N0	W/214.8	3.08	150
37	GEN	ServiceMaster Ottawa DR	180 Wescar Lane Ottawa ON KOA1LO	W/214.8	3.08	150
37	GEN	Service Master Ottawa Service Master Ottawa	180 Wescar Lane Ottawa ON KOA1LO	W/214.8	3.08	151
38	WWIS		100 CARDEVCO RD CARP ON <i>Well ID:</i> 7335299	SE/215.2	1.08	151
39	CA	1649174 Ontario Inc.	132 Wescar Lane Ottawa ON	SSW/216.4	3.08	154
39	ECA	1649174 Ontario Inc.	132 Wescar Lane Ottawa ON K0A 1L0	SSW/216.4	3.08	155
40	GEN	Akman Construction Inc.	123 Cardevco Rd Carp ON K0A 1L0	SSE/222.7	2.17	155
41	WWIS		100 CARDWCO RD CARP ON <i>Well ID:</i> 7335296	ESE/222.9	0.00	155

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>42</u>	GEN	CHARTERWAYS CANADIAN DIVISION	100 CARDEVCO DRIVE CARP ON K0A 1L0	SE/224.1	1.14	<u>158</u>
<u>42</u>	GEN	LAIDLAW TRANSIT LIMITED	100 CARDEVCO DRIVE CARP ON K0A 1L0	SE/224.1	1.14	<u>159</u>
<u>42</u>	FSTH	LAIDLAW EDUCATION SERVICES	100 CARDEVCO RD BOX 159 STITTSVILLE ON	SE/224.1	1.14	<u>159</u>
<u>42</u>	FSTH	LAIDLAW EDUCATION SERVICES	100 CARDEVCO RD CARP ON K0A 1L0	SE/224.1	1.14	<u>160</u>
<u>42</u>	GEN	FirstCanada ULC	100 CARDEVCO DRIVE CARP ON K0A 1L0	SE/224.1	1.14	<u>160</u>
<u>42</u>	GEN	FirstCanada ULC	100 CARDEVCO DRIVE CARP ON K0A 1L0	SE/224.1	1.14	<u>160</u>
<u>42</u>	GEN	FirstCanada ULC	100 CARDEVCO DRIVE CARP ON K0A 1L0	SE/224.1	1.14	<u>161</u>
<u>42</u>	GEN	FirstCanada ULC	100 CARDEVCO DRIVE CARP ON K0A 1L0	SE/224.1	1.14	<u>161</u>
<u>42</u>	GEN	FirstCanada ULC	100 CARDEVCO DRIVE CARP ON K0A 1L0	SE/224.1	1.14	<u>162</u>
<u>42</u>	GEN	FirstCanada ULC	100 CARDEVCO DRIVE CARP ON	SE/224.1	1.14	<u>162</u>
<u>42</u>	GEN	Voyageur Transportation Services	100 Cardeveo Road Ottawa ON K0A 1L0	SE/224.1	1.14	<u>163</u>
<u>42</u>	GEN	Voyageur Transportation Services	100 Cardeveo Road Ottawa ON K0A 1L0	SE/224.1	1.14	<u>163</u>
<u>42</u>	GEN	FirstCanada ULC	100 CARDEVCO DRIVE CARP ON K0A 1L0	SE/224.1	1.14	<u>163</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>42</u>	GEN	FirstCanada ULC	100 CARDEVCO DRIVE CARP ON K0A 1L0	SE/224.1	1.14	<u>164</u>
<u>42</u>	GEN	Voyageur Transportation Services	100 Cardeveo Road Ottawa ON K0A 1L0	SE/224.1	1.14	<u>164</u>
<u>42</u>	EHS		100 Cardevco Road Carp ON K0A 1L0	SE/224.1	1.14	<u>165</u>
<u>42</u>	GEN	947465 Ontario Ltd	100 Cardevco Road Ottawa ON K0A 1L0	SE/224.1	1.14	<u>165</u>
<u>42</u>	GEN	947465 Ontario Ltd	100 Cardevco Road Ottawa ON K0A 1L0	SE/224.1	1.14	<u>165</u>
<u>43</u>	CA	Ralco Masonry & Construction	126 Wescar Lane Ottawa ON	SSW/235.5	3.08	<u>166</u>
<u>43</u>	ECA	Ralco Masonry & Construction	126 Wescar Lane Ottawa ON	SSW/235.5	3.08	<u>166</u>
<u>44</u>	WWIS		100 CARDEYCA RD CARP ON Well ID: 7335295	ESE/238.1	0.06	<u>167</u>
<u>45</u>	WWIS		126 WESCAR LANE lot 10 con 24 OTTAWA ON Well ID: 1536876	SSE/238.7	1.05	<u>170</u>
<u>46</u>	GEN	Akman Construction Inc.	123 Cardevco Rd Carp ON	SSE/239.5	1.96	<u>176</u>
<u>46</u>	GEN	Akman Construction Inc.	123 Cardevco Rd Carp ON K0A 1L0	SSE/239.5	1.96	<u>177</u>
<u>46</u>	GEN	Akman Construction Inc.	123 Cardevco Rd Carp ON K0A 1L0	SSE/239.5	1.96	<u>177</u>
<u>46</u>	GEN	Akman Construction Inc.	123 Cardevco Rd Carp ON K0A 1L0	SSE/239.5	1.96	<u>177</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>46</u>	GEN	Akman Construction Inc.	123 Cardevco Rd Carp ON K0A 1L0	SSE/239.5	1.96	<u>177</u>
<u>46</u>	EASR	AKMAN CONSTRUCTION INC	123 CARDEVCO RD CARP ON K0A 1L0	SSE/239.5	1.96	<u>178</u>
<u>46</u>	GEN	Akman Construction Inc.	123 Cardevco Rd Carp ON K0A 1L0	SSE/239.5	1.96	<u>178</u>
<u>46</u>	GEN	Akman Construction Inc.	123 Cardevco Rd Carp ON K0A 1L0	SSE/239.5	1.96	<u>178</u>
<u>47</u>	SCT	The Carp Valley Press	2210 Cavanmore Dr Carp ON	NNE/240.4	-1.84	<u>178</u>
<u>48</u>	EHS		217 Cardevco Rd Ottawa ON	NE/245.0	-2.92	<u>179</u>
<u>48</u>	GEN	Boldt Theile (Division of The State Group Inc)	217 CARDEVCO ROAD CARP ON	NE/245.0	-2.92	<u>179</u>
<u>49</u>	EHS		172 & 180 Wescar Lane Ottawa ON	W/248.3	3.08	<u>179</u>

Executive Summary: Summary By Data Source

CA - Certificates of Approval

A search of the CA database, dated 1985-Oct 30, 2011* has found that there are 7 CA site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Kris Jason Hodgins	154 Cardevco Dr Ottawa ON	SE	61.34	<u>3</u>
Andrew Ross McNeely	153 Cardevco Rd Ottawa ON	SW	120.25	<u>7</u>
1043084 Ontario Inc.	142 Cardevco Road Carp Carleton Ottawa ON	SE	136.32	<u>17</u>
Competition Composites Inc.	168 Wescar Lane Carp Ottawa ON	WSW	180.20	<u>25</u>
1649174 Ontario Inc.	132 Wescar Lane Ottawa ON	SSW	216.36	<u>39</u>
Ralco Masonry & Construction	126 Wescar Lane Ottawa ON	SSW	235.45	<u>43</u>

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
BOYER EQUIPMENT INC.	189 CARDEVCO RD., PT.BLK. 7 WEST CARLETON TWP. ON	N	135.64	<u>15</u>

EASR - Environmental Activity and Sector Registry

A search of the EASR database, dated Oct 2011- Aug 31, 2022 has found that there are 2 EASR site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
CAPITAL DEDICATED LOGISTICS INC.	135 CARDEVCO RD CARP ON K0A 1L0	S	174.45	23
AKMAN CONSTRUCTION INC	123 CARDEVCO RD CARP ON K0A 1L0	SSE	239.46	46

ECA - Environmental Compliance Approval

A search of the ECA database, dated Oct 2011- Aug 31, 2022 has found that there are 7 ECA site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Kris Jason Hodgins	154 Cardevco Dr Ottawa ON K0A 1L0	SE	61.34	3
Andrew Ross McNeely	153 Cardevco Rd Ottawa ON	SW	120.25	7
Harris Steel ULC	171 Cardevco Rd Part of Block 9, 12, 28, 31, Ref. Plan 4R10176, 4R-15838 Ottawa ON	W	135.74	16
1043084 Ontario Inc.	142 Cardevco Road Carp Carleton Ottawa ON K2S 1B6	SE	136.32	17
Competition Composites Inc.	168 Wescar Lane Carp Ottawa ON K0A 1L0	WSW	180.20	25
1649174 Ontario Inc.	132 Wescar Lane Ottawa ON K0A 1L0	SSW	216.36	39
Ralco Masonry & Construction	126 Wescar Lane Ottawa ON	SSW	235.45	43

EHS - ERIS Historical Searches

A search of the EHS database, dated 1999-Jul 31, 2022 has found that there are 26 EHS site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	158 Cardevco Rd Ottawa ON K0A1L0	WNW	0.00	<u>1</u>
	146 Cardevco Road Carp ON K0A 1L0	SE	104.85	<u>5</u>
	146 Cardevco Road Carp ON K0A 1L0	SE	104.85	<u>5</u>
	163 Cardevco Road Carp ON K0A 1L0	WSW	105.16	<u>6</u>
	149 Cardevco Rd. Ottawa ON	SSW	128.98	<u>10</u>
	145 Cardevco Road Ottawa (Carp) ON K0A 1L0	S	133.70	<u>13</u>
	142 Cardevco Rd Ottawa ON	SE	135.25	<u>14</u>
	145 Cardevco Road Carp ON K0A 1L0	S	150.66	<u>20</u>
	135 Cardevco Road Carp ON K0A 1L0	S	174.45	<u>24</u>
	135 Cardevco Road Ottawa ON	S	174.45	<u>24</u>
	135 Cardevco Rd Ottawa ON K0A1L0	S	174.45	<u>24</u>
	135 Cardevco Rd Ottawa ON K0A1L0	S	174.45	<u>24</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	154 Wescar Lane Ottawa ON K0A1L0	SW	182.63	<u>28</u>
	162 Wescar Lane Carp ON K0A 1L0	WSW	197.31	<u>32</u>
	162 Wescar Lane Carp ON K0A 1L0	WSW	197.31	<u>32</u>
	100 Cardevco Road Carp ON K0A 1L0	SE	224.06	<u>42</u>
	172 & 180 Wescar Lane Ottawa ON	W	248.31	<u>49</u>
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	189 Cardevco Blvd Ottawa (Carp) ON	N	135.64	<u>15</u>
	189 Cardevco Road Ottawa ON	N	135.64	<u>15</u>
	189 Cardevco Rd Carp ON K0A 1L0	N	138.15	<u>18</u>
	189 Cardevco Rd Carp ON K0A 1L0	N	138.15	<u>18</u>
	197 Cardevco Road Carp ON K0A 1L0	NE	167.77	<u>22</u>
	197 Cardevco Road Carp ON K0A 1L0	NE	167.77	<u>22</u>

217 Cardevco Rd Carp ON K0A 1L0	NE	181.24	27
217 Cardevco Rd Carp ON K0A 1L0	NE	181.24	27
217 Cardevco Rd Ottawa ON	NE	245.03	48

FST - Fuel Storage Tank

A search of the FST database, dated Feb 28, 2022 has found that there are 2 FST site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
W.O. STINSON & SON LIMITED	142 CARDEVCO RD CARP K0A 1L0 ON CA ON	ESE	132.52	11
W.O. STINSON & SON LIMITED	142 CARDEVCO RD CARP K0A 1L0 ON CA ON	ESE	132.52	11

FSTH - Fuel Storage Tank - Historic

A search of the FSTH database, dated Pre-Jan 2010* has found that there are 4 FSTH site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
W O STINSON & SON LTD	142 CARDEVCO CARP ON K0A 1L0	SE	136.32	17
W O STINSON & SON LTD	142 CARDEVCO CARP ON K0A 1L0	SE	136.32	17
LAILAW EDUCATION SERVICES	100 CARDEVCO RD CARP ON K0A 1L0	SE	224.06	42
LAILAW EDUCATION SERVICES	100 CARDEVCO RD BOX 159 STITTSVILLE ON	SE	224.06	42

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
-------------------------------	----------------	------------------	---------------------	----------------

GEN - Ontario Regulation 347 Waste Generators Summary

A search of the GEN database, dated 1986-Apr 30, 2022 has found that there are 128 GEN site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
S L HODGINS	158 CARDEVCO CARP ON K0A 1L0	WNW	0.00	<u>1</u>
S. L. HODGINS	158 CARDEVCO CARP ON	WNW	0.00	<u>1</u>
Thunderbolt Contracting	153 Cardevco Road, Unit 2 Carp ON K0A 1L0	SW	120.25	<u>7</u>
Thunderbolt Contracting	153 Cardevco Road RR#2 Carp ON K0A 1L0	SW	120.25	<u>7</u>
harrisrebar	171 Cardevco road carp ON K0A 1L0	W	135.74	<u>16</u>
harrisrebar	171 Cardevco road carp ON K0A 1L0	W	135.74	<u>16</u>
CQS Electric	171 Cardevco Road Ottawa ON K0A 1L0	W	135.74	<u>16</u>
Harris Rebar - Harris Steel ULC	171 Cardevco Road Ottawa ON K0A 1L0	W	135.74	<u>16</u>
Harris Rebar - Harris Steel ULC	171 Cardevco Road Ottawa ON K0A 1L0	W	135.74	<u>16</u>
Harris Rebar - Harris Steel ULC	171 Cardevco Road Ottawa ON K0A 1L0	W	135.74	<u>16</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Harris Rebar Company	171 Cardevco Road Ottawa ON	W	135.74	<u>16</u>
Harris Rebar Company	171 Cardevco Road Ottawa ON	W	135.74	<u>16</u>
Harris Rebar - Harris Steel ULC	171 Cardevco Road Ottawa ON K0A 1L0	W	135.74	<u>16</u>
Harris Rebar - Harris Steel ULC	171 Cardevco Road Ottawa ON K0A 1L0	W	135.74	<u>16</u>
Harris Rebar Company	171 Cardevco Road Ottawa ON K0A 1L0	W	135.74	<u>16</u>
Harris Rebar - Harris Steel ULC	171 Cardevco Road Ottawa ON K0A 1L0	W	135.74	<u>16</u>
2299663 Ontario Ltd	142 Cardevco Road Carp ON K0A 1L0	SE	136.32	<u>17</u>
2299663 Ontario Ltd	142 Cardevco Road Carp ON K0A 1L0	SE	136.32	<u>17</u>
2299663 Ontario Ltd	142 Cardevco Road Carp ON	SE	136.32	<u>17</u>
2299663 Ontario Ltd	142 Cardevco Road Carp ON K0A1L0	SE	136.32	<u>17</u>
2299663 Ontario Ltd	142 Cardevco Road Carp ON K0A1L0	SE	136.32	<u>17</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
2299663 Ontario Ltd	142 Cardevco Road Carp ON K0A1L0	SE	136.32	<u>17</u>
2299663 Ontario Ltd	142 Cardevco Road Carp ON K0A1L0	SE	136.32	<u>17</u>
2299663 Ontario Ltd	142 Cardevco Road Carp ON K0A1L0	SE	136.32	<u>17</u>
2299663 Ontario Ltd	142 Cardevco Road Carp ON K0A1L0	SE	136.32	<u>17</u>
2299663 Ontario Ltd	142 Cardevco Road Carp ON K0A1L0	SSE	163.98	<u>21</u>
Capital Dedicated Logistics	135 Cardevco Carp ON K0A 1L0	S	174.45	<u>24</u>
Capital Dedicated Logistics	135 Cardevco Carp ON K0A 1L0	S	174.45	<u>24</u>
Capital Dedicated Logistics	135 Cardevco Carp ON K0A 1L0	S	174.45	<u>24</u>
Premier Bus Lines Inc. Carp	135 Cardevco Rd Carp ON K0A 1L0	S	174.45	<u>24</u>
Premier Bus Lines Inc. Carp	135 Cardevco Rd Carp ON K0A 1L0	S	174.45	<u>24</u>
Premier Bus Lines Inc. Carp	135 Cardevco Rd Carp ON K0A 1L0	S	174.45	<u>24</u>
Premier Bus Lines Inc. Carp	135 Cardevco Rd Carp ON K0A 1L0	S	174.45	<u>24</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Competition Composites	168 Wescar Lane Carp ON K0A 1L0	WSW	180.20	<u>25</u>
Competition Composites	168 Wescar Lane Carp ON K0A 1L0	WSW	180.20	<u>25</u>
6920055 Canada Inc.	1 - 144 Wescar Lane Carp ON K0A 1L0	SW	188.93	<u>30</u>
6920055 Canada Inc.	1 - 144 Wescar Lane Carp ON K0A 1L0	SW	188.93	<u>30</u>
6920055 Canada Inc.	1 - 144 Wescar Lane Carp ON K0A 1L0	SW	188.93	<u>30</u>
6920055 Canada Inc.	1 - 144 Wescar Lane Carp ON K0A 1L0	SW	188.93	<u>30</u>
6920055 Canada Inc.	1 - 144 Wescar Lane Carp ON K0A 1L0	SW	188.93	<u>30</u>
6920055 Canada Inc.	1 - 144 Wescar Lane Carp ON K0A 1L0	SW	188.93	<u>30</u>
6920055 Canada Inc.	1 - 144 Wescar Lane Carp ON	SW	188.93	<u>30</u>
6920055 Canada Inc.	1 - 144 Wescar Lane Carp ON K0A 1L0	SW	188.93	<u>30</u>
6920055 Canada Inc.	1 - 144 Wescar Lane Carp ON K0A 1L0	SW	188.93	<u>30</u>
6920055 Canada Inc.	1 - 144 Wescar Lane Carp ON K0A 1L0	SW	188.93	<u>30</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
6920055 Canada Inc.	1 - 144 Wescar Lane Carp ON K0A 1L0	SW	188.93	<u>30</u>
6920055 Canada Inc.	1 - 144 Wescar Lane Carp ON K0A 1L0	SW	188.93	<u>30</u>
634833 ONTARIO INC.	132 CARDEVCO RD CARP ON K0A 1L0	SE	197.08	<u>31</u>
634833 ONTARIO INC.	132 CARDEVCO RD CARP ON K0A 1L0	SE	197.08	<u>31</u>
634833 ONTARIO INC.	132 CARDEVCO RD CARP ON K0A 1L0	SE	197.08	<u>31</u>
634833 ONTARIO INC.	132 CARDEVCO RD CARP ON	SE	197.08	<u>31</u>
1850795 Ontario Inc.	132 CARDEVCO RD CARP ON K0A 1L0	SE	197.08	<u>31</u>
1850795 Ontario Inc.	132 CARDEVCO RD CARP ON K0A 1L0	SE	197.08	<u>31</u>
1850795 Ontario Inc.	132 CARDEVCO RD CARP ON K0A 1L0	SE	197.08	<u>31</u>
1850795 Ontario Inc.	132 CARDEVCO RD CARP ON K0A 1L0	SE	197.08	<u>31</u>
Tarstone Canada Limited	132 Cardevco Road Carp ON K0A1L0	SE	197.08	<u>31</u>
634833 ONTARIO INC.	132 CARDEVCO RD CARP ON K0A 1L0	SE	197.08	<u>31</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
634833 ONTARIO INC.	132 CARDEVCO RD CARP ON K0A 1L0	SE	197.08	<u>31</u>
G P SERVICE STATION MAINTENANCE	132 CARDEVCO OFF CARP ROAD C/O P.O. BOX 657 STITTSVILLE ON K0A 3G0	SE	197.08	<u>31</u>
G.P. SERVICE STATION MAINTENANCE	132 CARDEVCO ROAD CARP ON K0A 1L0	SE	197.08	<u>31</u>
G P SERVICE STATION MAINTENANCE 16-270	132 CARDEVCO OFF CARP ROAD C/O P.O. BOX 657 STITTSVILLE ON K2S 1A7	SE	197.08	<u>31</u>
G. P. SERVICE STATION MAINTENANCE	QUEENSWAY CARP INDUSTRIAL PARK 132 CARDEVCO ROAD CARP ON K0A 1L0	SE	197.08	<u>31</u>
NU-TEK SIGNS INC.	162 WESCAR LANE CARP ON K0A 1L0	WSW	197.31	<u>32</u>
ONTRAC EQUIPMENT SERVICES	139 CARDEVCO ROAD CARP ON K0A 1L0	SSE	202.16	<u>35</u>
ALLEREX LABORATORY LTD.	180 WESCAR DRIVE CARP ON K0A 2N0	W	214.80	<u>37</u>
ServiceMaster Ottawa DR	180 Wescar Lane Ottawa ON KOA1LO	W	214.80	<u>37</u>
Service Master Ottawa Service Master Ottawa	180 Wescar Lane Ottawa ON KOA1LO	W	214.80	<u>37</u>
Akman Construction Inc.	123 Cardevco Rd Carp ON K0A 1L0	SSE	222.73	<u>40</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Voyageur Transportation Services	100 Cardeveo Road Ottawa ON K0A 1L0	SE	224.06	<u>42</u>
FirstCanada ULC	100 CARDEVCO DRIVE CARP ON K0A 1L0	SE	224.06	<u>42</u>
FirstCanada ULC	100 CARDEVCO DRIVE CARP ON K0A 1L0	SE	224.06	<u>42</u>
Voyageur Transportation Services	100 Cardeveo Road Ottawa ON K0A 1L0	SE	224.06	<u>42</u>
947465 Ontario Ltd	100 Cardevco Road Ottawa ON K0A 1L0	SE	224.06	<u>42</u>
947465 Ontario Ltd	100 Cardevco Road Ottawa ON K0A 1L0	SE	224.06	<u>42</u>
CHARTERWAYS CANADIAN DIVISION	100 CARDEVCO DRIVE CARP ON K0A 1L0	SE	224.06	<u>42</u>
LAIDLAW TRANSIT LIMITED	100 CARDEVCO DRIVE CARP ON K0A 1L0	SE	224.06	<u>42</u>
FirstCanada ULC	100 CARDEVCO DRIVE CARP ON K0A 1L0	SE	224.06	<u>42</u>
FirstCanada ULC	100 CARDEVCO DRIVE CARP ON K0A 1L0	SE	224.06	<u>42</u>
FirstCanada ULC	100 CARDEVCO DRIVE CARP ON K0A 1L0	SE	224.06	<u>42</u>
FirstCanada ULC	100 CARDEVCO DRIVE CARP ON K0A 1L0	SE	224.06	<u>42</u>

davtair industries inc	197 cardevco rd ottawa ON K2H 7V1	NE	120.93	<u>8</u>
Davtair Industries Inc.	197 Cardevco Rd Ottawa ON K0A 1L0	NE	120.93	<u>8</u>
Davtair Industries Inc.	197 Cardevco Rd Ottawa ON	NE	120.93	<u>8</u>
Davtair Industries Inc.	197 Cardevco Rd Ottawa ON	NE	120.93	<u>8</u>
DAVEY TREE EXPERT CO OF CANADA LTD	196 CARDEVCO RD. TWP OF WEST CARLETON C/O 3350 SOUTH SERVICE RD. BURLINGTON ON L7N 3M6	E	123.62	<u>9</u>
DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD WEST CARLETON TWP. ON L7N 3M6	E	123.62	<u>9</u>
DAVEY TREE EXPERT CO OF CANADA LTD12-353	196 CARDEVCO RD. TWP OF WEST CARLETON C/O 3350 SOUTH SERVICE RD. BURLINGTON ON L7N 3M6	E	123.62	<u>9</u>
DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD CARP ON K0A 1L0	E	123.62	<u>9</u>
DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD CARP ON K0A 1L0	E	123.62	<u>9</u>
DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD CARP ON K0A 1L0	E	123.62	<u>9</u>
DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD CARP ON K0A 1L0	E	123.62	<u>9</u>
DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD CARP ON	E	123.62	<u>9</u>

DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD CARP ON K0G 1L0	E	123.62	<u>9</u>
DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD CARP ON K0G 1L0	E	123.62	<u>9</u>
DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD CARP ON K0G 1L0	E	123.62	<u>9</u>
DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD CARP ON K0G 1L0	E	123.62	<u>9</u>
DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD CARP ON K0G 1L0	E	123.62	<u>9</u>
DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD CARP ON K0G 1L0	E	123.62	<u>9</u>
DAVEY TREE EXPERT CO. OF CANADA LTD.	196 CARDEVCO ROAD CARP ON K0G 1L0	E	123.62	<u>9</u>
ONTRAC EQUIPMENT SERVICES	189 CARDEVCO ROAD CARP ON K0A 1L0	N	135.64	<u>15</u>
Nortrax Canada Inc.	189 Cardevco Road Carp ON K0A 1L0	N	135.64	<u>15</u>
Nortrax Canada Inc.	189 Cardevco Road Carp ON K0A 1L0	N	135.64	<u>15</u>
Nortrax Canada Inc.	189 Cardevco Road Carp ON K0A 1L0	N	135.64	<u>15</u>
Nortrax Canada Inc.	189 Cardevco Road Carp ON K0A 1L0	N	135.64	<u>15</u>

Nortrax Canada Inc.	189 Cardevco Road Carp ON K0A 1L0	N	135.64	<u>15</u>
Nortrax Canada Inc.	189 Cardevco Road Carp ON	N	135.64	<u>15</u>
Nortrax Canada Inc.	189 Cardevco Road Carp ON K0A 1L0	N	135.64	<u>15</u>
PCL CONSTRUCTION CANADA INC.	189 CARDEVCO ROAD CARP ON K0A 1L0	N	135.64	<u>15</u>
PCL CONSTRUCTION CANADA INC.	189 CARDEVCO ROAD CARP ON K0A 1L0	N	135.64	<u>15</u>
Nortrax Canada Inc.	189 Cardevco Road Carp ON K0A 1L0	N	135.64	<u>15</u>
PCL CONSTRUCTION CANADA INC.	189 CARDEVCO ROAD CARP ON K0A 1L0	N	135.64	<u>15</u>
PCL CONSTRUCTION CANADA INC.	189 CARDEVCO ROAD CARP ON K0A 1L0	N	135.64	<u>15</u>
PCL CONSTRUCTION CANADA INC.	189 CARDEVCO ROAD CARP ON K0A 1L0	N	135.64	<u>15</u>
PCL CONSTRUCTION CANADA INC.	189 CARDEVCO ROAD CARP ON K0A 1L0	N	135.64	<u>15</u>
TRUCK & TRACTOR EASTERN INC. 05-915	189 CARDEVCO ROAD WEST CARLETON ON	N	135.64	<u>15</u>
BOYER EQUIPMENT INC. 05-915	189 CARDEVCO STREET WEST CARLETON ON	N	135.64	<u>15</u>
TRUCK & TRACTOR (SEE & USE ON2158207)	189 CARDEVCO ROAD WEST CARLETON ON	N	135.64	<u>15</u>

Boldt Theile (Division of The State Group Inc)	217 CARDEVCO ROAD CARP ON	NE	245.03	48
--	------------------------------	----	--------	--------------------

PES - Pesticide Register

A search of the PES database, dated Oct 2011- Aug 31, 2022 has found that there are 1 PES site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
THUNDERBOLT CONTRACTING INC.	149 CARDEVLO RD CARP ON KOA1LO	SSW	128.98	10

SCT - Scott's Manufacturing Directory

A search of the SCT database, dated 1992-Mar 2011* has found that there are 12 SCT site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Prestige Fence	163 Cardevco Rd Carp ON K0A 1L0	WSW	105.16	6
City Plastering	2-149 Cardevco Rd Carp ON K0A 1L0	SSW	128.98	10
Harris Rebar - Div. of Harris Steel Limited	171 Cardevco Rd Ottawa ON K1G 1L0	W	135.74	16
Harris Rebar - Div. of Harris	171 Cardevco Rd Carp ON K0A 1L0	W	135.74	16
Bytown Mouldings Inc.	142 Cardevco Rd Carp ON K0A 1L0	SE	136.32	17
Kerr Design Ltd.	168 Wescar Lane RR 2 Carp ON K0A 1L0	WSW	180.20	25
Competition Composites Inc.	168 Wescar Lane Unit 3 Carp ON K0A 1L0	WSW	180.20	25

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Competition Composites Inc.	3-168 Wescar Lane Carp ON K0A 1L0	WSW	180.20	25

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Davtair Industries Inc.	197 Cardevco Rd Carp ON K0A 1L0	NE	120.93	8
DAVTAIR INDUSTRIES INC.	197 CARDEVCO RD OTTAWA ON K1P	NE	120.93	8
Nortrax Canada Inc.	189 Cardevco Rd RR 2 Carp ON K0A 1L0	N	135.64	15
The Carp Valley Press	2210 Cavanmore Dr Carp ON	NNE	240.45	47

SPL - Ontario Spills

A search of the SPL database, dated 1988-Sep 2020; Dec 2020-Mar 2021 has found that there are 2 SPL site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	158 CARDEVCO RD \ WEST CARLETON TOWNSHIP ON	WNW	0.00	1

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Nortrax Canada Inc.	189 Cardevco Rd RR#2, Carp Ottawa ON K0A 1L0	N	135.64	15


WWIS - Water Well Information System

A search of the WWIS database, dated Jun 30 2022 has found that there are 14 WWIS site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	lot 6 con 3 ON <i>Well ID:</i> 1532402	SSE	60.17	<u>2</u>
	153 CARDEVCO ROAD lot 6 con 3 CARP ON <i>Well ID:</i> 7127022	WSW	133.58	<u>12</u>
	5630 OSGOODER MAIN STREET lot 6 con 3 OSGOODER ON <i>Well ID:</i> 7126803	WSW	133.58	<u>12</u>
	lot 6 con 3 ON <i>Well ID:</i> 1532757	S	140.98	<u>19</u>
	123 CARDEVCO ROAD lot 6 con 3 CARP ON <i>Well ID:</i> 7210658	S	180.94	<u>26</u>
	135 CARDEVCO RD CARP ON <i>Well ID:</i> 7186867	S	184.26	<u>29</u>
	171 CARDENCO lot 6 con 3 CARP ON <i>Well ID:</i> 7191739	WNW	198.31	<u>33</u>
	128 Cardevco Rd Carp ON <i>Well ID:</i> 7344968	ESE	199.93	<u>34</u>
	132 WESCAR LANE lot 6 con 3 CARP ON <i>Well ID:</i> 1536824	SSW	202.42	<u>36</u>
	100 CARDEVCO RD CARP ON <i>Well ID:</i> 7335299	SE	215.23	<u>38</u>
	100 CARDWCO RD CARP ON <i>Well ID:</i> 7335296	ESE	222.92	<u>41</u>
	100 CARDEYCA RD CARP ON	ESE	238.12	<u>44</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	<i>Well ID:</i> 7335295			
	126 WESCAR LANE lot 10 con 24 OTTAWA ON	SSE	238.69	45
	<i>Well ID:</i> 1536876			

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	lot 6 con 3 ON	NE	90.46	4
	<i>Well ID:</i> 1532934			

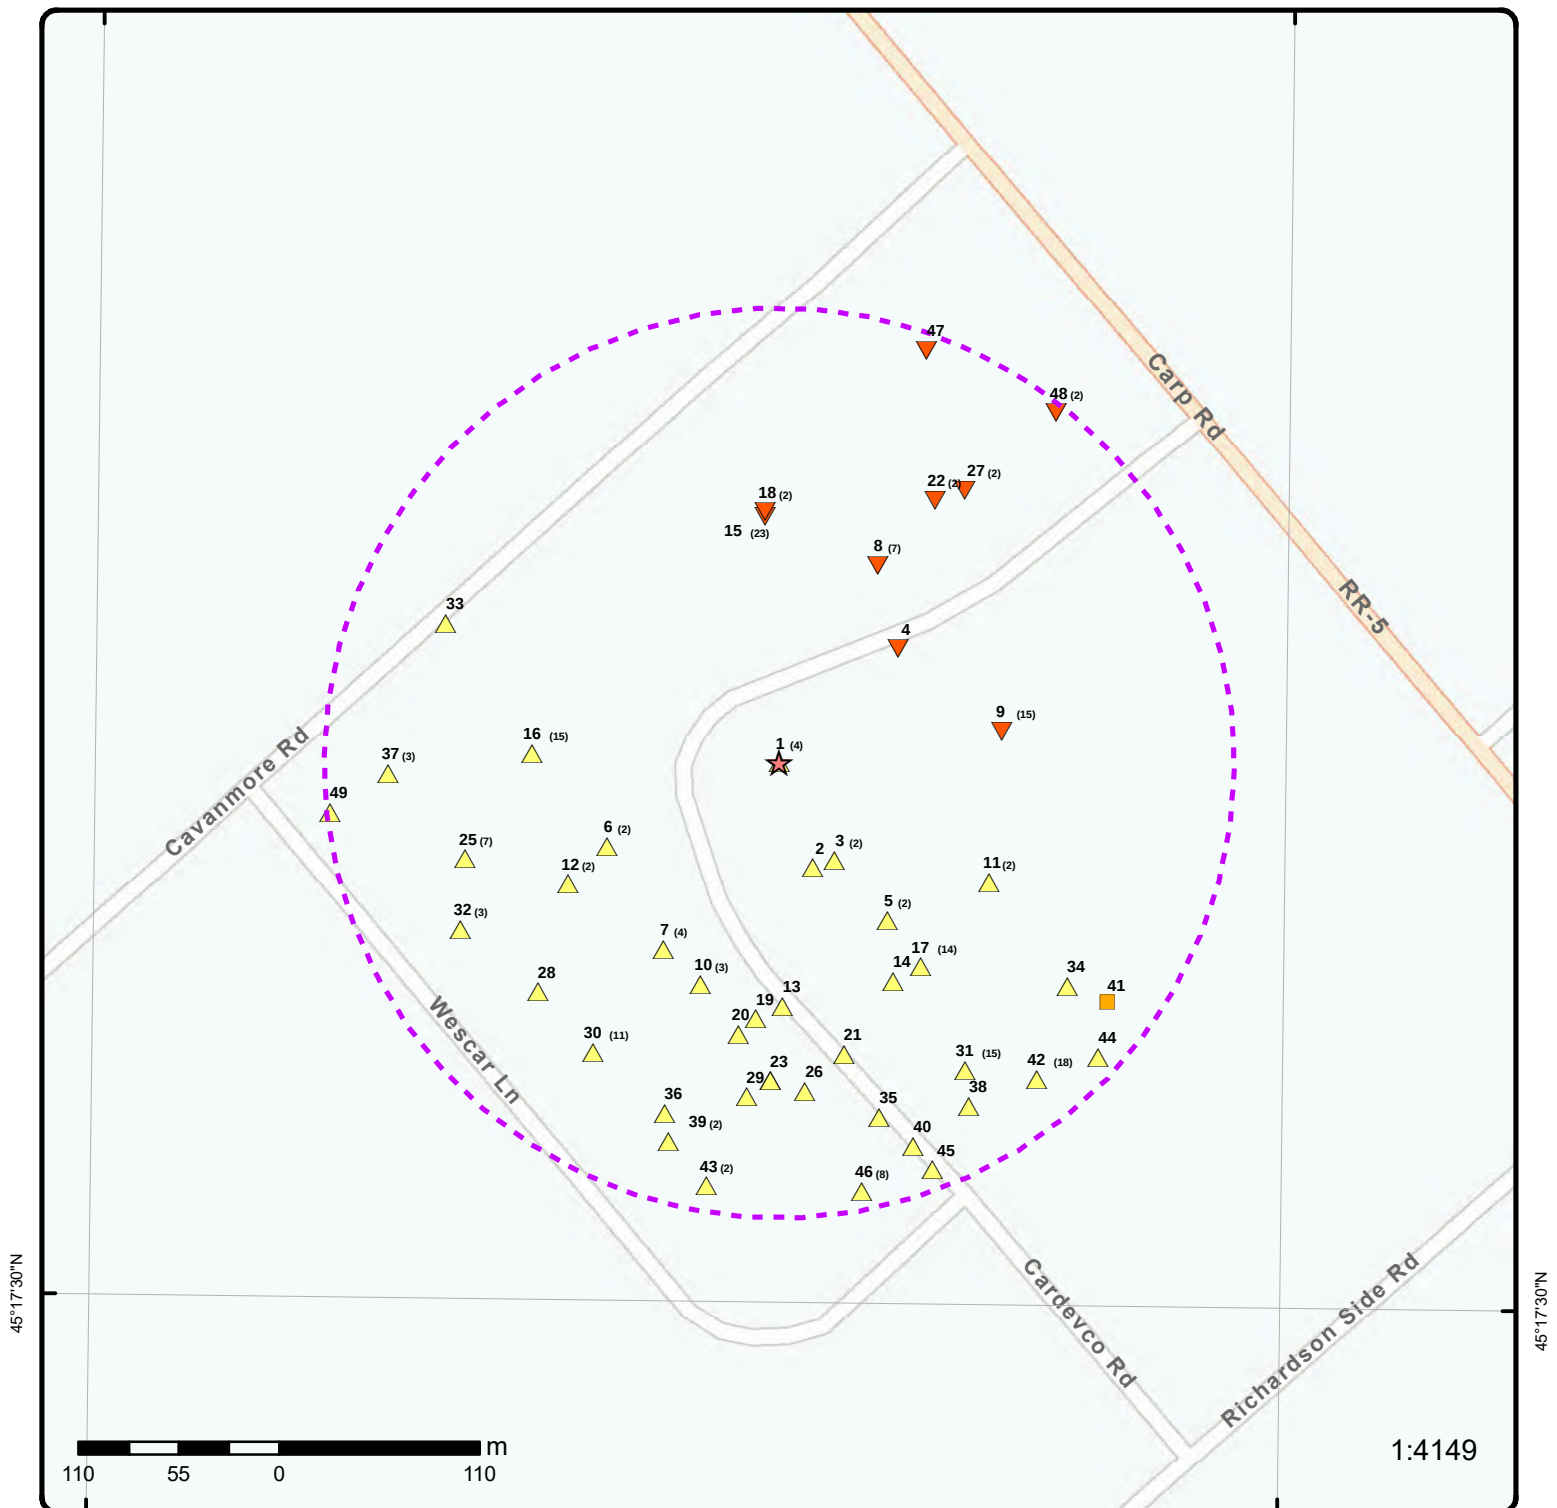

Map: 0.25 Kilometer Radius

Order Number: 22100605450

Address: 158 Cardevco Road Ottawa ON, Carp, ON



★ Project Property	Freeways; Highways	Beach	Shopping & Sports Area
⬡ Buffer Outline	Traffic Circle; Ramp	Airport	University/College
▲ Eris Sites with Higher Elevation	Major Arterial; Minor Arterial	Industrial Area	Cemetery; Golf Course
■ Eris Sites with Same Elevation	Local Road	Military Base	Park (National)
▼ Eris Sites with Lower Elevation	Service Road; Traffic Circle; Ramp	Aircraft Roads	Park (City/County)
○ Eris Sites with Unknown Elevation	Rail	Native Reservation	
		Hospital	

75°58'30"W

45°18'N

45°18'N



Aerial Year: 2021

Order Number: 22100605450

Address: 158 Cardevco Road Ottawa ON, Carp, ON



Source: ESRI World Imagery

© ERIS Information Limited Partnership

76°0'W

75°58'30"W


75°57'W

45°18'N

45°18'N

45°16'30"N

45°16'30"N

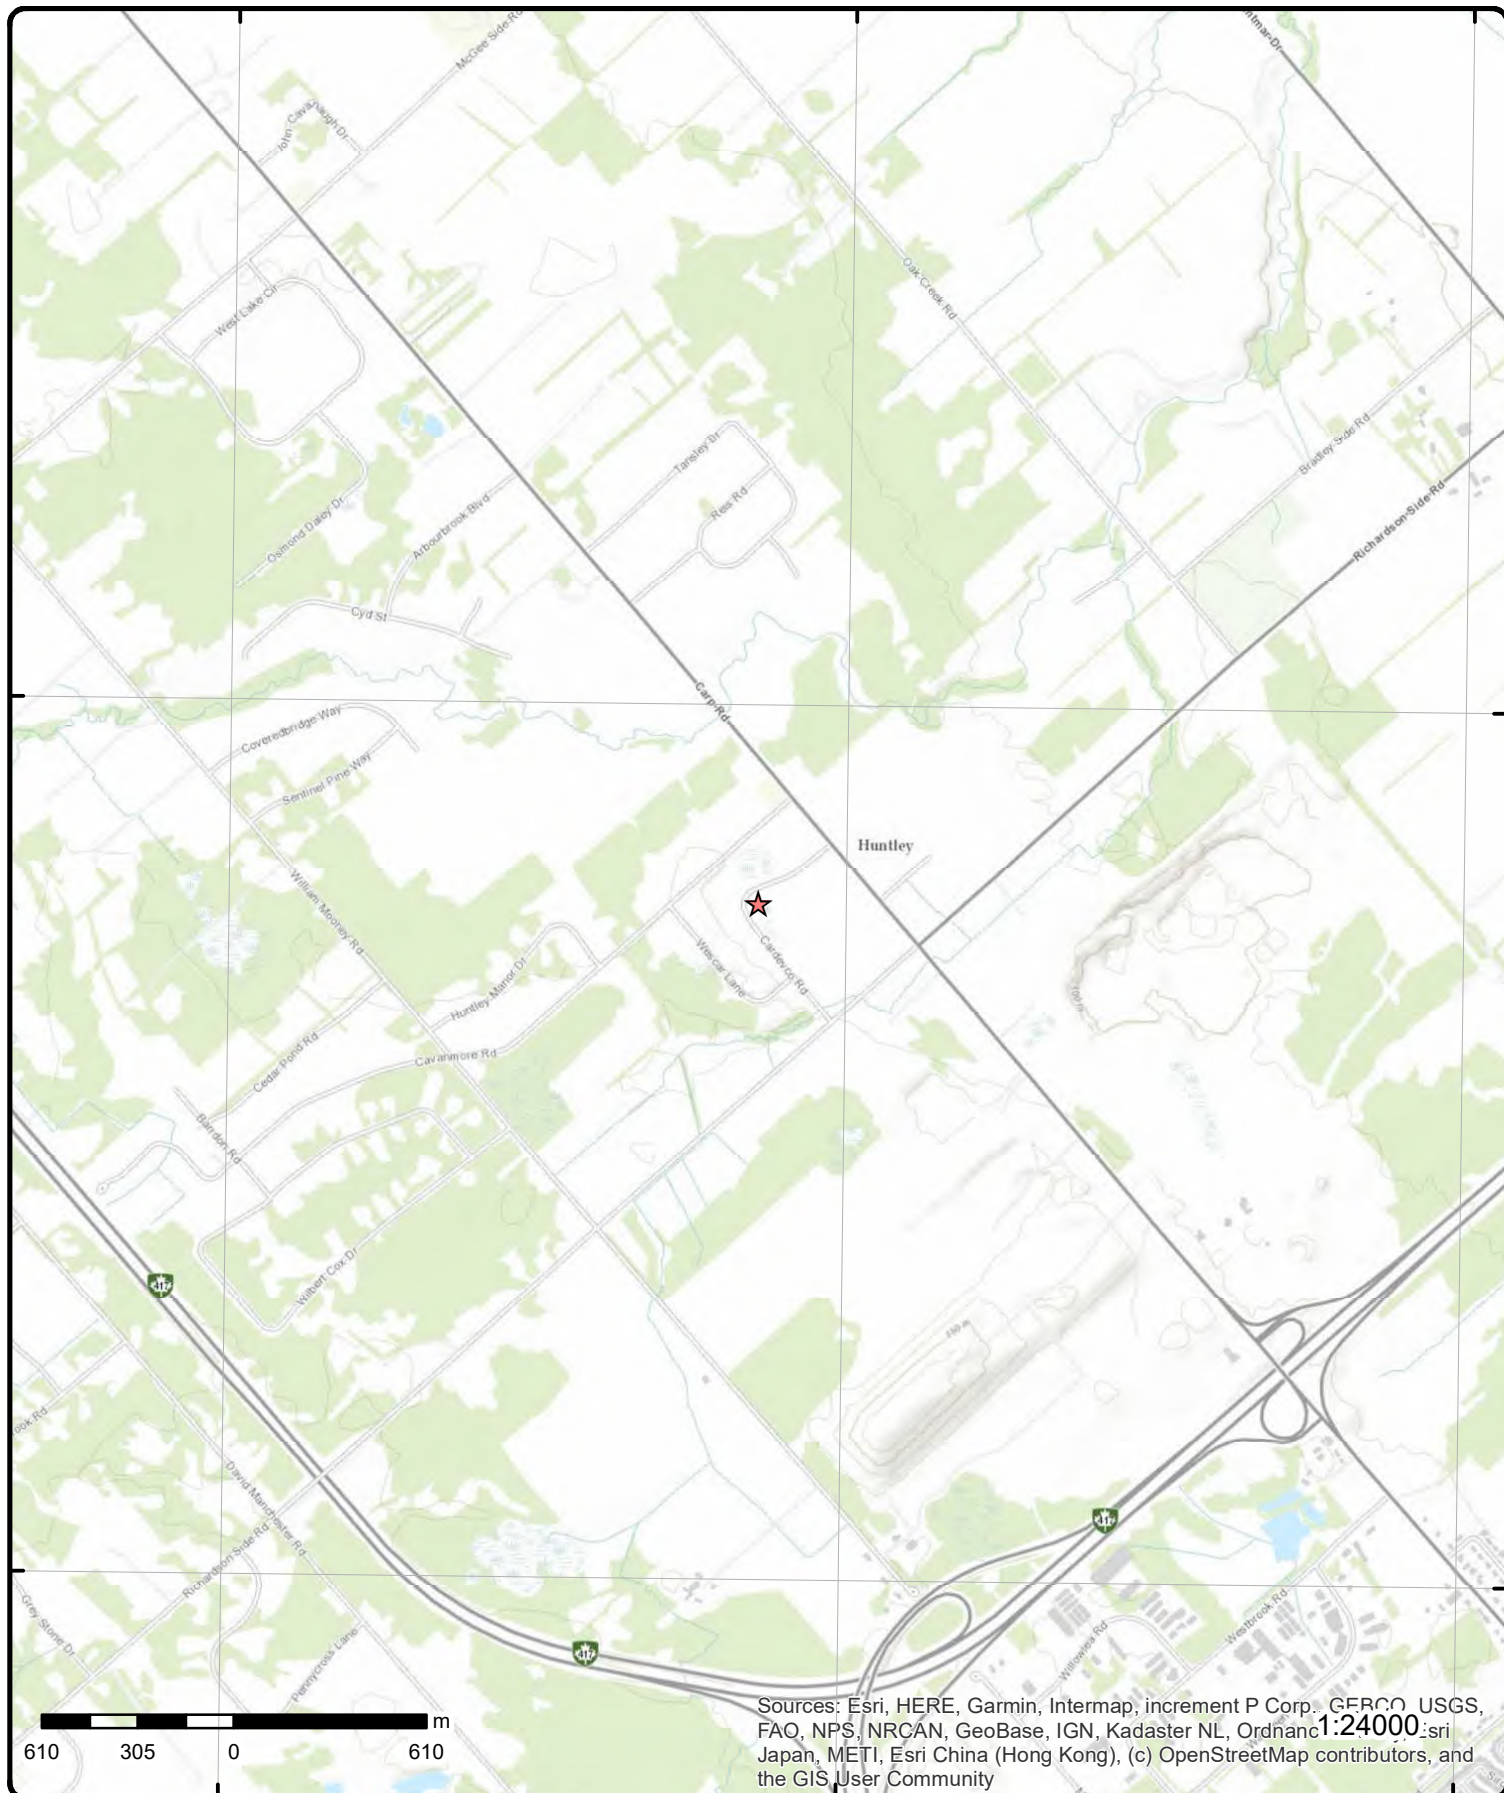

Topographic Map

Address: 158 Cardevco Road Ottawa ON, ON

Source: ESRI World Topographic Map

Order Number: 22100605450



© ERIS Information Limited Partnership

Detail Report

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
1	1 of 4	WNW/0.0	116.9 / 0.08	158 CARDEVCO RD \ WEST CARLETON TOWNSHIP ON	SPL
Ref No: 157790 Site No: Incident Dt: 7/3/1998 Year: Incident Cause: Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: LAND / WATER Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 7/9/1998 Dt Document Closed: Incident Reason: Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: Contaminant Qty: Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: 20613 Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:					
1	2 of 4	WNW/0.0	116.9 / 0.08	S L HODGINS 158 CARDEVCO CARP ON K0A 1L0	GEN
Generator No: ON2019300 SIC Code: 9919 SIC Description: OTHER MACH. RENTAL Approval Years: 95,96,97,98 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility: Detail(s) Waste Class: 252 Waste Class Desc: WASTE OILS & LUBRICANTS					
1	3 of 4	WNW/0.0	116.9 / 0.08	S. L. HODGINS 158 CARDEVCO CARP ON	GEN
Generator No: ON2019300 SIC Code: 9919 Status: Co Admin:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description: Approval Years: PO Box No: Country:		OTHER MACH. RENTAL 99,00,01		Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	
Detail(s)					
Waste Class: Waste Class Desc:		252 WASTE OILS & LUBRICANTS			
1	4 of 4	WNW/0.0	116.9 / 0.08	158 Cardevco Rd Ottawa ON K0A1L0	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:		20160725056 C Standard Report 28-JUL-16 25-JUL-16		Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:	
				ON .25 -75.978541 45.294331	
2	1 of 1	SSE/60.2	117.8 / 1.03	lot 6 con 3 ON	WWIS
Well ID: Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:		1532402 Domestic Water Supply 238005 HUNTLEY TOWNSHIP		Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: Selected Flag: Abandonment Rec: Contractor: Form Version: Owner: County: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/153\1532402.pdf			
Additional Detail(s) (Map)					
Well Completed Date: Year Completed: Depth (m): Latitude: Longitude: Path:		2001/10/23 2001 22.86 45.2938164574934 -75.9783015078213 153\1532402.pdf			
Bore Hole Information					
Bore Hole ID: DP2BR:		10516852 Elevation: Elevrc:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Spatial Status:				Zone:	18
Code OB:				East83:	423290.00
Code OB Desc:				North83:	5016056.00
Open Hole:				Org CS:	N83
Cluster Kind:				UTMRC:	3
Date Completed:		23-Oct-2001 00:00:00	UTMRC Desc:		margin of error : 10 - 30 m
Remarks:				Location Method:	
Loc Method Desc:					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		932832735			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		6.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		932832736			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		6.0			
Formation End Depth:		75.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		933219844			
Layer:		1			
Plug From:		0.0			
Plug To:		21.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		961532402			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11065422			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930094748			
Layer:		1			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:					
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930094749			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:					
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991532402			
Pump Set At:					
Static Level:		4.0			
Final Level After Pumping:		20.0			
Recommended Pump Depth:		50.0			
Pumping Rate:		25.0			
Flowing Rate:					
Recommended Pump Rate:		5.0			
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		2			
Water State After Test:		CLOUDY			
Pumping Test Method:		1			
Pumping Duration HR:		1			
Pumping Duration MIN:		0			
Flowing:		No			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		934116794			
Test Type:		Draw Down			
Test Duration:		15			
Test Level:		20.0			
Test Level UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		934660930			
Test Type:		Draw Down			
Test Duration:		45			
Test Level:		50.0			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		934400963			
Test Type:		Draw Down			
Test Duration:		30			
Test Level:		50.0			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		934918371			
Test Type:		Draw Down			
Test Duration:		60			
Test Level:		70.0			
Test Level UOM:		ft			
<u>Water Details</u>					
Water ID:		934008590			
Layer:		1			
Kind Code:		5			
Kind:		Not stated			
Water Found Depth:		62.0			
Water Found Depth UOM:		ft			
<u>Links</u>					
Bore Hole ID:	10516852			Tag No:	
Depth M:	22.86			Contractor:	1558
Year Completed:	2001			Path:	153\1532402.pdf
Well Completed Dt:	2001/10/23			Latitude:	45.2938164574934
Audit No:	238005			Longitude:	-75.9783015078213
3	1 of 2	SE/61.3	117.8 / 1.03	Kris Jason Hodgins 154 Cardevco Dr Ottawa ON	CA
Certificate #:		4377-7DRRP3			
Application Year:		2008			
Issue Date:		7/11/2008			
Approval Type:		Waste Management Systems			
Status:		Approved			
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
3	2 of 2	SE/61.3	117.8 / 1.03	Kris Jason Hodgins 154 Cardevco Dr Ottawa ON K0A 1L0	ECA
Approval No:		4377-7DRRP3		MOE District:	
Approval Date:		2008-07-11		City:	
Status:		Approved		Longitude:	
Record Type:		ECA		Latitude:	
Link Source:		IDS		Geometry X:	
SWP Area Name:				Geometry Y:	
Approval Type:		ECA-WASTE MANAGEMENT SYSTEMS			
Project Type:		WASTE MANAGEMENT SYSTEMS			
Business Name:		Kris Jason Hodgins			
Address:		154 Cardevco Dr			
Full Address:					
Full PDF Link:		https://www.accessenvironment.ene.gov.on.ca/instruments/7290-7DGHV7-14.pdf			
PDF Site Location:					
4	1 of 1	NE/90.5	116.0 / -0.76	lot 6 con 3 ON	WWIS
Well ID:		1532934		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Domestic		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Water Supply		Date Received:	
Water Type:				Selected Flag:	
Casing Material:				Abandonment Rec:	
Audit No:		237884		Contractor:	
Tag:				Form Version:	
Constructn Method:				Owner:	
Elevation (m):				County:	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		GOULBOURN TOWNSHIP			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/153\1532934.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2002/05/28			
Year Completed:		2002			
Depth (m):		15.24			
Latitude:		45.2949016293912			
Longitude:		-75.9777182026145			
Path:		153\1532934.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		10529681		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Cluster Kind:				UTMRC:	5
Date Completed:	28-May-2002 00:00:00			UTMRC Desc:	margin of error : 100 m - 300 m
Remarks:				Location Method:	gis
Loc Method Desc:		from gis			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		932879692			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		9.0			
Formation End Depth:		50.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		932879691			
Layer:		1			
Color:					
General Color:					
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		9.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		933230026			
Layer:		1			
Plug From:		2.0			
Plug To:		22.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		961532934			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		11078251			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930095866			
Layer:		3			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:					
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930095865			
Layer:		2			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:					
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930095864			
Layer:		1			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:					
Casing Diameter:		8.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991532934			
Pump Set At:					
Static Level:		2.0			
Final Level After Pumping:		40.0			
Recommended Pump Depth:		40.0			
Pumping Rate:		30.0			
Flowing Rate:					
Recommended Pump Rate:		30.0			
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		2			
Water State After Test:		CLOUDY			
Pumping Test Method:		1			
Pumping Duration HR:		1			
Pumping Duration MIN:		0			
Flowing:		No			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		934662638			
Test Type:		Recovery			
Test Duration:		45			
Test Level:		2.0			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		934402118			
Test Type:		Recovery			
Test Duration:		30			
Test Level:		2.0			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		934118504			
Test Type:		Recovery			
Test Duration:		15			
Test Level:		2.0			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		934919522			
Test Type:		Recovery			
Test Duration:		60			
Test Level:		2.0			
Test Level UOM:		ft			
<u>Water Details</u>					
Water ID:		934022234			
Layer:		2			
Kind Code:		5			
Kind:		Not stated			
Water Found Depth:		42.0			
Water Found Depth UOM:		ft			
<u>Water Details</u>					
Water ID:		934022233			
Layer:		1			
Kind Code:		5			
Kind:		Not stated			
Water Found Depth:		31.0			
Water Found Depth UOM:		ft			
<u>Links</u>					
Bore Hole ID:	10529681			Tag No:	
Depth M:	15.24			Contractor:	1119
Year Completed:	2002			Path:	153\1532934.pdf
Well Completed Dt:	2002/05/28			Latitude:	45.2949016293912
Audit No:	237884			Longitude:	-75.9777182026145

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
5	1 of 2	SE/104.8	117.9 / 1.08	146 Cardevco Road Carp ON K0A 1L0	EHS
Order No: 22031000108 Status: C Report Type: Standard Report Report Date: 15-MAR-22 Date Received: 10-MAR-22 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.97777 Y: 45.29356			
5	2 of 2	SE/104.8	117.9 / 1.08	146 Cardevco Road Carp ON K0A 1L0	EHS
Order No: 22031000108 Status: C Report Type: Standard Report Report Date: 15-MAR-22 Date Received: 10-MAR-22 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.97777 Y: 45.29356			
6	1 of 2	WSW/105.2	118.9 / 2.14	Prestige Fence 163 Cardevco Rd Carp ON K0A 1L0	SCT
Established: 01-AUG-86 Plant Size (ft²): Employment:					
--Details-- Description: Other Millwork SIC/NAICS Code: 321919 Description: Other Millwork SIC/NAICS Code: 321919 Description: All Other Miscellaneous Wood Product Manufacturing SIC/NAICS Code: 321999					
6	2 of 2	WSW/105.2	118.9 / 2.14	163 Cardevco Road Carp ON K0A 1L0	EHS
Order No: 20061107020 Status: C Report Type: Complete Report Report Date: 11/13/2006 Date Received: 11/7/2006 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps And /or Site Plans		Nearest Intersection: Richardson Side Road Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -75.979292 Y: 45.294151			
7	1 of 4	SW/120.3	118.8 / 2.05	Andrew Ross McNeely 153 Cardevco Rd Ottawa ON	CA

56 erisinfo.com | Environmental Risk Information Services Order No: 22100605450

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Years: PO Box No: Country:	2014 Canada			Phone No Admin: Contam. Facility: MHSW Facility:	No No
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	212 ALIPHATIC SOLVENTS				
Waste Class: Waste Class Desc:	252 WASTE OILS & LUBRICANTS				
Waste Class: Waste Class Desc:	213 PETROLEUM DISTILLATES				
<u>8</u>	1 of 7	NE/120.9	114.7 / -2.07	DAVTAIR INDUSTRIES INC. 197 CARDEVCO RD OTTAWA ON K1P	SCT
Established: Plant Size (ft²): Employment:	1988 0 20				
<u>--Details--</u>					
Description: SIC/NAICS Code:	PREFABRICATED METAL BUILDINGS AND COMPONENTS 3448				
Description: SIC/NAICS Code:	FABRICATED METAL PRODUCTS, NOT ELSEWHERE CLASSIFIED 3499				
Description: SIC/NAICS Code:	TRUCK AND BUS BODIES 3713				
<u>8</u>	2 of 7	NE/120.9	114.7 / -2.07	Davtair Industries Inc. 197 Cardevco Rd Carp ON K0A 1L0	SCT
Established: Plant Size (ft²): Employment:	01-JUL-88 15000				
<u>--Details--</u>					
Description: SIC/NAICS Code:	Metal Can Manufacturing 332431				
Description: SIC/NAICS Code:	All Other Miscellaneous Fabricated Metal Product Manufacturing 332999				
Description: SIC/NAICS Code:	Prefabricated Metal Building and Component Manufacturing 332311				
Description: SIC/NAICS Code:	Other Metal Container Manufacturing 332439				
Description: SIC/NAICS Code:	Motor Vehicle Body Manufacturing 336211				
Description: SIC/NAICS Code:	Motor Vehicle Body Manufacturing 336211				
Description:	Stamping				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC/NAICS Code:		332118			
8	3 of 7	NE/120.9	114.7 / -2.07	DAVTAIR INDUSTRIES INC. 197 CARDEVCO ROAD CARP ON K2H 7V1	GEN
Generator No:		ON2582700		Status:	
SIC Code:		3351		Co Admin:	
SIC Description:		TELECOMMUNICATIONS		Choice of Contact:	
Approval Years:		00,01		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		145			
Waste Class Desc:		PAINT/PIGMENT/COATING RESIDUES			
8	4 of 7	NE/120.9	114.7 / -2.07	davtair industries inc 197 cardevco rd ottawa ON K2H 7V1	GEN
Generator No:		ON4338103		Status:	
SIC Code:		332999		Co Admin:	
SIC Description:		All Other Miscellaneous Fabricated Metal Product Manufacturing		Choice of Contact:	
Approval Years:		04,06		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		145			
Waste Class Desc:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		211			
Waste Class Desc:		AROMATIC SOLVENTS			
8	5 of 7	NE/120.9	114.7 / -2.07	Davtair Industries Inc. 197 Cardevco Rd Ottawa ON K0A 1L0	GEN
Generator No:		ON3395006		Status:	
SIC Code:		332319		Co Admin:	
SIC Description:		Other Plate Work and Fabricated Structural Product Manufacturing		Choice of Contact:	
Approval Years:		07,08		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		145			
Waste Class Desc:		PAINT/PIGMENT/COATING RESIDUES			
8	6 of 7	NE/120.9	114.7 / -2.07	Davtair Industries Inc. 197 Cardevco Rd Ottawa ON	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON3395006 SIC Code: 332319 SIC Description: Other Plate Work and Fabricated Structural Product Manufacturing Approval Years: 2009 PO Box No: Country:					
Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 145 Waste Class Desc: PAINT/PIGMENT/COATING RESIDUES					
<u>8</u>	7 of 7	NE/120.9	114.7 / -2.07	Davtair Industries Inc. 197 Cardevco Rd Ottawa ON	GEN
Generator No: ON3395006 SIC Code: 332319 SIC Description: Other Plate Work and Fabricated Structural Product Manufacturing Approval Years: 2010 PO Box No: Country:					
Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 145 Waste Class Desc: PAINT/PIGMENT/COATING RESIDUES					
Waste Class: 211 Waste Class Desc: AROMATIC SOLVENTS					
<u>9</u>	1 of 15	E/123.6	115.8 / -0.97	DAVEY TREE EXPERT CO OF CANADA LTD 196 CARDEVCO RD. TWP OF WEST CARLETON C/O 3350 SOUTH SERVICE RD. BURLINGTON ON L7N 3M6	GEN
Generator No: ON1119201 SIC Code: 9959 SIC Description: OTHER SERV. TO BLDG. Approval Years: 88,89 PO Box No: Country:					
Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 252 Waste Class Desc: WASTE OILS & LUBRICANTS					
<u>9</u>	2 of 15	E/123.6	115.8 / -0.97	DAVEY TREE EXPERT CO. OF CANADA LTD. 196 CARDEVCO ROAD WEST CARLETON TWP. ON L7N 3M6	GEN
Generator No: ON1119201 SIC Code: 9959 SIC Description: OTHER SERV. TO BLDG. Approval Years: 92,93,97,98,99,00,01,02,03,04,05,06,07,08 PO Box No: Country:					
Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
<u>9</u>	3 of 15	E/123.6	115.8 / -0.97	DAVEY TREE EXPERT CO OF CANADA LTD12-353 196 CARDEVCO RD. TWP OF WEST CARLETON C/O 3350 SOUTH SERVICE RD. BURLINGTON ON L7N 3M6	GEN
Generator No:		ON1119201		Status:	
SIC Code:		9959		Co Admin:	
SIC Description:		OTHER SERV. TO BLDG.		Choice of Contact:	
Approval Years:		94,95,96		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
<u>9</u>	4 of 15	E/123.6	115.8 / -0.97	DAVEY TREE EXPERT CO. OF CANADA LTD. 196 CARDEVCO ROAD CARP ON K0A 1L0	GEN
Generator No:		ON1119201		Status:	
SIC Code:		561730		Co Admin:	
SIC Description:		Landscaping Services		Choice of Contact:	
Approval Years:		2009		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
<u>9</u>	5 of 15	E/123.6	115.8 / -0.97	DAVEY TREE EXPERT CO. OF CANADA LTD. 196 CARDEVCO ROAD CARP ON K0A 1L0	GEN
Generator No:		ON1119201		Status:	
SIC Code:		561730		Co Admin:	
SIC Description:		Landscaping Services		Choice of Contact:	
Approval Years:		2010		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
<u>9</u>	6 of 15	E/123.6	115.8 / -0.97	DAVEY TREE EXPERT CO. OF CANADA LTD. 196 CARDEVCO ROAD CARP ON K0A 1L0	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON1119201 SIC Code: 561730 SIC Description: Landscaping Services Approval Years: 2011 PO Box No: Country:					
Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 252 Waste Class Desc: WASTE OILS & LUBRICANTS					
9	7 of 15	E/123.6	115.8 / -0.97	DAVEY TREE EXPERT CO. OF CANADA LTD. 196 CARDEVCO ROAD CARP ON K0A 1L0	GEN
Generator No: ON1119201 SIC Code: 561730 SIC Description: Landscaping Services Approval Years: 2012 PO Box No: Country:					
Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 252 Waste Class Desc: WASTE OILS & LUBRICANTS					
9	8 of 15	E/123.6	115.8 / -0.97	DAVEY TREE EXPERT CO. OF CANADA LTD. 196 CARDEVCO ROAD CARP ON	GEN
Generator No: ON1119201 SIC Code: 561730 SIC Description: LANDSCAPING SERVICES Approval Years: 2013 PO Box No: Country:					
Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 252 Waste Class Desc: WASTE OILS & LUBRICANTS					
9	9 of 15	E/123.6	115.8 / -0.97	DAVEY TREE EXPERT CO. OF CANADA LTD. 196 CARDEVCO ROAD CARP ON K0G 1L0	GEN
Generator No: ON1119201 SIC Code: 561730 SIC Description: LANDSCAPING SERVICES Approval Years: 2016 PO Box No: Country: Canada					
Status: Co Admin: David W Howell Choice of Contact: CO_OFFICIAL Phone No Admin: 905-304-7359 Ext.2018 Contam. Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 252 Waste Class Desc: WASTE OILS & LUBRICANTS					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
9	10 of 15	E/123.6	115.8 / -0.97	DAVEY TREE EXPERT CO. OF CANADA LTD. 196 CARDEVCO ROAD CARP ON K0G 1L0	GEN
Generator No: ON1119201				Status:	
SIC Code: 561730				Co Admin:	David W Howell
SIC Description: LANDSCAPING SERVICES				Choice of Contact:	CO_OFFICIAL
Approval Years: 2015				Phone No Admin:	905-304-7359 Ext.2018
PO Box No:				Contam. Facility:	No
Country: Canada				MHSW Facility:	No
<u>Detail(s)</u>					
Waste Class: 252					
Waste Class Desc: WASTE OILS & LUBRICANTS					
9	11 of 15	E/123.6	115.8 / -0.97	DAVEY TREE EXPERT CO. OF CANADA LTD. 196 CARDEVCO ROAD CARP ON K0G 1L0	GEN
Generator No: ON1119201				Status:	
SIC Code: 561730				Co Admin:	David W Howell
SIC Description: LANDSCAPING SERVICES				Choice of Contact:	CO_OFFICIAL
Approval Years: 2014				Phone No Admin:	905-304-7359 Ext.2018
PO Box No:				Contam. Facility:	No
Country: Canada				MHSW Facility:	No
<u>Detail(s)</u>					
Waste Class: 252					
Waste Class Desc: WASTE OILS & LUBRICANTS					
9	12 of 15	E/123.6	115.8 / -0.97	DAVEY TREE EXPERT CO. OF CANADA LTD. 196 CARDEVCO ROAD CARP ON K0G 1L0	GEN
Generator No: ON1119201				Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years: As of Dec 2018				Phone No Admin:	
PO Box No:				Contam. Facility:	
Country: Canada				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class: 252 L					
Waste Class Desc: Waste crankcase oils and lubricants					
9	13 of 15	E/123.6	115.8 / -0.97	DAVEY TREE EXPERT CO. OF CANADA LTD. 196 CARDEVCO ROAD CARP ON K0G 1L0	GEN
Generator No: ON1119201				Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years: As of Jul 2020				Phone No Admin:	
PO Box No:				Contam. Facility:	
Country: Canada				MHSW Facility:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		252 L			
Waste Class Desc:		Waste crankcase oils and lubricants			
9	14 of 15	E/123.6	115.8 / -0.97	DAVEY TREE EXPERT CO. OF CANADA LTD. 196 CARDEVCO ROAD CARP ON K0G 1L0	GEN
Generator No:		ON1119201		Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:		As of Nov 2021		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:		Canada		MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		252 L			
Waste Class Desc:		Waste crankcase oils and lubricants			
9	15 of 15	E/123.6	115.8 / -0.97	DAVEY TREE EXPERT CO. OF CANADA LTD. 196 CARDEVCO ROAD CARP ON K0G 1L0	GEN
Generator No:		ON1119201		Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:		As of Apr 2022		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:		Canada		MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		252 L			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
10	1 of 3	SSW/129.0	118.8 / 2.05	149 Cardevco Rd. Ottawa ON	EHS
Order No:		20040310001		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Complete Report		Client Prov/State:	ON
Report Date:		3/18/04		Search Radius (km):	0.25
Date Received:		3/10/04		X:	-75.978993
Previous Site Name:				Y:	45.293726
Lot/Building Size:					
Additional Info Ordered:					
10	2 of 3	SSW/129.0	118.8 / 2.05	THUNDERBOLT CONTRACTING INC. 149 CARDEVLO RD CARP ON KOA1LO	PES
Detail Licence No:				Operator Box:	
Licence No:				Operator Class:	
Status:				Operator No:	
Approval Date:				Operator Type:	Operator
Report Source:				Oper Area Code:	
Licence Type:				Oper Phone No:	
Licence Type Code:				Operator Ext:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Licence Class: Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL: PDF Site Location: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:					
10	3 of 3	SSW/129.0	118.8 / 2.05	City Plastering 2-149 Cardevco Rd Carp ON K0A 1L0	SCT
Established: Plant Size (ft²): Employment: 01-APR-82					
--Details-- Description: SIC/NAICS Code: Gypsum Product Manufacturing 327420 Description: SIC/NAICS Code: All Other Non-Metallic Mineral Product Manufacturing 327990 Description: SIC/NAICS Code: Gypsum Product Manufacturing 327420 Description: SIC/NAICS Code: Other Millwork 321919					
11	1 of 2	ESE/132.5	117.8 / 1.01	W.O. STINSON & SON LIMITED 142 CARDEVCO RD CARP K0A 1L0 ON CA ON	FST
Instance No: Status: Cont Name: Instance Type: Item: Item Description: Tank Type: Install Date: Install Year: Years in Service: Model: Description: Capacity: Tank Material: Corrosion Protect: Overfill Protect: Facility Type: Parent Facility Type: Facility Location: Device Installed Location: 11678362 FS Liquid Fuel Tank FS Liquid Fuel Tank Double Wall Horizontal AST 7/10/2002 2002 NULL 2270 Steel Coating FS Liquid Fuel Tank Fuels Safety Private Fuel Outlet - Self Serve 142 CARDEVCO RD CARP K0A 1L0 ON CA Manufacturer: Serial No: Ulc Standard: Quantity: Unit of Measure: Fuel Type: Fuel Type2: Fuel Type3: Piping Steel: Piping Galvanized: Tanks Single Wall St: Piping Underground: No Underground: Panam Related: Panam Venue: Gasoline NULL NULL 					
<u>Liquid Fuel Tank Details</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Overfill Protection: Owner Account Name: W.O. STINSON & SON LIMITED Item: FS LIQUID FUEL TANK					
11	2 of 2	ESE/132.5	117.8 / 1.01	W.O. STINSON & SON LIMITED 142 CARDEVCO RD CARP K0A 1L0 ON CA ON	FST
Instance No: 11678342 Status: Cont Name: Instance Type: FS Liquid Fuel Tank Item: Item Description: FS Liquid Fuel Tank Tank Type: Double Wall Horizontal AST Install Date: 7/10/2002 Install Year: 2002 Years in Service: Model: NULL Description: Capacity: 2270 Tank Material: Steel Corrosion Protect: Coating Overfill Protect: Facility Type: FS Liquid Fuel Tank Parent Facility Type: Fuels Safety Private Fuel Outlet - Self Serve Facility Location: Device Installed Location: 142 CARDEVCO RD CARP K0A 1L0 ON CA					
Manufacturer: Serial No: Ulc Standard: Quantity: Unit of Measure: Fuel Type: Gasoline Fuel Type2: NULL Fuel Type3: NULL Piping Steel: Piping Galvanized: Tanks Single Wall St: Piping Underground: No Underground: Panam Related: Panam Venue:					
<u>Liquid Fuel Tank Details</u>					
Overfill Protection: Owner Account Name: W.O. STINSON & SON LIMITED Item: FS LIQUID FUEL TANK					
12	1 of 2	WSW/133.6	119.6 / 2.78	5630 OSGOODE MAIN STREET lot 6 con 3 OSGOODE ON	WWIS
Well ID: 7126803 Construction Date: Use 1st: Domestic Use 2nd: Final Well Status: Water Supply Water Type: Casing Material: Audit No: Z94712 Tag: A082584 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: HUNTLEY TOWNSHIP Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 06-Aug-2009 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 1119 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: 006 Concession: 03 Concession Name: CON Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/712\7126803.pdf					
<u>Additional Detail(s) (Map)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Completed Date:		2009/07/06			
Year Completed:		2009			
Depth (m):		89.916			
Latitude:		45.293720806574			
Longitude:		-75.9800087966641			
Path:		712\7126803.pdf			
 <u>Bore Hole Information</u>					
Bore Hole ID:	1002603458			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	423156.00
Code OB Desc:				North83:	5016047.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	06-Jul-2009 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1002799109				
Layer:	3				
Color:	2				
General Color:	GREY				
Mat1:	18				
Most Common Material:	SANDSTONE				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	228.0				
Formation End Depth:	295.0				
Formation End Depth UOM:	ft				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1002799108				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	32.0				
Formation End Depth:	228.0				
Formation End Depth UOM:	ft				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1002799107			
Layer:		1			
Color:					
General Color:					
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		13			
Mat3 Desc:		BOULDERS			
Formation Top Depth:		0.0			
Formation End Depth:		32.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002799111			
Layer:		1			
Plug From:		42.0			
Plug To:		32.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002799112			
Layer:		2			
Plug From:		32.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1002799146			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1002799105			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1002799116			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		-2.0			
Depth To:		42.0			
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Casing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing ID:		1002799117			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		42.0			
Depth To:		295.0			
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1002799118			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1002799106			
Pump Set At:		280.0			
Static Level:		18.579999923706055			
Final Level After Pumping:		169.5			
Recommended Pump Depth:		200.0			
Pumping Rate:		20.0			
Flowing Rate:					
Recommended Pump Rate:		20.0			
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		0			
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:		1			
Pumping Duration MIN:					
Flowing:		No			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799137			
Test Type:		Draw Down			
Test Duration:		30			
Test Level:		151.4199981689453			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799140			
Test Type:		Recovery			
Test Duration:		40			
Test Level:		21.170000076293945			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799127			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Test Type:		Draw Down			
Test Duration:		5			
Test Level:		62.41999816894531			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799133			
Test Type:		Draw Down			
Test Duration:		20			
Test Level:		132.1699981689453			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799125			
Test Type:		Draw Down			
Test Duration:		4			
Test Level:		55.0			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799136			
Test Type:		Recovery			
Test Duration:		25			
Test Level:		30.329999923706055			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799142			
Test Type:		Recovery			
Test Duration:		50			
Test Level:		18.579999923706055			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799119			
Test Type:		Draw Down			
Test Duration:		1			
Test Level:		31.579999923706055			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799120			
Test Type:		Recovery			
Test Duration:		1			
Test Level:		154.0			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799122			
Test Type:		Recovery			
Test Duration:		2			
Test Level:		145.75			
Test Level UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799123			
Test Type:		Draw Down			
Test Duration:		3			
Test Level:		47.5			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799130			
Test Type:		Recovery			
Test Duration:		10			
Test Level:		84.08000183105469			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799131			
Test Type:		Draw Down			
Test Duration:		15			
Test Level:		121.5			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799138			
Test Type:		Recovery			
Test Duration:		30			
Test Level:		24.75			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799124			
Test Type:		Recovery			
Test Duration:		3			
Test Level:		138.1699981689453			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799132			
Test Type:		Recovery			
Test Duration:		15			
Test Level:		64.16999816894531			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799135			
Test Type:		Draw Down			
Test Duration:		25			
Test Level:		142.1699981689453			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pump Test Detail ID:		1002799143			
Test Type:		Draw Down			
Test Duration:		60			
Test Level:		169.5			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799144			
Test Type:		Recovery			
Test Duration:		60			
Test Level:		18.579999923706055			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799126			
Test Type:		Recovery			
Test Duration:		4			
Test Level:		131.5			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799128			
Test Type:		Recovery			
Test Duration:		5			
Test Level:		125.16999816894531			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799134			
Test Type:		Recovery			
Test Duration:		20			
Test Level:		42.33000183105469			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799139			
Test Type:		Draw Down			
Test Duration:		40			
Test Level:		160.0800018310547			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799141			
Test Type:		Draw Down			
Test Duration:		50			
Test Level:		166.3300018310547			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799121			
Test Type:		Draw Down			
Test Duration:		2			
Test Level:		40.5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002799129			
Test Type:		Draw Down			
Test Duration:		10			
Test Level:		94.66999816894531			
Test Level UOM:		ft			
<u>Water Details</u>					
Water ID:		1002799115			
Layer:		3			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		263.0			
Water Found Depth UOM:		ft			
<u>Water Details</u>					
Water ID:		1002799114			
Layer:		2			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		231.0			
Water Found Depth UOM:		ft			
<u>Water Details</u>					
Water ID:		1002799113			
Layer:		1			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		155.0			
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1002799110			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		295.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:	1002603458			Tag No:	A082584
Depth M:	89.916			Contractor:	1119
Year Completed:	2009			Path:	712\7126803.pdf
Well Completed Dt:	2009/07/06			Latitude:	45.293720806574
Audit No:	Z94712			Longitude:	-75.9800087966641
12	2 of 2	WSW/133.6	119.6 / 2.78	153 CARDEVCO ROAD lot 6 con 3 CARP ON	WWIS
Well ID:	7127022			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Domestic			Data Entry Status:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Use 2nd:				Data Src:	
Final Well Status:	Water Supply			Date Received:	06-Aug-2009 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z94721			Contractor:	1119
Tag:	A082584			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	006
Depth to Bedrock:				Concession:	03
Well Depth:				Concession Name:	CON
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	HUNTLEY TOWNSHIP				
Site Info:	BLOCK 9 & 12				
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/712\7127022.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2009/07/06				
Year Completed:	2009				
Depth (m):	18.288				
Latitude:	45.293720806574				
Longitude:	-75.9800087966641				
Path:	712\7127022.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1002626750			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	423156.00
Code OB Desc:				North83:	5016047.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	06-Jul-2009 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	www
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1002876432				
Layer:	1				
Color:					
General Color:					
Mat1:	28				
Most Common Material:	SAND				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	15.0				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1002876433			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		15.0			
Formation End Depth:		60.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002876435			
Layer:		1			
Plug From:		19.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1002876469			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1002876430			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002876439			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		-2.0			
Depth To:		19.0			
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		1002876440			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From:		19.0			
Depth To:		60.0			
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1002876441			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1002876431			
Pump Set At:		50.0			
Static Level:		5.5			
Final Level After Pumping:		8.079999923706055			
Recommended Pump Depth:		50.0			
Pumping Rate:		20.0			
Flowing Rate:					
Recommended Pump Rate:		20.0			
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		0			
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:		1			
Pumping Duration MIN:					
Flowing:		No			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876452			
Test Type:		Draw Down			
Test Duration:		10			
Test Level:		7.25			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876462			
Test Type:		Draw Down			
Test Duration:		40			
Test Level:		7.75			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876465			
Test Type:		Recovery			
Test Duration:		50			
Test Level:		5.5			
Test Level UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876467			
Test Type:		Recovery			
Test Duration:		60			
Test Level:		5.5			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876458			
Test Type:		Draw Down			
Test Duration:		25			
Test Level:		7.579999923706055			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876461			
Test Type:		Recovery			
Test Duration:		30			
Test Level:		5.5			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876464			
Test Type:		Draw Down			
Test Duration:		50			
Test Level:		8.0			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876448			
Test Type:		Draw Down			
Test Duration:		4			
Test Level:		6.75			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876443			
Test Type:		Recovery			
Test Duration:		1			
Test Level:		6.5			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876445			
Test Type:		Recovery			
Test Duration:		2			
Test Level:		6.420000076293945			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876456			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Test Type:		Draw Down			
Test Duration:		20			
Test Level:		7.5			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876444			
Test Type:		Draw Down			
Test Duration:		2			
Test Level:		6.5			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876451			
Test Type:		Recovery			
Test Duration:		5			
Test Level:		6.170000076293945			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876466			
Test Type:		Draw Down			
Test Duration:		60			
Test Level:		8.079999923706055			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876442			
Test Type:		Draw Down			
Test Duration:		1			
Test Level:		6.329999923706055			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876446			
Test Type:		Draw Down			
Test Duration:		3			
Test Level:		6.670000076293945			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876449			
Test Type:		Recovery			
Test Duration:		4			
Test Level:		6.25			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876454			
Test Type:		Draw Down			
Test Duration:		15			
Test Level:		7.420000076293945			
Test Level UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876459			
Test Type:		Recovery			
Test Duration:		25			
Test Level:		5.5			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876463			
Test Type:		Recovery			
Test Duration:		40			
Test Level:		5.5			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876447			
Test Type:		Recovery			
Test Duration:		3			
Test Level:		6.329999923706055			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876450			
Test Type:		Draw Down			
Test Duration:		5			
Test Level:		7.0			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876453			
Test Type:		Recovery			
Test Duration:		10			
Test Level:		5.670000076293945			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876455			
Test Type:		Recovery			
Test Duration:		15			
Test Level:		5.5			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1002876457			
Test Type:		Recovery			
Test Duration:		20			
Test Level:		5.5			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pump Test Detail ID: 1002876460					
Test Type: Draw Down					
Test Duration: 30					
Test Level: 7.579999923706055					
Test Level UOM: ft					
<u>Water Details</u>					
Water ID: 1002876438					
Layer: 3					
Kind Code: 8					
Kind: Untested					
Water Found Depth: 51.0					
Water Found Depth UOM: ft					
<u>Water Details</u>					
Water ID: 1002876436					
Layer: 1					
Kind Code: 8					
Kind: Untested					
Water Found Depth: 30.0					
Water Found Depth UOM: ft					
<u>Water Details</u>					
Water ID: 1002876437					
Layer: 2					
Kind Code: 8					
Kind: Untested					
Water Found Depth: 48.0					
Water Found Depth UOM: ft					
<u>Hole Diameter</u>					
Hole ID: 1002876434					
Diameter: 6.0					
Depth From: 0.0					
Depth To: 60.0					
Hole Depth UOM: ft					
Hole Diameter UOM: inch					
<u>Links</u>					
Bore Hole ID: 1002626750		Tag No: A082584			
Depth M: 18.288		Contractor: 1119			
Year Completed: 2009		Path: 712\7127022.pdf			
Well Completed Dt: 2009/07/06		Latitude: 45.293720806574			
Audit No: Z94721		Longitude: -75.9800087966641			

13	1 of 1	S/133.7	118.9 / 2.08	145 Cardevco Road Ottawa (Carp) ON K0A 1L0	EHS
Order No: 20061103004					
Status: C					
Report Type: Complete Report					
Report Date: 11/6/2006					
Date Received: 11/3/2006					
Previous Site Name:					
Lot/Building Size: 1800 square m lot					
Additional Info Ordered:					
				Nearest Intersection: Wescar Lane	
				Municipality:	
				Client Prov/State: ON	
				Search Radius (km): 0.25	
				X: -75.978674	
				Y: 45.293226	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
14	1 of 1	SE/135.2	118.4 / 1.65	142 Cardevco Rd Ottawa ON	EHS
Order No:	20110617020			Nearest Intersection:	Carp Rd
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	6/28/2011			Search Radius (km):	0.25
Date Received:	6/17/2011 2:53:25 PM			X:	-75.977749
Previous Site Name:				Y:	45.293335
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans; City Directory				
15	1 of 23	N/135.6	116.6 / -0.22	BOYER EQUIPMENT INC. 189 CARDEVCO RD., PT.BLK. 7 WEST CARLETON TWP. ON	CA
Certificate #:	8-4204-94-				
Application Year:	94				
Issue Date:	1/5/1995				
Approval Type:	Industrial air				
Status:	Approved in 1995				
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:	WASTE OIL FURNACE MODEL CB-4000				
Contaminants:	Nitrogen Oxides, Sulphur Dioxide, Suspended Particulate Matter				
Emission Control:	No Controls				
15	2 of 23	N/135.6	116.6 / -0.22	189 Cardevco Blvd Ottawa (Carp) ON	EHS
Order No:	20001130007			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Basic Report			Client Prov/State:	ON
Report Date:	12/7/00			Search Radius (km):	0.25
Date Received:	11/30/00			X:	-75.97924
Previous Site Name:				Y:	45.294346
Lot/Building Size:					
Additional Info Ordered:					
15	3 of 23	N/135.6	116.6 / -0.22	TRUCK & TRACTOR EASTERN INC. 05-915 189 CARDEVCO ROAD WEST CARLETON ON	GEN
Generator No:	ON1599301			Status:	
SIC Code:	3192			Co Admin:	
SIC Description:	CONSTR TUCTION EQUIP.			Choice of Contact:	
Approval Years:	92,93,95,96,97			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:	212				
Waste Class Desc:	ALIPHATIC SOLVENTS				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Desc: 213 PETROLEUM DISTILLATES Waste Class: Waste Class Desc: 221 LIGHT FUELS Waste Class: Waste Class Desc: 252 WASTE OILS & LUBRICANTS					
15	4 of 23	N/135.6	116.6 / -0.22	BOYER EQUIPMENT INC. 05-915 189 CARDEVCO STREET WEST CARLETON ON	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: ON1599301 3192 CONSTRUCTION EQUIP. 94 Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: Waste Class Desc: 213 PETROLEUM DISTILLATES Waste Class: Waste Class Desc: 252 WASTE OILS & LUBRICANTS					
15	5 of 23	N/135.6	116.6 / -0.22	TRUCK & TRACTOR (SEE & USE ON2158207) 189 CARDEVCO ROAD WEST CARLETON ON	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: ON1599301 3192 CONSTRUCTION EQUIP. 98,99 Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: Waste Class Desc: 212 ALIPHATIC SOLVENTS Waste Class: Waste Class Desc: 213 PETROLEUM DISTILLATES Waste Class: Waste Class Desc: 221 LIGHT FUELS Waste Class: Waste Class Desc: 252 WASTE OILS & LUBRICANTS					
15	6 of 23	N/135.6	116.6 / -0.22	ONTRAC EQUIPMENT SERVICES 189 CARDEVCO ROAD CARP ON K0A 1L0	GEN
Generator No: SIC Code: SIC Description: Approval Years: ON2158207 3192 CONSTRUCTION EQUIP. 00,01,02,03,04,05,06 Status: Co Admin: Choice of Contact: Phone No Admin:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No: Country:		Contam. Facility: MHSW Facility:			
<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
15	7 of 23	N/135.6	116.6 / -0.22	Nortrax Canada Inc. 189 Cardevco Road Carp ON K0A 1L0	GEN
Generator No:	ON2158207			Status:	
SIC Code:	811119			Co Admin:	
SIC Description:	Other Automotive Mechanical and Electrical Repair and Maintenance			Choice of Contact:	
Approval Years:	07,08			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
15	8 of 23	N/135.6	116.6 / -0.22	Nortrax Canada Inc. 189 Cardevco Rd RR 2 Carp ON K0A 1L0	SCT
Established:					
Plant Size (ft²):					
Employment:					
<u>--Details--</u>					
Description:	Wholesale Trade Agents and Brokers				
SIC/NAICS Code:	419120				
Description:	Commercial and Industrial Machinery and Equipment (except Automotive and Electronic) Repair and Maintenance				
SIC/NAICS Code:	811310				
Description:	Construction and Forestry Machinery, Equipment and Supplies Wholesaler-Distributors				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC/NAICS Code:		417210			
Description:		Construction and Forestry Machinery, Equipment and Supplies Wholesaler-Distributors			
SIC/NAICS Code:		417210			
15	9 of 23	N/135.6	116.6 / -0.22	Nortrax Canada Inc. 189 Cardevco Rd RR#2, Carp Ottawa ON K0A 1L0	SPL
Ref No:		0524-8FUNH6		Discharger Report:	
Site No:				Material Group:	
Incident Dt:		3/11/2011		Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:		Other Discharges		Sector Type:	Other
Incident Event:				Agency Involved:	
Contaminant Code:		27		Nearest Watercourse:	
Contaminant Name:		OIL ADDITIVES		Site Address:	189 Cardevco Rd RR#2, Carp
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:		Not Anticipated		Site Municipality:	Ottawa
Nature of Impact:		Soil Contamination		Site Lot:	
Receiving Medium:				Site Conc:	
Receiving Env:				Northing:	5016019
MOE Response:		No Field Response		Easting:	423263
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:		4/12/2011		Site Map Datum:	
Dt Document Closed:		6/4/2011		SAC Action Class:	Land Spills
Incident Reason:		Error- Operator error		Source Type:	
Site Name:		Nortrax Canada Inc.			
Site County/District:					
Site Geo Ref Meth:					
Incident Summary:		Nortrax: Poss oil spill 60L, assessing			
Contaminant Qty:		60 L			
15	10 of 23	N/135.6	116.6 / -0.22	Nortrax Canada Inc. 189 Cardevco Road Carp ON K0A 1L0	GEN
Generator No:		ON2158207		Status:	
SIC Code:		811119		Co Admin:	
SIC Description:		Other Automotive Mechanical and Electrical Repair and Maintenance		Choice of Contact:	
Approval Years:		2009		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
15	11 of 23	N/135.6	116.6 / -0.22	Nortrax Canada Inc. 189 Cardevco Road Carp ON K0A 1L0	GEN
Generator No:		ON2158207	Status:		
SIC Code:		811119	Co Admin:		
SIC Description:		Other Automotive Mechanical and Electrical Repair and Maintenance	Choice of Contact:		
Approval Years:		2010	Phone No Admin:		
PO Box No:			Contam. Facility:		
Country:			MHSW Facility:		
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			

15	12 of 23	N/135.6	116.6 / -0.22	Nortrax Canada Inc. 189 Cardevco Road Carp ON K0A 1L0	GEN
Generator No:		ON2158207	Status:		
SIC Code:		811119	Co Admin:		
SIC Description:		Other Automotive Mechanical and Electrical Repair and Maintenance	Choice of Contact:		
Approval Years:		2011	Phone No Admin:		
PO Box No:			Contam. Facility:		
Country:			MHSW Facility:		
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			

15	13 of 23	N/135.6	116.6 / -0.22	Nortrax Canada Inc. 189 Cardevco Road Carp ON K0A 1L0	GEN
Generator No:		ON2158207	Status:		
SIC Code:		811119	Co Admin:		
SIC Description:		Other Automotive Mechanical and Electrical Repair and Maintenance	Choice of Contact:		
Approval Years:		2012	Phone No Admin:		
PO Box No:			Contam. Facility:		
Country:			MHSW Facility:		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
15	14 of 23	N/135.6	116.6 / -0.22	Nortrax Canada Inc. 189 Cardevco Road Carp ON	GEN
Generator No:	ON2158207			Status:	
SIC Code:	811119			Co Admin:	
SIC Description:	OTHER AUTOMOTIVE MECHANICAL AND ELECTRICAL REPAIR AND MAINTENANCE			Choice of Contact:	
Approval Years:	2013			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
15	15 of 23	N/135.6	116.6 / -0.22	189 Cardevco Road Ottawa ON	EHS
Order No:	20150625056			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	03-JUL-15			Search Radius (km):	.25
Date Received:	25-JUN-15			X:	-75.97866
Previous Site Name:				Y:	45.295549
Lot/Building Size:					
Additional Info Ordered:	City Directory				
15	16 of 23	N/135.6	116.6 / -0.22	Nortrax Canada Inc. 189 Cardevco Road Carp ON K0A 1L0	GEN
Generator No:	ON2158207			Status:	
SIC Code:	811119			Co Admin:	Karen Pammett
SIC Description:	OTHER AUTOMOTIVE MECHANICAL AND ELECTRICAL REPAIR AND MAINTENANCE			Choice of Contact:	CO_OFFICIAL

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Years: PO Box No: Country:	2015 Canada			Phone No Admin: Contam. Facility: MHSW Facility:	705742-1021 Ext.235 No No
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	145 PAINT/PIGMENT/COATING RESIDUES				
Waste Class: Waste Class Desc:	331 WASTE COMPRESSED GASES				
Waste Class: Waste Class Desc:	213 PETROLEUM DISTILLATES				
Waste Class: Waste Class Desc:	252 WASTE OILS & LUBRICANTS				
Waste Class: Waste Class Desc:	212 ALIPHATIC SOLVENTS				
Waste Class: Waste Class Desc:	251 OIL SKIMMINGS & SLUDGES				
15	17 of 23	N/135.6	116.6 / -0.22	PCL CONSTRUCTION CANADA INC. 189 CARDEVCO ROAD CARP ON K0A 1L0	GEN
Generator No: SIC Code: SIC Description:	ON8353804 236220 COMMERCIAL AND INSTITUTIONAL BUILDING CONSTRUCTION			Status: Co Admin: Choice of Contact:	CO_OFFICIAL
Approval Years: PO Box No: Country:	2016 Canada			Phone No Admin: Contam. Facility: MHSW Facility:	No No
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	251 OIL SKIMMINGS & SLUDGES				
15	18 of 23	N/135.6	116.6 / -0.22	PCL CONSTRUCTION CANADA INC. 189 CARDEVCO ROAD CARP ON K0A 1L0	GEN
Generator No: SIC Code: SIC Description:	ON8353804 236220 COMMERCIAL AND INSTITUTIONAL BUILDING CONSTRUCTION			Status: Co Admin: Choice of Contact:	CO_OFFICIAL
Approval Years: PO Box No: Country:	2015 Canada			Phone No Admin: Contam. Facility: MHSW Facility:	No No
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	251 OIL SKIMMINGS & SLUDGES				
15	19 of 23	N/135.6	116.6 / -0.22	Nortrax Canada Inc. 189 Cardevco Road Carp ON K0A 1L0	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON2158207 SIC Code: 811119 SIC Description: OTHER AUTOMOTIVE MECHANICAL AND ELECTRICAL REPAIR AND MAINTENANCE Approval Years: 2014 PO Box No: Country: Canada Status: Co Admin: Karen Pammett Choice of Contact: CO_OFFICIAL Phone No Admin: 705742-1021 Ext.235 Contam. Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		331			
Waste Class Desc:		WASTE COMPRESSED GASES			
Waste Class:		145			
Waste Class Desc:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
15	20 of 23	N/135.6	116.6 / -0.22	PCL CONSTRUCTION CANADA INC. 189 CARDEVCO ROAD CARP ON K0A 1L0	GEN
Generator No: ON8353804 SIC Code: SIC Description: Approval Years: As of Dec 2018 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		112 C			
Waste Class Desc:		Acid solutions - containing heavy metals			
Waste Class:		263 I			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		331 I			
Waste Class Desc:		Waste compressed gases including cylinders			
Waste Class:		145 I			
Waste Class Desc:		Wastes from the use of pigments, coatings and paints			
Waste Class:		251 L			
Waste Class Desc:		Waste oils/sludges (petroleum based)			
15	21 of 23	N/135.6	116.6 / -0.22	PCL CONSTRUCTION CANADA INC. 189 CARDEVCO ROAD CARP ON K0A 1L0	GEN
Generator No: ON8353804 SIC Code: Status: Registered Co Admin:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description:		As of Jul 2020		Choice of Contact:	
Approval Years:				Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
		Canada			
<u>Detail(s)</u>					
Waste Class:		146 R			
Waste Class Desc:		Other specified inorganic sludges, slurries or solids			
Waste Class:		251 L			
Waste Class Desc:		Waste oils/sludges (petroleum based)			
Waste Class:		331 I			
Waste Class Desc:		Waste compressed gases including cylinders			
Waste Class:		112 C			
Waste Class Desc:		Acid solutions - containing heavy metals			
Waste Class:		263 I			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		146 T			
Waste Class Desc:		Other specified inorganic sludges, slurries or solids			
Waste Class:		145 I			
Waste Class Desc:		Wastes from the use of pigments, coatings and paints			
15	22 of 23	N/135.6	116.6 / -0.22	PCL CONSTRUCTION CANADA INC. 189 CARDEVCO ROAD CARP ON K0A 1L0	GEN
Generator No:		ON8353804		Status: Registered	
SIC Code:		Co Admin:			
SIC Description:		Choice of Contact:			
Approval Years:		As of Nov 2021		Phone No Admin:	
PO Box No:		Contam. Facility:			
Country:		Canada		MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		263 I			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		251 L			
Waste Class Desc:		Waste oils/sludges (petroleum based)			
Waste Class:		146 R			
Waste Class Desc:		Other specified inorganic sludges, slurries or solids			
Waste Class:		146 T			
Waste Class Desc:		Other specified inorganic sludges, slurries or solids			
Waste Class:		145 I			
Waste Class Desc:		Wastes from the use of pigments, coatings and paints			
Waste Class:		112 C			
Waste Class Desc:		Acid solutions - containing heavy metals			
Waste Class:		331 I			
Waste Class Desc:		Waste compressed gases including cylinders			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
15	23 of 23	N/135.6	116.6 / -0.22	PCL CONSTRUCTION CANADA INC. 189 CARDEVCO ROAD CARP ON K0A 1L0	GEN
Generator No:	ON8353804			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Apr 2022			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:	331 I				
Waste Class Desc:	WASTE COMPRESSED GASES				
Waste Class:	146 R				
Waste Class Desc:	OTHER SPECIFIED INORGANICS				
Waste Class:	251 L				
Waste Class Desc:	OIL SKIMMINGS & SLUDGES				
Waste Class:	145 I				
Waste Class Desc:	PAINT/PIGMENT/COATING RESIDUES				
Waste Class:	263 I				
Waste Class Desc:	ORGANIC LABORATORY CHEMICALS				
Waste Class:	112 C				
Waste Class Desc:	ACID WASTE - HEAVY METALS				
16	1 of 15	W/135.7	118.2 / 1.39	Harris Rebar - Div. of Harris Steel Limited 171 Cardevco Rd Ottawa ON K1G 1L0	SCT
Established:					
Plant Size (ft²):					
Employment:	15				
<u>--Details--</u>					
Description:	Concrete Reinforcing Bar Manufacturing				
SIC/NAICS Code:	332314				
Description:	Other Ornamental and Architectural Metal Products Manufacturing				
SIC/NAICS Code:	332329				
Description:	All Other Miscellaneous Fabricated Metal Product Manufacturing				
SIC/NAICS Code:	332999				
16	2 of 15	W/135.7	118.2 / 1.39	Harris Rebar - Div. of Harris 171 Cardevco Rd Carp ON K0A 1L0	SCT
Established:	01-JUN-54				
Plant Size (ft²):					
Employment:					
<u>--Details--</u>					
Description:	Other Ornamental and Architectural Metal Product Manufacturing				
SIC/NAICS Code:	332329				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Description:		Concrete Reinforcing Bar Manufacturing			
SIC/NAICS Code:		332314			
Description:		All Other Miscellaneous Fabricated Metal Product Manufacturing			
SIC/NAICS Code:		332999			
16	3 of 15	W/135.7	118.2 / 1.39	Harris Steel ULC 171 Cardevco Rd Part of Block 9, 12, 28, 31, Ref. Plan 4R10176, 4R-15838 Ottawa ON	ECA
Approval No:		4207-8XUSZD		MOE District:	Ottawa
Approval Date:		2012-09-07		City:	
Status:		Approved		Longitude:	-75.97978
Record Type:		ECA		Latitude:	45.294952
Link Source:		IDS		Geometry X:	
SWP Area Name:		Mississippi Valley		Geometry Y:	
Approval Type:		ECA-INDUSTRIAL SEWAGE WORKS			
Project Type:		INDUSTRIAL SEWAGE WORKS			
Business Name:		Harris Steel ULC			
Address:		171 Cardevco Rd Part of Block 9, 12, 28, 31, Ref. Plan 4R10176, 4R-15838			
Full Address:					
Full PDF Link:		https://www.accessenvironment.ene.gov.on.ca/instruments/3162-8TAPLS-14.pdf			
PDF Site Location:					
16	4 of 15	W/135.7	118.2 / 1.39	harrisrebar 171 Cardevco road carp ON K0A 1L0	GEN
Generator No:		ON7589486		Status:	
SIC Code:		332314		Co Admin:	
SIC Description:		Concrete Reinforcing Bar Manufacturing		Choice of Contact:	
Approval Years:		2010		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
16	5 of 15	W/135.7	118.2 / 1.39	harrisrebar 171 Cardevco road carp ON K0A 1L0	GEN
Generator No:		ON7589486		Status:	
SIC Code:		332314		Co Admin:	
SIC Description:		Concrete Reinforcing Bar Manufacturing		Choice of Contact:	
Approval Years:		2011		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
16	6 of 15	W/135.7	118.2 / 1.39	Harris Rebar Company 171 Cardevco Road	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
				Ottawa ON	
Generator No:	ON7186651			Status:	
SIC Code:	332314			Co Admin:	
SIC Description:	Concrete Reinforcing Bar Manufacturing			Choice of Contact:	
Approval Years:	2012			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
16	7 of 15	W/135.7	118.2 / 1.39	Harris Rebar Company 171 Cardevco Road Ottawa ON	GEN
Generator No:	ON7186651			Status:	
SIC Code:	332314			Co Admin:	
SIC Description:	CONCRETE REINFORCING BAR MANUFACTURING			Choice of Contact:	
Approval Years:	2013			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:	252				
Waste Class Desc:	WASTE OILS & LUBRICANTS				
16	8 of 15	W/135.7	118.2 / 1.39	Harris Rebar - Harris Steel ULC 171 Cardevco Road Ottawa ON K0A 1L0	GEN
Generator No:	ON7186651			Status:	
SIC Code:	332314			Co Admin:	
SIC Description:	CONCRETE REINFORCING BAR MANUFACTURING			Choice of Contact:	CO_OFFICIAL
Approval Years:	2016			Phone No Admin:	
PO Box No:				Contam. Facility:	No
Country:	Canada			MHSW Facility:	No
<u>Detail(s)</u>					
Waste Class:	263				
Waste Class Desc:	ORGANIC LABORATORY CHEMICALS				
Waste Class:	252				
Waste Class Desc:	WASTE OILS & LUBRICANTS				
16	9 of 15	W/135.7	118.2 / 1.39	Harris Rebar - Harris Steel ULC 171 Cardevco Road Ottawa ON K0A 1L0	GEN
Generator No:	ON7186651			Status:	
SIC Code:	332314			Co Admin:	
SIC Description:	CONCRETE REINFORCING BAR MANUFACTURING			Choice of Contact:	CO_OFFICIAL
Approval Years:	2015			Phone No Admin:	
PO Box No:				Contam. Facility:	No
Country:	Canada			MHSW Facility:	No
<u>Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Desc:		252 WASTE OILS & LUBRICANTS			
16	10 of 15	W/135.7	118.2 / 1.39	Harris Rebar Company 171 Cardevco Road Ottawa ON K0A 1L0	GEN
Generator No:		ON7186651		Status:	
SIC Code:		332314		Co Admin:	
SIC Description:		CONCRETE REINFORCING BAR MANUFACTURING		Choice of Contact: CO_OFFICIAL	
Approval Years:		2014		Phone No Admin:	
PO Box No:				Contam. Facility: No	
Country:		Canada		MHSW Facility: No	
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
16	11 of 15	W/135.7	118.2 / 1.39	Harris Rebar - Harris Steel ULC 171 Cardevco Road Ottawa ON K0A 1L0	GEN
Generator No:		ON7186651		Status: Registered	
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:		As of Dec 2018		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:		Canada		MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		252 L			
Waste Class Desc:		Waste crankcase oils and lubricants			
Waste Class:		263 I			
Waste Class Desc:		Misc. waste organic chemicals			
16	12 of 15	W/135.7	118.2 / 1.39	CQS Electric 171 Cardevco Road Ottawa ON K0A 1L0	GEN
Generator No:		ON9165915		Status: Registered	
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:		As of Oct 2019		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:		Canada		MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		251 L			
Waste Class Desc:		Waste oils/sludges (petroleum based)			
16	13 of 15	W/135.7	118.2 / 1.39	Harris Rebar - Harris Steel ULC 171 Cardevco Road Ottawa ON K0A 1L0	GEN
Generator No:		ON7186651		Status: Registered	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Code: SIC Description: Approval Years: As of Jul 2020 PO Box No: Country: Canada					
Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 252 L Waste Class Desc: Waste crankcase oils and lubricants					
Waste Class: 263 I Waste Class Desc: Misc. waste organic chemicals					
16	14 of 15	W/135.7	118.2 / 1.39	Harris Rebar - Harris Steel ULC 171 Cardevco Road Ottawa ON K0A 1L0	GEN
Generator No: ON7186651 SIC Code: SIC Description: Approval Years: As of Nov 2021 PO Box No: Country: Canada					
Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 331 I Waste Class Desc: Waste compressed gases including cylinders					
Waste Class: 263 I Waste Class Desc: Misc. waste organic chemicals					
Waste Class: 252 L Waste Class Desc: Waste crankcase oils and lubricants					
Waste Class: 252 T Waste Class Desc: Waste crankcase oils and lubricants					
16	15 of 15	W/135.7	118.2 / 1.39	Harris Rebar - Harris Steel ULC 171 Cardevco Road Ottawa ON K0A 1L0	GEN
Generator No: ON7186651 SIC Code: SIC Description: Approval Years: As of Apr 2022 PO Box No: Country: Canada					
Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 252 L Waste Class Desc: WASTE OILS & LUBRICANTS					
Waste Class: 331 I Waste Class Desc: WASTE COMPRESSED GASES					
Waste Class: 263 I Waste Class Desc: ORGANIC LABORATORY CHEMICALS					
Waste Class: 252 T					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Desc:		WASTE OILS & LUBRICANTS			
17	1 of 14	SE/136.3	118.4 / 1.65	Bytown Mouldings Inc. 142 Cardevco Rd Carp ON K0A 1L0	SCT
Established:		1994			
Plant Size (ft²):		6400			
Employment:		7			
--Details--					
Description:		Other Millwork			
SIC/NAICS Code:		321919			
Description:		All Other Plastic Product Manufacturing			
SIC/NAICS Code:		326198			
Description:		Metal Window and Door Manufacturing			
SIC/NAICS Code:		332321			
17	2 of 14	SE/136.3	118.4 / 1.65	W O STINSON & SON LTD 142 CARDEVCO CARP ON K0A 1L0	FSTH
License Issue Date:		7/10/2002			
Tank Status:		Licensed			
Tank Status As Of:		August 2007			
Operation Type:		Private Fuel Outlet			
Facility Type:		Gasoline Station - Self Serve			
--Details--					
Status:		Active			
Year of Installation:		2002			
Corrosion Protection:					
Capacity:		2270			
Tank Fuel Type:		Liquid Fuel Double Wall AST - Gasoline			
Status:		Active			
Year of Installation:		2002			
Corrosion Protection:					
Capacity:		2270			
Tank Fuel Type:		Liquid Fuel Double Wall AST - Gasoline			
17	3 of 14	SE/136.3	118.4 / 1.65	W O STINSON & SON LTD 142 CARDEVCO CARP ON K0A 1L0	FSTH
License Issue Date:		7/10/2002			
Tank Status:		Licensed			
Tank Status As Of:		December 2008			
Operation Type:		Private Fuel Outlet			
Facility Type:		Gasoline Station - Self Serve			
--Details--					
Status:		Active			
Year of Installation:		2002			
Corrosion Protection:					
Capacity:		2270			
Tank Fuel Type:		Liquid Fuel Double Wall AST - Gasoline			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: Year of Installation: Corrosion Protection: Capacity: Tank Fuel Type:		Active 2002 2270 Liquid Fuel Double Wall AST - Gasoline			
17	4 of 14	SE/136.3	118.4 / 1.65	1043084 Ontario Inc. 142 Cardevco Road Carp Carleton Ottawa ON	CA
Certificate #: Application Year: Issue Date: Approval Type: Status: Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:		6674-8AGRUQ 2010 11/9/2010 Waste Management Systems Approved			
17	5 of 14	SE/136.3	118.4 / 1.65	2299663 Ontario Ltd 142 Cardevco Road Carp ON K0A 1L0	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:		ON3825812 332999 2011	Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:		
17	6 of 14	SE/136.3	118.4 / 1.65	2299663 Ontario Ltd 142 Cardevco Road Carp ON K0A 1L0	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:		ON3825812 332999 All Other Miscellaneous Fabricated Metal Product Manufacturing 2012	Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:		
17	7 of 14	SE/136.3	118.4 / 1.65	2299663 Ontario Ltd 142 Cardevco Road Carp ON	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:		ON3825812 332999 ALL OTHER MISCELLANEOUS FABRICATED METAL PRODUCT MANUFACTURING 2013	Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:	113				
Waste Class Desc:	ACID WASTE - OTHER METALS				
Waste Class:	212				
Waste Class Desc:	ALIPHATIC SOLVENTS				
Waste Class:	252				
Waste Class Desc:	WASTE OILS & LUBRICANTS				
Waste Class:	122				
Waste Class Desc:	ALKALINE WASTES - OTHER METALS				
17	8 of 14	SE/136.3	118.4 / 1.65	1043084 Ontario Inc. 142 Cardevco Road Carp Carleton Ottawa ON K2S 1B6	ECA
Approval No:	6674-8AGRUQ			MOE District:	Ottawa
Approval Date:	2010-11-09			City:	
Status:	Approved			Longitude:	-75.9772
Record Type:	ECA			Latitude:	45.293453
Link Source:	IDS			Geometry X:	
SWP Area Name:	Mississippi Valley			Geometry Y:	
Approval Type:	ECA-WASTE MANAGEMENT SYSTEMS				
Project Type:	WASTE MANAGEMENT SYSTEMS				
Business Name:	1043084 Ontario Inc.				
Address:	142 Cardevco Road Carp Carleton				
Full Address:					
Full PDF Link:	https://www.accessenvironment.ene.gov.on.ca/instruments/2555-8A6GSD-14.pdf				
PDF Site Location:					
17	9 of 14	SE/136.3	118.4 / 1.65	2299663 Ontario Ltd 142 Cardevco Road Carp ON K0A1L0	GEN
Generator No:	ON3825812			Status:	
SIC Code:	332999			Co Admin:	Ellen Gyenis
SIC Description:	ALL OTHER MISCELLANEOUS FABRICATED METAL PRODUCT MANUFACTURING			Choice of Contact:	CO_ADMIN
Approval Years:	2016			Phone No Admin:	6138361954 Ext.
PO Box No:				Contam. Facility:	No
Country:	Canada			MHSW Facility:	No
<u>Detail(s)</u>					
Waste Class:	113				
Waste Class Desc:	ACID WASTE - OTHER METALS				
Waste Class:	212				
Waste Class Desc:	ALIPHATIC SOLVENTS				
Waste Class:	252				
Waste Class Desc:	WASTE OILS & LUBRICANTS				
Waste Class:	122				
Waste Class Desc:	ALKALINE WASTES - OTHER METALS				
17	10 of 14	SE/136.3	118.4 / 1.65	2299663 Ontario Ltd 142 Cardevco Road	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Carp ON K0A1L0					
Generator No:	ON3825812			Status:	
SIC Code:	332999			Co Admin:	Ellen Gyenis
SIC Description:	ALL OTHER MISCELLANEOUS FABRICATED METAL PRODUCT MANUFACTURING			Choice of Contact:	CO_ADMIN
Approval Years:	2015			Phone No Admin:	6138361954 Ext.
PO Box No:				Contam. Facility:	No
Country:	Canada			MHSW Facility:	No
<u>Detail(s)</u>					
Waste Class:	252				
Waste Class Desc:	WASTE OILS & LUBRICANTS				
Waste Class:	212				
Waste Class Desc:	ALIPHATIC SOLVENTS				
Waste Class:	113				
Waste Class Desc:	ACID WASTE - OTHER METALS				
Waste Class:	122				
Waste Class Desc:	ALKALINE WASTES - OTHER METALS				
17	11 of 14	SE/136.3	118.4 / 1.65	2299663 Ontario Ltd 142 Cardevco Road Carp ON K0A1L0	GEN
Generator No:	ON3825812			Status:	
SIC Code:	332999			Co Admin:	Ellen Gyenis
SIC Description:	ALL OTHER MISCELLANEOUS FABRICATED METAL PRODUCT MANUFACTURING			Choice of Contact:	CO_ADMIN
Approval Years:	2014			Phone No Admin:	6138361954 Ext.
PO Box No:				Contam. Facility:	No
Country:	Canada			MHSW Facility:	No
<u>Detail(s)</u>					
Waste Class:	113				
Waste Class Desc:	ACID WASTE - OTHER METALS				
Waste Class:	122				
Waste Class Desc:	ALKALINE WASTES - OTHER METALS				
Waste Class:	212				
Waste Class Desc:	ALIPHATIC SOLVENTS				
Waste Class:	252				
Waste Class Desc:	WASTE OILS & LUBRICANTS				
17	12 of 14	SE/136.3	118.4 / 1.65	2299663 Ontario Ltd 142 Cardevco Road Carp ON K0A1L0	GEN
Generator No:	ON3825812			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Dec 2018			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		113 C			
Waste Class Desc:		Acid solutions - containing other metals and non-metals			
Waste Class:		122 L			
Waste Class Desc:		Alkaline slutions - containing other metals and non-metals (not cyanide)			
Waste Class:		212 L			
Waste Class Desc:		Aliphatic solvents and residues			
Waste Class:		252 L			
Waste Class Desc:		Waste crankcase oils and lubricants			
<u>17</u>	13 of 14	SE/136.3	118.4 / 1.65	2299663 Ontario Ltd 142 Cardevco Road Carp ON K0A1L0	GEN
Generator No:	ON3825812			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Jul 2020			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		252 L			
Waste Class Desc:		Waste crankcase oils and lubricants			
Waste Class:		212 L			
Waste Class Desc:		Aliphatic solvents and residues			
Waste Class:		122 L			
Waste Class Desc:		Alkaline slutions - containing other metals and non-metals (not cyanide)			
Waste Class:		113 C			
Waste Class Desc:		Acid solutions - containing other metals and non-metals			
<u>17</u>	14 of 14	SE/136.3	118.4 / 1.65	2299663 Ontario Ltd 142 Cardevco Road Carp ON K0A1L0	GEN
Generator No:	ON3825812			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Nov 2021			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		212 L			
Waste Class Desc:		Aliphatic solvents and residues			
Waste Class:		122 L			
Waste Class Desc:		Alkaline slutions - containing other metals and non-metals (not cyanide)			
Waste Class:		252 L			
Waste Class Desc:		Waste crankcase oils and lubricants			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		113 C			
Waste Class Desc:		Acid solutions - containing other metals and non-metals			
18	1 of 2	N/138.2	116.5 / -0.25	189 Cardevco Rd Carp ON K0A 1L0	EHS
Order No:		20300200030		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State: ON	
Report Date:		07-OCT-20		Search Radius (km): .25	
Date Received:		02-OCT-20		X: -75.9786631	
Previous Site Name:				Y: 45.2955715	
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans			
18	2 of 2	N/138.2	116.5 / -0.25	189 Cardevco Rd Carp ON K0A 1L0	EHS
Order No:		20300200030		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State: ON	
Report Date:		07-OCT-20		Search Radius (km): .25	
Date Received:		02-OCT-20		X: -75.9786631	
Previous Site Name:				Y: 45.2955715	
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans			
19	1 of 1	S/141.0	118.9 / 2.06	lot 6 con 3 ON	WWIS
Well ID:		1532757		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Domestic		Data Entry Status:	
Use 2nd:				Data Src: 1	
Final Well Status:		Water Supply		Date Received: 06-May-2002 00:00:00	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No:		238136		Contractor: 1558	
Tag:				Form Version: 1	
Constructn Method:				Owner:	
Elevation (m):				County: OTTAWA-CARLETON	
Elevatn Reliabilty:				Lot: 006	
Depth to Bedrock:				Concession: 03	
Well Depth:				Concession Name: CON	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		HUNTLEY TOWNSHIP			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/153\1532757.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2002/04/29			
Year Completed:		2002			
Depth (m):		18.288			
Latitude:		45.2930660584471			
Longitude:		-75.9786839507555			
Path:		153\1532757.pdf			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	10523885			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	423259.00
Code OB Desc:				North83:	5015973.00
Open Hole:				Org CS:	N83
Cluster Kind:				UTMRC:	3
Date Completed:	29-Apr-2002 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	
Loc Method Desc:					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	932857631				
Layer:	3				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	16.0				
Formation End Depth:	60.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	932857630				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	28				
Most Common Material:	SAND				
Mat2:	11				
Mat2 Desc:	GRAVEL				
Mat3:					
Mat3 Desc:					
Formation Top Depth:	13.0				
Formation End Depth:	16.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	932857629				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	28				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Most Common Material:		SAND			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		13.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933225398			
Layer:		1			
Plug From:		0.0			
Plug To:		22.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		961532757			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11072455			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930095516			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:					
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930095515			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:					
Casing Diameter:		5.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991532757			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pump Set At:					
Static Level:		4.0			
Final Level After Pumping:		25.0			
Recommended Pump Depth:		40.0			
Pumping Rate:		15.0			
Flowing Rate:					
Recommended Pump Rate:		5.0			
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		2			
Water State After Test:		CLOUDY			
Pumping Test Method:		1			
Pumping Duration HR:		1			
Pumping Duration MIN:		0			
Flowing:		No			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		934117924			
Test Type:		Draw Down			
Test Duration:		15			
Test Level:		25.0			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		934918943			
Test Type:		Draw Down			
Test Duration:		60			
Test Level:		55.0			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		934401536			
Test Type:		Draw Down			
Test Duration:		30			
Test Level:		40.0			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		934662059			
Test Type:		Draw Down			
Test Duration:		45			
Test Level:		40.0			
Test Level UOM:		ft			
<u>Water Details</u>					
Water ID:		934016451			
Layer:		1			
Kind Code:		5			
Kind:		Not stated			
Water Found Depth:		27.0			
Water Found Depth UOM:		ft			
<u>Water Details</u>					
Water ID:		934016452			
Layer:		2			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Kind Code: Kind: Water Found Depth: Water Found Depth UOM:		5 Not stated 51.0 ft			
<u>Links</u>					
Bore Hole ID: Depth M: Year Completed: Well Completed Dt: Audit No:		10523885 18.288 2002 2002/04/29 238136		Tag No: Contractor: Path: Latitude: Longitude:	1558 153\1532757.pdf 45.2930660584471 -75.9786839507555
20	1 of 1	S/150.7	119.3 / 2.54	145 Cardevco Road Carp ON K0A 1L0	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:		20190916176 C Standard Report 19-SEP-19 16-SEP-19 Fire Insur. Maps and/or Site Plans		Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:	 ON .25 -75.978807 45.292988
21	1 of 1	SSE/164.0	118.9 / 2.08	2299663 Ontario Ltd 142 Cardevco Road Carp ON K0A1L0	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:		ON3825812 As of Apr 2022 Canada		Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	Registered
<u>Detail(s)</u>					
Waste Class:		252 L			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		113 C			
Waste Class Desc:		ACID WASTE - OTHER METALS			
Waste Class:		122 L			
Waste Class Desc:		ALKALINE WASTES - OTHER METALS			
Waste Class:		212 L			
Waste Class Desc:		ALIPHATIC SOLVENTS			
22	1 of 2	NE/167.8	114.2 / -2.61	197 Cardevco Road Carp ON K0A 1L0	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:		21060100016 C Standard Report 04-JUN-21 01-JUN-21 		Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:	 ON .25 -75.9774715 45.2956389

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
22	2 of 2	NE/167.8	114.2 / -2.61	197 Cardevco Road Carp ON K0A 1L0	EHS
Order No: 21060100016 Status: C Report Type: Standard Report Report Date: 04-JUN-21 Date Received: 01-JUN-21 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.9774715 Y: 45.2956389			
23	1 of 1	S/174.5	119.2 / 2.39	CAPITAL DEDICATED LOGISTICS INC. 135 CARDEVCO RD CARP ON K0A 1L0	EASR
Approval No: R-004-1110114179 Status: REGISTERED Date: 2017-04-06 Record Type: EASR Link Source: MOFA Project Type: Waste Management System Full Address: Approval Type: EASR-Waste Management System SWP Area Name: Mississippi Valley PDF URL: PDF Site Location:		MOE District: Ottawa Municipality: CARP Latitude: 45.29277778 Longitude: -75.97861111 Geometry X: Geometry Y:			
24	1 of 11	S/174.5	119.2 / 2.39	135 Cardevco Road Carp ON K0A 1L0	EHS
Order No: 20081118034 Status: C Report Type: Standard Report Report Date: 11/27/2008 Date Received: 11/18/2008 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Cardevco Road and Carp Road Municipality: Ottawa Client Prov/State: ON Search Radius (km): 0.25 X: -75.97822 Y: 45.292846			
24	2 of 11	S/174.5	119.2 / 2.39	135 Cardevco Road Ottawa ON	EHS
Order No: 20110812035 Status: C Report Type: Standard Report Report Date: 8/23/2011 Date Received: 8/12/2011 4:25:47 PM Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -75.978342 Y: 45.292946			
24	3 of 11	S/174.5	119.2 / 2.39	Capital Dedicated Logisics 135 Cardevco Carp ON K0A 1L0	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON7253275 SIC Code: 484110 SIC Description: General Freight Trucking Local Approval Years: 2009 PO Box No: Country:					
Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 252 Waste Class Desc: WASTE OILS & LUBRICANTS					
24	4 of 11	S/174.5	119.2 / 2.39	Capital Dedicated Logistics 135 Cardevco Carp ON K0A 1L0	GEN
Generator No: ON7253275 SIC Code: 484110 SIC Description: General Freight Trucking Local Approval Years: 2010 PO Box No: Country:					
Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 252 Waste Class Desc: WASTE OILS & LUBRICANTS					
24	5 of 11	S/174.5	119.2 / 2.39	Capital Dedicated Logistics 135 Cardevco Carp ON K0A 1L0	GEN
Generator No: ON7253275 SIC Code: 484110 SIC Description: General Freight Trucking Local Approval Years: 2011 PO Box No: Country:					
Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 252 Waste Class Desc: WASTE OILS & LUBRICANTS					
24	6 of 11	S/174.5	119.2 / 2.39	135 Cardevco Rd Ottawa ON K0A1L0	EHS
Order No: 20160316075 Status: C Report Type: Standard Report Report Date: 23-MAR-16 Date Received: 16-MAR-16 Previous Site Name: Lot/Building Size: 2024 sq.m. Additional Info Ordered: City Directory					
Nearest Intersection: Municipality: Ottawa Client Prov/State: ON Search Radius (km): .25 X: -75.978578 Y: 45.292761					
24	7 of 11	S/174.5	119.2 / 2.39	135 Cardevco Rd Ottawa ON K0A1L0	EHS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Order No: 20180202014 Status: C Report Type: Standard Report Report Date: 07-FEB-18 Date Received: 02-FEB-18 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.978578 Y: 45.292761					
24	8 of 11	S/174.5	119.2 / 2.39	Premier Bus Lines Inc. Carp 135 Cardevco Rd Carp ON K0A 1L0	GEN
Generator No: ON7347589 SIC Code: SIC Description: Approval Years: As of Jul 2020 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
Detail(s)					
Waste Class: 252 L Waste Class Desc: Waste crankcase oils and lubricants					
24	9 of 11	S/174.5	119.2 / 2.39	Premier Bus Lines Inc. Carp 135 Cardevco Rd Carp ON K0A 1L0	GEN
Generator No: ON7347589 SIC Code: SIC Description: Approval Years: As of Jan 2021 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
Detail(s)					
Waste Class: 252 L Waste Class Desc: Waste crankcase oils and lubricants					
24	10 of 11	S/174.5	119.2 / 2.39	Premier Bus Lines Inc. Carp 135 Cardevco Rd Carp ON K0A 1L0	GEN
Generator No: ON7347589 SIC Code: SIC Description: Approval Years: As of Nov 2021 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
Detail(s)					
Waste Class: 252 L Waste Class Desc: Waste crankcase oils and lubricants					
24	11 of 11	S/174.5	119.2 / 2.39	Premier Bus Lines Inc. Carp 135 Cardevco Rd	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Carp ON K0A 1L0					
Generator No:	ON7347589			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Apr 2022			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:	252 L				
Waste Class Desc:	WASTE OILS & LUBRICANTS				
<u>25</u>	1 of 7	WSW/180.2	119.6 / 2.78	Kerr Design Ltd. 168 Wescar Lane RR 2 Carp ON K0A 1L0	SCT
Established:	01-JUN-90				
Plant Size (ft²):					
Employment:					
--Details--					
Description:	Wood Office Furniture, including Custom Architectural Woodwork, Manufacturing				
SIC/NAICS Code:	337213				
Description:	Other Millwork				
SIC/NAICS Code:	321919				
Description:	Other Wood Household Furniture Manufacturing				
SIC/NAICS Code:	337123				
Description:	Wood Office Furniture, including Custom Architectural Woodwork, Manufacturing				
SIC/NAICS Code:	337213				
<u>25</u>	2 of 7	WSW/180.2	119.6 / 2.78	Competition Composites Inc. 168 Wescar Lane Unit 3 Carp ON K0A 1L0	SCT
Established:	1/1/2002				
Plant Size (ft²):	1800				
Employment:					
--Details--					
Description:	All Other Plastic Product Manufacturing				
SIC/NAICS Code:	326198				
Description:	Engineering Services				
SIC/NAICS Code:	541330				
<u>25</u>	3 of 7	WSW/180.2	119.6 / 2.78	Competition Composites Inc. 168 Wescar Lane Carp Ottawa ON	CA
Certificate #:	5353-8BBMUW				
Application Year:	2010				
Issue Date:	11/19/2010				
Approval Type:	Air				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:		Approved			
25	4 of 7	WSW/180.2	119.6 / 2.78	Competition Composites Inc. 3-168 Wescar Lane Carp ON K0A 1L0	SCT
Established: Plant Size (ft²): Employment:		01-JAN-02 1800			
--Details--					
Description:		All Other Plastic Product Manufacturing			
SIC/NAICS Code:		326198			
Description:		Engineering Services			
SIC/NAICS Code:		541330			
25	5 of 7	WSW/180.2	119.6 / 2.78	Competition Composites Inc. 168 Wescar Lane Carp Ottawa ON K0A 1L0	ECA
Approval No:		5353-8BBMUW		MOE District:	Ottawa
Approval Date:		2010-11-19		City:	
Status:		Revoked and/or Replaced		Longitude:	-75.9808
Record Type:		ECA		Latitude:	45.293774
Link Source:		IDS		Geometry X:	
SWP Area Name:		Mississippi Valley		Geometry Y:	
Approval Type:		ECA-AIR			
Project Type:		AIR			
Business Name:		Competition Composites Inc.			
Address:		168 Wescar Lane Carp			
Full Address:					
Full PDF Link:		https://www.accessenvironment.ene.gov.on.ca/instruments/1325-82CS5P-14.pdf			
PDF Site Location:					
25	6 of 7	WSW/180.2	119.6 / 2.78	Competition Composites 168 Wescar Lane Carp ON K0A 1L0	GEN
Generator No:		ON3677511		Status:	
SIC Code:		333310		Co Admin:	Phillip Locker
SIC Description:		COMMERCIAL AND SERVICE INDUSTRY MACHINERY MANUFACTURING		Choice of Contact:	CO_OFFICIAL
Approval Years:		2015		Phone No Admin:	613-599-6951 Ext.
PO Box No:				Contam. Facility:	No
Country:		Canada		MHSW Facility:	No
<u>Detail(s)</u>					
Waste Class:		211			
Waste Class Desc:		AROMATIC SOLVENTS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
25	7 of 7	WSW/180.2	119.6 / 2.78	Competition Composites 168 Wescar Lane Carp ON K0A 1L0	GEN
Generator No:		ON3677511		Status:	
SIC Code:		333310		Co Admin:	Phillip Locker
SIC Description:		COMMERCIAL AND SERVICE INDUSTRY MACHINERY MANUFACTURING		Choice of Contact:	CO_OFFICIAL
Approval Years:		2014		Phone No Admin:	613-599-6951 Ext.
PO Box No:				Contam. Facility:	No
Country:		Canada		MHSW Facility:	No
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		211			
Waste Class Desc:		AROMATIC SOLVENTS			
26	1 of 1	S/180.9	119.2 / 2.39	123 CARDEVCO ROAD lot 6 con 3 CARP ON	WWIS
Well ID:		7210658		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Domestic		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Water Supply		Date Received:	06-Nov-2013 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z155253		Contractor:	1119
Tag:		A135308		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	006
Depth to Bedrock:				Concession:	03
Well Depth:				Concession Name:	CON
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		HUNTLEY TOWNSHIP			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/721\7210658.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2013/10/08			
Year Completed:		2013			
Depth (m):		30.48			
Latitude:		45.2927090022949			
Longitude:		-75.9783334777821			
Path:		721\7210658.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1004623534		Elevation:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	423286.00
Code OB Desc:				North83:	5015933.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	08-Oct-2013 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004869371			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		11.0			
Formation End Depth:		78.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004869370			
Layer:		1			
Color:					
General Color:					
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		13			
Mat3 Desc:		BOULDERS			
Formation Top Depth:		0.0			
Formation End Depth:		11.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004869373			
Layer:		4			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation Top Depth:		93.0			
Formation End Depth:		100.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004869372			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		78.0			
Formation End Depth:		93.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004869409			
Layer:		1			
Plug From:		20.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004869408			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004869368			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004869379			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		20.0			
Depth To:		100.0			
Casing Diameter:		5.9375			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		1004869378			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		-2.0			
Depth To:		20.0			
Casing Diameter:		6.25			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1004869380			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1004869369			
Pump Set At:		90.0			
Static Level:		7.599999904632568			
Final Level After Pumping:		19.700000762939453			
Recommended Pump Depth:		90.0			
Pumping Rate:		20.0			
Flowing Rate:					
Recommended Pump Rate:		20.0			
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		0			
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:		1			
Pumping Duration MIN:					
Flowing:					
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869393			
Test Type:		Draw Down			
Test Duration:		15			
Test Level:		18.399999618530273			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869396			
Test Type:		Recovery			
Test Duration:		20			
Test Level:		7.599999904632568			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869403			
Test Type:		Draw Down			
Test Duration:		50			
Test Level:		19.700000762939453			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869404			
Test Type:		Recovery			
Test Duration:		50			
Test Level:		7.599999904632568			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869406			
Test Type:		Recovery			
Test Duration:		60			
Test Level:		7.599999904632568			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869386			
Test Type:		Recovery			
Test Duration:		3			
Test Level:		7.599999904632568			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869388			
Test Type:		Recovery			
Test Duration:		4			
Test Level:		7.599999904632568			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869400			
Test Type:		Recovery			
Test Duration:		30			
Test Level:		7.599999904632568			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869398			
Test Type:		Recovery			
Test Duration:		25			
Test Level:		7.599999904632568			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869391			
Test Type:		Draw Down			
Test Duration:		10			
Test Level:		17.299999237060547			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pump Test Detail ID:		1004869381			
Test Type:		Draw Down			
Test Duration:		1			
Test Level:		13.699999809265137			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869389			
Test Type:		Draw Down			
Test Duration:		5			
Test Level:		15.399999618530273			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869392			
Test Type:		Recovery			
Test Duration:		10			
Test Level:		7.599999904632568			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869399			
Test Type:		Draw Down			
Test Duration:		30			
Test Level:		19.600000381469727			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869402			
Test Type:		Recovery			
Test Duration:		40			
Test Level:		7.599999904632568			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869401			
Test Type:		Draw Down			
Test Duration:		40			
Test Level:		19.700000762939453			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869387			
Test Type:		Draw Down			
Test Duration:		4			
Test Level:		15.100000381469727			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869390			
Test Type:		Recovery			
Test Duration:		5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Test Level:		7.599999904632568			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869394			
Test Type:		Recovery			
Test Duration:		15			
Test Level:		7.599999904632568			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869395			
Test Type:		Draw Down			
Test Duration:		20			
Test Level:		19.5			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869397			
Test Type:		Draw Down			
Test Duration:		25			
Test Level:		19.600000381469727			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869382			
Test Type:		Recovery			
Test Duration:		1			
Test Level:		7.599999904632568			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869383			
Test Type:		Draw Down			
Test Duration:		2			
Test Level:		14.199999809265137			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869384			
Test Type:		Recovery			
Test Duration:		2			
Test Level:		7.599999904632568			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869385			
Test Type:		Draw Down			
Test Duration:		3			
Test Level:		14.800000190734863			
Test Level UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004869405			
Test Type:		Draw Down			
Test Duration:		60			
Test Level:		19.700000762939453			
Test Level UOM:		ft			
<u>Water Details</u>					
Water ID:		1004869377			
Layer:		2			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		93.0			
Water Found Depth UOM:		ft			
<u>Water Details</u>					
Water ID:		1004869376			
Layer:		1			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		78.0			
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1004869374			
Diameter:		9.75			
Depth From:		0.0			
Depth To:		20.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Hole Diameter</u>					
Hole ID:		1004869375			
Diameter:		5.9375			
Depth From:		20.0			
Depth To:		100.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:	1004623534			Tag No:	A135308
Depth M:	30.48			Contractor:	1119
Year Completed:	2013			Path:	721\7210658.pdf
Well Completed Dt:	2013/10/08			Latitude:	45.2927090022949
Audit No:	Z155253			Longitude:	-75.9783334777821
27	1 of 2	NE/181.2	114.2 / -2.61	217 Cardevco Rd Carp ON K0A 1L0	EHS
Order No:	20200716104			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	21-JUL-20			Search Radius (km):	.25
Date Received:	16-JUL-20			X:	-75.9772658
Previous Site Name:				Y:	45.2956916

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Lot/Building Size: Additional Info Ordered:					
27	2 of 2	NE/181.2	114.2 / -2.61	217 Cardevco Rd Carp ON K0A 1L0	EHS
Order No: 20200716104				Nearest Intersection:	
Status: C				Municipality:	
Report Type: Standard Report				Client Prov/State: ON	
Report Date: 21-JUL-20				Search Radius (km): .25	
Date Received: 16-JUL-20				X: -75.9772658	
Previous Site Name:				Y: 45.2956916	
Lot/Building Size:					
Additional Info Ordered:					
28	1 of 1	SW/182.6	119.9 / 3.08	154 Wescar Lane Ottawa ON K0A1L0	EHS
Order No: 20180503108				Nearest Intersection:	
Status: C				Municipality: Ottawa	
Report Type: Standard Report				Client Prov/State: ON	
Report Date: 10-MAY-18				Search Radius (km): .25	
Date Received: 03-MAY-18				X: -75.980212	
Previous Site Name:				Y: 45.293186	
Lot/Building Size: 1.02 acres					
Additional Info Ordered: City Directory; Aerial Photos					
29	1 of 1	S/184.3	119.9 / 3.08	135 CARDEVCO RD CARP ON	WWIS
Well ID: 7186867				Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st: Domestic				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status: Water Supply				Date Received: 11-Sep-2012 00:00:00	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No: Z154051				Contractor: 2558	
Tag: A134668				Form Version: 7	
Constructn Method:				Owner:	
Elevation (m):				County: OTTAWA-CARLETON	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality: HUNTLEY TOWNSHIP					
Site Info: PART 7&10					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/718\7186867.pdf			
Additional Detail(s) (Map)					
Well Completed Date: 2012/08/09					
Year Completed: 2012					
Depth (m): 30.48					
Latitude: 45.2926785057057					
Longitude: -75.9787410494549					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Path:		718\7186867.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1004152215			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	423254.00
Code OB Desc:				North83:	5015930.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	09-Aug-2012 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1004453816				
Layer:	2				
Color:	8				
General Color:	BLACK				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	16.0				
Formation End Depth:	100.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1004453815				
Layer:	1				
Color:					
General Color:					
Mat1:	05				
Most Common Material:	CLAY				
Mat2:	28				
Mat2 Desc:	SAND				
Mat3:	12				
Mat3 Desc:	STONES				
Formation Top Depth:	0.0				
Formation End Depth:	16.0				
Formation End Depth UOM:	ft				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1004453850				
Layer:	1				
Plug From:	0.0				
Plug To:	22.0				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004453849			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004453813			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004453820			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		22.0			
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1004453821			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1004453814			
Pump Set At:		75.0			
Static Level:					
Final Level After Pumping:		11.0			
Recommended Pump Depth:		80.0			
Pumping Rate:		15.0			
Flowing Rate:					
Recommended Pump Rate:		15.0			
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		2			
Water State After Test:		CLOUDY			
Pumping Test Method:		0			
Pumping Duration HR:		1			
Pumping Duration MIN:					
Flowing:		No			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453831			
Test Type:		Recovery			
Test Duration:		5			
Test Level:		19.700000762939453			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453835			
Test Type:		Recovery			
Test Duration:		15			
Test Level:		12.5			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453840			
Test Type:		Draw Down			
Test Duration:		30			
Test Level:		63.0			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453829			
Test Type:		Recovery			
Test Duration:		4			
Test Level:		22.8999999618530273			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453832			
Test Type:		Draw Down			
Test Duration:		10			
Test Level:		47.0			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453844			
Test Type:		Draw Down			
Test Duration:		50			
Test Level:		67.4000015258789			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453823			
Test Type:		Recovery			
Test Duration:		1			
Test Level:		45.099998474121094			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453824			
Test Type:		Draw Down			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Test Duration:		2			
Test Level:		25.899999618530273			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453826			
Test Type:		Draw Down			
Test Duration:		3			
Test Level:		29.799999237060547			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453830			
Test Type:		Draw Down			
Test Duration:		5			
Test Level:		35.400001525878906			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453837			
Test Type:		Recovery			
Test Duration:		20			
Test Level:		11.75			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453839			
Test Type:		Recovery			
Test Duration:		25			
Test Level:		11.649999618530273			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453842			
Test Type:		Draw Down			
Test Duration:		40			
Test Level:		67.4000015258789			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453845			
Test Type:		Recovery			
Test Duration:		50			
Test Level:		11.100000381469727			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453822			
Test Type:		Draw Down			
Test Duration:		1			
Test Level:		20.799999237060547			
Test Level UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453825			
Test Type:		Recovery			
Test Duration:		2			
Test Level:		35.20000076293945			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453828			
Test Type:		Draw Down			
Test Duration:		4			
Test Level:		32.900001525878906			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453836			
Test Type:		Draw Down			
Test Duration:		20			
Test Level:		56.099998474121094			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453838			
Test Type:		Draw Down			
Test Duration:		25			
Test Level:		56.79999923706055			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453827			
Test Type:		Recovery			
Test Duration:		3			
Test Level:		27.799999237060547			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453847			
Test Type:		Recovery			
Test Duration:		60			
Test Level:		11.050000190734863			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453846			
Test Type:		Draw Down			
Test Duration:		60			
Test Level:		67.4000015258789			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453833			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Test Type:		Recovery			
Test Duration:		10			
Test Level:		13.699999809265137			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453834			
Test Type:		Draw Down			
Test Duration:		15			
Test Level:		53.5			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453841			
Test Type:		Recovery			
Test Duration:		30			
Test Level:		11.399999618530273			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004453843			
Test Type:		Recovery			
Test Duration:		40			
Test Level:		11.199999809265137			
Test Level UOM:		ft			
 <u>Water Details</u>					
Water ID:		1004453818			
Layer:		1			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		79.0			
Water Found Depth UOM:		ft			
 <u>Water Details</u>					
Water ID:		1004453819			
Layer:		2			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		82.0			
Water Found Depth UOM:		ft			
 <u>Hole Diameter</u>					
Hole ID:		1004453817			
Diameter:		25.399999618530273			
Depth From:		0.0			
Depth To:		22.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
 <u>Links</u>					
Bore Hole ID:	1004152215			Tag No:	A134668
Depth M:	30.48			Contractor:	2558

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Year Completed:		2012		Path:	718\7186867.pdf
Well Completed Dt:		2012/08/09		Latitude:	45.2926785057057
Audit No:		Z154051		Longitude:	-75.9787410494549
30	1 of 11	SW/188.9	119.9 / 3.08	6920055 Canada Inc. 1 - 144 Wescar Lane Carp ON K0A 1L0	GEN
Generator No:		ON4708737		Status:	
SIC Code:		562910		Co Admin:	
SIC Description:		Remediation Services		Choice of Contact:	
Approval Years:		07,08		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
30	2 of 11	SW/188.9	119.9 / 3.08	6920055 Canada Inc. 1 - 144 Wescar Lane Carp ON K0A 1L0	GEN
Generator No:		ON4708737		Status:	
SIC Code:		562910		Co Admin:	
SIC Description:		Remediation Services		Choice of Contact:	
Approval Years:		2009		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
30	3 of 11	SW/188.9	119.9 / 3.08	6920055 Canada Inc. 1 - 144 Wescar Lane Carp ON K0A 1L0	GEN
Generator No:		ON4708737		Status:	
SIC Code:		562910		Co Admin:	
SIC Description:		Remediation Services		Choice of Contact:	
Approval Years:		2010		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
30	4 of 11	SW/188.9	119.9 / 3.08	6920055 Canada Inc. 1 - 144 Wescar Lane Carp ON K0A 1L0	GEN
Generator No:		ON4708737		Status:	
SIC Code:		562910		Co Admin:	
SIC Description:		Remediation Services		Choice of Contact:	
Approval Years:		2011		Phone No Admin:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No: Country:				Contam. Facility: MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
30	5 of 11	SW/188.9	119.9 / 3.08	6920055 Canada Inc. 1 - 144 Wescar Lane Carp ON K0A 1L0	GEN
Generator No:		ON4708737		Status:	
SIC Code:		562910		Co Admin:	
SIC Description:		Remediation Services		Choice of Contact:	
Approval Years:		2012		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
30	6 of 11	SW/188.9	119.9 / 3.08	6920055 Canada Inc. 1 - 144 Wescar Lane Carp ON	GEN
Generator No:		ON4708737		Status:	
SIC Code:		562910		Co Admin:	
SIC Description:		REMEDICATION SERVICES		Choice of Contact:	
Approval Years:		2013		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
30	7 of 11	SW/188.9	119.9 / 3.08	6920055 Canada Inc. 1 - 144 Wescar Lane Carp ON K0A 1L0	GEN
Generator No:		ON4708737		Status:	
SIC Code:		562910		Co Admin:	
SIC Description:		REMEDICATION SERVICES		Choice of Contact:	
Approval Years:		2016		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:		Canada		MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
30	8 of 11	SW/188.9	119.9 / 3.08	6920055 Canada Inc. 1 - 144 Wescar Lane Carp ON K0A 1L0	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON4708737 SIC Code: 562910 SIC Description: REMEDIATION SERVICES Approval Years: 2015 PO Box No: Country: Canada Status: Co Admin: Donna L Salim Choice of Contact: CO_OFFICIAL Phone No Admin: 613-836-7669 Ext. Contam. Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
30	9 of 11	SW/188.9	119.9 / 3.08	6920055 Canada Inc. 1 - 144 Wescar Lane Carp ON K0A 1L0	GEN
Generator No: ON4708737 SIC Code: 562910 SIC Description: REMEDIATION SERVICES Approval Years: 2014 PO Box No: Country: Canada Status: Co Admin: Donna L Salim Choice of Contact: CO_OFFICIAL Phone No Admin: 613-836-7669 Ext. Contam. Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
30	10 of 11	SW/188.9	119.9 / 3.08	6920055 Canada Inc. 1 - 144 Wescar Lane Carp ON K0A 1L0	GEN
Generator No: ON4708737 SIC Code: SIC Description: Approval Years: As of Dec 2018 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Desc:		Pathological wastes			
30	11 of 11	SW/188.9	119.9 / 3.08	6920055 Canada Inc. 1 - 144 Wescar Lane Carp ON K0A 1L0	GEN
Generator No: ON4708737 SIC Code: SIC Description: Approval Years: As of Oct 2019 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Desc:		Pathological wastes			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
31	1 of 15	SE/197.1	117.9 / 1.08	G P SERVICE STATION MAINTENANCE 132 CARDEVCO OFF CARP ROAD C/O P.O. BOX 657 STITTSVILLE ON K0A 3G0	GEN
Generator No: ON1022601		Status:			
SIC Code: 0000		Co Admin:			
SIC Description: *** NOT DEFINED ***		Choice of Contact:			
Approval Years: 88,89,90		Phone No Admin:			
PO Box No:		Contam. Facility:			
Country:		MHSW Facility:			
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
31	2 of 15	SE/197.1	117.9 / 1.08	G.P. SERVICE STATION MAINTENANCE 132 CARDEVCO ROAD CARP ON K0A 1L0	GEN
Generator No: ON1022601		Status:			
SIC Code: 6351		Co Admin:			
SIC Description: GARAGES(GEN. REPAIR)		Choice of Contact:			
Approval Years: 92,93,97,98		Phone No Admin:			
PO Box No:		Contam. Facility:			
Country:		MHSW Facility:			
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
31	3 of 15	SE/197.1	117.9 / 1.08	G P SERVICE STATION MAINTENANCE 16-270 132 CARDEVCO OFF CARP ROAD C/O P.O. BOX 657 STITTSVILLE ON K2S 1A7	GEN
Generator No: ON1022601		Status:			
SIC Code: 6351		Co Admin:			
SIC Description: GARAGES(GEN. REPAIR)		Choice of Contact:			
Approval Years: 94,95,96		Phone No Admin:			
PO Box No:		Contam. Facility:			
Country:		MHSW Facility:			
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
31	4 of 15	SE/197.1	117.9 / 1.08	G. P. SERVICE STATION MAINTENANCE QUEENSWAY CARP INDUSTRIAL PARK 132 CARDEVCO ROAD CARP ON K0A 1L0	GEN
Generator No: ON1022601				Status:	
SIC Code: 6351				Co Admin:	
SIC Description: GARAGES(GEN. REPAIR)				Choice of Contact:	
Approval Years: 99,00,01				Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
31	5 of 15	SE/197.1	117.9 / 1.08	634833 ONTARIO INC. 132 CARDEVCO RD CARP ON K0A 1L0	GEN
Generator No: ON8749071				Status:	
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years: 04,05,06,07,08				Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
31	6 of 15	SE/197.1	117.9 / 1.08	634833 ONTARIO INC. 132 CARDEVCO RD CARP ON K0A 1L0	GEN
Generator No: ON8749071				Status:	
SIC Code: 232990				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years: 2009				Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
31	7 of 15	SE/197.1	117.9 / 1.08	634833 ONTARIO INC. 132 CARDEVCO RD CARP ON K0A 1L0	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON8749071 SIC Code: 232990 SIC Description: Approval Years: 2010 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
31	8 of 15	SE/197.1	117.9 / 1.08	634833 ONTARIO INC. 132 CARDEVCO RD CARP ON K0A 1L0	GEN
Generator No: ON8749071 SIC Code: 232990 SIC Description: Approval Years: 2011 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
31	9 of 15	SE/197.1	117.9 / 1.08	634833 ONTARIO INC. 132 CARDEVCO RD CARP ON K0A 1L0	GEN
Generator No: ON8749071 SIC Code: 232990 SIC Description: Approval Years: 2012 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
31	10 of 15	SE/197.1	117.9 / 1.08	634833 ONTARIO INC. 132 CARDEVCO RD CARP ON	GEN
Generator No: ON8749071 SIC Code: 232990 SIC Description: ALL OTHER SPECIAL TRADE CONTRACTING Approval Years: 2013 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		252			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
31	11 of 15	SE/197.1	117.9 / 1.08	1850795 Ontario Inc. 132 CARDEVCO RD CARP ON K0A 1L0	GEN
Generator No:		ON8749071		Status:	
SIC Code:		232990		Co Admin: Debbie Dodge	
SIC Description:		ALL OTHER SPECIAL TRADE CONTRACTING		Choice of Contact: CO_ADMIN	
Approval Years:		2016		Phone No Admin: 613-831-1088 Ext.400	
PO Box No:				Contam. Facility: No	
Country:		Canada		MHSW Facility: No	
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
31	12 of 15	SE/197.1	117.9 / 1.08	1850795 Ontario Inc. 132 CARDEVCO RD CARP ON K0A 1L0	GEN
Generator No:		ON8749071		Status:	
SIC Code:		232990		Co Admin: Debbie Dodge	
SIC Description:		ALL OTHER SPECIAL TRADE CONTRACTING		Choice of Contact: CO_ADMIN	
Approval Years:		2015		Phone No Admin: 613-831-1088 Ext.400	
PO Box No:				Contam. Facility: No	
Country:		Canada		MHSW Facility: No	
<u>Detail(s)</u>					
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
31	13 of 15	SE/197.1	117.9 / 1.08	1850795 Ontario Inc. 132 CARDEVCO RD CARP ON K0A 1L0	GEN
Generator No:		ON8749071		Status:	
SIC Code:		232990		Co Admin: Susan Grant	
SIC Description:		ALL OTHER SPECIAL TRADE CONTRACTING		Choice of Contact: CO_ADMIN	
Approval Years:		2014		Phone No Admin: 613-831-1088 Ext.400	
PO Box No:				Contam. Facility: No	
Country:		Canada		MHSW Facility: No	
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Desc:		221 LIGHT FUELS			
31	14 of 15	SE/197.1	117.9 / 1.08	1850795 Ontario Inc. 132 CARDEVCO RD CARP ON K0A 1L0	GEN
Generator No: ON8749071 SIC Code: SIC Description: Approval Years: PO Box No: Country: Canada			Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:		
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:		221 I Light fuels			
Waste Class: Waste Class Desc:		221 L Light fuels			
Waste Class: Waste Class Desc:		252 L Waste crankcase oils and lubricants			
31	15 of 15	SE/197.1	117.9 / 1.08	Tarstone Canada Limited 132 Cardevco Road Carp ON K0A1L0	GEN
Generator No: ON4183552 SIC Code: SIC Description: Approval Years: PO Box No: Country: Canada			Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:		
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:		252 L Waste crankcase oils and lubricants			
32	1 of 3	WSW/197.3	119.9 / 3.08	NU-TEK SIGNS INC. 162 WESCAR LANE CARP ON K0A 1L0	GEN
Generator No: ON2137000 SIC Code: 3971 SIC Description: SIGN & DISPLAY IND. Approval Years: 96,97,98,99,00,01 PO Box No: Country:			Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:		
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:		211 AROMATIC SOLVENTS			
32	2 of 3	WSW/197.3	119.9 / 3.08	162 Wescar Lane Carp ON K0A 1L0	EHS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Order No: 21041600030 Status: C Report Type: Standard Report Report Date: 21-APR-21 Date Received: 16-APR-21 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.9807573 Y: 45.2934901					
32	3 of 3	WSW/197.3	119.9 / 3.08	162 Wescar Lane Carp ON K0A 1L0	EHS
Order No: 21041600030 Status: C Report Type: Standard Report Report Date: 21-APR-21 Date Received: 16-APR-21 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.9807573 Y: 45.2934901					
33	1 of 1	WNW/198.3	119.9 / 3.08	171 CARDENCO lot 6 con 3 CARP ON	WWIS
Well ID: 7191739 Construction Date: Use 1st: Commerical Use 2nd: Final Well Status: Water Supply Water Type: Casing Material: Audit No: Z149101 Tag: A129749 Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: HUNTLEY TOWNSHIP Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 20-Nov-2012 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 4875 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: 006 Concession: 03 Concession Name: CON Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): Additional Detail(s) (Map) Well Completed Date: 2012/10/24 Year Completed: 2012 Depth (m): 27.45 Latitude: 45.2950004922099 Longitude: -75.9808853258624 Path:					
Bore Hole Information Bore Hole ID: 1004207214 DP2BR:					
Elevation: Elevrc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Spatial Status:				Zone:	18
Code OB:				East83:	423089.00
Code OB Desc:				North83:	5016190.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	24-Oct-2012 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004533196			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		01			
Mat2 Desc:		FILL			
Mat3:		05			
Mat3 Desc:		CLAY			
Formation Top Depth:		0.0			
Formation End Depth:		0.9200000166893005			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004533197			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		13			
Mat2 Desc:		BOULDERS			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.9200000166893005			
Formation End Depth:		2.440000057220459			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004533198			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		13			
Mat2 Desc:		BOULDERS			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		2.440000057220459			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:		5.179999828338623			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004533199			
Layer:		4			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		5.179999828338623			
Formation End Depth:		27.450000762939453			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004533235			
Layer:		1			
Plug From:		0.0			
Plug To:		6.400000095367432			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1004533234			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1004533194			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1004533205			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		-0.9200000166893005			
Depth To:		6.400000095367432			
Casing Diameter:		15.880000114440918			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1004533206			
Layer:					
Slot:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Top Depth: Screen End Depth: Screen Material: Screen Depth UOM: m Screen Diameter UOM: cm Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc: Pump Test ID: 1004533195 Pump Set At: 12.199999809265137 Static Level: 2.490000009536743 Final Level After Pumping: 2.559999942779541 Recommended Pump Depth: 12.199999809265137 Pumping Rate: 45.0 Flowing Rate: Recommended Pump Rate: 45.0 Levels UOM: m Rate UOM: LPM Water State After Test Code: 3 Water State After Test: OTHER Pumping Test Method: 0 Pumping Duration HR: 1 Pumping Duration MIN: Flowing: No					
<u>Draw Down & Recovery</u>					
Pump Test Detail ID: 1004533209 Test Type: Draw Down Test Duration: 2 Test Level: 2.5399999618530273 Test Level UOM: m					
<u>Draw Down & Recovery</u>					
Pump Test Detail ID: 1004533210 Test Type: Recovery Test Duration: 2 Test Level: 2.5199999809265137 Test Level UOM: m					
<u>Draw Down & Recovery</u>					
Pump Test Detail ID: 1004533224 Test Type: Recovery Test Duration: 25 Test Level: 2.5 Test Level UOM: m					
<u>Draw Down & Recovery</u>					
Pump Test Detail ID: 1004533213 Test Type: Draw Down Test Duration: 4 Test Level: 2.559999942779541 Test Level UOM: m					
<u>Draw Down & Recovery</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pump Test Detail ID:		1004533216			
Test Type:		Recovery			
Test Duration:		5			
Test Level:		2.5199999809265137			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004533222			
Test Type:		Recovery			
Test Duration:		20			
Test Level:		2.5			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004533219			
Test Type:		Draw Down			
Test Duration:		15			
Test Level:		2.5299999713897705			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004533214			
Test Type:		Recovery			
Test Duration:		4			
Test Level:		2.5199999809265137			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004533227			
Test Type:		Draw Down			
Test Duration:		40			
Test Level:		2.559999942779541			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004533228			
Test Type:		Recovery			
Test Duration:		40			
Test Level:		2.490000009536743			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004533230			
Test Type:		Recovery			
Test Duration:		50			
Test Level:		2.490000009536743			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004533208			
Test Type:		Recovery			
Test Duration:		1			
Test Level:		2.5199999809265137			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004533211			
Test Type:		Draw Down			
Test Duration:		3			
Test Level:		2.549999952316284			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004533215			
Test Type:		Draw Down			
Test Duration:		5			
Test Level:		2.5299999713897705			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004533218			
Test Type:		Recovery			
Test Duration:		10			
Test Level:		2.509999990463257			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004533225			
Test Type:		Draw Down			
Test Duration:		30			
Test Level:		2.5299999713897705			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004533220			
Test Type:		Recovery			
Test Duration:		15			
Test Level:		2.509999990463257			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004533226			
Test Type:		Recovery			
Test Duration:		30			
Test Level:		2.490000009536743			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004533212			
Test Type:		Recovery			
Test Duration:		3			
Test Level:		2.5199999809265137			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pump Test Detail ID:		1004533223			
Test Type:		Draw Down			
Test Duration:		25			
Test Level:		2.5299999713897705			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004533231			
Test Type:		Draw Down			
Test Duration:		60			
Test Level:		2.559999942779541			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004533207			
Test Type:		Draw Down			
Test Duration:		1			
Test Level:		2.5299999713897705			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004533217			
Test Type:		Draw Down			
Test Duration:		10			
Test Level:		2.5299999713897705			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004533221			
Test Type:		Draw Down			
Test Duration:		20			
Test Level:		2.5299999713897705			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004533229			
Test Type:		Draw Down			
Test Duration:		50			
Test Level:		2.559999942779541			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1004533232			
Test Type:		Recovery			
Test Duration:		60			
Test Level:		2.490000009536743			
Test Level UOM:		m			
 <u>Water Details</u>					
Water ID:		1004533203			
Layer:		2			
Kind Code:		8			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Kind:		Untested			
Water Found Depth:		18.899999618530273			
Water Found Depth UOM:		m			
 <u>Water Details</u>					
Water ID:		1004533202			
Layer:		1			
Kind Code:		3			
Kind:		SULPHUR			
Water Found Depth:		12.5			
Water Found Depth UOM:		m			
 <u>Water Details</u>					
Water ID:		1004533204			
Layer:		3			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		24.100000381469727			
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1004533201			
Diameter:		15.239999771118164			
Depth From:		6.400000095367432			
Depth To:		27.450000762939453			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		1004533200			
Diameter:		22.860000610351562			
Depth From:		0.0			
Depth To:		5.400000095367432			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Links</u>					
Bore Hole ID:	1004207214			Tag No:	A129749
Depth M:	27.45			Contractor:	4875
Year Completed:	2012			Path:	
Well Completed Dt:	2012/10/24			Latitude:	45.2950004922099
Audit No:	Z149101			Longitude:	-75.9808853258624
34	1 of 1	ESE/199.9	117.9 / 1.12	128 Cardevco Rd Carp ON	WWIS
Well ID:	7344968			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	09-Oct-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z317325			Contractor:	7241
Tag:	A274753			Form Version:	7
Constructn Method:				Owner:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:				County: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	OTTAWA-CARLETON
HUNTLEY TOWNSHIP					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2019/08/28			
Year Completed:		2019			
Depth (m):		4.57			
Latitude:		45.2932467258327			
Longitude:		-75.9765062733899			
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:		1007688859		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	423430.00
Code OB Desc:				North83:	5015991.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		28-Aug-2019 00:00:00		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007880640			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		18			
Mat2 Desc:		SANDSTONE			
Mat3:		74			
Mat3 Desc:		LAYERED			
Formation Top Depth:		0.9100000262260437			
Formation End Depth:		4.570000171661377			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007880638			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Color:		2			
General Color:		GREY			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		12			
Mat2 Desc:		STONES			
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007880639			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		12			
Mat2 Desc:		STONES			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		0.9100000262260437			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007882151			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007882153			
Layer:		3			
Plug From:		1.2200000286102295			
Plug To:		4.570000171661377			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007882152			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.2200000286102295			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1007884055			
Method Construction Code:		5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007879200			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007884753			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.5199999809265137			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007885333			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.5199999809265137			
Screen End Depth:		4.570000171661377			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007886099			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007883348			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:					
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1007883349			
Diameter:		7.619999885559082			
Depth From:					
Depth To:		4.570000171661377			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	1007688859			Tag No:	A274753
Depth M:	4.57			Contractor:	7241
Year Completed:	2019			Path:	
Well Completed Dt:	2019/08/28			Latitude:	45.2932467258327
Audit No:	Z317325			Longitude:	-75.9765062733899
35	1 of 1	SSE/202.2	118.9 / 2.08	ONTRAC EQUIPMENT SERVICES 139 CARDEVCO ROAD CARP ON K0A 1L0	GEN
Generator No:	ON2158207			Status:	
SIC Code:	3192			Co Admin:	
SIC Description:	CONSTRUCTION EQUIP.			Choice of Contact:	
Approval Years:	98,99			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:	212				
Waste Class Desc:	ALIPHATIC SOLVENTS				
Waste Class:	213				
Waste Class Desc:	PETROLEUM DISTILLATES				
Waste Class:	221				
Waste Class Desc:	LIGHT FUELS				
Waste Class:	252				
Waste Class Desc:	WASTE OILS & LUBRICANTS				
36	1 of 1	SSW/202.4	119.9 / 3.08	132 WESCAR LANE lot 6 con 3 CARP ON	WWIS
Well ID:	1536824			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Domestic			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Water Supply			Date Received:	17-Nov-2006 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z47066			Contractor:	1558
Tag:	A041980			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	006
Depth to Bedrock:				Concession:	03
Well Depth:				Concession Name:	CON
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Static Water Level: Clear/Cloudy: Municipality: Site Info:			Zone: UTM Reliability:		
HUNTLEY TOWNSHIP					
PDF URL (Map):			https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/153\1536824.pdf		
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:			2006/08/30		
Year Completed:			2006		
Depth (m):			52.72		
Latitude:			45.2925925854696		
Longitude:			-75.9793134556728		
Path:			153\1536824.pdf		
<u>Bore Hole Information</u>					
Bore Hole ID:			11691918		
DP2BR:			Elevation:		
Spatial Status:			Elevrc:		
Code OB:			Zone:		
Code OB Desc:			East83:		
Open Hole:			North83:		
Cluster Kind:			Org CS:		
Date Completed:			UTMRC:		
Remarks:			UTMRC Desc:		
Loc Method Desc:			Location Method:		
Elevrc Desc:			18		
Location Source Date:			423209.00		
Improvement Location Source:			5015921.00		
Improvement Location Method:			UTM83		
Source Revision Comment:			3		
Supplier Comment:			margin of error : 10 - 30 m		
			wwr		
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:			933071033		
Layer:			3		
Color:			2		
General Color:			GREY		
Mat1:			15		
Most Common Material:			LIMESTONE		
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:			7.309999942779541		
Formation End Depth:			52.720001220703125		
Formation End Depth UOM:			m		
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:			933071032		
Layer:			2		
Color:			2		
General Color:			GREY		
Mat1:			05		
Most Common Material:			CLAY		
Mat2:			81		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat2 Desc:		SANDY			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		3.6500000953674316			
Formation End Depth:		7.309999942779541			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933071031			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		81			
Mat2 Desc:		SANDY			
Mat3:		12			
Mat3 Desc:		STONES			
Formation Top Depth:		0.0			
Formation End Depth:		3.6500000953674316			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933286615			
Layer:		1			
Plug From:		8.220000267028809			
Plug To:		0.0			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		961536824			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11696784			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930873873			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		8.220000267028809			
Depth To:		52.720001220703125			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing ID:		930873872			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		-0.44999998807907104			
Depth To:		8.220000267028809			
Casing Diameter:		15.859999656677246			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Results of Well Yield Testing</u>					
 <u>Pumping Test Method Desc:</u>					
Pump Test ID:		11701494			
Pump Set At:		45.709999084472656			
Static Level:		4.489999771118164			
Final Level After Pumping:		19.010000228881836			
Recommended Pump Depth:		30.469999313354492			
Pumping Rate:		40.95000076293945			
Flowing Rate:					
Recommended Pump Rate:		40.95000076293945			
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:					
Pumping Duration HR:		3			
Pumping Duration MIN:		0			
Flowing:					
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11738004			
Test Type:		Recovery			
Test Duration:		3			
Test Level:		11.40999984741211			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11738002			
Test Type:		Recovery			
Test Duration:		2			
Test Level:		13.0600004196167			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11738005			
Test Type:		Draw Down			
Test Duration:		4			
Test Level:		10.300000190734863			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11738020			
Test Type:		Recovery			
Test Duration:		40			
Test Level:		5.190000057220459			
Test Level UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11738021			
Test Type:		Draw Down			
Test Duration:		50			
Test Level:		17.5			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11738001			
Test Type:		Draw Down			
Test Duration:		2			
Test Level:		8.109999656677246			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11738003			
Test Type:		Draw Down			
Test Duration:		3			
Test Level:		9.270000457763672			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11738009			
Test Type:		Draw Down			
Test Duration:		10			
Test Level:		14.5			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11738023			
Test Type:		Draw Down			
Test Duration:		60			
Test Level:		17.6299991607666			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11737999			
Test Type:		Draw Down			
Test Duration:		1			
Test Level:		6.690000057220459			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11738006			
Test Type:		Recovery			
Test Duration:		4			
Test Level:		10.369999885559082			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pump Test Detail ID:		11738008			
Test Type:		Recovery			
Test Duration:		5			
Test Level:		9.5600004196167			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11738014			
Test Type:		Recovery			
Test Duration:		20			
Test Level:		5.46999979019165			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11738022			
Test Type:		Recovery			
Test Duration:		50			
Test Level:		5.170000076293945			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11738010			
Test Type:		Recovery			
Test Duration:		10			
Test Level:		6.880000114440918			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11738011			
Test Type:		Draw Down			
Test Duration:		15			
Test Level:		15.720000267028809			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11738015			
Test Type:		Draw Down			
Test Duration:		25			
Test Level:		16.56999969482422			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11738016			
Test Type:		Recovery			
Test Duration:		25			
Test Level:		5.340000152587891			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11738017			
Test Type:		Draw Down			
Test Duration:		30			
Test Level:		16.719999313354492			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11738024			
Test Type:		Recovery			
Test Duration:		60			
Test Level:		5.170000076293945			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11738000			
Test Type:		Recovery			
Test Duration:		1			
Test Level:		15.1899995803833			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11738007			
Test Type:		Draw Down			
Test Duration:		5			
Test Level:		11.210000038146973			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11738012			
Test Type:		Recovery			
Test Duration:		15			
Test Level:		5.829999923706055			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11738013			
Test Type:		Draw Down			
Test Duration:		20			
Test Level:		16.329999923706055			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11738018			
Test Type:		Recovery			
Test Duration:		30			
Test Level:		5.25			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11738019			
Test Type:		Draw Down			
Test Duration:		40			
Test Level:		16.8799991607666			
Test Level UOM:		m			
<u>Water Details</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water ID:		934070908			
Layer:		1			
Kind Code:					
Kind:					
Water Found Depth:		50.59000015258789			
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		11755508			
Diameter:		15.229999542236328			
Depth From:		8.220000267028809			
Depth To:		52.720001220703125			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		11755509			
Diameter:		22.75			
Depth From:		0.0			
Depth To:		8.220000267028809			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Links</u>					
Bore Hole ID:	11691918			Tag No:	A041980
Depth M:	52.72			Contractor:	1558
Year Completed:	2006			Path:	153\1536824.pdf
Well Completed Dt:	2006/08/30			Latitude:	45.2925925854696
Audit No:	Z47066			Longitude:	-75.9793134556728
37	1 of 3	W/214.8	119.9 / 3.08	ALLEREX LABORATORY LTD. 180 WESCAR DRIVE CARP ON K0A 2N0	GEN
Generator No:	ON2499700			Status:	
SIC Code:	8681			Co Admin:	
SIC Description:	MEDICAL LABORATORIES			Choice of Contact:	
Approval Years:	99,00,01			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
 <u>Detail(s)</u>					
Waste Class:	312				
Waste Class Desc:	PATHOLOGICAL WASTES				
37	2 of 3	W/214.8	119.9 / 3.08	ServiceMaster Ottawa DR 180 Wescar Lane Ottawa ON K0A1L0	GEN
Generator No:	ON6914720			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Nov 2021			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Desc:		Pathological wastes			
37	3 of 3	W/214.8	119.9 / 3.08	Service Master Ottawa 180 Wescar Lane Ottawa ON KOA1LO	GEN
Generator No:	ON9012557			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Apr 2022			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Desc:		PATHOLOGICAL WASTES			
38	1 of 1	SE/215.2	117.9 / 1.08	100 CARDEVCO RD CARP ON	WWIS
Well ID:	7335299			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:	Monitoring			Data Src:	
Final Well Status:	Test Hole			Date Received:	08-Mar-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z302863			Contractor:	7241
Tag:	A261082			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		HUNTLEY TOWNSHIP			
Site Info:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2019/01/17				
Year Completed:	2019				
Depth (m):	3.35				
Latitude:	45.2926468261661				
Longitude:	-75.9771846391588				
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1007485252			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB:				East83:	423376.00
Code OB Desc:				North83:	5015925.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	17-Jan-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007733593			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		18			
Most Common Material:		SANDSTONE			
Mat2:					
Mat2 Desc:					
Mat3:		74			
Mat3 Desc:		LAYERED			
Formation Top Depth:		1.2200000286102295			
Formation End Depth:		3.3499999046325684			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007733591			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		02			
Most Common Material:		TOPSOIL			
Mat2:					
Mat2 Desc:					
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007733592			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		1.2200000286102295			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007733604			
Layer:		3			
Plug From:		1.6200000047683716			
Plug To:		3.3499999046325684			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007733603			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.6799999475479126			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007733602			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007733601			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007733590			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007733597			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.8300000429153442			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007733598			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Slot:		10			
Screen Top Depth:		1.8300000429153442			
Screen End Depth:		3.3499999046325684			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
 <u>Water Details</u>					
Water ID:		1007733596			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1007733595			
Diameter:		7.619999885559082			
Depth From:		2.130000114440918			
Depth To:		3.3499999046325684			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		1007733594			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		2.130000114440918			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Links</u>					
Bore Hole ID:	1007485252			Tag No:	A261082
Depth M:	3.35			Contractor:	7241
Year Completed:	2019			Path:	733\7335299.pdf
Well Completed Dt:	2019/01/17			Latitude:	45.2926468261661
Audit No:	Z302863			Longitude:	-75.9771846391588

39	1 of 2	SSW/216.4	119.9 / 3.08	1649174 Ontario Inc. 132 Wescar Lane Ottawa ON	CA
Certificate #:	1511-6S2KLS				
Application Year:	2006				
Issue Date:	7/28/2006				
Approval Type:	Municipal and Private Sewage Works				
Status:	Approved				
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
39	2 of 2	SSW/216.4	119.9 / 3.08	1649174 Ontario Inc. 132 Wescar Lane Ottawa ON K0A 1L0	ECA
Approval No: 1511-6S2KLS Approval Date: 2006-07-28 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS Business Name: 1649174 Ontario Inc. Address: 132 Wescar Lane Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/8224-6PAQXM-14.pdf PDF Site Location: MOE District: City: Longitude: Latitude: Geometry X: Geometry Y:					
40	1 of 1	SSE/222.7	119.0 / 2.17	Akman Construction Inc. 123 Cardevco Rd Carp ON K0A 1L0	GEN
Generator No: ON5186787 SIC Code: SIC Description: Approval Years: As of Apr 2022 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 252 L Waste Class Desc: WASTE OILS & LUBRICANTS					
41	1 of 1	ESE/222.9	116.8 / 0.00	100 CARDWCO RD CARP ON	WWIS
Well ID: 7335296 Construction Date: Use 1st: Test Hole Use 2nd: Monitoring Final Well Status: Test Hole Water Type: Casing Material: Audit No: Z298199 Tag: A261078 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: HUNTLEY TOWNSHIP Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 08-Mar-2019 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Completed Date: 2019/01/16 Year Completed: 2019 Depth (m): 3.1 Latitude: 45.2931681227322 Longitude: -75.9762243558726 Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1007485218			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	423452.00
Code OB Desc:				North83:	5015982.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	16-Jan-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1007733563				
Layer:	3				
Color:	2				
General Color:	GREY				
Mat1:	18				
Most Common Material:	SANDSTONE				
Mat2:					
Mat2 Desc:					
Mat3:	74				
Mat3 Desc:	LAYERED				
Formation Top Depth:	0.6100000143051147				
Formation End Depth:	3.0999999046325684				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1007733562				
Layer:	2				
Color:	6				
General Color:	BROWN				
Mat1:	28				
Most Common Material:	SAND				
Mat2:	11				
Mat2 Desc:	GRAVEL				
Mat3:	85				
Mat3 Desc:	SOFT				
Formation Top Depth:	0.3100000023841858				
Formation End Depth:	0.6100000143051147				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:		1007733561			
Layer:		1			
Color:		2			
General Color:		GREY			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007733572			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007733573			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.22000000286102295			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007733574			
Layer:		3			
Plug From:		1.22000000286102295			
Plug To:		3.0999999046325684			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007733571			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007733560			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007733567			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:					
		1			
Material:					
		5			
Open Hole or Material:					
		PLASTIC			
Depth From:					
		0.0			
Depth To:					
		1.5199999809265137			
Casing Diameter:					
		5.199999809265137			
Casing Diameter UOM:					
		cm			
Casing Depth UOM:					
		m			
<u>Construction Record - Screen</u>					
Screen ID:					
		1007733568			
Layer:					
		1			
Slot:					
		10			
Screen Top Depth:					
		1.5199999809265137			
Screen End Depth:					
		3.0999999046325684			
Screen Material:					
		5			
Screen Depth UOM:					
		m			
Screen Diameter UOM:					
		cm			
Screen Diameter:					
		6.03000020980835			
<u>Water Details</u>					
Water ID:					
		1007733566			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:					
		m			
<u>Hole Diameter</u>					
Hole ID:					
		1007733564			
Diameter:					
		11.430000305175781			
Depth From:					
		0.0			
Depth To:					
		0.6100000143051147			
Hole Depth UOM:					
		m			
Hole Diameter UOM:					
		cm			
<u>Hole Diameter</u>					
Hole ID:					
		1007733565			
Diameter:					
		7.619999885559082			
Depth From:					
		0.6100000143051147			
Depth To:					
		3.0999999046325684			
Hole Depth UOM:					
		m			
Hole Diameter UOM:					
		cm			
<u>Links</u>					
Bore Hole ID:					
		1007485218		Tag No:	A261078
Depth M:					
		3.1		Contractor:	7241
Year Completed:					
		2019		Path:	733\7335296.pdf
Well Completed Dt:					
		2019/01/16		Latitude:	45.2931681227322
Audit No:					
		Z298199		Longitude:	-75.9762243558726
42	1 of 18	SE/224.1	117.9 / 1.14	CHARTERWAYS CANADIAN DIVISION 100 CARDEVCO DRIVE CARP ON K0A 1L0	GEN
Generator No:					
		ON0053640		Status:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Code: 4574 SIC Description: CHART./SIGHTSEEING Approval Years: 95,96,97 PO Box No: Country:					
Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 212 Waste Class Desc: ALIPHATIC SOLVENTS					
Waste Class: 213 Waste Class Desc: PETROLEUM DISTILLATES					
Waste Class: 251 Waste Class Desc: OIL SKIMMINGS & SLUDGES					
Waste Class: 252 Waste Class Desc: WASTE OILS & LUBRICANTS					
42	2 of 18	SE/224.1	117.9 / 1.14	LAIDLAW TRANSIT LIMITED 100 CARDEVCO DRIVE CARP ON K0A 1L0	GEN
Generator No: ON0053640 SIC Code: 4574 SIC Description: CHART./SIGHTSEEING Approval Years: 98,99,00,01,02,03,04,05,06 PO Box No: Country:					
Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 212 Waste Class Desc: ALIPHATIC SOLVENTS					
Waste Class: 213 Waste Class Desc: PETROLEUM DISTILLATES					
Waste Class: 221 Waste Class Desc: LIGHT FUELS					
Waste Class: 251 Waste Class Desc: OIL SKIMMINGS & SLUDGES					
Waste Class: 252 Waste Class Desc: WASTE OILS & LUBRICANTS					
42	3 of 18	SE/224.1	117.9 / 1.14	LAIDLAW EDUCATION SERVICES 100 CARDEVCO RD BOX 159 STITTSVILLE ON	FSTH
License Issue Date: 7/6/2000 Tank Status: Licensed Tank Status As Of: August 2007 Operation Type: Private Fuel Outlet Facility Type: Gasoline Station - Self Serve					
<u>--Details--</u>					
Status: Active Year of Installation: 1985 Corrosion Protection:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Capacity:		35000			
Tank Fuel Type:		Liquid Fuel Single Wall AST - Diesel			
42	4 of 18	SE/224.1	117.9 / 1.14	LAILAW EDUCATION SERVICES 100 CARDEVCO RD CARP ON K0A 1L0	FSTH
License Issue Date:		7/6/2000			
Tank Status:		Licensed			
Tank Status As Of:		December 2008			
Operation Type:		Private Fuel Outlet			
Facility Type:		Gasoline Station - Self Serve			
--Details--					
Status:		Active			
Year of Installation:		1985			
Corrosion Protection:					
Capacity:		35000			
Tank Fuel Type:		Liquid Fuel Single Wall AST - Diesel			
42	5 of 18	SE/224.1	117.9 / 1.14	FirstCanada ULC 100 CARDEVCO DRIVE CARP ON K0A 1L0	GEN
Generator No:		ON0053640		Status:	
SIC Code:		485410		Co Admin:	
SIC Description:		School and Employee Bus Transportation		Choice of Contact:	
Approval Years:		07,08		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
42	6 of 18	SE/224.1	117.9 / 1.14	FirstCanada ULC 100 CARDEVCO DRIVE CARP ON K0A 1L0	GEN
Generator No:		ON0053640		Status:	
SIC Code:		485410		Co Admin:	
SIC Description:		School and Employee Bus Transportation		Choice of Contact:	
Approval Years:		2009		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
42	7 of 18	SE/224.1	117.9 / 1.14	FirstCanada ULC 100 CARDEVCO DRIVE CARP ON K0A 1L0	GEN
Generator No:	ON0053640			Status:	
SIC Code:	485410			Co Admin:	
SIC Description:	School and Employee Bus Transportation			Choice of Contact:	
Approval Years:	2010			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
42	8 of 18	SE/224.1	117.9 / 1.14	FirstCanada ULC 100 CARDEVCO DRIVE CARP ON K0A 1L0	GEN
Generator No:	ON0053640			Status:	
SIC Code:	485410			Co Admin:	
SIC Description:	School and Employee Bus Transportation			Choice of Contact:	
Approval Years:	2011			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Desc: 212 ALIPHATIC SOLVENTS Waste Class: Waste Class Desc: 251 OIL SKIMMINGS & SLUDGES Waste Class: Waste Class Desc: 252 WASTE OILS & LUBRICANTS					
42	9 of 18	SE/224.1	117.9 / 1.14	FirstCanada ULC 100 CARDEVCO DRIVE CARP ON K0A 1L0	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: ON0053640 485410 School and Employee Bus Transportation 2012 Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: Waste Class Desc: 252 WASTE OILS & LUBRICANTS Waste Class: Waste Class Desc: 251 OIL SKIMMINGS & SLUDGES Waste Class: Waste Class Desc: 213 PETROLEUM DISTILLATES Waste Class: Waste Class Desc: 212 ALIPHATIC SOLVENTS Waste Class: Waste Class Desc: 221 LIGHT FUELS					
42	10 of 18	SE/224.1	117.9 / 1.14	FirstCanada ULC 100 CARDEVCO DRIVE CARP ON	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: ON0053640 485410 2013 Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: Waste Class Desc: 252 WASTE OILS & LUBRICANTS Waste Class: Waste Class Desc: 251 OIL SKIMMINGS & SLUDGES Waste Class: Waste Class Desc: 221 LIGHT FUELS Waste Class: Waste Class Desc: 212 ALIPHATIC SOLVENTS					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
42	11 of 18	SE/224.1	117.9 / 1.14	Voyageur Transportation Services 100 Cardeveo Road Ottawa ON K0A 1L0	GEN
Generator No:		ON8587989		Status:	
SIC Code:		415210		Co Admin:	
SIC Description:		TIRE WHOLESALER-DISTRIBUTORS		Choice of Contact:	
Approval Years:		2016		CO_OFFICIAL	
PO Box No:				Phone No Admin:	
Country:		Canada		Contam. Facility:	
				MHSW Facility:	
				No	
				No	
<u>Detail(s)</u>					
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
42	12 of 18	SE/224.1	117.9 / 1.14	Voyageur Transportation Services 100 Cardeveo Road Ottawa ON K0A 1L0	GEN
Generator No:		ON8587989		Status:	
SIC Code:		415210		Co Admin:	
SIC Description:		TIRE WHOLESALER-DISTRIBUTORS		Choice of Contact:	
Approval Years:		2015		CO_OFFICIAL	
PO Box No:				Phone No Admin:	
Country:		Canada		Contam. Facility:	
				MHSW Facility:	
				No	
				No	
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
42	13 of 18	SE/224.1	117.9 / 1.14	FirstCanada ULC 100 CARDEVCO DRIVE CARP ON K0A 1L0	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON0053640 SIC Code: 485410 SIC Description: 485410 Approval Years: 2015 PO Box No: Country: Canada Status: Co Admin: JENNIFER FORTUNA Choice of Contact: CO_ADMIN Phone No Admin: 289-288-4359 Ext.243 Contam. Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 251 Waste Class Desc: OIL SKIMMINGS & SLUDGES Waste Class: 221 Waste Class Desc: LIGHT FUELS Waste Class: 212 Waste Class Desc: ALIPHATIC SOLVENTS Waste Class: 252 Waste Class Desc: WASTE OILS & LUBRICANTS Waste Class: 213 Waste Class Desc: PETROLEUM DISTILLATES					
42	14 of 18	SE/224.1	117.9 / 1.14	FirstCanada ULC 100 CARDEVCO DRIVE CARP ON K0A 1L0	GEN
Generator No: ON0053640 SIC Code: 485410 SIC Description: 485410 Approval Years: 2014 PO Box No: Country: Canada Status: Co Admin: JENNIFER FORTUNA Choice of Contact: CO_ADMIN Phone No Admin: 289-288-4359 Ext.243 Contam. Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 251 Waste Class Desc: OIL SKIMMINGS & SLUDGES Waste Class: 252 Waste Class Desc: WASTE OILS & LUBRICANTS Waste Class: 221 Waste Class Desc: LIGHT FUELS Waste Class: 212 Waste Class Desc: ALIPHATIC SOLVENTS Waste Class: 213 Waste Class Desc: PETROLEUM DISTILLATES					
42	15 of 18	SE/224.1	117.9 / 1.14	Voyageur Transportation Services 100 Cardeveo Road Ottawa ON K0A 1L0	GEN
Generator No: ON8587989 SIC Code: SIC Description: Approval Years: As of Dec 2018 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		212 L			
Waste Class Desc:		Aliphatic solvents and residues			
Waste Class:		213 I			
Waste Class Desc:		Petroleum distillates			
Waste Class:		221 I			
Waste Class Desc:		Light fuels			
Waste Class:		251 L			
Waste Class Desc:		Waste oils/sludges (petroleum based)			
Waste Class:		252 L			
Waste Class Desc:		Waste crankcase oils and lubricants			
42	16 of 18	SE/224.1	117.9 / 1.14	100 Cardevco Road Carp ON K0A 1L0	EHS
Order No:	20181221021			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	31-DEC-18			Search Radius (km):	.25
Date Received:	21-DEC-18			X:	-75.976713
Previous Site Name:				Y:	45.292781
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans				
42	17 of 18	SE/224.1	117.9 / 1.14	947465 Ontario Ltd 100 Cardevco Road Ottawa ON K0A 1L0	GEN
Generator No:	ON8587989			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Jul 2020			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		212 L			
Waste Class Desc:		Aliphatic solvents and residues			
Waste Class:		221 I			
Waste Class Desc:		Light fuels			
Waste Class:		252 L			
Waste Class Desc:		Waste crankcase oils and lubricants			
Waste Class:		213 I			
Waste Class Desc:		Petroleum distillates			
Waste Class:		251 L			
Waste Class Desc:		Waste oils/sludges (petroleum based)			
42	18 of 18	SE/224.1	117.9 / 1.14	947465 Ontario Ltd 100 Cardevco Road Ottawa ON K0A 1L0	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
44	1 of 1	ESE/238.1	116.8 / 0.06	100 CARDEYCA RD CARP ON	WWIS
Well ID: 7335295		Flowing (Y/N):			
Construction Date:		Flow Rate:			
Use 1st: Test Hole		Data Entry Status:			
Use 2nd: Monitoring		Data Src:			
Final Well Status: Test Hole		Date Received: 08-Mar-2019 00:00:00			
Water Type:		Selected Flag: TRUE			
Casing Material:		Abandonment Rec:			
Audit No: Z229576		Contractor: 7241			
Tag: A261077		Form Version: 7			
Constructn Method:		Owner:			
Elevation (m):		County: OTTAWA-CARLETON			
Elevatn Reliabilty:		Lot:			
Depth to Bedrock:		Concession:			
Well Depth:		Concession Name:			
Overburden/Bedrock:		Easting NAD83:			
Pump Rate:		Northing NAD83:			
Static Water Level:		Zone:			
Clear/Cloudy:		UTM Reliability:			
Municipality: HUNTLEY TOWNSHIP					
Site Info:					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date: 2019/01/16					
Year Completed: 2019					
Depth (m): 6.1					
Latitude: 45.2928975730971					
Longitude: -75.976283479059					
Path:					
Bore Hole Information					
Bore Hole ID: 1007485215		Elevation:			
DP2BR:		Elevrc:			
Spatial Status:		Zone: 18			
Code OB:		East83: 423447.00			
Code OB Desc:		North83: 5015952.00			
Open Hole:		Org CS: UTM83			
Cluster Kind:		UTMRC: 4			
Date Completed: 16-Jan-2019 00:00:00		UTMRC Desc: margin of error : 30 m - 100 m			
Remarks:		Location Method: wwr			
Loc Method Desc: on Water Well Record					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID: 1007733548					
Layer: 3					
Color: 2					
General Color: GREY					
Mat1: 18					
Most Common Material: SANDSTONE					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:					
74					
LAYERED					
1.2200000286102295					
6.099999904632568					
m					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:					
Layer:					
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:					
1007733547					
2					
8					
BLACK					
28					
SAND					
11					
GRAVEL					
85					
SOFT					
0.3100000023841858					
1.2200000286102295					
m					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:					
Layer:					
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:					
1007733546					
1					
8					
BLACK					
11					
GRAVEL					
28					
SAND					
66					
DENSE					
0.0					
0.3100000023841858					
m					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:					
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
1007733559					
3					
2.740000009536743					
6.099999904632568					
m					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:					
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
1007733557					
1					
0.0					
0.3100000023841858					
m					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1007733558			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007733556			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007733545			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007733552			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1007733553			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		6.099999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
 <u>Water Details</u>					
Water ID:		1007733551			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1007733549			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		1.2200000286102295			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1007733550			
Diameter:		7.619999885559082			
Depth From:		1.2200000286102295			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	1007485215			Tag No:	A261077
Depth M:	6.1			Contractor:	7241
Year Completed:	2019			Path:	733\7335295.pdf
Well Completed Dt:	2019/01/16			Latitude:	45.2928975730971
Audit No:	Z229576			Longitude:	-75.976283479059

45	1 of 1	SSE/238.7	117.8 / 1.05	126 WESCAR LANE lot 10 con 24 OTTAWA ON	WWIS
Well ID:		1536876		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Commerical		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Water Supply		Date Received:	18-Dec-2006 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z71634		Contractor:	6006
Tag:		A053904		Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	010
Depth to Bedrock:				Concession:	24
Well Depth:				Concession Name:	CON
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		HUNTLEY TOWNSHIP			
Site Info:		4M-356-4R-7616			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/153\1536876.pdf			

Additional Detail(s) (Map)

Well Completed Date: 2006/11/20
 Year Completed: 2006
 Depth (m): 22.72
 Latitude: 45.2923296384885
 Longitude: -75.9774342501015
 Path: 153\1536876.pdf

Bore Hole Information

Bore Hole ID:	11691970	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	423356.00
Code OB Desc:		North83:	5015890.00

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	20-Nov-2006 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		933071178			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		11.510000228881836			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		933071179			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		73			
Mat2 Desc:		HARD			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		11.510000228881836			
Formation End Depth:		22.719999313354492			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		933286686			
Layer:		1			
Plug From:		0.0			
Plug To:		6.059999942779541			
Plug Depth UOM:		m			
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		961536876			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		11696836			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930887026			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		11.510000228881836			
Casing Diameter:		15.550000190734863			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		930887027			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		11.510000228881836			
Depth To:		22.719999313354492			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		11701532			
Pump Set At:		19.690000534057617			
Static Level:		3.4000000953674316			
Final Level After Pumping:		12.800000190734863			
Recommended Pump Depth:		19.690000534057617			
Pumping Rate:		58.5			
Flowing Rate:					
Recommended Pump Rate:		45.5			
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:		1			
Pumping Duration MIN:					
Flowing:					
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754561			
Test Type:		Recovery			
Test Duration:		1			
Test Level:		14.100000381469727			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pump Test Detail ID:		11754564			
Test Type:		Draw Down			
Test Duration:		3			
Test Level:		7.150000095367432			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754601			
Test Type:		Recovery			
Test Duration:		20			
Test Level:		3.4000000953674316			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754606			
Test Type:		Draw Down			
Test Duration:		40			
Test Level:		17.790000915527344			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754611			
Test Type:		Recovery			
Test Duration:		60			
Test Level:		3.4000000953674316			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754593			
Test Type:		Recovery			
Test Duration:		4			
Test Level:		7.559999942779541			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754594			
Test Type:		Draw Down			
Test Duration:		5			
Test Level:		8.270000457763672			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754600			
Test Type:		Draw Down			
Test Duration:		20			
Test Level:		14.40999984741211			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754607			
Test Type:		Recovery			
Test Duration:		40			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Test Level:		3.4000000953674316			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754598			
Test Type:		Draw Down			
Test Duration:		15			
Test Level:		12.3100004196167			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754599			
Test Type:		Recovery			
Test Duration:		15			
Test Level:		3.4000000953674316			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754608			
Test Type:		Draw Down			
Test Duration:		50			
Test Level:		17.799999237060547			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754604			
Test Type:		Draw Down			
Test Duration:		30			
Test Level:		17.770000457763672			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754610			
Test Type:		Draw Down			
Test Duration:		60			
Test Level:		17.799999237060547			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754562			
Test Type:		Draw Down			
Test Duration:		2			
Test Level:		6.539999961853027			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754592			
Test Type:		Draw Down			
Test Duration:		4			
Test Level:		7.28000020980835			
Test Level UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754595			
Test Type:		Recovery			
Test Duration:		5			
Test Level:		6.239999771118164			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754596			
Test Type:		Draw Down			
Test Duration:		10			
Test Level:		10.15999984741211			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754603			
Test Type:		Recovery			
Test Duration:		25			
Test Level:		3.4000000953674316			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754609			
Test Type:		Recovery			
Test Duration:		50			
Test Level:		3.4000000953674316			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754591			
Test Type:		Recovery			
Test Duration:		3			
Test Level:		9.260000228881836			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754560			
Test Type:		Draw Down			
Test Duration:		1			
Test Level:		5.239999771118164			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754563			
Test Type:		Recovery			
Test Duration:		2			
Test Level:		11.789999961853027			
Test Level UOM:		m			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754597			
Test Type:		Recovery			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Test Duration:		10			
Test Level:		4.070000171661377			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754602			
Test Type:		Draw Down			
Test Duration:		25			
Test Level:		16.200000762939453			
Test Level UOM:		m			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		11754605			
Test Type:		Recovery			
Test Duration:		30			
Test Level:		3.4000000953674316			
Test Level UOM:		m			
 <u>Water Details</u>					
Water ID:		934070963			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		10.600000381469727			
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		11755566			
Diameter:		20.31999969482422			
Depth From:		0.0			
Depth To:		6.059999942779541			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Links</u>					
Bore Hole ID:	11691970			Tag No:	A053904
Depth M:	22.72			Contractor:	6006
Year Completed:	2006			Path:	153\1536876.pdf
Well Completed Dt:	2006/11/20			Latitude:	45.2923296384885
Audit No:	Z71634			Longitude:	-75.9774342501015
46	1 of 8	SSE/239.5	118.8 / 1.96	Akman Construction Inc. 123 Cardevco Rd Carp ON	GEN
Generator No:	ON5186787			Status:	
SIC Code:	811111			Co Admin:	
SIC Description:	GENERAL AUTOMOTIVE REPAIR			Choice of Contact:	
Approval Years:	2013			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
 <u>Detail(s)</u>					
Waste Class:		252			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Desc:		WASTE OILS & LUBRICANTS			
46	2 of 8	SSE/239.5	118.8 / 1.96	Akman Construction Inc. 123 Cardevco Rd Carp ON K0A 1L0	GEN
Generator No:		ON5186787	Status:		
SIC Code:		811111	Co Admin:		Tony Saikaly
SIC Description:		GENERAL AUTOMOTIVE REPAIR	Choice of Contact:		CO_ADMIN
Approval Years:		2016	Phone No Admin:		613-836-6424 Ext.
PO Box No:			Contam. Facility:		No
Country:		Canada	MHSW Facility:		No
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
46	3 of 8	SSE/239.5	118.8 / 1.96	Akman Construction Inc. 123 Cardevco Rd Carp ON K0A 1L0	GEN
Generator No:		ON5186787	Status:		
SIC Code:		811111	Co Admin:		Tony Saikaly
SIC Description:		GENERAL AUTOMOTIVE REPAIR	Choice of Contact:		CO_ADMIN
Approval Years:		2015	Phone No Admin:		613-836-6424 Ext.
PO Box No:			Contam. Facility:		No
Country:		Canada	MHSW Facility:		No
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
46	4 of 8	SSE/239.5	118.8 / 1.96	Akman Construction Inc. 123 Cardevco Rd Carp ON K0A 1L0	GEN
Generator No:		ON5186787	Status:		
SIC Code:		811111	Co Admin:		
SIC Description:		GENERAL AUTOMOTIVE REPAIR	Choice of Contact:		CO_OFFICIAL
Approval Years:		2014	Phone No Admin:		
PO Box No:			Contam. Facility:		No
Country:		Canada	MHSW Facility:		No
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
46	5 of 8	SSE/239.5	118.8 / 1.96	Akman Construction Inc. 123 Cardevco Rd Carp ON K0A 1L0	GEN
Generator No:		ON5186787	Status:		Registered
SIC Code:			Co Admin:		
SIC Description:			Choice of Contact:		
Approval Years:		As of Dec 2018	Phone No Admin:		
PO Box No:			Contam. Facility:		
Country:		Canada	MHSW Facility:		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		252 L			
Waste Class Desc:		Waste crankcase oils and lubricants			
46	6 of 8	SSE/239.5	118.8 / 1.96	AKMAN CONSTRUCTION INC 123 CARDEVCO RD CARP ON K0A 1L0	EASR
Approval No:		R-004-1110549484		MOE District: Ottawa	
Status:		REGISTERED		Municipality: CARP	
Date:		2018-08-16		Latitude: 45.29222222	
Record Type:		EASR		Longitude: -75.97805556	
Link Source:		MOFA		Geometry X:	
Project Type:		Waste Management System		Geometry Y:	
Full Address:					
Approval Type:		EASR-Waste Management System			
SWP Area Name:		Mississippi Valley			
PDF URL:					
PDF Site Location:					
46	7 of 8	SSE/239.5	118.8 / 1.96	Akman Construction Inc. 123 Cardevco Rd Carp ON K0A 1L0	GEN
Generator No:		ON5186787		Status: Registered	
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:		As of Jul 2020		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:		Canada		MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		252 L			
Waste Class Desc:		Waste crankcase oils and lubricants			
46	8 of 8	SSE/239.5	118.8 / 1.96	Akman Construction Inc. 123 Cardevco Rd Carp ON K0A 1L0	GEN
Generator No:		ON5186787		Status: Registered	
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:		As of Nov 2021		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:		Canada		MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		252 L			
Waste Class Desc:		Waste crankcase oils and lubricants			
47	1 of 1	NNE/240.4	114.9 / -1.84	The Carp Valley Press 2210 Cavanmore Dr Carp ON	SCT
Established:		1988			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plant Size (ft²):		800			
Employment:		2			
48	1 of 2	NE/245.0	113.9 / -2.92	217 Cardevco Rd Ottawa ON	EHS
Order No:		20130501004		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Custom Report		Client Prov/State:	ON
Report Date:		07-MAY-13		Search Radius (km):	.25
Date Received:		01-MAY-13		X:	0
Previous Site Name:				Y:	0
Lot/Building Size:					
Additional Info Ordered:					
48	2 of 2	NE/245.0	113.9 / -2.92	Boldt Theile (Division of The State Group Inc) 217 CARDEVCO ROAD CARP ON	GEN
Generator No:		ON9335538		Status:	
SIC Code:		238210		Co Admin:	
SIC Description:		ELECTRICAL CONTRACTORS, ELECTRICAL CONTRACTORS AND OTHER WIRING		Choice of Contact:	
Approval Years:		2013		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
49	1 of 1	W/248.3	119.9 / 3.08	172 & 180 Wescar Lane Ottawa ON	EHS
Order No:		20070316030		Nearest Intersection:	Cavanmore Road & Wescar Lane
Status:		C		Municipality:	Ottawa
Report Type:		CAN - Site Report		Client Prov/State:	
Report Date:		3/20/2007		Search Radius (km):	0.25
Date Received:		3/16/2007		X:	-75.981684
Previous Site Name:				Y:	45.294059
Lot/Building Size:		3.1 acre			
Additional Info Ordered:					

Unplottable Summary

Total: 15 Unplottable sites

DB	Company Name/Site Name	Address	City	Postal
CA	1374421 Ontario Ltd.	North Part of Lot 6, Concession III	Ottawa ON	
CA	Longwood Building Corporation	Part of Lot 6, Between Concession 2 & 3	Ottawa ON	
CA	1374421 Ontario Ltd.	North Part of Lot 6, Concession III	Ottawa ON	
CA		Lot 6, Concession 2 and 3	Ottawa ON	
CA		Lot 6, Concession 2 and 3	Ottawa ON	
CA		Lot 6, Concession 2 and 3	Ottawa ON	
CA		Wescar Lane	West Carleton ON	
CA	PAVAGE YOUNG ENG.	CARP ROAD, STITTSVILLE	WEST CARLETON TWP. ON	
CA	W. O. Stinson & Son Limited		Ottawa ON	
CA	1250353 Ontario Limited	Part of Lot 6, Concession 2 and 3, Rideau	Ottawa ON	
CA	WEST CARLETON TOWNSHIP	R.R.#5(CARP RD.),S-WATER MGT.	WEST CARLETON TWP. ON	
CA	WEST CARLETON TOWNSHIP	RR#5 (CARP RD.) S-WATER MGT.	WEST CARLETON TWP. ON	
SPL		Carp Road (between Hazeldean and Stittsville Main), Stittsville	Ottawa ON	
SPL	UNKNOWN	VILLAGE OF CARP CARP ROAD	WEST CARLETON TOWNSHIP ON	
SPL	TRANSPORT TRUCK	CARP RD. TRANSPORT TRUCK (CARGO)	WEST CARLETON TOWNSHIP ON	

Unplottable Report

Site: 1374421 Ontario Ltd.
North Part of Lot 6, Concession III Ottawa ON

Database:
CA

Certificate #: 7248-6M3NHQ
Application Year: 2006
Issue Date: 2/17/2006
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Longwood Building Corporation
Part of Lot 6, Between Concession 2 & 3 Ottawa ON

Database:
CA

Certificate #: 6229-6EQGQE
Application Year: 2005
Issue Date: 7/28/2005
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: 1374421 Ontario Ltd.
North Part of Lot 6, Concession III Ottawa ON

Database:
CA

Certificate #: 1907-62VS2P
Application Year: 2004
Issue Date: 7/21/2004
Approval Type: Municipal and Private Sewage Works
Status: Revoked and/or Replaced
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Lot 6, Concession 2 and 3 Ottawa ON

Database:
CA

Certificate #: 1760-4W5ML6
Application Year: 01

Issue Date: 4/25/01
Approval Type: Municipal & Private water
Status: Approved
Application Type: New Certificate of Approval
Client Name: KNL Developments Inc.
Client Address: 222 Somerset Street West, Suite 300
Client City: Ottawa
Client Postal Code: K2P 2G3
Project Description: Watermains to be constructed on Witherspoon Crescent
Contaminants:
Emission Control:

Site: Lot 6, Concession 2 and 3 Ottawa ON

Database:
CA

Certificate #: 5772-4W5M6D
Application Year: 01
Issue Date: 4/25/01
Approval Type: Municipal & Private sewage
Status: Approved
Application Type: New Certificate of Approval
Client Name: KNL Developments Inc.
Client Address: 222 Somerset Street West, Suite 300
Client City: Ottawa
Client Postal Code: K2P 2G3
Project Description: Storm and sanitary sewers to be constructed on Witherspoon Crescent
Contaminants:
Emission Control:

Site: Lot 6, Concession 2 and 3 Ottawa ON

Database:
CA

Certificate #: 6816-54HQ5P
Application Year: 01
Issue Date: 11/16/01
Approval Type: Municipal & Private sewage
Status: Approved
Application Type: New Certificate of Approval
Client Name: KNL Developments Inc.
Client Address: 222 Somerset Street West, Suite 300
Client City: Ottawa
Client Postal Code: K2P 2G3
Project Description: Sanitary Sewers including appurtenances from approximately 50m west of Ironside Court to the Goulbourn Forced Road to serve the Kanata Lakes Subdivision, City of Ottawa
Contaminants:
Emission Control:

Site: Wescar Lane West Carleton ON

Database:
CA

Certificate #: 7126-4X3RFA
Application Year: 01
Issue Date: 8/1/01
Approval Type: Municipal & Private sewage
Status: Approved
Application Type: New Certificate of Approval
Client Name: 1055733 Ontario Limited
Client Address: 180 Wescar Lane
Client City: West Carleton
Client Postal Code: K0A 1L0
Project Description: This application is for a Certificate of Approval for the installation of a new wastewater treatment system with subsurface discharge handling an average daily sewage flow of 34000L. The treatment system will service three (3) office buildings.
Contaminants:
Emission Control:

Site: PAVAGE YOUNG ENG.
CARP ROAD, STITTSVILLE WEST CARLETON TWP. ON

Database:
CA

Certificate #: 8-4027-96-
Application Year: 96
Issue Date: 5/3/1996
Approval Type: Industrial air
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description: RELOCATE ASPHALT PLANT
Contaminants: Nitrogen Oxides, Suspended Particulate Matter, Odour/Fumes
Emission Control: No Controls, Spray Chamber, No Controls,

Site: W. O. Stinson & Son Limited
Ottawa ON

Database:
CA

Certificate #: 7712-79VSZY
Application Year: 2007
Issue Date: 12/28/2007
Approval Type: Industrial Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: 1250353 Ontario Limited
Part of Lot 6, Concession 2 and 3, Rideau Ottawa ON

Database:
CA

Certificate #: 9386-674PJH
Application Year: 2004
Issue Date: 12/16/2004
Approval Type: Industrial Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: WEST CARLETON TOWNSHIP
R.R.#5(CARP RD.),S-WATER MGT. WEST CARLETON TWP. ON

Database:
CA

Certificate #: 3-0439-93-
Application Year: 93
Issue Date: 7/5/1993
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:

Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: WEST CARLETON TOWNSHIP
RR#5 (CARP RD.) S-WATER MGT. WEST CARLETON TWP. ON

Database:
CA

Certificate #: 3-0439-93-
Application Year: 93
Issue Date: 6/1/1993
Approval Type: Municipal sewage
Status: Cancelled
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Carp Road (between Hazeldean and Stittsville Main), Stittsville Ottawa ON

Database:
SPL

Ref No:	4602-9PMMJY	Discharger Report:	
Site No:	NA	Material Group:	
Incident Dt:	2014/10/06	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:	Unknown / N/A	Sector Type:	Sewer (Private or Municipal)
Incident Event:		Agency Involved:	
Contaminant Code:	15	Nearest Watercourse:	
Contaminant Name:	MOTOR OIL	Site Address:	Carp Road (between Hazeldean and Stittsville Main), Stittsville
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:	Not Anticipated	Site Municipality:	Ottawa
Nature of Impact:	Other Impact(s)	Site Lot:	
Receiving Medium:		Site Conc:	
Receiving Env:		Northing:	
MOE Response:	No Field Response	Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	2014/10/06	Site Map Datum:	
Dt Document Closed:	2014/11/03	SAC Action Class:	Land Spills
Incident Reason:	Unknown / N/A	Source Type:	
Site Name:	Sanitary sewer<UNOFFICIAL>		
Site County/District:			
Site Geo Ref Meth:			
Incident Summary:	Stittsville, motor oil in sewer, city investigating source		
Contaminant Qty:	0 other - see incident description		

Site: UNKNOWN
VILLAGE OF CARP CARP ROAD WEST CARLETON TOWNSHIP ON

Database:
SPL

Ref No:	106528	Discharger Report:	
Site No:		Material Group:	
Incident Dt:	10/18/1994	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:	UNKNOWN	Sector Type:	
Incident Event:		Agency Involved:	
Contaminant Code:		Nearest Watercourse:	
Contaminant Name:		Site Address:	
Contaminant Limit 1:		Site District Office:	

Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:	CONFIRMED	Site Municipality:	20613
Nature of Impact:	Multi Media Pollution	Site Lot:	
Receiving Medium:	LAND	Site Conc:	
Receiving Env:		Northing:	
MOE Response:		Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	10/18/1994	Site Map Datum:	
Dt Document Closed:		SAC Action Class:	
Incident Reason:	UNKNOWN	Source Type:	
Site Name:			
Site County/District:			
Site Geo Ref Meth:			
Incident Summary:	HYDROCARBONS SEEPING FROMGROUND INTO DITCH		
Contaminant Qty:			

Site:	TRANSPORT TRUCK		Database:
	CARP RD. TRANSPORT TRUCK (CARGO) WEST CARLETON TOWNSHIP ON		SPL
Ref No:	67418	Discharger Report:	
Site No:		Material Group:	
Incident Dt:	2/26/1992	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:	OTHER TRANSPORTATION ACCIDENT	Sector Type:	
Incident Event:		Agency Involved:	
Contaminant Code:		Nearest Watercourse:	
Contaminant Name:		Site Address:	
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:	CONFIRMED	Site Municipality:	20613
Nature of Impact:	Soil Contamination	Site Lot:	
Receiving Medium:	LAND	Site Conc:	
Receiving Env:		Northing:	
MOE Response:		Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	2/26/1992	Site Map Datum:	
Dt Document Closed:		SAC Action Class:	
Incident Reason:	EQUIPMENT FAILURE	Source Type:	
Site Name:			
Site County/District:			
Site Geo Ref Meth:			
Incident Summary:	LAIDLAW ENVIRONMENTAL: 315 L ANTIFREEZE TO GRND FROM TRANSPORT TRUCK.		
Contaminant Qty:			

Appendix: Database Descriptions

*Environmental Risk Information Services (ERIS) can search the following databases. The extent of historical information varies with each database and current information is determined by what is publicly available to ERIS at the time of update. **Note:** Databases denoted with " * " indicates that the database will no longer be updated. See the individual database description for more information.*

Abandoned Aggregate Inventory:

Provincial

[AAGR](#)

The MAAP Program maintains a database of abandoned pits and quarries. Please note that the database is only referenced by lot and concession and city/town location. The database provides information regarding the location, type, size, land use, status and general comments.*

Government Publication Date: Sept 2002*

Aggregate Inventory:

Provincial

[AGR](#)

The Ontario Ministry of Natural Resources maintains a database of all active pits and quarries. The database provides information regarding the registered owner/operator, location name, operation type, approval type, and maximum annual tonnage.

Government Publication Date: Up to Nov 2021

Abandoned Mine Information System:

Provincial

[AMIS](#)

The Abandoned Mines Information System contains data on known abandoned and inactive mines located on both Crown and privately held lands. The information was provided by the Ministry of Northern Development and Mines (MNDM), with the following disclaimer: "the database provided has been compiled from various sources, and the Ministry of Northern Development and Mines makes no representation and takes no responsibility that such information is accurate, current or complete". Reported information includes official mine name, status, background information, mine start/end date, primary commodity, mine features, hazards and remediation.

Government Publication Date: 1800-Mar 2022

Anderson's Waste Disposal Sites:

Private

[ANDR](#)

The information provided in this database was collected by examining various historical documents which aimed to characterize the likely position of former waste disposal sites from 1860 to present. The research initiative behind the creation of this database was to identify those sites that are missing from the Ontario MOE Waste Disposal Site Inventory, as well as to provide revisions and corrections to the positions and descriptions of sites currently listed in the MOE inventory. In addition to historic waste disposal facilities, the database also identifies certain auto wreckers and scrap yards that have been extrapolated from documentary sources. Please note that the data is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1860s-Present

Aboveground Storage Tanks:

Provincial

[AST](#)

Historical listing of aboveground storage tanks made available by the Department of Natural Resources and Forestry. Includes tanks used to hold water or petroleum. This dataset has been retired as of September 25, 2014 and will no longer be updated.

Government Publication Date: May 31, 2014

Automobile Wrecking & Supplies:

Private

[AUWR](#)

This database provides an inventory of known locations that are involved in the scrap metal, automobile wrecking/recycling, and automobile parts & supplies industry. Information is provided on the company name, location and business type.

Government Publication Date: 1999-May 31, 2022

Borehole:

Provincial

[BORE](#)

A borehole is the generalized term for any narrow shaft drilled in the ground, either vertically or horizontally. The information here includes geotechnical investigations or environmental site assessments, mineral exploration, or as a pilot hole for installing piers or underground utilities. Information is from many sources such as the Ministry of Transportation (MTO) boreholes from engineering reports and projects from the 1950 to 1990's in Southern Ontario. Boreholes from the Ontario Geological Survey (OGS) including The Urban Geology Analysis Information System (UGAIS) and the York Peel Durham Toronto (YPDT) database of the Conservation Authority Moraine Coalition. This database will include fields such as location, stratigraphy, depth, elevation, year drilled, etc. For all water well data or oil and gas well data for Ontario please refer to WWIS and OOGW.

Government Publication Date: 1875-Jul 2018

Certificates of Approval:

Provincial CA

This database contains the following types of approvals: Air & Noise, Industrial Sewage, Municipal & Private Sewage, Waste Management Systems and Renewable Energy Approvals. The MOE in Ontario states that any facility that releases emissions to the atmosphere, discharges contaminants to ground or surface water, provides potable water supplies, or stores, transports or disposes of waste, must have a Certificate of Approval before it can operate lawfully. Fields include approval number, business name, address, approval date, approval type and status. This database will no longer be updated, as CofA's have been replaced by either Environmental Activity and Sector Registry (EASR) or Environmental Compliance Approval (ECA). Please refer to those individual databases for any information after Oct.31, 2011.

Government Publication Date: 1985-Oct 30, 2011*

Dry Cleaning Facilities:

Federal CDRY

List of dry cleaning facilities made available by Environment and Climate Change Canada. Environment and Climate Change Canada's Tetrachloroethylene (Use in Dry Cleaning and Reporting Requirements) Regulations (SOR/2003-79) are intended to reduce releases of tetrachloroethylene to the environment from dry cleaning facilities.

Government Publication Date: Jan 2004-Dec 2020

Commercial Fuel Oil Tanks:

Provincial CFOT

Locations of commercial underground fuel oil tanks. This is not a comprehensive or complete inventory of commercial fuel tanks in the province; this listing is a copy of records of registered commercial underground fuel oil tanks obtained under Access to Public Information.

Note that the following types of tanks do not require registration: waste oil tanks in apartments, office buildings, residences, etc.; aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Chemical Manufacturers and Distributors:

Private CHEM

This database includes information from both a one time study conducted in 1992 and private source and is a listing of facilities that manufacture or distribute chemicals. The production of these chemical substances may involve one or more chemical reactions and/or chemical separation processes (i.e. fractionation, solvent extraction, crystallization, etc.).

Government Publication Date: 1999-Jan 31, 2020

Chemical Register:

Private CHM

This database includes a listing of locations of facilities within the Province or Territory that either manufacture and/or distributes chemicals.

Government Publication Date: 1999-May 31, 2022

Compressed Natural Gas Stations:

Private CNG

Canada has a network of public access compressed natural gas (CNG) refuelling stations. These stations dispense natural gas in compressed form at 3,000 pounds per square inch (psi), the pressure which is allowed within the current Canadian codes and standards. The majority of natural gas refuelling is located at existing retail gasoline that have a separate refuelling island for natural gas. This list of stations is made available by the Canadian Natural Gas Vehicle Alliance.

Government Publication Date: Dec 2012 -Sep 2022

Inventory of Coal Gasification Plants and Coal Tar Sites:

Provincial COAL

This inventory includes both the "Inventory of Coal Gasification Plant Waste Sites in Ontario-April 1987" and the Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario-November 1988) collected by the MOE. It identifies industrial sites that produced and continue to produce or use coal tar and other related tars. Detailed information is available and includes: facility type, size, land use, information on adjoining properties, soil condition, site operators/occupants, site description, potential environmental impacts and historic maps available. This was a one-time inventory.*

Government Publication Date: Apr 1987 and Nov 1988*

Compliance and Convictions:

Provincial CONV

This database summarizes the fines and convictions handed down by the Ontario courts beginning in 1989. Companies and individuals named here have been found guilty of environmental offenses in Ontario courts of law.

Government Publication Date: 1989-Jun 2022

Certificates of Property Use:

Provincial CPU

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include CPU's on the registry such as (EPA s. 168.6) - Certificate of Property Use.

Government Publication Date: 1994 - Aug 31, 2022

Drill Hole Database:

Provincial

[DRL](#)

The Ontario Drill Hole Database contains information on more than 113,000 percussion, overburden, sonic and diamond drill holes from assessment files on record with the department of Mines and Minerals. Please note that limited data is available for southern Ontario, as it was the last area to be completed. The database was created when surveys submitted to the Ministry were converted in the Assessment File Research Image Database (AFRI) project. However, the degree of accuracy (coordinates) as to the exact location of drill holes is dependent upon the source document submitted to the MNDM. Levels of accuracy used to locate holes are: centering on the mining claim; a sketch of the mining claim; a 1:50,000 map; a detailed company map; or from submitted a "Report of Work".

Government Publication Date: 1886 - Sep 2020

Delisted Fuel Tanks:

Provincial

[DTNK](#)

List of fuel storage tank sites that were once found in - and have since been removed from - the list of fuel storage tanks made available by the regulatory agency under Access to Public Information.

Government Publication Date: Feb 28, 2022

Environmental Activity and Sector Registry:

Provincial

[EASR](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. The EASR allows businesses to register certain activities with the ministry, rather than apply for an approval. The registry is available for common systems and processes, to which preset rules of operation can be applied. The EASR is currently available for: heating systems, standby power systems and automotive refinishing. Businesses whose activities aren't subject to the EASR may apply for an ECA (Environmental Compliance Approval). Please see our ECA database.

Government Publication Date: Oct 2011- Aug 31, 2022

Environmental Registry:

Provincial

[EBR](#)

The Environmental Registry lists proposals, decisions and exceptions regarding policies, Acts, instruments, or regulations that could significantly affect the environment. Through the Registry, thirteen provincial ministries notify the public of upcoming proposals and invite their comments. For example, if a local business is requesting a permit, license, or certificate of approval to release substances into the air or water; these are notified on the registry. Data includes: Approval for discharge into the natural environment other than water (i.e. Air) - EPA s. 9, Approval for sewage works - OWRA s. 53(1), and EPA s. 27 - Approval for a waste disposal site. For information regarding Permit to Take Water (PTTW), Certificate of Property Use (CPU) and (ORD) Orders please refer to those individual databases.

Government Publication Date: 1994 - Aug 31, 2022

Environmental Compliance Approval:

Provincial

[ECA](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. In the past, a business had to apply for multiple approvals (known as certificates of approval) for individual processes and pieces of equipment. Today, a business either registers itself, or applies for a single approval, depending on the types of activities it conducts. Businesses whose activities aren't subject to the EASR may apply for an ECA. A single ECA addresses all of a business's emissions, discharges and wastes. Separate approvals for air, noise and waste are no longer required. This database will also include Renewable Energy Approvals. For certificates of approval prior to Nov 1st, 2011, please refer to the CA database. For all Waste Disposal Sites please refer to the WDS database.

Government Publication Date: Oct 2011- Aug 31, 2022

Environmental Effects Monitoring:

Federal

[EEM](#)

The Environmental Effects Monitoring program assesses the effects of effluent from industrial or other sources on fish, fish habitat and human usage of fisheries resources. Since 1992, pulp and paper mills have been required to conduct EEM studies under the Pulp and Paper Effluent Regulations. This database provides information on the mill name, geographical location and sub-lethal toxicity data.

Government Publication Date: 1992-2007*

ERIS Historical Searches:

Private

[EHS](#)

ERIS has compiled a database of all environmental risk reports completed since March 1999. Available fields for this database include: site location, date of report, type of report, and search radius. As per all other databases, the ERIS database can be referenced on both the map and "Statistical Profile" page.

Government Publication Date: 1999-Jul 31, 2022

Environmental Issues Inventory System:

Federal

[EIIS](#)

The Environmental Issues Inventory System was developed through the implementation of the Environmental Issues and Remediation Plan. This plan was established to determine the location and severity of contaminated sites on inhabited First Nation reserves, and where necessary, to remediate those that posed a risk to health and safety; and to prevent future environmental problems. The EIIS provides information on the reserve under investigation, inventory number, name of site, environmental issue, site action (Remediation, Site Assessment), and date investigation completed.

Government Publication Date: 1992-2001*

Emergency Management Historical Event:

Provincial

EMHE

List of locations of historical occurrences of emergency events, including those assigned to the Ministry of Natural Resources by Order-In-Council (OIC) under the Emergency Management and Civil Protection Act, as well as events where MNR provided requested emergency response assistance. Many of these events will have involved community evacuations, significant structural loss, and/or involvement of MNR emergency response staff. These events fall into one of ten (10) type categories: Dam Failure; Drought / Low Water; Erosion; Flood; Forest Fire; Soil and Bedrock Instability; Petroleum Resource Center Event, EMO Requested Assistance, Continuity of Operations Event, Other Requested Assistance. EMHE record details are reproduced by ERIIS under License with the Ontario Ministry of Natural Resources © Queen's Printer for Ontario, 2017.

Government Publication Date: Apr 30, 2022

Environmental Penalty Annual Report:

Provincial

EPAR

This database contains data from Ontario's annual environmental penalty report published by the Ministry of the Environment and Climate Change. These reports provide information on environmental penalties for land or water violations issued to companies in one of the nine industrial sectors covered by the Municipal Industrial Strategy for Abatement (MISA) regulations.

Government Publication Date: Jan 1, 2011 - Dec 31, 2021

List of Expired Fuels Safety Facilities:

Provincial

EXP

List of facilities and tanks for which there was once a fuel registration. This is not a comprehensive or complete inventory of expired tanks/tank facilities in the province; this listing is a copy of previously registered tanks and facilities obtained under Access to Public Information. Includes private fuel outlets, bulk plants, fuel oil tanks, gasoline stations, marinas, propane filling stations, liquid fuel tanks, piping systems, etc; includes tanks which have been removed from the ground.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Federal Convictions:

Federal

FCON

Environment Canada maintains a database referred to as the "Environmental Registry" that details prosecutions under the Canadian Environmental Protection Act (CEPA) and the Fisheries Act (FA). Information is provided on the company name, location, charge date, offence and penalty.

Government Publication Date: 1988-Jun 2007*

Contaminated Sites on Federal Land:

Federal

FCS

The Federal Contaminated Sites Inventory includes information on known federal contaminated sites under the custodianship of departments, agencies and consolidated Crown corporations as well as those that are being or have been investigated to determine whether they have contamination arising from past use that could pose a risk to human health or the environment. The inventory also includes non-federal contaminated sites for which the Government of Canada has accepted some or all financial responsibility. It does not include sites where contamination has been caused by, and which are under the control of, enterprise Crown corporations, private individuals, firms or other levels of government. Includes fire training sites and sites at which Per- and Polyfluoroalkyl Substances (PFAS) are a concern.

Government Publication Date: Jun 2000-Sep 2022

Fisheries & Oceans Fuel Tanks:

Federal

FOFT

Fisheries & Oceans Canada maintains an inventory of aboveground & underground fuel storage tanks located on Fisheries & Oceans property or controlled by DFO. Our inventory provides information on the site name, location, tank owner, tank operator, facility type, storage tank location, tank contents & capacity, and date of tank installation.

Government Publication Date: 1964-Sep 2019

Federal Identification Registry for Storage Tank Systems (FIRSTS):

Federal

FRST

A list of federally regulated Storage tanks from the Federal Identification Registry for Storage Tank Systems (FIRSTS). FIRSTS is Environment and Climate Change Canada's database of storage tank systems subject to the Storage Tank for Petroleum Products and Allied Petroleum Products Regulations. The main objective of the Regulations is to prevent soil and groundwater contamination from storage tank systems located on federal and aboriginal lands. Storage tank systems that do not have a valid identification number displayed in a readily visible location on or near the storage tank system may be refused product delivery.

Government Publication Date: May 31, 2018

Fuel Storage Tank:

Provincial

FST

List of registered private and retail fuel storage tanks. This is not a comprehensive or complete inventory of private and retail fuel storage tanks in the province; this listing is a copy of registered private and retail fuel storage tanks, obtained under Access to Public Information.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Fuel Storage Tank - Historic:

Provincial

FSTH

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks. Public records of private fuel storage tanks are only available since the registration became effective in September 1989. This information is now collected by the Technical Standards and Safety Authority.

Government Publication Date: Pre-Jan 2010*

Ontario Regulation 347 Waste Generators Summary:

Provincial

GEN

Regulation 347 of the Ontario EPA defines a waste generation site as any site, equipment and/or operation involved in the production, collection, handling and/or storage of regulated wastes. A generator of regulated waste is required to register the waste generation site and each waste produced, collected, handled, or stored at the site. This database contains the registration number, company name and address of registered generators including the types of hazardous wastes generated. It includes data on waste generating facilities such as: drycleaners, waste treatment and disposal facilities, machine shops, electric power distribution etc. This information is a summary of all years from 1986 including the most currently available data. Some records may contain, within the company name, the phrase "See & Use..." followed by a series of letters and numbers. This occurs when one company is amalgamated with or taken over by another registered company. The number listed as "See & Use", refers to the new ownership and the other identification number refers to the original ownership. This phrase serves as a link between the 2 companies until operations have been fully transferred.

Government Publication Date: 1986-Apr 30, 2022

Greenhouse Gas Emissions from Large Facilities:

Federal

GHG

List of greenhouse gas emissions from large facilities made available by Environment Canada. Greenhouse gas emissions in kilotonnes of carbon dioxide equivalents (kt CO₂ eq).

Government Publication Date: 2013-Dec 2019

TSSA Historic Incidents:

Provincial

HINC

List of historic incidences of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen recorded by the TSSA in their previous incident tracking system. The TSSA's Fuels Safety Program administers the Technical Standards & Safety Act 2000, providing fuel-related safety services associated with the safe transportation, storage, handling and use of fuels such as gasoline, diesel, propane, natural gas and hydrogen. Under this Act, the TSSA regulates fuel suppliers, storage facilities, transport trucks, pipelines, contractors and equipment or appliances that use fuels. Records are not verified for accuracy or completeness. This is not a comprehensive or complete inventory of historical fuel spills and leaks in the province. This listing is a copy of the data captured at one moment in time and is hence limited by the record date provided here.

Government Publication Date: 2006-June 2009*

Indian & Northern Affairs Fuel Tanks:

Federal

IAFT

The Department of Indian & Northern Affairs Canada (INAC) maintains an inventory of aboveground & underground fuel storage tanks located on both federal and crown land. Our inventory provides information on the reserve name, location, facility type, site/facility name, tank type, material & ID number, tank contents & capacity, and date of tank installation.

Government Publication Date: 1950-Aug 2003*

Fuel Oil Spills and Leaks:

Provincial

INC

Listing of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen reported to the Spills Action Centre (SAC). This is not a comprehensive or complete inventory of fuel-related leaks, spills, and incidents in the province; this listing is a copy of incidents reported to the SAC, obtained under Access to Public Information. Includes incidents from fuel-related hazards such as spills, fires, and explosions. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Landfill Inventory Management Ontario:

Provincial

LIMO

The Landfill Inventory Management Ontario (LIMO) database is updated every year, as the Ministry of the Environment, Conservation and Parks compiles new and updated information. Includes small and large landfills currently operating as well as those which are closed and historic. Operators of larger landfills provide landfill information for the previous operating year to the ministry for LIMO including: estimated amount of total waste received, landfill capacity, estimated total remaining landfill capacity, fill rates, engineering designs, reporting and monitoring details, size of location, service area, approved waste types, leachate of site treatment, contaminant attenuation zone and more. The small landfills include information such as site owner, site location and certificate of approval # and status.

Government Publication Date: Mar 21, 2022

Canadian Mine Locations:

Private

MINE

This information is collected from the Canadian & American Mines Handbook. The Mines database is a national database that provides over 290 listings on mines (listed as public companies) dealing primarily with precious metals and hard rocks. Listed are mines that are currently in operation, closed, suspended, or are still being developed (advanced projects). Their locations are provided as geographic coordinates (x, y and/or longitude, latitude). As of 2002, data pertaining to Canadian smelters and refineries has been appended to this database.

Government Publication Date: 1998-2009*

Mineral Occurrences:

Provincial

MNR

In the early 70's, the Ministry of Northern Development and Mines created an inventory of approximately 19,000 mineral occurrences in Ontario, in regard to metallic and industrial minerals, as well as some information on building stones and aggregate deposits. Please note that the "Horizontal Positional Accuracy" is approximately +/- 200 m. Many reference elements for each record were derived from field sketches using pace or chain/tape measurements against claim posts or topographic features in the area. The primary limiting factor for the level of positional accuracy is the scale of the source material. The testing of horizontal accuracy of the source materials was accomplished by comparing the plan metric (X and Y) coordinates of that point with the coordinates of the same point as defined from a source of higher accuracy.

Government Publication Date: 1846-Feb 2022

National Analysis of Trends in Emergencies System (NATES):

Federal

NATE

In 1974 Environment Canada established the National Analysis of Trends in Emergencies System (NATES) database, for the voluntary reporting of significant spill incidents. The data was to be used to assist in directing the work of the emergencies program. NATES ran from 1974 to 1994. Extensive information is available within this database including company names, place where the spill occurred, date of spill, cause, reason and source of spill, damage incurred, and amount, concentration, and volume of materials released.

Government Publication Date: 1974-1994*

Non-Compliance Reports:

Provincial

NCPL

The Ministry of the Environment provides information about non-compliant discharges of contaminants to air and water that exceed legal allowable limits, from regulated industrial and municipal facilities. A reported non-compliance failure may be in regard to a Control Order, Certificate of Approval, Sectoral Regulation or specific regulation/act.

Government Publication Date: Dec 31, 2020

National Defense & Canadian Forces Fuel Tanks:

Federal

NDFT

The Department of National Defense and the Canadian Forces maintains an inventory of all aboveground & underground fuel storage tanks located on DND lands. Our inventory provides information on the base name, location, tank type & capacity, tank contents, tank class, date of tank installation, date tank last used, and status of tank as of May 2001. This database will no longer be updated due to the new National Security protocols which have prohibited any release of this database.

Government Publication Date: Up to May 2001*

National Defense & Canadian Forces Spills:

Federal

NDSP

The Department of National Defense and the Canadian Forces maintains an inventory of spills to land and water. All spill sites have been classified under the "Transportation of Dangerous Goods Act - 1992". Our inventory provides information on the facility name, location, spill ID #, spill date, type of spill, as well as the quantity of substance spilled & recovered.

Government Publication Date: Mar 1999-Apr 2018

National Defence & Canadian Forces Waste Disposal Sites:

Federal

NDWD

The Department of National Defence and the Canadian Forces maintains an inventory of waste disposal sites located on DND lands. Where available, our inventory provides information on the base name, location, type of waste received, area of site, depth of site, year site opened/closed and status.

Government Publication Date: 2001-Apr 2007*

National Energy Board Pipeline Incidents:

Federal

NEBI

Locations of pipeline incidents from 2008 to present, made available by the Canada Energy Regulator (CER) - previously the National Energy Board (NEB). Includes incidents reported under the Onshore Pipeline Regulations and the Processing Plant Regulations related to pipelines under federal jurisdiction, does not include incident data related to pipelines under provincial or territorial jurisdiction.

Government Publication Date: 2008-Jun 30, 2021

National Energy Board Wells:

Federal

NEBP

The NEBW database contains information on onshore & offshore oil and gas wells that are outside provincial jurisdiction(s) and are thereby regulated by the National Energy Board. Data is provided regarding the operator, well name, well ID No./UWI, status, classification, well depth, spud and release date.

Government Publication Date: 1920-Feb 2003*

National Environmental Emergencies System (NEES):

Federal

[NEES](#)

In 2000, the Emergencies program implemented NEES, a reporting system for spills of hazardous substances. For the most part, this system only captured data from the Atlantic Provinces, some from Quebec and Ontario and a portion from British Columbia. Data for Alberta, Saskatchewan, Manitoba and the Territories was not captured. However, NEES is also a repository for previous Environment Canada spill datasets. NEES is composed of the historic datasets ' or Trends ' which dates from approximately 1974 to present. NEES Trends is a compilation of historic databases, which were merged and includes data from NATES (National Analysis of Trends in Emergencies System), ARTS (Atlantic Regional Trends System), and NEES. In 2001, the Emergencies Program determined that variations in reporting regimes and requirements between federal and provincial agencies made national spill reporting and trend analysis difficult to achieve. As a consequence, the department has focused efforts on capturing data on spills of substances which fall under its legislative authority only (CEPA and FA). As such, the NEES database will be decommissioned in December 2004.

Government Publication Date: 1974-2003***National PCB Inventory:**

Federal

[NPCB](#)

Environment Canada's National PCB inventory includes information on in-use PCB containing equipment in Canada including federal, provincial and private facilities. Federal out-of-service PCB containing equipment and PCB waste owned by the federal government or by federally regulated industries such as airlines, railway companies, broadcasting companies, telephone and telecommunications companies, pipeline companies, etc. are also listed. Although it is not Environment Canada's mandate to collect data on non-federal PCB waste, the National PCB inventory includes some information on provincial and private PCB waste and storage sites. Some addresses provided may be Head Office addresses and are not necessarily the location of where the waste is being used or stored.

Government Publication Date: 1988-2008***National Pollutant Release Inventory:**

Federal

[NPRI](#)

Environment Canada has defined the National Pollutant Release Inventory ("NPRI") as a federal government initiative designed to collect comprehensive national data regarding releases to air, water, or land, and waste transfers for recycling for more than 300 listed substances.

Government Publication Date: 1993-May 2017**Oil and Gas Wells:**

Private

[OGWE](#)

The Nickle's Energy Group (publisher of the Daily Oil Bulletin) collects information on drilling activity including operator and well statistics. The well information database includes name, location, class, status and depth. The main Nickle's database is updated on a daily basis, however, this database is updated on a monthly basis. More information is available at www.nickles.com.

Government Publication Date: 1988-Aug 31, 2022**Ontario Oil and Gas Wells:**

Provincial

[OOGW](#)

In 1998, the MNR handed over to the Ontario Oil, Gas and Salt Resources Corporation, the responsibility of maintaining a database of oil and gas wells drilled in Ontario. The OGSR Library has over 20,000+ wells in their database. Information available for all wells in the ERIS database include well owner/operator, location, permit issue date, and well cap date, license No., status, depth and the primary target (rock unit) of the well being drilled. All geology/stratigraphy table information, plus all water table information is also provide for each well record.

Government Publication Date: 1800-Aug 2021**Inventory of PCB Storage Sites:**

Provincial

[OPCB](#)

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of PCB storage sites within the province. Ontario Regulation 11/82 (Waste Management - PCB) and Regulation 347 (Generator Waste Management) under the Ontario EPA requires the registration of inactive PCB storage equipment and/or disposal sites of PCB waste with the Ontario Ministry of Environment. This database contains information on: 1) waste quantities; 2) major and minor sites storing liquid or solid waste; and 3) a waste storage inventory.

Government Publication Date: 1987-Oct 2004; 2012-Dec 2013**Orders:**

Provincial

[ORD](#)

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include Orders on the registry such as (EPA s. 17) - Order for remedial work, (EPA s. 18) - Order for preventative measures, (EPA s. 43) - Order for removal of waste and restoration of site, (EPA s. 44) - Order for conformity with Act for waste disposal sites, (EPA s. 136) - Order for performance of environmental measures.

Government Publication Date: 1994 - Aug 31, 2022**Canadian Pulp and Paper:**

Private

[PAP](#)

This information is part of the Pulp and Paper Canada Directory. The Directory provides a comprehensive listing of the locations of pulp and paper mills and the products that they produce.

Government Publication Date: 1999, 2002, 2004, 2005, 2009-2014**Parks Canada Fuel Storage Tanks:**

Federal

[PCFT](#)

Canadian Heritage maintains an inventory of known fuel storage tanks operated by Parks Canada, in both National Parks and at National Historic Sites. The database details information on site name, location, tank install/removal date, capacity, fuel type, facility type, tank design and owner/operator.

Government Publication Date: 1920-Jan 2005*

Pesticide Register:

Provincial PES

The Ontario Ministry of the Environment and Climate Change maintains a database of licensed operators and vendors of registered pesticides.

Government Publication Date: Oct 2011- Aug 31, 2022

Pipeline Incidents:

Provincial PINC

List of pipeline incidents (strikes, leaks, spills). This is not a comprehensive or complete inventory of pipeline incidents in the province; this listing is an historical copy of records previously obtained under Access to Public Information. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2021

Private and Retail Fuel Storage Tanks:

Provincial PRT

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks and licensed retail fuel outlets. This database includes an inventory of locations that have gasoline, oil, waste oil, natural gas and/or propane storage tanks on their property. The MCCR no longer collects this information. This information is now collected by the Technical Standards and Safety Authority (TSSA).

Government Publication Date: 1989-1996*

Permit to Take Water:

Provincial PTTW

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include PTTW's on the registry such as OWRA s. 34 - Permit to take water.

Government Publication Date: 1994 - Aug 31, 2022

Ontario Regulation 347 Waste Receivers Summary:

Provincial REC

Part V of the Ontario Environmental Protection Act ("EPA") regulates the disposal of regulated waste through an operating waste management system or a waste disposal site operated or used pursuant to the terms and conditions of a Certificate of Approval or a Provisional Certificate of Approval. Regulation 347 of the Ontario EPA defines a waste receiving site as any site or facility to which waste is transferred by a waste carrier. A receiver of regulated waste is required to register the waste receiving facility. This database represents registered receivers of regulated wastes, identified by registration number, company name and address, and includes receivers of waste such as: landfills, incinerators, transfer stations, PCB storage sites, sludge farms and water pollution control plants. This information is a summary of all years from 1986 including the most currently available data.

Government Publication Date: 1986-1990, 1992-2019

Record of Site Condition:

Provincial RSC

The Record of Site Condition (RSC) is part of the Ministry of the Environment's Brownfields Environmental Site Registry. Protection from environmental cleanup orders for property owners is contingent upon documentation known as a record of site condition (RSC) being filed in the Environmental Site Registry. In order to file an RSC, the property must have been properly assessed and shown to meet the soil, sediment and groundwater standards appropriate for the use (such as residential) proposed to take place on the property. The Record of Site Condition Regulation (O. Reg. 153/04) details requirements related to site assessment and clean up.

RSCs filed after July 1, 2011 will also be included as part of the new (O.Reg. 511/09).

Government Publication Date: 1997-Sept 2001, Oct 2004-Aug 2022

Retail Fuel Storage Tanks:

Private RST

This database includes an inventory of retail fuel outlet locations (including marinas) that have on their property gasoline, oil, waste oil, natural gas and / or propane storage tanks.

Government Publication Date: 1999-May 31, 2022

Scott's Manufacturing Directory:

Private SCT

Scott's Directories is a data bank containing information on over 200,000 manufacturers across Canada. Even though Scott's listings are voluntary, it is the most comprehensive database of Canadian manufacturers available. Information concerning a company's address, plant size, and main products are included in this database.

Government Publication Date: 1992-Mar 2011*

Ontario Spills:

Provincial SPL

List of spills and incidents made available the Ministry of the Environment, Conservation and Parks. This database identifies information such as location (approximate), type and quantity of contaminant, date of spill, environmental impact, cause, nature of impact, etc. Information from 1988-2002 was part of the ORIS (Occurrence Reporting Information System). The SAC (Spills Action Centre) handles all spills reported in Ontario. Regulations for spills in Ontario are part of the MOE's Environmental Protection Act, Part X. The Ministry of the Environment, Conservation and Parks cites the coronavirus pandemic as an explanation for delays in releasing data pursuant to requests.

Government Publication Date: 1988-Sep 2020; Dec 2020-Mar 2021

Wastewater Discharger Registration Database:

Provincial

[SRDS](#)

Information under this heading is combination of the following 2 programs. The Municipal/Industrial Strategy for Abatement (MISA) division of the Ontario Ministry of Environment maintained a database of all direct dischargers of toxic pollutants within nine sectors including: Electric Power Generation; Mining; Petroleum Refining; Organic Chemicals; Inorganic Chemicals; Pulp & Paper; Metal Casting; Iron & Steel; and Quarries. All sampling information is now collected and stored within the Sample Result Data Store (SRDS).

Government Publication Date: 1990-Dec 31, 2020

Anderson's Storage Tanks:

Private

[TANK](#)

The information provided in this database was collected by examining various historical documents, which identified the location of former storage tanks, containing substances such as fuel, water, gas, oil, and other various types of miscellaneous products. Information is available in regard to business operating at tank site, tank location, permit year, permit & installation type, no. of tanks installed & configuration and tank capacity. Data contained within this database pertains only to the city of Toronto and is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1915-1953*

Transport Canada Fuel Storage Tanks:

Federal

[TCFT](#)

List of fuel storage tanks currently or previously owned or operated by Transport Canada. This inventory also includes tanks on The Pickering Lands, which refers to 7,530 hectares (18,600 acres) of land in Pickering, Markham, and Uxbridge owned by the Government of Canada since 1972; properties on this land has been leased by the government since 1975, and falls under the Site Management Policy of Transport Canada, but is administered by Public Works and Government Services Canada. This inventory provides information on the site name, location, tank age, capacity and fuel type.

Government Publication Date: 1970 - Dec 2020

Variances for Abandonment of Underground Storage Tanks:

Provincial

[VAR](#)

Listing of variances granted for storage tank abandonment. This is not a comprehensive or complete inventory of tank abandonment variances in the province; this listing is a copy of tank abandonment variance records previously obtained under Access to Public Information. In Ontario, registered underground storage tanks must be removed within two years of disuse; if removal of a tank is not feasible, an application may be sought for a variance from this code requirement.

Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Waste Disposal Sites - MOE CA Inventory:

Provincial

[WDS](#)

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of known open (active or inactive) and closed disposal sites in the Province of Ontario. Active sites maintain a Certificate of Approval, are approved to receive and are receiving waste. Inactive sites maintain Certificate(s) of Approval but are not receiving waste. Closed sites are not receiving waste. The data contained within this database was compiled from the MOE's Certificate of Approval database. Locations of these sites may be cross-referenced to the Anderson database described under ERIS's Private Source Database section, by the CA number. All new Environmental Compliance Approvals handed out after Oct 31, 2011 for Waste Disposal Sites will still be found in this database.

Government Publication Date: Oct 2011- Aug 31, 2022

Waste Disposal Sites - MOE 1991 Historical Approval Inventory:

Provincial

[WDSH](#)

In June 1991, the Ontario Ministry of Environment, Waste Management Branch, published the "June 1991 Waste Disposal Site Inventory", of all known active and closed waste disposal sites as of October 30th, 1990. For each "active" site as of October 31st 1990, information is provided on site location, site/CA number, waste type, site status and site classification. For each "closed" site as of October 31st 1990, information is provided on site location, site/CA number, closure date and site classification. Locations of these sites may be cross-referenced to the Anderson database described under ERIS's Private Source Database section, by the CA number.

Government Publication Date: Up to Oct 1990*

Water Well Information System:

Provincial

[WWIS](#)

This database describes locations and characteristics of water wells found within Ontario in accordance with Regulation 903. It includes such information as coordinates, construction date, well depth, primary and secondary use, pump rate, static water level, well status, etc. Also included are detailed stratigraphy information, approximate depth to bedrock and the approximate depth to the water table.

Government Publication Date: Jun 30 2022

Definitions

Database Descriptions: This section provides a detailed explanation for each database including: source, information available, time coverage, and acronyms used. They are listed in alphabetic order.

Detail Report: This is the section of the report which provides the most detail for each individual record. Records are summarized by location, starting with the project property followed by records in closest proximity.

Distance: The distance value is the distance between plotted points, not necessarily the distance between the sites' boundaries. All values are an approximation.

Direction: The direction value is the compass direction of the site in respect to the project property and/or center point of the report.

Elevation: The elevation value is taken from the location at which the records for the site address have been plotted. All values are an approximation. Source: Google Elevation API.

Executive Summary: This portion of the report is divided into 3 sections:

'Report Summary'- Displays a chart indicating how many records fall on the project property and, within the report search radii.

'Site Report Summary'-Project Property'- This section lists all the records which fall on the project property. For more details, see the 'Detail Report' section.

'Site Report Summary-Surrounding Properties'- This section summarizes all records on adjacent properties, listing them in order of proximity from the project property. For more details, see the 'Detail Report' section.

Map Key: The map key number is assigned according to closest proximity from the project property. Map Key numbers always start at #1. The project property will always have a map key of '1' if records are available. If there is a number in brackets beside the main number, this will indicate the number of records on that specific property. If there is no number in brackets, there is only one record for that property.

The symbol and colour used indicates 'elevation': the red inverted triangle will dictate 'ERIS Sites with Lower Elevation', the yellow triangle will dictate 'ERIS Sites with Higher Elevation' and the orange square will dictate 'ERIS Sites with Same Elevation.'

Unplottables: These are records that could not be mapped due to various reasons, including limited geographic information. These records may or may not be in your study area, and are included as reference.

APPENDIX E
MECP FOI Search Request

Ministry of the Environment,
Conservation and Parks

Access and Privacy Office

12th Floor
40 St. Clair Avenue West
Toronto ON M4V 1M2
Tel: (416) 314-4075

Ministère de l'Environnement, de la
Protection de la nature et des Parcs

Bureau de l'accès à l'information et
de la protection de la vie privée

12^e étage
40, avenue St. Clair ouest
Toronto ON M4V 1M2
Tél. : (416) 314-4075



October 28, 2022

Julie Crooks
Pinchin Ltd.
1 Hines Road, Suite 200
Kanata, Ontario K2K 3C7
jcrooks@pinchin.com

Dear Julie Crooks:

RE: MECP FOI A-2022-07302, Your Reference #: 316252 – Record Release Letter

This letter is further to your request made pursuant to the Freedom of Information and Protection of Privacy Act (the Act) relating to 158 Cardevco Road, Ottawa.

Attached is a copy of the records.

You may request a review of my decision within 30 days from the date of this letter by contacting the Information and Privacy Commissioner/Ontario at <http://www.ipc.on.ca>. Please note there may be a fee associated with submitting the appeal.

If you have any questions, please contact Mai Tang at 437-996-8412 or Mai.Tang@ontario.ca.

Yours truly,

maitang
for

Ryan Gunn
Manager (A), Access and Privacy Office

Attachment

INCIDENT REPORT

Reference Number:	5486-7GCNUG	File Storage Number:	SI OC WC CA 100
Module:	Incident Reporting	Module Type:	Legislation Non-Compliance
Cross Reference:	7638-79RK3K (doc link)	Task Link:	1112-7GCNWL 
Originating Document:		Created by:	Mike Heeringa
Incident Report Reference Number:	5486-7GCNUG 		
Date Created:	2008/07/08	Date Completed:	2009/02/02
Bring Forward Date:		Bring Forward Reason:	
Status:	Closed		
Program	Waste - Hazardous & Liquid industrial	Activity:	Control Documents

Is this an **air emission** (measured or modelled) or **wastewater** (sewage) **discharge exceedance** that will become part of the Environmental Compliance Report?

(legislation, certificate of approval, order, or guideline)

☐ Yes ☒ No ☐ To be determined

[Click here for Guidance](#)

Caller or PO Information

Reported By:	Name of Company:
	Unit Identifier:
	Delivery Identifier:
Province/State:	Postal Code:
Ontario	
Other Number:	Email Address:

Reported By:	
---------------------	--

MOE Information

Date & Time Reported to MOE:	2008/07/08 13:01		
Office Receiving Incident Report:	Ottawa District Office		
Incident Info Received By:	Mike Heeringa		
MOE Response:	Planned Field Response	Site Region:	Eastern
Date & Time of MOE Arrival at Scene:			
Master Incident Report	5486-7GCNUG	Subordinate	7638-79RK3K 

Number:		Documents(s):	
SAC Action Class:			
Non-Standard Procedure:	No		
ERP Call-out Initiated:			

Client(s)

Client Details

Kris Jason Hodgins, Business/Facility Name: 1-888-Dr.Waste
Mailing Address: 108 Huntley Manor Dr, Ottawa, Ontario, Canada, K0A 1L0
Physical Address: 108 Huntley Manor Dr, Ottawa, City, Ontario, Canada
Telephone: (613)836-4502
Client #: 6560-7CUJZM, Client Type: Individual

Site(s)

Site Details

154 Cardevco Drive
Address: 154 Cardevco Dr, Ottawa, City
District Office: Ottawa
Site #: 9573-7DGHW8

Incident Information

Incident Summary:	Operate WDS - no COA <i>cannot be longer than 60 characters</i>
Incident Description:	November 22, 2007 (13:20) - caller notified Ottawa District Office of the storage of waste without approval at 154 Cardevco Rd., in Carp. April 9, 2008 (13:33) - EO conducted drive-by of site. At this time; sign on fence indicating: "Vehicle Storage & Parking 831-5000." There was a yellow and white truck in yard (perhaps a vacuum truck), which had "Rent Me 831-5000" painted on it. Observed appliances (washing machines, sink, tub), paint cans, storage units, wood waste, pipes, fencing, 5 pails, 3 light blue roll-off bins with sign: "794-6661 Rent Me," small building and a trailer (storage) with "Hodgins" written on it. There was a man on-site servicing the truck. July 29, 2008 (11:00) - EO Straberger conducted site visit with summer student Kathryn Maton. No one present at the time of site visit. To the left of entrance, the following items were observed: mini fridge, A/C, metal, shopping carts, containers of what appeared to be windshield washer fluid, carbon filter and paint cans. An empty Goulbourn Sanitation roll-off bin was observed farther to the left; adjacent to it was a pile of wood waste and garbage. Two blue "Mister Dumpster 794-6661" bins were also observed: the larger of the two contained four 4L empty waste oil containers and the smaller bin was empty. At the back of the property a flat bed trailer was observed. Scrap metal, tires, two furnace oil tanks, one waste oil tank, approx. five 45-gallon drums (one being plastic) were observed on or next to trailer and a fuel tank was observed beside trailer. Evidence of oil leaking onto the surface of the wooden flat bed trailer was observed. To the right of the trailer logs, garbage, fridge, stove, scrap metal, paint cans, containers containing liquid, and concrete was observed. There are two storage trailers and one shed on-site; contents inside are unknown. A motor boat and a Chev Lumina (Licence) were observed on-site. The site also has storage units which are available for rent. s.21 2008/07/07 - Caller to EO reports waste deposits on 154 Cardevco Road, West Carleton - oil spilled on ground surface near property line, tires, paint cans, trailers, temp building, trucking activity. 2008/07/08 - EO to Site - observed waste deposits at 154 Cardevco, paint cans, with contents, wood waste, white goods, glycol, oil filters, metal waste, plastics, concrete mix, many oil/fuel tanks, some with material, staining noted on ground surface at several locations, incl. at property line and off-site at 158 Cardevco. One roll-off container with waste observed. Site Operator on arrived on site during visit, operating under 1-888-Dr.Waste - previous incident re WMS - no approval yet. Operator advised to remove wastes via licensed waste carriers, incl. haz/LIW wastes. No wastes to be deposited at site w/out COA for waste disposal site. Operator advised to contact 158 Cardevco and arrange for collection of drinking water sample for PHC. 2008/07/08 - Operator to EO by telephone - requested clarification on potential to use his fathers WMS COA # -

EO advised was possible if all vehicle registered under WMS and WMS is still valid. "Old" MWS # could not be provided.

2008/07/17 - EO to Site, observed:

White goods removed; GSSL waste bin on site (empty), Dr. Waste bin empty, waste oil container moved, tires stacked, no other activities evident - paint wastes and other materials not moved.

2008/07/22 - EO to Kris Hodgins - Kris advised he was on holidays last week but was lining up people to put waste in bins and contact Drain-All. Kris had also not contacted neighbour to arrange a drinking water sample. Kris indicated he needed a week to get the work completed.

2008/07/31 - VM msg from KH - advised that watersample from neighbour will be collected 08/08/01. Drain-all may be a couple days before wastes can be collected. GSSL bin to be filled shortly.

2008/08/08 - VM msg from KH - advised that site cleaned. water sample collected and submitted to Accutest. KH out of country for 2 weeks.

November 14, 2008 - EO Rick Watchorn attended site to follow-up on this incident report. No one was present at the site at the time of the visit. There were several piles of waste on-site. Several 'white' appliances were present and several unidentified containers around the site with product in them. Several paint cans were observed with product in them that have been dumped with other waste. There was a flat deck trailer at the back of the site holding several unidentified drums and tanks that were full of some product. There were two fuel tanks at the back of this trailer on the ground. One tank appears empty and one had product in it. There were several 20L pails located beside a small building on-site, the well is on the other side of this building. There was an uncovered drum in front of this small building with unidentified black sludgy liquid in it. Visited 158 Cardevco Rd. which is next door to this site to see if anyone had been by to collect a water sample. Talked to Greg Whelan (partner in TDL Truck Repairs) and he said no one had taken a water sample. Greg suggested I call his partner Tim Kingsbury to see if he had heard anything. Called Tim on his cell phone and he said he had no information on a water sample. Pictures of visit are attached to this IR.

s.21

December 23, 2008 (14:30) - EO Rick Watchorn called Kris Hodgins (KH) and Mr. Hodgins stated that the site at 154 Cardevco Rd. had been cleaned up at the beginning of December. When asked about the outstanding results from the water sample he took, he said that he hasn't received any call back from Accutest yet. He is out of the country at the moment but will be returning at the beginning of January 2009. Mr. Hodgins said he would be in touch regarding the water sample results which he will supply to the Ministry and to his neighbour at 158 Cardevco Rd. (TDL Truck Repairs).

January 13, 2009

14:40 - EO Rick Watchorn called KH regarding water test again. KH said he was going to follow up on the test he said he had submitted awhile ago. He said that this week he will have a free day and he will go and get another test kit to grab another sample of water from his neighbour at 158 Cardevco Rd.

18:30 - visited site to see if waste has been cleaned up. Site appears to be cleaned up since last visit. No more piles of waste are present on site has not been plowed recently so difficult to see ground but appears clean from walking around.

January 20, 2009 (09:40) - EO Rick Watchorn called KH. He has water sampling containers and is getting a water sample today. Will await results of test for further action.

January 31, 2009 - received water test results from Kris Hodgins for 158 Cardevco Rd. Test results are attached to this IR. Tests results show parameters tested for (petroleum hydrocarbons) are below Ontario Drinking Water Objectives, Standards and Guidelines values.

No adverse effect or impairment anticipated at this time. VA compliance attained. No further action recommended at this time.

Links & Comments:

Attachments Names:

Dr.Waste.pdf; Picture 001.jpg; Picture 002.jpg; Picture 003.jpg; Picture 004.jpg; Picture 005.jpg; Picture 006.jpg; Picture 007.jpg; Picture 008.jpg; Picture 009.jpg; Picture 010.jpg; Picture 011.jpg; Picture 012.jpg; Picture 013.jpg; Picture 014.jpg; Picture 015.jpg; Picture 016.jpg; Picture 017.jpg; Picture 018.jpg

Date & Time of Incident

Incident Date Confirmation? Actual
2008/07/08

Source Type:

Sector Type:

Nearest Watercourse:

**Watershed Category
Code:**

Environmental Impact:	Not Anticipated		
Nature of Impact:			
Incident Cause:		Incident Reason:	
Damaged Party:	No		

Contaminants Table						
Contaminant Name	Code	UN#	Limit	Quantity	[units]	[freq]

Controller of Material:		Owner of Material:	
Estimated Clean Up Cost:		Who Cleaned Up:	
% Clean Up:	%	Agencies Involved:	

Voluntary / Mandatory Abatement

Is there Voluntary Abatement Activity?	☒ Yes	☐ No	☐ To be determined
--	--------------------------------------	--------------------------	--

Voluntary / Mandatory Compliance Items

Type	Parent RefNo	Work Summary (may be truncated)	Date	AttainList
VA	5486-7GCNUG	Dr. Waste - proceed with site cle...	2008/07/19	2009/01/31

Offence(s)

Suspected Violation(s)/Offence(s):	
Act - Regulation - Section, Description {General Offence}	

Provincial Officer:

Name: Rick Watchorn
Badge No: 1473

Work Unit:

District/Area Office: Ottawa District Office
Date: 2009/02/02

Signature:



Area Supervisor:

Name: Paul Kehoe

Work Unit:

District/Area Office:

Date:

Ottawa District Office

2009/02/02

Signature:

Paul Kehoe.

Additional Disclosure Information

Reference Number:	5486-7GCNUG	File Storage Number:	SI OC WC CA 100
Module:	Incident Reporting	Module Type:	Legislation Non-Compliance
Cross Reference:	(doc link)	Task Link:	1112-7GCNWL 
Originating Document:		Created by:	Mike Heeringa
Incident Report Reference Number:	5486-7GCNUG		
Date Created:	2008/07/08	Date Completed:	2009/02/02
Bring Forward Date:		Bring Forward Reason:	
Status:	Closed	Main Document Reference Number:	5486-7GCNUG
Program	Waste - Hazardous & Liquid industrial	Activity	Control Documents

General Comments

2008/11/19 08:26:09 AM (Tor Rustad) -
Who should receive this incident report? It was forwarded to the Ottawa District Task box on November 18, 2008.

Signing Comments

Abatement Items

ITEM 1

Type : Voluntary Compliance

Compliance Date : 07/19/2008

Attained : Compliance Attained 01/31/2009

Dr. Waste - proceed with site clean-up, waste removal by licensed carriers, water sample from 158 Cardevco - test for PHC.

ATT: RICK

ACCUTEST LABORATORIES - A New Bodycote Company

CCME METHOD VERIFICATION REPORT

Client: Hodgins, Kris
108 Huntley Manor Dr.
Carp, ON
K0A 1L0
Attention: Mr. Kris Hodgins

Report Number: 29010R3
Date: 2009-01-22
Date Submitted: 2009-01-20

Project:

P.O. Number: MC
Matrix: Water

Samples were analysed by Accutest Method AMCCME2, "Petroleum Hydrocarbons in Water and Soil, CCME/TP11"
This method complies with the reference method for the CCME CWS PHC and is validated for use in the laboratory.
Accutest is accredited by CAEL (ISO 17025) for all CCME F1-F4 fractions as listed in this report.
Data for QC samples (Blank, duplicate, spike) are available on request.

Fractions Analysed Within Acceptable Holding/Analysis Times

	HOLD TIME		ANALYSIS TIME	
	YES	NO	YES	NO
F1 (C6-C10)	☒	☐	☒	☐
F2 (C10-C16)	☒	☐	☒	☐
F3 (C16-C34)	☒	☐	☒	☐
F4 (C34-C50)	☒	☐	☒	☐
F4 (C34-C50) gravimetric (when applicable)	☐	☐	☐	☐

If No then Reasons

Fraction Specific Information

F1

nC6 and nC10 response factors within 30% of Toluene

BTEX subtracted from F1 fraction

If YES was F1-BTEX (C6-C10) reported

F2

nC10, nC16 and nC34 response factors within 10% of their average (F2-F4)

Linearity within 15 % (F2-F4)

Naphthalene subtracted from F2 fraction

If YES was F2-Naphthalene reported

F3

PAH (selected compounds) subtracted from F3 fraction

If YES was F3-PAH reported

F4

C50 response factor within 70% of nC10 + nC16 + nC34 average

Chromatograms descended to baseline by retention time of C50

If NO was F4 (C34-C50) gravimetric reported

YES NO

☒ ☐☒ ☐☒ ☐

YES NO

☒ ☐☒ ☐☐ ☒☐ ☐

YES NO

☐ ☒☐ ☐

YES NO

☒ ☐☒ ☐☐ ☐

Naphthalene (PAH) not requested/analysed

PAH not requested/analysed

APPROVAL:

Mina Nasir
Organic Lab Supervisor

FROM: ERDL-FAX
FROM ACCUTEST LABS 013-727-0222

FAX NO.: 6138231281

(THU) JAN 22 2009 10:06/ST. 15:04/NO. 702014000 P. 2

Jan. 31 2009 12:18PM P1

FROM : ERPL-FAK
FROM ACCUTEST LABS 913-727-6222

FAX NO. : 6139231291

JAN. 31 2009 12:19PM P2

(THU) JAN 22 2009 16:06:57.15:04/NO. 75214006 P 1

ATT: RICK

ACCUTEST LABORATORIES - A New Bodycote Company

REPORT OF ANALYSIS

Client: Hodgins, Kris
108 Hurdley Manor Dr.
Carp, ON
K0A 1L0
Attention: Mr. Kris Hodgins

Report Number: 2901083
Date: 2009-01-22
Date Submitted: 2009-01-20


Project:

P.O. Number: MC
Matrix: Water

Chain of Custody Number: 97629

			LAB ID: 686873						GUIDELINE		
			Sample Date: 2009-01-20								
			Sample ID: 158 Cardewco						OHWSOG		
PARAMETER	UNITS	MRL							TYPE	LIMIT	UNITS
VOLATILE ORGANIC COMPOUNDS - VOCs											
Benzene	ug/L	0.5	<0.5						MAC	5	ug/L
Dihydrobenzene	ug/L	0.5	<0.5						AO	24	ug/L
Toluene	ug/L	0.5	<0.5						AO	24	ug/L
m,p-xylene	ug/L	1.0	<1.0								
o-xylene	ug/L	0.5	<0.5								
VOC SURROGATES											
Toluene-d6	%		99								
CCME Total Petroleum Hydrocarbons											
F1 (C6-C10)	mg/L	0.2	<0.2								
F1-BTEX (C6-C10)	mg/L	0.2	<0.2								
F2 (C10-C16)	mg/L	0.2	<0.2								
F3 (C16-C34)	mg/L	0.2	<0.2								
F4 (C34-C50)	mg/L	0.2	<0.2								

MRL = Method Reporting Limit INC = Incomplete AO = Aesthetic Objective OG = Operational Guideline MAC = Maximum Allowable Concentration IMAC = Interim Maximum Allowable Concentration
Comment:

APPROVAL: 
Mira Nasirai
Organic Lab Supervisor







































OCCURENCE REPORT

Ministry of the
Environment

Location of Occurrence: WEST CARLETON TOWNSHIP 158 CARDEVCO RD @CARP Reg: 4 Dist: OT Municipality: 20613		Source: BRUCE FUELS 35 JAMIE AVE NEPEAN ON Sector: PE Source: TT SIC: 4569 UTM: N: [5024000] E: [414000] Zone: [18]	
Entered: 1998/07/09 14:24	ORIS No. 9800006678	Abstracts: 2	Diaries: 1
Received By: SYLVIA HOLLOWAY		Batch: 3958	I. E. B. No.
Occurrence Type: S	Subtype: LW	Occurrence Date:	1998/07/03
Work Plan:	WG	Occurrence Time:	
Reported By: JOYCE DICK S.L. HODGINS EQUIPMENT		Report to MOE : 1998/07/09 14:24 MOE at Scene: 98/07/14 11:00	
Telephone No. 613-831-9000 x	Alternate No. 613-831-5000 x	Assigned To:	BRYAN DICKMAN
Address: 158 CARDEVCO RD CARP ON Postal Code:		ERP Contacted: Callout: ☐ ERP Name: NSP: ☐	
Syn: BRUCE FUELS-150 L DIESEL TO GROUND DURING DELIVERY-TO BE EXCAVATING SOIL.			
Brief Summary: CALLER REPORTS THAT 150L DIESEL FUEL WAS SPILLED TO ABOVE LOCATION BY BRUCE FUELS, DURING DELIVERY. DIESEL PENETRATED GROUND, BUT IT HAS RAINED SINCE THEN AND CALLER IS UNSURE WHETHER ANYTHING WASHED TO NEARBY DITCHES. OWNER OF S.L. HODGINS, MR SID HODGINS, WAS TOLD BY BRUCE FUELS' CONTACT "REID" (SURNAME UNKNOWN BY CALLER) THAT BRUCE FUELS WOULD BE EXCAVATING AND BACK-FILLING CONTAMINATED SOIL TODAY. CALLER HAD CONTACTED SAC FOR CLEAN-UP ADVICE. [SAC CHECKED ORIS DATA-BASE: CONFIRM NO PREVIOUS NOTIFICATION OF THIS OCCURENCE.]@14:32--TO MOE-OT BRYAN DICKMAN: UPDATED.			
If there are related reports, record initial/master ORIS No. here >>			
Followup Action: X Abatement Y IEB Other BF Date: SPILL WAS NOT REPORTED WHEN IT OCCURRED.			
File Closed: Y Abatement: IEB Other Suspected Violation: 11			
Report Prepared By: BRYAN DICKMAN	Date: 07/14/98	IEB Investigator:	IEB BF Date
Approving Officer GEORGE CLARKE	Date: 07/14/98	Reviewing Officer:	Date
Specify number(s) for routing Original [] [] [] [] []		Continued [] Yes	
Specify number(s) for copy distribution [] [] [] [] [] []			
1. Investigator/E.O.	2. D. O. /File	3. SAC (initial spills)	
4. Reg. Dir. / _____ Mgr.	5. IEB Reg. Spv	6. IEB H.O./file	7. Other _____
SAC Action Class: 1:25 2: 06			

Material 1: DIESEL FUEL
Amount : 150 L
Material 2:

Code : 13
UN No.: 1202
Code :

Amount :		UN No.:
Material 3:		Code :
Amount :		UN No.:
Cause. :		Code. . : 09
Reason. :		Code. . : 02
Person in Control: BRUCE FUELS		Waste GenNum :
Owner : BRUCE FUELS		Waste GenNum :
Agencies Involved :		
Clean up and Restoration Carried out by:		
☒ Controller	☒ Owner	☐ Other
N	N	
% Cleaned up: 0		Estimated Cost:
Were Directions or Approval Given Under		
EPA Part X ☒	Regulation 362 ☒	Manifest No.
Waste Class :		Code . . : 000
Hauler :		Code . . :
Disposal Site :		Code . . :
Environmental Impact:	Nature of Impact:	
C	Soil contamination	Code . . : 07
People/Business Damaged		
(Other than to Owner/Controller) :		
Nature of Damage:		Code . . :



Abstract Entry

Ministry of the
Environment

Abstract Date Time: 07/10/98 08:16	MOE Office: hollowsy	ORIS No. 9800006678	Occurence No: 157790
Text ABSTRACT #1-S.HOLLOWAY\@07:29---FROM REID MCDONALD, BRUCE FUELS: CALLED TO REPORT ABOVE OCCURENCE. HE CLAIMED HE HAD REPORTED IT TO CANUTEC, AND HAD BEEN TOLD SPILLS OF <200L WERE NOT REPORTABLE. SAC EXPLAINED CANUTEC'S FUNCTION AND ONT EPA OBLIGATIONS. CALLER CONFIRMED THAT 80-120 L DIESEL HAD SPILLED DURING AN OVERFILL LATE 98/07/03; DIESEL HAD SPRAYED OUT FROM NOZZLE. CALLER HAD ATTENDED SCENE ON 98/07/04, BUT SAID IT WAS RAINING SO HE COULDN'T TELL HOW MUCH DIESEL WAS THERE/WHERE IT WENT ETC. YESTERDAY 98/07/09 HE WAS ON-SCENE AGAIN AND SAYS SOIL CONTAMINATION RANGES FROM 1/4" TO SHOVEL-DEPTH. HE IS ARRANGING FOR EXCAVATION. SAC REFERRED CALLER TO MOE-OT EO BRYAN DICKMAN TO REPORT FURTHER CLEAN-UP PROGRESS.			



Abstract Entry

Ministry of the
Environment

Abstract Date Time: 08/13/98 08:37	MOE Office: dickmabr	ORIS No. 9800006678	Occurence No: 157790
Text ABSTRACT #2 - B. DICKMAN. PLAYERS NOW INVOLVED. SID HODGINS (831-5000, 725-7069), REID ABROSIOS - BRUCE FUELS (225-6500), DOMINION INSURANCE - ALAN GALAGHER (726-9556), O.M.M. - STEVE WILSON (225-9940). CLEAN-UP HAS NOT TAKEN PLACE YET. HOLE DUG WHERE ORIGINAL SPILL OCCURRED, SPOIL FROM HOLE SET ASIDE ON PROPERTY. AREA STILL SMELLS OF FUEL OIL. WATER WELL CMS. AWAY FROM SPILL AREA. DELAY SEEMS TO BE CAUSED BY INSURANCE COMPANY WANTING TO ENSURE EXTENT OF PROBLEM. OMM WILL BE DOING MORE DRILLING IN THE AREA, HAVE ALREADY TAKEN SAMPLES FROM WELL.			



Diary Entry

Occ_Num: 157790	Reg Num: 9800006678	Reg Sup: 4	MOE Office: dickmabr
Diary Date Time : 1998/07/13 09:34		Diary Type: CON	Org:
Text: CONTACTED BRUCE FUELS REPRESENTATIVE (REID)			



Waste Systems CofA Archive

[Back](#)

All:

by Client Name
by Status
by Year
by Instrument
Number

Applications

Previous Name
Information
Receiver Name
Information
Waste Type
Export Site
Information

Search

Certificate of Approval Waste Management Systems (Archive)

CofA Number:A860993
A860993
Certificate:

C of A information

CofA Status:006 ---- Approved	Issue Date:97/01/17
Instrument Type:Waste Management Systems	Reissue Date:
Reviewer:I. Cooney	Certificate Mailing01/20/97
Mail Registration	Date:
Number:	Revocation Date:
Record Date:01/21/97	Date Completed:01/17/97
Date Received:12/23/96	Hearing Date:
Appeal Date:	
Appeal Resolved?:No	

Client Information

Proponent:SI Hodgins Equipment Ltd.
Operating Name:SI Hodgins Equipment Ltd.
Address:108 Huntley Manor Dr. R.R. #2
City:Carp
Province / State:Ont
Postal Code / Zip:K0A-1L0

Area Co
613831-900

Principal 1:Hodgins, Elroy
Principal 2:
Principal 3:
Principal 4:
Principal 5:
Company NameNo
Changed? (Y/N):
Waste HaulageNo
Outside Ontario?
(Y/N):
Waste Haulage IntoNo
Ontario? (Y/N):
Truck Yard AddressYes
Different from
above?:
Service Area:1000
Ontario Region:000100
MOE District Office402
Code:
Own Sites by C of
A?:

Ontario
South East
Ottawa

Truck Storage

Truck Storage Yard158 CARDEVCO
Address:
City:CARP
Province / State:ONT
Postal Code / Zip:

Receiver Site Information

Receiver File CofA
Number:

CofA Menu

**Pages 33 to / à 34
are not reviewed
ne sont pas revisées**



Under the Environmental Protection Act and the regulations and subject to the limitations thereof, this Provisional Certificate of Approval is issued to:

("Company")

SL Hodgins Equipment Ltd.
108 Huntley Manor Drive
R.R. #2
Carp, Ontario
K0A 1L0

for the Waste Management System serving the Province of Ontario

and subject to the following conditions:

1. Use of this waste management system is limited to the collection, handling and transportation of waste.
2. Except as otherwise provided by these conditions, the waste management system shall be operated in accordance with the application for this Provisional Certificate of Approval dated December 11, 1996 and with the supporting information submitted therewith.
3. Only domestic, commercial and non-hazardous solid industrial waste which includes contaminated soil shall be transported pursuant to this Provisional Certificate of Approval and in any case, no hazardous waste, liquid industrial waste, pathological waste, agricultural waste, processed organic waste or hauled sewage shall be transported pursuant to this Provisional Certificate of Approval.
4. Waste shall only be delivered to a waste disposal site or facility which has a Certificate of Approval or a Provisional Certificate of Approval, and only where the waste being delivered complies with the Certificate of Approval or Provisional Certificate of Approval of the receiving waste disposal site or facility.
5. Any addition, deletion or other change to the fleet of vehicles, trailers and equipment (i.e. year, make, model, serial number and licence number of each vehicle, trailer or piece of equipment) in particular those which are leased or rented, shall be reported to the Director of the Approvals Branch of the Ministry of Environment and Energy within fourteen (14) days of any such change.
6. a. The Company shall notify the Director in writing of any of the following changes within thirty (30) days of the change occurring:
 - i. change of Company name, owner or operating authority;
 - ii. change of Company address or address of new owner or operating authority;

PROVISIONAL CERTIFICATE OF APPROVAL
FOR A WASTE MANAGEMENT SYSTEM

NO. A 860993

Page 2 of 3

- b. In the event of any change in ownership or operator of the waste management system the Company shall notify the succeeding (new owner/operator) company of the existence of this Certificate, and a copy of such notice shall be forwarded to the Director.
- c. The Company shall ensure that all communications made pursuant to this condition will refer to this Certificate number.

The reasons for the imposition of these conditions are as follows:

- 1. The reason for condition 1 is to ensure that this waste management system is only used for the collection, handling and transportation of waste as any activity in addition to those noted may result in a hazard to the health and safety of any person or the natural environment.
- 2. The reason for condition 2 is to ensure that this waste management system is operated in accordance with the application for this Provisional Certificate of Approval and the supporting information submitted therewith and not on a basis or in any way which the Director has not been asked to consider.
- 3. The reason for condition 3 is to ensure that this waste management system is only used to collect, handle and transport waste which it is able to collect, handle and transport in a suitable manner. The collection, handling and transportation of waste which this waste management system is not able to collect, handle and transport may create a nuisance or result in a hazard to the health and safety of any person or the natural environment.
- 4. The reason for condition 4 is to ensure that the waste management system is only used to take waste materials to waste disposal sites or facilities that have been approved by the Ministry of Environment and Energy, or the appropriate corresponding regulatory agency, to accept the waste this system is approved to collect, handle and transport under this Provisional Certificate of Approval. Taking these materials elsewhere may create a nuisance or may result in a hazard to the health and safety of any person or the natural environment.
- 5. The reason for condition 5 is to ensure that all vehicles, trailers and equipment including those leased or rented for operation under this Provisional Certificate of Approval have been approved as part of a suitable waste transportation system to collect and transport waste as an unsuitable waste transportation system could result in a hazard to the health and safety of any person or the natural environment.
- 6. The reason for condition 6 is to ensure that the waste management system is operated under the corporate, limited or the applicant's own name which appears on the application and supporting information submitted for this Provisional Certificate of Approval and not under any name which the Director has not been asked to consider.

PROVISIONAL CERTIFICATE OF APPROVAL
FOR A WASTE MANAGEMENT SYSTEM
NO. A 860993
Page 3 of 3

In accordance with Section 139 of the Environmental Protection Act, R.S.O. 1990 c. E-19, you may by written notice served upon me and the Environmental Appeal Board within 15 days after receipt of this Notice, require a hearing by the Board. Section 142 of the Environmental Protection Act, as amended provides that the Notice requiring a hearing shall state:

1. *The portions of the approval or each term or condition in the approval in respect of which the hearing is required, and;*
2. *The grounds on which you intend to rely at the hearing in relation to each portion appealed.*

In addition to these legal requirements, the Notice should also include:

3. *The name of the appellant;*
4. *The address of the appellant;*
5. *The Certificate of Approval number;*
6. *The date of the Certificate of Approval;*
7. *The name of the Director;*
8. *The municipality within which the waste management system is located;*

And the Notice should be signed and dated by the appellant.

This Notice must be served upon:

The Secretary,
Environmental Appeal Board,
112 St. Clair Avenue West,
Suite 502,
Toronto, Ontario,
M4V 1N3

AND

The Director,
Section 39, Environmental Protection Act,
Ministry of Environment and Energy,
250 Davisville Avenue, 3rd Floor,
Toronto, Ontario.
M4S 1H2

DATED AT TORONTO this 17th day of January, 1997.

THIS IS A TRUE COPY OF
THE ORIGINAL CERTIFICATE
SIGNED BY

A. DOMINSKI, P. ENG.

MAILED ON Jan 20/97
BY [Signature]

IC/am
c.c.: District Manager, Ottawa



Ontario

Ministry of
Environment
and EnergyApplication For A Provisional Certificate Of Approval
For A Waste Management System

* Ce formulaire est disponible en français

For Office Use Only			
Application Number	Payment received	Date	Initials
160993	\$ 378.00	Dec 30/92	18

Personal information contained on this form is collected under the authority of the Environmental Protection Act, Sections 19 and 38, R.S.O. 1990, Reg. 347. The purpose of this form is to apply for approval for the operation of a Waste Management System. Questions should be directed to the Information Officer, Approvals Branch, Ministry of Environment and Energy, 250 Davisville Avenue, 3rd Floor, Toronto, Ontario M4S 1H2.

Any documents or portions thereof which you are requesting to be exempted from disclosure under the provision of the Freedom of Information and Privacy Act must be marked "confidential".

Instructions

See notes on last page for form completion instructions. The following information is required to process this application. Completed applications must be submitted to the Approvals Branch, Ministry of Environment and Energy. **Incomplete applications will be returned.**

Effective October 1, 1992, fee payment will be required for any new complete application and request for amendment received on or after this date (see notes for fee schedule). A certified cheque or money order must be made payable to the Minister of Finance. **PLEASE DO NOT SEND CASH IN THE MAIL.**

All applicants must complete Part A and appropriate sections in Part B and Part C

Part A

An individual and a corporation may apply together for a Certificate of Approval to operate a Waste Management System, under the Environmental Protection Act and Regulations. This application is made by:

(a) Applicant / Company name

S. L. McQuinn Equipment Ltd.

(b) Operating name (if different than (a))

Same

Part B

Reason for application

☒ New issue
(Complete
Sections 1 to 6)

☐ Reissue
(Complete
this box
only)

Previous Certificate of Approval No. A

N/A

Changes since last issue

☐ Address☐ Receiving sites☐ Service area☐ Waste types☐ Corporate Officers /
Directors☐ Legal Name☐ Vehicle(s)☐ Waste classes☐ Other, describe

Additional information attached?

☐ Yes☐ No

Proof of legal name

Attached as required

(a) For each applicant who is applying as an individual, enclose a copy of a Birth Certificate.

☐ Yes☐ No

(b) Business Registration (Form 1, 2 or 3 of Reg. 182 (Formerly Reg. 189) filed under the Corporations Information Act or the most recent declaration filed under the Partnerships Registration Act.

☐ Yes☐ No

(c) Photocopy of the most recent Form 1, 2 or 3 of Reg. 182, (Formerly Reg. 189) stamped "RECEIVED" by the Ministry of Consumer and Commercial Relations, filed under the Corporations Information Act or the most recent declaration filed under the Partnership Registration Act.

☐ Yes☐ No

(a) Head office address

(b) Mailing address if different from 2(a)

108 HUNTLEY MANOR DR
CORNWALL

Postal Code

K6C 1L9

SAME

Postal Code

000038

Part B (cont'd.)

Section 3	Name of contact person <i>ELROY HOUNG</i>	Title <i>President</i>	Telephone <i>(413) 231-7100</i>
-----------	--	---------------------------	------------------------------------

Wastes handled

(a) Non-Subject Waste

- ☒ Domestic ☒ Commercial ☒ Non-hazardous solid industrial
☐ Asbestos waste in bulk
☐ Other, please describe *N/A*

(b) Subject Waste

- ☐ Non-hazardous liquid industrial ☐ Hazardous liquid ☐ Hazardous solid
☐ Other, please describe

(c) List all waste classes transported for each category of subject waste (see Ontario Waste Classes)
(This box must be completed for Subject Waste Transportation)

Non-hazardous liquid industrial	Hazardous liquid	Hazardous solid
<i>N/A</i>		

Additional list attached? ☐ Yes ☐ No

(d) Disposal facilities to be used for

- ☒ Non-Subject waste ☐ Subject waste

(e) Site(s)

- ☒ Any site approved by the Ontario Ministry of Environment and Energy.
☐ Sites approved by a Regulatory Agency outside of Ontario.
 (Please list provinces / states to which waste is intended for transport.)

Province / State	Province / State

Additional list attached? ☐ Yes ☐ No

(f) Additional information requirements for transporters of 243 and/or 312 Subject Waste classes only

- Driver training manual attached? ☐ Yes ☐ No
 Operations manual attached? ☐ Yes ☐ No
 Irrevocable letter of credit provided? ☐ Yes ☐ No

PART B (cont'd.)

Section 5

(1) Vehicle information

(a) Address of truck storage yard

☐ Same as listed in Section 2

☒ Indicated as follows: 157-222-2222 Corp. Ont.

(b) List all vehicles and equipment to be used in the operation of the Waste Management System

Year	Make	Model	Serial #	Licence plate #	Province / State

Additional list attached? ☐ Yes ☐ No

(c) Are all vehicles owned by the applicant / company?

☒ Yes

☐ No (provide an explanation on vehicle ownership arrangements in the space provided below)

(2) This box is for Subject Waste transportation only

(a) All current and future drivers will be trained in accordance with Reg. 347 and all pertinent environmental legislation? ☐ Yes ☒ No

(b) Each vehicle used to transport a specific class is suitable for that waste transportation in order to preserve the health and safety of the public and the natural environment? ☐ Yes ☒ No

Section 6

This section must be completed for Subject Waste transportation

Insurance

Confirmation of a minimum of \$1,000,000.00 Liability Insurance for Subject Waste transportation. ☐ Yes ☒ Not applicable

Please list or describe additional insurances, for example, environmental impairment liability insurance. ☐ Not applicable

PART C

I hereby certify that all of the information in this application is true and that I understand it is an offence, under the Environmental Protection Act, to provide a false statement.

Signature of Individual / Officer / Director of Company

Print name of Individual / Officer / Director of Company

Title

Date

000040

NOTES FOR APPLICATION FOR A PROVISIONAL CERTIFICATE OF APPROVAL FOR A WASTE MANAGEMENT SYSTEM

PART A The application for a Provisional Certificate of Approval shall be made by the person or the municipality responsible for the system and its operation in conformity with the Environmental Protection Act and Regulations. The applicant shall also be responsible for the particulars provided in the application and with the supporting information provided herewith. By signing the application, the applicant accepts all the responsibilities set out for the "Owner" or "Operator" in the relevant clauses of the Environmental Protection Act and the Regulations.

PART B Issue means a first time application. Re-issue means that the Provisional Certificate of Approval was previously issued for the system.

Complete appropriate sections for the following amendments:

Address	-	Section 2
Receiving Sites	-	Section 4(d) and (e)
Service Area	-	Shaded Area
Waste Types	-	Section 4
Corporate Officers/ - Directors	-	Section 1(b) or 1(c)
Legal Name	-	For Companies - Section 1(b) or 1(c) For Individuals - Section 1(a)
Vehicles	-	Section 5
Waste Class	-	Section 4(c)
Other	-	Please attach

Minor amendments may be made in the Shaded Area.

Section 1 Ontario Filings: For a trade or style name, business registration documents must be attached. Corporations must attach the most recent "Initial Notice or Notice of Change", listing the corporate officers and directors. (Form 1, 2 or 3.) Extra-provincial corporations must provide a copy of their Extra-Provincial Corporations Licence. The filing must be stamped "received" by the Ministry of Consumer and Commercial Relations.

Federal Filing: Corporations must provide their Articles of Incorporation, Form 3 and Form 6.

Section 2 Company address.

Section 3 A contact person must be provided in the event that there are inquiries with respect to the application, a phone number should also be included.

Section 4 (a) Non-subject waste includes non-hazardous waste comprised of: domestic, commercial, non-hazardous solid industrial, or asbestos waste in bulk, etc. For non-subject waste, other waste includes spill clean-up material and contaminated soil.

(b) Subject waste includes non-hazardous liquid industrial, hazardous liquid and hazardous solid waste. For subject waste, other waste includes dust suppressant. The applicant may choose to transport both non-subject and subject waste.

(c) All Ontario waste classes transported must be separated into their specific categories.

(d) Identify types of waste transported.

(e) The applicant may select any Ontario licensed site or list provinces/states for out-of-province approved sites.

(f) Any applicant proposing to transport biomedical or PCB waste must provide:

- a detailed driver training manual outlining the driver training and responsibilities with respect to waste shipment;
- a detailed operations manual outlining the packaging methods, waste loading and unloading procedures, as well as a contingency plan in the event of a spill; and
- an irrevocable letter of credit must be provided and deemed to be acceptable prior to the issuance of the system. For biomedical carriers - a minimum of \$50,000, for PCB carriers - \$100,000.

Section 5(1) (a) Address of vehicle storage yard, this location may not be a residential area or area used by the public at large.

(b) Provide a detailed listing of vehicles and equipment. If a legible copy of the vehicle registration is attached for each vehicle or piece of equipment, then the year, make, model, serial number and licence plate number do not need to be listed.

(c) The applicant must own one vehicle or at least have a "lease to own" agreement with a leasing company.

Section 5(2) (a) Confirmation that drivers are trained in accordance with O.Reg. 347 (formerly O.Reg. 309).

(b) Confirmation of vehicle suitability for all waste transported.

Section 6 (a) A photocopy of the Certificate of Insurance must be supplied confirming that all vehicles and equipment operating as part of the waste management system are insured for a minimum of \$1,000,000 liability insurance.

(b) List any insurance coverage which cover spill incidents, i.e., Environmental Impairment Liability Insurance, etc.

PART C The individual signing the application must be the individual applying. If this is a company, the person signing the application must be a director or officer of the company.

FEE SCHEDULE

1. For all new applications for a Waste Management System approval, the fee will be \$300.
2. For applications to amend a Waste Management System, the fee is \$50.
3. No fee is required when changes to a Certificate of Approval are required due to compliance requirements of an existing Certificate of Approval.

NOTE: Fee payment must be made on submission of the application. A certified cheque or money order should be made payable to the Minister of Finance. Please do not send cash.

APPENDIX F
TSSA Archival Search Requests



345 Carlingview Drive
Toronto, Ontario M9W 6N9
Tel.: 416.734.3300
Fax: 416.231.1626
Toll Free: 1 877.682.8772

www.tssa.org

Tel: (416) 734-3570

Fax: (416) 734-3568

Email: publicinformationservices@tssa.org

03 August 2016

File No: FS 56835

Kurt Frommann
Project Technologist
Environmental Due Diligence & Remediation
PINCHIN LTD.
555 Legget Drive
Suite 1001, Tower A
KANATA ON K2K2X3

Dear Sir:

RE: 158 Cardevco Road, Ottawa, Ontario – Your Project No: 117492

This is with reference to your request and fee of \$50.00 + HST, for information on the above location.


After a search of our files, TSSA has no record of any outstanding instructions, incident reports, fuel oil spills, or contamination records respecting the above-mentioned property.

We have no record of retail facilities or underground storage tanks licensed or registered at the above address.

TSSA cannot guarantee having information on sites that have not been licensed since 1987.

It should be noted that the Fuels Safety Division did not register private fuel underground/aboveground storage tanks prior to January of 1990 or furnace oil tanks prior to May 1, 2002. Also note that the Fuels Safety Division does not register waste oil tanks in apartments, office buildings, residences etc. or ABOVEGROUND gas or diesel tanks.

Yours truly,

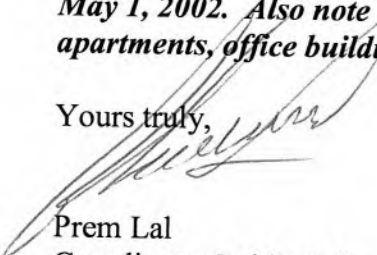
Prem Lal
Coordinator Public Information Services

APPENDIX G
Maps




ANSI Report

ANSI Units Found within 2000 m of
158 Cardevco Road Ottawa ON

Page 1
Order No.
22100605450



No ANSI units found within search area.

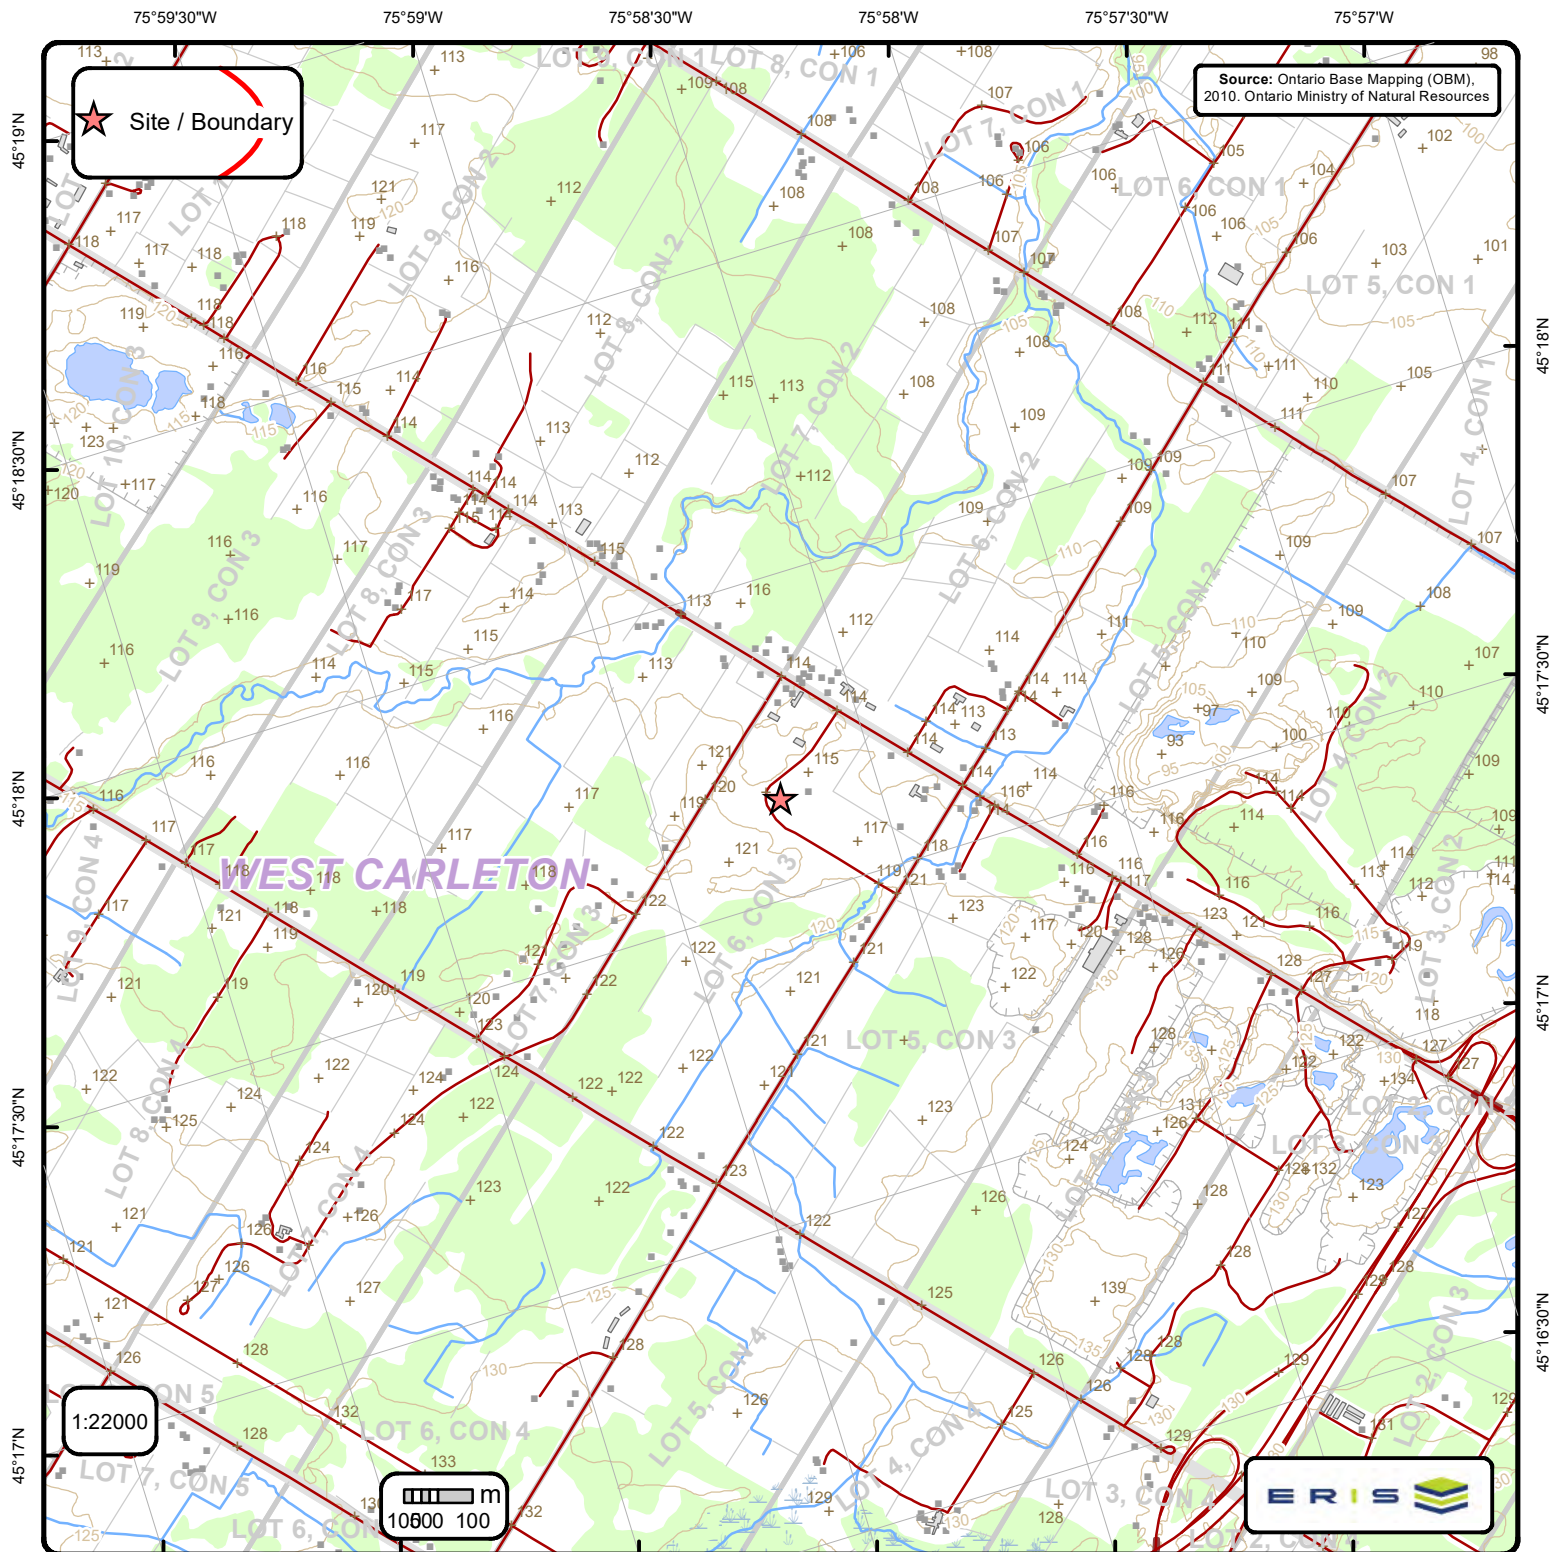

Ontario Base Mapping (OBM) Data

Order No. 22100605450

+	Spot Height (metre)	—	Transportation Structure	—	Contour Line	■	Wooded Area
■	Building Point	—●—	Utility Line	□	Pit or Quarry	■	Conservation Authority
⚡	Towers	—	Water Structure	■	Waterbody	■	Conservation Area
●	Utility Site Point	—	Drainage Line Feature	■	Wetlands	■	Municipal Park
—	Misc. Line	—	River or Stream	■	Concession	■	Provincial Park
—+—	Railroads	□	Airports	■	Lots	■	National Park
—+—	Roads	■	Tanks	■	Municipality	■	Nature Reserve
- - -	Trail	■	Building to Scale	■	Land Ownership		