

Phase I Environmental Site Assessment

240 Bank Street
Ottawa, Ontario

Prepared for 240 Bank Street Holdings Ltd.

Report: PE6874-1

Date: February 4, 2025



TABLE OF CONTENTS

EXECUTIVE SUMMARY	ii
1.0 INTRODUCTION	1
2.0 PHASE I PROPERTY INFORMATION.....	2
3.0 SCOPE OF INVESTIGATION	3
4.0 RECORDS REVIEW	4
4.1 General.....	4
4.2 Environmental Source Information	11
4.3 Physical Setting Sources	18
5.0 INTERVIEWS	20
6.0 SITE RECONNAISSANCE.....	20
6.1 General Requirements.....	20
6.2 Specific Observations at the Phase I Property	20
7.0 REVIEW AND EVALUATION OF INFORMATION	25
7.1 Current and Past Uses	25
7.2 Conceptual Site Model.....	26
8.0 CONCLUSIONS	30
8.1 Assessment.....	30
8.2 Recommendations.....	31
9.0 STATEMENT OF LIMITATIONS	32
10.0 REFERENCES	33

List of Figures

Figure 1 - Key Plan
Figure 2 - Topographic Map
Drawing PE6874-1 - Site Plan
Drawing PE6874-2 - Surrounding Land Use Plan

List of Appendices

Appendix 1 Plan of Survey
Aerial Photographs
Site Photographs

Appendix 2 MECP Freedom of Information Acknowledgement Letter
MECP Well Records
TSSA Correspondence
City of Ottawa HLUI Request
ERIS Report

Appendix 3 Qualifications of Assessors

EXECUTIVE SUMMARY

Assessment

Paterson Group was retained by 240 Bank Street Holdings Ltd., to conduct a Phase I-Environmental Site Assessment (ESA) for 240 Bank Street, in the City of Ottawa, Ontario. The purpose of this Phase I-ESA was to research the past and current use of the Phase I Property and 250m Phase I Study Area, and to identify any environmental concerns with the potential to have impacted the Phase I Property.

Based on the available historical information, the Phase I Property was initially developed with commercial structures sometime prior to 1888. The Phase I Property was redeveloped with the existing commercial building circa 1974. No historical potentially contaminating activities (PCAs) were identified on the Phase I Property.

Based on the available historical information, adjacent and surrounding properties within the Phase I Study Area were developed from primarily commercial and residential purposes. Former printers and automotive service garage were identified on the properties addressed 346 and 348 Lisgar Street, adjacent to the west of the Phase I Property and are considered to represent APECs on the Phase I Property. Remaining historical PCAs identified in the Phase I Study Area are not considered to represent APECs on the Phase I Property due to their separation distance and/or the down/cross-gradient orientation with respect to the Phase I Property.

Following the historical research, a site visit was conducted. The Phase I Property is occupied by a six-storey commercial building with a full basement level. The ground floor houses three active retail stores, while the upper floors are utilized as office spaces by various tenants. No environmental concerns were identified with the current use of the Phase I Property.

Land use within the Phase I Study Area consists of primarily commercial (offices, restaurant, medical clinic, various stores, etc.) along with residential and community use. A tailoring and dry-cleaning establishment is located at 272 Bank Street, approximately 70m southeast of the Phase I Property. Additionally, a dry cleaner is situated at 395 Somerset Street West, approximately 130m south of the Phase I Property. Based on the separation distance with respect to the Phase I Property, these identified PCAs are not considered to represent an environmental concern on the Phase I Property.

Based on the findings of the Phase I ESA, it is **our opinion that a Phase II-Environmental Site Assessment is required for the Phase I Property.**

Recommendations

Based on the age of the subject building (circa 1974), asbestos containing building materials may be potentially present within the structure. Potential ACMs observed in the subject buildings include drywall joint compound, vinyl floor tiles, suspended ceiling tiles and stippled plaster. These materials were observed to be in fair to good condition at the time of the site inspection and do not represent an immediate concern to the building's occupants. An asbestos survey of the subject building should be conducted in accordance with Ontario Regulation 278/05, under the Occupational Health and Safety Act, prior to any proposed demolition activities, if one has not already been conducted.

Based on the age of the subject buildings (circa 1974), lead-based paints may be present on any original or older painted surfaces. The painted surfaces within the subject buildings were generally observed to be in good condition and do not pose an immediate concern to the occupants of the building. Major work involving lead-based paint or other lead containing products must be done in accordance with O. Reg 843, under the Occupational Health and Safety Act.

It is recommended that a Designated Substance Survey (DSS) be conducted for the existing building prior to any future renovation or demolition activities.

1.0 INTRODUCTION

At the request of 240 Bank Street Holdings Ltd., Paterson Group (Paterson) conducted a Phase I-Environmental Site Assessment (Phase I-ESA) for 240 Bank Street, in the City of Ottawa, Ontario. The purpose of this Phase I-ESA was to research the past and current use of the Phase I Property and properties within the Phase I Study Area to identify any potentially contaminating activities (PCAs) that would result in areas of potential environmental concern (APECs) on the subject land.

Paterson was engaged to conduct this Phase I-ESA by Mr. Elliot Drazin with 240 Bank Street Holdings Ltd. Mr. Elliot Drazin can be reached by telephone at (514)-566-8826.

This report has been prepared specifically and solely for the above noted project which is described herein. It contains all our findings and results of the environmental conditions at this site.

This Phase I-ESA report has been prepared in general accordance with Ontario Regulation (O.Reg.) 153/04, as amended, under the Environmental Protection Act, and CSA Z768-01 (reaffirmed 2022). The conclusions presented herein are based on information gathered from a limited historical review and field inspection program. The findings of the Phase I-ESA are based on a review of readily available geological, historical and regulatory information and a cursory review made at the time of the field assessment. The historical research relies on information supplied by others, such as, local, provincial and federal agencies and was limited within the scope-of-work, time and budget of the project herein.

2.0 PHASE I PROPERTY INFORMATION

Address:	240 Bank Street, Ottawa, Ontario.
Legal Description:	Lot 34 (South Lisgar Street), Registered Plan 12281, City of Ottawa.
Property Identification Number (PIN):	04114-0320.
Location:	The Phase I Property is located on the south side of the intersection of Bank Street and Lisgar Street, in the City of Ottawa, Ontario. Refer to Figure 1 - Key Plan in the Figures section following the text.
Latitude and Longitude:	45° 24' 59.167" N, 75° 41' 51.456" W
Site Description:	
Configuration:	Rectangular
Area:	0.07 ha (approximate)
Zoning:	TM H (19) – Traditional Mainstreet Zone
Current Use:	The Phase I Property is currently occupied by a six-storey commercial building.
Services:	The Phase I Property is located in a municipally serviced area.

3.0 SCOPE OF INVESTIGATION

The scope of work for this Phase I – Environmental Site Assessment was as follows:

- ☐ Determine the historical activities on the Phase I property and Study Area by conducting a review of readily available records, reports, photographs, plans, mapping, databases, and regulatory agencies;
- ☐ Investigate the existing conditions present at the Phase I property and Study Area by conducting site reconnaissance;
- ☐ Conduct interviews with persons knowledgeable of current and historic operations on the subject properties, and if warranted, neighbouring properties;
- ☐ Present the results of our findings in a comprehensive report in general accordance with the requirements of O.Reg. 153/04, as amended, under the Environmental Protection Act, and CSA Z768-01 (reaffirmed 2022);
- ☐ Provide a preliminary environmental site evaluation based on our findings;
- ☐ Provide preliminary remediation recommendations and further investigative work if contamination is suspected or encountered.

4.0 RECORDS REVIEW

4.1 General

Phase I-ESA Study Area Determination

A radius of approximately 250m was determined to be appropriate as a Phase I Study Area for this assignment. Properties outside the 250m radius are not considered to have impacted the subject land, based on their significant distance from the site.

First Developed Use Determination

Based on a review of available historical information, the Phase I Property was first developed with commercial structures sometime prior to 1888. The Phase I Property was redeveloped with the existing commercial (mainly office) building in 1974.

Fire Insurance Plans (FIPs)

Fire Insurance Plans (FIPs) from 1888, 1912 and 1956 were reviewed for the area of the subject site and surrounding properties.

In the 1888 Fire Insurance Plans (FIPs), the Phase I Property consists of several smaller buildings with multiple addresses. The site is occupied by commercial structures, including stores and plumbing-related businesses. Surrounding properties feature a mix of commercial and residential developments. No environmental concerns were identified in the 1888 FIPs.

In the 1912 Fire Insurance Plans (FIPs), the Phase I Property is occupied by structures similar to those noted in the 1888 FIPs. The stores house businesses such as dyers and cleaners, a Chinese laundry, and a plumber. Given the period of operation, the former use of the property for laundry and cleaning is presumed to have operated without the use of chemicals and is therefore not considered a potentially contaminating activity (PCA). Surrounding properties feature a mix of commercial and residential developments. A machine shop, located at 431 Lisgar Street (now part of 290 Nepean Street), is situated approximately 245 meters west of the Phase I Property. Based on its separation distance with respect to the Phase I Property, the identified PCA is not considered to represent an environmental concern on the Phase I Property.

In the 1956 Fire Insurance Plans (FIPs), the Phase I Property remains occupied by structures similar to those noted in the 1912 FIPs, including uses such as office space, a beauty parlor, a plumber's shop, and a paper warehouse. Surrounding

properties within the Phase I Study Area in the 1956 FIPs are depicted as a mix of residential, commercial and industrial buildings.

Potentially contaminating activities (PCAs) identified within the Phase I Study Area from a review of the 1956 FIPs are summarized in Table 1.

Table 1 – Potentially Contaminating Activities Fire Insurance Plans (1956) Review Summary			
Address	Potentially Contaminating Activity	Distance / Orientation from Site	Area of Potential Environmental Concern (Y/ N)
346 Lisgar Street (now part of 360 Lisgar Street)	Former Printing Shop	Adjacent West	Y
348 Lisgar Street (now part of 360 Lisgar Street)	Former Automotive Service Garage (with three associated USTs)	Adjacent Southwest	Y
318 Lisgar Street	Former Laundry (possibly dry cleaners)	35 m East	N
433 Cooper Street	Former Glass Industry	50 m Southwest	N
370 Lisgar Street	Former Automotive Service Garage	60 m West	N
420-446 Cooper Street	Former Dairy Company with Truck Storage and Repair (with one associated UST)	65 m South	N
300 Lisgar Street	Former Glass Industry	70 m East	N
375 Lisgar Street	Former Automotive Service Garage (with one associated UST)	75 m West	N
241 Kent Street (now part of 235 Kent Street)	Former Retail Fuel Outlet (with four associated USTs)	115 m West	N
448-456 Cooper Street (now part of 450 Cooper Street)	Former Paper Sales Ltd. with on-site Cleaning and Pressing	120 m Southwest	N
146 Nepean Street (now part of 144 Nepean Street)	Former Dry Cleaners	140 m Northeast	N
429 Somerset Street West	Former Retail Fuel Outlet (with four associated USTs)	160 m Southwest	N
387 McLaren Street (now part of 294 Bank Street)	Former Automotive Service Garage	190 m South	N
443 Somerset Street West	Former Retail Fuel Outlet (with four associated USTs)	195 m Southwest	N
154 O'Connor Street	Former Retail Fuel Outlet (with three associated USTs)	200 m Northeast	N

**Table 1 – Potentially Contaminating Activities
Fire Insurance Plans (1956) Review Summary**

Address	Potentially Contaminating Activity	Distance / Orientation from Site	Area of Potential Environmental Concern (Y/ N)
324 Laurier Avenue West	Former Dry Cleaners	205 m Northwest	N
328 Kent Street (now divided in multiple addresses)	Former Retail Fuel Outlet (with four associated USTs)	225 m Southwest	N

The former printing shop addressed 346 Lisgar Street (now part of 360 Lisgar Street), adjacent to the west of the Phase I Property and the former automotive service garage with 3 USTs addressed 348 Lisgar Street (now part of 360 Lisgar Street), adjacent to the west of the Phase I Property are considered to represent APECs on the Phase I Property.

Based on the respective separation distances relative to the Phase I Property, the remaining off-site PCAs identified in the FIPs are not considered to represent an environmental concern on the Phase I Property.

It should be noted that civic addresses have changed over the years and those listed above may not currently exist. The respective distances of the above noted activities from the Phase I Property were determined using FIPs and the City of Ottawa electronic mapping website.

The PCAs identified during a review of the FIPs are illustrated on Drawing PE6874-2 – Surrounding Land Use Plan, provided in the Figures section following the text.

City of Ottawa Street Directories

City directories for the Phase I Property and neighbouring properties in the Phase I Study Area were reviewed in approximate ten-year intervals, between 1900 and 2011.

The Phase I Property, encompassing 234, 236, 238, and 240 Bank Street, has been addressed 240 Bank Street collectively since 1965. Based on historical city directories, the property has predominantly been listed as commercial, with occasional residential use noted in one or more structures for brief periods.

A company, Argue & McColl Coal, was listed at the property in 1916, from 1918 to 1922, from 1928 to 1933, and in 1940. Another company, FW Ltd. Coal, was listed from 1954 to 1963. Both companies functioned as coal wholesalers, and other listings of the Phase I Property from similar years indicate that the property likely

was used as office space for coal companies during that time. The identified former use of the Phase I Property as an office space for coal wholesaler companies is not considered to represent an environmental concern on the Phase I Property.

The city directories also revealed the presence of a Chinese laundry operating on the property between 1910 and 1916, as well as a dyer listed from 1903 to 1914. As discussed in FIP section, given the period of operation, the former use of the property for laundry, dyer and cleaning is presumed to have operated without the use of chemicals and/or heavy machinery and is therefore not considered a potentially contaminating activity (PCA).

Surrounding properties in the Phase I Study Area were historically listed for residential and commercial uses. Potentially contaminating activities identified from a review of the City Directories are summarized in Table 2.

Table 2 - Potentially Contaminating Activities City Directories Review Summary					
Listing	Address	Approx. Distance from Phase I Property	Years Listed	Potentially Contaminating Activity	Represents an Area of Potential Environmental Concern (Y/N)
Special Auto Service of Canada	346 Lisgar Street (now part of 360 Lisgar Street)	Adjacent to West	1921	Former Automotive Service Garage	Y
Lisgar Street Garage	346 Lisgar Street (now part of 360 Lisgar Street)	Adjacent to West	1931-1940	Former Automotive Service Garage	Y
Lillico Garage / City Radiator Service	348 Lisgar Street (now part of 360 Lisgar Street)	Adjacent to West	1946-1959	Former Automotive Service Garage	Y
Miller Print Shoppe	346 Lisgar Street (now part of 360 Lisgar Street)	Adjacent to West	1959	Former Printers	Y
Centre Laundrymaid	318 Lisgar Street	35 m East	1950-1959	Former Dry Cleaners	N
Norge Laundry & Cleaning Village	318 Lisgar Street	35 m East	1970	Former Dry Cleaners	N
Cleanaway	318 Lisgar Street	35 m East	1980-1989	Former Dry Cleaners	N
Chinese Laundry	393 Cooper Street (now part of 251 Bank Street)	40 m Southeast	1921	Former Possible Dry Cleaners	N
Houg Sing Laundry	393 Cooper Street (now part of 251 Bank Street)	40 m Southeast	1931-1940	Former Dry Cleaners	N
Capital Glass & Paint Co. Ltd.	433 Cooper Street	50 m Southwest	1931-1940	Former Glass Industry	N

**Table 2 - Potentially Contaminating Activities
City Directories Review Summary**

Listing	Address	Approx. Distance from Phase I Property	Years Listed	Potentially Contaminating Activity	Represents an Area of Potential Environmental Concern (Y/N)
Consolidated Glass Industries Ltd.	433 Cooper Street	50 m Southwest	1950- 1959	Former Glass Industry	N
Parker's Cleaners & Dryers Ltd.	214 Bank Street (now part of 212 Bank Street)	65 m North	1940	Former Dry Cleaners	N
Draicchio Tailoring & Cleaning	272 Bank Street	70 m Southeast	1989	Former Dry Cleaners	N
Brown's Cleaners & Tailors Ltd.	211 Bank Street (now part of 178 Nepean Street)	70 m North	1980- 1989	Former Dry Cleaners	N
Brown's Cleaners	211 Bank Street (now part of 178 Nepean Street)	70 m North	2000	Former Dry Cleaners	N
Mail-o-metric direct Mail Printing	230 Nepean Street	85 m Northwest	1969	Former Printers	N
Bill's Battery Service Garage	375 Cooper Street	90 m East	1931	Former Automotive Service Garage	N
Bill's Auto Service	375 Cooper Street	90 m East	1940	Former Automotive Service Garage	N
Woo John Laundry	238 Nepean Street (now part of 235 Kent Street)	100 m Northwest	1941	Former Dry Cleaners	N
United Cleaners & Tailors	286 Bank Street (now part of 282 Bank Street)	100 m Southeast	1940- 1949	Former Dry Cleaners	N
Multiple Listing	177 Nepean Street	105 m Northeast	1916- 1931, 1941	Former Dry Cleaners	N
Multiple Listing	171 Nepean Street	110 m Northeast	1916, 1931- 1959, 1989	Former Printers	N
De Fonteny French Cleaners	200 Bank Street (now part of 196 Bank Street)	115 m Northwest	1940	Former Dry Cleaners	N
Parker Cleaners & Dryers	287 Bank Street (now part of 271 Bank Street)	120 m Southeast	1959- 1960	Former Dry Cleaners	N
Mouson's Deluxe Dry Cleaners	146 Nepean Street (now part of 144 Nepean Street)	140 m Northeast	1949- 1959	Former Dry Cleaners	N
Multiple Listing	429 Somerset Street West	160 m Southwest	1947- 1987	Former Retail Fuel Outlet	N
Ottawa Motor Sales	296 Bank Street (now part of 294 Bank Street)	165 m Southeast	1927	Former Automotive Storage and Sales	N

Table 2 - Potentially Contaminating Activities City Directories Review Summary					
Listing	Address	Approx. Distance from Phase I Property	Years Listed	Potentially Contaminating Activity	Represents an Area of Potential Environmental Concern (Y/N)
Campbell Motor Sales	296 Bank Street (now part of 294 Bank Street)	165 m Southeast	1940	Former Automotive Storage and Sales	N
Long Wing Laundry	290 Kent Street (now part of 288 Kent Street)	185 m Southwest	1967	Former Dry Cleaners	N
Spic & Span Cleaners & Dryers	301 Bank Street	185 m Southeast	1959	Former Dry Cleaners	N
Multiple Listing	443 Somerset Street West	195 m Southwest	1947-2010	Former Retail Fuel Outlet & Automotive Service Garage	N
Tyrell Printers	305 Bank Street	200 m Southeast	1959	Former Printers	N
Parker Cleaners & Dryers	310 Bank Street (now part of 294 Bank Street)	200 m Southeast	1949	Former Dry Cleaners	N
Brookshire Cleaners & Dryers	310 Bank Street (now part of 294 Bank Street)	200 m Southeast	1950-1970	Former Dry Cleaners	N
Multiple Listing	154 O'Connor Street	200 m Northeast	1940-2010	Former Retail Fuel Outlet	N
Chinese Laundry	324 Laurier Avenue West	205 m Northwest	1916	Former Dry Cleaners	N
Chung Mark Laundry	324 Laurier Avenue West	205 m Northwest	1931-1941	Former Dry Cleaners	N
Brookshire Cleaners Ltd.	324 Laurier Avenue West	205 m Northwest	1949-1969	Former Dry Cleaners	N
Young's Supply Co. Auto Accessories	302-304 Laurier Avenue West (now part of 171 Bank Street)	210 m North	1941-1949	Former Automotive Storage and Sales	N
Spic & Span Cleaners	302 Laurier Avenue West (now part of 171 Bank Street)	210 m North	1941-1949	Former Dry Cleaners	N
Kent Street Shell Service Station	328 Kent Street	225 m Southwest	1947-1987	Former Retail Fuel Outlet	N

As discussed in FIP section, the former printing shop addressed 344 Lisgar Street (now part of 360 Lisgar Street), adjacent to the west of the Phase I Property and the former automotive service garage with 3 USTs addressed 346 Lisgar Street (now part of 360 Lisgar Street), adjacent to the west of the Phase I Property are considered to represent APECs on the Phase I Property.

Based on the respective separation distances relative to the Phase I Property, the remaining off-site PCAs identified during the review of the City of Ottawa street directories are not considered to represent an environmental concern on the Phase I Property.

It should be noted that civic addresses have changed over the years and those listed above may not currently exist. The respective distances of the above noted activities from the Phase I Property were determined using the City of Ottawa electronic mapping website.

The PCAs identified during a review of the City of Ottawa street directories are illustrated on Drawing PE6874-2 – Surrounding Land Use Plan, provided in the Figures section following the text.

Chain of Title

Given the available information, it was determined that the results of a chain of title search would not contribute to the environmental assessment for the Phase I Property. Therefore, a chain of title search was not completed as part of this assessment.

Plan of Survey

A topographic plan of survey for the Phase I Property, prepared by Annis, O'Sullivan Vollebakk Ltd. was reviewed as part of the Phase I ESA. The plan shows the Phase I Property in its current configuration. A copy of the topographic plan of survey is provided in Appendix 1.

Previous Environmental Reports

The review of previous environmental reports for surrounding properties identified two Potentially Contaminating Activities (PCAs) within the Phase I Study Area that were identified in city directories or FIP sections. The property at 232 Bank Street, located approximately 20m north of the Phase I Property, operated as a printer in 1998. The property at 345 Lisgar Street (currently part of 222 Nepean Street), about 20m northwest of the Phase I Property, operated as a printer from 1956 to 1960.

Based on the separation distance, down/cross-gradient orientation relative to the Phase I Property, and the brief operational period, both identified PCAs are not considered to pose an environmental concern to the Phase I Property.

4.2 Environmental Source Information

Environment Canada

A search of the National Pollutant Release Inventory (NPRI) was conducted electronically on January 16, 2025. No records were found in the NPRI database for properties within the Phase I Study Area.

PCB Inventory

A search of provincial PCB waste storage sites was conducted. No PCB waste storage sites were identified within the Phase I Study Area.

Areas of Natural Significance

A search for areas of natural significance and features within the Phase I Study Area was conducted on the website of the Ontario Ministry of Natural Resources (MNR) on January 16, 2025. The search did not reveal any areas of natural significance within the Phase I Study Area.

Ministry of the Environment, Conservation and Parks Freedom of Information Request

A request was submitted to the MECP FOI office for information with respect to reports related to environmental conditions for the Phase I Property. A response from the MECP had not been received prior to the issuance of this report. A copy of the response will be forwarded to the client if it contains any pertinent information.

MECP Instruments

A request was submitted to the MECP Freedom of Information (FOI) office for information with respect to certificates of approval, permits to take water, certificates of property use or any other similar MECP issued instruments for the site. A response from the MECP had not been received prior to the issuance of this report. A copy of the response will be forwarded to the client if it contains any pertinent information.

MECP Waste Management Records

A request was submitted to the MECP FOI office for information with respect to waste management records. A response from the MECP had not been received prior to the issuance of this report. A copy of the response will be forwarded to the client if it contains any pertinent information.

MECP Submissions

A request was submitted to the MECP FOI office for information with respect to reports related to environmental conditions for the Phase I Property. A response from the MECP had not been received prior to the issuance of this report. A copy of the response will be forwarded to the client if it contains any pertinent information.

MECP Incident Reports

A request was submitted to the MECP FOI office for information with respect to records concerning environmental incidents, orders, offences, spills, discharges of contaminants, inspections maintained by the MECP for the Phase I Property or neighbouring properties. A response from the MECP had not been received prior to the issuance of this report. A copy of the response will be forwarded to the client if it contains any pertinent information.

MECP Brownfields Environmental Site Registry

A search of the MECP Brownfields Environmental Site Registry (ESR) was conducted as part of this assessment for the site, neighbouring properties and the general area of the site. No record of site condition (RSC) was identified for the Phase I Property. Seven (7) RSCs were filled for properties within the Phase I Study Area.

An RSC was filled for the following properties: 433 Cooper Street (approximately 50m to the southwest), 300 Lisgar Street (approximately 70m to the east), 235-245 Kent Street (approximately 955m to the west), 287 Lisgar Street (approximately 125m to the northeast), 433 Somerset Street West (approximately 195m to the southwest), 324 Laurier Avenue West (approximately 205m to the northwest) and 360 Laurier Avenue West (approximately 220m to the northwest). According to the registry, approximately 22 m³, 35 m³, 2,900 m³, 10,589 m³, 573 m³ and 1,300 m³ of contaminated soil, respectively, was removed from the RSC properties. No contamination media was present on 360 Laurier Avenue West and therefore no remediation was required. Based on the separation distance of these properties from the subject site, these properties are not considered to have had the potential to have impacted the subject site.

MECP Waste Disposal Site Inventory

The Ontario Ministry of Environment document titled "Waste Disposal Site Inventory in Ontario, 1991" was reviewed as part of the historical research. This document includes all recorded active and closed waste disposal sites, industrial manufactured gas plants and coal tar distillation plants in the Province of Ontario.

No waste disposal sites were listed in the database for the Phase I Property or properties within the Phase I Study Area.

Technical Standards and Safety Authority (TSSA)

The TSSA, Fuels Safety Branch in Toronto, was contacted electronically on January 17, 2024, to inquire about current and former underground/aboveground storage tanks, spills, and incidents for the subject and neighbouring properties. The response from the TSSA indicated that no records were listed in the TSSA registry for the Phase I Property or surrounding properties within the Phase I Study Area.

A copy of the TSSA correspondence is included in Appendix 2.

City of Ottawa Historical Land Use Inventory (HLUI)

A request for a search of the City of Ottawa's Historical Land Use Inventory (HLUI) database was submitted to the City of Ottawa. A response had not been received at the time of issuing the report. A copy of the search results will be forwarded to the client upon receipt. A copy of the HLUI request form is provided in Appendix 2.

City of Ottawa Old Landfill Sites

The document prepared by Golder Associates entitled, "*Old Landfill Management Strategy, Phase I - Identification of Sites, City of Ottawa*", was reviewed as part of this assessment. No former landfill sites were identified on the Phase I Property, or within a 150m radius of the Phase I Property.

City of Ottawa Former Industrial Sites

The document prepared by Intera Technologies Limited entitled, "*Mapping and Assessment of Former Industrial Sites, City of Ottawa*", was also reviewed as part of this assessment. No former industrial sites were identified on the Phase I Property.

The property located at 175 Nepean Street (now part of 171 Nepean Street), approximately 110m northeast of the Phase I Property, was identified as the Lowe-Martin (Industrial Site #40). The site operated from 1928 to 1965, primarily engaged in printing and publishing activities. The property, along with its previous use as a printing facility, is considered a PCA. The property located at 300 Laurier Avenue West, approximately 185m northeast of the Phase I Property, was identified as the Ottawa Photo Engraving Co. (Industrial Site #84). The site operated from 1925 to 1950, primarily involved in printing and publishing activities, as well as lithography, engraving, and stereotyping. The property, along with its previous use as a printing facility, is considered a PCA. Based on the separation

distances with respect to the Phase I Property, the identified PCAs are not considered to represent an environmental concern to the Phase I Property.

Environmental Risk Information Service (ERIS) Report

An Environmental Risk Information Services (ERIS) report, dated January 14, 2025, was acquired for the Phase I Property and reviewed as part of this assessment. It should be noted that the ERIS report includes information that would normally be obtained through the MECP FOI, MECP well records search as well as several other records (i.e., incident reports, waste generators, etc.). The complete ERIS report has been included in Appendix 2.

☐ *On-Site Records:*

A total of five records were identified for the Phase I Property (4 of which are previous ERIS searches). The ERIS report identified one Waste Generator record for the Phase I Property. The identified record pertains to Al's Care Pharmacy, with an approval year of 2014. The listed waste classes include pharmaceuticals and pathological wastes. This record is not considered an environmental concern for the Phase I Property.

☐ *Off-Site Records:*

A total of 427 records from various databases were identified for properties within a 250m radius of the Phase I Property (69 of which are previous ERIS searches).

The ERIS report identified two Dry cleaning Facilities records for the property addressed 272 Bank Street, approximately 70m southeast of the Phase I Property. These records identify Draicchio's Tailoring & Cleaning and Downtown Clobber as the associated businesses in 2004 and 2021, respectively. Based on the separation distance from the Phase I Property, the former dry cleaner is classified as a PCA but is not considered an APEC for the Phase I Property.

The ERIS report identified the following records for surrounding properties within the Phase I Study Area: seven delisted fuel tank records, six records from lists of expired fuel safety facilities, one record from the federal identification registry for storage tank systems, three records for fuel storage tanks - historic, and four records for private and retail fuel storage tanks. One record is associated with 300 Laurier Avenue West, located approximately 185m northeast of the Phase I Property. The record provides information about two 10,200-litre aboveground storage tanks (ASTs) located in the diesel room and a 1,217-litre AST situated in the generator room of the building. These ASTs are classified as a PCA. Two records are associated with 199 Kent Street, located approximately 205m

northwest of the Phase I Property. These include information about a 1,000-litre tank with an expiry date of 1993 and an expired record for a propane refill center. The identified tank record is classified as a PCA. Based on their separation distances with respect to the Phase I Property, both identified PCAs are not considered to represent an environmental concern to the Phase I Property. The remaining records pertain to properties already identified as PCAs and are not considered to pose an environmental concern to the Phase I Property.

The ERIS report identified two fuel oil spills and leaks records for surrounding properties within the Phase I Study Area. A record was identified for the property located at 212 Bank Street, approximately 18m north of the Phase I Property. The record, dated 2010, indicates fuel oil as the type of fuel involved, with a status code of "causal analysis complete." The occurrence narrative mentions the discovery of an abandoned UST. However, no further significant details are provided, such as the spill quantity, environmental contact media, or other relevant information. Based on the available information, this record is not considered to pose an environmental concern for the Phase I Property. The second identified record pertains to natural gas and is not considered an environmental concern for the Phase I Property.

The ERIS report identified 26 Scott's manufacturing directory records for surrounding properties within the Phase I Study Area. A record was identified for the property located at 231 Bank Street, approximately 25m north of the Phase I Property. The record lists the business name as "Wallack's Art & Drafting," employing 20 persons. While no establishment year is provided, the description includes items such as marking devices, pencils, crayons, and measuring tools. The business is classified as a supply store, is not considered a PCA, and does not pose an environmental concern to the Phase I Property. Three records were identified for the property located at 251 Bank Street, approximately 30m southeast of the Phase I Property. These records reference three different establishments, all operating as printers. Two records provide establishment years of 1994 and 1996, with facility sizes of 1,800 ft² and 1,000 ft², respectively. The identified former printers are classified as a PCA. However, due to their separation distance and cross-gradient orientation relative to the Phase I Property, the identified PCA is not considered to pose an environmental concern to the Phase I Property. The review of remaining records identified following PCAs: 396 Cooper Street (approximately 80m southeast - former printers), 177 Nepean Street (approximately 105m northeast - former printers), 146 Nepean Street (approximately 140m northeast - former printers), 176 Gloucester Street (approximately 145m north - former printers), 386 MacLaren Street (approximately 240m southeast – former electrical

component manufacturer). Based on their separation distances with respect to the Phase I Property, these PCAs are not considered to represent an environmental concern to the Phase I Property. The remaining Scott's manufacturing directory records identified in the ERIS report are either related to a previously identified PCA or are not considered to represent PCAs based on information contained within the records.

The ERIS report identified 27 Ontario spill records for surrounding properties within the Phase I Study Area. A 2000 record for 232 Bank Street, located approximately 20m north of the Phase I Property, documented a 5-litre oil spill to the ground, which was subsequently cleaned up. This record of minimal spill is not considered to pose an environmental concern to the Phase I Property. A 2002 record for 340 Laurier Avenue, located approximately 175m northwest of the Phase I Property, documented an 1,800-litre ethylene glycol spill affecting the property and sewer system. This spill record is classified as a Potentially Contaminated Area (PCA). Additionally, a 1993 record for 154 O'Connor Street, situated approximately 200m northeast of the Phase I Property, reported the loss of 1,800 litres of furnace oil from an underground storage tank (UST) due to a tank leak. The associated impact was identified as soil contamination, and this record is also considered a PCA. Based on the separation distances and down/cross-gradient orientation with respect to the Phase I Property, both PCAs are not considered to represent an environmental concern to the Phase I Property. The remaining spill records consist of minimal (less than 30L) transformer oil, coolant, grease or gas leak/spills occurring at properties a minimum of 30m from the Phase I Property. Based on their respective separation distances and the nature of the spills, the records are not considered to represent an environmental concern to the phase I Property.

The ERIS report identified 186 Waste Generator records for surrounding properties within the Phase I Study Area. Five records were identified for 360 Lisgar Street, located adjacent to the west of the Phase I Property. Two records pertain to a Revenue Canada Taxation establishment, with waste classes including photo processing wastes and alkaline wastes containing heavy metals, spanning from 1994 to 2001. One record is associated with Urbandale Corporation, with waste classes including halogenated pesticides, alkaline wastes (other metals), and waste oils & lubricants, covering the years 2003 to 2005. The remaining four records relate to a Bell Canada business, with approval years from 2015 to 2018, listing waste classes such as waste oils/sludges, waste compressed gases (including cylinders), and others. Based on aerial photographs, the property is shown to be occupied by an existing office building, with all three establishments possibly using the building solely for office purposes. Given the available

information, the identified records are not considered a PCA. Three records were identified for 224 Bank Street, located approximately 40 meters north of the Phase I Property. The records list petroleum distillates as the waste class for approval years spanning 1989 to 2001. The records are related to Bicycle Revival Ltd., a bicycle repair service. Given the nature of the business, these records are not classified as a PCA. Remaining waste generator records identified in the ERIS report are either related to a previously identified PCA or are not considered to represent PCAs based on information contained within the records.

The ERIS report identified five national PCB inventory records for surrounding properties within the Phase I Study Area. Four records pertain to the property at 171 Bank Street, located approximately 175m northeast of the Phase I Property. These records indicate the presence of a transformer vault on the P1 level, north side, housing two transformers containing 3,250 litres of Askarel liquid and six transformers containing 1,433 litres of Askarel/Inerteen liquid. The identified PCB records are considered a PCA. Based on the separation distance and down-gradient orientation with respect to the Phase I Property, the identified PCA is not considered to represent an environmental concern to the Phase I Property. The remaining record does not contain significant information and is not considered a PCA.

The ERIS report identified seven Record of Site Condition for surrounding properties within the Phase I Study Area. As discussed above in MECP brownfields environmental site registry section, the identified RSC properties are not considered to represent an environmental concern on the Phase I Property.

The ERIS report identified 12 certificates of approval, two environmental activity and sector registry, one environmental registry, eight environmental compliance approval, one permit to take water records for surrounding property within the Phase I Study Area. The records are limited to air, sewer and water works and are not considered to pose an environmental risk to the Phase I Property.

The ERIS report identified 34 well records and five borehole records for surrounding properties within the Phase I Study Area, which are further discussed in the water well records section of this report.

The remaining records identified in the ERIS report contain minimal or non-pertinent information and/or include details that are not considered indicative of a potential environmental concern to the Phase I Property. The complete ERIS report has been included in Appendix 1.

4.3 Physical Setting Sources

Aerial Photographs

Historical air photos from the National Air Photo Library, GeoOttawa Website and Google Earth were reviewed in approximate ten (10) year intervals. Based on the review, the following observations have been made:

1933	The Phase I Property consist of multiple small commercial building structures. Bank Street and Lisgar Street are located adjacent to the northeast and northwest of the Phase I Property, respectively. The surrounding properties are primarily developed with a mix of residential and commercial buildings.
1949	(Poor Scale) No significant changes are apparent with regard to the Phase I Property or surrounding properties.
1958	(GeoOttawa) No significant changes are apparent with regard to the Phase I Property or surrounding properties.
1965	(GeoOttawa) No significant changes are apparent with regard to the Phase I Property. The property adjacent to the west of the Phase I Property appears to have been redeveloped with new, smaller commercial building.
1976	(GeoOttawa) The Phase I Property appears to have undergone redevelopment, now featuring a new multi-storey commercial building in place of the previous smaller structures. Similarly, the surrounding properties exhibit significant redevelopment, with new buildings replacing the earlier smaller structures.
1984	No significant changes are apparent with regard to the Phase I Property or surrounding properties.
1991	(GeoOttawa) No significant changes are apparent with regard to the Phase I Property. Further redevelopment of surrounding properties is noted to the southeast of the Phase I Property.
2002	(GeoOttawa) No significant changes are apparent with regard to the Phase I Property or surrounding properties.
2011	(GeoOttawa) No significant changes are apparent with regard to the Phase I Property or surrounding properties.

2024 (Google Earth) No significant changes are apparent with regard to the Phase I Property or surrounding properties.

Copies of selected aerial photographs reviewed are included in Appendix 1.

Physiographic Maps

A Physiographic Map was reviewed from the Natural Resources Canada – The Atlas of Canada website. According to this physiographic map, the site is located in the St. Lawrence Lowlands. According to the mapping description provided: “The lowlands are plain-like areas that were all affected by the Pleistocene glaciations and are therefore covered by surficial deposits and other features associated with the ice sheets.” The Phase I Property is located in the Central St. Lawrence Lowland, which is generally less than 150 m above sea level.

Topographic Maps

Topographic maps were obtained from Natural Resources Canada – The Atlas of Canada website and from the City of Ottawa website. The topographic maps indicate that the elevation of the Phase I Property is approximately 73m above sea level. The regional topography in the general area of the Phase I Property slightly slopes downward to the north and northeast. An illustration of the referenced topographic map is presented on Figure 2 – Topographic Map, appended to this report.

Geological Maps

The Geological Survey of Canada website on the Urban Geology of the National Capital Area was consulted as part of this assessment. Based on the information from NRCAN, bedrock in the area of the site consists of shale of the Billings Formation. Based on the maps, the surficial geology consists of offshore marine deposits with an overburden thickness ranging from 10 to 15m.

Water Well Records

A search of the MECPs website was conducted on January 21, 2025, for all drilled well records within a 250m radius of the Phase I Property. No well records were identified for the Phase I Property.

The search identified 36 well and well cluster records associated with surrounding properties within the Phase I Study Area. Of these, 27 records pertain to monitoring wells installed between 2005 and 2021, which are assumed to have been established for geotechnical purposes and/or environmental investigations. Two records lacked significant information, while six records related to well

abandonment. The remaining record pertains to a domestic supply well installed in 1948. Based on the availability of municipal services, no drinking water wells are expected to be currently in use within the Phase I Study Area. A copy of the well records has been included in Appendix 2.

In general, according to the well records, the strata in the Phase I Study Area consists of silt and sand over underlying silty clay, over shale bedrock. Shale bedrock was encountered at depths ranging from 9.33 – 19.25 mbgs in the nearby well records identified within the Phase I Study Area.

5.0 INTERVIEWS

Property Owner Representatives

Mr. Elliot Drazin, with 240 Bank Street Holdings Ltd., the current property owner was interviewed via e-mail correspondence as part of this assessment. Mr. Drazin stated that 240 Bank Street Holdings Ltd. acquired the Phase I Property in 2006. Mr. Drazin also noted that the existing building on the property was constructed in 1974 and has primarily been used for commercial purposes, mainly as an office building. Mr. Drazin stated that he was unaware of any environmental concerns on the Phase I Property.

The information obtained through the interview with Mr. Drazin is considered to be consistent with site information obtained from other sources (aerial photos, ERIS Database Report and site observations) and is considered to be valid.

6.0 SITE RECONNAISSANCE

6.1 General Requirements

A site visit was conducted on January 24, 2025, by Mr. Kuldeep Panchal with the Environmental Department of Paterson Group. Weather conditions at the time of the site inspection were clear and approximately -12°C. In addition to the site, the uses of neighbouring properties within the Phase I Study Area were assessed at the time of the site visit from publicly accessible areas.

6.2 Specific Observations at the Phase I Property

Buildings and Structures

Six-storey commercial building with a full basement level is present on the Phase I Property. The commercial building was constructed circa 1974 and is currently heated with a natural gas system. The subject building is constructed with a

concrete foundation and is finished on the exterior with brick and has a flat tar and gravel roof. A smaller rooftop unit, occupying a footprint proportionally smaller than the main structure, serves as a mechanical room and elevator room.

The ground floor of the commercial building consists of multiple retail spaces fronting Bank Street and Lisgar Street. Currently, three stores are occupied and operational: a comic store, a barbershop, and a cake/gift shop, while the remaining two units are vacant at the time of the site inspection. A portion of the basement, previously used as office space, is also vacant. The upper floors are designated for office use, accommodating various tenants, with approximately half of the area unoccupied at the time of the site inspection.

Subsurface Structures and Utilities

The Phase I Property is serviced by a municipal connection for water and sewer. Multiple underground utilities were identified on the Phase I Property, including electrical, natural gas, water and telecommunication lines. No other subsurface structures were identified at the time of the site inspection.

Site Features

The entire portion of the subject site is currently occupied with a commercial building. The Phase I Property is considered to be at grade with respect to the adjacent roadways. The site topography is generally flat and the regional topography slightly slopes downward to the north and northeast.

Water drainage on the Phase I Property occurs via sheet drainage to catch basins located along the Bank Street and Lisgar Street. No ponded water, stressed vegetation, surficial staining, or any other indications of potential sub-surface contamination were observed on the subject site at time of the site inspection.

No drains, pits or sumps were observed on the exterior of the Phase I Property at the time of the site inspection. No evidence of current or former railway lines or spur lines on the Phase I Property was observed at the time of the site inspection.

Site features are presented on Drawing PE6874-1 – Site Plan, provided in the Figures section following the text.

Potential Environmental Concerns

☐ **Groundwater Monitoring Wells**

No monitoring wells were identified on the Phase I Property during the site assessment.

☐ **Fuels and Chemical Storage**

No above ground fuel storage tanks (ASTs), or signs of USTs were observed on the exterior of the Phase I Property at the time of the site inspection. No chemicals were found to be stored on the exterior of the Phase I Property.

☐ **Waste Management**

Solid, non-hazardous domestic waste and recyclable products are stored in plastic bins located along the western edge of the building and are collected regularly. No environmental concerns were identified with respect to waste management practices on the Phase I Property.

☐ **Polychlorinated Biphenyls (PCBs) and Transformer Oil**

No transformers were observed on the exterior of the Phase I Property.

☐ **Fill Material**

No evidence of fill material was observed on the exterior of the Phase I Property at the time of the site inspection.

Interior Assessment

A general description of the interior of the commercial building is as follows:

- ☐ Floors consist of concrete, carpet, laminate, ceramic tiles and vinyl floor tiles;
- ☐ Walls consist of drywall, concrete, plaster and concrete block;
- ☐ Ceilings consist of suspended tiles, plaster and stippled plaster;
- ☐ Lighting is provided by LED fixtures.

Potentially Hazardous Building Products

☐ **Asbestos-Containing Materials (ACMs)**

Based on the age of construction of the subject building (circa 1974), asbestos containing building materials may be present within the structure. Potentially asbestos-containing materials (ACMs) observed at the time of the site inspection include drywall joint compound, vinyl floor tiles, suspended ceiling tiles and stippled plaster.

☐ **Lead-Based Paints (LBPs)**

Based on the age of construction of the subject building (circa 1974), lead-based paints (LBPs) may be present within the structure. Painted surfaces were generally observed to be in good condition at the time of the site inspection and do not pose an immediate concern.

☐ **Polychlorinated Biphenyls (PCBs) and Transformer Oil**

A hydro vault was observed in the basement of the building. The room was secured and not accessible, but the presence of transformers within the hydro vault is expected. The hydro vault is constructed with concrete floor and no staining or cracks were observed in the concrete floor outside the vault room. Based on the observations made during the site inspection, the potential presence of transformers in the building is not considered an environmental concern for the Phase I Property.

☐ **Urea Formaldehyde Foam Insulation (UFFI)**

UFFI was not observed in the subject building at the time of the site inspection, however, wall cavities were not inspected for insulation type.

Other Potential Environmental Concerns

☐ **Fuel and Chemical Storage**

No aboveground storage tanks (ASTs) or signs of underground storage tanks (USTs) were observed inside the subject building at the time of the site visit.

Chemical products stored in the subject building were observed to be limited to domestically available cleaning products and boiler water treatment chemicals, stored in their original containers. No environmental concerns were identified with respect to chemical storage practices within the subject building.

☐ **Wastewater Discharge**

Wastewater generated on the Phase I Property, including wash water and sewage, is discharged to the municipal water system.

☐ **Drains, Pits and Sumps**

One sump pit was observed within the basement of the subject building. The sump pit contained clean water with no noticeable odours or staining. No environmental concerns were identified with respect to wastewater discharges at the Phase I Property.

☐ **Ozone Depleting Substances (ODSs)**

Potential sources of ODSs observed on-site include a commercial cooler, refrigerators, air-conditioning units and fire extinguishers. These appliances were noted to be in good condition at the time of the site inspection and should be regularly serviced by a licensed contractor.

Neighbouring Properties

An inspection of the neighbouring properties was conducted from publicly accessible areas at the time of the site visit. Land use adjacent to the Phase I Property was as follows:

- ☐ North - Lisgar Street, followed by light commercial buildings (restaurants);
- ☐ South - Light commercial buildings (bakery, barbershop, various stores);
- ☐ East - Bank Street, followed by light commercial buildings (various stores and restaurants);
- ☐ West - Office building, followed by residential dwellings.

Land use within the Phase I Study consists of properties used residential and commercial purposes. A tailoring and dry-cleaning establishment is located at 272 Bank Street, approximately 70m southeast of the Phase I Property. Additionally, a dry cleaner is situated at 395 Somerset Street West, approximately 130m south of the Phase I Property. Both identified are considered PCAs. Based on the separation distance with respect to the Phase I Property, these identified PCAs are not considered to represent an environmental concern on the Phase I Property.

Current land use and PCAs identified in the Phase I Study Area are presented on Drawing PE6874-2 – Surrounding Land Use Plan.

7.0 REVIEW AND EVALUATION OF INFORMATION

7.1 Current and Past Uses

Based on a review of available historical information, the Phase I Property was first developed with commercial structures sometime prior to 1888. The Phase I Property was redeveloped with the existing commercial building circa 1974.

Potentially Contaminating Activities (PCAs) and Areas of Potential Environmental Concern (APECs)

Based on the findings of the Phase I ESA, the following off-site PCAs (as listed in Column A, Table 2 of O.Reg.153/04) were considered to result in two APECs on the Phase I Property:

- ☐ PCA 31 – Ink Manufacturing, Processing and Bulk Storage – this PCA is associated with the historical off-site printers addressed 346 Lisgar street, adjacent to the west of the Phase I Property (APEC 1)
- ☐ PCA 28/52 – Gasoline and Associated Products in Storage in Fixed Tanks, and Storage, maintenance, fuelling and repair of equipment, vehicles, and material used to maintain transportation systems – this PCA is associated with the historical off-site automotive service garage addressed 346 and 348 Lisgar Street, adjacent to the west of the Phase I Property (APEC 2)

The remaining off-site PCAs (existing or historical) identified within the Phase I Study Area are not considered to result in APECs on the Phase I Property due to their separation distance and/or their down/cross-gradient orientation with respect to the Phase I Property.

All APECs are outlined on Drawing PE6874-1 – Site Plan, while all PCAs identified within the Phase I Study Area are present on PE6874-2 – Surrounding Land Use Plan in the Figures section of this report, following the text.

Contaminants of Potential Concern (CPCs)

The contaminants of potential concern for the soil and/or groundwater on the Phase I Property include the following:

- ☐ Petroleum Hydrocarbons, fractions 1 – 4 (PHCs F₁-F₄);
- ☐ Benzene, Toluene, Ethylbenzene, and Xylenes (BTEX);
- ☐ Volatile Organic Compounds (VOCs);

These CPCs have the potential to be present in the soil matrix and/or groundwater situated beneath the Phase I Property.

7.2 Conceptual Site Model

Geological and Hydrogeological Setting

The Geological Survey of Canada website on the Urban Geology of the National Capital Area was consulted as part of this assessment. Based on the information from NRCAN, bedrock in the area of the site consists of shale of the Billings Formation. Based on the maps, the surficial geology consists of offshore marine deposits with an overburden thickness ranging from 10 to 15m.

The topographic maps indicate that the elevation of the Phase I Property is approximately 73m above sea level. The regional topography in the general area of the Phase I Property slightly slopes downward to the north and northeast.

Fill Placement

No evidence of fill placement was observed at the time of the site inspection.

Water Bodies and Areas of Natural Significance

A search for areas of natural significance and features within the Phase I Study Area was conducted on the website of the Ontario Ministry of Natural Resources (MNR) on January 16, 2025. The search did not reveal any areas of natural significance within the Phase I Study Area. The nearest body of water is the Ottawa River, approximately 900m northwest of the Phase I Property.

Potable Water Wells

A search of the MECPs website was conducted on January 21, 2025, for all drilled well records within a 250 m radius of the Phase I Property. No well records were identified for the Phase I Property. One record for domestic supply well installed in 1948 was identified within the Phase I Study Area. Based on the availability of municipal services, no drinking water wells are expected to be currently in use within the Phase I Study Area.

Monitoring Wells

No monitoring well records were identified for the Phase I Property. The search identified 27 monitoring well records for surrounding properties within the Phase I Study Area, installed between 2005 and 2021. The monitoring well records are assumed to have been installed for geotechnical purposes and/or as part of previous environmental investigations.

In general, according to the well records, the strata in the Phase I Study Area consists of silt and sand over underlying silty clay, over shale bedrock. Shale bedrock was encountered at depths ranging from 9.33 – 19.25 mbgs in the nearby well records identified within the Phase I Study Area.

Existing Buildings and Structures

Six-storey commercial building with a full basement level is present on the Phase I Property. The commercial building was constructed circa 1974 and is currently heated with a natural gas system. The subject building is constructed with a concrete foundation and is finished on the exterior with brick and has a flat tar and gravel roof. A smaller rooftop unit, occupying a footprint proportionally smaller than the main structure, serves as a mechanical room and elevator room.

The ground floor of the commercial building consists of multiple retail spaces fronting Bank Street and Lisgar Street. Currently, three stores are occupied and operational: a comic store, a barbershop, and a cake/gift shop, while the remaining two units are vacant at the time of the site inspection. A portion of the basement, previously used as office space, is also vacant. The upper floors are designated for office use, accommodating various tenants, with approximately half of the area unoccupied at the time of the site inspection.

Subsurface Structures and Utilities

The Phase I Property is serviced by a municipal connection for water and sewer. Multiple underground utilities were identified on the Phase I Property, including electrical, natural gas, water and telecommunication lines. No other subsurface structures were identified at the time of the site inspection.

Neighbouring Land Use

Land use within the Phase I Study consists of properties used residential and commercial purposes. A tailoring and dry-cleaning establishment is located at 272 Bank Street, approximately 70m southeast of the Phase I Property. Additionally, a dry cleaner is situated at 395 Somerset Street West, approximately 130m south of the Phase I Property. Both identified are considered PCAs. Based on the separation distance with respect to the Phase I Property, these identified PCAs are not considered to represent an environmental concern on the Phase I Property.

Current land use and PCAs identified in the Phase I Study Area are presented on Drawing PE6874-2 – Surrounding Land Use Plan.

Potentially Contaminating Activities and Areas of Potential Environmental Concern

As previously discussed in Section 7.1, two off-site PCAs are considered to result in two APECs on the Phase I Property. The PCAs, APECs and associated CPCs are summarized in Table 3.

Table 3 - Areas of Potential Environmental Concern					
Area of Potential Environmental Concern	Location of Area of Potential Environmental Concern with respect to Phase I-ESA Property	Potentially Contaminating Activity	Location of PCA (on-site or off-site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, Soil, and/or Sediment)
APEC 1 Former Printers	West portion of the Phase I Property	<i>"Item 31 – Ink Manufacturing, Processing and Bulk Storage"</i>	Off-site	BTEX PHCs (F ₁ -F ₄) VOCs	Soil Groundwater
APEC 2 ¹ Former Automotive Service Garage	West portion of the Phase I Property	<i>"Item 28: Gasoline and Associated Products Storage in Fixed Tanks"</i> <i>"Item 52 – Storage, maintenance, fuelling and repair of equipment, vehicles, and material used to maintain transportation systems"</i>	Off-site	BTEX PHCs (F ₁ -F ₄) VOCs	Soil Groundwater

The remaining off-site PCAs (existing or historical) identified within the Phase I Study Area are not considered to result in APECs on the Phase I Property due to their separation distance and/or their down/cross-gradient orientation with respect to the Phase I Property.

As previously discussed in Section 7.1, all APECs are outlined on Drawing PE6874-1 – Site Plan, while all PCAs identified within the Phase I Study Area are present on PE6874-2 – Surrounding Land Use Plan in the Figures section of this report, following the text.

Contaminants of Potential Concern

As per section 7.1 of this report and Table 3, CPCs in the soil and/or groundwater beneath the Phase I Property include the following:

- ☐ Petroleum Hydrocarbons, fractions 1 – 4 (PHCs F₁-F₄);

- ☐ Benzene, Toluene, Ethylbenzene, and Xylenes (BTEX);
- ☐ Volatile Organic Compounds (VOCs);

These CPCs have the potential to be present in the soil matrix and/or groundwater situated beneath the Phase I Property.

Assessment of Uncertainty and/or Absence of Information

The information available for review as part of the preparation of this Phase I- ESA is considered to be sufficient to conclude that there are former off-site PCAs that have resulted in APECs on the Phase I Property. Additional off-site PCAs identified within the Phase I Study Area are not considered to represent APECs on the Phase I Property based on their separation distance and/or cross-gradient orientation with respect to the Phase I Property.

A variety of independent sources were consulted as part of this assessment, and as such, the conclusions of this report are not affected by uncertainty which may be present with respect to the individual sources.

8.0 CONCLUSIONS

8.1 Assessment

Paterson Group was retained by 240 Bank Street Holdings Ltd., to conduct a Phase I-Environmental Site Assessment (ESA) for 240 Bank Street, in the City of Ottawa, Ontario. The purpose of this Phase I-ESA was to research the past and current use of the Phase I Property and 250m Phase I Study Area, and to identify any environmental concerns with the potential to have impacted the Phase I Property.

Based on the available historical information, the Phase I Property was initially developed with commercial structures sometime prior to 1888. The Phase I Property was redeveloped with the existing commercial building circa 1974. No historical potentially contaminating activities (PCAs) were identified on the Phase I Property.

Based on the available historical information, adjacent and surrounding properties within the Phase I Study Area were developed from primarily commercial and residential purposes. Former printers and automotive service garage were identified on the properties addressed 346 and 348 Lisgar Street, adjacent to the west of the Phase I Property and are considered to represent APECs on the Phase I Property. Remaining historical PCAs identified in the Phase I Study Area are not considered to represent APECs on the Phase I Property due to their separation distance and/or the down/cross-gradient orientation with respect to the Phase I Property.

Following the historical research, a site visit was conducted. The Phase I Property is occupied by a six-storey commercial building with a full basement level. The ground floor houses three active retail stores, while the upper floors are utilized as office spaces by various tenants. No environmental concerns were identified with the current use of the Phase I Property.

Land use within the Phase I Study Area consists of primarily commercial (offices, restaurant, medical clinic, various stores, etc.) along with residential and community use. A tailoring and dry-cleaning establishment is located at 272 Bank Street, approximately 70m southeast of the Phase I Property. Additionally, a dry cleaner is situated at 395 Somerset Street West, approximately 130m south of the Phase I Property. Based on the separation distance with respect to the Phase I Property, these identified PCAs are not considered to represent an environmental concern on the Phase I Property.

Based on the findings of the Phase I ESA, it is **our opinion that a Phase II-Environmental Site Assessment is required for the Phase I Property.**

8.2 Recommendations

Based on the age of the subject building (circa 1974), asbestos containing building materials may be potentially present within the structure. Potential ACMs observed in the subject buildings include drywall joint compound, vinyl floor tiles, suspended ceiling tiles and stippled plaster. These materials were observed to be in fair to good condition at the time of the site inspection and do not represent an immediate concern to the building's occupants. An asbestos survey of the subject building should be conducted in accordance with Ontario Regulation 278/05, under the Occupational Health and Safety Act, prior to any proposed demolition activities, if one has not already been conducted.

Based on the age of the subject buildings (circa 1974), lead-based paints may be present on any original or older painted surfaces. The painted surfaces within the subject buildings were generally observed to be in good condition and do not pose an immediate concern to the occupants of the building. Major work involving lead-based paint or other lead containing products must be done in accordance with O. Reg 843, under the Occupational Health and Safety Act.

It is recommended that a Designated Substance Survey (DSS) be conducted for the existing building prior to any future renovation or demolition activities.

9.0 STATEMENT OF LIMITATIONS

This Phase I - Environmental Site Assessment report has been prepared in general accordance with O.Reg. 153/04, as amended, and meets the requirements of CSA Z768-01 (reaffirmed 2022). The conclusions presented herein are based on information gathered from a limited historical review and field inspection program. The findings of the Phase I - ESA are based on a review of readily available geological, historical and regulatory information and a cursory review made at the time of the field assessment. The historical research relies on information supplied by others, such as, local, provincial and federal agencies and was limited within the scope-of-work, time and budget of the project herein.

Should any conditions be encountered at the Phase I property and/or historical information that differ from our findings, we request that we be notified immediately in order to allow for a reassessment.

This report was prepared for the sole use of 240 Bank Street Holdings Ltd. Permission and notification from 240 Bank Street Holdings Ltd. and Paterson will be required to release this report to any other party.

Paterson Group Inc.



Kuldeep Panchal, M.Eng.



Michael Beaudoin, P.Eng, Q.P.ESA



Report Distribution:

- ☐ 240 Bank Street Holdings Ltd.
- ☐ Paterson Group

10.0 REFERENCES

Federal Records

Air photos at the Energy Mines and Resources Air Photo Library.
National Archives.
Maps and photographs (Geological Survey of Canada surficial and subsurface mapping).
Natural Resources Canada – The Atlas of Canada.
Environment Canada, National Pollutant Release Inventory.
PCB Waste Storage Site Inventory.

Provincial Records

MECP Municipal Coal Gasification Plant Site Inventory, 1991.
MECP document titled “Waste Disposal Site Inventory in Ontario”.
MECP Brownfields Environmental Site Registry.
MNR Areas of Natural Significance.
MECP Water Well Record Inventory.
Maps and photographs (Geological Survey of Ontario surficial and subsurface mapping).
Chapman, L.J., and Putnam, D.F., 1984: ‘The Physiography of Southern Ontario, Third Edition’, Ontario Geological Survey Special Volume 2.

Municipal Records

geoOttawa: City of Ottawa electronic mapping website.
City of Ottawa Historical Land Use Inventory (HLUI) Database.

Local Information Sources

Personal Interviews
Chain of Title
Previous Engineering Reports
Environmental Risk Information Services (ERIS) Report, May 13, 2024

Public Information Sources

Google Earth.
Google Maps/Street View.

FIGURES

FIGURE 1 – KEY PLAN

FIGURE 2 – TOPOGRAPHIC MAP

DRAWING PE6874-1 – SITE PLAN

DRAWING PE6874-2 – SURROUNDING LAND USE PLAN

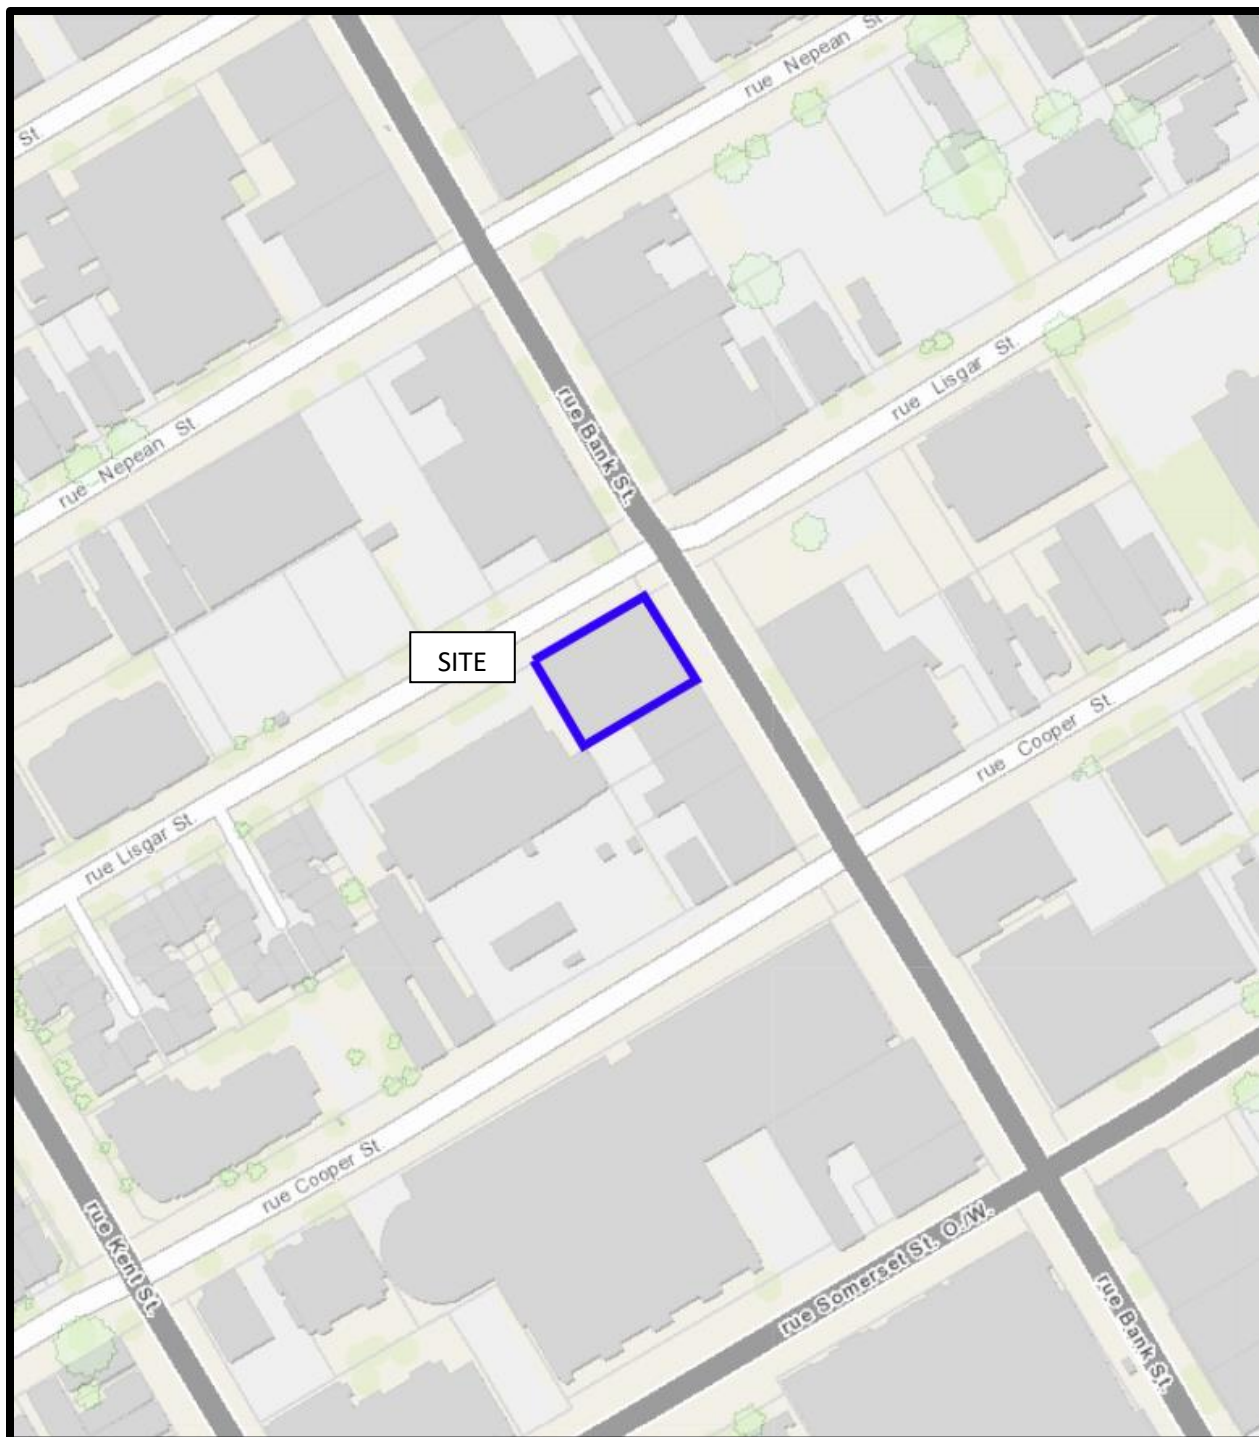


FIGURE 1
KEY PLAN


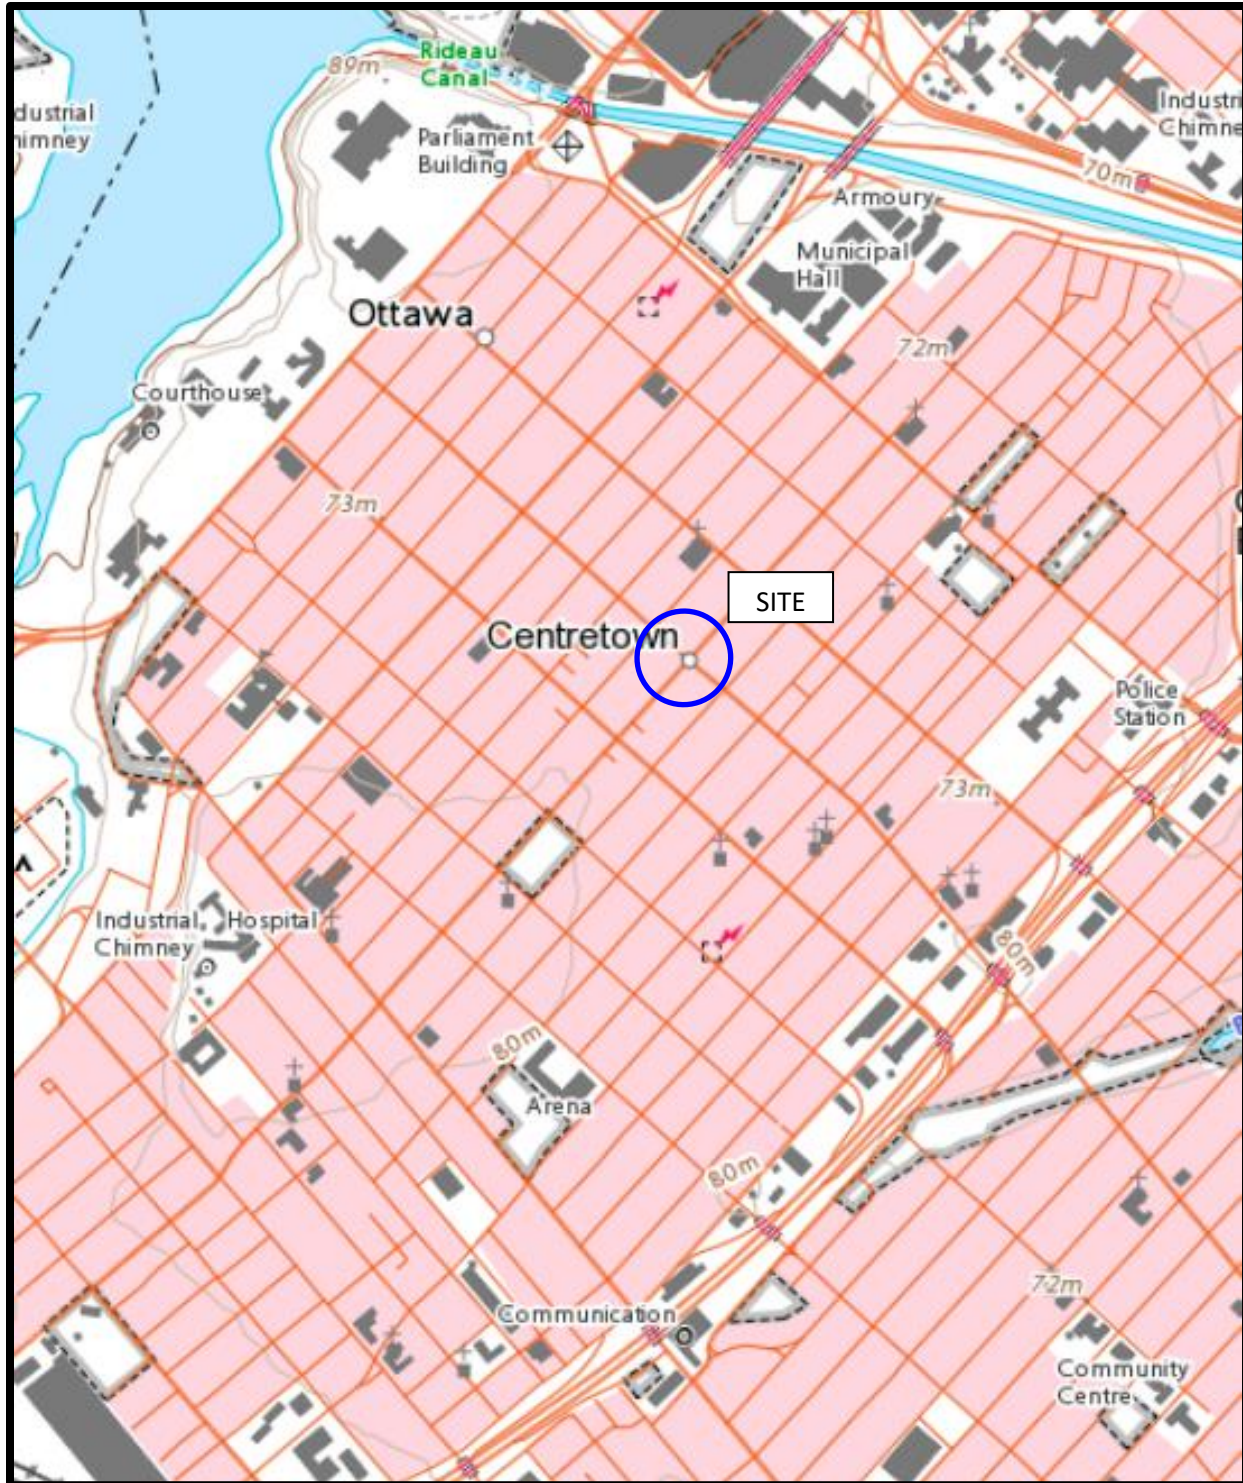


FIGURE 2
TOPOGRAPHIC MAP



AREAS OF POTENTIAL ENVIRONMENTAL CONCERN :

ID #	PCA ID	DESCRIPTION
1	31	FORMER PRINTERS
2	28/52	FORMER AUTOMOTIVE SERVICE GARAGE

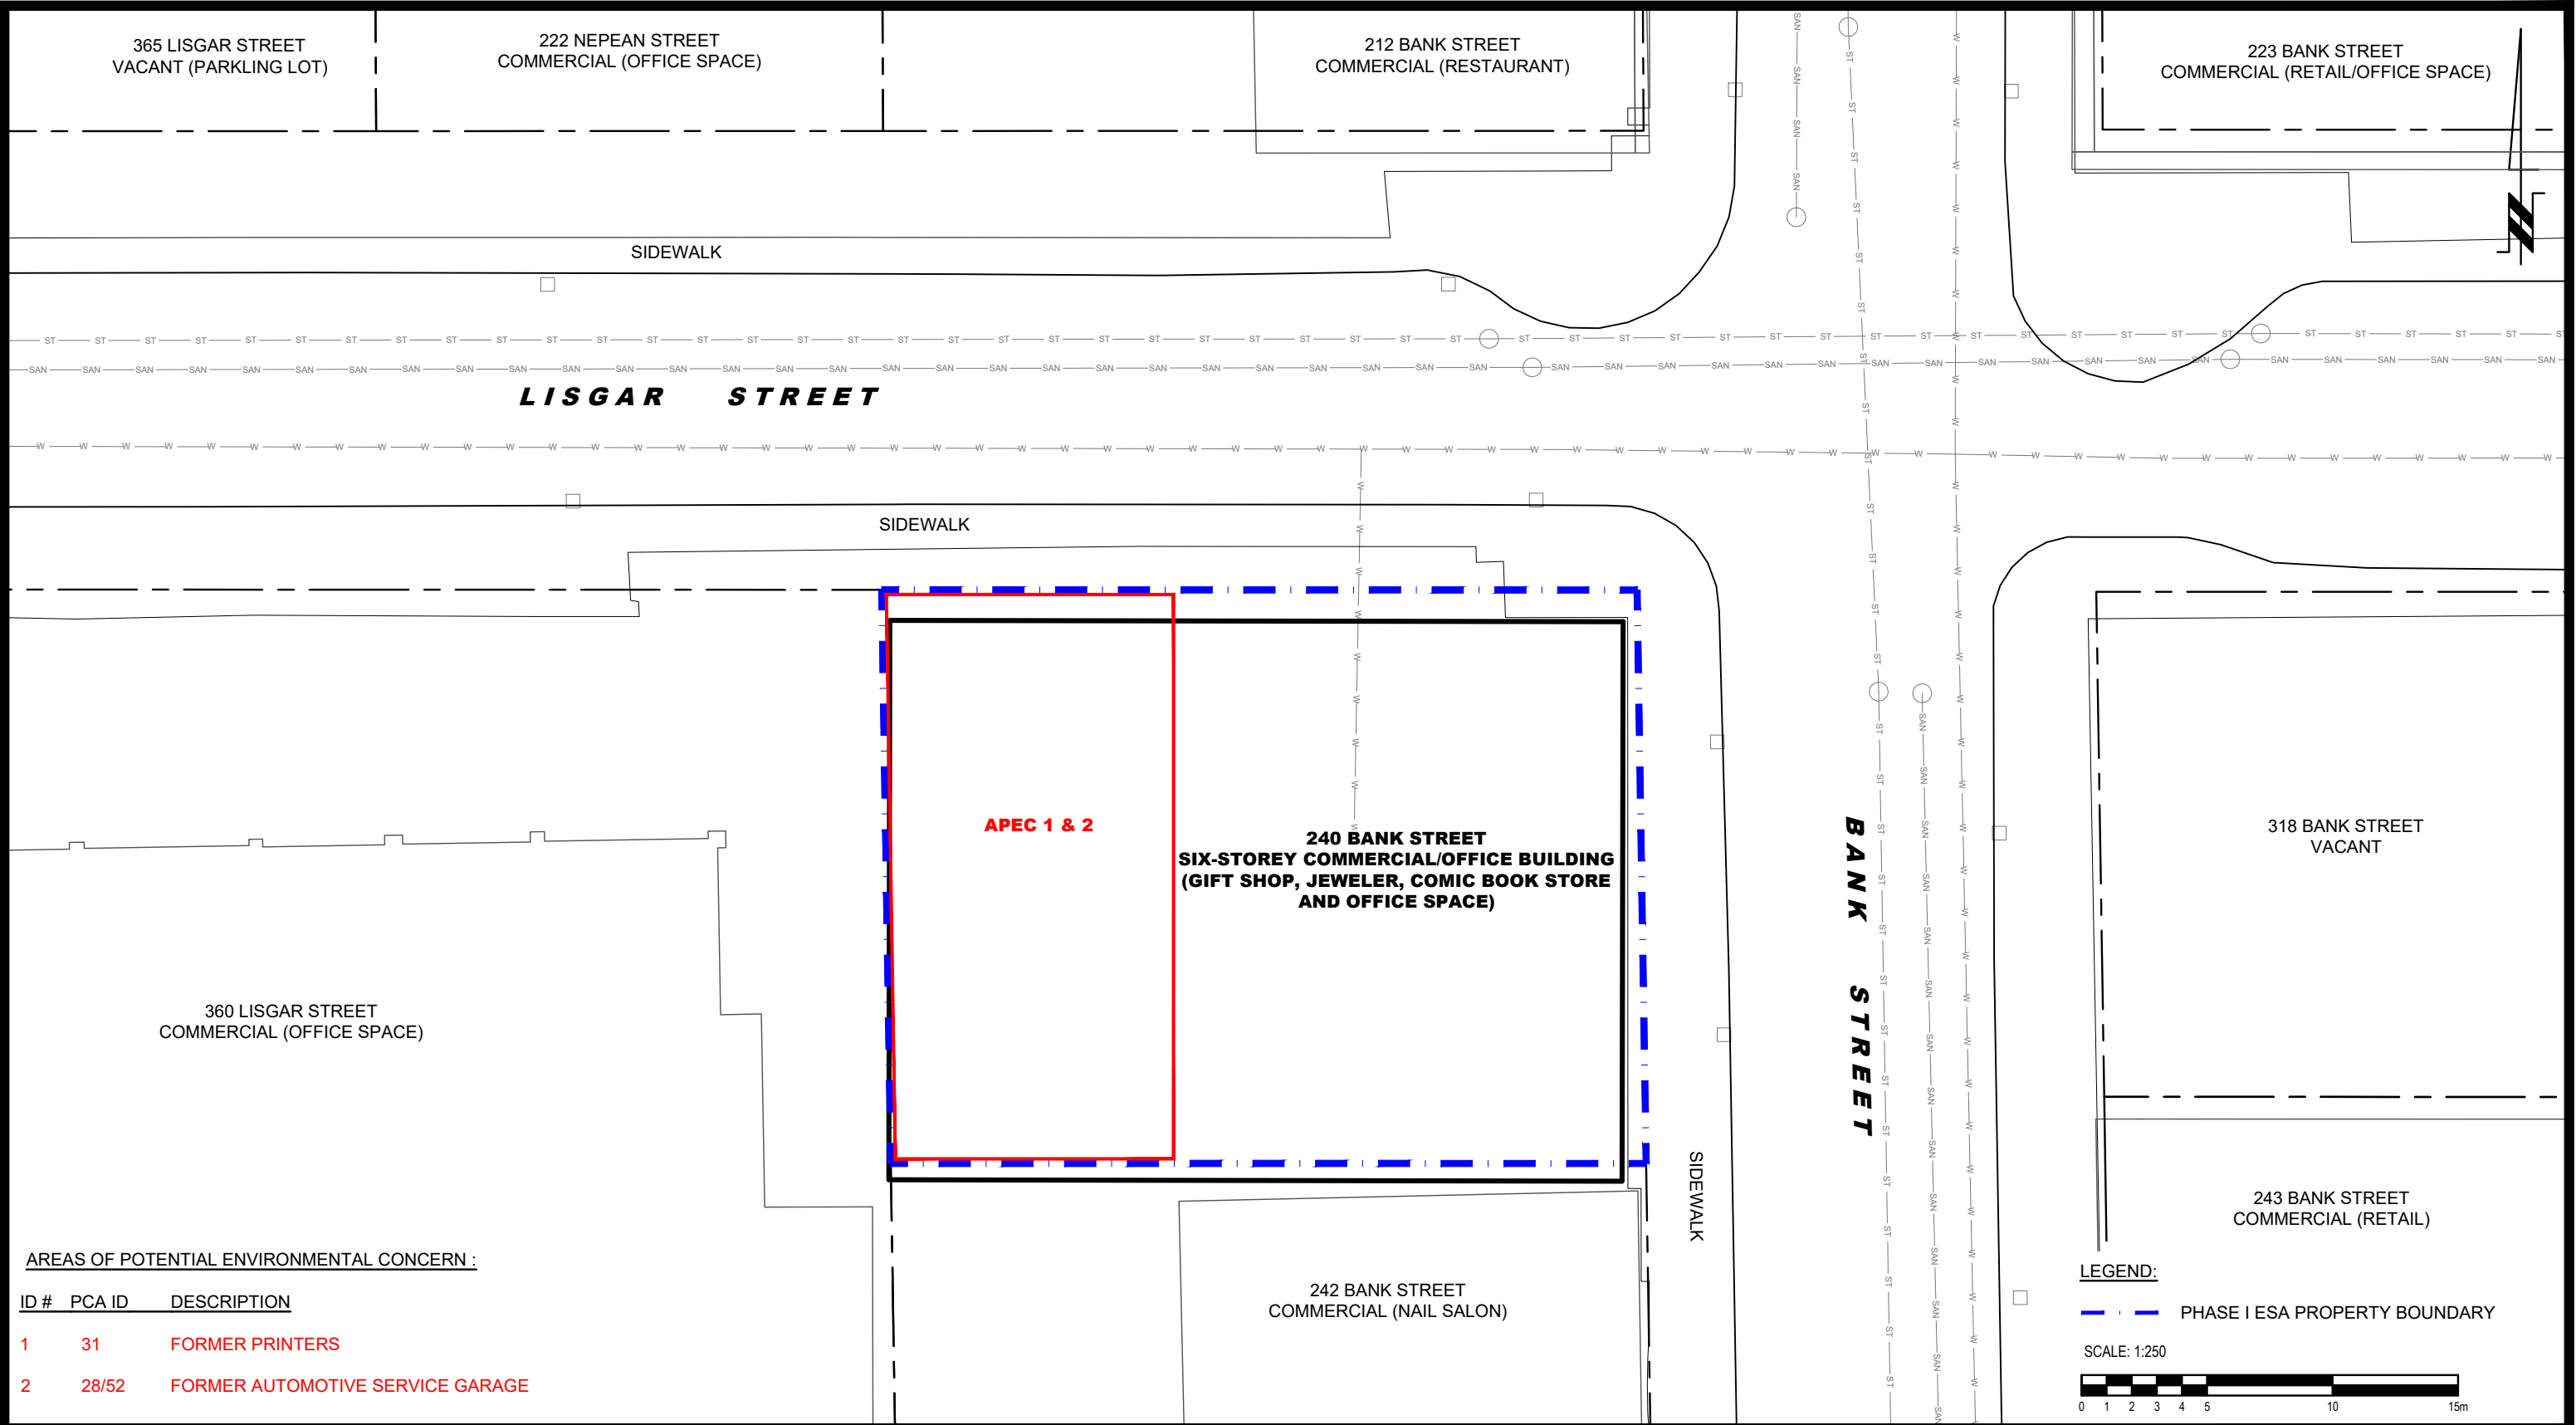

PATERSON GROUP
9 AURIGA DRIVE
OTTAWA, ON
K2E 7T9
TEL: (613) 226-7381

NO.	REVISIONS	DATE	INITIAL


240 BANK STREET HOLDINGS LTD.
PHASE I - ENVIRONMENTAL SITE ASSESSMENT
240 BANK STREET

OTTAWA,
Title:

ONTARIO


SITE PLAN

Scale:	1:250	Date:	01/2025
Drawn by:	ZS	Report No.:	PE6874-1
Checked by:	KP	Dwg. No.:	PE6874-1
Approved by:	MB	Revision No.:	

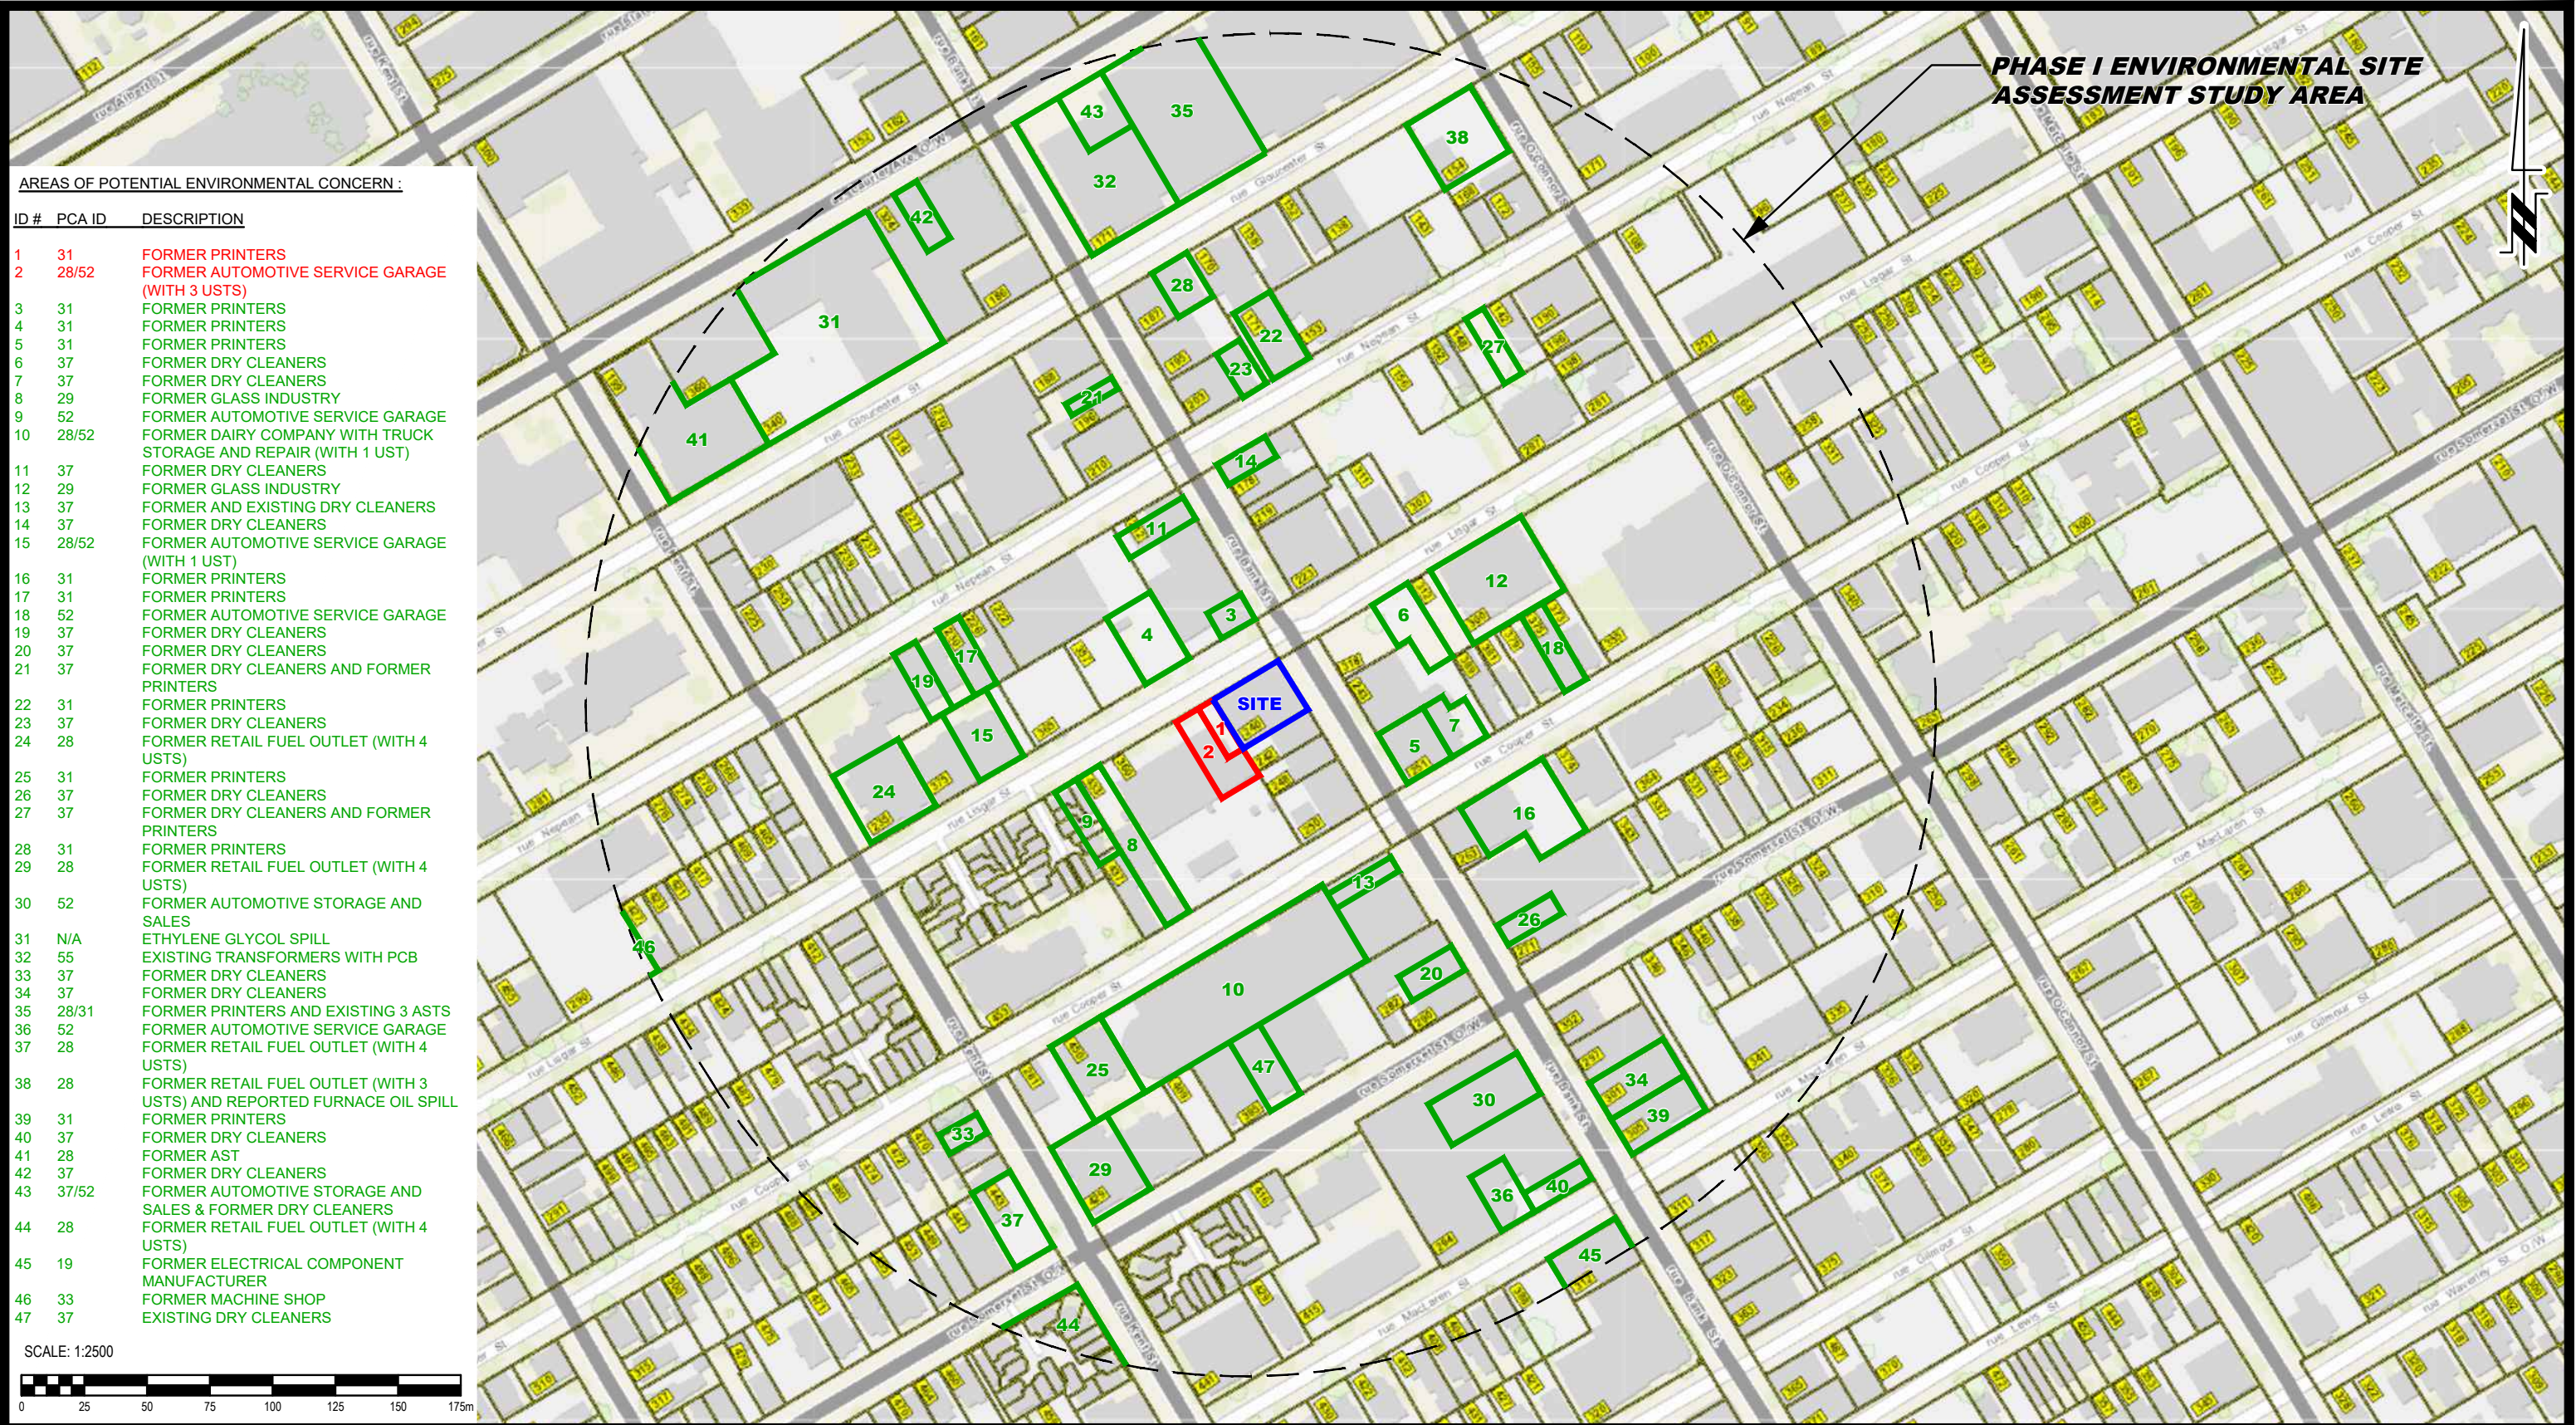

AREAS OF POTENTIAL ENVIRONMENTAL CONCERN :

ID #	PCA ID	DESCRIPTION
1	31	FORMER PRINTERS
2	28/52	FORMER AUTOMOTIVE SERVICE GARAGE (WITH 3 USTS)
3	31	FORMER PRINTERS
4	31	FORMER PRINTERS
5	31	FORMER PRINTERS
6	37	FORMER DRY CLEANERS
7	37	FORMER DRY CLEANERS
8	29	FORMER GLASS INDUSTRY
9	52	FORMER AUTOMOTIVE SERVICE GARAGE
10	28/52	FORMER DAIRY COMPANY WITH TRUCK STORAGE AND REPAIR (WITH 1 UST)
11	37	FORMER DRY CLEANERS
12	29	FORMER GLASS INDUSTRY
13	37	FORMER AND EXISTING DRY CLEANERS
14	37	FORMER DRY CLEANERS
15	28/52	FORMER AUTOMOTIVE SERVICE GARAGE (WITH 1 UST)
16	31	FORMER PRINTERS
17	31	FORMER PRINTERS
18	52	FORMER AUTOMOTIVE SERVICE GARAGE
19	37	FORMER DRY CLEANERS
20	37	FORMER DRY CLEANERS
21	37	FORMER DRY CLEANERS AND FORMER PRINTERS
22	31	FORMER PRINTERS
23	37	FORMER DRY CLEANERS
24	28	FORMER RETAIL FUEL OUTLET (WITH 4 USTS)
25	31	FORMER PRINTERS
26	37	FORMER DRY CLEANERS
27	37	FORMER DRY CLEANERS AND FORMER PRINTERS
28	31	FORMER PRINTERS
29	28	FORMER RETAIL FUEL OUTLET (WITH 4 USTS)
30	52	FORMER AUTOMOTIVE STORAGE AND SALES
31	N/A	ETHYLENE GLYCOL SPILL
32	55	EXISTING TRANSFORMERS WITH PCB
33	37	FORMER DRY CLEANERS
34	37	FORMER DRY CLEANERS
35	28/31	FORMER PRINTERS AND EXISTING 3 ASTS
36	52	FORMER AUTOMOTIVE SERVICE GARAGE
37	28	FORMER RETAIL FUEL OUTLET (WITH 4 USTS)
38	28	FORMER RETAIL FUEL OUTLET (WITH 3 USTS) AND REPORTED FURNACE OIL SPILL
39	31	FORMER PRINTERS
40	37	FORMER DRY CLEANERS
41	28	FORMER AST
42	37	FORMER DRY CLEANERS
43	37/52	FORMER AUTOMOTIVE STORAGE AND SALES & FORMER DRY CLEANERS
44	28	FORMER RETAIL FUEL OUTLET (WITH 4 USTS)
45	19	FORMER ELECTRICAL COMPONENT MANUFACTURER
46	33	FORMER MACHINE SHOP
47	37	EXISTING DRY CLEANERS



9 AURIGA DRIVE
OTTAWA, ON
K2E 7T9
TEL: (613) 226-7381

NO.	REVISIONS	DATE	INITIAL

240 BANK STREET HOLDINGS LTD.

PHASE I - ENVIRONMENTAL SITE ASSESSMENT

240 BANK STREET

OTTAWA, ONTARIO

Title:

SURROUNDING LAND USE PLAN

Scale: 1:2500

Drawn by: ZS

Checked by: KP

Approved by: MB

Date: 01/2025

Report No.: PE6874-1

Dwg. No.: **PE6874-2**

Revision No.:

APPENDIX 1

PLAN OF SURVEY

AERIAL PHOTOGRAPHS


SITE PHOTOGRAPHS

DISTANCES SHOWN ON THIS PLAN ARE IN METRES AND CAN BE CONVERTED TO FEET BY DIVIDING BY 0.3048

THIS PLAN MUST BE READ IN CONJUNCTION WITH
SURVEY REPORT DATED December 6, 2005


Q	Survey Monument Plotted, 1860.	
Q	Survey Monument Found.	
SIB	Survey Monument Found.	
SSIB	Standard Inq. Bc.	
IB	Short Standard Iron Bc.	
CC	Iron Bc.	
(WIT)	Cut Cross.	
Meas.	Winnes.	
(P1)	Measured.	
(P2)	Plan by (AO3) December	
(P3)	Registered Plan 12281.	
(P4)	Plan by (647) July 20, 1860.	
(P5)	Plan by (690) July 27, 1860.	
(P6)	Plan by (693) July 27, 1860.	
(P7)	Plan by (632) June 15, 1860.	
(AO3)	Plan by (AO3) July 10, 1860.	
Bldg	O'Sullivan, Vellekette, 1860.	
Fdn	Building.	
Meas	Foundation.	
Acc	Measured.	
Acc	Accepted.	
	Bellard (Centre Noted).	

Land Surveyor





AERIAL PHOTOGRAPH
1933

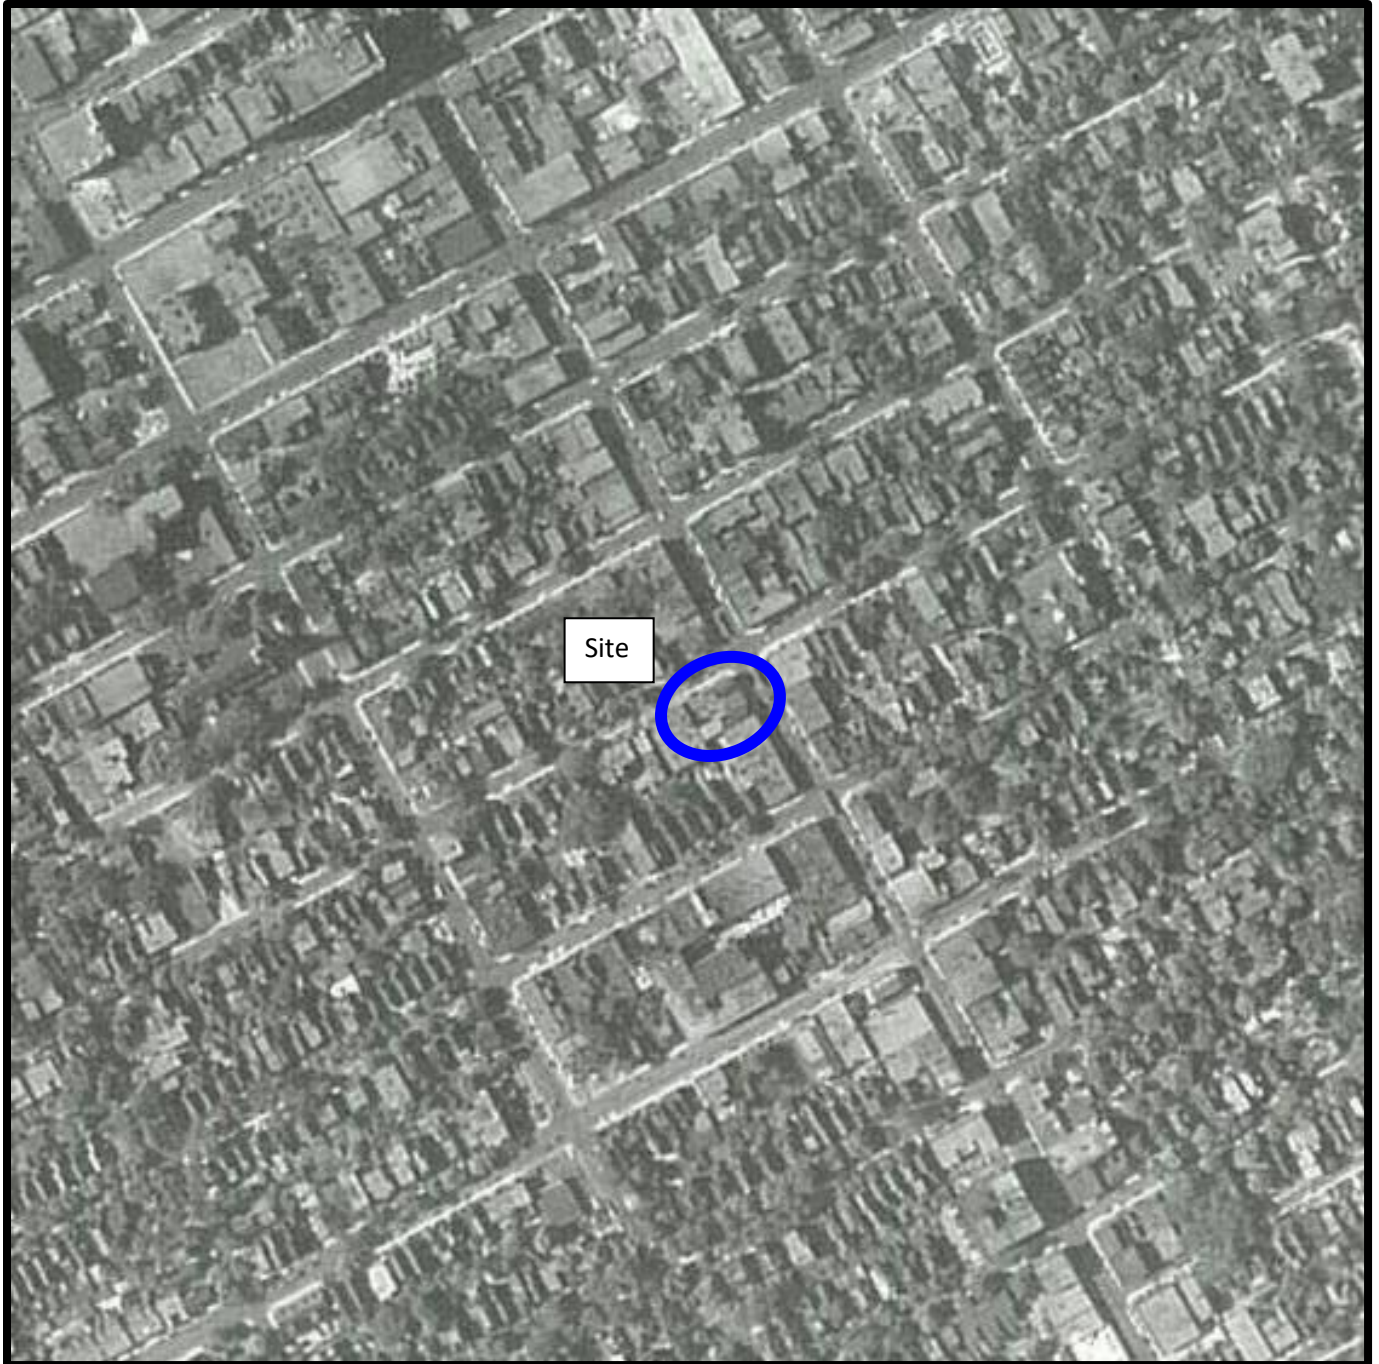

AERIAL PHOTOGRAPH
1949




AERIAL PHOTOGRAPH
1958




AERIAL PHOTOGRAPH
1965




AERIAL PHOTOGRAPH
1976

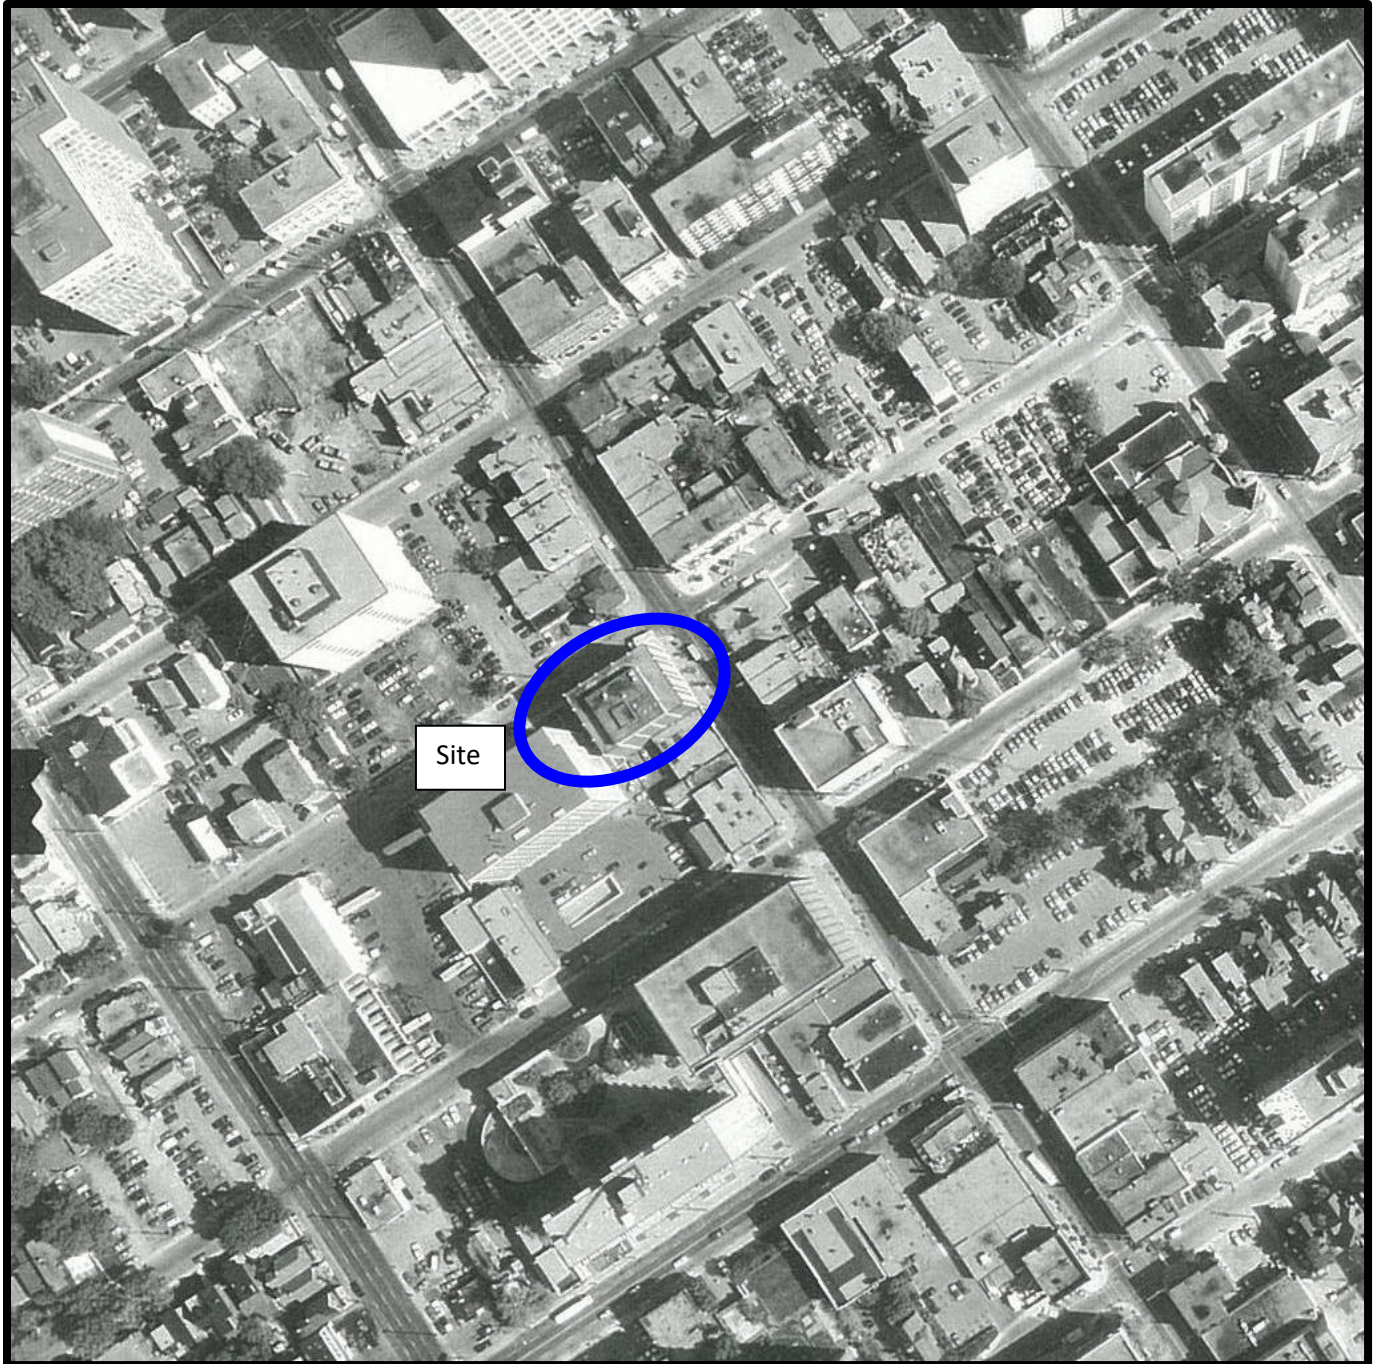


AERIAL PHOTOGRAPH
1984

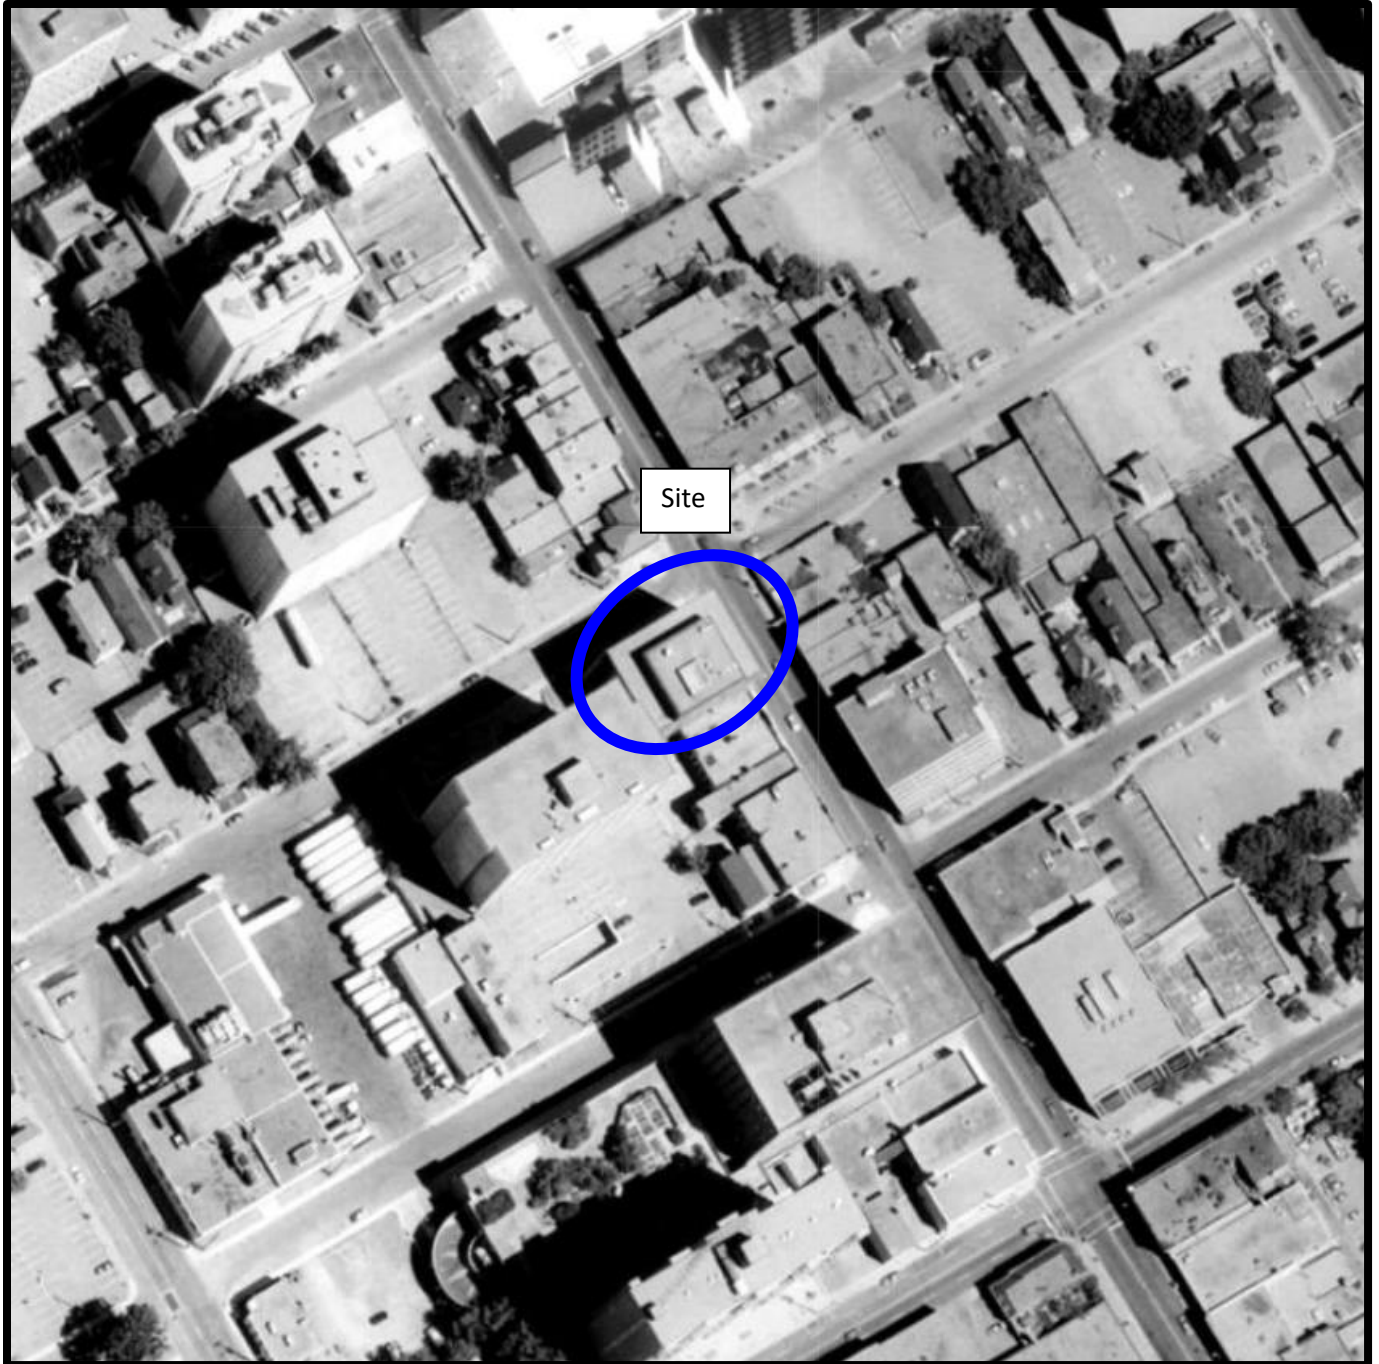

AERIAL PHOTOGRAPH
1991

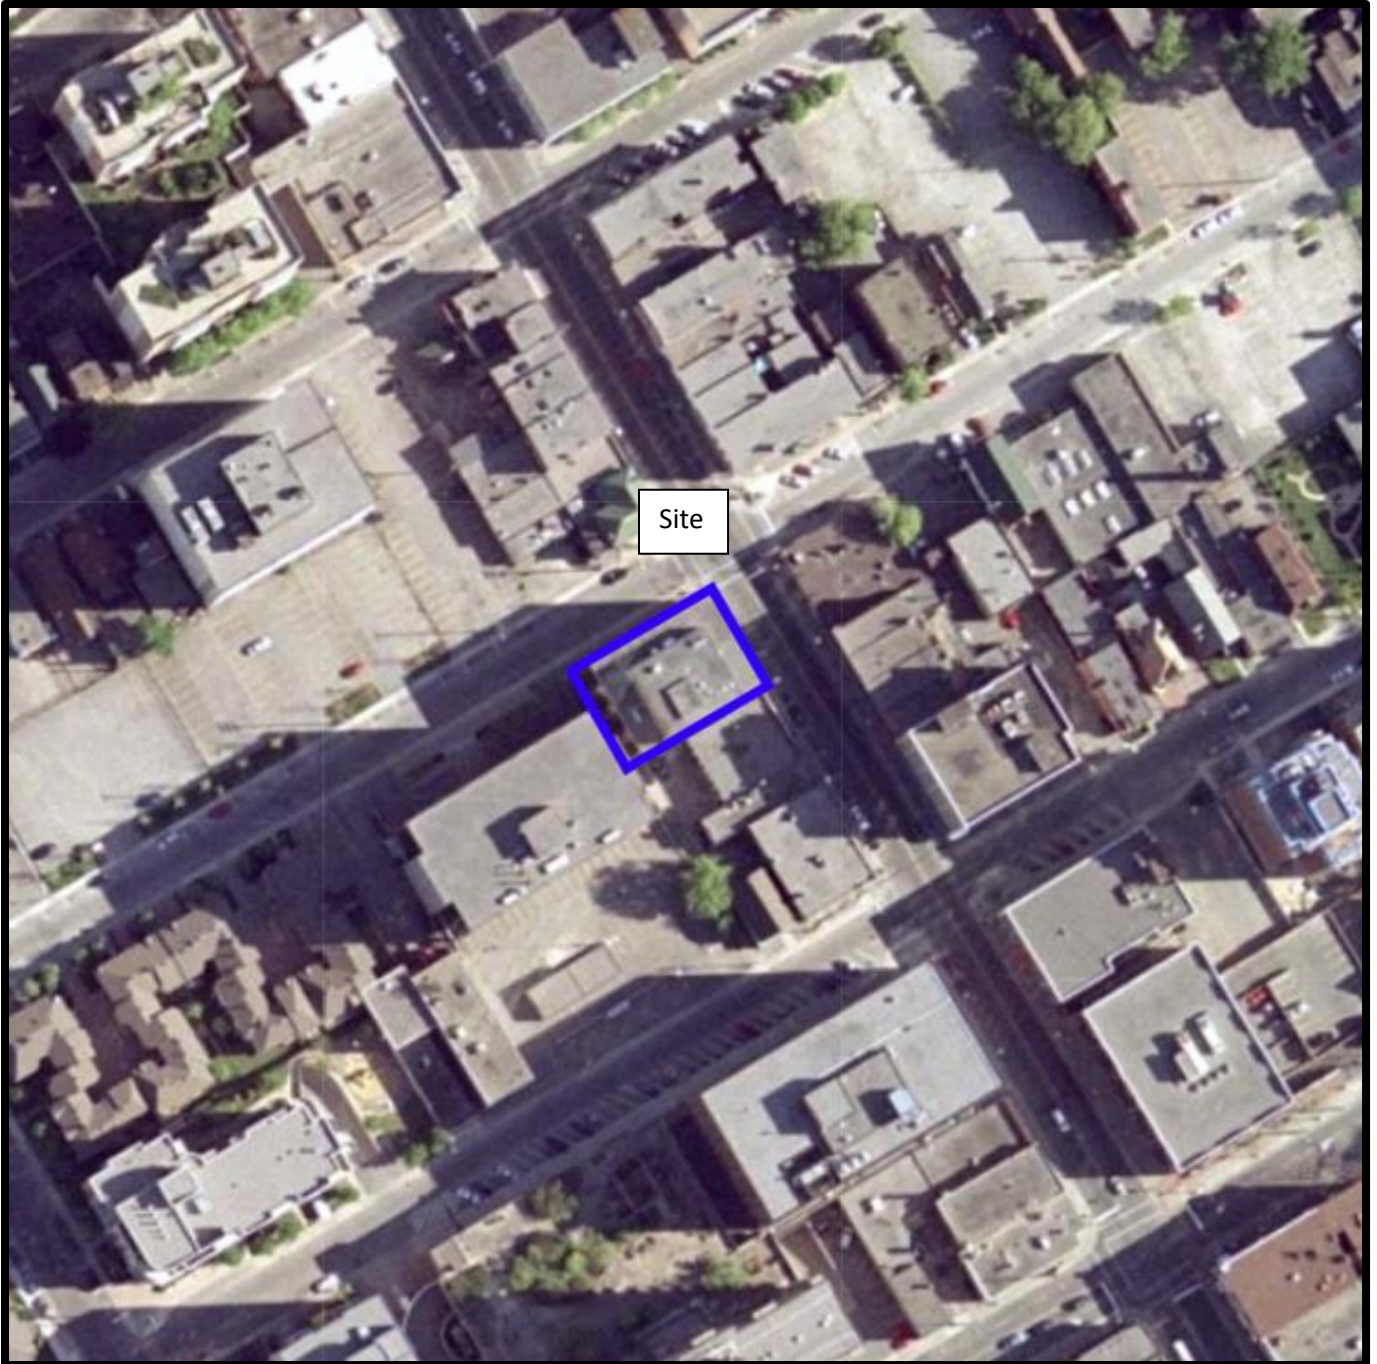

AERIAL PHOTOGRAPH
2002

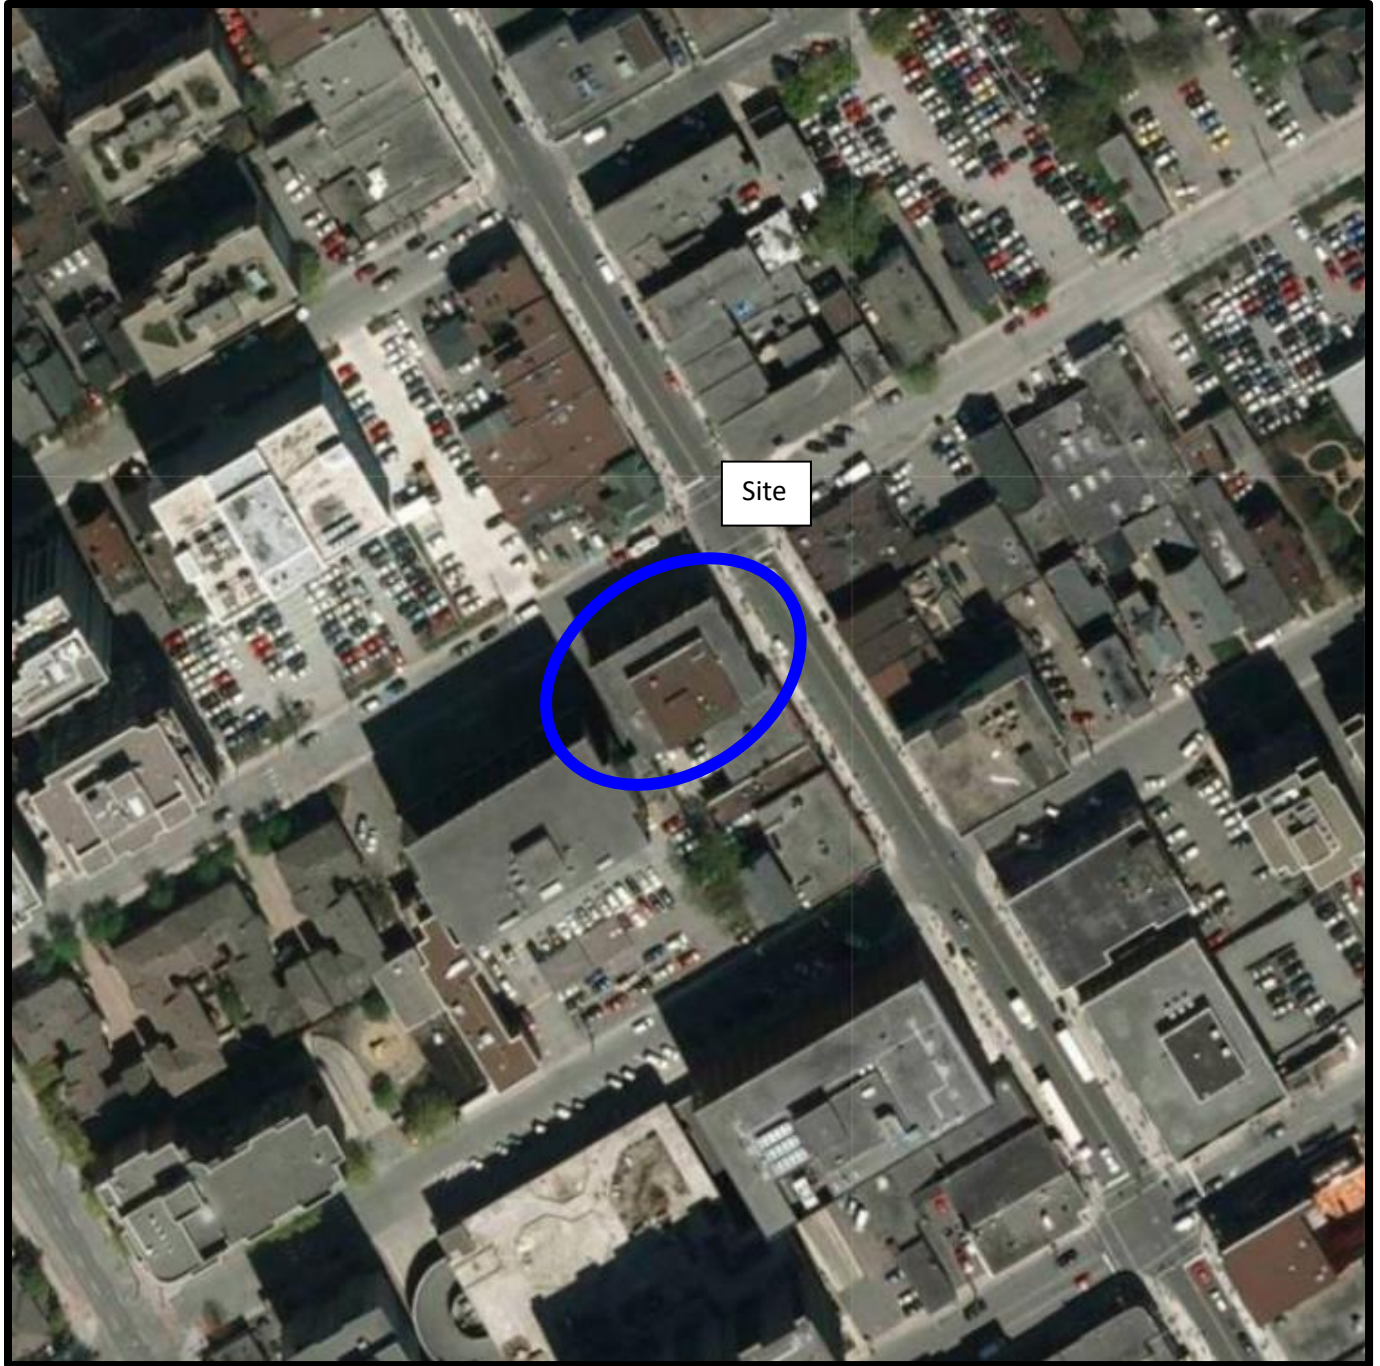

AERIAL PHOTOGRAPH
2011



AERIAL PHOTOGRAPH
2024

Site Photographs

PE6874

240 Bank Street, Ottawa ON

January 24, 2025



Photograph 1: View of the Phase I Property from Bank Street, facing south.

Site Photographs

PE6874

240 Bank Street, Ottawa ON

January 24, 2025



Photograph 2: View of the Phase I Property from Lisgar Street, facing west.

APPENDIX 2

MECP FREEDOM OF INFORMATION ACKNOWLEDGEMENT LETTER

MECP WELL RECORDS

TSSA CORRESPONDENCE

CITY OF OTTAWA HLUI REQUEST

ERIS REPORT

**Ministry of the Environment,
Conservation and Parks**

Corporate Services Branch
40 St. Clair Avenue West
Toronto ON M4V 1M2

**Ministère de l'Environnement, de la
Protection de la nature et des Parcs**

Direction des services ministériels
40, avenue St. Clair Ouest
Toronto ON M4V 1M2



January 15, 2025

Kuldeep Panchal
Paterson Group
9 Auriga Drive
Ottawa, Ontario
kpanchal@patersongroup.ca

Dear Kuldeep Panchal:

**RE: MECP FOI A-2025-00285 / Your Reference PE6874 –
Acknowledgement Letter**

The Ministry is in receipt of your request made pursuant to the Freedom of Information and Protection of Privacy Act. **The search will be conducted on the following:**

240 Bank Street (Known historic 234, 236, & 238 Bank Street), Ottawa

Timeframe: January 1st, 1900 to January 14th, 2025

If there is any discrepancy, please contact us immediately.

Please note the file number that has been assigned to your request. This number should be referred to in all future communications with our office.

If you have any questions, please contact Adeolu Paul-Taiwo at adeolu.paul-taiwo@ontario.ca.

Yours truly,
Adeolu Paul-Taiwo
MECP Access and Privacy Office

035.58

Instructions for Completing Form

- For use in the Province of Ontario only. This document is a permanent legal document. Please retain for future reference.
- All Sections must be completed in full to avoid delays in processing. Further instructions and explanations are available on the back of this form.
- Questions regarding completing this application can be directed to the Water Well Management Coordinator at 416-235-6203.
- All metre measurements shall be reported to 1/10th of a metre.
- Please print clearly in blue or black ink only.

Ministry Use Only

Address of Well Location (County/District/Municipality) City of Ottawa Township Lot Concession

RR#/Street Number/Name Somerset Roadway City/Town/Village Ottawa Site/Compartment/Block/Tract etc.

GPS Reading NAD Zone Easting Northing Unit Make/Model Mode of Operation: Undifferentiated Averaged Differentiated, specify WASS

Log of Overburden and Bedrock Materials (see instructions)

General Colour	Most common material	Other Materials	General Description	Depth From	Metres To
Grey	asphalt, crushed gravel		Typical Monitoring well	0	0.8
Brown	Sand, trace silt		Installation	0.8	1.2
Grey	Silty clay trace sand			1.2	6
6 Monitoring well: AS + Cluster					
1 Typical Installation					

Hole Diameter

Depth From	Metres To	Diameter Centimetres
0	6m	20cm

Water Record

Water found at Metres Kind of Water

Construction Record

Inside diam centimetres	Material	Wall thickness centimetres	Depth From	Metres To
50	Steel Fibreglass Plastic Concrete Galvanized	40	0	3m
61.5	Steel Fibreglass Plastic Concrete Galvanized	10	3m	6m

Test of Well Yield

Pumping test method	Draw Down Time min	Water Level Metres	Recovery Time min	Water Level Metres
Pump intake set at - (metres)	1	1		
Pumping rate - (litres/min)	2	2		
Duration of pumping hrs + min	3	3		
Final water level end of pumping metres	4	4		
Recommended pump type. Shallow Deep	5	5		
Recommended pump depth. metres	10	10		
Recommended pump rate. (litres/min)	15	15		
If flowing give rate - (litres/min)	20	20		
	25	25		
If pumping discontinued, give reason.	30	30		
	40	40		
	50	50		
	60	60		

Plugging and Sealing Record

Depth set at - Metres From To

Material and type (bentonite slurry, neat cement slurry) etc.

Volume Placed (cubic metres)

Method of Construction

Water Use

Final Status of Well

Location of Well

In diagram below show distances of well from road, lot line, and building. Indicate north by arrow.

Audit No. 30507 Date Well Completed 2005 04 27

Was the well owner's information package delivered? Yes No

Well Contractor/Technician Information

Name of Well Contractor George Downing Estate Drilling

Well Contractor's Licence No. 1844

Business Address (street name, number, city etc.) 410 Main St. Grenville-sur-la-Rouge QC J0V 1B0

Name of Well Technician (last name, first name) Downing Bruce

Well Technician's Licence No. T2173

Signature of Technician/Contractor

Date Submitted 2005 10 03

Ministry Use Only

Data Source Contractor

Date Received 2005 04 27 Date of Inspection


Remarks

Well Record Number

230507

1844

JUN 24 2005

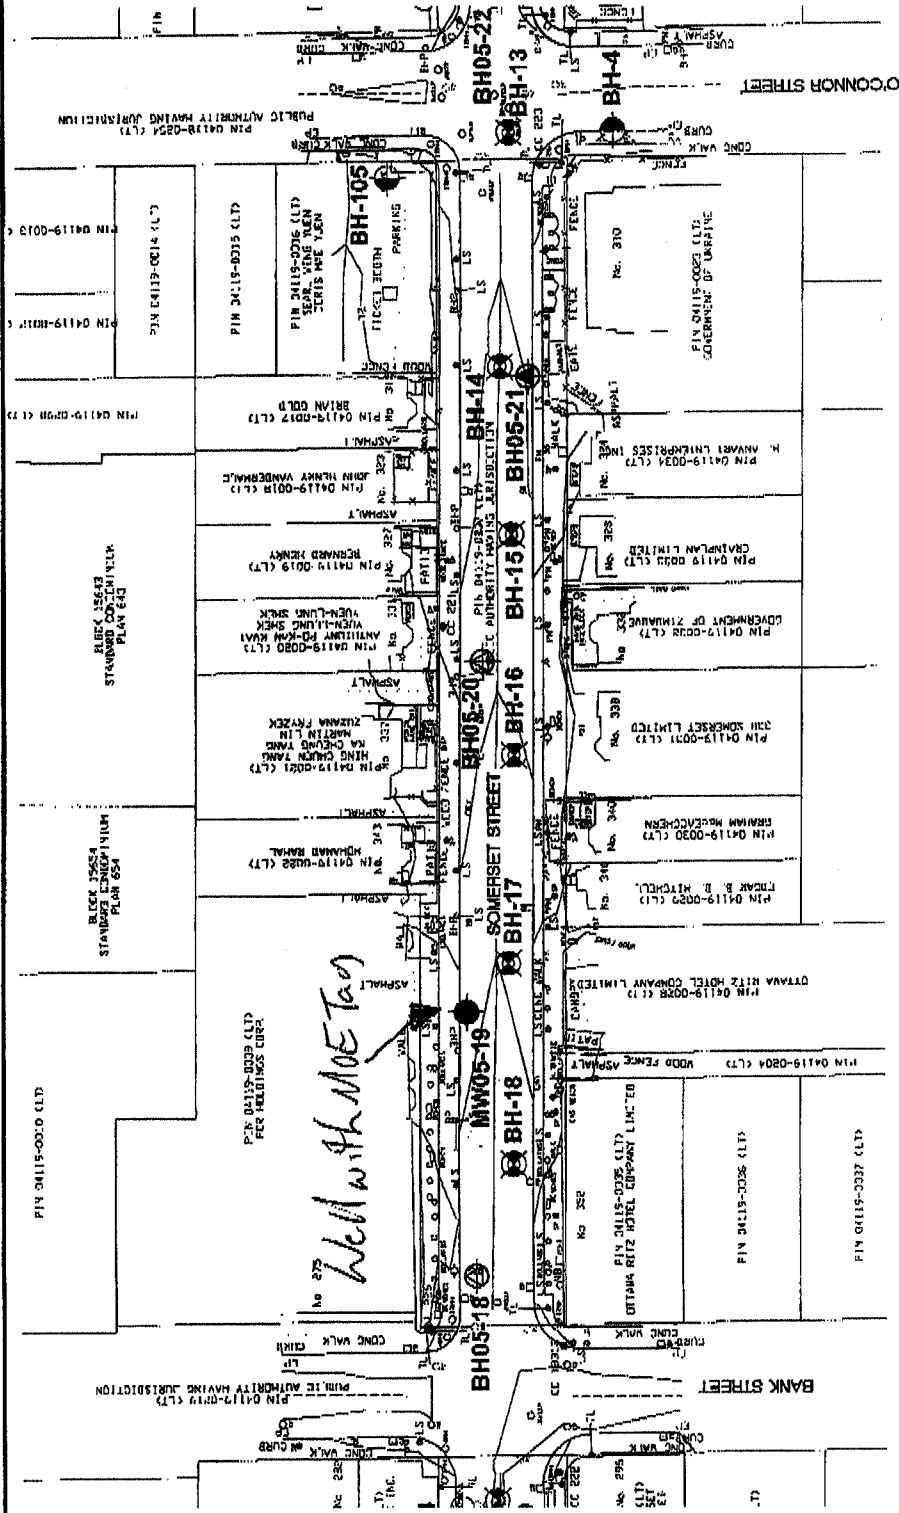

LEGEND:

- BH-106 APPROXIMATE BOREHOLE LOCATION, PREVIOUS INVESTIGATION BY GOLDER (REPORT NO. 991-2211)
- BH-25 APPROXIMATE BOREHOLE LOCATION, PREVIOUS INVESTIGATION BY TROW (REPORT NO. TA 12105A)
- BH-4 APPROXIMATE BOREHOLE LOCATION, PREVIOUS INVESTIGATION BY OTHERS (PLAN 1526, EXISTING COMBINED SEWER, O'CONNOR STREET)
- BH05 APPROXIMATE BOREHOLE LOCATION BY JACQUES WHITFORD, 2005

- BH05 APPROXIMATE BOREHOLE LOCATION BY JACQUES WHITFORD, 2005 (ASPHALT OVERLAID CONCRETE PAVEMENT)
- MW05 APPROXIMATE MONITORING WELL LOCATION BY JACQUES WHITFORD, 2005

DELCAN CORPORATION
SOMERSET STREET
FROM BANK STREET TO O'CONNOR STREET
BOREHOLE AND MONITORING WELL LOCATION PLAN

OTTAWA,

ONTARIO

Scale:	Proj. No.:	Dwg. No.:
1:1000	ON063588-1	1
Date:	Dwn. by:	Appd.:
05/05/12	GBB	

Instructions for Completing Form

- For use in the **Province of Ontario** only. This document is a permanent **legal** document. Please retain for future reference.
- All Sections **must** be completed in full to avoid delays in processing. Further instructions and explanations are available on the back of this form.
- Questions regarding completing this application can be directed to the Water Well Help Desk (Toll Free) at 1-888-396-9355.
- All metre measurements shall be reported to 1/10th of a metre.**
- Please print clearly in blue or black ink only.

Well Owner's Information and Location of Well Information

First Name

Last Name

Mailing Address (Street Number/Name, RR, Lot, Concession)

County/District/Municipality

Township/City/Town/Village

Province

Postal Code

Telephone Number (include area code)

Address of Well Location (County/District/Municipality)

Township

Lot

Concession

RR#/Street Number/Name

City/Town/Village

Site/Compartment/Block/Tract etc.

GPS Reading

NAD

Zone

Easting

Northing

Unit Make/Model

Mode of Operation:

☐ Undifferentiated
 ☒ Averaged
 ☐ Differentiated, specify _____

Log of Overburden and Bedrock Materials (see instructions)

General Colour	Most common material	Other Materials	General Description	Depth From	Metres To
Brn	Topsoil		Sandy Gravel, soft	0	.91
Brn	silt	Sand / clay	fine Sand, dry, soft	.91	1.5
Brn Grey	silt	clay	Soft, moist	1.5	3.66
Grey	clay	silt	Soft, moist	3.66	6.1
Grey	clay		wet, sticky, soft	6.1	8.23

Hole Diameter

Depth

Metres

Diameter

From

To

Centimetres

0

8.23

8.84

Water Record

Water found at _____ Metres / Kind of Water

☐ m ☐ Fresh ☐ Sulphur
 ☐ Gas ☐ Salty ☐ Minerals

Other: _____

☐ m ☐ Fresh ☐ Sulphur
 ☐ Gas ☐ Salty ☐ Minerals

Other: _____

After test of well yield, water was

☐ Clear and sediment free
 ☐ Other, specify _____

Chlorinated

☐ Yes ☐ No

Construction Record

Inside diam centimetres

Material

Wall thickness centimetres

Depth

Metres

From

To

Casing

3.81

☐ Steel ☐ Fibreglass
 ☒ Plastic ☐ Concrete
 ☐ Galvanized

0.25

0

4.88

Screen

Outside diam

☐ Steel ☐ Fibreglass
 ☒ Plastic ☐ Concrete
 ☐ Galvanized

Slot No.

10

4.88

8.23

No Casing or Screen

☐ Open hole

Test of Well Yield

Pumping test method

Draw Down

Recovery

Time min

Water Level Metres

Time min

Water Level Metres

Pump intake set at - (metres)

Static Level

1

1

Pumping rate - (litres/min)

2

2

Duration of pumping _____ hrs + _____ min

3

3

Final water level end of pumping _____ metres

4

4

Recommended pump type. ☐ Shallow ☐ Deep

5

5

Recommended pump depth. _____ metres

10

10

Recommended pump rate. (litres/min)

15

15

If flowing give rate - (litres/min)

20

20

If pumping discontinued, give reason.

25

25

30

30

40

40

50

50

60

60

Plugging and Sealing Record

☒ Annular space
 ☐ Abandonment

Depth set at - Metres

Material and type (bentonite slurry, neat cement slurry) etc.

Volume Placed (cubic metres)

From

To

Plushmount / concrete

Benseal

Sand

0

.31

.31

Method of Construction

☐ Cable Tool
 ☐ Rotary (air)
 ☐ Diamond
 ☐ Digging
 ☐ Rotary (conventional)
 ☐ Air percussion
 ☐ Jetting
 ☒ Other
 ☐ Rotary (reverse)
 ☐ Boring
 ☐ Driving

Geoprobe

Water Use

☐ Domestic
 ☐ Industrial
 ☐ Public Supply
 ☒ Other
 ☐ Stock
 ☐ Commercial
 ☐ Not used

Monitoring well

☐ Irrigation
 ☐ Municipal
 ☐ Cooling & air conditioning

Final Status of Well

☐ Water Supply
 ☐ Recharge well
 ☐ Unfinished
 ☐ Abandoned, (Other)
 ☒ Observation well
 ☐ Abandoned, insufficient supply
 ☐ Dewatering
 ☒ Test Hole
 ☐ Abandoned, poor quality
 ☐ Replacement well

Well Contractor/Technician Information

Name of Well Contractor

Well Contractor's Licence No.

Business Address (street name, number, city etc.)

147 WEST BEAVER CREEK, RICHMOND HILL

Name of Well Technician (last name, first name)

Well Technician's Licence No.

PENGELIUS JOAN T-3069

T-3069

Signature of Technician/Contractor

Date Submitted

X

2007 06 22

Location of Well

In diagram below show distances of well from road, lot line, and building. Indicate north by arrow.

Audit No.

Date Well Completed

Z 74024

2007 06 22

Was the well owner's information package delivered?

☐ Yes
 ☒ No

Ministry Use Only

Data Source

Contractor

Date Received

Date of Inspection

Remarks

Well Record Number

JUL 17 2007

0506E (08/2006)

Brenton Brian, 1796

Ministry's Copy

Cette formule est disponible en français



Ministry of
the Environment

Well Tag No. for Master Well (Place Sticker and/or Print Below)

A 074637

mw-9

Master Well Record for Cluster Well Construction

Regulation 903 Ontario Water Resources Act

Page 1 of 2

Master Well Owner's and Land Owner's Information

First Name	Last Name	E-mail Address
Shell Canada Products		
Mailing Address (Street Number/Name, RR)	Municipality	Province
90 Sheppard Ave. Ste 600	Toronto	ON
Postal Code	Telephone No. (inc. area code)	
M9W1G4Y2	4162271111	

Location and Construction of the Master Well in the Cluster

Address of Well Location (Street Number/Name, RR)	Township	Lot	Concession
154 O'Connor Street			
County/District/Municipality	City/Town/Village	Province	Postal Code
	Ottawa	Ontario	

UTM Coordinates	Zone	Easting	Northing	GPS Unit Make	Model	Mode of Operation:	☐ Undifferentiated	☒ Averaged
NAD 83	118	44514815	501219467	Garmin	Etrex	☐ Differentiated, specify		

Overburden and Bedrock Materials (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (Metres)
				From To
	Asphalt surface			0 0.1
	Gray Sand - Gravel fill	moist		0.1 0.4
	Brown Sand fill			0.4 0.5
	Brown/Black Sandy clay fill	moist		0.5 1.5
	Gray Silty clay some sand fractured			1.5 4.8
	Black/Brown unconsolidated shale			4.8 6.1

Hole Details

Depth (Metres)	Diameter (Centimetres)
From To	
0 4.8	20
4.8 6.1	10

Water Use

☐ Public	☐ Industrial	☐ Not used	☐ Other, specify
☐ Domestic	☐ Commercial	☐ Dewatering	
☐ Livestock	☐ Municipal	☒ Monitoring	
☐ Irrigation	☐ Test Hole	☐ Cooling & Air Conditioning	

Method of Construction

☐ Cable Tool	☐ Air Percussion	☐ Digging
☐ Rotary (Conventional)	☐ Diamond	☐ Boring
☐ Rotary (Reverse)	☐ Jetting	☐ Other, specify
☐ Rotary (Air)	☐ Driving	Geoprobe

Status of Well

☒ Test Hole	☐ Abandoned, Insufficient Supply
☐ Replacement Well	☐ Abandoned, Poor Water Quality
☐ Dewatering Well	☐ Other, specify
☐ Alteration (Construction)	☐ Abandoned, other, specify

No Casing and Screen Used

Open Hole	Static Water Level Test
☐ Yes ☒ No	7.68 Metres

Screen

☐ Galvanized	☐ Steel	☐ Fibreglass	☐ Concrete	☒ Plastic
Outside Diameter (Centimetres)	Slot No.			
3.8	10			

Water Details

Water found at Depth	Kind of Water
Metres ☐ Gas	☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals
Water found at Depth	Kind of Water
Metres ☐ Gas	☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals
Water found at Depth	Kind of Water
Metres ☐ Gas	☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals

Disinfected ☐ Yes ☒ No	If no, provide reason:	Date Master Well Completed (yyyy/mm/dd)
	Monitoring well	2009/07/25

Cluster Information (Please also fill out the additional Cluster Well Information for Well Construction for each parcel of land and cluster.)

Total Wells in Cluster	Please indicate Number of Cluster Well Information Log Sheets Submitted
7	
Total Wells on this Property	
unknown	1

Location of Well Cluster

Detailed Map must be provided as an attachment no larger than legal size (8.5" x 14"). Sketches are not allowed.

☐ Check box to confirm detailed map is provided as per Section 11.1 (3)

Construction Details

Inside Diameter (Centimetres)	Material (steel, plastic, fibreglass, concrete, galvanized)	Wall Thickness	Depth (Metres)
			From To
3.2	Atmospheric PVC	3rd 40	0 3.0

Annular Space/Abandonment Sealing Record

Depth Set at (Metres)	Type of Sealant Used (Material and Type)	Volume Used (Cubic Metres)
From To		
0.1 2.4	Benfonite	40 kgs

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
George Downing Estate Drilling Ltd	118 14 14
Business Address (Street No./Name, number, RR)	Municipality
410 Rue Principale Greenville Stn La Rouge	
Province	Postal Code
QC	J10N1J1B101
Business E-mail Address	
downing@hawk.195.net	
Bus. Telephone No. (inc. area code)	Name of Well Technician (Last Name, First Name)
8119124124449	Downing Bruce
Well Technician's Licence No.	Signature of Technician
211713	
	Date Submitted (yyyy/mm/dd)
	2009/09/17

Ministry Use Only

Audit No.	Well Contractor No.
M 04512	
Date of Review (yyyy/mm/dd)	Date of Inspection (yyyy/mm/dd)
Oct 09 2009	
Remarks	

Property Owner's information

First Name Shull Canada Products		Last Name		Mailing Address (Street No./Name, RR) 90 Sheppard Ave. Ste 600			Municipality Toronto		
Province ONTARIO		Postal Code M2N 6Y2		E-mail Address			Telephone No. (inc. area code) 416 227 7111		

Cluster Well Information

Address of Well Location (Street Number/Name, RR) 154 O'Connor Street			Lot	Concession	Township		County/District/Municipality	
City/Town/Village Ottawa		Province Ontario	Postal Code		GPS Unit Make GARMIN	Model Etrex	Unit Mode of Operation ☐ Undifferentiated ☒ Averaged ☐ Differentiated, specify:	


Signature of Technician/Contractor		Date (yyyy/mm/dd)
		2009/09/17

[illegible]

Well Contractor and Well Technician Information

Business Name of Well Contractor. George Dawning Estate Drilling Ltd.			Business Address (Street Number/Name, RR) 410 Rue Principale Greenville			Municipality Sue La Rouge		Province QC	
Postal Code J0V 1B0		Business Telephone No. (inc. area code) 811 924 2646		Well Contractor's Licence No. 1844		Business E-mail Address downing@hawk.195.net			
Name of Well Technician (First Name, Last Name) Bruce Dawning				Well Technician's Licence No. 2173		Date Submitted (yyyy/mm/dd) 2009/09/17		Signature of Technician <i>Bruce Dawning</i>	

Date 1st Well in Cluster Constructed (yyyy/mm/dd) 2009/07/24	Date Last Well in Cluster Constructed (yyyy/mm/dd) 2009/07/25
Ministry Use Only	
Date Received (yyyy/mm/dd) OCT 01 2009	Date Inspected (yyyy/mm/dd)
Audit No. C 05217	Remarks m 4512

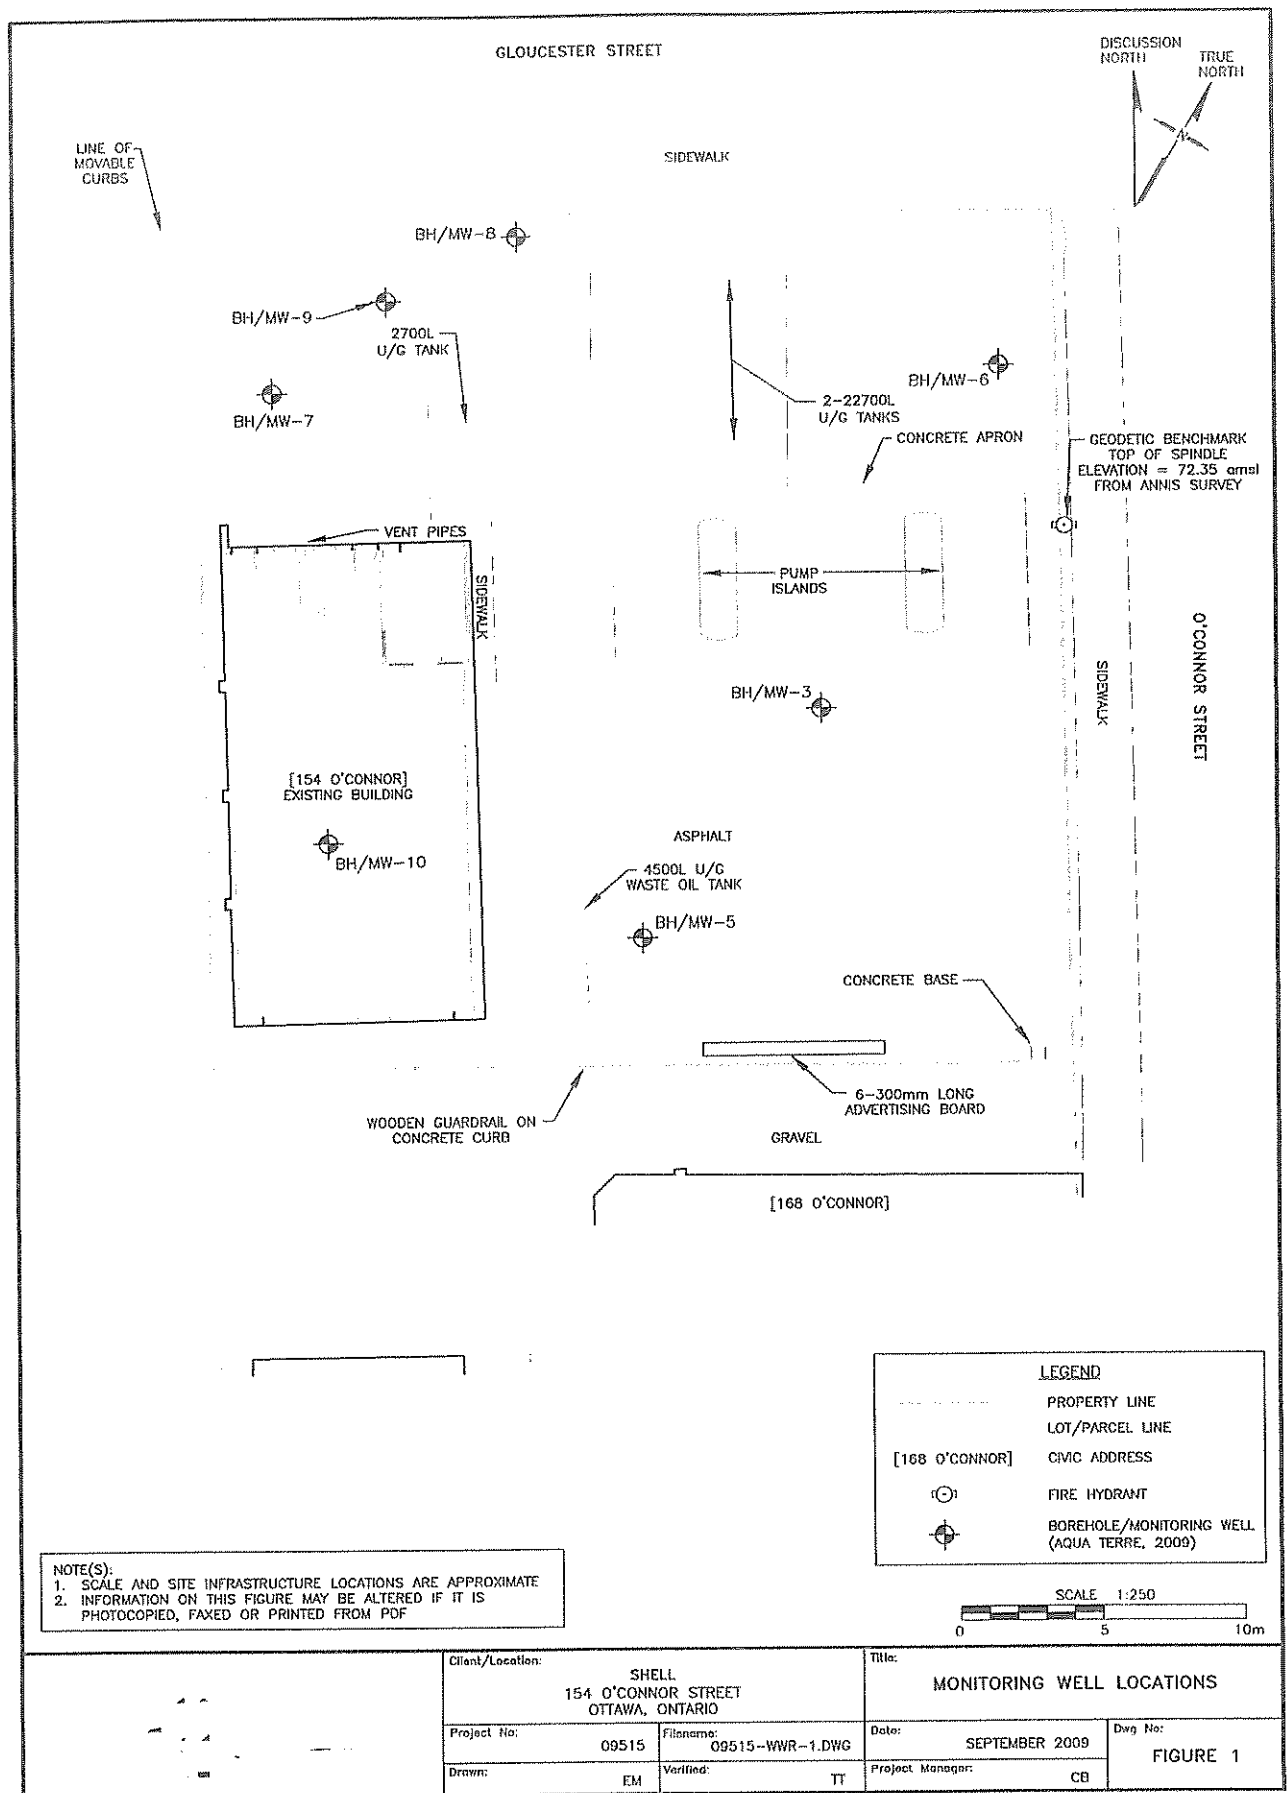

C-1844 M04512 C05217.

OCT 01 2009

Master Well Owner's and Land Owner's Information

First Name Shell Canada Products	Last Name	E-mail Address
Mailing Address (Street Number/Name, RR) 90 Sheppard Ave East Suite 600 Toronto	Municipality ON	Province Postal Code M2N 6Y2 / 622 7711

Location and Construction of the Master Well in the Cluster

Address of Well Location (Street Number/Name, RR) 154 O'Connor Street	Township	Lot	Concession
County/District/Municipality	City/Town/Village Ottawa	Province Ontario	Postal Code

UTM Coordinates NAD 83 18 44 50 63 50 29 67 6	Zone Easting	Northing	GPS Unit Make Garmin	Model Etrex	Mode of Operation: ☐ Undifferentiated ☒ Averaged ☐ Differentiated, specify

Overburden and Bedrock Materials (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (Metres) From To
			MW 5 and MW 10 abandoned under Tag A074637 (MW #10)	
			Remove casing + screen; back fill borehole from 6.7 m below surface to surface with aqua guard cement as per ONT MOE Reg 903	
			Tag remains affixed to MW #9.	

Hole Details

Depth (Metres) From To	Diameter (Centimetres)
0 6.7	20/10

Water Use

☐ Public	☐ Industrial	☐ Not used	☐ Other, specify
☐ Domestic	☐ Commercial	☐ Dewatering	
☐ Livestock	☐ Municipal	☐ Monitoring	
☐ Irrigation	☐ Test Hole	☐ Cooling & Air Conditioning	

Method of Construction

☐ Cable Tool	☐ Air Percussion	☐ Digging
☐ Rotary (Conventional)	☐ Diamond	☐ Boring
☐ Rotary (Reverse)	☐ Jetting	☐ Other, specify
☐ Rotary (Air)	☐ Driving	

Status of Well

☐ Test Hole	☐ Abandoned, Insufficient Supply
☐ Replacement Well	☐ Abandoned, Poor Water Quality
☐ Dewatering Well	☐ Other, specify
☐ Alteration (Construction)	☒ Abandoned, other, specify M.W.

No Casing and Screen Used

Open Hole ☐ Yes ☒ No	Static Water Level Test Metres

Screen

☐ Galvanized	☐ Steel	☐ Fibreglass	☐ Concrete	☐ Plastic
Outside Diameter (Centimetres)	Slot No.			

Water Details

Water found at Depth Metres	Kind of Water ☐ Gas ☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals
Water found at Depth Metres	Kind of Water ☐ Gas ☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals
Water found at Depth Metres	Kind of Water ☐ Gas ☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals

Disinfected ☐ Yes ☒ No If no, provide reason:	Date Master Well Completed (yyyy/mm/dd) 2009/12/09

Cluster Information (Please also fill out the additional Cluster Well Information for Well Construction for each parcel of land and cluster.)	
Total Wells in Cluster 2	Please indicate Number of Cluster Well Information Log Sheets Submitted 1
Total Wells on this Property unknown	

Location of Well Cluster

Detailed Map must be provided as an attachment no larger than legal size (8.5" x 14"). Sketches are not allowed.
☒ Check box to confirm detailed map is provided as per Section 11.1 (3)

Consent to release additional information concerning the cluster to the Director

Annular Space/Abandonment Sealing Record


Depth Set at (Metres) From To	Type of Sealant Used (Material and Type)	Volume Used (Cubic Metres)
0 6.7	Bibblicate Aqua guard Cement	40 Keps

Well Contractor and Well Technician Information

Business Name of Well Contractor George Downing Estate Drilling Ltd	Well Contractor's Licence No. 1181414
Business Address (Street No./Name, number, RR) 410 Rue Principale Grenville Sur La Ronge	Municipality
Province QC	Postal Code J0V1B0
Business E-mail Address downing@hawk.iqs.net	
Bus. Telephone No. (inc. area code) 819 242 6469	Name of Well Technician (Last Name, First Name) Downing, Bruce
Well Technician's Licence No.	Signature of Technician Bruce Downing
Date Submitted (yyyy/mm/dd) 2009/12/01	

Ministry Use Only

Audit No. M 05531	Well Contractor No.
Date Received (yyyy/mm/dd) JAN 07 2010	Date of Inspection (yyyy/mm/dd)
Remarks	



Well Tag No. for Master Well (Print Well Tag No.)
2 m.w. abandonments under
Tag A074637 (5 remaining wells)

Regulation 903 Ontario Water Resources Act

Page 1 of 1

Property Owner's Information

First Name Shell Canada Products	Last Name	Mailing Address (Street No./Name, RR) 90 Sheppard Ave. East Suite 600	Municipality Toronto
Province ON	Postal Code M2N 6Y2	E-mail Address	Telephone No. (inc. area code) 416 227 7111

Cluster Well Information

Address of Well Location (Street Number/Name, RR) 154 O'Connor Street			Lot	Concession	Township	County/District/Municipality	
City/Town/Village Ottawa		Province Ontario	Postal Code		GPS Unit Make Garmin	Model Etrex	Unit Mode of Operation ☐ Undifferentiated ☒ Averaged

Signature of Technician/Contractor	Date (yyyy/mm/dd)

<i>Bruce Dunning</i>	2009/12/01
Comments	Date of Completion

[illegible]


Well Contractor and Well Technician Information

Business Name of Well Contractor George Downing Estate Drilling Ltd.			Business Address (Street Number/Name, RR) 410 Rue Principale Grenville Sur La Rouge			Municipality	Province QC.
Postal Code J0V 1B0		Business Telephone No. (inc. area code) 819 242 6469		Well Contractor's Licence No. 18 44		Business E-mail Address downing@hawk.igs.net	
Name of Well Technician (First Name, Last Name) Bruce Downing				Well Technician's Licence No. 21 73		Date Submitted (yyyy/mm/dd) 2009/12/01	
						Signature of Technician <i>Bruce Downing</i>	

Date 1st Well in Cluster Constructed (yyyy/mm/dd)	Date Last Well in Cluster Constructed (yyyy/mm/dd)
2009/11/09	2009/11/09

Ministry Use Only

Date Received (yyyy/mm/dd) JAN 07 2010	Date Inspected (yyyy/mm/dd)
Audit No. c 06149	Remarks mo5531

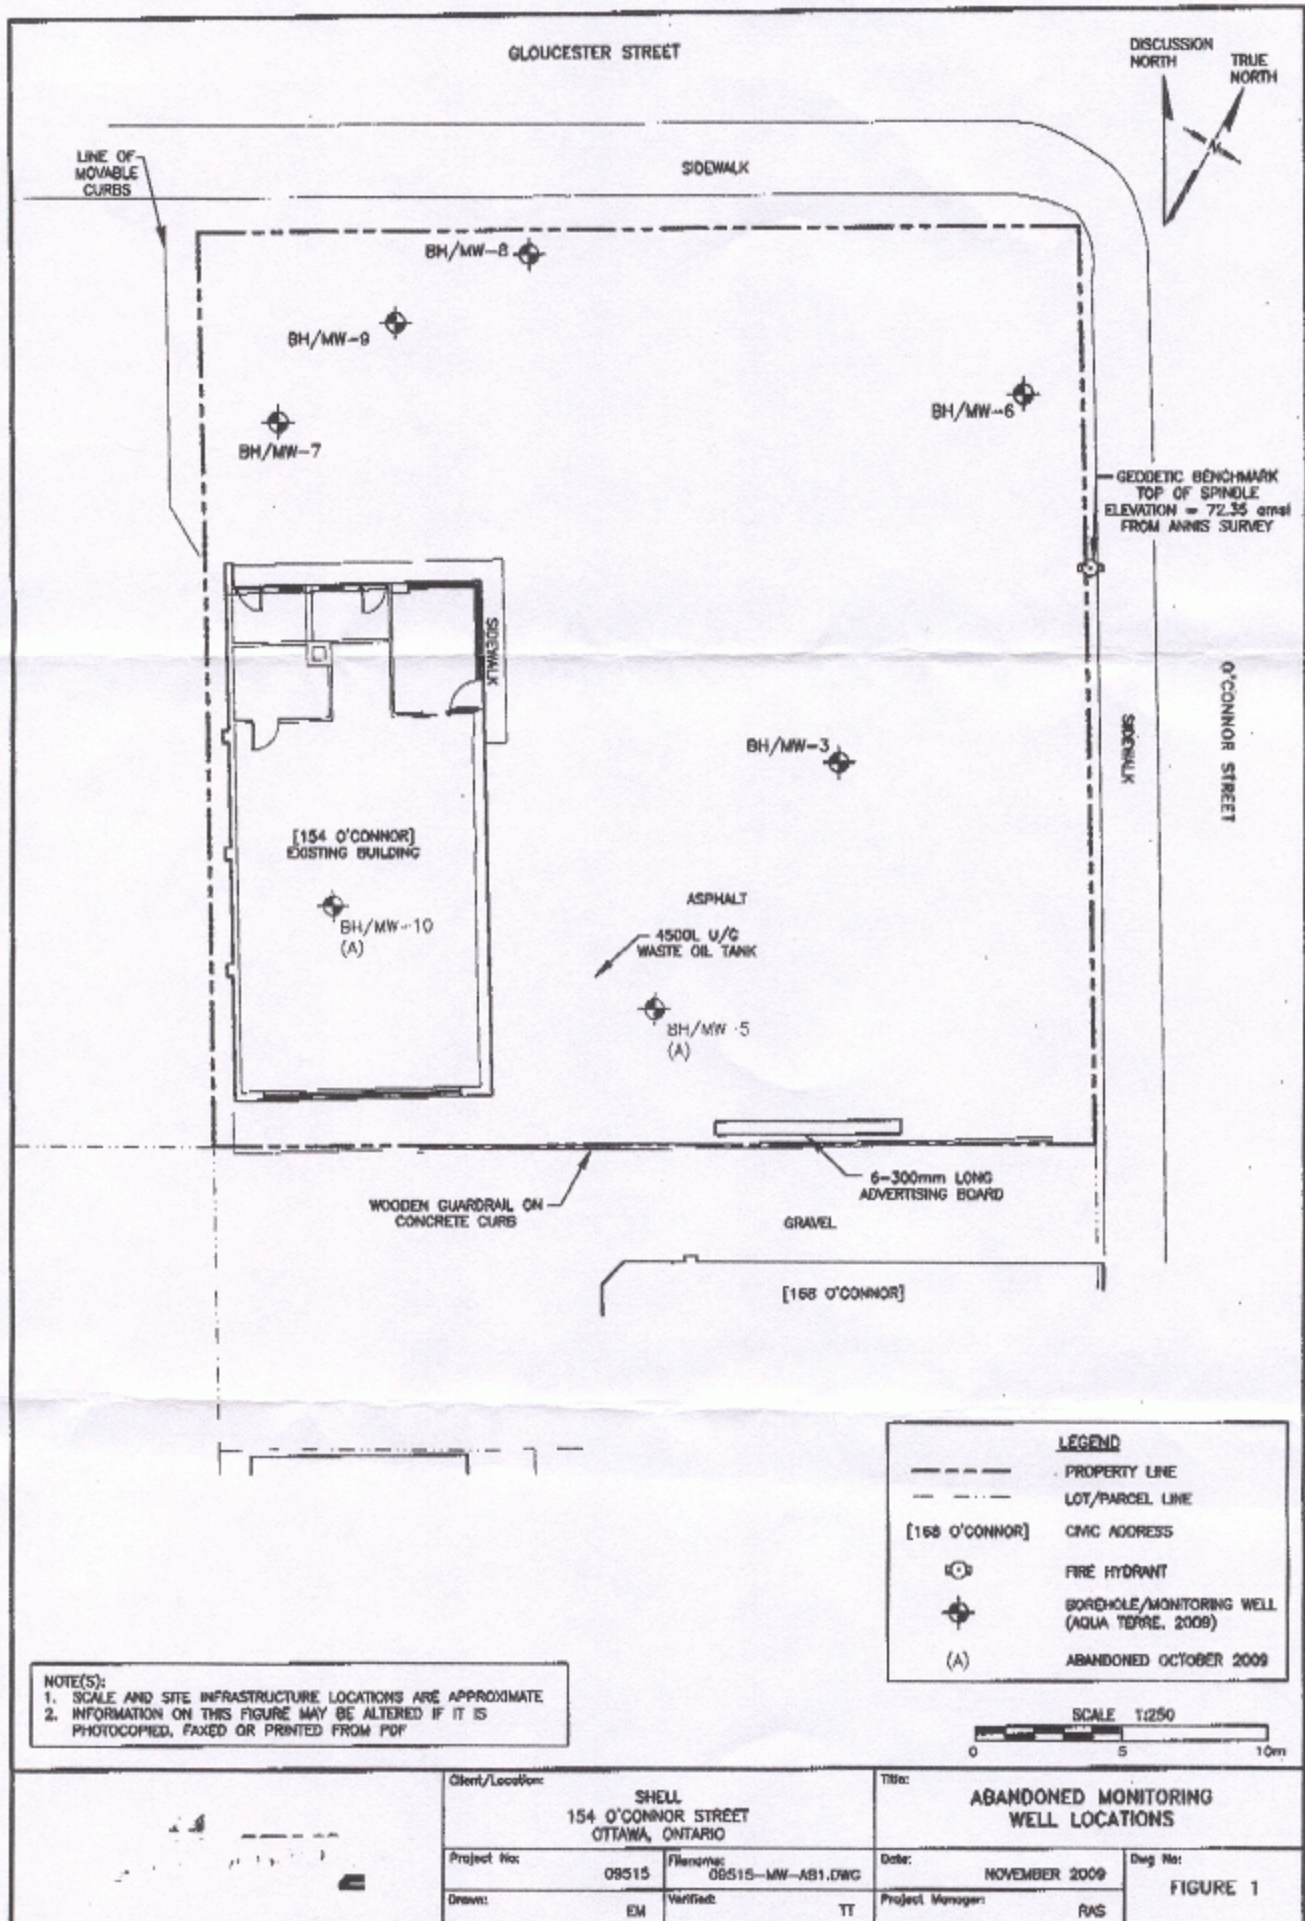

C-1844
MOSSBI
C06149

JAN 07 2010

A 083149

MW 09-23

Master Well Owner's and Land Owner's Information

First Name Shell Canada Products Ltd.	Last Name	E-mail Address
Mailing Address (Street Number/Name, RR) 90 Sheppard Ave. Suite 600	Municipality Toronto	Province ON
	Postal Code M2N 6Y2	Telephone No. (inc. area code) 416 438 3862

Location and Construction of the Master Well in the Cluster

Address of Well Location (Street Number/Name, RR) 154 O'Connor Street	Township	Lot 41 - Part of 2	Concession Lot D - Con C
County/District/Municipality	City/Town/Village Ottawa	Province Ontario	Postal Code K2P 1T5

UTM Coordinates NAD 83 18445498	Zone 18	Easting 5029689	Northings 5029689	GPS Unit Make Garmin	Model Etrex	Mode of Operation: ☐ Undifferentiated ☒ Averaged ☐ Differentiated, specify

Overburden and Bedrock Materials (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (Metres) From To
Dark Brown	Sand Fill		moist	0 0.6
" "	Sand + Gravel Fill		"	0.6 1.2
Brown/Grey	Silty Clay		"	1.2 3.0
Grey	Clay		wet	3.0 4.3
"	Clayey silt			4.3 5.5
"	Sandy clay			5.5 6.0
Brown/Grey	Shale		dry	6.0 11.3

Hole Details

Depth (Metres) From To	Diameter (Centimetres)
0 6.0	20
6.0 11.3	10

Water Use

☐ Public	☐ Industrial	☐ Not used	☐ Other, specify
☐ Domestic	☐ Commercial	☐ Dewatering	
☐ Livestock	☐ Municipal	☒ Monitoring	
☐ Irrigation	☐ Test Hole	☐ Cooling & Air Conditioning	

Method of Construction

☐ Cable Tool	☒ Air Percussion	☐ Digging
☐ Rotary (Conventional)	☐ Diamond	☐ Boring
☐ Rotary (Reverse)	☐ Jetting	☒ Other, specify
☐ Rotary (Air)	☐ Driving	HSA

Status of Well

☒ Test Hole	☐ Abandoned, Insufficient Supply
☐ Replacement Well	☐ Abandoned, Poor Water Quality
☐ Dewatering Well	☐ Other, specify
☐ Alteration (Construction)	☐ Abandoned, other, specify

No Casing and Screen Used

Open Hole ☐ Yes ☒ No	Static Water Level Test Metres

Screen

☐ Galvanized	☐ Steel	☐ Fibreglass	☐ Concrete	☒ Plastic
Outside Diameter (Centimetres) 5.8	Slot No. 10			

Water Details

Water found at Depth Metres ☐ Gas	Kind of Water ☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals
Water found at Depth Metres ☐ Gas	Kind of Water ☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals
Water found at Depth Metres ☐ Gas	Kind of Water ☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals

Disinfected ☐ Yes ☒ No If no, provide reason:	Date Master Well Completed (yyyy/mm/dd) 2009/12/17
Monitoring well	

Cluster Information (Please also fill out the additional Cluster Well Information for Well Construction for each parcel of land and cluster.)

Total Wells in Cluster 6	Please indicate Number of Cluster Well Information Log Sheets Submitted 1
Total Wells on this Property unknown	

Location of Well Cluster

Detailed Map must be provided as an attachment no larger than legal size (8.5" x 14"). Sketches are not allowed.
☒ Check box to confirm detailed map is provided as per Section 11.1 (3)

Consent to release additional information concerning the cluster to the Director upon request
Construction Details

Inside Diameter (Centimetres)	Material (steel, plastic, fibreglass, concrete, galvanized)	Wall Thickness	Depth (Metres) From To
5.8	Aluminium fleshment	Sched 40	0 8.3
	PVC Riser		


Annular Space/Abandonment Sealing Record

Depth Set at (Metres) From To	Type of Sealant Used (Material and Type)	Volume Used (Cubic Metres)
0.5 7.0	Bentonite	120kgs

Well Contractor and Well Technician Information

Business Name of Well Contractor George Downing Estate Drilling Ltd	Well Contractor's Licence No. 18 4 4
Business Address (Street No./Name, number, RR) 410 rue Principale	Municipality Grenville Sur La Ronge
Province QC	Postal Code J0V 1B0
Business E-mail Address downing@hawk.iqs.net	
Bus. Telephone No. (inc. area code) 819 242 6469	Name of Well Technician (Last Name, First Name) Downing, Bruce
Well Technician's Licence No. 2173	Signature of Technician Bruce Downing
	Date Submitted (yyyy/mm/dd) 2010/01/19

Audit No. M 05547	Well Contractor No.
Date Received (yyyy/mm/dd) FEB 02 2010	Date of Inspection (yyyy/mm/dd)
Remarks	



A 083149

A083149

Regulation 903 Ontario Water Resources Act

Page 1 of 1

First Name Shell Canada Products Ltd.		Last Name		Mailing Address (Street No./Name, RR) 90 Sheppard Avenue Suite 600		Municipality Toronto	
Province ONTARIO		Postal Code		E-mail Address		Telephone No. (inc. area code) 416 438 3862	

Address of Well Location (Street Number/Name, RR) 154 O'Connor Street		Lot 41 + Part 2	Concession	Township	County/District/Municipality	
City/Town/Village Ottawa	Province Ontario	Postal Code K2P1T5	GPS Unit Make Garmin	Model Etrex	Unit Mode of Operation ☐ Undifferentiated ☒ Averaged	☐ Differentiated, specify:

upon request

Signature of Technician/Contractor	Date (yyyy/mm/dd)

Beno Dur


2010/01/19

[illegible]

Business Name of Well Contractor George Downing Estate Drilling Ltd.			Business Address (Street Number/Name, RR) 410 Rue Principale			Municipality Granville Sur la Ronge		Province QC.	
Postal Code J0V1B0		Business Telephone No. (inc. area code) 8192426469		Well Contractor's Licence No. 1844		Business E-mail Address downing@hawk.igs.net			
Name of Well Technician (First Name, Last Name) Bruce Downing				Well Technician's Licence No. 2173		Date Submitted (yyyy/mm/dd) 2010/12/19		Signature of Technician 	


Date 1st Well in Cluster Constructed (yyyy/mm/dd) 2009/12/16	Date Last Well in Cluster Constructed (yyyy/mm/dd) 2009/12/21

Date Received (yyyy/mm/dd) FEB 02 2010	Date Inspected (yyyy/mm/dd)
Audit No. c 06171	Remarks mossy

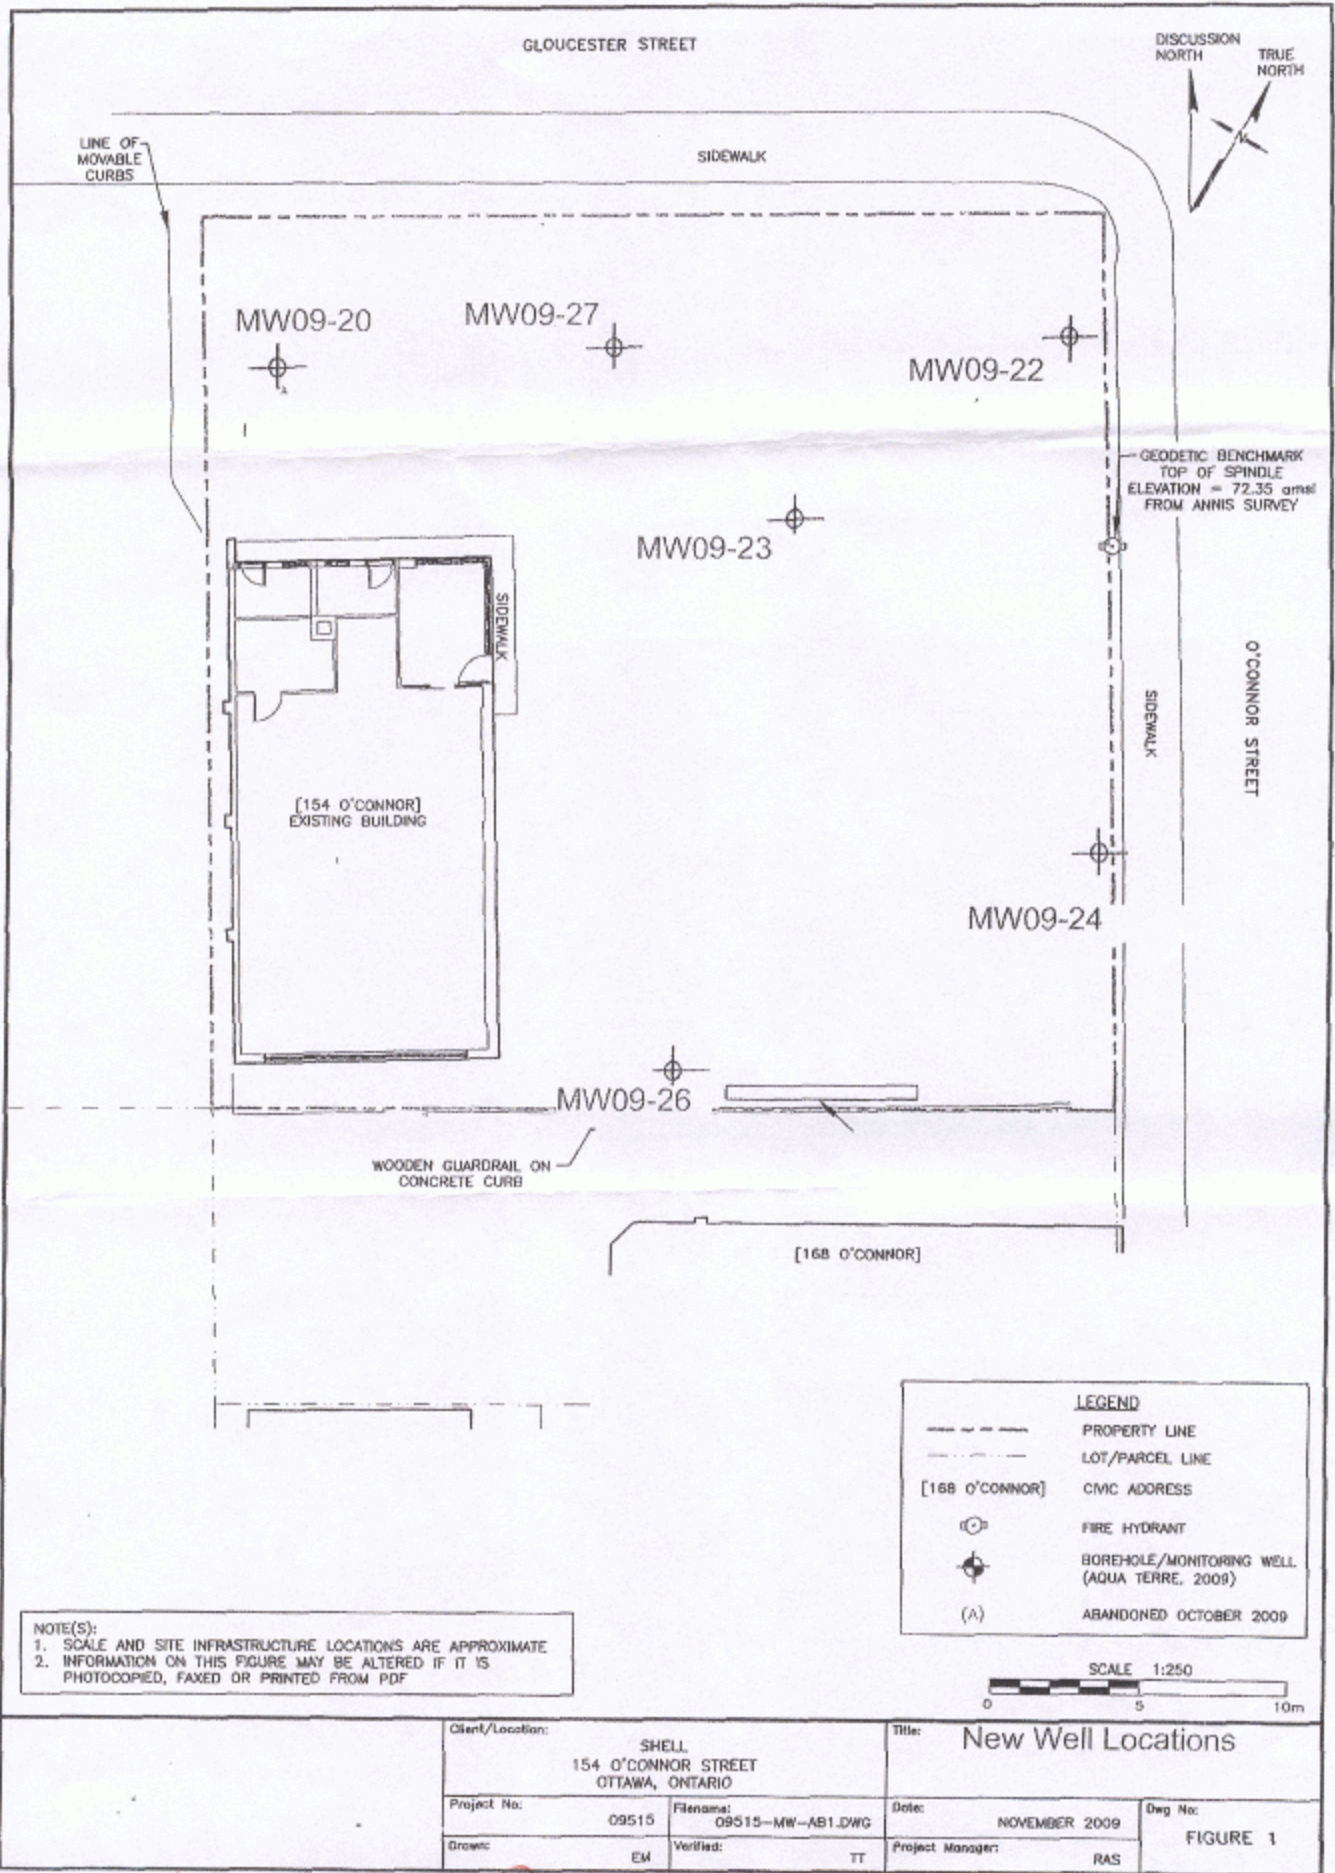

C-1844 mossy7 C06171

FEB 02 2010



A152335

Regulation 903 Ontario Water Resources Act

Page 7 of 7

Measurements recorded in: ☐ Metric ☐ Imperial

First Name	Last Name / Organization City of Ottawa	E-mail Address	☐ Well Constructed by Well Owner

Mailing Address (Street Number/Name)	Municipality	Province	Postal Code	Telephone No. (inc. area code)
110 Lawler Ave. West	Ottawa	ON	K1P 1S1	613 580 2424

Address of Well Location (Street Number/Name)	Township	Lot	Concession

County/District/Municipality	City/Town/Village	Province	Postal Code

UTM Coordinates	Zone	Easting	Northing	Municipal Plan and Sublot Number	Other
NAD 83	18	445315	5029218		

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)[illegible]

Depth Set at (m/ft)		Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
From	To		

After test of well yield, water was:	Draw Down		Recovery	
☐ Clear and sand free	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
☐ Other, <i>specify</i> _____				
If pumping discontinued, give reason:	Static Level			
	1		1	
Pump intake set at (m/ft)	2		2	
	3		3	
Pumping rate (l/min / GPM)	4		4	
	5		5	
Duration of pumping _____ hrs + _____ min	10		10	
Final water level end of pumping (m/ft)	15		15	
	20		20	
If flowing give rate (l/min / GPM)	25		25	
	30		30	
Recommended pump depth (m/ft)	40		40	
	50		50	
Recommended pump rate (l/min / GPM)	60		60	
Well production (l/min / GPM)				
Disinfected?				
☐ Yes ☐ No				

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		☐ Water Supply ☐ Replacement Well ☐ Test Hole ☐ Recharge Well ☐ Dewatering Well ☐ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned,
			From	To	

☐ Water Supply
☐ Replacement Well
☐ Test Hole
☐ Recharge Well
☐ Dewatering Well
☐ Observation and/or Monitoring Hole
☐ Alteration (Construction)
☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality
☒ Abandoned, other, *specify*
Remove
☐ Other, *specify*

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)		☐ Abandoned, poor Water Quality ☒ Abandoned, other, specify Removed ☐ Other, specify
			From	To	

Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____	Depth (m/ft) From	To	Diameter (cm/in)
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____			
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____			

Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____	Depth (m/ft) From	To	Diameter (cm/in)
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____			
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____			

Business Name of Well Contractor <i>Marathon Drilling Co Ltd</i>		Well Contractor's Licence No. <i>6894</i>	
Business Address (Street Number/Name) <i>66847 Hiram Dr.</i>		Municipality <i>OTT</i>	
Province <i>ON</i>	Postal Code <i>K1H 8S9</i>	Business E-mail Address <i>marathon@marathondrilling.com</i>	

us. Telephone No. (inc. area code)	Name of Well Technician (Last Name, First Name)
6138220571	Wright Terry

Well Technician's Licence No.	Signature of Technician and/or Contractor	Date Submitted
0715	TS	20130913

Please provide a map below following instructions on the back.

Comments:

Well owner's information package delivered	Date Package Delivered	Ministry Use Only Audit No. Z 096858 NOV 14 2013
	Y Y Y Y M M D D Date Work Completed Y Y Y Y M M D D	
☐ Yes ☐ No		Received By _____ Date _____

Measurements recorded in: ☒ Metric ☐ Imperial

Well Owner's Information

First Name	Last Name / Organization	E-mail Address		☐ Well Constructed by Well Owner	
	District Realty Corporation				
Mailing Address (Street Number/Name)	Municipality	Province	Postal Code	Telephone No. (inc. area code)	
50 Bauswater Avenue	Ottawa	ON	K1H 2E9		

Well Location

Address of Well Location (Street Number/Name) 384 McLaurin Rd.			Township			Lot			Concession				
County/District/Municipality			City/Town/Village Oxawa						Province Ontario		Postal Code 		
UTM Coordinates		Zone		Easting		Northing		Municipal Plan and Sublot Number				Other	
NAD 83		18		445546		5029331							

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)	
				From	To
GRY	concrete	gravel	hard	0	.31
BRN	sand	gravel	loose	.31	2.13
GRY	clay	silt	soft	2.13	6.1

Annular Space

Depth Set at (m/ft)		Type of Sealant Used (Material and Type)	Volume Placed (m ³ /ft ³)
From	To		
0	31	concrete / flush mount	
31	274	benfonite	
274	61	litter sand	

Method of Construction

☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial	☐ Not used
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal	☐ Dewatering
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☒ Test Hole	☒ Monitoring
☐ Boring	☐ Digging	☐ Irrigation	☐ Cooling & Air Conditioning	
☐ Air percussion		☐ Industrial		
☒ Other, specify <i>Direct Push</i>		☐ Other, specify		

Well Use

☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial	☐ Not used
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal	☐ Dewatering
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☒ Test Hole	☒ Monitoring
☐ Boring	☐ Digging	☐ Irrigation	☐ Cooling & Air Conditioning	
☐ Air percussion		☐ Industrial		
☒ Other, specify <i>Direct Push</i>		☐ Other, specify		

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☒ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned,
			From	To	
3.45	PVC	.356	0	3.1	

Status of Well

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☒ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned,
			From	To	
3.45	PVC	.356	0	3.1	

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)		☐ Abandoned, Poor Water Quality ☐ Abandoned, other, specify _____ ☐ Other, specify _____
			From	To	
4.21	PVC	10	3.1	6.1	


Water Details

Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____

Hole Diameter

Water found at Depth (m/ft) ☐ Gas ☐ Other, specify _____	Kind of Water: ☐ Fresh ☐ Untested	Depth (m/ft) From	To	Diameter (cm/in)
Water found at Depth (m/ft) ☐ Gas ☐ Other, specify _____	Kind of Water: ☐ Fresh ☐ Untested	0	6.1	5.71
Water found at Depth (m/ft) ☐ Gas ☐ Other, specify _____	Kind of Water: ☐ Fresh ☐ Untested			

Well Contractor and Well Technician Information


Business Name of Well Contractor <i>Sprata Drilling Group</i>		Well Contractor's Licence No. <i>7241</i>
Business Address (Street Number/Name) <i>147 West Beaver Creek</i>		Municipality <i>Richmond Hill</i>
Province <i>ON</i>	Postal Code <i>L4B1G6</i>	Business E-mail Address <i>6wrecords@stratasoil.com</i>
Bus. Telephone No. (inc. area code) <i>905-764-9304</i>	Name of Well Technician (Last Name, First Name) <i>M. Cuy, James</i>	
Well Technician's Licence No. <i>3656</i>	Signature of Technician and/or Contractor 	Date Submitted <i>2013/01/15</i>

Results of Well Yield Testing

After test of well yield, water was: ☐ Clear and sand free ☐ Other, <i>specify</i> _____	Draw Down		Recovery	
	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:	Static Level			
	1		1	
Pump intake set at (m/ft)	2		2	
Pumping rate (l/min / GPM)	3		3	
	4		4	
Duration of pumping _____ hrs + _____ min	5		5	
Final water level end of pumping (m/ft)	10		10	
If flowing give rate (l/min / GPM)	15		15	
Recommended pump depth (m/ft)	20		20	
	25		25	
Recommended pump rate (l/min / GPM)	30		30	
Well production (l/min / GPM)	40		40	
	50		50	
Disinfected? ☐ Yes ☐ No	60		60	


Map of Well Location

Please provide a map below following instructions on the back.

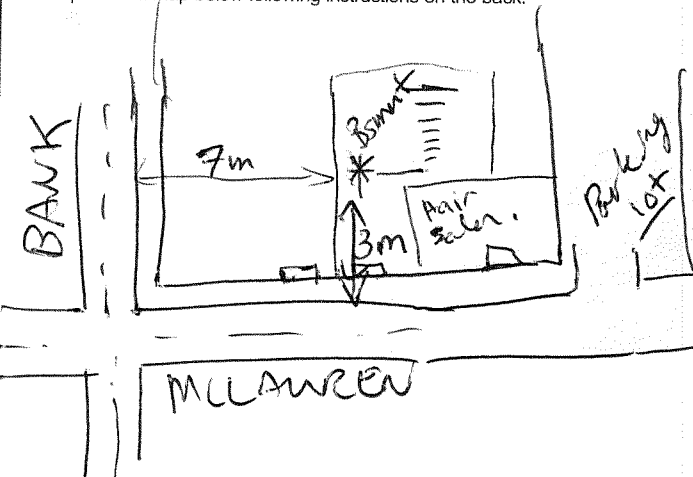

Comments:

Well owner's information package delivered	Date Package Delivered	Ministry Use Only Audit No. Z 177968 NOV 28 2013 Received
	Y Y Y Y M M D D Date Work Completed 20131201	
☐ Yes ☐ No		



Tag #: A173760

Regulation 903 Ontario Water Resources Act

Measurements recorded in: ☒ Metric ☐ Imperial

A173760

Page of

Well Owner's Information

First Name	Last Name / Organization	E-mail Address			☐ Well Constructed by Well Owner
	1618721 Ontario Inc. The Hair Loft / The spa				
Mailing Address (Street Number/Name)	Municipality	Province	Postal Code	Telephone No. (inc. area code)	
429 MacLaren street	Ottawa	ON	K2P 0H7	(613) 232-0202	

Well Location

Address of Well Location (Street Number/Name) <i>429 McKeown</i>				Township		Lot		Concession		
County/District/Municipality				City/Town/Village <i>Ottawa</i>				Province Ontario		
UTM Coordinates		Zone	Easting	Northing	Municipal Plan and Sublot Number				Postal Code 	
NAD 83		18	445399	5029205					Other	

Overburden and Bedrock Materials/Abandonment Sealing Record *(see instructions on the back of this form)*

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)	
				From	To
BIZN	Fill	Gravel/Sand	Soft	0	1.22
BW	Silty Sand	Trace Clay	Soft	1.22	3.1
BRN	Silty Clay		Soft	3.1	4.88
GRY	Clay	Silt	Soft	4.88	6.1

Annular Space

Depth Set at (m/ft)		Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
From	To		
0	.31	Concrete / Flushmount	
.31	2.74	Bentonite	
2.74	6.1	Sand	

Method of Construction

- ☐ Cable Tool ☐ Diamond
☒ Rotary (Conventional) ☐ Jetting
☐ Rotary (Reverse) ☐ Driving
☐ Boring ☐ Digging
☐ Air percussion
☐ Other, *specify*

Well Use

- ☐ Public ☐ Commercial ☐ Not used
☐ Domestic ☐ Municipal ☐ Dewatering
☐ Livestock ☒ Test Hole ☒ Monitoring
☐ Irrigation ☐ Cooling & Air Conditioning
☐ Industrial
☐ Other, *specify* _____

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☒ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, (Inactive)
			From	To	
5.20	PVC	.390	0	3.1	

Status of Well

- ☐ Water Supply
☐ Replacement Well
☒ Test Hole
☐ Recharge Well
☐ Dewatering Well
☒ Observation and/or Monitoring Hole
☐ Alteration (Construction)
☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality
☐ Abandoned, other, *specify*

☐ Other, *specify*

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)	
			From	To
6.03	PVC	10	3.1	6.1

Water Details

Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____

Hole Diameter

Depth (m/ft)		Diameter (cm/in)
From	To	
0	6.1	15.32

Well Contractor and Well Technician Information


Business Name of Well Contractor		Well Contractor's Licence No.	
Strata Drilling Group		7 2 4 1	
Business Address (Street Number/Name)		Municipality	
165 Shields Court		Markham	
Province	Postal Code	Business E-mail Address	
ON	L3R8V0	Wrecords@Strata501.com	
Bus. Telephone No. (inc. area code)		Name of Well Technician (Last Name, First Name)	
905 764 9304		Halladay Phil	
Well Technician's Licence No.	Signature of Technician and/or Contractor		Date Submitted
3 8 3 2	[Signature]		20141106

Results of Well Yield Testing

After test of well yield, water was: ☐ Clear and sand free ☐ Other, <i>specify</i> _____	Draw Down		Recovery	
	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:	Static Level			
	1		1	
Pump intake set at (m/ft)	2		2	
	3		3	
Pumping rate (l/min / GPM)	4		4	
	5		5	
Duration of pumping _____ hrs + _____ min	10		10	
	15		15	
Final water level end of pumping (m/ft)	20		20	
	25		25	
If flowing give rate (l/min / GPM)	30		30	
	40		40	
Recommended pump depth (m/ft)	50		50	
	60		60	
Recommended pump rate (l/min / GPM)				
Well production (l/min / GPM)				
Disinfected? ☐ Yes ☐ No				

Map of Well Location

Please provide a map below following instructions on the back.

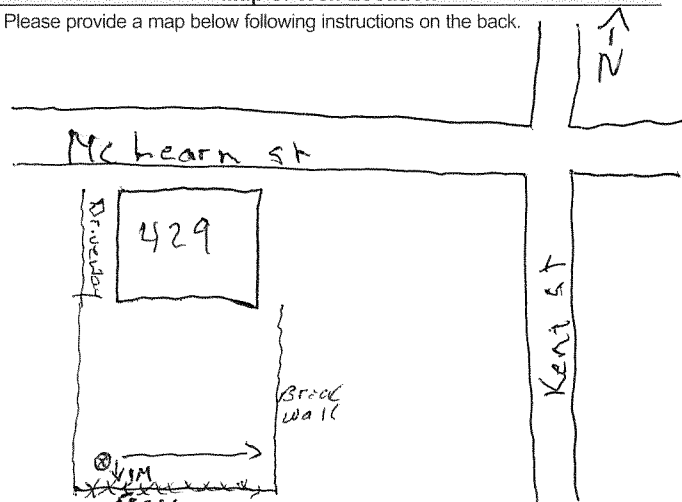

Comments:

Well owner's information package delivered	Date Package Delivered	Ministry Use Only Audit No. Z 198211 DEC 15 2014 Recovered
	Date Work Completed	

Measurements recorded in: ☒ Metric ☐ Imperial

A173761

S-16268 Page _____ of _____

Well Owner's Information

First Name	Last Name / Organization	E-mail Address		☐ Well Constructed by Well Owner
	1618721 Ontario Inc. The Hair Loft / The Spa			
Mailing Address (Street Number/Name)	Municipality	Province	Postal Code	Telephone No. (inc. area code)
429 MacLaren Street	Ottawa	ON	K2P0H7	

Well Location

Address of Well Location (Street Number/Name) 429 McLearn				Township		Lot		Concession	
County/District/Municipality				City/Town/Village Ottawa				Province Ontario	
UTM Coordinates				Zone		Easting		Northing	
NAD 83				18		495405		5029222	
				Municipal Plan and Sublot Number				Other	

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)	
				From	To
BRN	Fill	Gravel / Sand	Soft	0	1.22
BRN	Silty Sand	Trace Clay	Soft	1.22	3.1
BRN	Silty Clay		Soft	3.1	4.88
GRY	Clay	Silt	Soft	4.88	6.1

Annular Space

Depth Set at (m/ft)		Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
From	To		
0	.31	Concrete / Flushmount	
.31	2.74	Bentonite	
2.74	6.1	Sand	

Method of Construction

☐ Cable Tool ☐ Diamond
☒ Rotary (Conventional) ☐ Jetting
☐ Rotary (Reverse) ☐ Driving
☐ Boring ☐ Digging
☐ Air percussion
☐ Other, *specify* _____

Well Use

☐ Public ☐ Commercial ☐ Not used
☐ Domestic ☐ Municipal ☐ Dewatering
☐ Livestock ☒ Test Hole ☒ Monitoring
☐ Irrigation ☐ Cooling & Air Conditioning
☐ Industrial
☐ Other, *specify* _____

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☒ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, Insufficient Supply
			From	To	
5.20	PVC	390	0	3.1	

Status of Well

☐ Water Supply
☐ Replacement Well
☒ Test Hole
☐ Recharge Well
☐ Dewatering Well
☒ Observation and/or Monitoring Hole
☐ Alteration (Construction)
☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality
☐ Abandoned, other, *specify*

☐ Other, *specify*

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)	
			From	To
6.03	PVC	10	3.1	6.1

☐ Water Quality
☐ Abandoned, other, specify _____
☐ Other, specify _____

Water Details

Water found at Depth _____ (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____
Water found at Depth _____ (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____
Water found at Depth _____ (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____

Hole Diameter

Depth (m/ft)		Diameter (cm/in)
From	To	
0	0.1	15.32

Well Contractor and Well Technician Information


Business Name of Well Contractor <i>Strata Drilling Group</i>		Well Contractor's Licence No. <i>7 2 4 1</i>	
Business Address (Street Number/Name) <i>165 Shields Court</i>		Municipality <i>Markham</i>	
Province <i>ON</i>	Postal Code <i>L3R 8V2</i>	Business E-mail Address <i>Wrecords@Strata-drill.com</i>	
Bus. Telephone No. (inc. area code) <i>905 764 9304</i>	Name of Well Technician (Last Name, First Name) <i>Halladay Phil</i>		
Well Technician's Licence No. <i>3 8 7 2</i>	Signature of Technician and/or Contractor <i>Phil Halladay</i>		Date Submitted <i>20141106</i>

Results of Well Yield Testing

After test of well yield, water was:	Draw Down		Recovery	
☐ Clear and sand free	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
☐ Other, <i>specify</i> _____				
If pumping discontinued, give reason:	Static Level			
	1		1	
Pump intake set at (m/ft)	2		2	
Pumping rate (l/min / GPM)	3		3	
	4		4	
Duration of pumping _____ hrs + _____ min	5		5	
Final water level end of pumping (m/ft)	10		10	
If flowing give rate (l/min / GPM)	15		15	
	20		20	
Recommended pump depth (m/ft)	25		25	
Recommended pump rate (l/min / GPM)	30		30	
	40		40	
Well production (l/min / GPM)	50		50	
Disinfected?				
☐ Yes ☐ No	60		60	

Map of Well Location

Please provide a map below following instructions on the back.

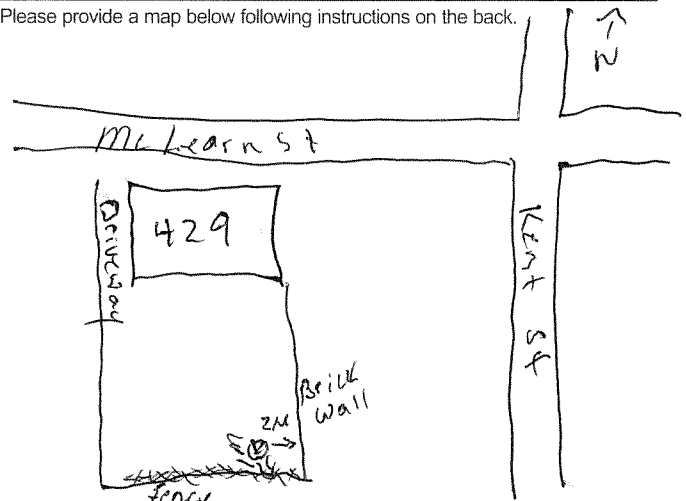

Comments:

Well owner's information package delivered

☐ Yes

☐ No

Date Package Delivered

Date Work Completed

2014, 106

Ministry Use Only

Audit No. Z 198210
DEC 15 2014
Received



Well Tag #: A165621 (low)
A165621

Well Record
Regulation 903 Ontario Water Resources Act
S-17328 Page of

Measurements recorded in: ☐ Metric ☒ Imperial

LOBLAW REAL ESTATE

Address of Well Location (Street Number/Name) 296 Bank St ~~Atara~~ Township Lot Concession
County/District/Municipality City/Town/Village/Atara Province Ontario Postal Code
UTM Coordinates Zone Easting Northing Municipal Plan and Sublot Number Other
NAD 83 18 75 69 63 459 1509

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)					
General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)	
GRY	Concrete			From 0	To 1
GRY	Clay	silt		1	10
~~FILE~~	T. II			10	20

Annular Space		
Depth Set at (m/ft)	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
From 0 To 1	concrete flushmount	
1 9	ben seal	
9 20	filter sand	

Method of Construction	Well Use
☐ Cable Tool ☐ Diamond ☐ Public ☐ Commercial ☐ Not used	
☐ Rotary (Conventional) ☐ Jetting ☐ Domestic ☐ Municipal ☐ Dewatering	
☐ Rotary (Reverse) ☐ Driving ☐ Livestock ☒ Test Hole ☒ Monitoring	
☐ Boring ☐ Digging ☐ Irrigation ☐ Cooling & Air Conditioning	
☐ Air percussion ☐ Industrial	
☒ Other, specify direct push	☐ Other, specify

Construction Record - Casing				Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		
			From To		
1.38	PVC	.14	0 10	☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☒ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, Insufficient Supply ☐ Abandoned, Poor Water Quality ☐ Abandoned, other, specify ☐ Other, specify	

Construction Record - Screen				Status of Well	
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)		
			From To		
1.66	PVC	10	10 20		

Water Details		Hole Diameter	
Water found at Depth (m/ft) ☐ Gas ☐ Other, specify	Kind of Water: ☐ Fresh ☐ Untested	Depth (m/ft) From To	Diameter (cm/in)
Water found at Depth (m/ft) ☐ Gas ☐ Other, specify	Kind of Water: ☐ Fresh ☐ Untested	0 20	2.375
Water found at Depth (m/ft) ☐ Gas ☐ Other, specify	Kind of Water: ☐ Fresh ☐ Untested		

Well Contractor and Well Technician Information
Business Name of Well Contractor Strata Drilling Group Well Contractor's Licence No. 7241
Business Address (Street Number/Name) 41 records@strata.com Municipality Markham
Province Postal Code Business E-mail Address ON C3R8V2 165 Shields Court Markham
Bus. Telephone No. (inc. area code) 905 440 7919 Name of Well Technician (Last Name, First Name) Beatty Brian
Well Technician's Licence No. 3616 Signature of Technician and/or Contractor Date Submitted 20150717

Results of Well Yield Testing			
After test of well yield, water was: ☐ Clear and sand free ☐ Other, specify		Draw Down	
If pumping discontinued, give reason:		Time (min)	Water Level (m/ft)
Pump intake set at (m/ft)		Static Level	Recovery
Pumping rate (l/min / GPM)		Time (min)	Water Level (m/ft)
Duration of pumping hrs + min		1	1
Final water level end of pumping (m/ft)		2	2
If flowing give rate (l/min / GPM)		3	3
Recommended pump depth (m/ft)		4	4
Recommended pump rate (l/min / GPM)		5	5
Well production (l/min / GPM)		10	10
Disinfected? ☐ Yes ☐ No		15	15
		20	20
		25	25
		30	30
		40	40
		50	50
		60	60

Map of Well Location
Please provide a map below following instructions on the back.
Somerset
Bank St
Parking
296
25'
15'

Comments:

Well owner's information package delivered ☐ Yes ☐ No	Date Package Delivered YYY YMM DDD 20150717	Ministry Use Only Audit No. Z 208884 AUG 24 2015

LOBLAW REAL ESTATE

Address of Well Location (Street Number/Name)
296 Bank St

Township

Lot

Concession

County/District/Municipality

City/Town/Village
Ottawa

Province
Ontario

Postal Code

UTM Coordinates
NAD 83 18 756983 9541509

Zone
18

Easting
756983

Northing
9541509

Municipal Plan and Sublot Number

Other

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	To
GRY	Concrete		hard	0	1
GRY	Clay	5.14	soft, wet	1	10

Annular Space

Depth Set at (m/ft) From	To	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
0	1	concrete / flushmount	
1	2.5	benseal	
2.5	10	filter sand	

Method of Construction

Well Use

Construction Record - Casing

Construction Record - Screen

Status of Well

Water Details

Hole Diameter

Well Contractor and Well Technician Information

Map of Well Location

Comments: Exp General Contractors

Well owner's information package delivered

Date Package Delivered

Date Work Completed

Ministry Use Only

Audit No. 2208885

AUG 24 2015

0506E (2014/11)

Ministry's Copy

© Queen's Printer for Ontario, 2014



Well Record for Well Cluster - Part 1 of 3
(Only for Multiple Test Holes or Dewatering Wells)
Regulation 903 Ontario Water Resources Act

All measurements recorded in: ☒ Metric ☐ Imperial



Follow instructions on the front and back of this form. Print or Type

Well Tag No. of Deepest Well: (Print Well Tag No.)

A 203689

Well # on Drawing of Deepest Well: BH2

Page 1 of 1

Well Cluster Location Information														Mandatory Attachments/Additional Information					
Address of Well Location (Street Number(s)/Name(s), RR, if available)								Lot(s)		Concession(s)		Geographic Township		County/District/Upper Tier Municipality		☒ Land Owner Consent Form must be attached. ☒ Detailed Drawing of All Well Locations must be attached. I, the person constructing the well, will promptly submit to the Director, on request, any additional information in my custody or control related to any well in the well cluster that I have constructed. Signature of Technician/Contractor:  Date (yyyy/mm/dd): 2017/09/18			
City, Town, Village or Hamlet								Province		GPS Unit Make		Model		Unit Mode of Operation ☐ Undifferentiated ☐ Averaged ☐ Differentiated, specify: _____					
OTTAWA								Ontario		GARMIN		ETREX							
Well Details																			
Well # on Drawing	UTM Coordinates		Hole Depth (m/ft)	Hole Diameter (cm/in)	Method of Construction	Casing Material; Diameter (cm/in)	Casing (m/ft)		Screen Interval (m/ft)		Annular Space Material (m/ft)		Overburden/Bedrock or Abandonment Filling Material Intervals (m/ft)	Static Water Level (m/ft)	Date of Completion (yyyy/mm/dd)				
	Zone	Easting					North	From	To	From	To	From				To	Material:		
BH1	18	445448	5029568	9.1 19.2	20.3 7.62	HSA DIAMOND NO/W	3.18	0.1	16.15	16.15	19.2	0.31	15.85	BENTONITE BACKFILL, CLAY, TILL, SHALE BEDROCK	10.21	2017/08/21			
BH1A	18	445440	5029546	12.19 7.6	20.3 7.62	HSA DIAMOND NO/W	3.18	0.1	9.1	9.1	12.19	0.31	8.8	BENTONITE BACKFILL, CLAY, TILL, SHALE BEDROCK	10.29	2017/08/23			
BH2	18	445485	5029547	19.25 7.6	20.3 7.62	HSA DIAMOND NO/W	3.18	0.1	16.2	16.2	19.25	0.31	15.85	BENTONITE BACKFILL, CLAY, TILL, SHALE BEDROCK	11.6	2017/08/24			
BH3	18	445458	5029576	13.16 7.3	20.3 7.62	HSA DIAMOND NO/W	3.18	0.1	10.17	10.17	13.16	0.31	9.75	BENTONITE BACKFILL, CLAY, TILL, SHALE BEDROCK	13.16	2017/08/22			
BH5	18	445493	5029527	12.12 9.1	20.3 7.62	HSA DIAMOND NO/W	3.18	0.1	9.15	9.15	12.12	0.31	8.83	BENTONITE BACKFILL, CLAY, TILL, SHALE BEDROCK	11.31	2017/08/23			
Well Contractor and Well Technician Information														Date First Well in Cluster Constructed or Abandoned (yyyy/mm/dd)		Date Last Well in Cluster Completed (yyyy/mm/dd)		Ministry Use Only	
Business Name of Well Contractor				Business Address (Street Number/Name, RR)				Municipality				Province		Date Received (yyyy/mm/dd)		Audit No.			
EASTERN ONTARIO DIAMOND DRILLING				3780 COUNTY ROAD 17, P.O. Box 33				HAWKESBURY				ON		OCT 06 2017		C 30157			
Postal Code		Bus. Telephone No.		Well Contractor's Licence No.				Business E-mail Address				Well Abandonment		Comments:					
K6A2R12		(613) 632-7769		7328				edd@gracedowningdrilling.com				Person Abandoning the Wells:							
Name of Well Technician (First Name, Last Name)				Well Technician's Licence No.				Signature of Well Technician				Date Submitted (yyyy/mm/dd)		Name					
STEPHEN DOWNING				3326								2017/09/18		n/a (Print or Type) - See instruction 11 on the back of this form					

Note: This Well Record for Well Cluster Part 3 - Detailed Drawing of all Well Locations, must be attached to Parts 1 and 2. The drawing must include all property boundaries, an arrow indicating the North direction, all named roads and sufficient measurements to locate all wells in the cluster in relation to fixed points. The drawing must show the location of each well and each well must be numbered on the drawing to match number used for that well on the Well Record for Well Cluster Parts 1 and 2. The well with the well tag must be clearly identified on the Drawing.

UTM coordinates should appear beside each well, if space permits. Additional comments on wells can be included on the drawing

Well Tag Number: # A203689

"Well Record for Well Cluster" Form Audit Number: # C30157





W Tag#: A182713 Below

A182713

Measurements recorded in: ☒ Metric ☐ Imperial

CARLETON UNIVERSITY

Address of Well Location (Street Number/Name)

355 Cooper St

Township

Lot

Concession

County/District/Municipality

City/Town/Village

Province

Postal Code

UTM Coordinates

Zone

Easting

Northing

Municipal Plan and Sublot Number

Other

NAD

83

18

445537

5029504

Ottawa

Ontario

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)					
General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)	
From	To			From	To
B2N	Gravel	Sand	Loose	0	0.1
B2N	Fill		Packed	0.1	3.1
B2N	Clay	Silt	Soft	3.1	4.57
AP4	Clay		Soft	4.57	7.62

Annular Space				Results of Well Yield Testing			
Depth Set at (m/ft)		Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)	Draw Down		Recovery	
From	To			Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
0	3.1	Concrete (Flushmount)					
3.1	3.96	Bentonite					
3.96	7.62	Sand					

Method of Construction

☐ Cable Tool ☐ Diamond ☐ Rotary (Conventional) ☐ Jetting ☐ Rotary (Reverse) ☐ Driving ☐ Boring ☐ Digging ☐ Air percussion ☒ Other, specify direct push

Well Use

☐ Public ☐ Commercial ☐ Not used ☐ Domestic ☐ Municipal ☐ Dewatering ☐ Livestock ☒ Test Hole ☒ Monitoring ☐ Irrigation ☐ Cooling & Air Conditioning ☐ Industrial ☐ Other, specify

Construction Record - Casing					Status of Well
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		
			From	To	
4.03	PVC	368	0	4.57	☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☒ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, Insufficient Supply ☐ Abandoned, Poor Water Quality ☐ Abandoned, other, specify ☐ Other, specify

Construction Record - Screen					
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)		
			From	To	
4.82	PVC	10	4.57	7.62	

Water Details		Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	Depth (m/ft)	Diameter (cm/in)
		From	To
		0	7.62

Well Contractor and Well Technician Information

Business Name of Well Contractor

Strata drilling Group

Business Address (Street Number/Name)

105 Shields Court

Province

ON

Postal Code

L3R 8V2

Business E-mail Address

Wrecords@strataso1.com

Well Contractor's Licence No.

7241

Municipality

Markham

Well owner's information package delivered

☐ Yes ☐ No

Date Package Delivered

20180109

Date Work Completed

20180109

Ministry Use Only

Audit No

212304

FEB 13 2018

Received

Well Technician's Licence No.

3832

Signature of Technician and/or Contractor

[Signature]

Date Submitted

20180109

8-212304



C-7241 Z-212304

FEB 13 2018

11

CARLETON UNIVERSITY

Address of Well Location (Street Number/Name) 355 Cooper St
County/District/Municipality City/Town/Village orton
Province Ontario
UTM Coordinates Zone Easting Northing NAD 83 18 44 55 26 50 29 51 1
Municipal Plan and Sublot Number Other

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
BRN	Gravel		Loose	0	.61
BRN	Fill		Failed	.61	3.1
BRN	Clay	Silt	Soft	3.1	4.57
GRY	Clay		Soft	4.57	7.62

Annular Space

Depth Set at (m/ft) From	Depth Set at (m/ft) To	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
0	.31	Concrete/Plush mount	
.31	3.96	Bentonite	
3.96	7.62	Sand	

Method of Construction Well Use

☐ Cable Tool ☐ Diamond ☐ Public ☐ Commercial ☐ Not used
☐ Rotary (Conventional) ☐ Jetting ☐ Domestic ☐ Municipal ☐ Dewatering
☐ Rotary (Reverse) ☐ Driving ☐ Livestock ☒ Test Hole ☒ Monitoring
☐ Boring ☐ Digging ☐ Irrigation ☐ Cooling & Air Conditioning
☐ Air percussion ☐ Industrial
☒ Other, specify direct push

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	Depth (m/ft) To	Status of Well
4.03	PVC	368	0	4.57	☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☒ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, Insufficient Supply ☐ Abandoned, Poor Water Quality ☐ Abandoned, other, specify ☐ Other, specify

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To
4.82	PVC	10	4.57	7.62

Water Details Hole Diameter

Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	Depth (m/ft) From	Depth (m/ft) To	Diameter (cm/in)
		0	7.62	8.25

Well Contractor and Well Technician Information

Business Name of Well Contractor Strata Drilling Group
Business Address (Street Number/Name) 165 Shields Court
Province ON Postal Code L3R 8V2 Business E-mail Address Wrecords@strata.co.uk
Bus. Telephone No. (inc. area code) 905 940 7919 Name of Well Technician (Last Name, First Name) Halladay Phil
Well Technician's Licence No. 3832 Signature of Technician and/or Contractor Date Submitted 2018 01 09

Results of Well Yield Testing

After test of well yield, water was:	Draw Down	Recovery
☐ Clear and sand free ☐ Other, specify	Time (min) Water Level (m/ft)	Time (min) Water Level (m/ft)
If pumping discontinued, give reason:	Static Level	
Pump intake set at (m/ft)	1	1
Pumping rate (l/min / GPM)	2	2
Duration of pumping hrs + min	3	3
Final water level end of pumping (m/ft)	4	4
If flowing give rate (l/min / GPM)	5	5
Recommended pump depth (m/ft)	10	10
Recommended pump rate (l/min / GPM)	15	15
Well production (l/min / GPM)	20	20
Disinfected? ☐ Yes ☐ No	25	25
	30	30
	40	40
	50	50
	60	60

Map of Well Location

Please provide a map below following instructions on the back.

See MAP

2

Well owner's information package delivered ☐ Yes ☐ No

Date Package Delivered

Date Work Completed


Ministry Use Only

Audit No. 2212307

FEB 13 2018

Received

50

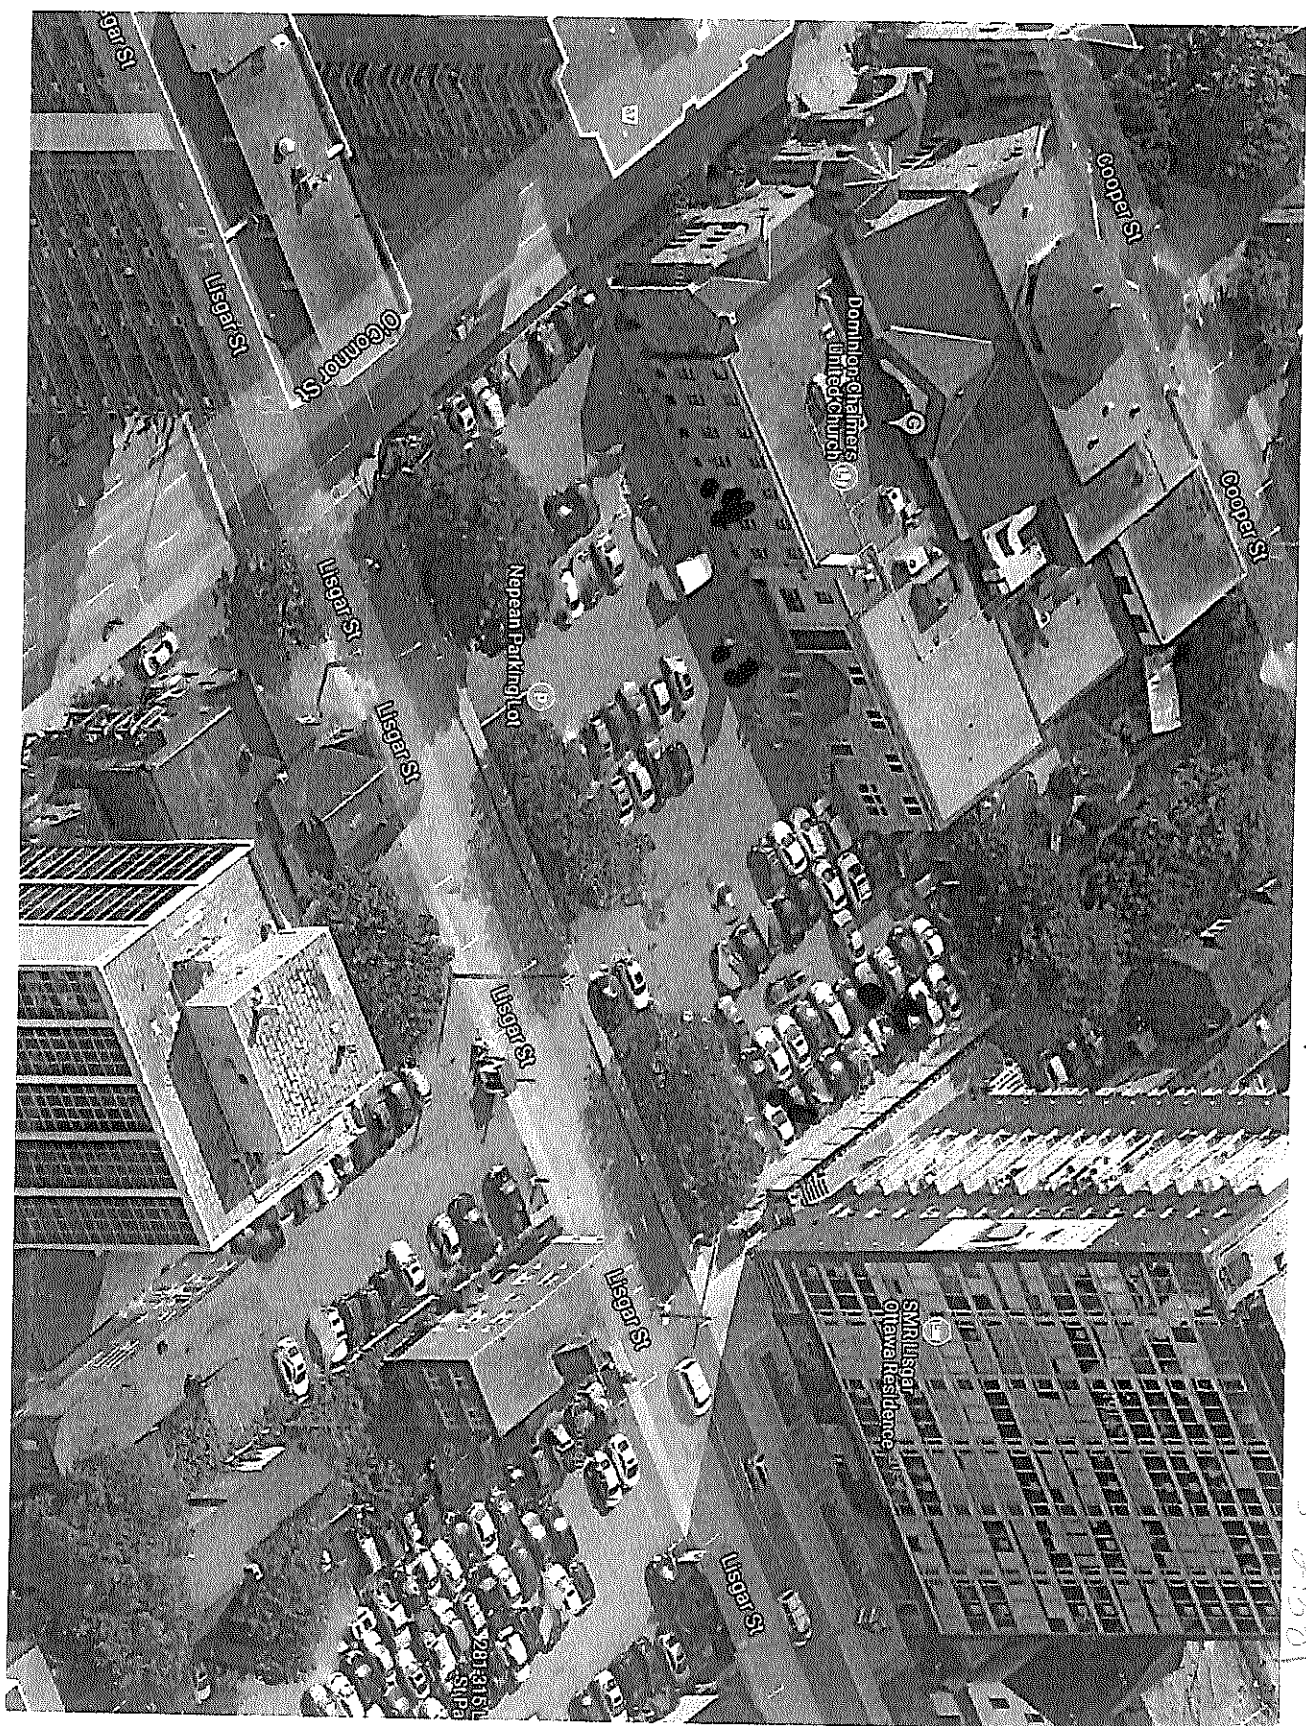


C-7241 Z-212307

FEB 13 2018 11

© Queen's Printer for Ontario, 2014

3.21381

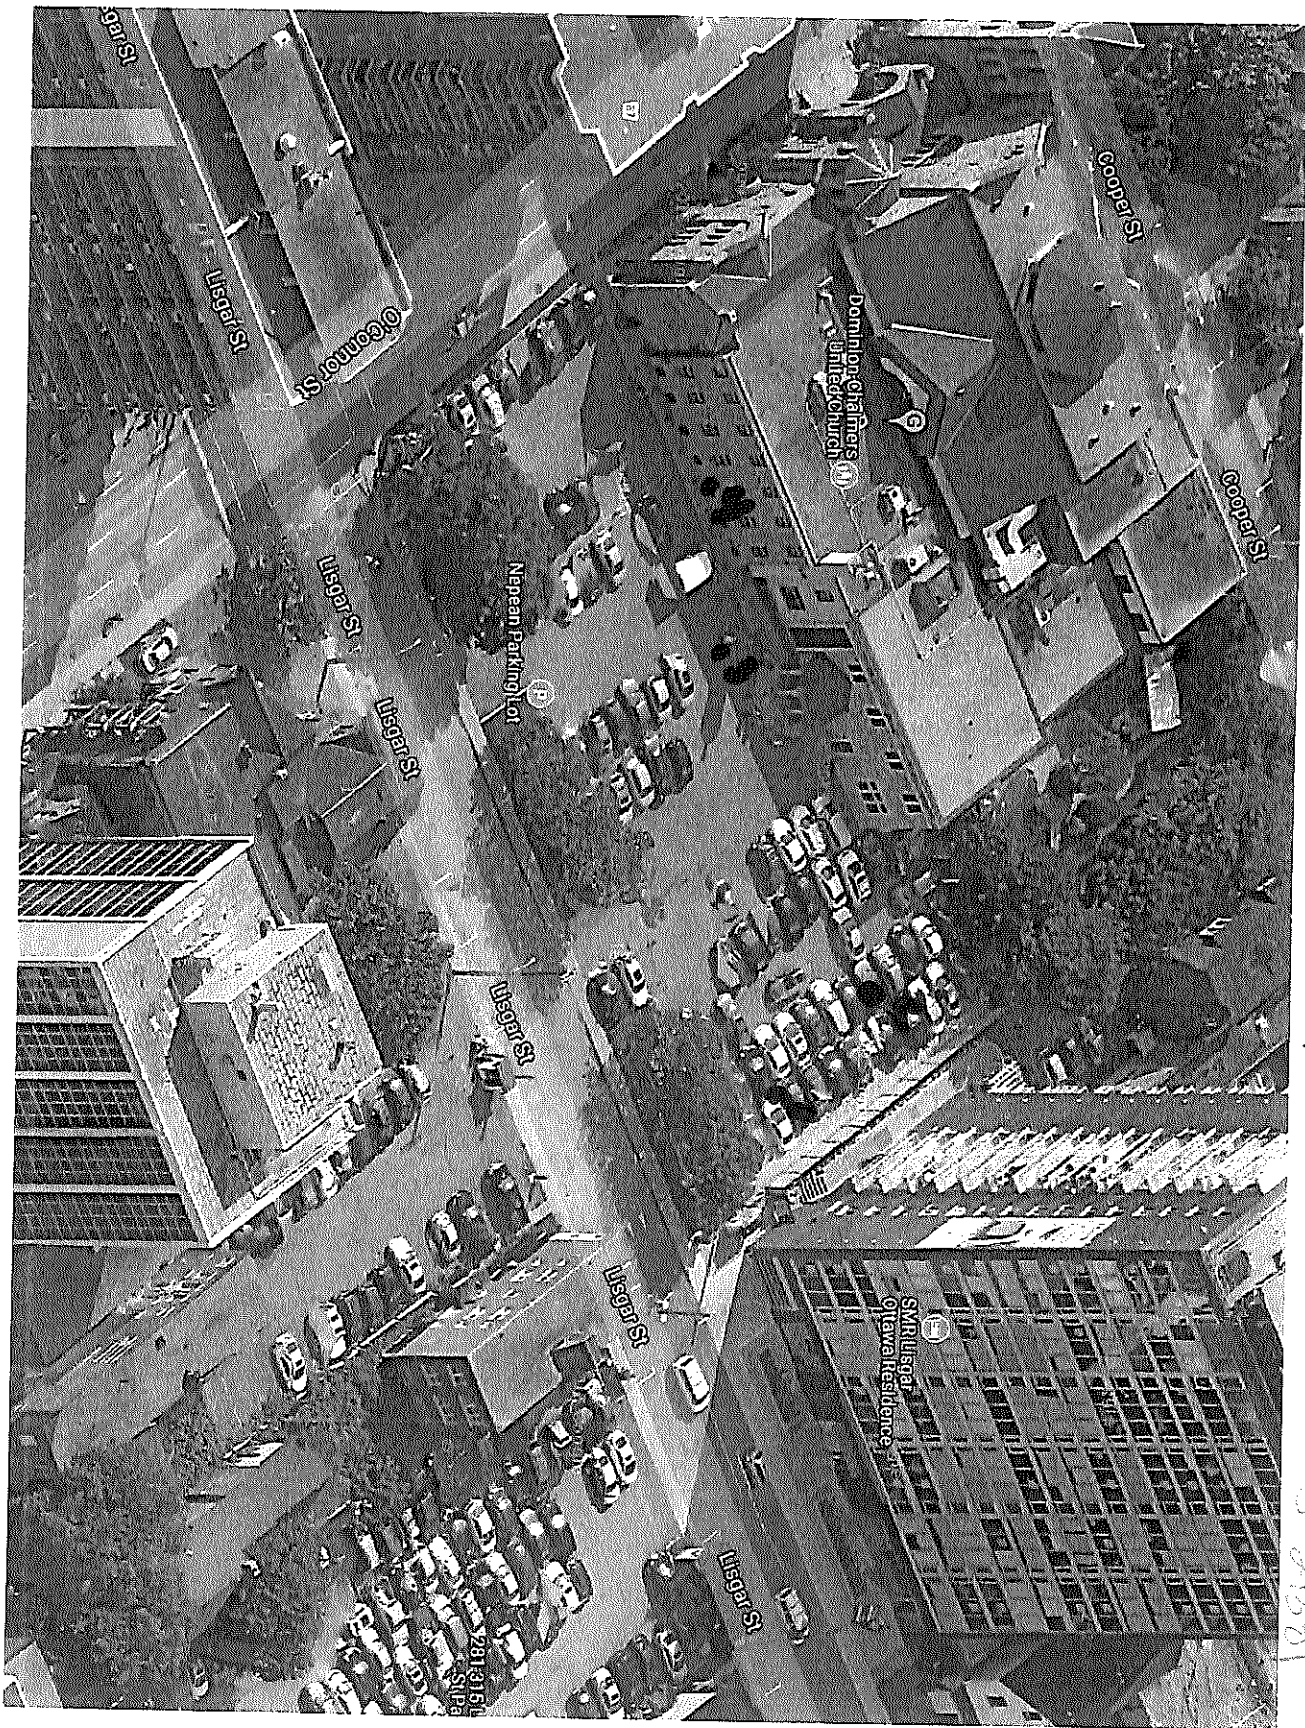

C-7241
Z-212305

FEB 13 2018

Measurements recorded in: ☒ Metric ☐ Imperial

A182722

S-21381 Page _____ of _____

CARLETON UNIVERSITY

Address of Well Location (Street Number/Name)
355 Cooper St

County/District/Municipality

Township

City/Town/Village
Ottawa

Lot

Province
Ontario

Concession

Postal Code

UTM Coordinates
NAD 83 18 44 55 34 50 29 57 0

Zone
18

Easting
44 55 34

Northing
50 29 57 0

Municipal Plan and Sublot Number

Other

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
GRY	Concrete			0	.15
GRY	Gravel		House	.15	.31
BWN	Clay	Silt	Soft	.31	1.83
GRY	Clay		Soft	1.83	3.96

Annular Space

Depth Set at (m/ft) From	Depth Set at (m/ft) To	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
0	.31	Concrete Flushmount	
.31	.91	Bentonite	
.91	3.96	Sand	

Method of Construction

Well Use

Construction Record - Casing

Status of Well

Construction Record - Screen

Status of Well

Results of Well Yield Testing

After test of well yield, water was: ☐ Clear and sand free ☐ Other, specify _____	Draw Down		Recovery	
	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
If pumping discontinued, give reason: Pump intake set at (m/ft)	Static Level			
	1		1	
	2		2	
	3		3	
Pumping rate (l/min / GPM)	4		4	
	5		5	
	10		10	
	15		15	
If flowing give rate (l/min / GPM)	20		20	
	25		25	
	30		30	
	40		40	
Recommended pump depth (m/ft)	50		50	
	60		60	
	Recommended pump rate (l/min / GPM)			
	Well production (l/min / GPM)			
Disinfected? ☐ Yes ☐ No				

Map of Well Location

Please provide a map below following instructions on the back.

See MAP

4

Water Details

Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested
	☐ Gas ☐ Other, specify _____
	☐ Fresh ☐ Untested
	☐ Gas ☐ Other, specify _____
	☐ Fresh ☐ Untested
	☐ Gas ☐ Other, specify _____

Hole Diameter

Depth (m/ft) From	Depth (m/ft) To	Diameter (cm/in)
0	3.96	5.08

Well Contractor and Well Technician Information

Business Name of Well Contractor Strata Drilling Corp	Well Contractor's Licence No. 7241
Business Address (Street Number/Name) 165 Shields Court	Municipality Markham
Province ON	Postal Code L3R 9V8
Business E-mail Address Wreccards@strata.ca	
Bus. Telephone No. (inc. area code) 905 940 7919	Name of Well Technician (Last Name, First Name) Halladay Phil
Well Technician's Licence No. 31832	Signature of Technician and/or Contractor [Signature]
Date Submitted 20180118	

Ministry Use Only

Audit No. 2212306
Received FEB 13 2018

Well owner's information package delivered

Date Package Delivered 1/17/2018
Date Work Completed 2/2/2018


Comments:
Well in boiler room

0506E (2014/11)

Ministry's Copy

© Queen's Printer for Ontario, 2014

3-21281

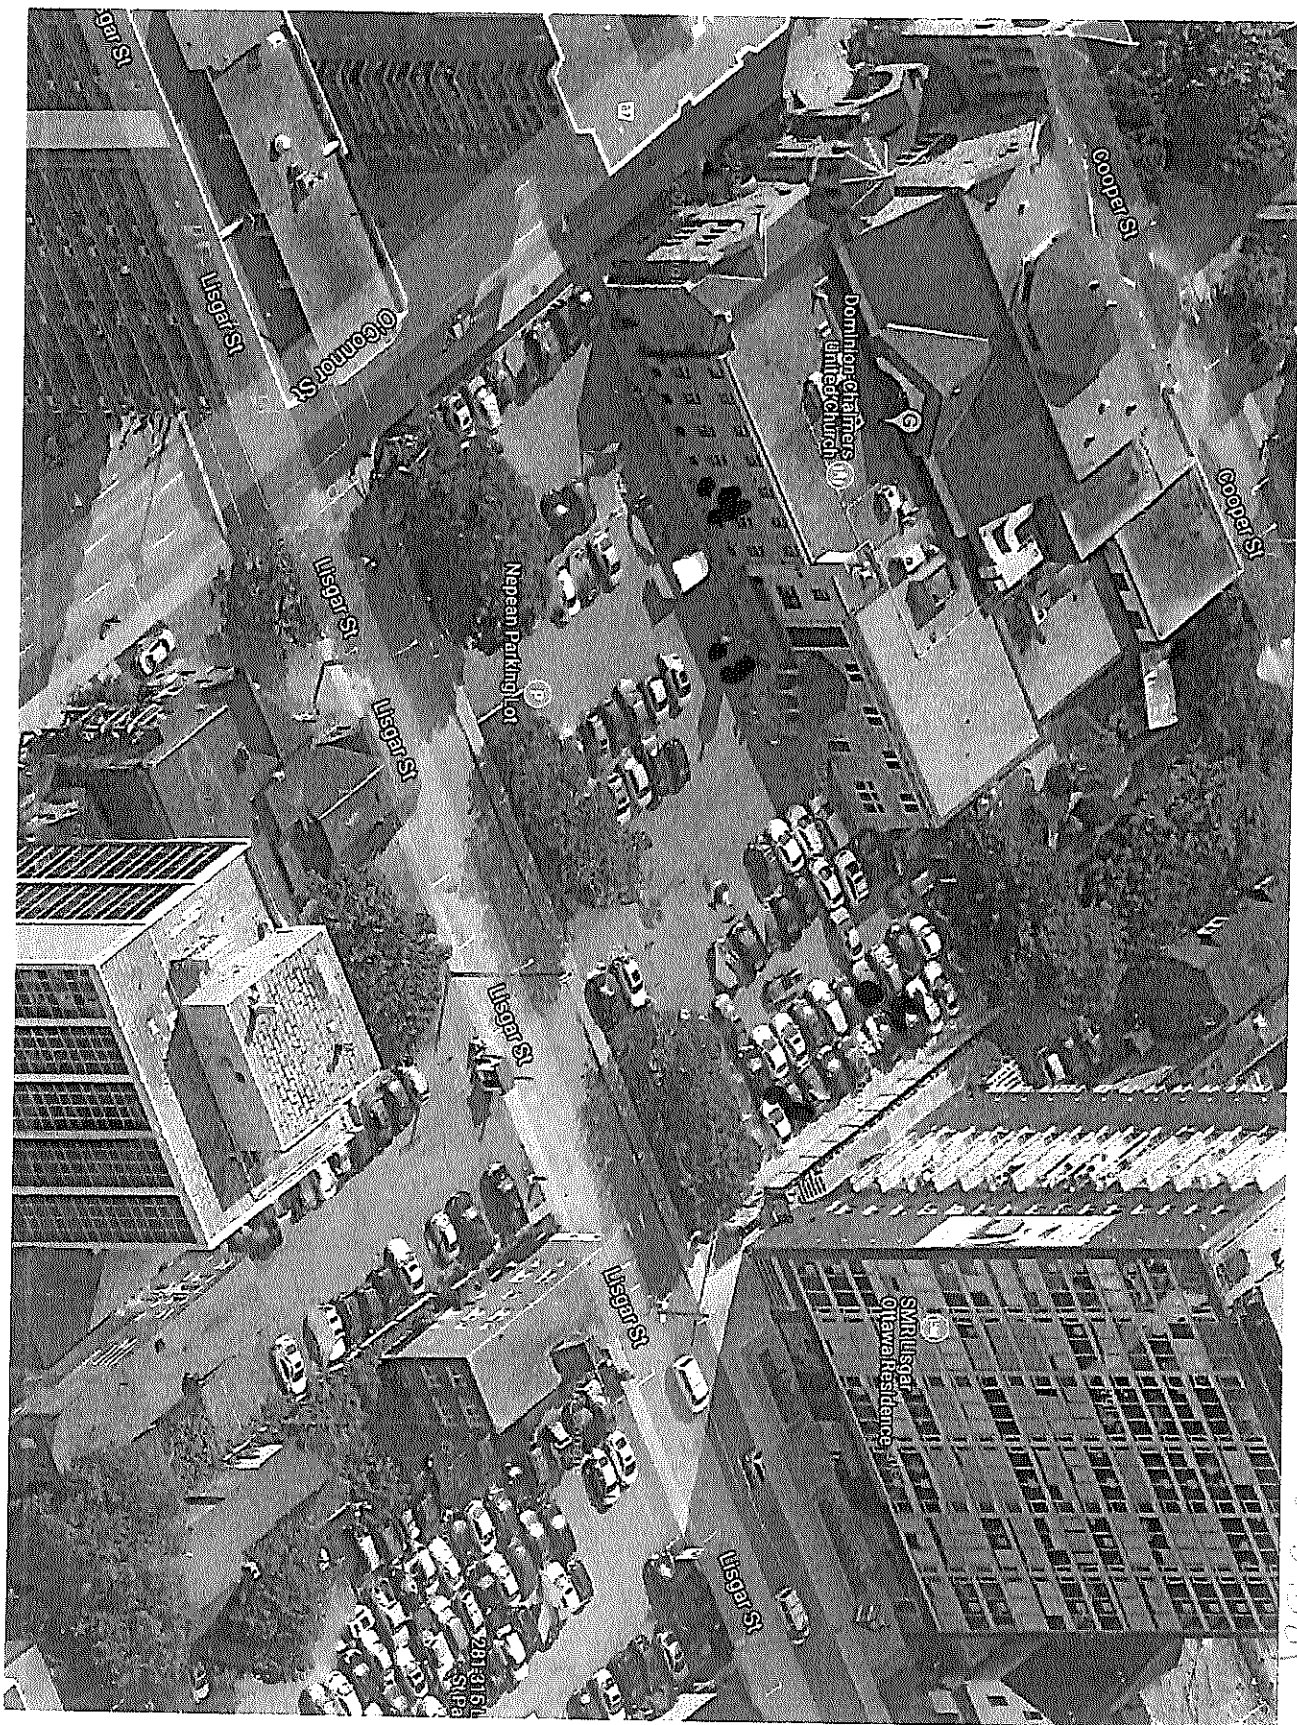

C-7241
Z-212306

FEB 13 2018



Measurements recorded in: ☒ Metric ☐ Imperial

A199385

S-21688 Page of

CARLETON UNIVERSITY

Address of Well Location (Street Number/Name) 355 Cooper St		Township	Lot	Concession	
County/District/Municipality		City/Town/Village Ottawa	Province Ontario	Postal Code	
UTM Coordinates	Zone	Easting	Northing	Municipal Plan and Sublot Number	
NAD	8	3	118445576	570295571	Other

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)					
General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
Brown	Fill	Sand, Gravel	Packed	0	1.22
Brown	Clay	Sand	Soft	1.22	3.1
Grey	Clay		Soft	3.1	6.1

Annular Space			Results of Well Yield Testing			
Depth Set at (m/ft) From	Depth Set at (m/ft) To	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)	Draw Down		Recovery
0	3.1	Concrete Flushmount Bentonite Sand		Time (min)	Water Level (m/ft)	Time (min)
				Static Level		
				1		1
				2		2
				3		3
				4		4
				5		5
				10		10
				15		15
				20		20
				25		25
				30		30
				40		40
				50		50
				60		60

Method of Construction	Well Use
☐ Cable Tool ☐ Rotary (Conventional) ☐ Rotary (Reverse) ☐ Boring ☐ Air percussion ☒ Other, specify direct Push	☐ Public ☐ Domestic ☐ Livestock ☐ Irrigation ☐ Industrial ☐ Commercial ☐ Municipal ☒ Test Hole ☐ Cooling & Air Conditioning ☐ Not used ☐ Dewatering ☒ Monitoring

Construction Record - Casing				Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From To	☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☒ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, Insufficient Supply ☐ Abandoned, Poor Water Quality ☐ Abandoned, other, specify ☐ Other, specify	
4.07	PVC	36.8	0 3.1		

Construction Record - Screen				Status of Well	
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From To	☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☒ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, Insufficient Supply ☐ Abandoned, Poor Water Quality ☐ Abandoned, other, specify ☐ Other, specify	
4.82	PVC	10	3.1 6.1		

Water Details		Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	Depth (m/ft) From To	Diameter (cm/in)
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	0 6.1	8.25
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify		

Well Contractor and Well Technician Information			
Business Name of Well Contractor Strata Drilling Corp	Well Contractor's Licence No. 7241	Business Address (Street Number/Name) 165 Shields Court	Municipality Markham
Province ON	Postal Code L3R 8A2	Business E-mail Address w@strata.on.ca	
Bus. Telephone No. (inc. area code) 905 907 919	Name of Well Technician (Last Name, First Name) Malladay Phil	Well Technician's Licence No. 3832	Date Submitted 2018 03 28

Map of Well Location			
Please provide a map below following instructions on the back.			
Comments: EXP			

Well owner's information	Date Package Delivered	Ministry Use Only
package delivered ☐ Yes ☐ No	7/7/7/4/4/0/0 Date Work Completed 2018 03 02	Audit No. 2212308 JUN 19 2018 Received



Well Tag #: A 215904
A215904

Measurements recorded in: ☐ Metric ☒ Imperial

CARLETON UNIVERSITY

Address of Well Location (Street Number/Name) 315 Cooper
Township
Lot
Concession
County/District/Municipality
City/Town/Village
Province Ontario
Postal Code
UTM Coordinates Zone Easting Northing
NAD 83 18 445558 5029481
Municipal Plan and Sublot Number
Other

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)					
General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
BK	Topsoil			0	1
BRN	fine sand	Gravel, silt	fill	1	10
SAI	Clay	silt	Soft	10	20

Annular Space			
Depth Set at (m/ft) From	Depth Set at (m/ft) To	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
0	1	Concrete / Flyash / Mortar	
1	9	Grout	
9	20	Filter sand	

Method of Construction		Well Use	
☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☒ Test Hole
☐ Boring	☐ Digging	☐ Irrigation	☒ Monitoring
☐ Air percussion		☐ Industrial	☐ Cooling & Air Conditioning
☒ Other, specify direct p5		☐ Other, specify	

Construction Record - Casing				Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	Depth (m/ft) To	
138	PLC	.14	0	10	☐ Water Supply
					☐ Replacement Well
					☒ Test Hole
					☐ Recharge Well
					☐ Dewatering Well
					☒ Observation and/or Monitoring Hole
					☐ Alteration (Construction)
					☐ Abandoned, Insufficient Supply
					☐ Abandoned, Poor Water Quality
					☐ Abandoned, other, specify
					☐ Other, specify

Construction Record - Screen				Status of Well	
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To	
168	PLC	0	10	20	☐ Water Supply
					☐ Replacement Well
					☒ Test Hole
					☐ Recharge Well
					☐ Dewatering Well
					☒ Observation and/or Monitoring Hole
					☐ Alteration (Construction)
					☐ Abandoned, Insufficient Supply
					☐ Abandoned, Poor Water Quality
					☐ Abandoned, other, specify
					☐ Other, specify

Water Details		Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	Depth (m/ft) From	Diameter (cm/in) To
		0	20
			2375

Well Contractor and Well Technician Information
Business Name of Well Contractor: Shata Drilling Group
Well Contractor's Licence No.: 7121411
Business Address (Street Number/Name): 165 Shields Court
Municipality: Markham
Province: ON
Postal Code: L3R 9V2
Business E-mail Address: wrecords@shatadrilling.com
Bus. Telephone No. (inc. area code): 905 940 7919
Name of Well Technician (Last Name, First Name): Beatty Brian
Well Technician's Licence No.: 36116
Signature of Technician and/or Contractor: [Signature]
Date Submitted: 20180308

Results of Well Yield Testing			
After test of well yield, water was:		Draw Down	
☐ Clear and sand free		Time (min)	Water Level (m/ft)
☐ Other, specify		Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:		Static Level	
Pump intake set at (m/ft)		1	1
Pumping rate (l/min / GPM)		2	2
Duration of pumping hrs + min		3	3
Final water level end of pumping (m/ft)		4	4
If flowing give rate (l/min / GPM)		5	5
Recommended pump depth (m/ft)		10	10
Recommended pump rate (l/min / GPM)		15	15
Well production (l/min / GPM)		20	20
Disinfected? ☐ Yes ☐ No		25	25
		30	30
		40	40
		50	50
		60	60

Map of Well Location
Please provide a map below following instructions on the back.
[Hand-drawn map showing well location with coordinates 151, 10, 401, 2375 and a box labeled 315. The name 'COOPER' is written vertically next to the map.]
Comments: Exp General Contractor

SERCO REALTY LTD.

Address of Well Location (Street Number/Name) 331 Cooper St				Township		Lot		Concession	
County/District/Municipality				City/Town/Village Ottawa				Province Ontario	
Postal Code				UTM Coordinates		Zone		Easting	
				NAD		8		3	
				18		44		5651	
				5029		536			
Municipal Plan and Sublot Number				Other					

[illegible]

Annular Space			
Depth Set at (m/ft)		Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
From	To		
0	1	Concrete / Flush joint	
1	2	Sealant	
2	18	Filter Sand	

Method of Construction		Well Use		
☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial	☐ Not used
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal	☐ Dewatering
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☒ Test Hole	☒ Monitoring
☐ Boring	☐ Digging	☐ Irrigation	☐ Cooling & Air Conditioning	
☐ Air percussion		☐ Industrial		
☒ Other, specify <i>direct push</i>		☐ Other, specify _____		

Construction Record - Casing					Status of Well
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☒ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned,
			From	To	
138	10LC	14	0	3	

Construction Record - Screen				
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)	
			From	To
1.66	PVC	10	8	13


☐ Insufficient Supply
☐ Abandoned, Poor Water Quality
☐ Abandoned, other, specify _____
☐ Other, specify _____

Water Details		Hole Diameter	
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____	Depth (m/ft) From	To Diameter (cm/in)
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____	0	18 2.375
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____		

Well Contractor and Well Technician Information			
Business Name of Well Contractor		Well Contractor's Licence No.	
Strata Drilling Group		7121411	
Business Address (Street Number/Name)		Municipality	
165 Shields Court		Markham	
Province	Postal Code	Business E-mail Address	
ON	L3R6P2	wreed@strataoil.com	
Bus. Telephone No. (inc. area code)	Name of Well Technician (Last Name, First Name)		
9059407911	Beatty Brian		
Well Technician's Licence No.	Signature of Technician and/or Contractor		Date Submitted
3616	LB		2018/11/17

Results of Well Yield Testing				
After test of well yield, water was: ☐ Clear and sand free ☐ Other, specify _____	Draw Down		Recovery	
	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:	Static Level			
	1		1	
Pump intake set at (m/ft)	2		2	
Pumping rate (l/min / GPM)	3		3	
Duration of pumping ____ hrs + ____ min	4		4	
	5		5	
Final water level end of pumping (m/ft)	10		10	
If flowing give rate (l/min / GPM)	15		15	
	20		20	
Recommended pump depth (m/ft)	25		25	
	30		30	
Recommended pump rate (l/min / GPM)	40		40	
	50		50	
Well production (l/min / GPM)	60		60	
Disinfected? ☐ Yes ☐ No				

Map of Well Location							
Please provide a map below following instructions on the back. MWI ON MAP							
Comments: Pincha General Contadores							
Well owner's information package delivered ☐ Yes ☐ No	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <th style="text-align: center; background-color: #f2f2f2;">Date Package Delivered</th> <th style="text-align: center; background-color: #f2f2f2;">Ministry Use Only</th> </tr> <tr> <td style="text-align: center;"> Y Y Y Y M M D D </td> <td style="padding: 5px;"> Audit No. Z298238 </td> </tr> <tr> <td style="padding: 5px;"> Date Work Completed 2018/11/14 </td> <td style="padding: 5px; text-align: center;"> MAR 08 2019 Received _____ </td> </tr> </table>	Date Package Delivered	Ministry Use Only	Y Y Y Y M M D D	Audit No. Z298238	Date Work Completed 2018/11/14	MAR 08 2019 Received _____
Date Package Delivered	Ministry Use Only						
Y Y Y Y M M D D	Audit No. Z298238						
Date Work Completed 2018/11/14	MAR 08 2019 Received _____						

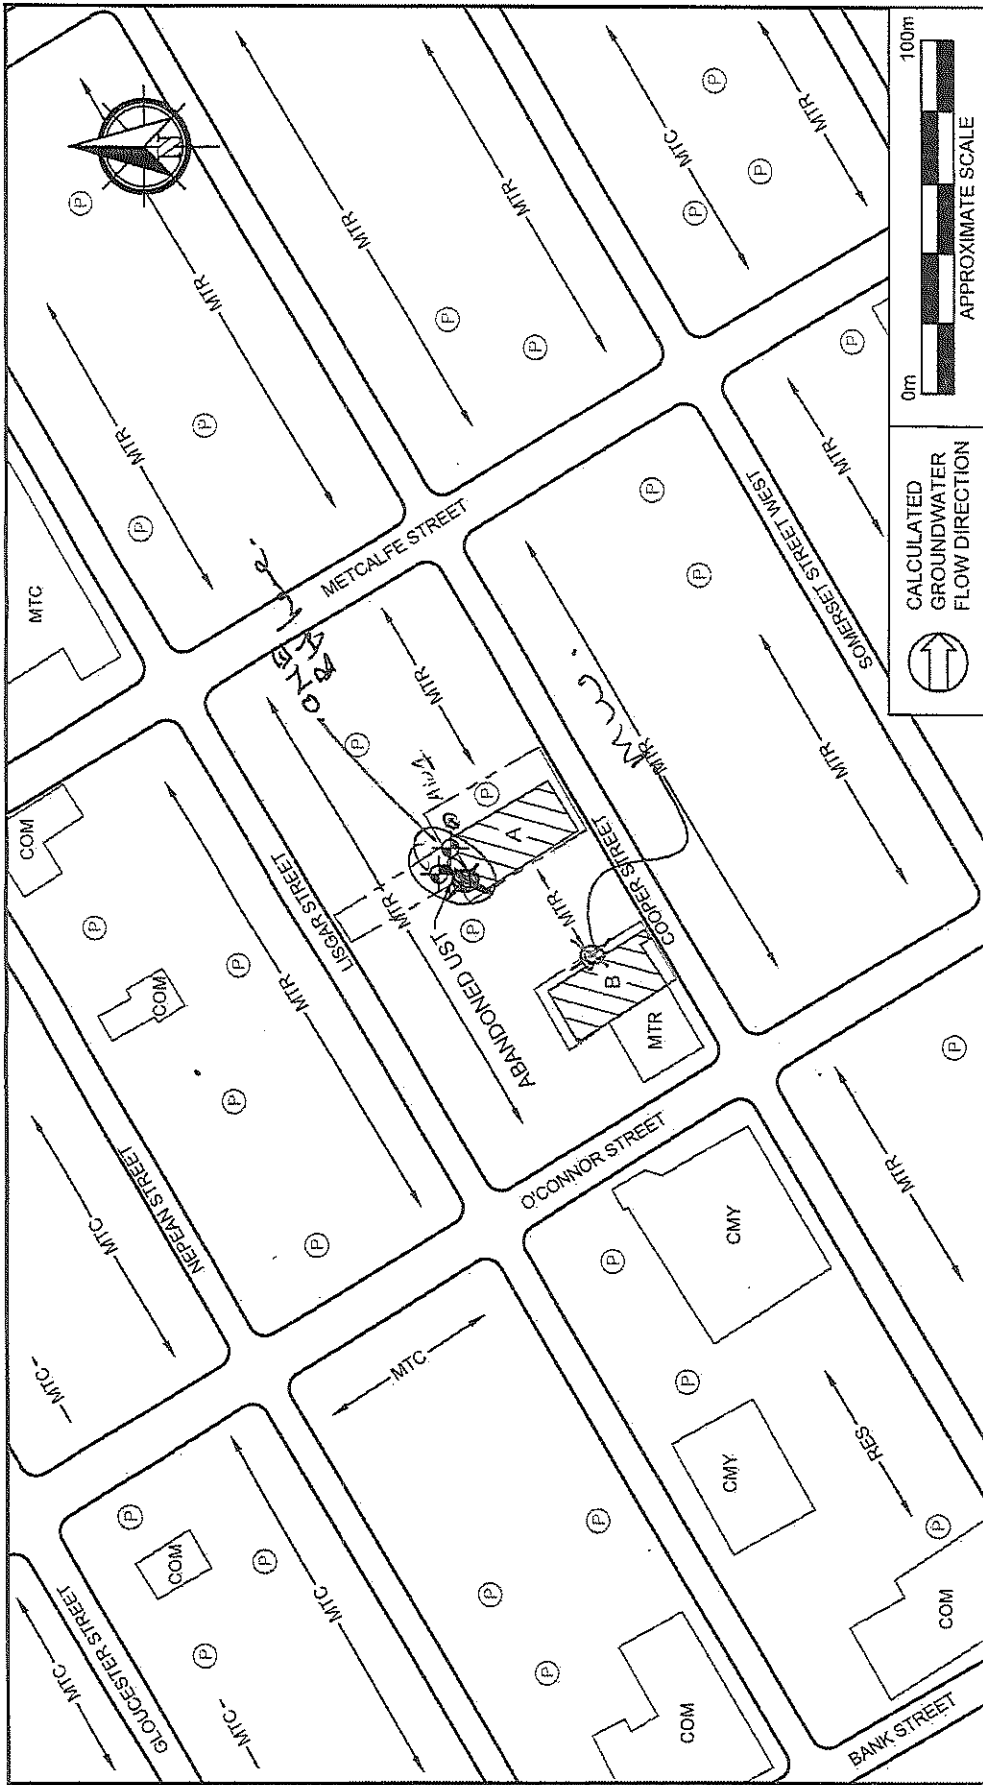

	PROJECT NAME PHASE I ENVIRONMENTAL SITE ASSESSMENT		
	CLIENT NAME SERCO COMMERCIAL HOLDINGS INC.		
	PROJECT LOCATION 309 AND 331 COOPER STREET, OTTAWA, ONTARIO		
	FIGURE NAME SITE AND SURROUNDING LAND USE PLAN		
	FIGURE NO. 2		
APPROXIMATE SCALE AS SHOWN		PROJECT NO. 230021	DATE OCTOBER 2018

MAR 08 2019

G7241 2298238



Measurements recorded in: ☐ Metric ☐ Imperial

Well Owner's Information

First Name	Last Name / Organization City of Ottawa	E-mail Address	☐ Well Constructed by Well Owner
Mailing Address (Street Number/Name) 100 CONSTELLATION DR	Municipality OTTAWA	Province ON	Postal Code K2G6S8K
Telephone No. (inc. area code) 135802424			

Well Location

Address of Well Location (Street Number/Name) KENT ST.	Township OTTAWA	Lot	Concession
County/District/Municipality OTTAWA	City/Town/Village OTTAWA	Province Ontario	Postal Code
UTM Coordinates Zone Easting Northing NAD 83 184453555029224	Municipal Plan and Sublot Number	Other	

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From To
	ABANDON MATT VPW			

Annular Space		
Depth Set at (m/ft) From To	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)

Method of Construction	Well Use
☐ Cable Tool ☐ Rotary (Conventional) ☐ Rotary (Reverse) ☐ Boring ☐ Air percussion ☐ Other, specify	☐ Diamond ☐ Jetting ☐ Driving ☐ Digging ☐ Public ☐ Commercial ☐ Domestic ☐ Livestock ☐ Irrigation ☐ Industrial ☐ Other, specify

Construction Record - Casing				Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From To	☐ Water Supply ☐ Replacement Well ☐ Test Hole ☐ Recharge Well ☐ Dewatering Well ☐ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, Insufficient Supply ☐ Abandoned, Poor Water Quality ☐ Abandoned, other, specify ☐ Other, specify	

Construction Record - Screen			
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From To

Water Details		Hole Diameter	
Water found at Depth (m/ft) ☐ Gas ☐ Other, specify	Kind of Water: ☐ Fresh ☐ Untested	Depth (m/ft) From To	Diameter (cm/in)
Water found at Depth (m/ft) ☐ Gas ☐ Other, specify	Kind of Water: ☐ Fresh ☐ Untested		
Water found at Depth (m/ft) ☐ Gas ☐ Other, specify	Kind of Water: ☐ Fresh ☐ Untested		

Well Contractor and Well Technician Information			
Business Name of Well Contractor DRILLING CCL GEOTECHNICAL & ENVIRONMENTAL	Well Contractor's Licence No. 71543		
Business Address (Street Number/Name) 48-2627 EDINBURGH PL	Municipality OTTAWA		
Province ON	Postal Code K1J3M1	Business E-mail Address matthew.webb@cclgroup.ca	
Bus. Telephone No. (inc. area code) 6137575227	Name of Well Technician (Last Name, First Name) CORY ALGER		
Well Technician's Licence No. 3388	Signature of Technician and/or Contractor Cory Alger	Date Submitted Y Y Y Y M M D D	

Results of Well Yield Testing				
After test of well yield, water was: ☐ Clear and sand free ☐ Other, specify	Draw Down		Recovery	
	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:	Static Level			
	1		1	
Pump intake set at (m/ft)	2		2	
Pumping rate (l/min / GPM)	3		3	
Duration of pumping hrs + min	4		4	
Final water level end of pumping (m/ft)	5		5	
If flowing give rate (l/min / GPM)	10		10	
Recommended pump depth (m/ft)	15		15	
Recommended pump rate (l/min / GPM)	20		20	
Well production (l/min / GPM)	25		25	
Disinfected? ☐ Yes ☐ No	30		30	
	40		40	
	50		50	
	60		60	

Map of Well Location	
Please provide a map below following instructions on the back.	

Comments:	Well owner's information package delivered ☐ Yes ☐ No	Date Package Delivered Y Y Y Y M M D D Date Work Completed Y Y Y Y M M D D	Ministry Use Only Audit No. 2287916 Rec'd 2 2019

Measurements recorded in: ☐ Metric ☒ Imperial

Well Tag No. (Place Sticker and/or Print Below)

A191626 17-4

Well Record

Regulation 903 Ontario Water Resources Act

Page 1 of 1

Web Owner's Information

First Name	Last Name / Organization	E-mail Address	☐ Well Constructed by Well Owner	
	City of Ottawa			
Mailing Address (Street Number/Name)	Municipality	Province	Postal Code	Telephone No. (inc. area code)
100 Casselton Dr.	Ottawa	ON	K2G6J8	613-580-2424

Well Location

Address of Well Location (Street Number/Name) <i>Kent St.</i>				Township		Lot		Concession	
County/District/Municipality <i>Ottawa</i>				City/Town/Village <i>Ottawa</i>				Province Ontario	
UTM Coordinates		Zone	Easting	Northing		Municipal Plan and Sublot Number			Other
NAD		8	3	18		445 267 5029 378			

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From To
			20% bentonite, slurry	175" 351
			Portland (quick grab)	
			3% bentonite chips	6" 175"
			Cold patch asphalt	0" 6"
			Top 6' of 2" PVC out	

Annular Space

Depth Set at (m/ft) From	To	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)

Method of Construction

☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial	☐ Not used
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal	☐ Dewatering
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☐ Test Hole	☐ Monitoring
☐ Boring	☐ Digging	☐ Irrigation	☐ Cooling & Air Conditioning	
☐ Air percussion		☐ Industrial		
☐ Other, <i>specify</i> _____		☐ Other, <i>specify</i> _____		

Well Use

☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial	☐ Not used
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal	☐ Dewatering
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☐ Test Hole	☐ Monitoring
☐ Boring	☐ Digging	☐ Irrigation	☐ Cooling & Air Conditioning	
☐ Air percussion		☐ Industrial		
☐ Other, <i>specify</i> _____		☐ Other, <i>specify</i> _____		

Construction Record - Casino

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		
			From	To	
					☐ Water Supply
					☐ Replacement Well
					☐ Test Hole
					☐ Recharge Well
					☐ Dewatering Well
					☐ Observation and/or Monitoring Hole
					☐ Alteration (Construction)
					☐ Abandoned,

Status of Well

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		☐ Water Supply ☐ Replacement Well ☐ Test Hole ☐ Recharge Well ☐ Dewatering Well ☐ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned,
			From	To	

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)		☐ Abandoned, poor Water Quality ☒ Abandoned, other, specify ☐ Other, specify
			From	To	
					NSL Long Bay 

Results of Well Yield Testing

After test of well yield, water was:	Draw Down		Recovery	
	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
☐ Clear and sand free ☐ Other, specify _____	Static Level			
If pumping discontinued, give reason:	1		1	
Pump intake set at (m/ft)	2		2	
Pumping rate (l/min / GPM)	3		3	
	4		4	
Duration of pumping ____ hrs + ____ min	5		5	
Final water level end of pumping (m/ft)	10		10	
	15		15	
If flowing give rate (l/min / GPM)	20		20	
Recommended pump depth (m/ft)	25		25	
Recommended pump rate (l/min / GPM)	30		30	
	40		40	
Well production (l/min / GPM)	50		50	
Disinfected?	60		60	
☐ Yes ☐ No				

Map of Well Location

Please provide a map below following instructions on the back.

Water Details

Water found at Depth 25 (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☒ Untested ☐ Other, specify _____	Depth (m/ft) From To	Diameter (cm/in)
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____	61 35	211
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____	Well Pipe	Size

Hole Diameter

Water found at Depth 25 (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☒ Untested ☐ Other, specify _____	Depth (m/ft) From To	Diameter (cm/in)
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____	61 35	211
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____	Well Pipe	Size

Well Contractor and Well Technician Information

Business Name of Well Contractor CCC Drilling		Well Contractor's Licence No. 7543	
Business Address (Street Number/Name) 48-2627 Edinburgh Place		Municipality Ottawa	
Province ON	Postal Code K1B5M1	Business E-mail Address mac@cccgrp.ca	
Bus. Telephone No. (inc. area code) 6137375227		Name of Well Technician (Last Name, First Name) Cyril Echlin	
Well Technician's Licence No. 3299	Signature of Technician and/or Contractor [Signature]	Date Submitted 2019-09-20	

Comments:

Well owner information package delivered

☐ Yes

☒ No

Date Package Delivered

Y	Y	Y	Y	M	M	D	D

Date Work Completed

2 NOV 09 19

Ministry Use Only
Audit No. **Z286433**
OCT 22 2010



Measurements recorded in: ☐ Metric ☐ Imperial

Well Owner's Information

First Name	Last Name / Organization	E-mail Address	☐ Well Constructed by Well Owner
	City of Ottawa		
Mailing Address (Street Number/Name)	Municipality	Province	Postal Code
100 Constellation Dr.	Ottawa	ON	K2G6J8
Telephone No. (inc. area code)			
613 580 2424			

Well Location

Address of Well Location (Street Number/Name)	Township	Lot	Concession
Kent St.			
County/District/Municipality	City/Town/Village	Province	Postal Code
Ottawa	Ottawa	Ontario	
UTM Coordinates Zone	Easting	North	Municipal Plan and Sublot Number
NAD 83	181445	182	5029510
Other			

Overburden and Bedrock Materials (Abandonment Sealing Record (see instructions on the back of this form))

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)
			2090 bentonite slurry	2' bottom
			(Portland/Quickgrout)	
			3/8 Portland chips	6" 2'
			Cold patch asphalt	0" 6"
Both these were 3/4" standpipes installed in the same hole. Could not get a tape down the pipe's for a measurement. Top 5' of pipe out of both.				

Annular Space		
Depth Set at (m/ft)	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
From	To	

Method of Construction	Well Use
☐ Cable Tool	☐ Public
☐ Rotary (Conventional)	☐ Commercial
☐ Rotary (Reverse)	☐ Domestic
☐ Boring	☐ Livestock
☐ Air percussion	☐ Irrigation
☐ Other, specify	☐ Industrial
	☐ Other, specify

Construction Record - Casing				Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)	☐ Water Supply	☐ Replacement Well
From	To	☐ Test Hole			
				☐ Recharge Well	
				☐ Dewatering Well	
				☐ Observation and/or Monitoring Hole	
				☐ Alteration (Construction)	
				☐ Abandoned, Insufficient Supply	
				☐ Abandoned, Poor Water Quality	
				☒ Abandoned, other, specify	
				☐ Other, specify	

Water Details		Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested	Depth (m/ft)	Diameter (cm/in)
	☐ Gas ☐ Other, specify	From	To

Well Contractor and Well Technician Information			
Business Name of Well Contractor	Well Contractor's Licence No.		
CCC Drilling	75143		
Business Address (Street Number/Name)	Municipality		
48-2627 Edinburgh Ave	Ottawa		
Province	Postal Code	Business E-mail Address	
ON	K1B5M1	muhb@cccgroup.ca	
Bus. Telephone No. (inc. area code)	Name of Well Technician (Last Name, First Name)		
613 737 5227	Charles Edlin		
Well Technician's Licence No.	Signature of Technician and/or Contractor		Date Submitted
51299	[Signature]		20190923

Results of Well Yield Testing			
After test of well yield, water was:		Draw Down	
☐ Clear and sand free		Time (min)	Water Level (m/ft)
☐ Other, specify			
If pumping discontinued, give reason:		Time (min)	Water Level (m/ft)
Pump intake set at (m/ft)			
Pumping rate (l/min / GPM)			
Duration of pumping			
hrs + min			
Final water level end of pumping (m/ft)			
If flowing give rate (l/min / GPM)			
Recommended pump depth (m/ft)			
Recommended pump rate (l/min / GPM)			
Well production (l/min / GPM)			
Disinfected?			
☐ Yes ☐ No			

Map of Well Location	
Please provide a map below following instructions on the back.	
[Map area]	
Well owner's information package delivered	Date Package Delivered
☐ Yes ☐ No	Y Y Y Y M M D D
	20190929
Date Work Completed	
20190929	
Ministry Use Only	
Audit No. 2286432	
OCT 22 2019	

Measurements recorded in: ☐ Metric ☒ Imperial

Well Tag No. (Place Sticker and/or Print Below)
No Tag Found 17-3

Well Owner's Information

First Name	Last Name / Organization	E-mail Address	☐ Well Constructed by Well Owner	
	City of Ottawa			
Mailing Address (Street Number/Name)	Municipality	Province	Postal Code	Telephone No. (inc. area code)
100 Constellation Dr.	Ottawa	ON	K2S6K7P8	613 580 2424

Well Location

Address of Well Location (Street Number/Name) <i>Kent St</i>		Township	Lot	Concession	
County/District/Municipality <i>Ontario</i>		City/Town/Village <i>Oshawa</i>		Province Ontario	Postal Code
UTM Coordinates Zone Easting NAD 8 3 <i>18445355</i>		Northing <i>5029 228</i>		Municipal Plan and Sublot Number	
				Other	

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)	
				From	To
			20% bentonite slurry (Port Hard / Quickglut)	118"	46'
			3/8 bentonite chips	6"	118"
			old patch asphalt	0"	6"
			Top 6' of 2 nd PVC out		

Annular Space

Depth Set at (m/ft)	To	Type of Sealant Used (Material and Type)	Volume Placed (m ³ /ft ³)

Method of Construction

☐ Cable Tool ☐ Diamond
☐ Rotary (Conventional) ☐ Jetting
☐ Rotary (Reverse) ☐ Driving
☐ Boring ☐ Digging
☐ Air percussion
☐ Other, *specify*

Well Use

☐ Public ☐ Commercial ☐ Not used
☐ Domestic ☐ Municipal ☐ Dewatering
☐ Livestock ☐ Test Hole ☐ Monitoring
☐ Irrigation ☐ Cooling & Air Conditioning
☐ Industrial
☐ Other, *specify*

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		
			From	To	
					☐ Water Supply
					☐ Replacement Well
					☐ Test Hole
					☐ Recharge Well
					☐ Dewatering Well
					☐ Observation and/or Monitoring Hole
					☐ Alteration (Construction)
					☐ Abandoned, Inefficient, Unsafe

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)		☐ Abandoned, Poor Water Quality ☒ Abandoned, other, specify <i>Not longer used</i> ☐ Other, specify _____
			From	To	

Results of Well Yield Testing

After test of well yield, water was:		Draw Down		Recovery	
☐ Clear and sand free ☐ Other, specify _____		Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:		Static Level			
		1		1	
Pump intake set at (m/ft)		2		2	
Pumping rate (l/min / GPM)		3		3	
Duration of pumping _____ hrs + _____ min		4		4	
Final water level end of pumping (m/ft)		5		5	
If flowing give rate (l/min / GPM)		10		10	
Recommended pump depth (m/ft)		15		15	
Recommended pump rate (l/min / GPM)		20		20	
Well production (l/min / GPM)		25		25	
Disinfected?		30		30	
☐ Yes ☐ No		40		40	
		50		50	
		60		60	

Map of Well Location

Please provide a map below following instructions on the back.

Water Details

Water found at Depth 4 (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☒ Untested ☐ Other, specify _____
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____

Hole Diameter

Depth (m/ft)		Diameter (cm/in)
From	To	
6 ⁰¹	40 ⁰¹	2 ⁰⁰
Well Pipe Size		

Well Contractor and Well Technician Information

Business Name of Well Contractor CCC Drilling		Well Contractor's Licence No. 7543	
Business Address (Street Number/Name) 48-2627 Edinboro Rd		Municipality Ottawa	
Province ON	Postal Code K1B5M1	Business E-mail Address mwebb@cccdrill.ca	
Bus. Telephone No. (inc. area code) 6137375227		Name of Well Technician (Last Name, First Name) Chad Echlin	
Well Technician's Licence No. 3299	Signature of Technician and/or Contractor Chad Echlin	Date Submitted 20190928	

Comments:

Well owner information package delivered

☐ Yes

☒ No

Date Package Delivered							
Y	Y	Y	Y	M	M	D	D
Date Work Completed							
2	0	1	9	0	9	1	9

Ministry Use Only
Audit No: **Z286434**
Recd: **661 27 2019**

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .

[Go Back to Map](#)

Well ID

Well ID Number: 7354243

Well Audit Number: Z302715

Well Tag Number: A282350

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	281 kent st
Township	OTTAWA CITY

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	Ottawa
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 445329.00 Northing: 5029309.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To
BLCK	GRVL	----	LOOS	0 m	.31 m

BRWN	CLAY	SILT	DNSE	.31 m	4 m
GREY	SILT	SAND	SOFT	4 m	7.13 m

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	
0 m	.31 m	CONCRETE FLUSHMOUNT		
.31 m	3.72 m	BENTONITE		
3.72 m	7.13 m	SAND		

Method of Construction & Well Use

Method of Construction	Well Use	
Direct Push	Monitoring	
	Test Hole	

Status of Well

Monitoring and Test Hole

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	
4.03 cm	PLASTIC	0 m	4.03 m	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	
4.82 cm	PLASTIC	4.03 m	7.13 m	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		

Pump intake set at	
Pumping Rate	
Duration of Pumping	
Final water level	
If flowing give rate	
Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	

3		3	
4		4	
5		5	
10		10	
15		15	
20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter
0 m	7.13 m	8.3 cm

Audit Number: Z302715

Date Well Completed: January 24, 2020

Date Well Record Received by MOE: February 19, 2020

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)

Updated: January 10, 2024

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .

[Go Back to Map](#)

Well ID

Well ID Number: 7354244

Well Audit Number: Z302714

Well Tag Number: A269067

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	81 kent st
Township	OTTAWA CITY

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	Ottawa
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 445329.00 Northing: 5029277.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To
BLCK	GRVL	----	LOOS	0 m	.31 m

BRWN	CLAY	SILT	DNSE	.31 m	4 m
GREY	SILT	SAND	SOFT	4 m	6.1 m

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	
0 m	.31 m	CONCRETE FLUSHMOUNT		
.31 m	2.79 m	BENTONITE		
2.79 m	6.1 m	SAND		

Method of Construction & Well Use

Method of Construction	Well Use	
Direct Push	Monitoring	
	Test Hole	

Status of Well

Monitoring and Test Hole

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	
4.03 cm	PLASTIC	0 m	3.1 m	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	
4.82 cm	PLASTIC	3.1 m	6.1 m	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		

Pump intake set at	
Pumping Rate	
Duration of Pumping	
Final water level	
If flowing give rate	
Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	

3		3	
4		4	
5		5	
10		10	
15		15	
20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter
0 m	6.1 m	8.3 cm

Audit Number: Z302714

Date Well Completed: January 20, 2020

Date Well Record Received by MOE: February 19, 2020

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .

[Go Back to Map](#)

Well ID

Well ID Number: 7354245

Well Audit Number: Z302708

Well Tag Number: A269066

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	281 kent st
Township	OTTAWA CITY

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	Ottawa
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 445323.00 Northing: 5029289.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To
BLCK	----	GRVL	LOOS	0 m	.31 m

BRWN	CLAY	SILT	DNSE	.31 m	4 m
GREY	SILT	SAND	SOFT	4 m	6.1 m

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	
0 m	.31 m	CONCRETE FLUSHMOUNT		
.31 m	2.79 m	BENTONITE		
2.79 m	6.1 m	SAND		

Method of Construction & Well Use

Method of Construction	Well Use	
Direct Push	Monitoring	
	Test Hole	

Status of Well

Monitoring and Test Hole

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	
4.03 cm	PLASTIC	0 m	3.1 m	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	
4.82 cm	PLASTIC	3.1 m	6.1 m	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		

Pump intake set at	
Pumping Rate	
Duration of Pumping	
Final water level	
If flowing give rate	
Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	

3		3	
4		4	
5		5	
10		10	
15		15	
20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter
0 m	6.1 m	8.3 cm

Audit Number: Z302708

Date Well Completed: January 20, 2020

Date Well Record Received by MOE: February 19, 2020

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)

Updated: January 10, 2024

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7382782

Well Audit Number: Z338246

Well Tag Number: A302969

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	311 Somerset St W
Township	OTTAWA CITY

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	Ottawa
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 445647.00 Northing: 5029419.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To
GREY	GRVL		HARD	0 m	2 m

GREY	GRVL	FILL	HARD	2 m	5 m
GREY	SILT	CLAY	SOFT	5 m	9 m
GREY	CLAY		SOFT	9 m	20 m

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	
0 m	1 m	CONCRETE FLUSHMOUNT		
1 m	9 m	BENSEAL		
9 m	20 m	SAND		

Method of Construction & Well Use

Method of Construction	Well Use	
Direct Push		
	Monitoring and Test Hole	

Status of Well

Observation Wells

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	
2.047 cm	PLASTIC	0 m	10 m	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	
2.375 cm	PLASTIC	10 m	20 m	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was		

If pumping discontinued, give reason	
Pump intake set at	
Pumping Rate	
Duration of Pumping	
Final water level	
If flowing give rate	
Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	

2		2	
3		3	
4		4	
5		5	
10		10	
15		15	
20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	
0 m	20 m	4.5 cm	

Audit Number: Z338246

Date Well Completed: February 19, 2021

Date Well Record Received by MOE: March 18, 2021

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)

Updated: January 10, 2024

Published: March 20, 2014

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .

[Go Back to Map](#)

Well ID

Well ID Number: 7382859

Well Audit Number: Z343100

Well Tag Number: A302968

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	311 Somerset St W
Township	OTTAWA CITY

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	Ottawa
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 445633.00 Northing: 5029462.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To
GREY	GRVL		DNSE	0 m	2 m

GREY	FILL		DNSE	2 m	4 m
GREY	SILT	CLAY	SOFT	4 m	10 m
GREY	CLAY		SOFT	10 m	22.5 m

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	
0 m	1 m	CONCRETE FLUSHMOUNT		
1 m	11.5 m	BENSEAL		
11.5 m	22.5 m	SAND		

Method of Construction & Well Use

Method of Construction	Well Use	
Direct Push		
	Monitoring and Test Hole	

Status of Well

Observation Wells

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	
2.047 cm	PLASTIC	0 m	12.5 m	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	
2.37 cm	PLASTIC	12.5 m	22.5 m	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was		

If pumping discontinued, give reason	
Pump intake set at	
Pumping Rate	
Duration of Pumping	
Final water level	
If flowing give rate	
Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	

2		2	
3		3	
4		4	
5		5	
10		10	
15		15	
20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	
0 m	22.5 m	4.5 cm	

Audit Number: Z343100

Date Well Completed: February 19, 2021

Date Well Record Received by MOE: March 17, 2021

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)

Updated: January 10, 2024

Published: March 20, 2014

Measurements recorded in: ☒ Metric ☐ Imperial

A302973

Tag#: A302973

ation 903 Ontario Water Resources Act

Page of

Well Owner's Information

First Name Last Name/Organization E-mail Address ☐ Well Constructed by Well Owner

Mailing Address (Street Number/Name) Municipality Province Postal Code Telephone No. (inc. area code)

Well Location

Address of Well Location (Street Number/Name) Township Lot Concession

County/District/Municipality City/Town/Village Province Postal Code

UTM Coordinates Zone Easting Northing Municipal Plan and Sublot Number Other

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From To
GRY	gravel	sand	loose	0 .31
BRN	sand	gravel	soft	.31 2.44
BRN	clay	sand	soft	2.44 3.66
GRY	clay	silt	soft, wet	3.66 11.28
GRY	silt	gravel, shale	dense	11.28 13.1

Annular Space			Results of Well Yield Testing					
Depth Set at (m/ft) From To		Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)	After test of well yield, water was: ☐ Clear and sand free ☐ Other, specify _____	Draw Down		Recovery	
0	.31	concrete/chuck mud		If pumping discontinued, give reason:	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
.31	9.75	bentonite			Static Level			
9.75	13.1	filter sand		Pump intake set at (m/ft)	1		1	
					2		2	
					3		3	

Method of Construction			Well Use		
☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial	☐ Not used	
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal	☐ Dewatering	
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☒ Test Hole	☐ Monitoring	
☐ Boring	☐ Digging	☐ Irrigation	☐ Cooling & Air Conditioning		
☒ Air percussion		☐ Industrial			
☐ Other, specify		☐ Other, specify			

Construction Record - Casing				Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From To	☐ Water Supply	☐ Replacement Well
5.20	PVC	.340	0 10.05	☒ Test Hole	☐ Recharge Well
				☐ Dewatering Well	☒ Observation and/or Monitoring Hole
				☐ Alteration (Construction)	☐ Abandoned, Insufficient Supply
				☐ Abandoned, Poor Water Quality	☐ Abandoned, other, specify
				☐ Other, specify	

Construction Record - Screen				Map of Well Location	
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From To	Please provide a map below following instructions on the back.	
6.03	PVC	10	10.05 13.1		

Water Details		Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	Depth (m/ft) From To	Diameter (cm/in)
0	13.1	11.43	

Well Contractor and Well Technician Information			
Business Name of Well Contractor	Well Contractor's Licence No.		
8749 Drilling Group	7241		
Business Address (Street Number/Name)	Municipality		
124 Ringwood Dr.	Stouffville		
Province	Postal Code	Business E-mail Address	
ON	L4A 8C1	wrecords@stouffville.com	
Bus. Telephone No. (inc. area code)	Name of Well Technician (Last Name, First Name)		
905 940 7919	McLoy, JAMES		
Well Technician's Licence No.	Signature of Technician and/or Contractor	Date Submitted	
71		Y Y Y Y M M D D	

Well owner's information package delivered		Date Package Delivered		Ministry Use Only	
☐ Yes	☐ No	Y Y Y Y M M D D	Y Y Y Y M M D D	Audit No.	2364081
		2021	0526	Received	JUN 29 2021

Well Owner's Information

First Name

Last Name/Organization
Somerset & O'Connor

E-mail Address

☐ Well Constructed by Well Owner

Mailing Address (Street Number/Name)
252 Argyle Ave

Municipality
Ottawa

Province
ON

Postal Code
K2P1B9

Telephone No. (inc. area code)

Well Location

Address of Well Location (Street Number/Name)
711 Somerset

Township

Lot

Concession

County/District/Municipality

City/Town/Village
Ottawa

Province
Ontario

Postal Code

UTM Coordinates

Zone
NAD 83

Easting
184956245029452

Northing

Municipal Plan and Sublot Number

Other

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)					
General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)	
BRN	top soil		soft	0	0.31
BRN	sand	gravel	soft	0.31	2.13
BRN	clay	sand	soft	2.13	3.66
GRY	clay	st	soft, wet	3.66	10.36
GRY	silts	gravel, shale	dense	10.36	14.33

Annular Space

Depth Set at (m/ft)
From To

Type of Sealant Used (Material and Type)

Volume Placed (m³/ft³)

0 0.31 concrete

0.31 10.97 bentonite

10.97 14.33 filter sand

Results of Well Yield Testing

After test of well yield, water was:
☐ Clear and sand free
☐ Other, specify

Draw Down

Recovery

If pumping discontinued, give reason:

Static Level

1

1

Pump intake set at (m/ft)

2

2

Pumping rate (l/min / GPM)

3

3

4

4

Duration of pumping
hrs + min

5

5

Final water level end of pumping (m/ft)

10

10

If flowing give rate (l/min/GPM)

15

15

20

20

Recommended pump depth (m/ft)

25

25

Recommended pump rate (l/min/GPM)

30

30

Well production (l/min/GPM)

40

40

50

50

60

60

Disinfected?
☐ Yes ☐ No

Method of Construction

☐ Cable Tool
☐ Rotary (Conventional)
☐ Rotary (Reverse)
☐ Boring
☐ Air percussion
☐ Other, specify

☐ Diamond
☐ Jetting
☐ Driving
☐ Digging

Well Use

☐ Public
☐ Domestic
☐ Livestock
☐ Irrigation
☐ Industrial
☐ Other, specify

☐ Commercial
☐ Municipal
☒ Test Hole
☐ Cooling & Air Conditioning

☐ Not used
☐ Dewatering
☒ Monitoring

Construction Record - Casing

Inside Diameter (cm/in)
10 PVC

Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)
390

Wall Thickness (cm/in)
0

Depth (m/ft)
From To
11.28

Status of Well

☐ Water Supply
☐ Replacement Well
☒ Test Hole
☐ Recharge Well
☐ Dewatering Well
☒ Observation and/or Monitoring Hole
☐ Alteration (Construction)
☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality
☐ Abandoned, other, specify
☐ Other, specify

Construction Record - Screen

Outside Diameter (cm/in)
6.03 PVC

Material (Plastic, Galvanized, Steel)
10

Slot No.
11.28

Depth (m/ft)
From To
14.33

Water Details

Water found at Depth (m/ft) ☐ Gas ☐ Other, specify

Kind of Water: ☐ Fresh ☐ Untested

Water found at Depth (m/ft) ☐ Gas ☐ Other, specify

Kind of Water: ☐ Fresh ☐ Untested

Water found at Depth (m/ft) ☐ Gas ☐ Other, specify

Kind of Water: ☐ Fresh ☐ Untested

Hole Diameter

Depth (m/ft)
From To

Diameter (cm/in)

0 11.28 14.33

Well Contractor and Well Technician Information

Business Name of Well Contractor
Strata Drilling Group

Well Contractor's Licence No.
7241

Business Address (Street Number/Name)
129 Ringwood Dr

Municipality
Stouffville

Province
Ont

Postal Code
L4A 8C1

Business E-mail Address
wlecord@strata-soil.com

Bus. Telephone No. (inc. area code)
905 940 7917

Name of Well Technician (Last Name, First Name)
M. C. J. Tanaka

Well Technician's Licence No.
2107

Signature of Technician and/or Contractor

Date Submitted
YY YY MM DD

Map of Well Location

Please provide a map below following instructions on the back.

20m

35m

602202

Somerset w

N

Comments:

Well owner's information package delivered
☐ Yes ☐ No

Date Package Delivered
YY YY MM DD

Date Work Completed
2021 05 25

Ministry Use Only

Audit No.
Z364138

JUN 29 2021

Received

Measurements recorded in: ☒ Metric ☐ Imperial

1302952 Tag#:A302952

Page 1 of 1

Well Owner's Information

First Name	Last Name/Organization		E-mail Address		☐ Well Constructed by Well Owner	
	Somerset & O'Connor					
Mailing Address (Street Number/Name)		Municipality	Province	Postal Code	Telephone No. (inc. area code)	
252 Argyle Ave		Ottawa	ON	K2P1B9		

Well Location

Address of Well Location (Street Number/Name) 311 Some St	Township	Lot	Concession
County/District/Municipality	City/Town/Village	Province	Postal Code

UTM Coordinates		Zone	Easting	Northings	Municipal Plan and Sublot Number	Other
NAD	83	18	495697	5029441		

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	To
GRY	gravel	skid	loose	0	31
BRN	skid	gravel	soft	31	2.74
BRN	clay	skid	soft	2.74	3.35
GRY	clay	skid	soft	3.35	11.28
GRY	skid	gravel, shale	dense	11.28	14.94

Annular Space

Depth Set at (m/ft) From To	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
0 .3)	concrete flushment	
.3) 11.58	benetone	
11.58 14.94	filter sand	

Method of Construction

☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial	☐ Not used
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☒ Municipal	☐ Dewatering
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☒ Test Hole	☒ Monitoring
☐ Boring	☐ Digging	☐ Irrigation	☐ Cooling & Air Conditioning	
☒ Air percussion		☐ Industrial		
☐ Other, specify _____		☐ Other, specify _____		

Well Use

☐ Commercial	☐ Not used
☒ Municipal	☒ Dewatering
☐ Test Hole	☒ Monitoring
☐ Cooling & Air Conditioning	

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		☐ Water Supply ☐ Replacement Well ☐ Test Hole ☐ Recharge Well ☐ Dewatering Well ☒ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned,
			From	To	
5.20	PVC	.340	0	11.89	

Status of Well

☐ Water Supply
☐ Replacement Well
☒ Test Hole
☐ Recharge Well
☐ Dewatering Well
☒ Observation and/or Monitoring Hole
☐ Alteration (Construction)
☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality
☐ Abandoned, other, specify _____
☐ Other, specify _____

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)		☐ Abandoned, poor Water Quality ☐ Abandoned, other, specify _____ ☐ Other, specify _____
			From	To	
6.03	PVC	10	11.83	14.94	


Water Details

Water found at Depth (m/ft) ☐ Gas ☐ Other, specify _____	Kind of Water: ☐ Fresh ☐ Untested	Depth (m/ft) From To	Diameter (cm/in)
Water found at Depth (m/ft) ☐ Gas ☐ Other, specify _____	Kind of Water: ☐ Fresh ☐ Untested	0 14.94	1.43
Water found at Depth (m/ft) ☐ Gas ☐ Other, specify _____	Kind of Water: ☐ Fresh ☐ Untested		

Hole Diameter

Depth (m/ft)		Diameter
From	To	(cm/in)
0	14.94	1.43

Well Contractor and Well Technician Information

Business Name of Well Contractor				Well Contractor's Licence No.			
Strata Drilling Group				7 2 4 1			
Business Address (Street Number/Name)				Municipality			
129 Ringwood Dr				Stouffville			
Province		Postal Code		Business E-mail Address			
Ont		L4A 8C1		wrecord@strataoil.com			
Bus. Telephone No. (inc. area code)				Name of Well Technician (Last Name, First Name)			
905 940 7917				McGee, JAMES			
Well Technician's Licence No.		Signature of Technician and/or Contractor		Date Submitted			
7107				Y Y Y Y M M D D			

Results of Well Yield Testing

After test of well yield, water was:	Draw Down		Recovery	
☐ Clear and sand free	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
☐ Other, specify _____	Static Level			
If pumping discontinued, give reason:	1		1	
Pump intake set at (m/ft)	2		2	
Pumping rate (l/min / GPM)	3		3	
Duration of pumping _____ hrs + _____ min	4		4	
Final water level end of pumping (m/ft)	5		5	
If flowing give rate (l/min/GPM)	10		10	
Recommended pump depth (m/ft)	15		15	
Recommended pump rate (l/min/GPM)	20		20	
Well production (l/min/GPM)	25		25	
Disinfected?	30		30	
☐ Yes ☐ No	40		40	
	50		50	
	60		60	

Map of Well Location

Please provide a map below following instructions on the back.

A hand-drawn sketch of a road intersection. A horizontal road is labeled "Somerset St W". A vertical road is labeled "B. Connor". At the intersection, there is a small circle with a dot inside, labeled "8m" and "30m".

Comments:

Well owner's information package delivered	Date Package Delivered							
	Y	Y	Y	Y	M	M	D	D
☐ Yes ☐ No	Date Work Completed							
	2	0	2	1	0	5	2	8

Ministry Use Only
Audit No. **Z364139**
JUN 24 2021
Received

All measurements recorded in: ☒ Metric ☐ Imperial

Follow instructions on the front and back of this form. Print or Type

Well Tag No. of Deepest Well: (Print Well Tag No.)

A290213
Well No. on Drawing of Deepest Well:

☐ Dewatering wells


 Test holes

No. of wells reported 1 - 21 (8)

Page 1 of 1[illegible]

Note: This Well Record for Well Cluster Part 3 - Detailed Drawing of all Well Locations, must be attached to Parts 1 and 2. The drawing must include all property boundaries, an arrow indicating the North direction, all named roads and sufficient measurements to locate all wells in the cluster in relation to fixed points. The drawing must show the location of each well and each well must be numbered on the drawing to match number used for that well on the Well Record for Well Cluster Parts 1 and 2. The well with the well tag must be clearly identified on the Drawing.
UTM coordinates should appear beside each well, if space permits. Additional comments on wells can be included on the drawing

Well Tag Number: # A290213
"Well Record for Well Cluster" Form Audit Number: # C52802

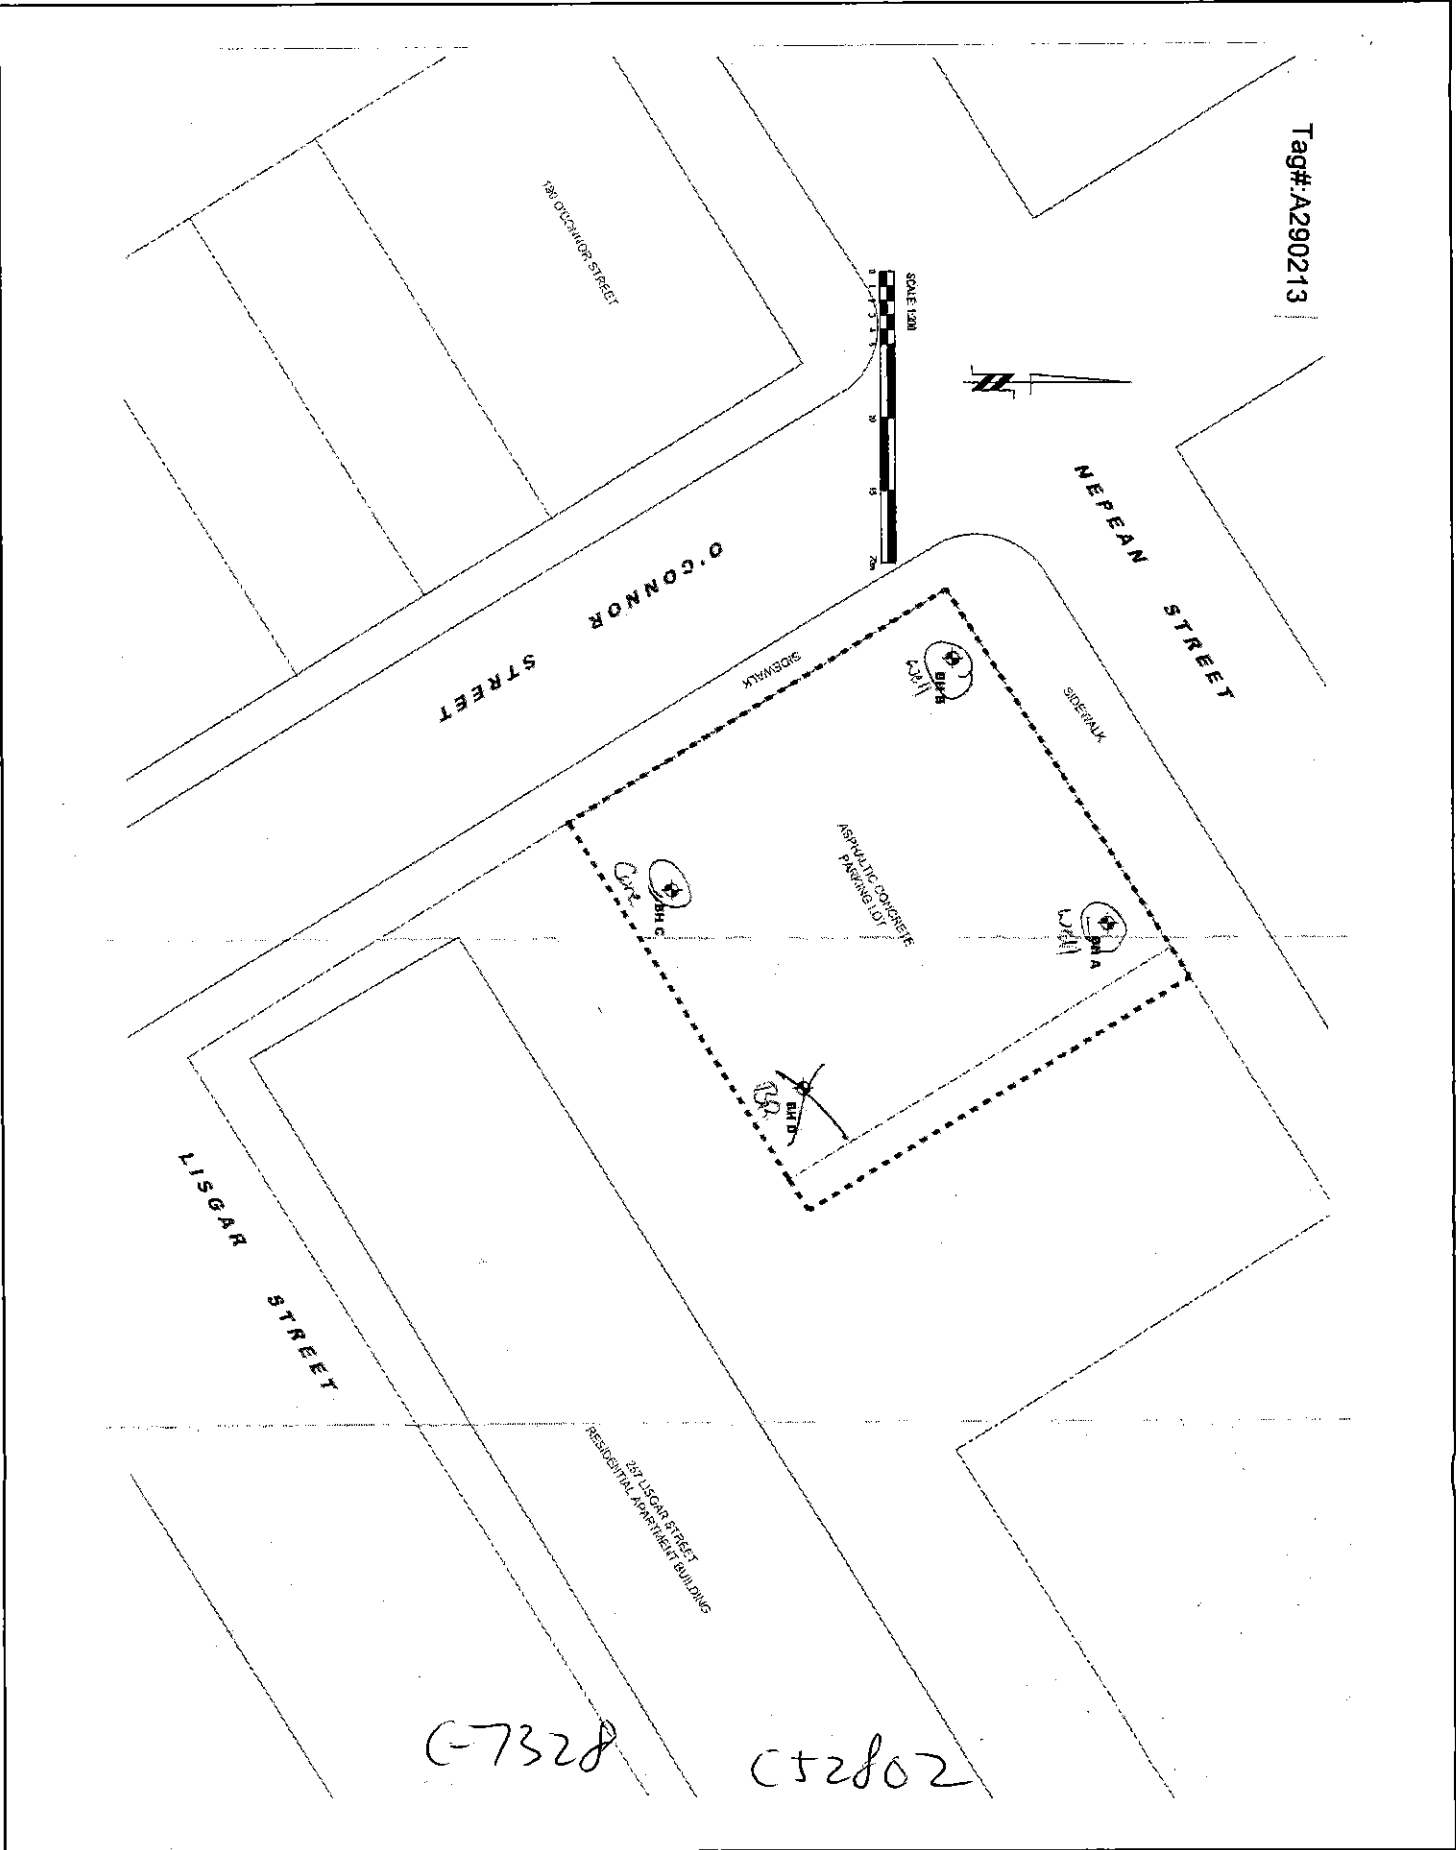

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .

[Go Back to Map](#)

Well ID

Well ID Number: 7439284

Well Audit Number: Z394366

Well Tag Number: A355544

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	
Township	NEPEAN TOWNSHIP

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 445428.00 Northing: 5029496.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	

Method of Construction & Well Use

Method of Construction	Well Use	

Status of Well

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 6964

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	

Audit Number: Z394366

Date Well Completed: December 06, 2022

Date Well Record Received by MOE: December 30, 2022

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)


Updated: January 10, 2024

Published: March 20, 2014

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7450257

Well Audit Number: Z400694

Well Tag Number: A371031

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	
Township	OTTAWA CITY

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 445315.00 Northing: 5029555.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	

Method of Construction & Well Use

Method of Construction	Well Use	

Status of Well

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	

Audit Number: Z400694

Date Well Completed: March 22, 2023

Date Well Record Received by MOE: May 01, 2023

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)

Updated: January 10, 2024

Published: March 20, 2014

RE: PE6874-Records Search Request

From Public Information Services <publicinformationsservices@tssa.org>

Date Fri 1/17/2025 9:40 AM

To Kuldeep Panchal <KPanchal@patersongroup.ca>

External Email: Do not click on links or open attachments unless you trust the sender.

NO RECORD FOUND IN CURRENT DATABASE

Hello,

Thank you for your request for confirmation of public information. TSSA has performed a preliminary search of TSSA's current database.

- We confirm that there are no records in our current database of any fuel storage tanks at the subject address(es).

This is not a confirmation that there are no records in the archives. For a further search in our archives, please go to the [TSSA Client Portal](#) to complete an Application for Release of Public Information.

Please refer to [How to Submit a Public Information Request \(tssa.org\)](#) for instructions.

The associated fee must be paid via credit card (Visa or MasterCard).

Once all steps have been successfully completed you will receive your payment receipt via email.

TSSA does not make any representations or warranties with respect to the accuracy or completeness of any records released. The requestor assumes all risk in using or relying on the information provided.

If you have any questions or concerns, please do not hesitate to contact our Public Information Release team at publicinformationsservices@tssa.org.

Kind regards,

Kimberly Gage | Public Information & Records Agent

Public Information

345 Carlingview Drive

Toronto, Ontario M9W 6N9

Tel: +1 416-734-3581 | Fax: +1 416-734-3568 | E-Mail: kgage@tssa.org

www.tssa.org





Winner of 2024 5-Star Safety Cultures Award

From: Kuldeep Panchal
<KPanchal@patersongroup.ca>

>

Sent: Friday, January 17, 2025 8:53 AM

To: Public Information Services <publicinformationservices@tssa.org>

Subject: PE6874-Records Search Request

[CAUTION]: This email originated outside the organisation.

Please do not click links or open attachments unless you recognise the source of this email and know the content is safe.

Hello,

Could you please complete a search of your records for **underground/aboveground storage tanks, historical spills, or other incidents/infractions** for the following addresses in Ottawa, Ontario:

Bank Street : 212, 223, 240, 242, 243, 248, 250

Lisgar Street: 318, 360

Nepean Street: 222

Best Regards,



KULDEEP PANCHAL

Junior Environmental Scientist

Environmental Division

TEL: (613) 226-7381 ext.103

DIRECT: (613) 701-6276

9 AURIGA DRIVE

OTTAWA ON K2E 7T9

patersongroup.ca

TEMPORARY SHORING DESIGN SERVICES ARE NOW AVAILABLE, PLEASE CONTACT US TO SEE HOW WE CAN HELP!

NEW OFFICE OPEN IN THE GREATER TORONTO AREA WITH OUR EXPANSIVE LIST OF SERVICES NOW AVAILABLE!

This electronic message and any attached documents are intended only for the named recipients. This communication from the Technical Standards and Safety Authority may contain information that is privileged, confidential or otherwise protected from disclosure and it must not be disclosed, copied, forwarded or distributed without authorization. If you have received this message in error, please notify the sender immediately and delete the original message.

Office Use Only

Application Number: _____	Ward Number: _____	Application Received: (dd/mm/yyyy): _____
Client Service Centre Staff: _____	Fee Received: \$	



Historic Land Use Inventory

Application Form

Notice of Public Record

All information and materials required in support of your application shall be made available to the public, as indicated by Section 1.0.1 of *The Planning Act*, R.S.O. 1990, C.P.13.

Municipal Freedom of Information and Protection Act

Personal information on this form is collected under the authority the *Planning Act*, RSO 1990, c. P. 13 and will be used to process this application. Questions about this collection may be directed by mail to Manager, Business and Technical Support Services, Planning, Development and Building Services Department, 110 Laurier Avenue West, Ottawa, K1P 1J1, or by phone at (613) 580-2424, ext. 52815.

Background Information

***Site Address or Location:**

240 Bank Street

**Mandatory Field*

*Applicant/Agent Information:

Company name:

Paterson Group Inc.

Contact name:

Kuldeep Panchal

Mailing Address:

9 Auriga Drive, Ottawa, Ontario, K2E 7T9

Telephone:

613-226-7381

Email Address:

kpanchal@patersongroup.ca

*Registered Property Owner Information:

☐ Same as above

Name:

240 Bank Street Holdings LTD

Mailing Address:

4950 Queen Mary Road, Suite 500, Montreal, QC, H3W 1X3

Telephone:

514-566-8826

Email Address:

edrazin@crestrealities.com

Site Details

Legal Description
and PIN:

Lot 34 (South Lisgar Street), Registered Plan 12281, City of Ottawa. PIN: 04114-0320.

What is the land
currently used for?

Commercial Building.

Lot frontage: m Lot depth: m Lot area: m²

OR Lot area: (irregular lot) m²

Does the site have Full Municipal Services: ☒ Yes ☐ No

Required Fees

Please don't hesitate to visit the [Historic Land Use Inventory website](#) more information. Fees must be paid in full at the time of application submission.

Planning Fee

\$196.00

Submittal Requirements

The following are required to be submitted with this application:

- 1. Consent to Disclose Information:** Consultants and other third parties may make requests for information on behalf of an individual or corporation. However, if the requester is not the owner of the property, **the requester must provide the City of Ottawa with a 'consent to disclose information' letter, signed by the property owner.** This will authorize the City of Ottawa to release any relevant information about the property or its owner(s) to the requester. Consent for disclosure is required in the event that personal information or proprietary company information is found concerning the property and its owner. All consents must clearly indicate the name of the property owner as well as the name of the requester, and must be signed and dated.
- 2. Disclaimer:** Requesters must read and understand the conditions included in the attached disclaimer and submit a signed disclaimer to the City of Ottawa's Planning, Development and Building Services Department. This disclaimer is related to the Historic Land Use Inventory and must be received by the City of Ottawa, signed and dated by the requestor, before the process can begin.
- 3. A site plan or key plan of the property, its location and particular features.**
- 4. Any significant dates or time frames that you would like researched.**

Disclaimer
For use with HLUI Database

CITY OF OTTAWA ("the City") is the owner of the Historical Land Use Inventory ("HLUI"), a database of information on the type and location of land uses within the geographic area of Ottawa, which had or have the potential to cause contamination in soil, groundwater or surface water.

The City, in providing information from the HLUI, to Paterson Group Inc. ("the Requester") does so only under the following conditions and understanding:

1. The HLUI may contain erroneous information given that such records and sources of information may be flawed. Changes in municipal addresses over time may have introduced error in such records and sources of information. The City is not responsible for any errors or omissions in the HLUI and reserves the right to change and update the HLUI without further notice. The City does not, however, make any commitment to update the HLUI. Accordingly, all information from the HLUI is provided on an "as is" basis with no representation or warranty by the City with respect to the information's accuracy or exhaustiveness in responding to the request.
2. City staff will perform a search of the HLUI based on the information given by the Requester. City staff will make every effort to be accurate, however, the City does not provide an assurance, guarantee, warranty, representation (express or implied), as to the availability, accuracy, completeness or currency of information which will be provided to the Requester. The HLUI in no way confirms the presence or absence of contamination or pollution of any kind. The information provided by the City to the Requester is provided on the assumption that it will not be relied upon by any person whatsoever. The City denies all liability to any such persons attempting to rely on any information provided from the HLUI database.
3. The City, its employees, servants, agents, boards, officials or contractors take no responsibility for any actions, claims, losses, liability, judgments, demands, expenses, costs, damages or harm suffered by any person whatsoever including negligence in compiling or disseminating information in the HLUI.
4. Copyright is reserved to the City.
5. Any use of the information provided from the HLUI which a third party makes, or any reliance on or decisions to be based on it, are the responsibilities of such third parties. The City, its employees, servants, agents, boards, officials or contractors accept no responsibility for any damages, if any, suffered by a third party as a result of decisions made as a result of an information search of the HLUI.
6. Any use of this service by the Requestor indicates an acknowledgement, acceptance and limits of this disclaimer.
7. All information collected under this request and all records provided in response to this request are subject to the provisions of the Municipal Freedom of Information and Protection of Privacy Act, R.S.O. 1990, c. M.56, as amended.

Signed: Kuldeep Panchal

Dated (dd/mm/yyyy): 15/01/2025

Per: Kuldeep Panchal
(Please print name)

Title: Jr. Environmental Scientist

Company: Paterson Group Inc.



DATABASE REPORT

Project Property:	<i>PE6874 - Phase I ESA 240 Bank Street Ottawa ON K2P 1X4 62156</i>
Project No:	<i>62156</i>
Report Type:	<i>Standard Report</i>
Order No:	<i>25011400345</i>
Requested by:	<i>Paterson Group Inc.</i>
Date Completed:	<i>January 14, 2025</i>

Table of Contents

Table of Contents.....	2
Executive Summary.....	3
Executive Summary: Report Summary.....	4
Executive Summary: Site Report Summary - Project Property.....	7
Executive Summary: Site Report Summary - Surrounding Properties.....	8
Executive Summary: Summary By Data Source.....	42
Map.....	83
Aerial.....	84
Topographic Map.....	85
Detail Report.....	86
Unplottable Summary.....	420
Unplottable Report.....	425
Appendix: Database Descriptions.....	461
Definitions.....	471

Notice: IMPORTANT LIMITATIONS and YOUR LIABILITY

Reliance on information in Report: This report DOES NOT replace a full Phase I Environmental Site Assessment but is solely intended to be used as a database review of environmental records.

License for use of information in Report: No page of this report can be used without this cover page, this notice and the project property identifier. The information in Report(s) may not be modified or re-sold.

Your Liability for misuse: Using this Service and/or its reports in a manner contrary to this Notice or your agreement will be in breach of copyright and contract and ERIS may obtain damages for such mis-use, including damages caused to third parties, and gives ERIS the right to terminate your account, rescind your license to any previous reports and to bar you from future use of the Service.

No warranty of Accuracy or Liability for ERIS: The information contained in this report has been produced by ERIS Information Limited Partnership ("ERIS") using various sources of information, including information provided by Federal and Provincial government departments. The report applies only to the address and up to the date specified on the cover of this report, and any alterations or deviation from this description will require a new report. This report and the data contained herein does not purport to be and does not constitute a guarantee of the accuracy of the information contained herein and does not constitute a legal opinion nor medical advice. Although ERIS has endeavored to present you with information that is accurate, ERIS disclaims, any and all liability for any errors, omissions, or inaccuracies in such information and data, whether attributable to inadvertence, negligence or otherwise, and for any consequences arising therefrom. Liability on the part of ERIS is limited to the monetary value paid for this report.

Trademark and Copyright: You may not use the ERIS trademarks or attribute any work to ERIS other than as outlined above. This Service and Report (s) are protected by copyright owned by ERIS Information Limited Partnership. Copyright in data used in the Service or Report(s) (the "Data") is owned by ERIS or its licensors. The Service, Report(s) and Data may not be copied or reproduced in whole or in any substantial part without prior written consent of ERIS.

Executive Summary

Property Information:

Project Property: PE6874 - Phase I ESA
240 Bank Street Ottawa ON K2P 1X4

Project No: 62156

Coordinates:

Latitude: 45.4164661
Longitude: -75.6976567
UTM Northing: 5,029,452.90
UTM Easting: 445,413.79
UTM Zone: 18T

Elevation: 255 FT
77.81 M

Order Information:

Order No: 25011400345
Date Requested: January 14, 2025
Requested by: Paterson Group Inc.
Report Type: Standard Report

Historical/Products:

Executive Summary: Report Summary

<i>Database</i>	<i>Name</i>	<i>Searched</i>	<i>Project Property</i>	<i>Within 0.25 km</i>	<i>Total</i>
AAGR	Abandoned Aggregate Inventory	Y	0	0	0
AGR	Aggregate Inventory	Y	0	0	0
AMIS	Abandoned Mine Information System	Y	0	0	0
ANDR	Anderson's Waste Disposal Sites	Y	0	0	0
AST	Aboveground Storage Tanks	Y	0	0	0
AUWR	Automobile Wrecking & Supplies	Y	0	0	0
BORE	Borehole	Y	0	5	5
CA	Certificates of Approval	Y	0	12	12
CDRY	Dry Cleaning Facilities	Y	0	2	2
CFOT	Commercial Fuel Oil Tanks	Y	0	0	0
CHEM	Chemical Manufacturers and Distributors	Y	0	0	0
CHM	Chemical Register	Y	0	0	0
CNG	Compressed Natural Gas Stations	Y	0	0	0
COAL	Inventory of Coal Gasification Plants and Coal Tar Sites	Y	0	0	0
CONV	Compliance and Convictions	Y	0	0	0
CPU	Certificates of Property Use	Y	0	0	0
DRL	Drill Hole Database	Y	0	0	0
DTNK	Delisted Fuel Tanks	Y	0	7	7
EASR	Environmental Activity and Sector Registry	Y	0	2	2
EBR	Environmental Registry	Y	0	1	1
ECA	Environmental Compliance Approval	Y	0	8	8
EEM	Environmental Effects Monitoring	Y	0	0	0
EHS	ERIS Historical Searches	Y	4	69	73
EIIS	Environmental Issues Inventory System	Y	0	0	0
EMHE	Emergency Management Historical Event	Y	0	0	0
EPAR	Environmental Penalty Annual Report	Y	0	0	0
EXP	List of Expired Fuels Safety Facilities	Y	0	6	6
FCON	Federal Convictions	Y	0	0	0
FCS	Contaminated Sites on Federal Land	Y	0	0	0
FOFT	Fisheries & Oceans Fuel Tanks	Y	0	0	0
FRST	Federal Identification Registry for Storage Tank Systems (FIRSTS)	Y	0	1	1
FST	Fuel Storage Tank	Y	0	0	0
FSTH	Fuel Storage Tank - Historic	Y	0	3	3
GEN	Ontario Regulation 347 Waste Generators Summary	Y	1	186	187
GHG	Greenhouse Gas Emissions from Large Facilities	Y	0	0	0
HINC	TSSA Historic Incidents	Y	0	2	2
IAFT	Indian & Northern Affairs Fuel Tanks	Y	0	0	0

Database	Name	Searched	Project Property	Within 0.25 km	Total
INC	Fuel Oil Spills and Leaks	Y	0	2	2
LIMO	Landfill Inventory Management Ontario	Y	0	0	0
MINE	Canadian Mine Locations	Y	0	0	0
MNR	Mineral Occurrences	Y	0	0	0
NATE	National Analysis of Trends in Emergencies System (NATES)	Y	0	0	0
NCPL	Non-Compliance Reports	Y	0	0	0
NDFT	National Defense & Canadian Forces Fuel Tanks	Y	0	0	0
NDSP	National Defense & Canadian Forces Spills	Y	0	0	0
NDWD	National Defence & Canadian Forces Waste Disposal Sites	Y	0	0	0
NEBI	National Energy Board Pipeline Incidents	Y	0	0	0
NEBP	National Energy Board Wells	Y	0	0	0
NEES	National Environmental Emergencies System (NEES)	Y	0	0	0
NPCB	National PCB Inventory	Y	0	5	5
NPR2	National Pollutant Release Inventory	Y	0	0	0
NPRI	National Pollutant Release Inventory - Historic	Y	0	1	1
OGWE	Oil and Gas Wells	Y	0	0	0
OOGW	Ontario Oil and Gas Wells	Y	0	1	1
OPCB	Inventory of PCB Storage Sites	Y	0	0	0
ORD	Orders	Y	0	0	0
PAP	Canadian Pulp and Paper	Y	0	0	0
PCFT	Parks Canada Fuel Storage Tanks	Y	0	0	0
PES	Pesticide Register	Y	0	12	12
PFAS	Ontario PFAS Spills	Y	0	0	0
PFCH	NPRI Reporters - PFAS Substances	Y	0	0	0
PFHA	Potential PFAS Handlers from NPRI	Y	0	0	0
PINC	Pipeline Incidents	Y	0	3	3
PPHA	Potential PFAS Handlers from EASR	Y	0	0	0
PRT	Private and Retail Fuel Storage Tanks	Y	0	4	4
PTTW	Permit to Take Water	Y	0	1	1
REC	Ontario Regulation 347 Waste Receivers Summary	Y	0	0	0
RSC	Record of Site Condition	Y	0	7	7
RST	Retail Fuel Storage Tanks	Y	0	0	0
SCT	Scott's Manufacturing Directory	Y	0	26	26
SPL	Ontario Spills	Y	0	27	27
SRDS	Wastewater Discharger Registration Database	Y	0	0	0
TANK	Anderson's Storage Tanks	Y	0	0	0
TCFT	Transport Canada Fuel Storage Tanks	Y	0	0	0
VAR	Variances for Abandonment of Underground Storage Tanks	Y	0	0	0
WDS	Waste Disposal Sites - MOE CA Inventory	Y	0	0	0
WDSH	Waste Disposal Sites - MOE 1991 Historical Approval Inventory	Y	0	0	0
WWIS	Water Well Information System	Y	0	34	34

<i>Database</i>	<i>Name</i>	<i>Searched</i>	<i>Project Property</i>	<i>Within 0.25 km</i>	<i>Total</i>
		Total:	5	427	432

Executive Summary: Site Report Summary - Project Property

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev diff (m)</i>	<i>Page Number</i>
<u>1</u>	EHS		240 Bank Street Ottawa ON K2P 1X4	-/0.0	0.00	<u>86</u>
<u>1</u>	EHS		240 Bank Street Ottawa ON K2P 1X4	-/0.0	0.00	<u>86</u>
<u>1</u>	GEN	AI's Care Pharmacy	240 Bank Street Ottawa ON K2P1X4	-/0.0	0.00	<u>86</u>
<u>1</u>	EHS		240 Bank Street Ottawa ON K2P 1X4	-/0.0	0.00	<u>87</u>
<u>1</u>	EHS		240 Bank Street Ottawa ON K2P 1X4	-/0.0	0.00	<u>87</u>

Executive Summary: Site Report Summary - Surrounding Properties

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>2</u>	SPL	PRIVATE BUSINESS	232 BANK ST STORAGE TANK OTTAWA ON K2P 1X1	N/30.5	-0.24	<u>87</u>
<u>2</u>	GEN	J Levinston Holding	212 - 232 Bank st. Ottawa ON K2P 1X1	N/30.5	-0.24	<u>88</u>
<u>3</u>	GEN	REVENUE CANADA TAXATION	CUSTOMS & EXCISE 360 LISGAR STREET OTTAWA ON K2P 2E4	WSW/47.6	0.07	<u>88</u>
<u>3</u>	GEN	REVENUE CANADA TAXATION	360 LISGAR STREET OTTAWA ON K1A 0L9	WSW/47.6	0.07	<u>89</u>
<u>3</u>	GEN	URBANALE CORPORATION	360 Lisgar Street Ottawa ON	WSW/47.6	0.07	<u>89</u>
<u>3</u>	GEN	Bell Canada	360 Lisgar st Ottawa ON K2P 2E4	WSW/47.6	0.07	<u>90</u>
<u>3</u>	GEN	Bell Canada	360 Lisgar st Ottawa ON K2P 2E4	WSW/47.6	0.07	<u>90</u>
<u>3</u>	GEN	BELLCANADA	360 LISGAR STREET OTTAWA ON K2P 2E4	WSW/47.6	0.07	<u>91</u>
<u>3</u>	GEN	Bell Canada	360 Lisgar st Ottawa ON K2P 2E4	WSW/47.6	0.07	<u>91</u>
<u>4</u>	EHS		251 Bank Street Ottawa ON K2P 1X3	ESE/49.4	-0.93	<u>93</u>
<u>5</u>	SCT	WALLACK'S ART & DRAFTING	231 BANK ST OTTAWA ON K2P 1W9	N/56.0	-0.23	<u>93</u>
<u>6</u>	GEN	BICYCLE REVIVAL LTD.	224 BANK STREET OTTAWA ON K2P 1X1	NNW/57.9	0.07	<u>93</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>6</u>	GEN	BICYCLE REVIVAL LTD. 04-341	224 BANK STREET OTTAWA ON K2P 1X1	NNW/57.9	0.07	<u>94</u>
<u>6</u>	GEN	BICYCLE REVIVAL LIMITED	224 BANK STREET OTTAWA ON K2P 1X1	NNW/57.9	0.07	<u>94</u>
<u>7</u>	GEN	FOCUS CENTRE, THE	254 BANK STREET OTTAWA ON K2P 1X4	SE/59.2	-0.93	<u>94</u>
<u>7</u>	GEN	Easy Drain Plumbing	254 Bank Str Ottawa ON	SE/59.2	-0.93	<u>95</u>
<u>8</u>	SCT	COOKWARE CENTRE (THE)	220 BANK ST OTTAWA ON K2P 1X1	NNW/59.8	0.07	<u>95</u>
<u>9</u>	EHS		251-259 Bank Street (395-397 Cooper St) Ottawa ON	ESE/67.9	-0.93	<u>95</u>
<u>9</u>	SCT	Capital Xtra - Div. of Pink	251 Bank St Unit 503 Ottawa ON K2P 1X3	ESE/67.9	-0.93	<u>96</u>
<u>9</u>	SCT	McKenzie Publishing Inc.	251A Bank St Suite 500 Ottawa ON K2P 1X3	ESE/67.9	-0.93	<u>96</u>
<u>9</u>	SCT	Akiva Publishing Inc.	251 Bank St Suite 206 Ottawa ON K2P 1X3	ESE/67.9	-0.93	<u>96</u>
<u>9</u>	EHS		251 Bank Street Ottawa ON	ESE/67.9	-0.93	<u>96</u>
<u>9</u>	EHS		251 Bank St Ottawa ON K2P1X3	ESE/67.9	-0.93	<u>97</u>
<u>10</u>	INC		212 Bank Street , Ottawa ON	NNW/71.1	0.07	<u>97</u>
<u>11</u>	GEN	DEPARTMENT OF NATIONAL DEFENCE	VANIER BUILDING 222 NEPEAN STREET OTTAWA ON K2B 0B8	WNW/73.6	0.07	<u>98</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>11</u>	GEN	DEPT OF NATIONAL DEFENCE, CDN. FORCES	VANIER BUILDING 222 NEPEAN STREET OTTAWA ON K2B 0B8	WNW/73.6	0.07	<u>98</u>
<u>11</u>	GEN	DEPT. OF NATIONAL DEFENCE	VANIER BUILDING 222 NEPEAN STREET OTTAWA ON K2B 0B8	WNW/73.6	0.07	<u>98</u>
<u>11</u>	EHS		222 Nepean Street Ottawa ON K2P 0B8	WNW/73.6	0.07	<u>99</u>
<u>11</u>	SPL		222 Nepean Street, Ottawa Ottawa ON	WNW/73.6	0.07	<u>99</u>
<u>11</u>	GEN	Bona Building Management	222 Nepean St Ottawa ON K1R5G2	WNW/73.6	0.07	<u>100</u>
<u>12</u>	CA	OTTAWA CITY	COOPER ST./BANK ST. OTTAWA CITY ON	ESE/75.1	-0.93	<u>101</u>
<u>12</u>	CA	R.M. OF OTTAWA-CARLETON	COOPER ST./BANK ST. OTTAWA CITY ON	ESE/75.1	-0.93	<u>101</u>
<u>13</u>	RSC	Youth Services Bureau of Ottawa	433 COOPER ST/366 LISGAR STREET, OTTAWA OTTAWA ON	SW/77.0	0.07	<u>101</u>
<u>14</u>	SCT	Canadian Bible Society	315 Lisgar St Ottawa ON K2P 0E1	NE/79.7	-0.93	<u>102</u>
<u>15</u>	EHS		178 Nepean, 219 & 223 Bank Ottawa ON K2P 1W9	N/85.7	-1.10	<u>102</u>
<u>16</u>	SCT	Canus Plastics Inc.	300 Lisgar St Ottawa ON K2P 0E2	ENE/85.8	-0.93	<u>102</u>
<u>16</u>	SCT	Canus Signs Plastics Ltd.	300 Lisgar St Ottawa ON K2P 0E2	ENE/85.8	-0.93	<u>103</u>
<u>16</u>	EHS		300 Lisgar Street Ottawa ON K2P 0E2	ENE/85.8	-0.93	<u>103</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>16</u>	RSC	Soho Lisgar Inc.	300 Lisgar Street, Ottawa, Ontario, K2P 1T6 OTTAWA ON	ENE/85.8	-0.93	<u>103</u>
<u>17</u>	GEN	DRAICCHIO'S TAILORING & CLEANING	272 BANK STREET OTTAWA ON K2P 1X6	SE/92.7	-0.93	<u>104</u>
<u>17</u>	GEN	DRAICCHIO'S TAILORING & CLEANING 12-549	272 BANK STREET OTTAWA ON K2P 1X6	SE/92.7	-0.93	<u>104</u>
<u>17</u>	GEN	DRAICCHIO'S TAILORING & CLEANING	272 BANK STREET OTTAWA ON K2P 1X6	SE/92.7	-0.93	<u>105</u>
<u>17</u>	GEN	DRAICCHIO'S TAILORING & CLEANING	272 BANK STREET OTTAWA ON K2P 1X6	SE/92.7	-0.93	<u>105</u>
<u>17</u>	GEN	DRAICCHIO'S TAILORING & CLEANING	272 BANK STREET OTTAWA ON K2P 1X6	SE/92.7	-0.93	<u>105</u>
<u>17</u>	GEN	DRAICCHIO'S TAILORING & CLEANING	272 BANK STREET OTTAWA ON K2P 1X6	SE/92.7	-0.93	<u>106</u>
<u>17</u>	GEN	7695713 canada inc.	272 BANK ST OTTAWA ON	SE/92.7	-0.93	<u>106</u>
<u>17</u>	GEN	7695713 canada inc.	272 BANK ST OTTAWA ON	SE/92.7	-0.93	<u>106</u>
<u>17</u>	GEN	7695713 canada inc.	272 BANK ST OTTAWA ON K2P1X6	SE/92.7	-0.93	<u>107</u>
<u>17</u>	GEN	7695713 canada inc.	272 BANK ST OTTAWA ON K2P1X6	SE/92.7	-0.93	<u>107</u>
<u>17</u>	GEN	7695713 canada inc.	272 BANK ST OTTAWA ON K2P1X6	SE/92.7	-0.93	<u>107</u>
<u>17</u>	GEN	7695713 canada inc.	272 BANK ST OTTAWA ON K2P1X6	SE/92.7	-0.93	<u>108</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>17</u>	CDRY	Draicchio's Tailoring&Cleaning	272 Bank St Ottawa ON K2P1X6	SE/92.7	-0.93	<u>108</u>
<u>17</u>	CDRY	Downtown Cobler	272 Bank St Ottawa ON K2P1X6	SE/92.7	-0.93	<u>108</u>
<u>17</u>	GEN	7695713 canada inc.	272 BANK ST OTTAWA ON K2P1X6	SE/92.7	-0.93	<u>109</u>
<u>17</u>	GEN	DOWNTOWN COBBLER DOWNTOWN COBBLER	272 BANK ST OTTAWA ON k2p1x6	SE/92.7	-0.93	<u>109</u>
<u>17</u>	GEN	Downtown Tailoring	272 BANK ST OTTAWA ON K2P 1X6	SE/92.7	-0.93	<u>109</u>
<u>18</u>	EHS		437 Cooper Street Ottawa ON K2P 0H1	SW/92.7	0.07	<u>112</u>
<u>19</u>	BORE		ON	E/97.5	-0.93	<u>113</u>
<u>20</u>	SPL	Enbridge Gas Distribution Inc.	Bank St and Nepean St Ottawa ON	NNW/100.1	0.07	<u>115</u>
<u>21</u>	GEN	Canus Plastics Inc.	300 Lisgar St. Ottawa ON	ENE/105.0	-0.93	<u>115</u>
<u>21</u>	GEN	Bassi Construction	300 lisgar st ottawa ON K2P 0E2	ENE/105.0	-0.93	<u>116</u>
<u>22</u>	GEN	GLASER PHARMACY LTD.	267 BANK STREET OTTAWA ON K2P 1X3	ESE/105.4	-0.93	<u>116</u>
<u>23</u>	GEN	COOPER PHARMACY INC SWIFT COMPOUNDING PHARMACY	276 BANK ST OTTAWA ON K2P 1X6	SE/107.6	-0.93	<u>117</u>
<u>23</u>	GEN	COOPER PHARMACY INC SWIFT COMPOUNDING PHARMACY	276 BANK ST OTTAWA ON K2P 1X6	SE/107.6	-0.93	<u>117</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
23	GEN	COOPER PHARMACY INC	276 BANK ST OTTAWA ON K2P 1X6	SE/107.6	-0.93	117
24	EHS		379 Cooper Street Ottawa ON K2P 0G8	E/110.1	-0.93	119
24	EHS		379 Cooper Street Ottawa ON K2P 0G8	E/110.1	-0.93	119
25	EHS		309 Lisgar Avenue Ottawa ON	NE/110.3	-0.93	119
26	GEN	BAYVIEW PROPERTY MANAGEMENT	210 BANK STREET OTTAWA ON K2P 1W8	NW/114.9	0.07	119
27	EHS		226 Nepean St Ottawa ON K2P0B8	W/116.2	0.07	120
28	EHS		300 Lisgar St and 375 Cooper St Ottawa ON	ENE/118.6	-0.93	120
29	WWIS		ON <i>Well ID:</i> 7296899	NNE/120.1	-0.95	120
30	EHS		177 Nepean St Ottawa ON K2P 1W7	N/120.8	-0.47	121
31	EHS		PE3651 - 293 Lisgar Street & 176 Nepean Street Ottawa ON K2P 0B6	NE/121.1	-0.93	121
32	EHS		205 Bank Street Ottawa ON K2P 1W7	NNW/121.2	0.07	121
33	SCT	The Ottawa Xpress	396 Cooper St Suite 204 Ottawa ON K2P 2H7	ESE/122.7	-0.93	122
33	SCT	The Ottawa X Press - Div. of Communications Voir Inc.	396 Cooper St Suite 204 Ottawa ON K2P 2H7	ESE/122.7	-0.93	122

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>33</u>	SCT	Communications Voir Inc.	396 Cooper St Suite 204 Ottawa ON K2P 2H7	ESE/122.7	-0.93	<u>122</u>
<u>33</u>	SCT	Communications Voir Inc.	396 Cooper St Suite 204 Ottawa ON K2P 2H7	ESE/122.7	-0.93	<u>122</u>
<u>33</u>	SCT	Ottawa X Press	396 Cooper St Suite 204 Ottawa ON K2P 2H7	ESE/122.7	-0.93	<u>123</u>
<u>33</u>	SCT	Imagnan Corp.	396 Cooper St Suite 203 Ottawa ON K2P 2H7	ESE/122.7	-0.93	<u>123</u>
<u>34</u>	EHS		203 Bank St Ottawa ON K2P1W7	N/124.5	0.07	<u>123</u>
<u>35</u>	EHS		215 Nepean St Ottawa ON K2P2K5	WNW/125.7	0.07	<u>123</u>
<u>36</u>	SCT	CAPITAL XTRA INC.	177 NEPEAN ST SUITE 500 OTTAWA ON K2P 0B4	N/125.9	0.07	<u>123</u>
<u>36</u>	SPL	PRIVATE RESIDENCE	177 NIPEON STREET FURNACE OIL TANK OTTAWA CITY ON	N/125.9	0.07	<u>124</u>
<u>36</u>	GEN	District Realty Corporation	177 Nepean Street Ottawa ON K2P 0B4	N/125.9	0.07	<u>125</u>
<u>36</u>	CA	Mel Cohen Realty Ltd.	177 Nepean Street Ottawa ON	N/125.9	0.07	<u>125</u>
<u>36</u>	ECA	Mel Cohen Realty Ltd.	177 Nepean Street Ottawa ON K1Y 2E9	N/125.9	0.07	<u>125</u>
<u>37</u>	WWIS		355 COOPER ST OTTAWA ON Well ID: 7305580	ENE/126.4	-0.93	<u>126</u>
<u>38</u>	EHS		275 Bank St Ottawa ON K2P2L6	ESE/127.2	-0.93	<u>129</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>39</u>	GEN	Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S/127.5	0.07	<u>129</u>
<u>39</u>	GEN	Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S/127.5	0.07	<u>129</u>
<u>39</u>	GEN	Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S/127.5	0.07	<u>130</u>
<u>39</u>	GEN	Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON	S/127.5	0.07	<u>130</u>
<u>39</u>	GEN	Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S/127.5	0.07	<u>131</u>
<u>39</u>	GEN	Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S/127.5	0.07	<u>131</u>
<u>39</u>	GEN	Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S/127.5	0.07	<u>132</u>
<u>39</u>	GEN	Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S/127.5	0.07	<u>132</u>
<u>39</u>	GEN	Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S/127.5	0.07	<u>132</u>
<u>39</u>	GEN	Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S/127.5	0.07	<u>133</u>
<u>39</u>	GEN	Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S/127.5	0.07	<u>133</u>
<u>40</u>	GEN	GVT. OF CAN. - R.C.M.P.	OTTAWA A DIVISION, DRUG SECTION 400 COOPER STREET OTTAWA ON K1A 0R4	S/131.1	0.07	<u>137</u>
<u>40</u>	GEN	GVT. OF CAN. - R.C.M.P. 18-132	OTTAWA A DIVISION, DRUG SECTION 400 COOPER STREET OTTAWA ON K1A 0R4	S/131.1	0.07	<u>138</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
40	EHS		400 Cooper Street Ottawa ON K2P 2H8	S/131.1	0.07	138
40	EHS		400 Cooper Street, Ottawa ON K2P 2H8	S/131.1	0.07	138
40	EHS		400 Cooper Street Ottawa ON K2P 2N1	S/131.1	0.07	139
40	GEN	400 Cooper Building Inc.	400 Cooper Street Ottawa ON K2P 2H8	S/131.1	0.07	139
40	EHS		400 Cooper Street Ottawa ON K2P 2N1	S/131.1	0.07	139
41	GEN	E.A.S. ILLUSTRATORS & PRINTERS LTD	171 NEPEAN ST. OTTAWA ON K2P 0B4	N/131.9	-0.95	139
41	GEN	E.A.S. ILLUSTRATORS & PRINTERS LTD14-740	171 NEPEAN ST. OTTAWA ON K2P 0B4	N/131.9	-0.95	140
41	GEN	E.A.S. (OUT OF BUS) 14-740	171 NEPEAN ST. OTTAWA ON K2P 0B4	N/131.9	-0.95	140
41	GEN	ARMCO PRINT 02-638	171 NEPEAN STREET OTTAWA ON K2P 0B4	N/131.9	-0.95	141
41	GEN	ARMCO PRINT 02-638	171 NEPEAN STREET OTTAWA ON K2P 0B4	N/131.9	-0.95	141
42	WWIS		355 COOPER ST OTTAWA ON <i>Well ID: 7305582</i>	ENE/133.1	-0.93	141
43	EHS		275 Bank Street Ottawa ON K2P 2L6	SE/133.2	-0.93	144
44	WWIS		355 COOPER ST OTTAWA ON	ENE/133.4	-0.90	145

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
Well ID: 7305579						
<u>45</u>	GEN	Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON K2P 0K1	SSE/134.3	0.16	<u>148</u>
<u>45</u>	GEN	Dedicated National Pharmacy (In Receivership)	401 Somerset St West Ottawa ON K2P 0K1	SSE/134.3	0.16	<u>148</u>
<u>45</u>	GEN	Dedicated National Pharmacy (In Receivership)	401 Somerset St West Ottawa ON K2P 0K1	SSE/134.3	0.16	<u>148</u>
<u>45</u>	GEN	Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON K2P 0K1	SSE/134.3	0.16	<u>149</u>
<u>45</u>	GEN	Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON K2P 0K1	SSE/134.3	0.16	<u>149</u>
<u>45</u>	GEN	Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON	SSE/134.3	0.16	<u>149</u>
<u>45</u>	GEN	Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON K2P0K1	SSE/134.3	0.16	<u>150</u>
<u>45</u>	GEN	Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON K2P0K1	SSE/134.3	0.16	<u>150</u>
<u>45</u>	GEN	Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON K2P0K1	SSE/134.3	0.16	<u>151</u>
<u>45</u>	GEN	Canadian Addiction Treatment Clinics LP	401 Somerset Street, West Ottawa ON K2P0K1	SSE/134.3	0.16	<u>151</u>
<u>45</u>	GEN	Canadian Addiction Treatment Clinics LP	401 Somerset Street, West Ottawa ON K2P0K1	SSE/134.3	0.16	<u>151</u>
<u>45</u>	GEN	Canadian Addiction Treatment Clinics LP	401 Somerset Street, West Ottawa ON K2P0K1	SSE/134.3	0.16	<u>152</u>
<u>46</u>	SPL	OTTAWA HYDRO	375 COOPER STREET TRANSFORMER OTTAWA CITY ON K2P 0G8	E/134.3	-0.90	<u>154</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
46	EHS		375 Cooper Street Ottawa ON K2P 0G8	E/134.3	-0.90	154
47	SCT	JacintalInk	207 Bank St Suite 242 Ottawa ON K2P 2N2	N/137.5	-0.47	155
47	SCT	To Be Publications Inc.	207 Bank St Ottawa ON K2P 2N2	N/137.5	-0.47	155
48	BORE		ON	WSW/139.1	0.07	155
49	NPCB	SEALTEST	DIVISION OF AULT FOODS; 453 COOPER STREET OTTAWA ON K2P 0H1	SW/142.5	0.07	157
49	SPL	AULT FOODS	453 COOPER STREET OTTAWA WINCHESTER 490 GORDON STREET OTTAWA CITY ON K2P 0H1	SW/142.5	0.07	157
49	SPL	AULT FOODS	453 COOPER ST.AT KENT ST. OTTAWA OTTAWA DAIRY OTTAWA CITY ON K2P 0H1	SW/142.5	0.07	158
49	GEN	AULT FOODS LIMITED	453 COOPER STREET OTTAWA ON K2P 0H1	SW/142.5	0.07	159
49	GEN	AULT FOODS LIMITED	453 COOPER STREET OTTAWA ON K2P 0H1	SW/142.5	0.07	159
49	GEN	AULT FOODS LIMITE(OUT OF BUSINESS)03-320	453 COOPER STREET OTTAWA ON K2P 0H1	SW/142.5	0.07	160
49	EHS		453 Cooper Street Ottawa ON K2P 0H1	SW/142.5	0.07	160
50	WWIS		195 BANK ST. OTTAWA ON <i>Well ID: 7246053</i>	NNW/145.1	0.07	161
51	WWIS		ON	NW/145.2	0.07	163

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			Well ID: 1503876			
52	BORE		ON	NW/145.4	0.07	166
53	SCT	Biz Point Inc.	273 Bank St Ottawa ON K2P 1X5	ESE/146.0	-0.93	167
54	GEN	OTTAWA COMMUNITY HOUSING CORPORATION	395 SOMERSET STREET OTTAWA ON	S/146.3	0.07	167
54	GEN	Black & McDonald Ltd.	395 Somerset Ottawa ON K2L 4X8	S/146.3	0.07	167
55	WWIS		315 COOPER ST Ottawa ON Well ID: 7312996	E/146.9	-1.62	169
56	BORE		ON	SW/154.9	0.07	172
57	GEN	OTTAWA MAGAZINE INC.	192 BANK STREET OTTAWA ON K2P 1W8	NW/154.9	0.07	173
57	GEN	OTTAWA MAGAZINE INC.	192 BANK STREET OTTAWA ON K2P 1W8	NW/154.9	0.07	173
57	GEN	OTTAWA MAGAZINE INC. 29-278	192 BANK STREET OTTAWA ON K2P 1W8	NW/154.9	0.07	174
57	GEN	OTTAWA MAGAZINE INCORPORATED	192 BANK STREET OTTAWA ON K2P 1W8	NW/154.9	0.07	174
57	GEN	OTTAWA(SEE&USE ON0897800 OTTAWA)	192 BANK STREET OTTAWA ON K2P 1W8	NW/154.9	0.07	174
57	GEN	OTTAWA(SEE&USE ON0897800 OTTAWA) 29-290	192 BANK STREET OTTAWA ON K2P 1W8	NW/154.9	0.07	175
57	SCT	Cdn Council Tobacco Control	192 Bank St Ottawa ON K2P 1W8	NW/154.9	0.07	175

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
58	EHS		153 Nepean Street Ottawa ON K2P 0B5	NNE/156.4	-0.93	175
59	WWIS		355 COOPER ST OTTAWA ON <i>Well ID:</i> 7305581	ENE/156.8	-0.90	175
60	OOGW	Ottawa Dairy Well	Nepean ON <i>Licence No:</i> F019784	SE/157.1	-0.93	178
61	GEN	MCEVOY-SHIELDS FUNERAL HOMES LTD.	235 KENT STREET OTTAWA ON K2P 1Z9	W/157.4	0.07	180
61	GEN	MCEVOY-SHIELDS FUNERAL HOMES LTD. 44-472	235 KENT STREET OTTAWA ON K2P 1Z9	W/157.4	0.07	181
61	GEN	Service Corporation International Canada	235 Kent Street Ottawa ON K2P 1Z9	W/157.4	0.07	181
61	GEN	Charlesfort Development Corporation	235 Kent Street Ottawa ON K2P 1Z9	W/157.4	0.07	181
62	EHS		287 Lisgar Street Ottawa ON	NE/157.6	-0.93	182
63	GEN	Claridge Homes Corporation	287 Lisgar Ottawa ON	NE/157.6	-0.93	182
63	GEN	CLARIDGE HOMES (CENTRETOWN) INC.	287 LISGAR STREET OTTAWA ON	NE/157.6	-0.93	182
63	PTTW	Claridge Homes (287 Lisgar) Inc.	287 Lisgar Street City of Ottawa, Ontario CITY OF OTTAWA ON	NE/157.6	-0.93	183
63	GEN	Claridge Homes Limited Partnership	287 Lisgar Street Ottawa ON K2P 0E1	NE/157.6	-0.93	183
63	GEN	Claridge Homes	287 Lisgar Street Ottawa ON K2P 0E1	NE/157.6	-0.93	183

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>63</u>	RSC	CLARIDGE HOMES (287 LISGAR) INC.	287 LISGAR STREET ON Ottawa ON	NE/157.6	-0.93	<u>184</u>
<u>63</u>	SPL	Claridge Homes (Carson) Inc.	287 Lisgar Avenue Ottawa ON K2P 1K8	NE/157.6	-0.93	<u>185</u>
<u>64</u>	ECA	City of Ottawa	Ottawa ON K2G 6J8	ENE/160.0	-0.89	<u>186</u>
<u>64</u>	ECA	City of Ottawa	Laurier Avenue at the Rideau Canal Ottawa ON K1P 1J1	ENE/160.0	-0.89	<u>186</u>
<u>65</u>	SPL		239 Nepean St OTTAWA ON	W/163.6	0.16	<u>186</u>
<u>66</u>	EHS		Nepean Street Ottawa ON K2P 0B6	NE/164.4	-0.93	<u>187</u>
<u>67</u>	WWIS		KENT ST Ottawa ON <i>Well ID:</i> 7344656	WSW/164.8	-0.01	<u>187</u>
<u>68</u>	WWIS		281 kent st Ottawa ON <i>Well ID:</i> 7354243	SW/167.0	1.07	<u>189</u>
<u>69</u>	GEN	City of Ottawa	210 Gloucester Ottawa ON K2P 2K4	NW/167.0	-0.24	<u>193</u>
<u>69</u>	GEN	City of Ottawa	210 Gloucester Ottawa ON K2P 2K4	NW/167.0	-0.24	<u>193</u>
<u>69</u>	GEN	City of Ottawa	210 Gloucester Ottawa ON K2P 2K4	NW/167.0	-0.24	<u>193</u>
<u>69</u>	GEN	City of Ottawa Parks, Bldg & Grounds Services Branch	210 Gloucester Ottawa ON K2P 2K4	NW/167.0	-0.24	<u>194</u>
<u>69</u>	GEN	City of Ottawa Parks, Bldg & Grounds Services Branch	210 Gloucester Ottawa ON K2P 2K4	NW/167.0	-0.24	<u>194</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>69</u>	GEN	City of Ottawa Parks, Bldg & Grounds Services Branch	210 Gloucester Ottawa ON K2P 2K4	NW/167.0	-0.24	<u>195</u>
<u>69</u>	GEN	City of Ottawa	210 Gloucester Ottawa ON K2P 2K4	NW/167.0	-0.24	<u>195</u>
<u>70</u>	SCT	KOFFMAN SIGNS	146 NEPEAN ST OTTAWA ON K2P 0B6	NE/168.1	-0.93	<u>197</u>
<u>70</u>	SCT	Koffman Signs Ltd.	146 Nepean St Ottawa ON K2P 0B6	NE/168.1	-0.93	<u>198</u>
<u>70</u>	GEN	Marilena Guerra	146 Nepean Street Ottawa ON	NE/168.1	-0.93	<u>198</u>
<u>71</u>	EHS		343 Somerset Street West Ottawa ON	ESE/168.2	-1.38	<u>198</u>
<u>72</u>	EHS		170 Gloucester Street Ottawa ON K2P 0A6	N/168.3	0.07	<u>198</u>
<u>73</u>	EHS		355 Cooper St Ottawa ON K2P0G8	ENE/168.3	-1.62	<u>199</u>
<u>74</u>	WWIS		SOMERSET ROADWAY OTTAWA ON Well ID: 1535586	ESE/168.6	-0.82	<u>199</u>
<u>75</u>	SCT	O'Brien Publishing Inc.	176 Gloucester St Suite 400 Ottawa ON K2P 0A6	NNW/172.4	0.07	<u>201</u>
<u>75</u>	EHS		176 Gloucester St Ottawa ON K2P0A6	NNW/172.4	0.07	<u>202</u>
<u>76</u>	EHS		PE4776 - 352 Somerset Street West Ottawa ON K2P 0J9	SE/175.0	-0.93	<u>202</u>
<u>77</u>	GEN	HUDSON PARK CONDOS	245 KENT STREET OTTAWA ON K2P 0A5	W/176.6	0.07	<u>202</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
77	RSC	Charlesfort Development Corporation	235 and 245 Kent Street, Ottawa, Ontario, K2P 1Z9 OTTAWA ON	W/176.6	0.07	202
78	EHS		281 Kent Street Ottawa ON K2P 2H8	SW/177.2	1.07	203
79	GEN	Regional Group	152 Gloucester St Ottawa ON K2P 0A6	NNE/179.8	-0.96	203
80	PINC	ENBRIDGE GAS INC	142 NEPEAN ST.,OTTAWA,ON,K2P 2N2, CA ON	NE/180.4	-0.93	204
81	EHS		352/348/346 Somerset & 349 MacLaren Ottawa ON	ESE/182.1	-0.93	205
82	CA	ALLAN KWAI	331 SOMERSET ST. W., SWM OTTAWA CITY ON K2P 0J8	E/186.3	-1.93	205
83	WWIS		296 BANK ST. OTTAWA ON Well ID: 7246842	SE/186.4	-0.93	205
83	WWIS		296 BANK ST. OTTAWA ON Well ID: 7246843	SE/186.4	-0.93	208
84	WWIS		281 kent st Ottawa ON Well ID: 7354245	SW/187.4	1.07	211
85	SPL	TRANSPORT TRUCK	KENT ST & COOPER ST. MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON	SW/188.0	1.07	214
86	PRT	SOMERSET SUNOCO	429 SOMERSET ST OTTAWA ON K2P0K1	SSW/189.0	0.01	215
86	GEN	CLARRIDGE HOMES	419-429 SOMERSET STREET OTTAWA ON K2P 2P5	SSW/189.0	0.01	215
86	GEN	Clarridge Homes	419-429 SOMERSET ST. OTTAWA ON K1N 6W8	SSW/189.0	0.01	216

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>86</u>	DTNK	SAVEWAY GAS & FUELS LTD	429 SOMERSET ST W OTTAWA ON K2P 0K1	SSW/189.0	0.01	<u>216</u>
<u>86</u>	DTNK	MARK TAZA	429 SOMERSET ST W OTTAWA ON K2P 0K1	SSW/189.0	0.01	<u>217</u>
<u>86</u>	DTNK	MARK TAZA	429 SOMERSET ST W OTTAWA ON	SSW/189.0	0.01	<u>217</u>
<u>86</u>	EXP	MARK TAZA	429 SOMERSET ST W OTTAWA ON	SSW/189.0	0.01	<u>218</u>
<u>86</u>	EXP	MARK TAZA	429 SOMERSET ST W OTTAWA ON	SSW/189.0	0.01	<u>218</u>
<u>87</u>	WWIS		355 COOPER ST Ottawa ON Well ID: 7312995	ENE/189.6	-1.61	<u>218</u>
<u>88</u>	EHS		186 Bank St Ottawa ON K2P1W6	NW/193.5	-0.23	<u>221</u>
<u>89</u>	EHS		230 Gloucester St Ottawa ON K2P0A9	WNW/194.6	-0.93	<u>222</u>
<u>90</u>	EHS		327 Somerset St W Ottawa ON K2P0J8	E/195.0	-1.93	<u>222</u>
<u>91</u>	WWIS		81 kent st Ottawa ON Well ID: 7354244	SW/195.3	1.07	<u>222</u>
<u>92</u>	PES	HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK STREET OTTAWA ON K2P 1X8	SE/197.4	-0.93	<u>225</u>
<u>92</u>	PES	HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK STREET OTTAWA ON K2P 1X8	SE/197.4	-0.93	<u>226</u>
<u>92</u>	PES	HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P 1X8	SE/197.4	-0.93	<u>226</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>92</u>	PES	HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P 1X8	SE/197.4	-0.93	<u>226</u>
<u>92</u>	SPL	Parson Refrigeration (1985) Ltd.	296 Bank St. Ottawa ON K2P 1X8	SE/197.4	-0.93	<u>227</u>
<u>92</u>	CA	Bank and Somerset Holdings Limited	296 Bank Street Ottawa ON K2P 1X8	SE/197.4	-0.93	<u>228</u>
<u>92</u>	PES	HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P 1X8	SE/197.4	-0.93	<u>228</u>
<u>92</u>	SPL	Parson Refrigeration (1985) Ltd.	296 Bank St Ottawa ON	SE/197.4	-0.93	<u>228</u>
<u>92</u>	EHS		296 Bank St Ottawa ON K2P1X8	SE/197.4	-0.93	<u>229</u>
<u>92</u>	PES	MASSINE ENTERPRISES INC. O/A MASSINE'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P1X8	SE/197.4	-0.93	<u>229</u>
<u>92</u>	PES	LOBLAWS INC O/A BANK STREET YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P1X8	SE/197.4	-0.93	<u>230</u>
<u>92</u>	PES	HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P1X8	SE/197.4	-0.93	<u>230</u>
<u>92</u>	ECA	Bank and Somerset Holdings Limited	296 Bank Street Ottawa ON K2P 1X8	SE/197.4	-0.93	<u>230</u>
<u>92</u>	GEN	Loblaw Companies Limited	296 Bank St. Ottawa ON K2P 1X8	SE/197.4	-0.93	<u>231</u>
<u>92</u>	GEN	Loblaw Companies Limited	296 Bank St. Ottawa ON K2P 1X8	SE/197.4	-0.93	<u>231</u>
<u>92</u>	GEN	LOBLAWS INC.	296 Bank St. Ottawa ON K2P 1X8	SE/197.4	-0.93	<u>231</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>92</u>	PES	HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P1X8	SE/197.4	-0.93	<u>232</u>
<u>92</u>	PES	HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P1X8	SE/197.4	-0.93	<u>232</u>
<u>92</u>	GEN	LOBLAWS INC.	296 Bank St. Ottawa ON K2P 1X8	SE/197.4	-0.93	<u>233</u>
<u>92</u>	GEN	LOBLAWS INC.	296 Bank St. Ottawa ON K2P 1X8	SE/197.4	-0.93	<u>233</u>
<u>92</u>	GEN	LOBLAWS INC.	296 Bank St. Ottawa ON K2P 1X8	SE/197.4	-0.93	<u>234</u>
<u>92</u>	SPL	296 Bank Street	296 Bank Street OTTAWA ON	SE/197.4	-0.93	<u>237</u>
<u>92</u>	SPL		296 Bank Street, Ottawa ON	SE/197.4	-0.93	<u>238</u>
<u>93</u>	EHS		380 &386 Somerset St W/296 Bank St Ottawa ON	SE/198.0	-0.93	<u>239</u>
<u>93</u>	GEN	DUFRESNE PILING COMPANY (1967) LTD.	380 SOMERSET STREET WEST OTTAWA ON K2P 2R2	SE/198.0	-0.93	<u>239</u>
<u>93</u>	EHS		380 Somerset St W Ottawa ON K2P2R2	SE/198.0	-0.93	<u>240</u>
<u>94</u>	GEN	GVT. OF CAN. - NATIONAL DEFENCE	CRAD/DSIS-NATIONAL DEFENCE HEADQUARTERS 190 O'CONNOR ST. OTTAWA ON K1A 1G8	NE/199.7	-0.93	<u>240</u>
<u>94</u>	GEN	GVT. OF CAN. - NATIONAL DEFENCE	190 O'CONNOR STREET DIRECTORATE, SCIENTIFIC INFORMAT.SERVICE OTTAWA ON K1A 1G8	NE/199.7	-0.93	<u>240</u>
<u>94</u>	GEN	GVT. OF CAN. - NATIONAL DEFENCE 18-192	CRAD/DSIS-NATIONAL DEFENCE HEADQUARTERS 190 O'CONNOR ST. OTTAWA ON K1A 1G8	NE/199.7	-0.93	<u>240</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>94</u>	GEN	DEPT. OF NATIONAL DEFENCE	DEFENCE RESEARCH DEVELOPMENT BRANCH 190 O'CONNOR STREET OTTAWA ON K1A 0K2	NE/199.7	-0.93	<u>241</u>
<u>94</u>	SCT	Canadian Council on Social	190 O'Connor St Suite 100 Ottawa ON K2P 2R3	NE/199.7	-0.93	<u>241</u>
<u>94</u>	EHS		190 O'connor St Ottawa ON K2P2R3	NE/199.7	-0.93	<u>242</u>
<u>95</u>	WWIS		338 SOMERSET STREET WEST OTTAWA ON <i>Well ID:</i> 7046637	ESE/206.1	-1.93	<u>242</u>
<u>96</u>	WWIS		154 O'CONNOR STREET Ottawa ON <i>Well ID:</i> 7130914	NNE/207.0	-0.93	<u>245</u>
<u>97</u>	WWIS		311 SOMERSET Ottawa ON <i>Well ID:</i> 7391114	E/210.2	-1.93	<u>260</u>
<u>98</u>	WWIS		311 SOMERSET Ottawa ON <i>Well ID:</i> 7391113	E/217.6	-1.93	<u>264</u>
<u>99</u>	WWIS		429 MC LEARN Ottawa ON <i>Well ID:</i> 7233874	S/218.4	0.07	<u>267</u>
<u>100</u>	SPL		290-292 Kent Street UTM Zone:18 Easting: 445333.64 Northing:5029231.41 Ottawa ON	SW/219.0	1.07	<u>271</u>
<u>101</u>	WWIS		311 Somerset St W Ottawa ON <i>Well ID:</i> 7382859	E/219.4	-1.93	<u>272</u>
<u>102</u>	EHS		172 O'Connor Ottawa ON K2P 1T5	NE/220.8	-0.93	<u>275</u>
<u>103</u>	GEN	FOSTER SPORT CENTER	305 BANK STREET OTTAWA ON K2P 1X7	SE/221.6	-0.87	<u>275</u>
<u>103</u>	GEN	FOSTER SPORT CENTER 15-418	305 BANK STREET OTTAWA ON K2P 1X7	SE/221.6	-0.87	<u>276</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>104</u>	GEN	BLACK PHOTO(OUT OF BUS.)	181 BANK STREET, UNITS 121-122 L'ESPLANADE OTTAWA ON K2P 1W5	N/222.5	0.07	<u>276</u>
<u>104</u>	GEN	BLACK PHOTO CORPORATION	171-181 BANK STREET, UNITS 121-122 OTTAWA ON K2P 1W5	N/222.5	0.07	<u>276</u>
<u>105</u>	GEN	PSL Mechanical	415 McLaren St Ottawa ON K2P 2C8	SSE/222.5	0.07	<u>277</u>
<u>106</u>	SCT	CDIA Report Newsletter	338 Somerset St W Unit 4 Ottawa ON K2P 0J9	ESE/224.5	-1.93	<u>278</u>
<u>106</u>	SPL	Enbridge Gas Distribution Inc.	338 Sommerset West Ottawa ON	ESE/224.5	-1.93	<u>278</u>
<u>106</u>	SCT	whatif? Technologies Inc.	338 Somerset St W Unit 3 Ottawa ON K2P 0J9	ESE/224.5	-1.93	<u>279</u>
<u>106</u>	HINC		338 SOMERSET STREET WEST OTTAWA ON	ESE/224.5	-1.93	<u>279</u>
<u>106</u>	EHS		338 Somerset Street West Ottawa Ontario Ottawa ON K2P 0J9	ESE/224.5	-1.93	<u>279</u>
<u>107</u>	CA	QUADRELLE MANAGEMENT LTD.	340 LAURIER AVENUE WEST OTTAWA ON K1A 0P9	WNW/224.8	-0.93	<u>280</u>
<u>107</u>	SPL	PRIVATE BUSINESS	340 LAURIER AVE (N.O.S.) OTTAWA CITY ON	WNW/224.8	-0.93	<u>280</u>
<u>107</u>	GEN	JER OTTAWA ULC	340 LAURIER AVENUE WEST OTTAWA ON K1A 0P9	WNW/224.8	-0.93	<u>281</u>
<u>107</u>	GEN	JER OTTAWA ULC	340 LAURIER AVENUE WEST SIR WILFRID LAURIER BUILDING OTTAWA ON K1A 0P9	WNW/224.8	-0.93	<u>282</u>
<u>107</u>	GEN	OTTAWA 340 LAURIER AVENUE WEST INC.	340 LAURIER AVENUE WEST OTTAWA ON K1A 0P9	WNW/224.8	-0.93	<u>283</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
107	GEN	Public Works and Government Services Canada	340 Laurier Street Ottawa ON K1P 5K3	WNW/224.8	-0.93	284
107	EHS		340 Laurier Avenue West Ottawa ON K1A 0P9	WNW/224.8	-0.93	285
107	EHS		340 Laurier Avenue Ottawa ON	WNW/224.8	-0.93	285
107	GEN	Public Works and Government Services Canada	340 Laurier Street Ottawa ON	WNW/224.8	-0.93	285
107	EASR	OTTAWA - 340 LAURIER WEST INC	340 LAURIER AVENUE WEST OTTAWA ON K1N 0P9	WNW/224.8	-0.93	286
107	NPRI	O&Y ENTERPRISE	340 LAURIER Avenue West OTTAWA ON K1A0P8	WNW/224.8	-0.93	286
107	EASR	OTTAWA - 340 LAURIER WEST INC	340 LAURIER AVENUE WEST OTTAWA ON K1N 0P9	WNW/224.8	-0.93	287
107	GEN	Starlight Investments	340 Laurier Ave West Ottawa ON K1A 0P9	WNW/224.8	-0.93	288
107	GEN	TNC 340 Laurier Ltd.	340 Laurier Ave West ottawa ON K1A 0P8	WNW/224.8	-0.93	288
107	GEN	TNC 340 Laurier Ltd	340 Laurier Ottawa ON K1A 0P9	WNW/224.8	-0.93	289
107	GEN	Epic Realty Partners	340 Laurier Ave. Ottawa ON K1P 5K3	WNW/224.8	-0.93	290
107	GEN	Demo Core	340 Laurier Ave. Ottawa ON K1A 0P9	WNW/224.8	-0.93	290
107	GEN	340 TNC Laurier Ltd.	340 Laurier Avenue Ottawa ON K1A 0P9	WNW/224.8	-0.93	292

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
107	GEN	340 TNC Laurier Ltd.	340 Laurier Avenue Ottawa ON K1A 0P9	WNW/224.8	-0.93	292
108	SPL	DARLING INTERNATIONAL CANADA INC.	OTTAWA ON	NNE/225.7	-0.93	293
109	CA	OTTAWA CITY - SOMERSET ST.	O'CONNOR ST./NEPEAN ST. OTTAWA CITY ON	NE/225.9	-1.21	294
110	EHS		311 Somerset Street West Ottawa ON K2P 0J8	E/226.5	-1.93	294
111	NPCB	OLYMPIA & YORK DEVELOPMENTS LTD.	L'ESPLANADE LAURIER; 171 BANK STREET LEVEL II OTTAWA ON K2P 1W5	NNW/227.7	0.07	294
111	NPCB	ROSTRUST INVESTMENTS INC.	171 BANK STREET LEVEL II BANK STREET LEVEL II OTTAWA ON	NNW/227.7	0.07	295
111	EHS		171 Bank St Ottawa ON K2P 1W5	NNW/227.7	0.07	295
111	GEN	CAMPBELL AND KENNEDY ELECTRIC LTD.	M2-171 BANK ST. OTTAWA ON K2P 1W5	NNW/227.7	0.07	295
111	GEN	O & Y PROPERTIES INC.	171 BANK STREET L'ESPLANADE LAURIER OTTAWA ON K2P 1W5	NNW/227.7	0.07	295
111	GEN	O & Y PROPERTIES INC.	L'ESPLANADE LAURIER 171 BANK STREET OTTAWA ON K2P 1W5	NNW/227.7	0.07	296
111	GEN	ROSTRUST INVESTMENTS INC.	171 BANK STREET (L'ESPLANADE LAURIER) OTTAWA ON K2P 1W5	NNW/227.7	0.07	296
111	NPCB	ROSTRUST INVESTMENTS INC.	171 BANK STREET LEVEL 2 L'Esplanade Laurier Ottawa ON K2P 1W5	NNW/227.7	0.07	297

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>111</u>	NPCB	ROSTRUST INVESTMENTS INC.	L'ESPLANADE LAURIER 171 BANK STREET LEVEL II OTTAWA ON K2P 1W5	NNW/227.7	0.07	<u>298</u>
<u>112</u>	PES	SHOPPERS DRUG MART #988	174 BANK ST OTTAWA ON K2P1W6	NW/228.1	-0.96	<u>299</u>
<u>112</u>	GEN	B. Surani Drugs Ltd. (910)	174 BANK ST OTTAWA ON K1P 5N7	NW/228.1	-0.96	<u>300</u>
<u>112</u>	GEN	B. Surani Drugs Ltd. (910)	174 BANK ST OTTAWA ON K1P 5N7	NW/228.1	-0.96	<u>300</u>
<u>112</u>	GEN	B. Surani Drugs Ltd. (910)	174 BANK ST OTTAWA ON K1P 5N7	NW/228.1	-0.96	<u>301</u>
<u>112</u>	PES	SHOPPERS DRUG MART #988	174 BANK ST OTTAWA ON K2P1W6	NW/228.1	-0.96	<u>301</u>
<u>112</u>	GEN	B. Surani Drugs Ltd. (910)	174 BANK ST OTTAWA ON K1P 5N7	NW/228.1	-0.96	<u>301</u>
<u>112</u>	GEN	B. Surani Drugs Ltd. (910)	174 BANK ST OTTAWA ON K1P 5N7	NW/228.1	-0.96	<u>302</u>
<u>112</u>	GEN	B. Surani Drugs Ltd. (910)	174 BANK ST OTTAWA ON K1P 5N7	NW/228.1	-0.96	<u>302</u>
<u>113</u>	EHS		326 Somerset St W Ottawa ON K2P0J9	ESE/228.4	-1.93	<u>306</u>
<u>113</u>	GEN	EnviroCentre	326 Somerset St. West Ottawa ON K2P 0J9	ESE/228.4	-1.93	<u>306</u>
<u>114</u>	EHS		234 O'connor St Ottawa ON K2P1T9	E/228.5	-1.93	<u>307</u>
<u>115</u>	PRT	BUDGET CAR & TRUCK RENTALS OF OTTAWA	443 SOMERSET ST W OTTAWA ON K1R 5J7	SSW/230.4	1.07	<u>308</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>115</u>	EHS		443 Somerset St. West Ottawa ON K1R 5J7	SSW/230.4	1.07	<u>308</u>
<u>115</u>	FSTH	BUDGET CAR & TRUCK RENTALS OF OTTAWA	443 SOMERSET ST W OTTAWA ON K1R 5J7	SSW/230.4	1.07	<u>308</u>
<u>115</u>	GEN	Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW/230.4	1.07	<u>308</u>
<u>115</u>	RSC	Avraham Holdings Inc.	443 SOMERSET ST W ON OTTAWA ON	SSW/230.4	1.07	<u>309</u>
<u>115</u>	GEN	Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW/230.4	1.07	<u>309</u>
<u>115</u>	GEN	Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW/230.4	1.07	<u>310</u>
<u>115</u>	GEN	Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW/230.4	1.07	<u>310</u>
<u>115</u>	GEN	Budget Car Inc	443 Somerset St. West Ottawa ON	SSW/230.4	1.07	<u>310</u>
<u>115</u>	GEN	Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW/230.4	1.07	<u>311</u>
<u>115</u>	GEN	Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW/230.4	1.07	<u>311</u>
<u>115</u>	GEN	Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW/230.4	1.07	<u>311</u>
<u>115</u>	GEN	Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW/230.4	1.07	<u>312</u>
<u>115</u>	GEN	Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW/230.4	1.07	<u>312</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
115	EXP	BUDGET CAR & TRUCK RENTALS OF OTTAWA	443 SOMERSET ST W OTTAWA ON	SSW/230.4	1.07	314
116	WWIS		154 O'CONNOR ST Ottawa ON Well ID: 7139448	NNE/230.9	-0.93	314
117	WWIS		429 MC LEARN OTTAWA ON Well ID: 7233875	S/231.1	0.07	327
118	WWIS		KENT ST Ottawa ON Well ID: 7344660	SSW/232.5	1.07	330
119	SPL	UNKNOWN	SOMERSET AND KENT STREET OTTAWA CITY ON	SSW/233.0	1.07	332
119	CA	CLARIDGE HOMES (SOMERSET) INC.	SOMERSET ST.W./KENT ST. OTTAWA CITY ON	SSW/233.0	1.07	333
120	SPL	PRIVATE OWNER	220 KENT ST MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON	W/233.3	-0.93	333
121	WWIS		311 SONERSET Ottawa ON Well ID: 7391115	E/233.5	-1.93	334
122	WWIS		ON Well ID: 7391814	NE/234.0	-1.21	338
123	GEN	HEALTH AND WELFARE CANADA	HEALTH UNIT#28, 10TH FL., WEST TOWER 300 LAURIER AVE. WEST (TBC) OTTAWA ON K1A 0R5	N/234.2	0.07	339
123	GEN	GVT OF CAN-HEALTH&WELFARE CAN.MED. 16-304	SER.BR,UNIT#28,10TH FL. W. TOWER 300 LAURIER AVE. WEST,C/O 301 ELGIN ST OTTAWA ON K1A 0L3	N/234.2	0.07	339
123	GEN	HEALTH AND WELFARE CANADA	300 LAURIER AVE. WEST (T.B.C) HEALTH UNIT #28, 10TH FLOOR WEST TOWER OTTAWA ON K1A 0R5	N/234.2	0.07	339
123	GEN	GVT. OF CAN.-SUPPLY AND SERVICES	OLYMPIA PRINTING PLANT,LEVEL P1,W. TOWER L'ESPLANADE LAURIER,300 LAURIER AVE. W	N/234.2	0.07	340

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			OTTAWA ON K1A 0M7			
123	GEN	GVT. OF CAN.(OUT OF BUS) 18-208	OLYMPIA PRINTING PLANT,LEVEL P1,W. TOWER L'ESPLANADE LAURIER,300 LAURIER AVE. W OTTAWA ON K1A 0M7	N/234.2	0.07	340
123	GEN	GVT. OF CAN.(OUT OF BUSINESS)	OLYMPIA PRINTING PLANT,LEVEL P1,W. TOWER L'ESPLANADE LAURIER,300 LAURIER AVE. W OTTAWA ON K1A 0M7	N/234.2	0.07	341
123	GEN	Public Works and Government Services Canada	300 Laurier Ave Ottawa ON K0A 0S5	N/234.2	0.07	341
123	SPL		in front of 300 Laurier Avenue<UNOFFICIAL> Ottawa ON	N/234.2	0.07	342
123	GEN	Public Works and Government Services Canada	300 Laurier Ave Ottawa ON	N/234.2	0.07	343
123	GEN	Public Works and Government Services Canada	300 Laurier Ave Ottawa ON	N/234.2	0.07	344
123	GEN	Public Works and Government Services Canada	300 Laurier Ave Ottawa ON	N/234.2	0.07	345
123	GEN	Public Works and Government Services Canada	300 Laurier Ave Ottawa ON K0A 0S5	N/234.2	0.07	347
123	GEN	Public Works and Government Services Canada	300 Laurier Ave Ottawa ON	N/234.2	0.07	348
123	GEN	Public Works and Government Services Canada	300 Laurier Ave Ottawa ON K0A0S5	N/234.2	0.07	349
123	GEN	Public Works and Government Services Canada	300 Laurier Ave Ottawa ON K0A0S5	N/234.2	0.07	351
123	GEN	Public Works and Government Services Canada	300 Laurier Ave Ottawa ON K0A0S5	N/234.2	0.07	352

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>123</u>	GEN	Public Services & Procurement Canada RPB	300 Laurier Ave Ottawa ON K0A 0S5	N/234.2	0.07	<u>353</u>
<u>123</u>	GEN	Public Services & Procurement Canada RPB	300 Laurier Ave Ottawa ON K0A 0S5	N/234.2	0.07	<u>355</u>
<u>123</u>	GEN	Public Services & Procurement Canada RPB	300 Laurier Ave Ottawa ON K0A 0S5	N/234.2	0.07	<u>356</u>
<u>123</u>	GEN	Public Services & Procurement Canada	300 Laurier Ave Ottawa ON K0A 0S5	N/234.2	0.07	<u>358</u>
<u>123</u>	FRST		300 Laurier Avenue Ottawa ON	N/234.2	0.07	<u>364</u>
<u>124</u>	SPL	SHELL CANADA PRODUCTS LTD.	154 O'CONNER STREET SERVICE STATION OTTAWA CITY ON	NNE/234.3	-0.93	<u>371</u>
<u>124</u>	SPL	SHELL CANADA PRODUCTS LTD.	154 O'CONNOR ST. SHELL CANADA GAS STATION SERVICE STATION OTTAWA CITY ON K2P 1T5	NNE/234.3	-0.93	<u>371</u>
<u>124</u>	PRT	BYTOWN TOWING & AUTOCARE LTD	154 O CONNOR ST AT GLOUCESTER OTTAWA ON	NNE/234.3	-0.93	<u>372</u>
<u>124</u>	FSTH	BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON K2P 1T5	NNE/234.3	-0.93	<u>373</u>
<u>124</u>	FSTH	BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON K2P 1T5	NNE/234.3	-0.93	<u>373</u>
<u>124</u>	EHS		154 O'Connor Street Ottawa ON K2P 1T5	NNE/234.3	-0.93	<u>374</u>
<u>124</u>	DTNK	BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	NNE/234.3	-0.93	<u>374</u>
<u>124</u>	DTNK	BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	NNE/234.3	-0.93	<u>374</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>124</u>	GEN	Shell Canada Products	154 O+Connor Street Ottawa ON K2P 1T5	NNE/234.3	-0.93	<u>375</u>
<u>124</u>	GEN	Shell Canada Products	154 O+Connor Street Ottawa ON K2P 1T5	NNE/234.3	-0.93	<u>375</u>
<u>124</u>	DTNK	BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON K2P 1T5	NNE/234.3	-0.93	<u>376</u>
<u>124</u>	EXP	BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	NNE/234.3	-0.93	<u>377</u>
<u>124</u>	EXP	BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	NNE/234.3	-0.93	<u>377</u>
<u>124</u>	EXP	BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	NNE/234.3	-0.93	<u>377</u>
<u>125</u>	EHS		324 Somerset Street West Ottawa ON K2P 0J9	ESE/235.6	-1.93	<u>377</u>
<u>126</u>	WWIS		311 Somerset St W Ottawa ON Well ID: 7382782	E/235.7	-1.93	<u>378</u>
<u>127</u>	HINC		322 SOMERSET STREET WEST OTTAWA ON	ESE/235.7	-1.93	<u>381</u>
<u>128</u>	WWIS		19 MCLAREN ON Well ID: 7233876	S/235.9	0.07	<u>381</u>
<u>129</u>	WWIS		KENT ST Ottawa ON Well ID: 7344655	SSW/236.3	1.07	<u>385</u>
<u>130</u>	WWIS		ON Well ID: 7211110	E/237.3	-1.93	<u>386</u>
<u>131</u>	EHS		335 Cooper Street Ottawa ON K2P 0G5	ENE/238.3	-1.93	<u>388</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
132	WWIS		KENT ST Ottawa ON <i>Well ID:</i> 7344659	W/238.7	-1.23	388
133	WWIS		311 SOMERSET Ottawa ON <i>Well ID:</i> 7391112	E/240.2	-1.93	390
134	EHS		340 Cooper street Ottawa ON Ottawa ON K2P 0G7	E/241.2	-1.93	394
135	EHS		171 Bank Street Ottawa ON K2P 1W5	N/242.8	0.07	394
136	EHS		340 Laurier Ave W Ottawa ON K1P 5K3	NW/243.2	-0.93	394
137	RSC	Ambassador-Mondrian Inc.	324 LAURIER AVE W ON OTTAWA ON	NW/244.0	-0.96	395
138	BORE		ON	SSW/245.2	1.07	395
139	WWIS		ON <i>Well ID:</i> 7211109	SSW/245.6	1.07	396
140	EHS		257 Lisgar Street Ottawa ON K2P 0C7	ENE/246.0	-1.93	398
140	GEN	Taggart Corporation Ltd.	257 Lisgar Street Ottawa ON K2P 0C7	ENE/246.0	-1.93	399
140	GEN	Taggart Group Ltd	257 Lisgar St Ottawa ON K2P1P0	ENE/246.0	-1.93	399
141	EHS		341 Maclaren St Ottawa ON K2P2E2	ESE/246.3	-1.95	400
142	CA	Tartan Land Corporation	331 Cooper Street, Suite 400 Ottawa ON K2P 0G5	ENE/246.4	-1.93	401

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
142	CA	Tartan Land Corporation	331 Cooper Street, Suite 400 Ottawa ON K2P 0G5	ENE/246.4	-1.93	401
142	CA	Tartan Land Corporation	331 Cooper Street, Suite 400 Ottawa ON K2P 0G5	ENE/246.4	-1.93	401
142	ECA	South Nepean Development Corporation	331 Cooper Street, Suite 400 Ottawa ON K1R 7Y2	ENE/246.4	-1.93	401
142	ECA	South Nepean Development Corporation	331 Cooper Street, Suite 400 Ottawa ON	ENE/246.4	-1.93	402
142	ECA	South Nepean Development Corporation	331 Cooper Street, Suite 400 Ottawa ON	ENE/246.4	-1.93	402
142	SPL	Enbridge Gas Distribution Inc.	331 Cooper St. Ottawa ON	ENE/246.4	-1.93	402
142	PINC	PIPELINE HIT 1"	331 COOPER ST.,,OTTAWA,ON,K2P 0G5, CA ON	ENE/246.4	-1.93	403
143	EHS		441 MACLAREN STREET OTTAWA ON K2P 2H3	S/246.7	0.07	404
143	EHS		441 MacLaren Ottawa ON	S/246.7	0.07	404
143	GEN	Dental Anaesthesia Group	441 MacLaren Street Suite 370 Ottawa ON	S/246.7	0.07	404
143	GEN	Sedation Dental Group	Suite 370 441 MacLaren St Ottawa ON K2P 2H3	S/246.7	0.07	404
143	GEN	Elevation Elevator Inc.	441 MacLaren Ottawa ON K2P 2R2	S/246.7	0.07	405
143	GEN	Sedation Dental Group	Suite 370 441 MacLaren St Ottawa ON K2P 2H3	S/246.7	0.07	406

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
143	GEN	Dental Anaesthesia Group	Suite 370 441 MacLaren St Ottawa ON K2P 2H3	S/246.7	0.07	406
143	GEN	Sedation Dental Group	Suite 370 441 MacLaren St Ottawa ON K2P 2H3	S/246.7	0.07	406
143	GEN	Sedation Dental Group	Suite 370 441 MacLaren St Ottawa ON K2P 2H3	S/246.7	0.07	407
143	GEN	Sedation Dental Group	Suite 370 441 MacLaren St Ottawa ON K2P 2H3	S/246.7	0.07	408
144	EHS		447 Somerset Street West Ottawa ON K1R 5J7	SW/246.7	1.07	409
145	PRT	I C ASSALY CONSTRUCTION	199 KENT ST OTTAWA ON K2P2K8	WNW/248.0	-2.08	409
145	DTNK	I C ASSALY CONSTRUCTION	199 KENT ST OTTAWA ON	WNW/248.0	-2.08	409
145	SPL	Kent Towers<UNOFFICIAL>	199 Kent st Ottawa ON	WNW/248.0	-2.08	410
146	EHS		360 Laurier Ave West Ottawa ON K1P 1C8	WNW/248.1	-0.87	411
146	GEN	HEALTH AND WELFARE CANADA	HEALTH UNIT#31, 2ND FL., NORONO BLDG. 360 LAURIER AVE. WEST (HWC) OTTAWA ON K1P 1C8	WNW/248.1	-0.87	411
146	GEN	GVT OF CAN- HEALTH&WELFARE CAN.MED. 16-305	SER.BR,UNIT#31,2ND FL.,NORONO BLDG. 360 LAURIER AVE. WEST,C/O 301 ELGIN ST OTTAWA ON K1P 1C8	WNW/248.1	-0.87	411
146	GEN	HEALTH AND WELFARE CANADA	360 LAURIER AVE. WEST (HWC) HEALTH UNIT #31, 2ND FLOOR, NORONO BLDG. OTTAWA ON K1P 5K3	WNW/248.1	-0.87	412

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>146</u>	EHS		360 Laurier Avenue West Ottawa ON K1P 1C8	WNW/248.1	-0.87	<u>412</u>
<u>146</u>	EBR	360 Laurier Avenue West Limited	360 Laurier Avenue West Ottawa K1P 6E2 CITY OF OTTAWA ON	WNW/248.1	-0.87	<u>412</u>
<u>146</u>	CA	360 Laurier Avenue West Limited	360 Laurier Ave W Ottawa ON	WNW/248.1	-0.87	<u>413</u>
<u>146</u>	ECA	360 Laurier Avenue West Limited	360 Laurier Ave W Ottawa ON K1P 6E2	WNW/248.1	-0.87	<u>413</u>
<u>146</u>	EHS		360 Laurier Avenue West Ottawa ON K1P 1C8	WNW/248.1	-0.87	<u>413</u>
<u>146</u>	EHS		360 Laurier Ave W Ottawa ON K1P1C8	WNW/248.1	-0.87	<u>414</u>
<u>146</u>	RSC	OTT A360 LAURIER INC.	360 Laurier AVE W Ottawa ON	WNW/248.1	-0.87	<u>414</u>
<u>147</u>	SPL	PRIVATE OWNER	280 GLOUCESTER ST(ST. PATRICK CHURCH) STORAGE TANK/BARREL OTTAWA CITY ON K1R 5E4	W/248.2	-0.93	<u>414</u>
<u>148</u>	GEN	2732685 Ontario Inc.	429 MacLaren Street Ottawa ON K2P 0M7	S/248.2	0.07	<u>415</u>
<u>149</u>	PINC	KEN RALPH	231 O'CONNOR ST.,OTTAWA,ON,K2P 1T8,CA ON	E/248.4	-1.93	<u>416</u>
<u>150</u>	EHS		447 Somerset Street West Ottawa ON K1R 5J7	SW/248.5	1.07	<u>416</u>
<u>150</u>	EHS		447 Somerset Street West Ottawa ON Ottawa ON K1R 5J7	SW/248.5	1.07	<u>416</u>
<u>151</u>	INC		384 MacLaren Street, Ottawa ON	SE/248.9	-0.93	<u>417</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
151	SPL	Enbridge Gas Distribution Inc.	384 MacLaren St Ottawa ON K2P 0M8	SE/248.9	-0.93	417
152	SCT	Soundmaster Ltd.	386 MacLaren St Ottawa ON K2P 0M8	SE/249.4	-0.93	418

Executive Summary: Summary By Data Source

BORE - Borehole

A search of the BORE database, dated 1875-Jul 2018 has found that there are 5 BORE site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	WSW	139.15	<u>48</u>
	ON	NW	145.36	<u>52</u>
	ON	SW	154.89	<u>56</u>
	ON	SSW	245.23	<u>138</u>

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	E	97.49	<u>19</u>

CA - Certificates of Approval

A search of the CA database, dated 1985-Oct 30, 2011* has found that there are 12 CA site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Mel Cohen Realty Ltd.	177 Nepean Street Ottawa ON	N	125.87	<u>36</u>
CLARIDGE HOMES (SOMERSET) INC.	SOMERSET ST.W./KENT ST. OTTAWA CITY ON	SSW	232.98	<u>119</u>

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
R.M. OF OTTAWA-CARLETON	COOPER ST./BANK ST. OTTAWA CITY ON	ESE	75.12	12
OTTAWA CITY	COOPER ST./BANK ST. OTTAWA CITY ON	ESE	75.12	12
ALLAN KWAI	331 SOMERSET ST. W., SWM OTTAWA CITY ON K2P 0J8	E	186.26	82
Bank and Somerset Holdings Limited	296 Bank Street Ottawa ON K2P 1X8	SE	197.37	92
QUADRELLE MANAGEMENT LTD.	340 LAURIER AVENUE WEST OTTAWA ON K1A 0P9	WNW	224.75	107
OTTAWA CITY - SOMERSET ST.	O'CONNOR ST./NEPEAN ST. OTTAWA CITY ON	NE	225.88	109
Tartan Land Corporation	331 Cooper Street, Suite 400 Ottawa ON K2P 0G5	ENE	246.38	142
Tartan Land Corporation	331 Cooper Street, Suite 400 Ottawa ON K2P 0G5	ENE	246.38	142
Tartan Land Corporation	331 Cooper Street, Suite 400 Ottawa ON K2P 0G5	ENE	246.38	142
360 Laurier Avenue West Limited	360 Laurier Ave W Ottawa ON	WNW	248.07	146

CDRY - Dry Cleaning Facilities

A search of the CDRY database, dated Jan 2004-Dec 2022 has found that there are 2 CDRY site(s) within approximately 0.25 kilometers of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>

Downtown Cobler	272 Bank St Ottawa ON K2P1X6	SE	92.70	17
Draicchio's Tailoring&Cleaning	272 Bank St Ottawa ON K2P1X6	SE	92.70	17

DTNK - Delisted Fuel Tanks

A search of the DTNK database, dated Oct 2023 has found that there are 7 DTNK site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
MARK TAZA	429 SOMERSET ST W OTTAWA ON	SSW	188.98	86
SAVEWAY GAS & FUELS LTD	429 SOMERSET ST W OTTAWA ON K2P 0K1	SSW	188.98	86
MARK TAZA	429 SOMERSET ST W OTTAWA ON K2P 0K1	SSW	188.98	86

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	NNE	234.32	124
BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	NNE	234.32	124
BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON K2P 1T5	NNE	234.32	124
I C ASSALY CONSTRUCTION	199 KENT ST OTTAWA ON	WNW	247.96	145

EASR - Environmental Activity and Sector Registry

A search of the EASR database, dated Oct 2011-Oct 31, 2024 has found that there are 2 EASR site(s) within approximately 0.25

kilometers of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
OTTAWA - 340 LAURIER WEST INC	340 LAURIER AVENUE WEST OTTAWA ON K1N 0P9	WNW	224.75	107
OTTAWA - 340 LAURIER WEST INC	340 LAURIER AVENUE WEST OTTAWA ON K1N 0P9	WNW	224.75	107

EBR - Environmental Registry

A search of the EBR database, dated 1994 - Nov 30, 2024 has found that there are 1 EBR site(s) within approximately 0.25 kilometers of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
360 Laurier Avenue West Limited	360 Laurier Avenue West Ottawa K1P 6E2 CITY OF OTTAWA ON	WNW	248.07	146

ECA - Environmental Compliance Approval

A search of the ECA database, dated Oct 2011-Oct 31, 2024 has found that there are 8 ECA site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Mel Cohen Realty Ltd.	177 Nepean Street Ottawa ON K1Y 2E9	N	125.87	36

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
City of Ottawa	Laurier Avenue at the Rideau Canal Ottawa ON K1P 1J1	ENE	160.00	64
City of Ottawa	Ottawa ON K2G 6J8	ENE	160.00	64
Bank and Somerset Holdings Limited	296 Bank Street Ottawa ON K2P 1X8	SE	197.37	92
South Nepean Development Corporation	331 Cooper Street, Suite 400 Ottawa ON	ENE	246.38	142

South Nepean Development Corporation	331 Cooper Street, Suite 400 Ottawa ON	ENE	246.38	142
South Nepean Development Corporation	331 Cooper Street, Suite 400 Ottawa ON K1R 7Y2	ENE	246.38	142
360 Laurier Avenue West Limited	360 Laurier Ave W Ottawa ON K1P 6E2	WNW	248.07	146

EHS - ERIS Historical Searches

A search of the EHS database, dated 1999-Aug 31, 2024 has found that there are 73 EHS site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	240 Bank Street Ottawa ON K2P 1X4	-	0.00	1
	240 Bank Street Ottawa ON K2P 1X4	-	0.00	1
	240 Bank Street Ottawa ON K2P 1X4	-	0.00	1
	240 Bank Street Ottawa ON K2P 1X4	-	0.00	1
	222 Nepean Street Ottawa ON K2P 0B8	WNW	73.58	11
	437 Cooper Street Ottawa ON K2P 0H1	SW	92.71	18
	226 Nepean St Ottawa ON K2P0B8	W	116.20	27

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	205 Bank Street Ottawa ON K2P 1W7	NNW	121.21	<u>32</u>
	203 Bank St Ottawa ON K2P1W7	N	124.52	<u>34</u>
	215 Nepean St Ottawa ON K2P2K5	WNW	125.74	<u>35</u>
	400 Cooper Street Ottawa ON K2P 2H8	S	131.07	<u>40</u>
	400 Cooper Street, Ottawa ON K2P 2H8	S	131.07	<u>40</u>
	400 Cooper Street Ottawa ON K2P 2N1	S	131.07	<u>40</u>
	400 Cooper Street Ottawa ON K2P 2N1	S	131.07	<u>40</u>
	453 Cooper Street Ottawa ON K2P 0H1	SW	142.54	<u>49</u>
	170 Gloucester Street Ottawa ON K2P 0A6	N	168.26	<u>72</u>
	176 Gloucester St Ottawa ON K2P0A6	NNW	172.42	<u>75</u>
	281 Kent Street Ottawa ON K2P 2H8	SW	177.21	<u>78</u>
	171 Bank St Ottawa ON K2P 1W5	NNW	227.71	<u>111</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	443 Somerset St. West Ottawa ON K1R 5J7	SSW	230.45	<u>115</u>
	171 Bank Street Ottawa ON K2P 1W5	N	242.79	<u>135</u>
	441 MACLAREN STREET OTTAWA ON K2P 2H3	S	246.68	<u>143</u>
	441 MacLaren Ottawa ON	S	246.68	<u>143</u>
	447 Somerset Street West Ottawa ON K1R 5J7	SW	246.72	<u>144</u>
	447 Somerset Street West Ottawa ON K1R 5J7	SW	248.49	<u>150</u>
	447 Somerset Street West Ottawa ON Ottawa ON K1R 5J7	SW	248.49	<u>150</u>
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	251 Bank Street Ottawa ON K2P 1X3	ESE	49.42	<u>4</u>
	251-259 Bank Street (395-397 Cooper St) Ottawa ON	ESE	67.86	<u>9</u>
	251 Bank Street Ottawa ON	ESE	67.86	<u>9</u>
	251 Bank St Ottawa ON K2P1X3	ESE	67.86	<u>9</u>

178 Nepean, 219 & 223 Bank Ottawa ON K2P 1W9	N	85.69	<u>15</u>
300 Lisgar Street Ottawa ON K2P 0E2	ENE	85.78	<u>16</u>
379 Cooper Street Ottawa ON K2P 0G8	E	110.11	<u>24</u>
379 Cooper Street Ottawa ON K2P 0G8	E	110.11	<u>24</u>
309 Lisgar Avenue Ottawa ON	NE	110.33	<u>25</u>
300 Lisgar St and 375 Cooper St Ottawa ON	ENE	118.60	<u>28</u>
177 Nepean St Ottawa ON K2P 1W7	N	120.82	<u>30</u>
PE3651 - 293 Lisgar Street & 176 Nepean Street Ottawa ON K2P 0B6	NE	121.06	<u>31</u>
275 Bank St Ottawa ON K2P2L6	ESE	127.25	<u>38</u>
275 Bank Street Ottawa ON K2P 2L6	SE	133.18	<u>43</u>
375 Cooper Street Ottawa ON K2P 0G8	E	134.34	<u>46</u>
153 Nepean Street Ottawa ON K2P 0B5	NNE	156.35	<u>58</u>

287 Lisgar Street Ottawa ON	NE	157.60	<u>62</u>
Nepean Street Ottawa ON K2P 0B6	NE	164.45	<u>66</u>
343 Somerset Street West Ottawa ON	ESE	168.15	<u>71</u>
355 Cooper St Ottawa ON K2P0G8	ENE	168.30	<u>73</u>
PE4776 - 352 Somerset Street West Ottawa ON K2P 0J9	SE	174.97	<u>76</u>
352/348/346 Somerset & 349 MacLaren Ottawa ON	ESE	182.08	<u>81</u>
186 Bank St Ottawa ON K2P1W6	NW	193.51	<u>88</u>
230 Gloucester St Ottawa ON K2P0A9	WNW	194.61	<u>89</u>
327 Somerset St W Ottawa ON K2P0J8	E	195.00	<u>90</u>
296 Bank St Ottawa ON K2P1X8	SE	197.37	<u>92</u>
380 & 386 Somerset St W/296 Bank St Ottawa ON	SE	197.97	<u>93</u>
380 Somerset St W Ottawa ON K2P2R2	SE	197.97	<u>93</u>
190 O'connor St Ottawa ON K2P2R3	NE	199.67	<u>94</u>

172 O'Connor Ottawa ON K2P 1T5	NE	220.76	<u>102</u>
338 Somerset Street West Ottawa Ontario Ottawa ON K2P 0J9	ESE	224.49	<u>106</u>
340 Laurier Avenue West Ottawa ON K1A 0P9	WNW	224.75	<u>107</u>
340 Laurier Avenue Ottawa ON	WNW	224.75	<u>107</u>
311 Somerset Street West Ottawa ON K2P 0J8	E	226.54	<u>110</u>
326 Somerset St W Ottawa ON K2P0J9	ESE	228.37	<u>113</u>
234 O'connor St Ottawa ON K2P1T9	E	228.52	<u>114</u>
154 O'Connor Street Ottawa ON K2P 1T5	NNE	234.32	<u>124</u>
324 Somerset Street West Ottawa ON K2P 0J9	ESE	235.60	<u>125</u>
335 Cooper Street Ottawa ON K2P 0G5	ENE	238.27	<u>131</u>
340 Cooper street Ottawa ON Ottawa ON K2P 0G7	E	241.18	<u>134</u>
340 Laurier Ave W Ottawa ON K1P 5K3	NW	243.22	<u>136</u>

257 Lisgar Street Ottawa ON K2P 0C7	ENE	245.96	140
341 Maclaren St Ottawa ON K2P2E2	ESE	246.33	141
360 Laurier Ave West Ottawa ON K1P 1C8	WNW	248.07	146
360 Laurier Avenue West Ottawa ON K1P 1C8	WNW	248.07	146
360 Laurier Avenue West Ottawa ON K1P 1C8	WNW	248.07	146
360 Laurier Ave W Ottawa ON K1P1C8	WNW	248.07	146

EXP - List of Expired Fuels Safety Facilities

A search of the EXP database, dated Oct 2023 has found that there are 6 EXP site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
MARK TAZA	429 SOMERSET ST W OTTAWA ON	SSW	188.98	86
MARK TAZA	429 SOMERSET ST W OTTAWA ON	SSW	188.98	86
BUDGET CAR & TRUCK RENTALS OF OTTAWA	443 SOMERSET ST W OTTAWA ON	SSW	230.45	115
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	NNE	234.32	124

BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	NNE	234.32	124

BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	NNE	234.32	124

FRST - Federal Identification Registry for Storage Tank Systems (FIRSTS)

A search of the FRST database, dated Oct 31, 2021 has found that there are 1 FRST site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	300 Laurier Avenue Ottawa ON	N	234.18	123

FSTH - Fuel Storage Tank - Historic

A search of the FSTH database, dated Pre-Jan 2010* has found that there are 3 FSTH site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
BUDGET CAR & TRUCK RENTALS OF OTTAWA	443 SOMERSET ST W OTTAWA ON K1R 5J7	SSW	230.45	115

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON K2P 1T5	NNE	234.32	124

BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON K2P 1T5	NNE	234.32	124

GEN - Ontario Regulation 347 Waste Generators Summary

A search of the GEN database, dated 1986-Nov 30, 2022 has found that there are 187 GEN site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Al's Care Pharmacy	240 Bank Street Ottawa ON K2P1X4	-	0.00	<u>1</u>
REVENUE CANADA TAXATION	CUSTOMS & EXCISE 360 LISGAR STREET OTTAWA ON K2P 2E4	WSW	47.64	<u>3</u>
REVENUE CANADA TAXATION	360 LISGAR STREET OTTAWA ON K1A 0L9	WSW	47.64	<u>3</u>
URBANDALE CORPORATION	360 Lisgar Street Ottawa ON	WSW	47.64	<u>3</u>
Bell Canada	360 Lisgar st Ottawa ON K2P 2E4	WSW	47.64	<u>3</u>
Bell Canada	360 Lisgar st Ottawa ON K2P 2E4	WSW	47.64	<u>3</u>
BELLCANADA	360 LISGAR STREET OTTAWA ON K2P 2E4	WSW	47.64	<u>3</u>
Bell Canada	360 Lisgar st Ottawa ON K2P 2E4	WSW	47.64	<u>3</u>
BICYCLE REVIVAL LTD.	224 BANK STREET OTTAWA ON K2P 1X1	NNW	57.88	<u>6</u>
BICYCLE REVIVAL LTD. 04-341	224 BANK STREET OTTAWA ON K2P 1X1	NNW	57.88	<u>6</u>
BICYCLE REVIVAL LIMITED	224 BANK STREET OTTAWA ON K2P 1X1	NNW	57.88	<u>6</u>
DEPARTMENT OF NATIONAL DEFENCE	VANIER BUILDING 222 NEPEAN STREET OTTAWA ON K2B 0B8	WNW	73.58	<u>11</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
DEPT OF NATIONAL DEFENCE, CDN. FORCES	VANIER BUILDING 222 NEPEAN STREET OTTAWA ON K2B 0B8	WNW	73.58	<u>11</u>
DEPT. OF NATIONAL DEFENCE	VANIER BUILDING 222 NEPEAN STREET OTTAWA ON K2B 0B8	WNW	73.58	<u>11</u>
Bona Building Management	222 Nepean St Ottawa ON K1R5G2	WNW	73.58	<u>11</u>
BAYVIEW PROPERTY MANAGEMENT	210 BANK STREET OTTAWA ON K2P 1W8	NW	114.93	<u>26</u>
District Realty Corporation	177 Nepean Street Ottawa ON K2P 0B4	N	125.87	<u>36</u>
Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S	127.54	<u>39</u>
Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S	127.54	<u>39</u>
Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S	127.54	<u>39</u>
Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON	S	127.54	<u>39</u>
Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S	127.54	<u>39</u>
Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S	127.54	<u>39</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S	127.54	<u>39</u>
Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S	127.54	<u>39</u>
Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S	127.54	<u>39</u>
Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S	127.54	<u>39</u>
Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S	127.54	<u>39</u>
GVT. OF CAN. - R.C.M.P.	OTTAWA A DIVISION, DRUG SECTION 400 COOPER STREET OTTAWA ON K1A 0R4	S	131.07	<u>40</u>
GVT. OF CAN. - R.C.M.P. 18-132	OTTAWA A DIVISION, DRUG SECTION 400 COOPER STREET OTTAWA ON K1A 0R4	S	131.07	<u>40</u>
400 Cooper Building Inc.	400 Cooper Street Ottawa ON K2P 2H8	S	131.07	<u>40</u>
Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON K2P 0K1	SSE	134.29	<u>45</u>
Dedicated National Pharmacy (In Receivership)	401 Somerset St West Ottawa ON K2P 0K1	SSE	134.29	<u>45</u>
Dedicated National Pharmacy (In Receivership)	401 Somerset St West Ottawa ON K2P 0K1	SSE	134.29	<u>45</u>
Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON K2P 0K1	SSE	134.29	<u>45</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON K2P 0K1	SSE	134.29	<u>45</u>
Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON	SSE	134.29	<u>45</u>
Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON K2P0K1	SSE	134.29	<u>45</u>
Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON K2P0K1	SSE	134.29	<u>45</u>
Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON K2P0K1	SSE	134.29	<u>45</u>
Canadian Addiction Treatment Clinics LP	401 Somerset Street, West Ottawa ON K2P0K1	SSE	134.29	<u>45</u>
Canadian Addiction Treatment Clinics LP	401 Somerset Street, West Ottawa ON K2P0K1	SSE	134.29	<u>45</u>
Canadian Addiction Treatment Clinics LP	401 Somerset Street, West Ottawa ON K2P0K1	SSE	134.29	<u>45</u>
AULT FOODS LIMITED	453 COOPER STREET OTTAWA ON K2P 0H1	SW	142.54	<u>49</u>
AULT FOODS LIMITED	453 COOPER STREET OTTAWA ON K2P 0H1	SW	142.54	<u>49</u>
AULT FOODS LIMITE(OUT OF BUSINESS)03-320	453 COOPER STREET OTTAWA ON K2P 0H1	SW	142.54	<u>49</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
OTTAWA COMMUNITY HOUSING CORPORATION	395 SOMERSET STREET OTTAWA ON	S	146.26	<u>54</u>
Black & McDonald Ltd.	395 Somerset Ottawa ON K2L 4X8	S	146.26	<u>54</u>
OTTAWA MAGAZINE INC.	192 BANK STREET OTTAWA ON K2P 1W8	NW	154.93	<u>57</u>
OTTAWA MAGAZINE INC.	192 BANK STREET OTTAWA ON K2P 1W8	NW	154.93	<u>57</u>
OTTAWA MAGAZINE INC. 29-278	192 BANK STREET OTTAWA ON K2P 1W8	NW	154.93	<u>57</u>
OTTAWA MAGAZINE INCORPORATED	192 BANK STREET OTTAWA ON K2P 1W8	NW	154.93	<u>57</u>
OTTAWA(SEE&USE ON0897800 OTTAWA)	192 BANK STREET OTTAWA ON K2P 1W8	NW	154.93	<u>57</u>
OTTAWA(SEE&USE ON0897800 OTTAWA) 29-290	192 BANK STREET OTTAWA ON K2P 1W8	NW	154.93	<u>57</u>
MCEVOY-SHIELDS FUNERAL HOMES LTD.	235 KENT STREET OTTAWA ON K2P 1Z9	W	157.45	<u>61</u>
MCEVOY-SHIELDS FUNERAL HOMES LTD. 44-472	235 KENT STREET OTTAWA ON K2P 1Z9	W	157.45	<u>61</u>
Service Corporation International Canada	235 Kent Street Ottawa ON K2P 1Z9	W	157.45	<u>61</u>
Charlesfort Development Corporation	235 Kent Street Ottawa ON K2P 1Z9	W	157.45	<u>61</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
HUDSON PARK CONDOS	245 KENT STREET OTTAWA ON K2P 0A5	W	176.64	<u>77</u>
CLARRIDGE HOMES	419-429 SOMERSET STREET OTTAWA ON K2P 2P5	SSW	188.98	<u>86</u>
Clarridge Homes	419-429 SOMERSET ST. OTTAWA ON K1N 6W8	SSW	188.98	<u>86</u>
BLACK PHOTO(OUT OF BUS.)	181 BANK STREET, UNITS 121-122 L'ESPLANADE OTTAWA ON K2P 1W5	N	222.50	<u>104</u>
BLACK PHOTO CORPORATION	171-181 BANK STREET, UNITS 121-122 OTTAWA ON K2P 1W5	N	222.50	<u>104</u>
PSL Mechanical	415 McLaren St Ottawa ON K2P 2C8	SSE	222.55	<u>105</u>
CAMPBELL AND KENNEDY ELECTRIC LTD.	M2-171 BANK ST. OTTAWA ON K2P 1W5	NNW	227.71	<u>111</u>
O & Y PROPERTIES INC.	171 BANK STREET L'ESPLANADE LAURIER OTTAWA ON K2P 1W5	NNW	227.71	<u>111</u>
O & Y PROPERTIES INC.	L'ESPLANADE LAURIER 171 BANK STREET OTTAWA ON K2P 1W5	NNW	227.71	<u>111</u>
ROSTRUST INVESTMENTS INC.	171 BANK STREET (L'ESPLANADE LAURIER) OTTAWA ON K2P 1W5	NNW	227.71	<u>111</u>
Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW	230.45	<u>115</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW	230.45	<u>115</u>
Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW	230.45	<u>115</u>
Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW	230.45	<u>115</u>
Budget Car Inc	443 Somerset St. West Ottawa ON	SSW	230.45	<u>115</u>
Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW	230.45	<u>115</u>
Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW	230.45	<u>115</u>
Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW	230.45	<u>115</u>
Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW	230.45	<u>115</u>
Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW	230.45	<u>115</u>
HEALTH AND WELFARE CANADA	HEALTH UNIT#28, 10TH FL., WEST TOWER 300 LAURIER AVE. WEST (TBC) OTTAWA ON K1A 0R5	N	234.18	<u>123</u>
GVT OF CAN- HEALTH&WELFARE CAN.MED. 16-304	SER.BR,UNIT#28,10TH FL. W. TOWER 300 LAURIER AVE. WEST, C/O 301 ELGIN ST OTTAWA ON K1A 0L3	N	234.18	<u>123</u>
HEALTH AND WELFARE CANADA	300 LAURIER AVE. WEST (T.B.C) HEALTH UNIT #28, 10TH FLOOR WEST TOWER	N	234.18	<u>123</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	OTTAWA ON K1A 0R5			
GVT. OF CAN.-SUPPLY AND SERVICES	OLYMPIA PRINTING PLANT,LEVEL P1,W.TOWER L'ESPLANADE LAURIER,300 LAURIER AVE. W OTTAWA ON K1A 0M7	N	234.18	<u>123</u>
GVT. OF CAN.(OUT OF BUS) 18-208	OLYMPIA PRINTING PLANT,LEVEL P1,W.TOWER L'ESPLANADE LAURIER,300 LAURIER AVE. W OTTAWA ON K1A 0M7	N	234.18	<u>123</u>
GVT. OF CAN.(OUT OF BUSINESS)	OLYMPIA PRINTING PLANT,LEVEL P1,W.TOWER L'ESPLANADE LAURIER,300 LAURIER AVE. W OTTAWA ON K1A 0M7	N	234.18	<u>123</u>
Public Works and Government Services Canada	300 Laurier Ave Ottawa ON K0A 0S5	N	234.18	<u>123</u>
Public Works and Government Services Canada	300 Laurier Ave Ottawa ON	N	234.18	<u>123</u>
Public Works and Government Services Canada	300 Laurier Ave Ottawa ON	N	234.18	<u>123</u>
Public Works and Government Services Canada	300 Laurier Ave Ottawa ON	N	234.18	<u>123</u>
Public Works and Government Services Canada	300 Laurier Ave Ottawa ON K0A 0S5	N	234.18	<u>123</u>
Public Works and Government Services Canada	300 Laurier Ave Ottawa ON	N	234.18	<u>123</u>
Public Works and Government Services Canada	300 Laurier Ave Ottawa ON K0A0S5	N	234.18	<u>123</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Public Works and Government Services Canada	300 Laurier Ave Ottawa ON K0A0S5	N	234.18	<u>123</u>
Public Works and Government Services Canada	300 Laurier Ave Ottawa ON K0A0S5	N	234.18	<u>123</u>
Public Services & Procurement Canada RPB	300 Laurier Ave Ottawa ON K0A 0S5	N	234.18	<u>123</u>
Public Services & Procurement Canada RPB	300 Laurier Ave Ottawa ON K0A 0S5	N	234.18	<u>123</u>
Public Services & Procurement Canada RPB	300 Laurier Ave Ottawa ON K0A 0S5	N	234.18	<u>123</u>
Public Services & Procurement Canada	300 Laurier Ave Ottawa ON K0A 0S5	N	234.18	<u>123</u>
Dental Anaesthesia Group	441 MacLaren Street Suite 370 Ottawa ON	S	246.68	<u>143</u>
Sedation Dental Group	Suite 370 441 MacLaren St Ottawa ON K2P 2H3	S	246.68	<u>143</u>
Elevation Elevator Inc.	441 MacLaren Ottawa ON K2P 2R2	S	246.68	<u>143</u>
Sedation Dental Group	Suite 370 441 MacLaren St Ottawa ON K2P 2H3	S	246.68	<u>143</u>
Sedation Dental Group	Suite 370 441 MacLaren St Ottawa ON K2P 2H3	S	246.68	<u>143</u>
Sedation Dental Group	Suite 370 441 MacLaren St Ottawa ON K2P 2H3	S	246.68	<u>143</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Sedation Dental Group	Suite 370 441 MacLaren St Ottawa ON K2P 2H3	S	246.68	<u>143</u>
Dental Anaesthesia Group	Suite 370 441 MacLaren St Ottawa ON K2P 2H3	S	246.68	<u>143</u>
2732685 Ontario Inc.	429 MacLaren Street Ottawa ON K2P 0M7	S	248.25	<u>148</u>
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
J Levinston Holding	212 - 232 Bank st. Ottawa ON K2P 1X1	N	30.51	<u>2</u>
FOCUS CENTRE, THE	254 BANK STREET OTTAWA ON K2P 1X4	SE	59.17	<u>7</u>
Easy Drain Plumbing	254 Bank Str Ottawa ON	SE	59.17	<u>7</u>
DRAICCHIO'S TAILORING & CLEANING	272 BANK STREET OTTAWA ON K2P 1X6	SE	92.70	<u>17</u>
DRAICCHIO'S TAILORING & CLEANING 12-549	272 BANK STREET OTTAWA ON K2P 1X6	SE	92.70	<u>17</u>
DRAICCHIO'S TAILORING & CLEANING	272 BANK STREET OTTAWA ON K2P 1X6	SE	92.70	<u>17</u>
DRAICCHIO'S TAILORING & CLEANING	272 BANK STREET OTTAWA ON K2P 1X6	SE	92.70	<u>17</u>
DRAICCHIO'S TAILORING & CLEANING	272 BANK STREET OTTAWA ON K2P 1X6	SE	92.70	<u>17</u>

DRAICCHIO'S TAILORING & CLEANING	272 BANK STREET OTTAWA ON K2P 1X6	SE	92.70	<u>17</u>
7695713 canada inc.	272 BANK ST OTTAWA ON	SE	92.70	<u>17</u>
7695713 canada inc.	272 BANK ST OTTAWA ON	SE	92.70	<u>17</u>
7695713 canada inc.	272 BANK ST OTTAWA ON K2P1X6	SE	92.70	<u>17</u>
7695713 canada inc.	272 BANK ST OTTAWA ON K2P1X6	SE	92.70	<u>17</u>
7695713 canada inc.	272 BANK ST OTTAWA ON K2P1X6	SE	92.70	<u>17</u>
7695713 canada inc.	272 BANK ST OTTAWA ON K2P1X6	SE	92.70	<u>17</u>
7695713 canada inc.	272 BANK ST OTTAWA ON K2P1X6	SE	92.70	<u>17</u>
7695713 canada inc.	272 BANK ST OTTAWA ON K2P1X6	SE	92.70	<u>17</u>
DOWNTOWN COBBLER DOWNTOWN COBBLER	272 BANK ST OTTAWA ON k2p1x6	SE	92.70	<u>17</u>
Downtown Tailoring	272 BANK ST OTTAWA ON K2P 1X6	SE	92.70	<u>17</u>
Canus Plastics Inc.	300 Lisgar St. Ottawa ON	ENE	104.97	<u>21</u>
Bassi Construction	300 lisgar st ottawa ON K2P 0E2	ENE	104.97	<u>21</u>

GLASER PHARMACY LTD.	267 BANK STREET OTTAWA ON K2P 1X3	ESE	105.36	22
COOPER PHARMACY INC SWIFT COMPOUNDING PHARMACY	276 BANK ST OTTAWA ON K2P 1X6	SE	107.56	23
COOPER PHARMACY INC SWIFT COMPOUNDING PHARMACY	276 BANK ST OTTAWA ON K2P 1X6	SE	107.56	23
COOPER PHARMACY INC	276 BANK ST OTTAWA ON K2P 1X6	SE	107.56	23
E.A.S. ILLUSTRATORS & PRINTERS LTD	171 NEPEAN ST. OTTAWA ON K2P 0B4	N	131.90	41
E.A.S. ILLUSTRATORS & PRINTERS LTD14-740	171 NEPEAN ST. OTTAWA ON K2P 0B4	N	131.90	41
E.A.S. (OUT OF BUS) 14-740	171 NEPEAN ST. OTTAWA ON K2P 0B4	N	131.90	41
ARMCO PRINT 02-638	171 NEPEAN STREET OTTAWA ON K2P 0B4	N	131.90	41
ARMCO PRINT 02-638	171 NEPEAN STREET OTTAWA ON K2P 0B4	N	131.90	41
Claridge Homes Corporation	287 Lisgar Ottawa ON	NE	157.60	63
CLARIDGE HOMES (CENTRETOWN) INC.	287 LISGAR STREET OTTAWA ON	NE	157.60	63
Claridge Homes Limited Partnership	287 Lisgar Street Ottawa ON K2P 0E1	NE	157.60	63
Claridge Homes	287 Lisgar Street Ottawa ON K2P 0E1	NE	157.60	63

City of Ottawa	210 Gloucester Ottawa ON K2P 2K4	NW	167.04	<u>69</u>
City of Ottawa	210 Gloucester Ottawa ON K2P 2K4	NW	167.04	<u>69</u>
City of Ottawa	210 Gloucester Ottawa ON K2P 2K4	NW	167.04	<u>69</u>
City of Ottawa Parks, Bldg & Grounds Services Branch	210 Gloucester Ottawa ON K2P 2K4	NW	167.04	<u>69</u>
City of Ottawa Parks, Bldg & Grounds Services Branch	210 Gloucester Ottawa ON K2P 2K4	NW	167.04	<u>69</u>
City of Ottawa Parks, Bldg & Grounds Services Branch	210 Gloucester Ottawa ON K2P 2K4	NW	167.04	<u>69</u>
City of Ottawa	210 Gloucester Ottawa ON K2P 2K4	NW	167.04	<u>69</u>
Marilena Guerra	146 Nepean Street Ottawa ON	NE	168.08	<u>70</u>
Regional Group	152 Gloucester St Ottawa ON K2P 0A6	NNE	179.80	<u>79</u>
Loblaw Companies Limited	296 Bank St. Ottawa ON K2P 1X8	SE	197.37	<u>92</u>
Loblaw Companies Limited	296 Bank St. Ottawa ON K2P 1X8	SE	197.37	<u>92</u>
LOBLAWS INC.	296 Bank St. Ottawa ON K2P 1X8	SE	197.37	<u>92</u>

LOBLAWS INC.	296 Bank St. Ottawa ON K2P 1X8	SE	197.37	<u>92</u>
LOBLAWS INC.	296 Bank St. Ottawa ON K2P 1X8	SE	197.37	<u>92</u>
LOBLAWS INC.	296 Bank St. Ottawa ON K2P 1X8	SE	197.37	<u>92</u>
DUFRESNE PILING COMPANY (1967) LTD.	380 SOMERSET STREET WEST OTTAWA ON K2P 2R2	SE	197.97	<u>93</u>
GVT. OF CAN. - NATIONAL DEFENCE	CRAD/DSIS-NATIONAL DEFENCE HEADQUARTERS 190 O'CONNOR ST. OTTAWA ON K1A 1G8	NE	199.67	<u>94</u>
GVT. OF CAN. - NATIONAL DEFENCE	190 O'CONNOR STREET DIRECTORATE, SCIENTIFIC INFORMAT.SERVICE OTTAWA ON K1A 1G8	NE	199.67	<u>94</u>
GVT. OF CAN. - NATIONAL DEFENCE 18-192	CRAD/DSIS-NATIONAL DEFENCE HEADQUARTERS 190 O'CONNOR ST. OTTAWA ON K1A 1G8	NE	199.67	<u>94</u>
DEPT. OF NATIONAL DEFENCE	DEFENCE RESEARCH DEVELOPMENT BRANCH 190 O'CONNOR STREET OTTAWA ON K1A 0K2	NE	199.67	<u>94</u>
FOSTER SPORT CENTER	305 BANK STREET OTTAWA ON K2P 1X7	SE	221.56	<u>103</u>
FOSTER SPORT CENTER 15-418	305 BANK STREET OTTAWA ON K2P 1X7	SE	221.56	<u>103</u>
Starlight Investments	340 Laurier Ave West Ottawa ON K1A 0P9	WNW	224.75	<u>107</u>
TNC 340 Laurier Ltd.	340 Laurier Ave West ottawa ON K1A 0P8	WNW	224.75	<u>107</u>

TNC 340 Laurier Ltd	340 Laurier Ottawa ON K1A 0P9	WNW	224.75	107
Epic Realty Partners	340 Laurier Ave. Ottawa ON K1P 5K3	WNW	224.75	107
Demo Core	340 Laurier Ave. Ottawa ON K1A 0P9	WNW	224.75	107
340 TNC Laurier Ltd.	340 Laurier Avenue Ottawa ON K1A 0P9	WNW	224.75	107
340 TNC Laurier Ltd.	340 Laurier Avenue Ottawa ON K1A 0P9	WNW	224.75	107
JER OTTAWA ULC	340 LAURIER AVENUE WEST OTTAWA ON K1A 0P9	WNW	224.75	107
JER OTTAWA ULC	340 LAURIER AVENUE WEST SIR WILFRID LAURIER BUILDING OTTAWA ON K1A 0P9	WNW	224.75	107
OTTAWA 340 LAURIER AVENUE WEST INC.	340 LAURIER AVENUE WEST OTTAWA ON K1A 0P9	WNW	224.75	107
Public Works and Government Services Canada	340 Laurier Street Ottawa ON K1P 5K3	WNW	224.75	107
Public Works and Government Services Canada	340 Laurier Street Ottawa ON	WNW	224.75	107
B. Surani Drugs Ltd. (910)	174 BANK ST OTTAWA ON K1P 5N7	NW	228.14	112
B. Surani Drugs Ltd. (910)	174 BANK ST OTTAWA ON K1P 5N7	NW	228.14	112

B. Surani Drugs Ltd. (910)	174 BANK ST OTTAWA ON K1P 5N7	NW	228.14	112
B. Surani Drugs Ltd. (910)	174 BANK ST OTTAWA ON K1P 5N7	NW	228.14	112
B. Surani Drugs Ltd. (910)	174 BANK ST OTTAWA ON K1P 5N7	NW	228.14	112
B. Surani Drugs Ltd. (910)	174 BANK ST OTTAWA ON K1P 5N7	NW	228.14	112
EnviroCentre	326 Somerset St. West Ottawa ON K2P 0J9	ESE	228.37	113
Shell Canada Products	154 O+Connor Street Ottawa ON K2P 1T5	NNE	234.32	124
Shell Canada Products	154 O+Connor Street Ottawa ON K2P 1T5	NNE	234.32	124
Taggart Corporation Ltd.	257 Lisgar Street Ottawa ON K2P 0C7	ENE	245.96	140
Taggart Group Ltd	257 Lisgar St Ottawa ON K2P1P0	ENE	245.96	140
HEALTH AND WELFARE CANADA	HEALTH UNIT#31, 2ND FL., NORONO BLDG. 360 LAURIER AVE. WEST (HWC) OTTAWA ON K1P 1C8	WNW	248.07	146
GVT OF CAN- HEALTH&WELFARE CAN.MED. 16-305	SER.BR,UNIT#31,2ND FL.,NORONO BLDG. 360 LAURIER AVE. WEST,C/O 301 ELGIN ST OTTAWA ON K1P 1C8	WNW	248.07	146
HEALTH AND WELFARE CANADA	360 LAURIER AVE. WEST (HWC) HEALTH UNIT #31, 2ND FLOOR, NORONO BLDG. OTTAWA ON K1P 5K3	WNW	248.07	146

HINC - TSSA Historic Incidents

A search of the HINC database, dated 2006-June 2009* has found that there are 2 HINC site(s) within approximately 0.25 kilometers of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	338 SOMERSET STREET WEST OTTAWA ON	ESE	224.49	<u>106</u>
	322 SOMERSET STREET WEST OTTAWA ON	ESE	235.67	<u>127</u>

INC - Fuel Oil Spills and Leaks

A search of the INC database, dated 31 Oct, 2023 has found that there are 2 INC site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	212 Bank Street , Ottawa ON	NNW	71.10	<u>10</u>

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	384 MacLaren Street, Ottawa ON	SE	248.87	<u>151</u>

NPCB - National PCB Inventory

A search of the NPCB database, dated 1988-2008* has found that there are 5 NPCB site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
SEALTEST	DIVISION OF AULT FOODS; 453 COOPER STREET OTTAWA ON K2P 0H1	SW	142.54	<u>49</u>
OLYMPIA & YORK DEVELOPMENTS LTD.	L'ESPLANADE LAURIER; 171 BANK STREET LEVEL II OTTAWA ON K2P 1W5	NNW	227.71	<u>111</u>
ROSTRUST INVESTMENTS INC.	171 BANK STREET LEVEL II BANK STREET LEVEL II OTTAWA ON	NNW	227.71	<u>111</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
ROSTRUST INVESTMENTS INC.	171 BANK STREET LEVEL 2 L'Esplanade Laurier Ottawa ON K2P 1W5	NNW	227.71	111
ROSTRUST INVESTMENTS INC.	L'ESPLANADE LAURIER 171 BANK STREET LEVEL II OTTAWA ON K2P 1W5	NNW	227.71	111

NPRI - National Pollutant Release Inventory - Historic

A search of the NPRI database, dated 1993-May 2017 has found that there are 1 NPRI site(s) within approximately 0.25 kilometers of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
O&Y ENTERPRISE	340 LAURIER Avenue West OTTAWA ON K1A0P8	WNW	224.75	107

OOGW - Ontario Oil and Gas Wells

A search of the OOGW database, dated 1800-Aug 2024 has found that there are 1 OOGW site(s) within approximately 0.25 kilometers of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Ottawa Dairy Well	Nepean ON <i>Licence No:</i> F019784	SE	157.14	60

PES - Pesticide Register

A search of the PES database, dated Oct 2011-Oct 31, 2024 has found that there are 12 PES site(s) within approximately 0.25 kilometers of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P1X8	SE	197.37	92
HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P1X8	SE	197.37	92
HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P1X8	SE	197.37	92

LOBLAWS INC O/A BANK STREET YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P1X8	SE	197.37	<u>92</u>
MASSINE ENTERPRISES INC. O/A MASSINE'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P1X8	SE	197.37	<u>92</u>
HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P 1X8	SE	197.37	<u>92</u>
HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P 1X8	SE	197.37	<u>92</u>
HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P 1X8	SE	197.37	<u>92</u>
HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK STREET OTTAWA ON K2P 1X8	SE	197.37	<u>92</u>
HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK STREET OTTAWA ON K2P 1X8	SE	197.37	<u>92</u>
SHOPPERS DRUG MART #988	174 BANK ST OTTAWA ON K2P1W6	NW	228.14	<u>112</u>
SHOPPERS DRUG MART #988	174 BANK ST OTTAWA ON K2P1W6	NW	228.14	<u>112</u>

PINC - Pipeline Incidents

A search of the PINC database, dated Feb 28, 2021 has found that there are 3 PINC site(s) within approximately 0.25 kilometers of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
ENBRIDGE GAS INC	142 NEPEAN ST.,OTTAWA,ON,K2P 2N2,CA ON	NE	180.40	<u>80</u>

PIPELINE HIT 1"	331 COOPER ST,,OTTAWA,ON,K2P 0G5,CA ON	ENE	246.38	142
KEN RALPH	231 O'CONNOR ST,,OTTAWA,ON, K2P 1T8,CA ON	E	248.42	149

PRT - Private and Retail Fuel Storage Tanks

A search of the PRT database, dated 1989-1996* has found that there are 4 PRT site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
SOMERSET SUNOCO	429 SOMERSET ST OTTAWA ON K2P0K1	SSW	188.98	86
BUDGET CAR & TRUCK RENTALS OF OTTAWA	443 SOMERSET ST W OTTAWA ON K1R 5J7	SSW	230.45	115

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
BYTOWN TOWING & AUTOCARE LTD	154 O CONNOR ST AT GLOUCESTER OTTAWA ON	NNE	234.32	124
I C ASSALY CONSTRUCTION	199 KENT ST OTTAWA ON K2P2K8	WNW	247.96	145

PTTW - Permit to Take Water

A search of the PTTW database, dated 1994 - Nov 30, 2024 has found that there are 1 PTTW site(s) within approximately 0.25 kilometers of the project property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Claridge Homes (287 Lisgar) Inc.	287 Lisgar Street City of Ottawa, Ontario CITY OF OTTAWA ON	NE	157.60	63

RSC - Record of Site Condition

A search of the RSC database, dated 1997-Sept 2001, Oct 2004-Nov 2024 has found that there are 7 RSC site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Youth Services Bureau of Ottawa	433 COOPER ST/366 LISGAR STREET, OTTAWA ON	SW	77.03	<u>13</u>
Charlesfort Development Corporation	235 and 245 Kent Street, Ottawa, Ontario, K2P 1Z9 OTTAWA ON	W	176.64	<u>77</u>
Avraham Holdings Inc.	443 SOMERSET ST W ON OTTAWA ON	SSW	230.45	<u>115</u>
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Soho Lisgar Inc.	300 Lisgar Street, Ottawa, Ontario, K2P 1T6 OTTAWA ON	ENE	85.78	<u>16</u>
CLARIDGE HOMES (287 LISGAR) INC.	287 LISGAR STREET ON Ottawa ON	NE	157.60	<u>63</u>
Ambassador-Mondrian Inc.	324 LAURIER AVE W ON OTTAWA ON	NW	244.03	<u>137</u>
OTT A360 LAURIER INC.	360 Laurier AVE W Ottawa ON	WNW	248.07	<u>146</u>

SCT - Scott's Manufacturing Directory

A search of the SCT database, dated 1992-Mar 2011* has found that there are 26 SCT site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
COOKWARE CENTRE (THE)	220 BANK ST OTTAWA ON K2P 1X1	NNW	59.81	<u>8</u>
CAPITAL XTRA INC.	177 NEPEAN ST SUITE 500 OTTAWA ON K2P 0B4	N	125.87	<u>36</u>
Cdn Council Tobacco Control	192 Bank St Ottawa ON K2P 1W8	NW	154.93	<u>57</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
O'Brien Publishing Inc.	176 Gloucester St Suite 400 Ottawa ON K2P 0A6	NNW	172.42	<u>75</u>
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
WALLACK'S ART & DRAFTING	231 BANK ST OTTAWA ON K2P 1W9	N	56.04	<u>5</u>
Akiva Publishing Inc.	251 Bank St Suite 206 Ottawa ON K2P 1X3	ESE	67.86	<u>9</u>
McKenzie Publishing Inc.	251A Bank St Suite 500 Ottawa ON K2P 1X3	ESE	67.86	<u>9</u>
Capital Xtra - Div. of Pink	251 Bank St Unit 503 Ottawa ON K2P 1X3	ESE	67.86	<u>9</u>
Canadian Bible Society	315 Lisgar St Ottawa ON K2P 0E1	NE	79.69	<u>14</u>
Canus Signs Plastics Ltd.	300 Lisgar St Ottawa ON K2P 0E2	ENE	85.78	<u>16</u>
Canus Plastics Inc.	300 Lisgar St Ottawa ON K2P 0E2	ENE	85.78	<u>16</u>
Ottawa X Press	396 Cooper St Suite 204 Ottawa ON K2P 2H7	ESE	122.71	<u>33</u>
Imagnan Corp.	396 Cooper St Suite 203 Ottawa ON K2P 2H7	ESE	122.71	<u>33</u>
Communications Voir Inc.	396 Cooper St Suite 204 Ottawa ON K2P 2H7	ESE	122.71	<u>33</u>

Communications Voir Inc.	396 Cooper St Suite 204 Ottawa ON K2P 2H7	ESE	122.71	<u>33</u>
The Ottawa X Press - Div. of Communications Voir Inc.	396 Cooper St Suite 204 Ottawa ON K2P 2H7	ESE	122.71	<u>33</u>
The Ottawa Xpress	396 Cooper St Suite 204 Ottawa ON K2P 2H7	ESE	122.71	<u>33</u>
To Be Publications Inc.	207 Bank St Ottawa ON K2P 2N2	N	137.46	<u>47</u>
JacintalInk	207 Bank St Suite 242 Ottawa ON K2P 2N2	N	137.46	<u>47</u>
Biz Point Inc.	273 Bank St Ottawa ON K2P 1X5	ESE	145.98	<u>53</u>
Koffman Signs Ltd.	146 Nepean St Ottawa ON K2P 0B6	NE	168.08	<u>70</u>
KOFFMAN SIGNS	146 NEPEAN ST OTTAWA ON K2P 0B6	NE	168.08	<u>70</u>
Canadian Council on Social	190 O'Connor St Suite 100 Ottawa ON K2P 2R3	NE	199.67	<u>94</u>
whatif? Technologies Inc.	338 Somerset St W Unit 3 Ottawa ON K2P 0J9	ESE	224.49	<u>106</u>
CDIA Report Newsletter	338 Somerset St W Unit 4 Ottawa ON K2P 0J9	ESE	224.49	<u>106</u>
Soundmaster Ltd.	386 MacLaren St Ottawa ON K2P 0M8	SE	249.40	<u>152</u>

SPL - Ontario Spills

A search of the SPL database, dated 1988-Jun 2024; Aug 2024; Oct 2024 has found that there are 27 SPL site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	222 Nepean Street, Ottawa Ottawa ON	WNW	73.58	<u>11</u>
Enbridge Gas Distribution Inc.	Bank St and Nepean St Ottawa ON	NNW	100.12	<u>20</u>
PRIVATE RESIDENCE	177 NIPEON STREET FURNACE OIL TANK OTTAWA CITY ON	N	125.87	<u>36</u>
AULT FOODS	453 COOPER ST.AT KENT ST. OTTAWA OTTAWA DAIRY OTTAWA CITY ON K2P 0H1	SW	142.54	<u>49</u>
AULT FOODS	453 COOPER STREET OTTAWA WINCHESTER 490 GORDON STREET OTTAWA CITY ON K2P 0H1	SW	142.54	<u>49</u>
	239 Nepean St OTTAWA ON	W	163.59	<u>65</u>
TRANSPORT TRUCK	KENT ST & COOPER ST. MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON	SW	187.97	<u>85</u>
	290-292 Kent Street UTM Zone:18 Easting:445333.64 Northing: 5029231.41 Ottawa ON	SW	218.95	<u>100</u>
UNKNOWN	SOMERSET AND KENT STREET OTTAWA CITY ON	SSW	232.98	<u>119</u>
	in front of 300 Laurier Avenue<UNOFFICIAL> Ottawa ON	N	234.18	<u>123</u>

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
PRIVATE BUSINESS	232 BANK ST STORAGE TANK OTTAWA ON K2P 1X1	N	30.51	<u>2</u>
OTTAWA HYDRO	375 COOPER STREET TRANSFORMER OTTAWA CITY ON K2P 0G8	E	134.34	<u>46</u>
Claridge Homes (Carson) Inc.	287 Lisgar Avenue Ottawa ON K2P 1K8	NE	157.60	<u>63</u>
296 Bank Street	296 Bank Street OTTAWA ON	SE	197.37	<u>92</u>
Parson Refrigeration (1985) Ltd.	296 Bank St Ottawa ON	SE	197.37	<u>92</u>
Parson Refrigeration (1985) Ltd.	296 Bank St. Ottawa ON K2P 1X8	SE	197.37	<u>92</u>
	296 Bank Street, Ottawa ON	SE	197.37	<u>92</u>
Enbridge Gas Distribution Inc.	338 Sommerset West Ottawa ON	ESE	224.49	<u>106</u>
PRIVATE BUSINESS	340 LAURIER AVE (N.O.S.) OTTAWA CITY ON	WNW	224.75	<u>107</u>
DARLING INTERNATIONAL CANADA INC.	OTTAWA ON	NNE	225.74	<u>108</u>
PRIVATE OWNER	220 KENT ST MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON	W	233.27	<u>120</u>
SHELL CANADA PRODUCTS LTD.	154 O'CONNOR ST. SHELL CANADA GAS STATION SERVICE STATION OTTAWA CITY ON K2P 1T5	NNE	234.32	<u>124</u>

SHELL CANADA PRODUCTS LTD.	154 O'CONNER STREET SERVICE STATION OTTAWA CITY ON	NNE	234.32	124
Enbridge Gas Distribution Inc.	331 Cooper St. Ottawa ON	ENE	246.38	142
Kent Towers<UNOFFICIAL>	199 Kent st Ottawa ON	WNW	247.96	145
PRIVATE OWNER	280 GLOUCESTER ST(ST. PATRICK CHURCH) STORAGE TANK/BARREL OTTAWA CITY ON K1R 5E4	W	248.21	147
Enbridge Gas Distribution Inc.	384 MacLaren St Ottawa ON K2P 0M8	SE	248.87	151

WWIS - Water Well Information System

A search of the WWIS database, dated Dec 31 2023 has found that there are 34 WWIS site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	195 BANK ST. OTTAWA ON <i>Well ID:</i> 7246053	NNW	145.09	50
	ON <i>Well ID:</i> 1503876	NW	145.22	51
	281 kent st Ottawa ON <i>Well ID:</i> 7354243	SW	167.02	68
	281 kent st Ottawa ON <i>Well ID:</i> 7354245	SW	187.37	84
	81 kent st Ottawa ON <i>Well ID:</i> 7354244	SW	195.27	91

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	429 MC LEARN Ottawa ON <i>Well ID: 7233874</i>	S	218.40	<u>99</u>
	429 MC LEARN OTTAWA ON <i>Well ID: 7233875</i>	S	231.07	<u>117</u>
	KENT ST Ottawa ON <i>Well ID: 7344660</i>	SSW	232.46	<u>118</u>
	19 MCLAREN ON <i>Well ID: 7233876</i>	S	235.93	<u>128</u>
	KENT ST Ottawa ON <i>Well ID: 7344655</i>	SSW	236.33	<u>129</u>
	ON <i>Well ID: 7211109</i>	SSW	245.64	<u>139</u>
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON <i>Well ID: 7296899</i>	NNE	120.08	<u>29</u>
	355 COOPER ST OTTAWA ON <i>Well ID: 7305580</i>	ENE	126.36	<u>37</u>
	355 COOPER ST OTTAWA ON <i>Well ID: 7305582</i>	ENE	133.08	<u>42</u>
	355 COOPER ST OTTAWA ON <i>Well ID: 7305579</i>	ENE	133.38	<u>44</u>
	315 COOPER ST Ottawa ON <i>Well ID: 7312996</i>	E	146.92	<u>55</u>

355 COOPER ST OTTAWA ON <i>Well ID:</i> 7305581	ENE	156.82	<u>59</u>
KENT ST Ottawa ON <i>Well ID:</i> 7344656	WSW	164.80	<u>67</u>
SOMERSET ROADWAY OTTAWA ON <i>Well ID:</i> 1535586	ESE	168.56	<u>74</u>
296 BANK ST. OTTAWA ON <i>Well ID:</i> 7246842	SE	186.43	<u>83</u>
296 BANK ST. OTTAWA ON <i>Well ID:</i> 7246843	SE	186.43	<u>83</u>
355 COOPER ST Ottawa ON <i>Well ID:</i> 7312995	ENE	189.56	<u>87</u>
338 SOMERSET STREET WEST OTTAWA ON <i>Well ID:</i> 7046637	ESE	206.06	<u>95</u>
154 O'CONNOR STREET Ottawa ON <i>Well ID:</i> 7130914	NNE	207.00	<u>96</u>
311 SOMERSET Ottawa ON <i>Well ID:</i> 7391114	E	210.21	<u>97</u>
311 SOMERSET Ottawa ON <i>Well ID:</i> 7391113	E	217.64	<u>98</u>
311 Somerset St W Ottawa ON <i>Well ID:</i> 7382859	E	219.40	<u>101</u>
154 O'CONNOR ST Ottawa ON <i>Well ID:</i> 7139448	NNE	230.88	<u>116</u>
311 SONERSET Ottawa ON	E	233.51	<u>121</u>

Well ID: 7391115

ON	NE	234.03	<u>122</u>

Well ID: 7391814

311 Somerset St W Ottawa ON	E	235.66	<u>126</u>

Well ID: 7382782

ON	E	237.32	<u>130</u>


Well ID: 7211110

KENT ST Ottawa ON	W	238.72	<u>132</u>

Well ID: 7344659

311 SOMERSET Ottawa ON	E	240.21	<u>133</u>

Well ID: 7391112

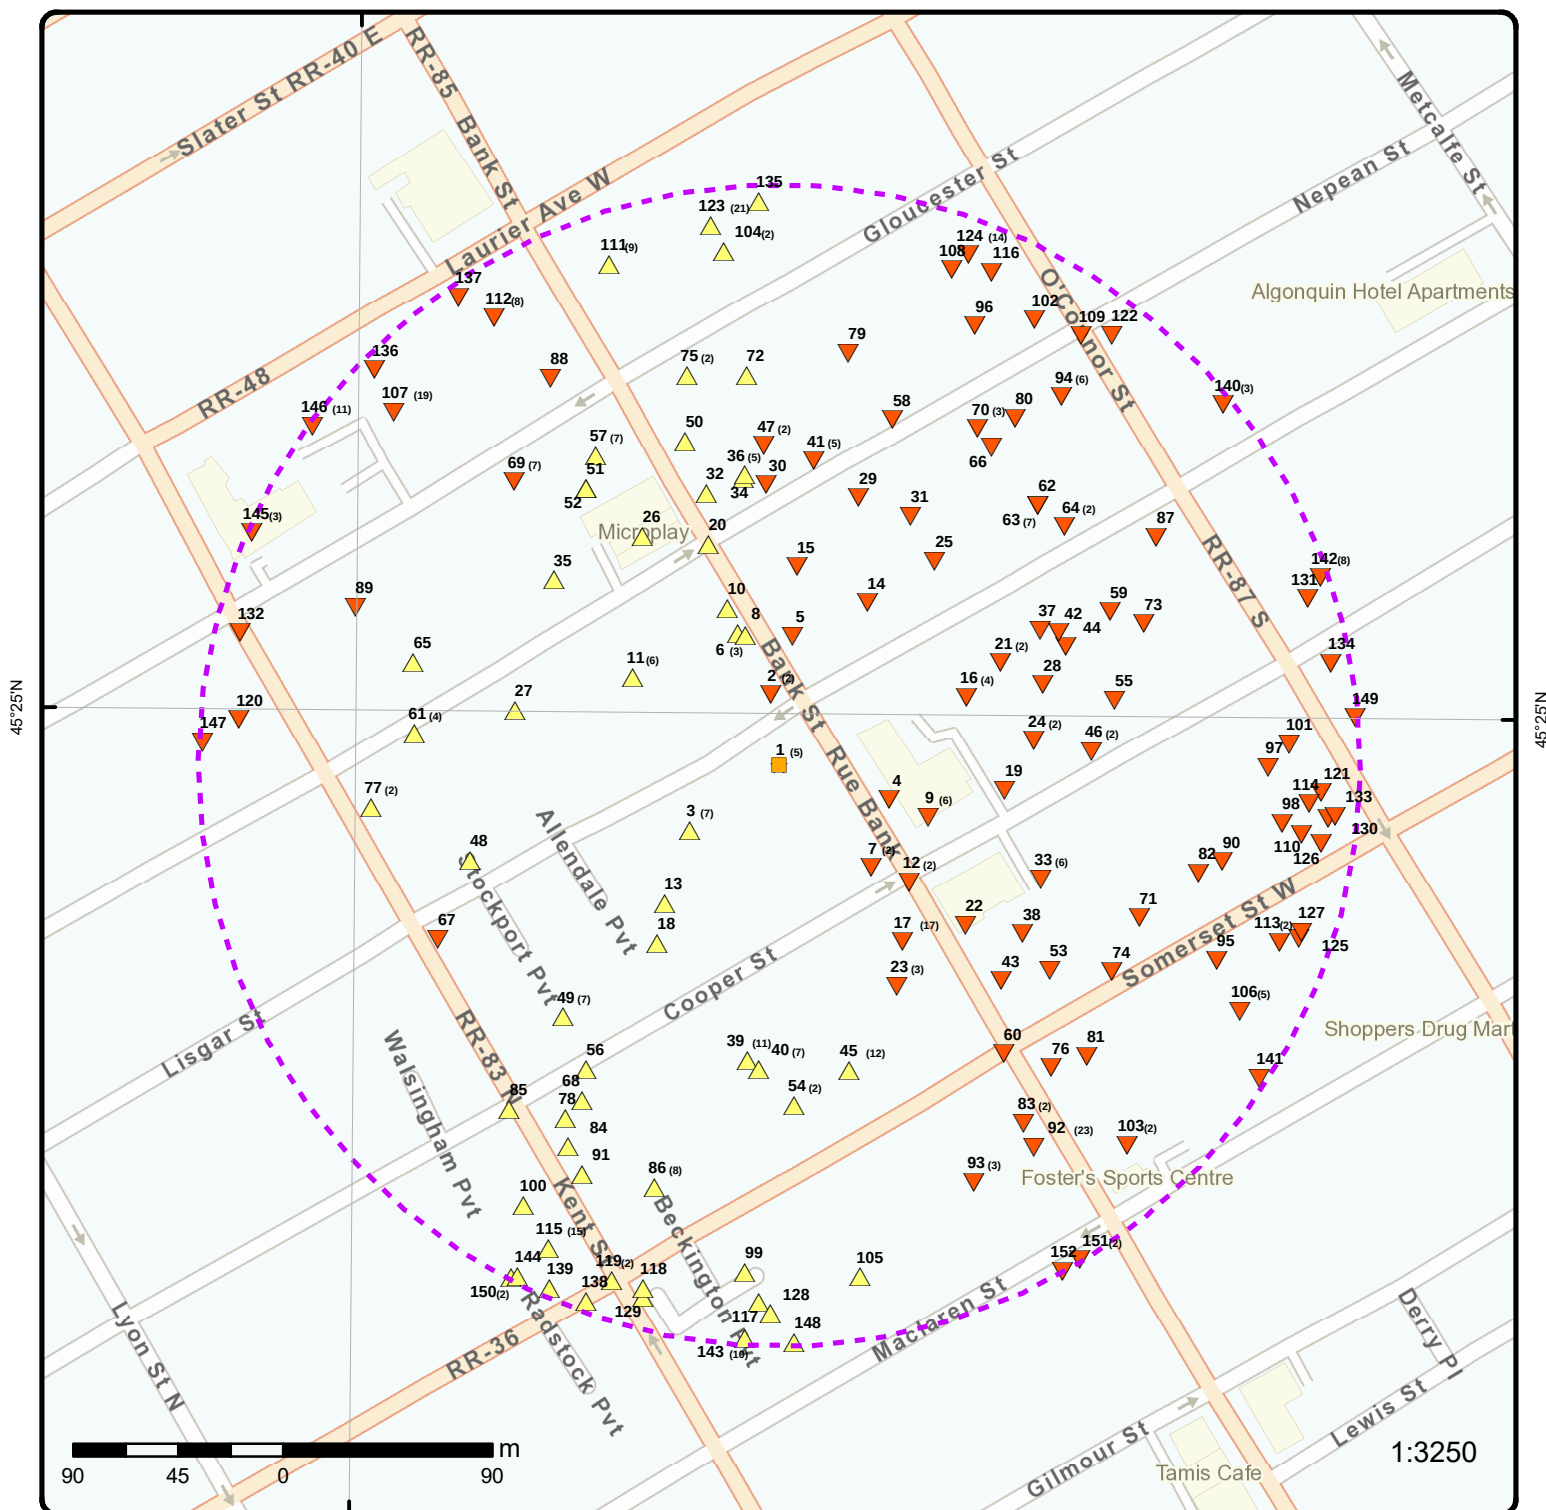

Map: 0.25 Kilometer Radius

Order Number: 25011400345

Address: 240 Bank Street, Ottawa, ON




★ Project Property	Freeways; Highways	Beach	Shopping & Sports Area
--- Buffer Outline	Traffic Circle; Ramp	Airport	University/College
▲ Eris Sites with Higher Elevation	Major Arterial; Minor Arterial	Industrial Area	Cemetery; Golf Course
■ Eris Sites with Same Elevation	Local Road	Military Base	Parkt (National)
▼ Eris Sites with Lower Elevation	Service Road; Traffic Circle; Ramp	Aircraft Roads	Park (City/County)
○ Eris Sites with Unknown Elevation	Rail	Native Reservation	
		Hospital	

75°42'W

45°25'30"N

45°25'30"N

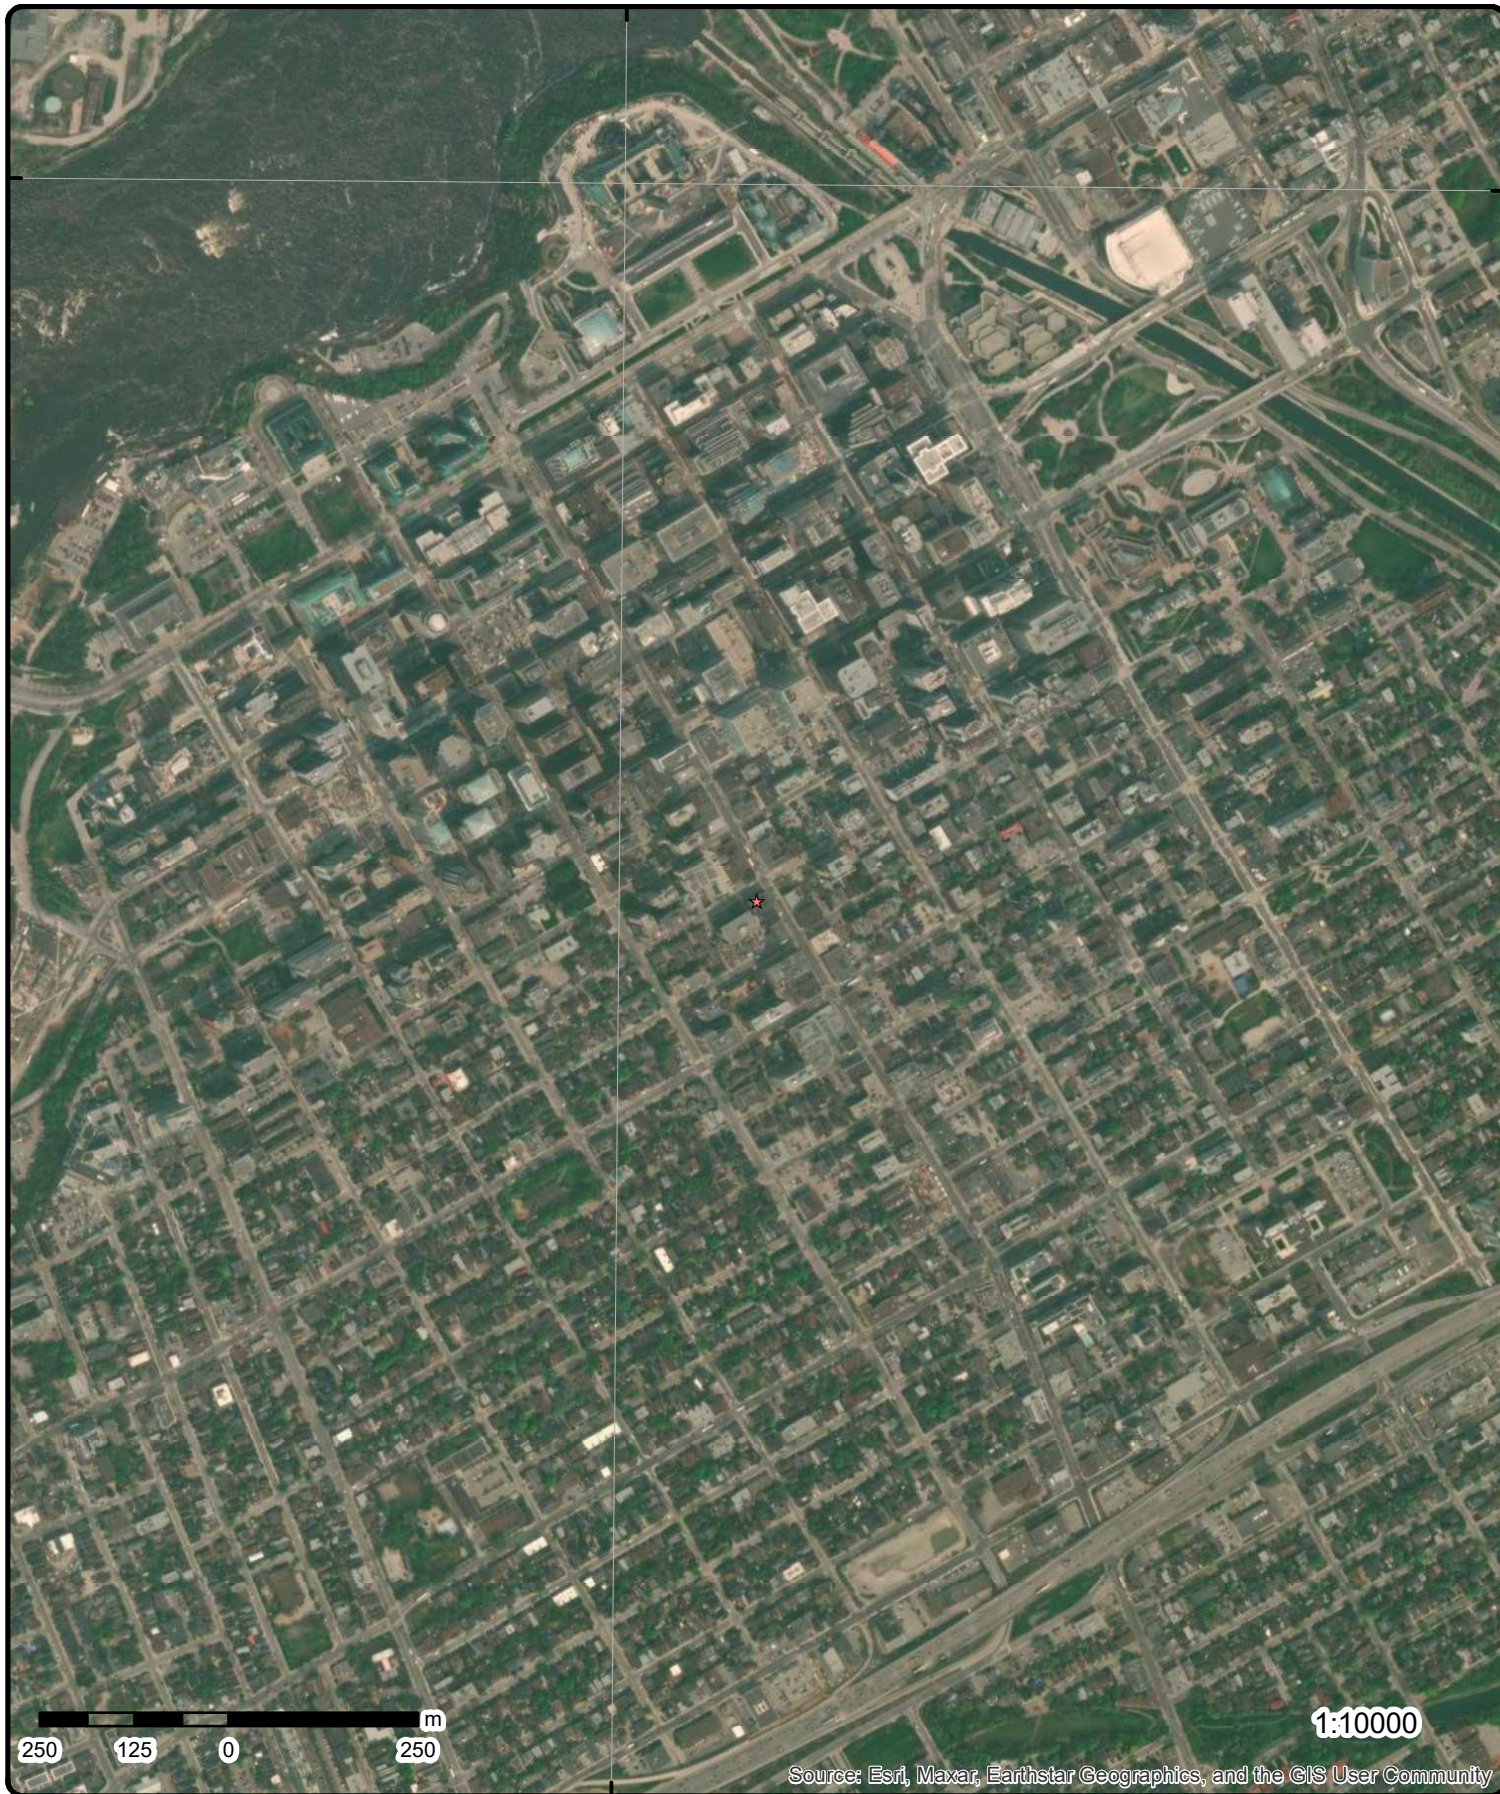

Aerial

Year: 2023

Order Number: 25011400345

Address: 240 Bank Street, Ottawa, ON



Source: ESRI World Imagery

© ERIS Information Limited Partnership

75°43'30"W

75°42'W


75°40'30"W

45°25'30"N

45°25'30"N

45°24'N

45°24'N

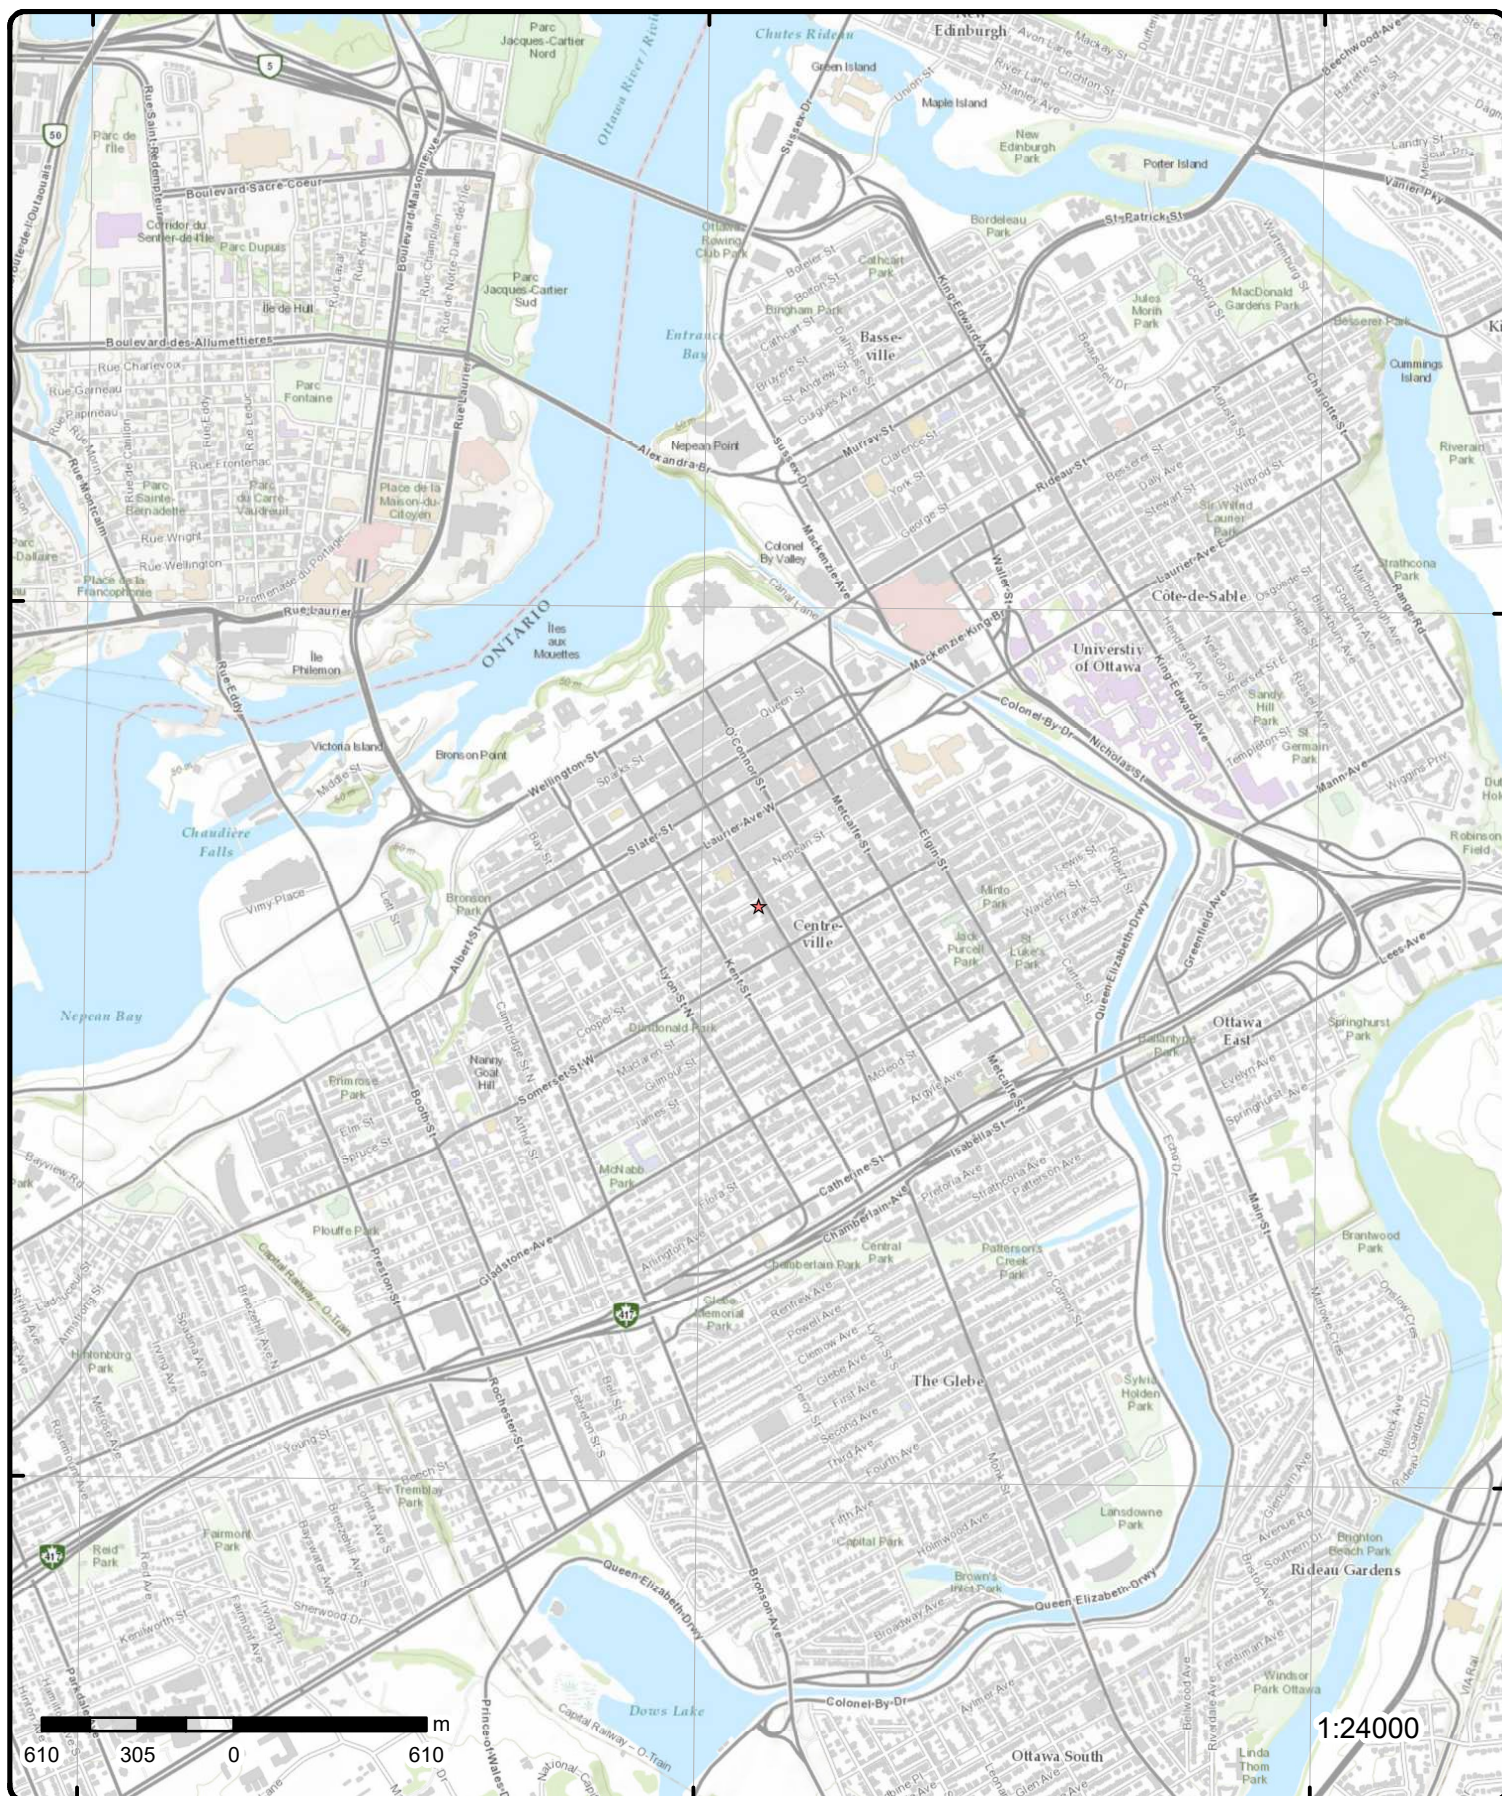

Topographic Map

Address: 240 Bank Street, ON

Source: ESRI World Topographic Map

Order Number: 25011400345



© ERIS Information Limited Partnership

Detail Report

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
1	1 of 5	-/0.0	77.8 / 0.00	240 Bank Street Ottawa ON K2P 1X4	EHS
Order No: 20050923002 Status: C Report Type: Basic Report Report Date: 10/3/2005 Date Received: 9/23/2005 Previous Site Name: Lot/Building Size: Additional Info Ordered: Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -75.697626 Y: 45.416523					
1	2 of 5	-/0.0	77.8 / 0.00	240 Bank Street Ottawa ON K2P 1X4	EHS
Order No: 20120207002 Status: C Report Type: Custom Report Report Date: 2/13/2012 9:30:56 AM Date Received: 2/7/2012 9:28:54 AM Previous Site Name: Lot/Building Size: Additional Info Ordered: Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -75.697546 Y: 45.416509					
1	3 of 5	-/0.0	77.8 / 0.00	Al's Care Pharmacy 240 Bank Street Ottawa ON K2P1X4	GEN
Generator Info Generator No: ON2848712 Approval Years: 2014 Status: PO Box No: Country: Canada Co Admin: Julia Moussa Phone No Admin: 6134222900 Ext. SIC Description: 446110 Choice of Contact: CO_ADMIN Contaminated Fac: No MHSW Facility: No SIC Code: 446110					
Waste Detail(s) Waste Class: 261 Waste Class Name: PHARMACEUTICALS					
Waste Detail(s) Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>1</u>	4 of 5	-/0.0	77.8 / 0.00	240 Bank Street Ottawa ON K2P 1X4	EHS
Order No: 20181010039		Nearest Intersection:			
Status: C		Municipality:			
Report Type: Standard Report		Client Prov/State: ON			
Report Date: 15-OCT-18		Search Radius (km): .25			
Date Received: 10-OCT-18		X: -75.697626			
Previous Site Name:		Y: 45.41644			
Lot/Building Size:					
Additional Info Ordered:					
<u>1</u>	5 of 5	-/0.0	77.8 / 0.00	240 Bank Street Ottawa ON K2P 1X4	EHS
Order No: 20200224086		Nearest Intersection:			
Status: C		Municipality:			
Report Type: Standard Report		Client Prov/State: ON			
Report Date: 27-FEB-20		Search Radius (km): .25			
Date Received: 24-FEB-20		X: -75.6976257			
Previous Site Name:		Y: 45.41644			
Lot/Building Size:					
Additional Info Ordered:					
<u>2</u>	1 of 2	N/30.5	77.6 / -0.24	PRIVATE BUSINESS 232 BANK ST STORAGE TANK OTTAWA ON K2P 1X1	SPL
Ref No: 186320		Municipality No: 20107			
Year:		Nature of Damage:			
Incident Dt: 9/7/2000		Discharger Report:			
Dt MOE Arvl on Scn:		Material Group:			
MOE Reported Dt: 9/8/2000		Impact to Health:			
Dt Document Closed:		Agency Involved:			
Site No:					
MOE Response:					
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					
Site Name:					
Site Address:					
Site Region:					
Site Municipality: OTTAWA					
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:					
Client Type:					
Source Type:					
Incident Cause: OTHER CONTAINER LEAK					
Incident Preceding Spill:					
Incident Reason: DAMAGE BY MOVING EQUIPMENT					
Incident Summary: COM/LEV/VIN: LEAK FROM OIL TANK 5L TO GND. CLEAN-ED.					
Environment Impact: NOT ANTICIPATED					
Health Env Consequence:					
Nature of Impact:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: LAND Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:					
2	2 of 2	N/30.5	77.6 / -0.24	J Levinston Holding 212 - 232 Bank st. Ottawa ON K2P 1X1	GEN
<u>Generator Info</u>					
Generator No:	ON3771486			Choice of Contact:	
Approval Years:	2010			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	236110
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	Residential Building Construction				
<u>Waste Detail(s)</u>					
Waste Class:	211				
Waste Class Name:	AROMATIC SOLVENTS				
<u>Waste Detail(s)</u>					
Waste Class:	221				
Waste Class Name:	LIGHT FUELS				
3	1 of 7	WSW/47.6	77.9 / 0.07	REVENUE CANADA TAXATION CUSTOMS & EXCISE 360 LISGAR STREET OTTAWA ON K2P 2E4	GEN
<u>Generator Info</u>					
Generator No:	ON0426519			Choice of Contact:	
Approval Years:	94,95,96,97,98			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	8153
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	TAXATION ADMIN.				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>3</u>	2 of 7	WSW/47.6	77.9 / 0.07	REVENUE CANADA TAXATION 360 LISGAR STREET OTTAWA ON K1A 0L9	GEN
<u>Generator Info</u>					
Generator No:	ON0426519			Choice of Contact:	
Approval Years:	99,00,01			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	8153
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		TAXATION ADMIN.			
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>3</u>	3 of 7	WSW/47.6	77.9 / 0.07	URBAN DALE CORPORATION 360 Lisgar Street Ottawa ON	GEN
<u>Generator Info</u>					
Generator No:	ON2940601			Choice of Contact:	
Approval Years:	03,04,05			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		242			
Waste Class Name:		HALOGENATED PESTICIDES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>3</u>	4 of 7	WSW/47.6	77.9 / 0.07	Bell Canada 360 Lisgar st Ottawa ON K2P 2E4	GEN
<u>Generator Info</u>					
Generator No:	ON2601606			Choice of Contact:	CO_ADMIN
Approval Years:	2015			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	517110, 517210, 517510
Country:	Canada				
Co Admin:	Julie Labelle				
Phone No Admin:	514-870-0688 Ext.				
SIC Description:	WIRED TELECOMMUNICATIONS CARRIERS, WIRELESS TELECOMMUNICATIONS CARRIERS (EXCEPT SATELLITE), 517510				
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			

<u>3</u>	5 of 7	WSW/47.6	77.9 / 0.07	Bell Canada 360 Lisgar st Ottawa ON K2P 2E4	GEN
<u>Generator Info</u>					
Generator No:	ON2601606			Choice of Contact:	CO_ADMIN
Approval Years:	2016			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	517110, 517210, 517510

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Country: Canada					
Co Admin: Chloé Labelle					
Phone No Admin: 514-391-1021 Ext.					
SIC Description: WIRED TELECOMMUNICATIONS CARRIERS, WIRELESS TELECOMMUNICATIONS CARRIERS (EXCEPT SATELLITE), 517510					
<u>Waste Detail(s)</u>					
Waste Class: 251					
Waste Class Name: OIL SKIMMINGS & SLUDGES					
<u>Waste Detail(s)</u>					
Waste Class: 121					
Waste Class Name: ALKALINE WASTES - HEAVY METALS					
<u>Waste Detail(s)</u>					
Waste Class: 331					
Waste Class Name: WASTE COMPRESSED GASES					
<u>Waste Detail(s)</u>					
Waste Class: 112					
Waste Class Name: ACID WASTE - HEAVY METALS					

<u>3</u>	6 of 7	WSW/47.6	77.9 / 0.07	BELLCANADA 360 LISGAR STREET OTTAWA ON K2P 2E4	GEN

Generator Info

Generator No:	ON6704214	Choice of Contact:	CO_OFFICIAL
Approval Years:	2014	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	237130
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:	POWER AND COMMUNICATION LINE AND RELATED STRUCTURES CONSTRUCTION		

Waste Detail(s)

Waste Class:	252
Waste Class Name:	WASTE OILS & LUBRICANTS

<u>3</u>	7 of 7	WSW/47.6	77.9 / 0.07	Bell Canada 360 Lisgar st Ottawa ON K2P 2E4	GEN

Generator Info

Generator No:	ON2601606	Choice of Contact:	
Approval Years:	As of Dec 2018	Contaminated Fac:	
Status:	Registered	MHSW Facility:	
PO Box No:		SIC Code:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		121 C			
Waste Class Name:		Alkaline slutions - containing heavy metals			
<u>Waste Detail(s)</u>					
Waste Class:		112 C			
Waste Class Name:		Acid solutions - containing heavy metals			
<u>Waste Detail(s)</u>					
Waste Class:		146 T			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
<u>Waste Detail(s)</u>					
Waste Class:		251 L			
Waste Class Name:		Waste oils/sludges (petroleum based)			
<u>Waste Detail(s)</u>					
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			
<u>2017 Generator Info</u>					
Gen No:	ON2601606	Choice of Contact:		CO_ADMIN	
ID:	10396	Phone No Official:		514-870-6540 Ext.	
Contaminated Fac:	N	Phone No Admin:		514-391-1021 Ext.	
MHSW Facility:	N	County Ont:		OTTAWA CARLTON (RM)	
NAICS Code1:	517110	County Out:			
NAICS Code2:	517210	District:		402	
NAICS Code3:	517510				
Gen Name:	Bell Canada				
Gen Div:					
Gen Op Name:	Bell Canada				
Gen Op Div:					
Site Adrs1:	360 Lisgar st				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K2P 2E4				
Site Country:	Canada				
Co Official:	Martin Girard				
Co Admin:	Chlo� Labelle				
<u>2018 Generator Info</u>					
Gen No:	ON2601606	Choice of Contact:		CO_ADMIN	
ID:	10152	Phone No Official:		514-870-6540 Ext.	
Contaminated Fac:	N	Phone No Admin:		514-391-1021 Ext.	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MHSW Facility: N NAICS Code1: 517110 NAICS Code2: 517210 NAICS Code3: 517510 Gen Name: Bell Canada Gen Div: Gen Op Name: Bell Canada Gen Op Div: Site Adrs1: 360 Lisgar st Site Bldg: Site Pobox: Province In: ONTARIO Site Adrs2: Site City: Ottawa Province Out: Site Postal Code: K2P 2E4 Site Country: Canada Co Official: Martin Girard Co Admin: Chlo�� Labelle					
County Ont: OTTAWA CARLTON (RM) County Out: District: 402					
<u>4</u>	1 of 1	ESE/49.4	76.9 / -0.93	251 Bank Street Ottawa ON K2P 1X3	EHS
Order No: 24082900023 Status: C Report Type: Standard Report Report Date: 04-SEP-24 Date Received: 29-AUG-24 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.6970523 Y: 45.416337					
<u>5</u>	1 of 1	N/56.0	77.6 / -0.23	WALLACK'S ART & DRAFTING 231 BANK ST OTTAWA ON K2P 1W9	SCT
Established: Plant Size (ft²): 0 Employment: 20					
--Details-- Description: MEASURING & CONTROLLING DEVICES, N.E.C. SIC/NAICS Code: 3829 Description: LEAD PENCILS, CRAYONS, & ARTISTS' MATERIALS SIC/NAICS Code: 3952 Description: MARKING DEVICES SIC/NAICS Code: 3953					
<u>6</u>	1 of 3	NNW/57.9	77.9 / 0.07	BICYCLE REVIVAL LTD. 224 BANK STREET OTTAWA ON K2P 1X1	GEN
Generator Info Generator No: ON1177400 Approval Years: 89 Status:					
Choice of Contact: Contaminated Fac: MHSW Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No:				SIC Code:	9949
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		OTHER REPAIR SERV.			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
6	2 of 3	NNW/57.9	77.9 / 0.07	BICYCLE REVIVAL LTD. 04-341 224 BANK STREET OTTAWA ON K2P 1X1	GEN
<u>Generator Info</u>					
Generator No:		ON1177400		Choice of Contact:	
Approval Years:		92,93,94,95,96,97,98		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	9949
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		OTHER REPAIR SERV.			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
6	3 of 3	NNW/57.9	77.9 / 0.07	BICYCLE REVIVAL LIMITED 224 BANK STREET OTTAWA ON K2P 1X1	GEN
<u>Generator Info</u>					
Generator No:		ON1177400		Choice of Contact:	
Approval Years:		99,00,01		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	9949
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		OTHER REPAIR SERV.			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
7	1 of 2	SE/59.2	76.9 / -0.93	FOCUS CENTRE, THE 254 BANK STREET OTTAWA ON K2P 1X4	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON1882400			Choice of Contact:	
Approval Years:	94,95,96,97,98,99,00,01			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	6571
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	CAMERA/PHOTO. SUPPLY				
<u>Waste Detail(s)</u>					
Waste Class:	264				
Waste Class Name:	PHOTOPROCESSING WASTES				
<u>7</u>	2 of 2	SE/59.2	76.9 / -0.93	Easy Drain Plumbing 254 Bank Str Ottawa ON	GEN
<u>Generator Info</u>					
Generator No:	ON4987732			Choice of Contact:	
Approval Years:	2013			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	812115
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	262				
Waste Class Name:	DETERGENTS/SOAPS				
<u>8</u>	1 of 1	NNW/59.8	77.9 / 0.07	COOKWARE CENTRE (THE) 220 BANK ST OTTAWA ON K2P 1X1	SCT
Established:	1959				
Plant Size (ft²):	0				
Employment:	0				
<u>--Details--</u>					
Description:	Service Establishment Machinery, Equipment and Supplies Wholesaler-Distributors				
SIC/NAICS Code:	417920				
<u>9</u>	1 of 6	ESE/67.9	76.9 / -0.93	251-259 Bank Street (395-397 Cooper St) Ottawa ON	EHS
Order No:	20040428001			Nearest Intersection:	Bank St & Cooper St
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	ON
Report Date:	5/6/04			Search Radius (km):	0.25
Date Received:	4/28/04			X:	-75.69682
Previous Site Name:				Y:	45.416444
Lot/Building Size:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Additional Info Ordered:					
9	2 of 6	ESE/67.9	76.9 / -0.93	Capital Xtra - Div. of Pink 251 Bank St Unit 503 Ottawa ON K2P 1X3	SCT
Established:		1994			
Plant Size (ft²):		1800			
Employment:		3			
--Details--					
Description:		Newspaper Publishers			
SIC/NAICS Code:		511110			
9	3 of 6	ESE/67.9	76.9 / -0.93	McKenzie Publishing Inc. 251A Bank St Suite 500 Ottawa ON K2P 1X3	SCT
Established:		01-JUL-96			
Plant Size (ft²):		1000			
Employment:					
--Details--					
Description:		Periodical Publishers			
SIC/NAICS Code:		511120			
9	4 of 6	ESE/67.9	76.9 / -0.93	Akiva Publishing Inc. 251 Bank St Suite 206 Ottawa ON K2P 1X3	SCT
Established:					
Plant Size (ft²):					
Employment:					
--Details--					
Description:		Internet Publishing and Broadcasting and Web Search Portals			
SIC/NAICS Code:		519130			
Description:		Book Publishers			
SIC/NAICS Code:		511130			
Description:		Periodical Publishers			
SIC/NAICS Code:		511120			
9	5 of 6	ESE/67.9	76.9 / -0.93	251 Bank Street Ottawa ON	EHS
Order No:		20110609005	Nearest Intersection:		
Status:		C	Municipality:		
Report Type:		Custom Report	Client Prov/State: ON		
Report Date:		6/15/2011	Search Radius (km): 0.25		
Date Received:		6/9/2011 8:51:43 AM	X: -75.696931		
Previous Site Name:			Y: 45.416234		
Lot/Building Size:					
Additional Info Ordered:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
9	6 of 6	ESE/67.9	76.9 / -0.93	251 Bank St Ottawa ON K2P1X3	EHS
Order No:		20170306014		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State: ON	
Report Date:		09-MAR-17		Search Radius (km): .25	
Date Received:		06-MAR-17		X: -75.696806	
Previous Site Name:				Y: 45.416301	
Lot/Building Size:					
Additional Info Ordered:					
10	1 of 1	NNW/71.1	77.9 / 0.07	212 Bank Street , Ottawa ON	INC
Incident No:		388460		Any Health Impact: No	
Incident ID:		2540090		Any Enviro Impact: Unknown	
Instance No:				Service Intrap: No	
Status Code:		Causal Analysis Complete		Was Prop Damaged: Unknown	
Incident Status:					
Incident Severity:					
Task No:		2894418		Reside App. Type:	
Attribute Category:		FS-Perform L1 Near Miss Insp		Commer App. Type:	
Context:				Indus App. Type:	
Date of Occurrence:		2010/05/21 00:00:00		Institut App. Type:	
Time of Occurrence:		12:00:00		Depth Ground Cover:	
Occr Insp Start Dt:		2010/05/21 00:00:00		Operation Pressure:	
Incident Creat On:				Equipment Type:	
Instance Creat Dt:				Equipment Model:	
Instance Install Dt:				Serial No:	
Approx Quant Rel:		Unknown		Cylinder Capacity:	
Tank Capacity:				Cylinder Cap Units:	
Fuels Occur Type:		Other		Cylinder Mat Type:	
Occur Type Rpt:				Pump Flow Rate Cap:	
Occur Category:				Contam. Migrated: Unknown	
Fuel Type Involved:		Fuel Oil		Near Body of Water: No	
Fuel Type Reported:				Drainage System: Unknown	
Enforcement Policy:		NULL		Sub Surface Contam: Unknown	
Prc Escalation Req:		NULL		Tank Material Type:	
Item:				Tank Storage Type:	
Item Description:				Tank Location Type:	
Device Installed Location:					
Venting Type:					
Vent Conn Mater:					
Vent Chimney Mater:					
Pipeline Type:					
Pipeline Involved:					
Pipe Material:					
Regulator Location:					
Regulator Type:					
Liquid Prop Make:					
Liquid Prop Model:					
Liquid Prop Serial No:					
Liquid Prop Notes:					
Inventory Address:		212 Bank Street , Ottawa - Near Miss			
Invent Postal Code:					
Notes:					
Contact Natural Env:		Unknown			
Aff Prop Use Water:		No			
Occurence Narrative:		Discovery of abandoned UST.			
Operation Type Involved:		Commercial (e.g. restaurant, business unit, etc)			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
11	1 of 6	WNW/73.6	77.9 / 0.07	DEPARTMENT OF NATIONAL DEFENCE VANIER BUILDING 222 NEPEAN STREET OTTAWA ON K2B 0B8	GEN
Generator Info					
Generator No:	ON0046594			Choice of Contact:	
Approval Years:	95			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	8111
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	DEFENCE SERVICES				
Waste Detail(s)					
Waste Class:	121				
Waste Class Name:	ALKALINE WASTES - HEAVY METALS				
11	2 of 6	WNW/73.6	77.9 / 0.07	DEPT OF NATIONAL DEFENCE, CDN. FORCES VANIER BUILDING 222 NEPEAN STREET OTTAWA ON K2B 0B8	GEN
Generator Info					
Generator No:	ON0046594			Choice of Contact:	
Approval Years:	96,97			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	8111
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	DEFENCE SERVICES				
Waste Detail(s)					
Waste Class:	121				
Waste Class Name:	ALKALINE WASTES - HEAVY METALS				
11	3 of 6	WNW/73.6	77.9 / 0.07	DEPT. OF NATIONAL DEFENCE VANIER BUILDING 222 NEPEAN STREET OTTAWA ON K2B 0B8	GEN
Generator Info					
Generator No:	ON0046594			Choice of Contact:	
Approval Years:	98,99,00,01			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	8111
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	DEFENCE SERVICES				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:	121				
Waste Class Name:	ALKALINE WASTES - HEAVY METALS				
<u>11</u>	4 of 6	WNW/73.6	77.9 / 0.07	222 Nepean Street Ottawa ON K2P 0B8	EHS
Order No:	20111208034			Nearest Intersection:	
Status:	C			Municipality:	Ottawa
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	12/19/2011 4:17:41 PM			Search Radius (km):	0.25
Date Received:	12/8/2011 4:17:41 PM			X:	-75.698633
Previous Site Name:	Unknown			Y:	45.41695
Lot/Building Size:	2428 Square meters				
Additional Info Ordered:					
<u>11</u>	5 of 6	WNW/73.6	77.9 / 0.07	222 Nepean Street, Ottawa Ottawa ON	SPL
Ref No:	3052-A9WKJ9			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	2016/05/13			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	2016/05/13			Impact to Health:	
Dt Document Closed:				Agency Involved:	
Site No:	NA				
MOE Response:	No				
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					
Site Name:	Vanier Building<UNOFFICIAL>				
Site Address:	222 Nepean Street, Ottawa				
Site Region:					
Site Municipality:	Ottawa				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:					
Client Type:					
Source Type:					
Incident Cause:					
Incident Preceding Spill:	Leak/Break				
Incident Reason:	Unknown / N/A				
Incident Summary:	Refrigerant leak from 2 stages of unit, 240+ pounds of R22 to atm				
Environment Impact:					
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:	240 lb				
Contaminant Qty 1:	240				
Contaminant Unit:	lb				
Contaminant Code:	38				
Contaminant Name:	REFRIGERANT GAS, N.O.S.				
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:	Air				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type:Unknown / N/A SAC Action Class:Notifications Call Report Locatn Geodata: Time Reported: System Facility Address:					
11	6 of 6	WNW/73.6	77.9 / 0.07	Bona Building Management 222 Nepean St Ottawa ON K1R5G2	GEN
Generator Info Generator No:ON3438000 Approval Years:As of Nov 2021 Status:Registered PO Box No: Country:Canada Co Admin: Phone No Admin: SIC Description: Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
Waste Detail(s) Waste Class:212 L Waste Class Name:Aliphatic solvents and residues					
2021 Generator Info Gen No:ON3438000 ID:12990 Contaminated Fac:N MHSW Facility:N NAICS Code1:531310 NAICS Code2: NAICS Code3: Gen Name:Bona Building Management Gen Div: Gen Op Name:Bona Building Management Gen Op Div: Site Adrs1:222 Nepean St Site Bldg: Site Pobox: Province In:ONTARIO Site Adrs2: Site City:Ottawa Province Out: Site Postal Code:K1R5G2 Site Country:Canada Co Official:Bourco Bourco Co Admin: Choice of Contact:CO_OFFICIAL Phone No Official:3439618166 Ext. Phone No Admin: County Ont:OTTAWA CARLTON (RM) County Out: District:402					
2021 Generator Manifest ID:33024 Generator No:ON3438000 Receiver Type:035 Waste Char:L Sum Received Qty:490.0 Waste Class Name:ALIPHATIC SOLVENTS Count Manifests:2 District:402					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Code:		212			
12	1 of 2	ESE/75.1	76.9 / -0.93	OTTAWA CITY COOPER ST./BANK ST. OTTAWA CITY ON	CA
Certificate #:		3-0942-90-			
Application Year:		90			
Issue Date:		6/5/1990			
Approval Type:		Municipal sewage			
Status:		Approved			
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					
12	2 of 2	ESE/75.1	76.9 / -0.93	R.M. OF OTTAWA-CARLETON COOPER ST./BANK ST. OTTAWA CITY ON	CA
Certificate #:		7-0785-90-			
Application Year:		90			
Issue Date:		6/5/1990			
Approval Type:		Municipal water			
Status:		Approved			
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					
13	1 of 1	SW/77.0	77.9 / 0.07	Youth Services Bureau of Ottawa 433 COOPER ST/366 LISGAR STREET, OTTAWA OTTAWA ON	RSC
RSC No:		2091		X:	-75.69847162568209
RA No:				Y:	45.416435005054375
Status:		FILED		Latitude:	45.41643501
Filing Date:				Longitude:	-75.69847163
Date Ack:				UTM Coordinates:	
Date Returned:				Latitude Longitude:	
Approval Date:		November 14, 2005		Accuracy Estimate:	
Cert Date:				Measurement Method:	
Cert Prop Use No:				Mailing Address:	
Curr Property Use:				Telephone:	
Intended Prop Use:				Fax:	
Restoration Type:				Email:	
Soil Type:				Postal Code:	K2P 0H1
Criteria:				Ministry District:	
Stratified (Y/N):				MOE District:	Ottawa
Audit (Y/N):				SWP Area Name:	Rideau Valley
Entire Leg Prop.				Qual Person Name:	Joseph B Bennett
(Y/N):					
CPU Issu Sect 1686:				Consultant:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Business Name: Youth Services Bureau of Ottawa Address: 433 COOPER ST/366 LISGAR STREET, OTTAWA Legal Desc: Site Pin: 04114-0253 LT Asmt Roll No: Project Type: PRE2011 Approval Type: RSC based on Phase One and Two ESAs Applicable Standards: PDF Link: https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=2091					
14	1 of 1	NE/79.7	76.9 / -0.93	Canadian Bible Society 315 Lisgar St Ottawa ON K2P 0E1	SCT
Established: 01-DEC-05 Plant Size (ft²): 3000 Employment: --Details-- Description: Professional Organizations SIC/NAICS Code: 813920					
15	1 of 1	N/85.7	76.7 / -1.10	178 Nepean, 219 & 223 Bank Ottawa ON K2P 1W9	EHS
Order No: 22042800477 Status: C Report Type: Standard Report Report Date: 03-MAY-22 Date Received: 28-APR-22 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.6975686 Y: 45.4172349					
16	1 of 4	ENE/85.8	76.9 / -0.93	Canus Plastics Inc. 300 Lisgar St Ottawa ON K2P 0E2	SCT
Established: 8/1/1949 Plant Size (ft²): 22000 Employment: --Details-- Description: Plastic Film and Sheet Manufacturing SIC/NAICS Code: 326114 Description: Chemical (except Agricultural) and Allied Product Wholesaler-Distributors SIC/NAICS Code: 418410 Description: Other Paper and Disposable Plastic Product Wholesaler-Distributors SIC/NAICS Code: 418220 Description: Showcase, Partition, Shelving and Locker Manufacturing SIC/NAICS Code: 337215 Description: All Other Miscellaneous Fabricated Metal Product Manufacturing SIC/NAICS Code: 332999 Description: Industrial Machinery, Equipment and Supplies Wholesaler-Distributors SIC/NAICS Code: 417230					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Description:		Office and Store Machinery and Equipment Wholesaler-Distributors			
SIC/NAICS Code:		417910			
Description:		Plumbing, Heating and Air-Conditioning Equipment and Supplies Wholesaler-Distributors			
SIC/NAICS Code:		416120			
Description:		Unlaminated Plastic Profile Shape Manufacturing			
SIC/NAICS Code:		326121			
Description:		Sign Manufacturing			
SIC/NAICS Code:		339950			
Description:		All Other Plastic Product Manufacturing			
SIC/NAICS Code:		326198			
Description:		Other Specialty-Line Building Supplies Wholesaler-Distributors			
SIC/NAICS Code:		416390			
16	2 of 4	ENE/85.8	76.9 / -0.93	Canus Signs Plastics Ltd. 300 Lisgar St Ottawa ON K2P 0E2	SCT
Established:		1955			
Plant Size (ft²):		25			
Employment:					
--Details--					
Description:		All Other Plastic Product Manufacturing			
SIC/NAICS Code:		326198			
Description:		Sign Manufacturing			
SIC/NAICS Code:		339950			
Description:		Plastic Bottle Manufacturing			
SIC/NAICS Code:		326160			
16	3 of 4	ENE/85.8	76.9 / -0.93	300 Lisgar Street Ottawa ON K2P 0E2	EHS
Order No:		20090807045		Nearest Intersection:	Lisgar Street and Bank Street (Site located east of intersection)
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State:	ON
Report Date:		8/18/2009		Search Radius (km):	0.25
Date Received:		8/7/2009		X:	-75.696446
Previous Site Name:				Y:	45.416825
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Sire Plans			
16	4 of 4	ENE/85.8	76.9 / -0.93	Soho Lisgar Inc. 300 Lisgar Street, Ottawa, Ontario, K2P 1T6 OTTAWA ON	RSC
RSC No:		113750		X:	-75.6966629720621
RA No:				Y:	45.416941121398054
Status:		FILED		Latitude:	45.41694112
Filing Date:				Longitude:	-75.69666297
Date Ack:				UTM Coordinates:	
Date Returned:				Latitude Longitude:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Date: June 23, 2011 Cert Date: Cert Prop Use No: Curr Property Use: Intended Prop Use: Restoration Type: Soil Type: Criteria: Stratified (Y/N): Audit (Y/N): Entire Leg Prop. (Y/N): CPU Issu Sect 1686: Business Name: Soho Lisgar Inc. Address: 300 Lisgar Street, Ottawa, Ontario, K2P 1T6 Legal Desc: Site Pin: 04115-0309 LT Asmt Roll No: Project Type: PRE2011 Approval Type: RSC based on Phase One and Two ESAs Applicable Standards: PDF Link: https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=113750					
Accuracy Estimate: Measurement Method: Mailing Address: Telephone: Fax: Email: Postal Code: Ministry District: MOE District: Ottawa SWP Area Name: Rideau Valley Qual Person Name: Mark S D'Arcy Consultant:					

17	1 of 17	SE/92.7	76.9 / -0.93	DRAICCHIO'S TAILORING & CLEANING 272 BANK STREET OTTAWA ON K2P 1X6	GEN

Generator Info

Generator No:	ON1392900	Choice of Contact:	
Approval Years:	90,97,98,99,00,01,02,03,04,05,06,07,08	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	9721
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	POWER LAUND./CLEANER		

Waste Detail(s)

Waste Class:	241
Waste Class Name:	HALOGENATED SOLVENTS

17	2 of 17	SE/92.7	76.9 / -0.93	DRAICCHIO'S TAILORING & CLEANING 12-549 272 BANK STREET OTTAWA ON K2P 1X6	GEN

Generator Info

Generator No:	ON1392900	Choice of Contact:	
Approval Years:	92,93,94,95,96	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	9721
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	POWER LAUND./CLEANER		

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
17	3 of 17	SE/92.7	76.9 / -0.93	DRAICCHIO'S TAILORING & CLEANING 272 BANK STREET OTTAWA ON K2P 1X6	GEN
<u>Generator Info</u>					
Generator No:		ON1392900		Choice of Contact:	
Approval Years:		2009		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 812320	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Dry Cleaning and Laundry Services (except Coin-Operated)			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
17	4 of 17	SE/92.7	76.9 / -0.93	DRAICCHIO'S TAILORING & CLEANING 272 BANK STREET OTTAWA ON K2P 1X6	GEN
<u>Generator Info</u>					
Generator No:		ON1392900		Choice of Contact:	
Approval Years:		2010		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 812320	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Dry Cleaning and Laundry Services (except Coin-Operated)			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
17	5 of 17	SE/92.7	76.9 / -0.93	DRAICCHIO'S TAILORING & CLEANING 272 BANK STREET OTTAWA ON K2P 1X6	GEN
<u>Generator Info</u>					
Generator No:		ON1392900		Choice of Contact:	
Approval Years:		2011		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 812320	
Country:					
Co Admin:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Phone No Admin: SIC Description: Dry Cleaning and Laundry Services (except Coin-Operated)					
<u>Waste Detail(s)</u>					
Waste Class: 241 Waste Class Name: HALOGENATED SOLVENTS					
17	6 of 17	SE/92.7	76.9 / -0.93	DRAICCHIO'S TAILORING & CLEANING 272 BANK STREET OTTAWA ON K2P 1X6	GEN
<u>Generator Info</u>					
Generator No: ON1392900 Approval Years: 2012 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: Dry Cleaning and Laundry Services (except Coin-Operated)					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 812320					
<u>Waste Detail(s)</u>					
Waste Class: 241 Waste Class Name: HALOGENATED SOLVENTS					
17	7 of 17	SE/92.7	76.9 / -0.93	7695713 canada inc. 272 BANK ST OTTAWA ON	GEN
<u>Generator Info</u>					
Generator No: ON4418802 Approval Years: 2012 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: Dry Cleaning and Laundry Services (except Coin-Operated)					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 812320					
17	8 of 17	SE/92.7	76.9 / -0.93	7695713 canada inc. 272 BANK ST OTTAWA ON	GEN
<u>Generator Info</u>					
Generator No: ON4418802 Approval Years: 2013 Status: PO Box No: Country: Co Admin: Phone No Admin:					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 812320					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description:		DRY CLEANING AND LAUNDRY SERVICES (EXCEPT COIN-OPERATED)			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
17	9 of 17	SE/92.7	76.9 / -0.93	7695713 canada inc. 272 BANK ST OTTAWA ON K2P1X6	GEN
<u>Generator Info</u>					
Generator No:		ON4418802	Choice of Contact:		CO_ADMIN
Approval Years:		2016	Contaminated Fac:		No
Status:			MHSW Facility:		No
PO Box No:			SIC Code:		812320
Country:		Canada			
Co Admin:		MANUEL ML LEBRON			
Phone No Admin:		6132332965 Ext.			
SIC Description:		DRY CLEANING AND LAUNDRY SERVICES (EXCEPT COIN-OPERATED)			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
17	10 of 17	SE/92.7	76.9 / -0.93	7695713 canada inc. 272 BANK ST OTTAWA ON K2P1X6	GEN
<u>Generator Info</u>					
Generator No:		ON4418802	Choice of Contact:		CO_ADMIN
Approval Years:		2015	Contaminated Fac:		No
Status:			MHSW Facility:		No
PO Box No:			SIC Code:		812320
Country:		Canada			
Co Admin:		MANUEL ML LEBRON			
Phone No Admin:		6132332965 Ext.			
SIC Description:		DRY CLEANING AND LAUNDRY SERVICES (EXCEPT COIN-OPERATED)			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
17	11 of 17	SE/92.7	76.9 / -0.93	7695713 canada inc. 272 BANK ST OTTAWA ON K2P1X6	GEN
<u>Generator Info</u>					
Generator No:		ON4418802	Choice of Contact:		CO_OFFICIAL
Approval Years:		2014	Contaminated Fac:		No

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: PO Box No: Country: Canada Co Admin: aida af flores de lebron Phone No Admin: 613-234-1284 Ext. SIC Description: DRY CLEANING AND LAUNDRY SERVICES (EXCEPT COIN-OPERATED) MHSW Facility: No SIC Code: 812320					
Waste Detail(s) Waste Class: 213 Waste Class Name: PETROLEUM DISTILLATES					
17	12 of 17	SE/92.7	76.9 / -0.93	7695713 canada inc. 272 BANK ST OTTAWA ON K2P1X6	GEN
Generator Info Generator No: ON4418802 Approval Years: As of Dec 2018 Status: Registered PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description: Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
Waste Detail(s) Waste Class: 213 L Waste Class Name: Petroleum distillates					
17	13 of 17	SE/92.7	76.9 / -0.93	Draicchio's Tailoring&Cleaning 272 Bank St Ottawa ON K2P1X6	CDRY
Legal Name of Company: Region: Type of Reporter:					
Waste Quantity by Year Reporting Year: 2004 Quantity of PERC (kg): 89.1 Total Waste Water (kg): 92 Total Waste Water (L): - Total Residue (kg): 92 Total Residue (L): - Total Mix (kg): 184 Total Mix (L): - Request for Confidentiality: No Reason For Confidentiality: N/A					
17	14 of 17	SE/92.7	76.9 / -0.93	Downtown Cobler 272 Bank St Ottawa ON K2P1X6	CDRY
Legal Name of Company: Region: Ontario					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Type of Reporter:		Dry Cleaner			
<u>Waste Quantity by Year</u>					
Reporting Year:		2021			
Quantity of PERC (kg):		0			
Total Waste Water (kg):		0			
Total Waste Water (L):		0			
Total Residue (kg):		0			
Total Residue (L):		0			
Total Mix (kg):		0			
Total Mix (L):		0			
Request for Confidentiality:		no			
Reason For Confidentiality:					
17	15 of 17	SE/92.7	76.9 / -0.93	7695713 canada inc. 272 BANK ST OTTAWA ON K2P1X6	GEN
<u>Generator Info</u>					
Generator No:		ON4418802		Choice of Contact:	
Approval Years:		As of Jul 2020		Contaminated Fac:	
Status:		Registered		MHSW Facility:	
PO Box No:				SIC Code:	
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		213 L			
Waste Class Name:		Petroleum distillates			
17	16 of 17	SE/92.7	76.9 / -0.93	DOWNTOWN COBBLER DOWNTOWN COBBLER 272 BANK ST OTTAWA ON k2p1x6	GEN
<u>Generator Info</u>					
Generator No:		ON4418802		Choice of Contact:	
Approval Years:		As of Nov 2021		Contaminated Fac:	
Status:		Registered		MHSW Facility:	
PO Box No:				SIC Code:	
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		213 L			
Waste Class Name:		Petroleum distillates			
17	17 of 17	SE/92.7	76.9 / -0.93	Downtown Tailoring 272 BANK ST	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
OTTAWA ON K2P 1X6					
<u>Generator Info</u>					
Generator No:	ON4418802			Choice of Contact:	
Approval Years:	As of Oct 2022			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:	n/a			SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	213 L				
Waste Class Name:	PETROLEUM DISTILLATES				
<u>Waste Detail(s)</u>					
Waste Class:	241 H				
Waste Class Name:	HALOGENATED SOLVENTS				
<u>2017 Generator Info</u>					
Gen No:	ON4418802			Choice of Contact:	CO_ADMIN
ID:	17578			Phone No Official:	6132038099 Ext.
Contaminated Fac:	N			Phone No Admin:	6132332965 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	812320			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	7695713 canada inc.				
Gen Div:					
Gen Op Name:	DRAICCHIO'S TAILORING & CLEANING				
Gen Op Div:					
Site Adrs1:	272 BANK ST				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	OTTAWA				
Province Out:					
Site Postal Code:	K2P1X6				
Site Country:	Canada				
Co Official:	MANUEL ML LEBRON				
Co Admin:	MANUEL ML LEBRON				
<u>2017 Generator Manifest</u>					
ID:	41082			Sum Received Qty:	80.0
Generator No:	ON4418802			Waste Class Name:	HALOGENATED SOLVENTS
Receiver Type:	040			Count Manifests:	2
Waste Char:	H			District:	805
Waste Code:	241				
<u>2018 Generator Info</u>					
Gen No:	ON4418802			Choice of Contact:	CO_ADMIN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
ID:	17611			Phone No Official:	6132038099 Ext.
Contaminated Fac:	N			Phone No Admin:	6132332965 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	812320			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		7695713 canada inc.			
Gen Div:					
Gen Op Name:		DRAICCHIO'S TAILORING & CLEANING			
Gen Op Div:					
Site Adrs1:		272 BANK ST			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		OTTAWA			
Province Out:					
Site Postal Code:		K2P1X6			
Site Country:		Canada			
Co Official:		MANUEL ML LEBRON			
Co Admin:		MANUEL ML LEBRON			
<u>2018 Generator Manifest</u>					
ID:	40965			Sum Received Qty:	60.0
Generator No:	ON4418802			Waste Class Name:	HALOGENATED SOLVENTS
Receiver Type:	040			Count Manifests:	1
Waste Char:	H			District:	805
Waste Code:	241				
<u>2019 Generator Info</u>					
Gen No:	ON4418802			Choice of Contact:	CO_ADMIN
ID:	17503			Phone No Official:	6132038099 Ext.
Contaminated Fac:	N			Phone No Admin:	6132332965 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	812320			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		7695713 canada inc.			
Gen Div:					
Gen Op Name:		DRAICCHIO'S TAILORING & CLEANING			
Gen Op Div:					
Site Adrs1:		272 BANK ST			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		OTTAWA			
Province Out:					
Site Postal Code:		K2P1X6			
Site Country:		Canada			
Co Official:		MANUEL ML LEBRON			
Co Admin:		MANUEL ML LEBRON			
<u>2019 Generator Manifest</u>					
ID:	40283			Sum Received Qty:	24.0
Generator No:	ON4418802			Waste Class Name:	HALOGENATED SOLVENTS
Receiver Type:	040			Count Manifests:	1
Waste Char:	H			District:	805
Waste Code:	241				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2020 Generator Info</u>					
Gen No:	ON4418802			Choice of Contact:	CO_OFFICIAL
ID:	17205			Phone No Official:	6132038099 Ext.
Contaminated Fac:	N			Phone No Admin:	6132038099 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	812320			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		DOWNTOWN COBBLER			
Gen Div:		DOWNTOWN COBBLER			
Gen Op Name:		DOWNTOWN COBBLER			
Gen Op Div:					
Site Adrs1:		272 BANK ST			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		OTTAWA			
Province Out:					
Site Postal Code:		k2p1x6			
Site Country:		Canada			
Co Official:		MANUEL ML LEBRON			
Co Admin:		MANUEL MANUEL LEBRON			
<u>2021 Generator Info</u>					
Gen No:	ON4418802			Choice of Contact:	CO_OFFICIAL
ID:	17274			Phone No Official:	6132038099 Ext.
Contaminated Fac:	N			Phone No Admin:	6132038099 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	812320			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		Downtown Tailoring			
Gen Div:		DOWNTOWN TAILORING			
Gen Op Name:		Downtown Tailoring			
Gen Op Div:		DOWNTOWN TAILORING			
Site Adrs1:		272 BANK ST			
Site Bldg:		Downtown Tailoring			
Site Pobox:		n/a			
Province In:		ONTARIO			
Site Adrs2:					
Site City:		OTTAWA			
Province Out:					
Site Postal Code:		K2P 1X6			
Site Country:		Canada			
Co Official:		MANUEL ML LEBRON			
Co Admin:		MANUEL M.L LEBRON			
<u>2021 Generator Manifest</u>					
ID:	38317			Sum Received Qty:	20.0
Generator No:	ON4418802			Waste Class Name:	HALOGENATED SOLVENTS
Receiver Type:	040			Count Manifests:	1
Waste Char:	H			District:	805
Waste Code:	241				

18

1 of 1

SW/92.7

77.9 / 0.07

437 Cooper Street
Ottawa ON K2P 0H1

EHS

Order No: 24022901100

Nearest Intersection:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: C Report Type: Standard Report Report Date: 05-MAR-24 Date Received: 29-FEB-24 Previous Site Name: Lot/Building Size: Additional Info Ordered: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.6983206 Y: 45.4157749					
19	1 of 1	E/97.5	76.9 / -0.93	ON	BORE
Borehole ID: 613297 OGF ID: 215514598 Status: Borehole Type: Borehole Use: Completion Date: Static Water Level: 11.9 Primary Water Use: Sec. Water Use: Total Depth m: -999 Depth Ref: Ground Surface Depth Elev: Drill Method: Orig Ground Elev m: 72.9 Elev Reliabil Note: DEM Ground Elev m: 72.7 Concession: Location D: Survey D: Comments: Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 45.416378 Longitude DD: -75.696417 UTM Zone: 18 Easting: 445511 Northing: 5029442 Location Accuracy: Accuracy: Not Applicable					
Borehole Geology Stratum					
Geology Stratum ID: 218394556 Top Depth: 0 Bottom Depth: 2.3 Material Color: Material 1: Sand Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description: SAND. FIRM. Mat Consistency: Firm Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Geology Stratum ID: 218394562 Top Depth: 9.1 Bottom Depth: Material Color: Material 1: Bedrock Material 2: Shale Material 3: Material 4: Gsc Material Description: Stratum Description: BEDROCK. FOSSILIFEROUS, WATER STABLE AT 200.3 FEET.0050 043 00080 058 00115 062 00 **Note: Many records provided by the department have a truncated [Stratum Description] field. Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Geology Stratum ID: 218394559 Top Depth: 6.2 Bottom Depth: 7.3 Material Color: Grey Material 1: Clay Material 2: Silt Mat Consistency: Firm Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3: Material 4: Gsc Material Description: Stratum Description:		CLAY. GREY,FIRM.		Geologic Period: Depositional Gen:	
Geology Stratum ID: 218394561 Top Depth: 8.8 Bottom Depth: 9.1 Material Color: Material 1: Till Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:		TILL. COMPACT.		Mat Consistency: Compact Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Geology Stratum ID: 218394557 Top Depth: 2.3 Bottom Depth: 5 Material Color: Grey Material 1: Clay Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:		CLAY. GREY,SOFT.		Mat Consistency: Soft Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Geology Stratum ID: 218394558 Top Depth: 5 Bottom Depth: 6.2 Material Color: Material 1: Clay Material 2: Silt Material 3: Material 4: Gsc Material Description: Stratum Description:		CLAY. SOFT.		Mat Consistency: Soft Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Geology Stratum ID: 218394560 Top Depth: 7.3 Bottom Depth: 8.8 Material Color: Grey Material 1: Clay Material 2: Till Material 3: Material 4: Gsc Material Description: Stratum Description:		CLAY. GREY,FIRM.		Mat Consistency: Firm Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Source					
Source Type: Data Survey Source Orig: Geological Survey of Canada Source Date: 1956-1972 Confidence: H Observatio: Source Name: Source Details: Confiden 1:		Urban Geology Automated Information System (UGAIS) File: OTTAWA2.txt RecordID: 058050 NTS_Sheet: 31G05G Logged by professional. Exact and complete description of material and properties.		Source Appl: Spatial/Tabular Source Iden: 1 Scale or Res: Varies Horizontal: NAD27 Verticalda: Mean Average Sea Level	
Source List					
Source Identifier: 1 Source Type: Data Survey				Horizontal Datum: NAD27 Vertical Datum: Mean Average Sea Level	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Date: 1956-1972 Scale or Resolution: Varies Source Name: Urban Geology Automated Information System (UGAIS) Source Originators: Geological Survey of Canada		Projection Name: Universal Transverse Mercator			
20	1 of 1	NNW/100.1	77.9 / 0.07	Enbridge Gas Distribution Inc. Bank St and Nepean St Ottawa ON	SPL
Ref No: 8824-9TL9VT Year: Incident Dt: 2/10/2015 Dt MOE Arvl on Scn: MOE Reported Dt: 2/10/2015 Dt Document Closed: Site No: NA MOE Response: N Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Gas Meter<UNOFFICIAL> Site Address: Bank St and Nepean St Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Enbridge Gas Distribution Inc. Client Type: Source Type: Incident Cause: Collision/Accident Incident Preceding Spill: Incident Reason: Operator/Human Error Incident Summary: TSSA: gas meter struck by snowplow Environment Impact: Health Env Consequence: Nature of Impact: Air Contaminant Qty: 0 other - see incident description Contaminant Qty 1: 0 Contaminant Unit: other - see incident description Contaminant Code: 35 Contaminant Name: NATURAL GAS, COMPRESSED (METHANE) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill Call Report Locatn Geodata: Time Reported: System Facility Address:		Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:			
21	1 of 2	ENE/105.0	76.9 / -0.93	Canus Plastics Inc. 300 Lisgar St. Ottawa ON	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON3474706			Choice of Contact:	
Approval Years:	2009			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	326198
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	All Other Plastic Product Manufacturing				
<u>Waste Detail(s)</u>					
Waste Class:	221				
Waste Class Name:	LIGHT FUELS				
21	2 of 2	ENE/105.0	76.9 / -0.93	Bassi Construction 300 lisgar st ottawa ON K2P 0E2	GEN
<u>Generator Info</u>					
Generator No:	ON5537998			Choice of Contact:	
Approval Years:	2011			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	236220
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:					
22	1 of 1	ESE/105.4	76.9 / -0.93	GLASER PHARMACY LTD. 267 BANK STREET OTTAWA ON K2P 1X3	GEN
<u>Generator Info</u>					
Generator No:	ON1565711			Choice of Contact:	
Approval Years:	99,00,01			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	6031
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	PHARMACIES				
<u>Waste Detail(s)</u>					
Waste Class:	261				
Waste Class Name:	PHARMACEUTICALS				
<u>Waste Detail(s)</u>					
Waste Class:	312				
Waste Class Name:	PATHOLOGICAL WASTES				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
23	1 of 3	SE/107.6	76.9 / -0.93	COOPER PHARMACY INC SWIFT COMPOUNDING PHARMACY 276 BANK ST OTTAWA ON K2P 1X6	GEN
<u>Generator Info</u>					
Generator No:	ON9068684			Choice of Contact:	
Approval Years:	As of Jul 2020			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	312 P				
Waste Class Name:	Pathological wastes				
<u>Waste Detail(s)</u>					
Waste Class:	261 A				
Waste Class Name:	Pharmaceuticals				
23	2 of 3	SE/107.6	76.9 / -0.93	COOPER PHARMACY INC SWIFT COMPOUNDING PHARMACY 276 BANK ST OTTAWA ON K2P 1X6	GEN
<u>Generator Info</u>					
Generator No:	ON9068684			Choice of Contact:	
Approval Years:	As of Nov 2021			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	261 A				
Waste Class Name:	Pharmaceuticals				
<u>Waste Detail(s)</u>					
Waste Class:	312 P				
Waste Class Name:	Pathological wastes				
23	3 of 3	SE/107.6	76.9 / -0.93	COOPER PHARMACY INC 276 BANK ST OTTAWA ON K2P 1X6	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON9068684			Choice of Contact:	
Approval Years:	As of Oct 2022			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	261 A				
Waste Class Name:	PHARMACEUTICALS				
<u>Waste Detail(s)</u>					
Waste Class:	312 P				
Waste Class Name:	PATHOLOGICAL WASTES				
<u>2020 Generator Info</u>					
Gen No:	ON9068684			Choice of Contact:	CO_OFFICIAL
ID:	36378			Phone No Official:	6134222202 Ext.
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	446110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	COOPER PHARMACY INC				
Gen Div:	SWIFT COMPOUNDING PHARMACY				
Gen Op Name:	SWIFT COMPOUNDING PHARMACY				
Gen Op Div:					
Site Adrs1:	276 BANK ST				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	OTTAWA				
Province Out:					
Site Postal Code:	K2P 1X6				
Site Country:	Canada				
Co Official:	ALY EL DEFRAWY				
Co Admin:					
<u>2021 Generator Info</u>					
Gen No:	ON9068684			Choice of Contact:	CO_OFFICIAL
ID:	37309			Phone No Official:	6134222202 Ext.
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	446110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	COOPER PHARMACY INC				
Gen Div:	SWIFT COMPOUNDING PHARMACY				
Gen Op Name:	SWIFT COMPOUNDING PHARMACY				
Gen Op Div:					
Site Adrs1:	276 BANK ST				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Bldg: Site Pobox: Province In: ONTARIO Site Adrs2: Site City: OTTAWA Province Out: Site Postal Code: K2P 1X6 Site Country: Canada Co Official: ALY EL DEFRAWY Co Admin:					
2021 Generator Manifest					
ID: 62978 Generator No: ON9068684 Receiver Type: 030 Waste Char: A Waste Code: 261		Sum Received Qty: 14.05 Waste Class Name: PHARMACEUTICALS Count Manifests: 2 District: 402			
24	1 of 2	E/110.1	76.9 / -0.93	379 Cooper Street Ottawa ON K2P 0G8	EHS
Order No: 20180712164 Status: C Report Type: Standard Report Report Date: 19-JUL-18 Date Received: 12-JUL-18 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory; Aerial Photos		Nearest Intersection: Municipality: Ottawa Client Prov/State: ON Search Radius (km): .25 X: -75.696233 Y: 45.416539			
24	2 of 2	E/110.1	76.9 / -0.93	379 Cooper Street Ottawa ON K2P 0G8	EHS
Order No: 21051300364 Status: C Report Type: Site Report Report Date: 14-MAY-21 Date Received: 13-MAY-21 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .001 X: -75.6962569 Y: 45.4165681			
25	1 of 1	NE/110.3	76.9 / -0.93	309 Lisgar Avenue Ottawa ON	EHS
Order No: 20110307024 Status: C Report Type: Standard Report Report Date: 3/9/2011 Date Received: 3/7/2011 12:24:30 PM Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -75.696832 Y: 45.417327			
26	1 of 1	NW/114.9	77.9 / 0.07	BAYVIEW PROPERTY MANAGEMENT 210 BANK STREET OTTAWA ON K2P 1W8	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON7938408			Choice of Contact:	
Approval Years:	07,08			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	531310
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Real Estate Property Managers			
<u>Waste Detail(s)</u>					
Waste Class:	221				
Waste Class Name:	LIGHT FUELS				
<u>27</u>	1 of 1	W/116.2	77.9 / 0.07	226 Nepean St Ottawa ON K2P0B8	EHS
Order No:	20180404190			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	10-APR-18			Search Radius (km):	.25
Date Received:	04-APR-18			X:	-75.699113
Previous Site Name:				Y:	45.416671
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans			
<u>28</u>	1 of 1	ENE/118.6	76.9 / -0.93	300 Lisgar St and 375 Cooper St Ottawa ON	EHS
Order No:	20060914012			Nearest Intersection:	Lisgar Street and O'Connor Street
Status:	C			Municipality:	
Report Type:	Complete Report			Client Prov/State:	ON
Report Date:	9/25/2006			Search Radius (km):	0.25
Date Received:	9/14/2006			X:	-75.696169
Previous Site Name:				Y:	45.416845
Lot/Building Size:					
Additional Info Ordered:					
<u>29</u>	1 of 1	NNE/120.1	76.9 / -0.95	ON	WWIS
Well ID:	7296899			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	10/06/2017
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	C30157			Contractor:	7328
Tag:	A203689			Form Version:	8
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Static Water Level: Clear/Cloudy: Municipality: Site Info:				Zone: UTM Reliability:	
NEPEAN TOWNSHIP					
Additional Detail(s) (Map)					
Bore Hole ID:	1006764387			Tag No:	A203689
Depth M:				Contractor:	7328
Year Completed:	2017			Latitude:	45.4175047288114
Well Completed Dt:	08/24/2017			Longitude:	-75.697232269949
Audit No:	C30157			Y:	45.417504721938684
Path:				X:	-75.69723210832771
Bore Hole Information					
Bore Hole ID:	1006764387			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445448.00
Code OB Desc:				North83:	5029568.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	08/24/2017			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
30	1 of 1	N/120.8	77.3 / -0.47	177 Nepean St Ottawa ON K2P 1W7	EHS
Order No:	20191101030			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	06-NOV-19			Search Radius (km):	.25
Date Received:	01-NOV-19			X:	-75.69774
Previous Site Name:				Y:	45.417552
Lot/Building Size:					
Additional Info Ordered:					
31	1 of 1	NE/121.1	76.9 / -0.93	PE3651 - 293 Lisgar Street & 176 Nepean Street Ottawa ON K2P 0B6	EHS
Order No:	20292400956			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	29-SEP-20			Search Radius (km):	.25
Date Received:	24-SEP-20			X:	-75.6969478
Previous Site Name:				Y:	45.4174346
Lot/Building Size:					
Additional Info Ordered:					
32	1 of 1	NNW/121.2	77.9 / 0.07	205 Bank Street Ottawa ON K2P 1W7	EHS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Order No: 20120329004 Status: C Report Type: Custom Report Report Date: 4/4/2012 9:17:04 AM Date Received: 3/29/2012 9:15:30 AM Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -75.698073 Y: 45.417517					
33	1 of 6	ESE/122.7	76.9 / -0.93	The Ottawa Xpress 396 Cooper St Suite 204 Ottawa ON K2P 2H7	SCT
Established: 1992 Plant Size (ft²): Employment: 15					
--Details-- Description: Newspaper Publishers SIC/NAICS Code: 511110					
33	2 of 6	ESE/122.7	76.9 / -0.93	The Ottawa X Press - Div. of Communications Voir Inc. 396 Cooper St Suite 204 Ottawa ON K2P 2H7	SCT
Established: 1992 Plant Size (ft²): Employment: 15					
--Details-- Description: Newspaper Publishers SIC/NAICS Code: 511110					
33	3 of 6	ESE/122.7	76.9 / -0.93	Communications Voir Inc. 396 Cooper St Suite 204 Ottawa ON K2P 2H7	SCT
Established: 1992 Plant Size (ft²): Employment: 15					
--Details-- Description: Newspaper Publishers SIC/NAICS Code: 511110					
33	4 of 6	ESE/122.7	76.9 / -0.93	Communications Voir Inc. 396 Cooper St Suite 204 Ottawa ON K2P 2H7	SCT
Established: 2000 Plant Size (ft²): Employment: 15					
--Details--					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Description: SIC/NAICS Code:		Newspaper Publishers 511110			
33	5 of 6	ESE/122.7	76.9 / -0.93	Ottawa X Press 396 Cooper St Suite 204 Ottawa ON K2P 2H7	SCT
Established: Plant Size (ft²): Employment:		14			
--Details-- Description: SIC/NAICS Code:		Periodical Publishers 511120			
33	6 of 6	ESE/122.7	76.9 / -0.93	Imagnan Corp. 396 Cooper St Suite 203 Ottawa ON K2P 2H7	SCT
Established: Plant Size (ft²): Employment:		1995 5			
--Details-- Description: SIC/NAICS Code:		All Other Industrial Machinery Manufacturing 333299			
34	1 of 1	N/124.5	77.9 / 0.07	203 Bank St Ottawa ON K2P1W7	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:		20150804104 C Custom Report 10-AUG-15 04-AUG-15		Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y: ON .25 -75.697868 45.417577	
35	1 of 1	WNW/125.7	77.9 / 0.07	215 Nepean St Ottawa ON K2P2K5	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:		20150731085 C Standard Report 10-AUG-15 31-JUL-15		Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y: ON .25 -75.698906 45.417178	
36	1 of 5	N/125.9	77.9 / 0.07	CAPITAL XTRA INC. 177 NEPEAN ST SUITE 500 OTTAWA ON K2P 0B4	SCT

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Established:		1994			
Plant Size (ft²):		1800			
Employment:		7			
--Details--					
Description:		Newspaper Publishers			
SIC/NAICS Code:		511110			
36	2 of 5	N/125.9	77.9 / 0.07	PRIVATE RESIDENCE 177 NIPEON STREET FURNACE OIL TANK OTTAWA CITY ON	SPL
Ref No:	164499			Municipality No:	20101
Year:				Nature of Damage:	
Incident Dt:	//			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	2/9/1999			Impact to Health:	
Dt Document Closed:				Agency Involved:	
Site No:					
MOE Response:					
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					
Site Name:					
Site Address:					
Site Region:					
Site Municipality:		OTTAWA CITY			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northings:					
Easting:					
Entity Operating Name:					
Client Name:					
Client Type:					
Source Type:					
Incident Cause:		UNDERGROUND TANK LEAK			
Incident Preceding Spill:					
Incident Reason:		UNKNOWN			
Incident Summary:		PVT OWNER- UNK QTY FURNACE OIL TO GND, LEAK IN BURIED TANK.			
Environment Impact:		POSSIBLE			
Health Env Consequence:					
Nature of Impact:		Soil contamination			
Contaminant Qty:					
Contaminant Qty 1:					
Contaminant Unit:					
Contaminant Code:					
Contaminant Name:					
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:		LAND			
Activity Preceding Spill:					
Property 2nd Watershed:					
Property Tertiary Watershed:					
Sector Type:					
SAC Action Class:					
Call Report Locatn Geodata:					
Time Reported:					
System Facility Address:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
36	3 of 5	N/125.9	77.9 / 0.07	District Realty Corporation 177 Nepean Street Ottawa ON K2P 0B4	GEN
Generator Info					
Generator No:	ON3439760			Choice of Contact:	
Approval Years:	05			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	531310
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	Real Estate Property Managers				
Waste Detail(s)					
Waste Class:	243				
Waste Class Name:	PCB'S				
36	4 of 5	N/125.9	77.9 / 0.07	Mel Cohen Realty Ltd. 177 Nepean Street Ottawa ON	CA
Certificate #:	4169-6X5R3J				
Application Year:	2007				
Issue Date:	1/18/2007				
Approval Type:	Air				
Status:	Approved				
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					
36	5 of 5	N/125.9	77.9 / 0.07	Mel Cohen Realty Ltd. 177 Nepean Street Ottawa ON K1Y 2E9	ECA
Approval No:	4169-6X5R3J			MOE District:	Ottawa
Approval Date:	2007-01-18			City:	
Status:	Approved			Longitude:	-75.697105
Record Type:	ECA			Latitude:	45.417862
Link Source:	IDS			Geometry X:	
SWP Area Name:	Rideau Valley			Geometry Y:	
Approval Type:	ECA-AIR				
Project Type:	AIR				
Business Name:	Mel Cohen Realty Ltd.				
Address:	177 Nepean Street				
Full Address:					
Full PDF Link:	https://www.accessenvironment.ene.gov.on.ca/instruments/7918-6JULYV-14.pdf				
PDF Site Location:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
37	1 of 1	ENE/126.4	76.9 / -0.93	355 COOPER ST OTTAWA ON	WWIS
Well ID:7305580 Construction Date: Use 1st:Test Hole Use 2nd:Monitoring Final Well Status:Observation Wells Water Type: Casing Material: Audit No:Z212307 Tag:A182697 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality:OTTAWA CITY Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received:02/13/2018 Selected Flag:TRUE Abandonment Rec: Contractor:7241 Form Version:7 Owner: County:OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/730\7305580.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		01/09/2018			
Year Completed:		2018			
Depth (m):		7.62			
Latitude:		45.4169977753238			
Longitude:		-75.6962291165246			
X:		-75.69622895463574			
Y:		45.41699776833719			
Path:		730\7305580.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1006985634		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				18	
Code OB Desc:				East83:	
Open Hole:				445526.00	
Cluster Kind:				North83:	
Date Completed:		01/09/2018		5029511.00	
Remarks:				Org CS:	
Location Method Desc:		on Water Well Record		UTM83	
Elevrc Desc:				UTMRC:	
Location Source Date:				4	
Improvement Location Source:				UTMRC Desc:	
Improvement Location Method:				margin of error : 30 m - 100 m	
Source Revision Comment:				Location Method:	
Supplier Comment:				wwr	
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007145607			
Layer:		2			
Color:		6			
General Color:		BROWN			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.6100000143051147			
Formation End Depth:		4.570000171661377			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007145606			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:					
Material 2 Desc:					
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.6100000143051147			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007145608			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		4.570000171661377			
Formation End Depth:		7.619999885559082			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007145617			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		3.9600000381469727			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007145618			
Layer:		3			
Plug From:		3.9600000381469727			
Plug To:		7.619999885559082			
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007145616			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007145615			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007145605			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007145611			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.570000171661377			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007145612			
Layer:		1			
Slot:		10			
Screen Top Depth:		4.570000171661377			
Screen End Depth:		7.619999885559082			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.840000152587891			
<u>Water Details</u>					
Water ID:		1007145610			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007145609			
Diameter:		8.25			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From:		0.0			
Depth To:		7.619999885559082			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
38	1 of 1	ESE/127.2	76.9 / -0.93	275 Bank St Ottawa ON K2P2L6	EHS
Order No:		20160210002		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Custom Report		Client Prov/State:	ON
Report Date:		16-FEB-16		Search Radius (km):	.25
Date Received:		10-FEB-16		X:	-75.696311
Previous Site Name:				Y:	45.415823
Lot/Building Size:					
Additional Info Ordered:					
39	1 of 11	S/127.5	77.9 / 0.07	Centretown Community Health Centre Inc. 420 Cooper Street Ottawa ON K2P 2N6	GEN
<u>Generator Info</u>					
Generator No:		ON9263707		Choice of Contact:	
Approval Years:		2010		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	621494
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Community Health Centres			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
39	2 of 11	S/127.5	77.9 / 0.07	Centretown Community Health Centre Inc. 420 Cooper Street Ottawa ON K2P 2N6	GEN
<u>Generator Info</u>					
Generator No:		ON9263707		Choice of Contact:	
Approval Years:		2011		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	621494
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Community Health Centres			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
39	3 of 11	S/127.5	77.9 / 0.07	Centretown Community Health Centre Inc. 420 Cooper Street Ottawa ON K2P 2N6	GEN
<u>Generator Info</u>					
Generator No:	ON9263707			Choice of Contact:	
Approval Years:	2012			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	621494
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	Community Health Centres				
<u>Waste Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
39	4 of 11	S/127.5	77.9 / 0.07	Centretown Community Health Centre Inc. 420 Cooper Street Ottawa ON	GEN
<u>Generator Info</u>					
Generator No:	ON9263707			Choice of Contact:	
Approval Years:	2013			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	621494
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
39	5 of 11	S/127.5	77.9 / 0.07	Centretown Community Health Centre Inc. 420 Cooper Street Ottawa ON K2P 2N6	GEN
<u>Generator Info</u>					
Generator No:		ON9263707		Choice of Contact:	CO_ADMIN
Approval Years:		2016		Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	621494
Country:		Canada			
Co Admin:		Dan McNamara			
Phone No Admin:		613-233-4443 Ext.2173			
SIC Description:		621494			
<u>Waste Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
39	6 of 11	S/127.5	77.9 / 0.07	Centretown Community Health Centre Inc. 420 Cooper Street Ottawa ON K2P 2N6	GEN
<u>Generator Info</u>					
Generator No:		ON9263707		Choice of Contact:	CO_ADMIN
Approval Years:		2015		Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	621494
Country:		Canada			
Co Admin:		Dan McNamara			
Phone No Admin:		613-233-4443 Ext.2173			
SIC Description:		621494			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
39	7 of 11	S/127.5	77.9 / 0.07	Centretown Community Health Centre Inc. 420 Cooper Street Ottawa ON K2P 2N6	GEN

Generator Info

Generator No:	ON9263707	Choice of Contact:	CO_ADMIN
Approval Years:	2014	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	621494
Country:	Canada		
Co Admin:	Dan McNamara		
Phone No Admin:	613-233-4443 Ext.2173		
SIC Description:	621494		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class:	261
Waste Class Name:	PHARMACEUTICALS

39	8 of 11	S/127.5	77.9 / 0.07	Centretown Community Health Centre Inc. 420 Cooper Street Ottawa ON K2P 2N6	GEN

Generator Info

Generator No:	ON9263707	Choice of Contact:	
Approval Years:	As of Dec 2018	Contaminated Fac:	
Status:	Registered	MHSW Facility:	
PO Box No:		SIC Code:	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	Pathological wastes

Waste Detail(s)

Waste Class:	261 A
Waste Class Name:	Pharmaceuticals

39	9 of 11	S/127.5	77.9 / 0.07	Centretown Community Health Centre Inc. 420 Cooper Street Ottawa ON K2P 2N6	GEN

Generator Info

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON9263707 Approval Years: As of Jul 2020 Status: Registered PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description: Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
<u>Waste Detail(s)</u>					
Waste Class: 312 P Waste Class Name: Pathological wastes					
<u>Waste Detail(s)</u>					
Waste Class: 261 A Waste Class Name: Pharmaceuticals					
39	10 of 11	S/127.5	77.9 / 0.07	Centretown Community Health Centre Inc. 420 Cooper Street Ottawa ON K2P 2N6	GEN
<u>Generator Info</u>					
Generator No: ON9263707 Approval Years: As of Nov 2021 Status: Registered PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description: Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
<u>Waste Detail(s)</u>					
Waste Class: 312 P Waste Class Name: Pathological wastes					
<u>Waste Detail(s)</u>					
Waste Class: 261 A Waste Class Name: Pharmaceuticals					
39	11 of 11	S/127.5	77.9 / 0.07	Centretown Community Health Centre Inc. 420 Cooper Street Ottawa ON K2P 2N6	GEN
<u>Generator Info</u>					
Generator No: ON9263707 Approval Years: As of Oct 2022 Status: Registered PO Box No: Country: Canada Co Admin: Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Phone No Admin: SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		261 A			
Waste Class Name:		PHARMACEUTICALS			
<u>Waste Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>2017 Generator Info</u>					
Gen No:	ON9263707			Choice of Contact:	CO_ADMIN
ID:	36175			Phone No Official:	613-233-4443 Ext.2135
Contaminated Fac:	N			Phone No Admin:	613-233-4443 Ext.2173
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	621494			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		Centretown Community Health Centre Inc.			
Gen Div:					
Gen Op Name:		Centretown Community Health Centre			
Gen Op Div:					
Site Adrs1:		420 Cooper Street			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2P 2N6			
Site Country:		Canada			
Co Official:		Christine Nadori			
Co Admin:		Dan McNamara			
<u>2017 Generator Manifest</u>					
ID:	64530			Sum Received Qty:	172.94
Generator No:	ON9263707			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	7
Waste Char:	P			District:	402
Waste Code:	312				
<u>2017 Generator Manifest</u>					
ID:	64529			Sum Received Qty:	35.46
Generator No:	ON9263707			Waste Class Name:	PHARMACEUTICALS
Receiver Type:	030			Count Manifests:	7
Waste Char:	A			District:	402
Waste Code:	261				
<u>2018 Generator Info</u>					
Gen No:	ON9263707			Choice of Contact:	CO_ADMIN
ID:	36886			Phone No Official:	613-233-4443 Ext.2135
Contaminated Fac:	N			Phone No Admin:	613-233-4443 Ext.2173
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	621494			County Out:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
NAICS Code2:		District:			402
NAICS Code3:					
Gen Name:		Centretown Community Health Centre Inc.			
Gen Div:					
Gen Op Name:		Centretown Community Health Centre			
Gen Op Div:					
Site Adrs1:		420 Cooper Street			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2P 2N6			
Site Country:		Canada			
Co Official:		Christine Nadori			
Co Admin:		Dan McNamara			
<u>2018 Generator Manifest</u>					
ID:	65024	Sum Received Qty:		153.9	
Generator No:	ON9263707	Waste Class Name:		PATHOLOGICAL WASTES	
Receiver Type:	030	Count Manifests:		6	
Waste Char:	P	District:		402	
Waste Code:	312				
<u>2018 Generator Manifest</u>					
ID:	65023	Sum Received Qty:		36.6	
Generator No:	ON9263707	Waste Class Name:		PHARMACEUTICALS	
Receiver Type:	030	Count Manifests:		6	
Waste Char:	A	District:		402	
Waste Code:	261				
<u>2019 Generator Info</u>					
Gen No:	ON9263707	Choice of Contact:		CO_ADMIN	
ID:	37416	Phone No Official:		613-233-4443 Ext.2135	
Contaminated Fac:	N	Phone No Admin:		613-233-4443 Ext.2173	
MHSW Facility:	N	County Ont:		OTTAWA CARLTON (RM)	
NAICS Code1:	621494	County Out:			
NAICS Code2:		District:		402	
NAICS Code3:					
Gen Name:		Centretown Community Health Centre Inc.			
Gen Div:					
Gen Op Name:		Centretown Community Health Centre			
Gen Op Div:					
Site Adrs1:		420 Cooper Street			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2P 2N6			
Site Country:		Canada			
Co Official:		Christine Nadori			
Co Admin:		Dan McNamara			
<u>2019 Generator Manifest</u>					
ID:	65024	Sum Received Qty:		186.0	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No:	ON9263707			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	7
Waste Char:	P			District:	402
Waste Code:	312				
<u>2019 Generator Manifest</u>					
ID:	65023			Sum Received Qty:	30.0
Generator No:	ON9263707			Waste Class Name:	PHARMACEUTICALS
Receiver Type:	030			Count Manifests:	6
Waste Char:	A			District:	402
Waste Code:	261				
<u>2020 Generator Info</u>					
Gen No:	ON9263707			Choice of Contact:	CO_OFFICIAL
ID:	37158			Phone No Official:	613-233-4443 Ext.2135
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	621494			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	Centretown Community Health Centre Inc.				
Gen Div:					
Gen Op Name:	Centretown Community Health Centre				
Gen Op Div:					
Site Adrs1:	420 Cooper Street				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K2P 2N6				
Site Country:	Canada				
Co Official:	Julie Genzel				
Co Admin:					
<u>2020 Generator Manifest</u>					
ID:	61129			Sum Received Qty:	61.7
Generator No:	ON9263707			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	4
Waste Char:	P			District:	402
Waste Code:	312				
<u>2020 Generator Manifest</u>					
ID:	61126			Sum Received Qty:	20.1
Generator No:	ON9263707			Waste Class Name:	PHARMACEUTICALS
Receiver Type:	035			Count Manifests:	1
Waste Char:	A			District:	305
Waste Code:	261				
<u>2020 Generator Manifest</u>					
ID:	61127			Sum Received Qty:	27.9
Generator No:	ON9263707			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	035			Count Manifests:	1
Waste Char:	P			District:	305
Waste Code:	312				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2020 Generator Manifest</u>					
ID:	61128			Sum Received Qty:	21.1
Generator No:	ON9263707			Waste Class Name:	PHARMACEUTICALS
Receiver Type:	030			Count Manifests:	4
Waste Char:	A			District:	402
Waste Code:	261				
<u>2021 Generator Info</u>					
Gen No:	ON9263707			Choice of Contact:	CO_OFFICIAL
ID:	38127			Phone No Official:	613-233-4443 Ext.2135
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	621494			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	Centretown Community Health Centre Inc.				
Gen Div:					
Gen Op Name:	Centretown Community Health Centre				
Gen Op Div:					
Site Adrs1:	420 Cooper Street				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K2P 2N6				
Site Country:	Canada				
Co Official:	Julie Genzel				
Co Admin:					
<u>2021 Generator Manifest</u>					
ID:	63922			Sum Received Qty:	36.38
Generator No:	ON9263707			Waste Class Name:	PHARMACEUTICALS
Receiver Type:	030			Count Manifests:	7
Waste Char:	A			District:	402
Waste Code:	261				
<u>2021 Generator Manifest</u>					
ID:	63923			Sum Received Qty:	141.4
Generator No:	ON9263707			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	7
Waste Char:	P			District:	402
Waste Code:	312				
40	1 of 7	S/131.1	77.9 / 0.07	GVT. OF CAN. - R.C.M.P. OTTAWA A DIVISION, DRUG SECTION 400 COOPER STREET OTTAWA ON K1A 0R4	GEN
<u>Generator Info</u>					
Generator No:	ON0283126			Choice of Contact:	
Approval Years:	86,87,88,89,90,92,93,97,98,99,00,01			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	0007

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Country: Co Admin: Phone No Admin: SIC Description: LETTER ACKNOWLEDG.					
<u>Waste Detail(s)</u>					
Waste Class: 148 Waste Class Name: INORGANIC LABORATORY CHEMICALS					
<u>Waste Detail(s)</u>					
Waste Class: 263 Waste Class Name: ORGANIC LABORATORY CHEMICALS					
40	2 of 7	S/131.1	77.9 / 0.07	GVT. OF CAN. - R.C.M.P. 18-132 OTTAWA A DIVISION, DRUG SECTION 400 COOPER STREET OTTAWA ON K1A 0R4	GEN
<u>Generator Info</u>					
Generator No: ON0283126 Approval Years: 94,95,96 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: POLICE SERVICES					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 8123					
<u>Waste Detail(s)</u>					
Waste Class: 148 Waste Class Name: INORGANIC LABORATORY CHEMICALS					
<u>Waste Detail(s)</u>					
Waste Class: 263 Waste Class Name: ORGANIC LABORATORY CHEMICALS					
40	3 of 7	S/131.1	77.9 / 0.07	400 Cooper Street Ottawa ON K2P 2H8	EHS
Order No: 20050121005 Status: C Report Type: Report Date: 1/31/2005 Date Received: 1/21/2005 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Cooper St & Bank St Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -75.697694 Y: 45.415475					
40	4 of 7	S/131.1	77.9 / 0.07	400 Cooper Street, Ottawa ON K2P 2H8	EHS
Order No: 20070201023 Nearest Intersection:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: C Report Type: CAN - Custom Report Report Date: 2/7/2007 Date Received: 2/1/2007 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Municipality: Client Prov/State: Search Radius (km): 0.25 X: -75.697734 Y: 45.415526					
40	5 of 7	S/131.1	77.9 / 0.07	400 Cooper Street Ottawa ON K2P 2N1	EHS
Order No: 20190926204 Status: C Report Type: Standard Report Report Date: 01-OCT-19 Date Received: 26-SEP-19 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory					
Nearest Intersection: Municipality: Client Prov/State: QC Search Radius (km): .25 X: -75.697355 Y: 45.415736					
40	6 of 7	S/131.1	77.9 / 0.07	400 Cooper Building Inc. 400 Cooper Street Ottawa ON K2P 2H8	GEN
Generator Info					
Generator No: ON3843447 Approval Years: As of Oct 2022 Status: Registered PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description:					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
Waste Detail(s)					
Waste Class: 251 L Waste Class Name: OIL SKIMMINGS & SLUDGES					
40	7 of 7	S/131.1	77.9 / 0.07	400 Cooper Street Ottawa ON K2P 2N1	EHS
Order No: 22011700090 Status: C Report Type: Custom Report Report Date: 24-JAN-22 Date Received: 17-JAN-22 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: QC Search Radius (km): .25 X: -75.6973548 Y: 45.4157364					
41	1 of 5	N/131.9	76.9 / -0.95	E.A.S. ILLUSTRATORS & PRINTERS LTD 171 NEPEAN ST. OTTAWA ON K2P 0B4	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON1203100			Choice of Contact:	
Approval Years:	89			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	2811
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		BUSINESS FORMS PRINT			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
41	2 of 5	N/131.9	76.9 / -0.95	E.A.S. ILLUSTRATORS & PRINTERS LTD14-740 171 NEPEAN ST. OTTAWA ON K2P 0B4	GEN
<u>Generator Info</u>					
Generator No:	ON1203100			Choice of Contact:	
Approval Years:	92,93,94,95,96			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	2811
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		BUSINESS FORMS PRINT			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
41	3 of 5	N/131.9	76.9 / -0.95	E.A.S. (OUT OF BUS) 14-740 171 NEPEAN ST. OTTAWA ON K2P 0B4	GEN
<u>Generator Info</u>					
Generator No:	ON1203100			Choice of Contact:	
Approval Years:	97,98			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	2811
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		BUSINESS FORMS PRINT.			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
41	4 of 5	N/131.9	76.9 / -0.95	ARMCO PRINT 02-638 171 NEPEAN STREET OTTAWA ON K2P 0B4	GEN
Generator Info					
Generator No:	ON1550000			Choice of Contact:	
Approval Years:	92,93,96,97,98			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	2819
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	OTHER COMM. PRINTING				
Waste Detail(s)					
Waste Class:	264				
Waste Class Name:	PHOTOPROCESSING WASTES				
41	5 of 5	N/131.9	76.9 / -0.95	ARMCO PRINT 02-638 171 NEPEAN STREET OTTAWA ON K2P 0B4	GEN
Generator Info					
Generator No:	ON1550000			Choice of Contact:	
Approval Years:	94,95			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	2819
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	OTHER COMM. PRINTING				
Waste Detail(s)					
Waste Class:	264				
Waste Class Name:	PHOTOPROCESSING WASTES				
42	1 of 1	ENE/133.1	76.9 / -0.93	355 COOPER ST OTTAWA ON	WWIS
Well ID:	7305582			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:	Monitoring			Data Src:	
Final Well Status:	Observation Wells			Date Received:	02/13/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z212306			Contractor:	7241
Tag:	A182722			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Static Water Level: Clear/Cloudy: Municipality: Site Info:			Zone: UTM Reliability:		
OTTAWA CITY					
PDF URL (Map):			https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/730\7305582.pdf		
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:			01/09/2018		
Year Completed:			2018		
Depth (m):			3.96		
Latitude:			45.4169893978879		
Longitude:			-75.6961267659723		
X:			-75.69612660422017		
Y:			45.416989391278506		
Path:			730\7305582.pdf		
<u>Bore Hole Information</u>					
Bore Hole ID:			1006985640		
DP2BR:			Elevation:		
Spatial Status:			Elevrc:		
Code OB:			Zone:		
Code OB Desc:			East83:		
Open Hole:			North83:		
Cluster Kind:			Org CS:		
Date Completed:			UTMRC:		
Remarks:			UTMRC Desc:		
Location Method Desc:			Location Method:		
Elevrc Desc:			18		
Location Source Date:			445534.00		
Improvement Location Source:			5029510.00		
Improvement Location Method:			UTM83		
Source Revision Comment:			4		
Supplier Comment:			margin of error : 30 m - 100 m		
on Water Well Record			wwr		
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:			1007145636		
Layer:			3		
Color:			2		
General Color:			GREY		
Material 1:			05		
Material 1 Desc:			CLAY		
Material 2:					
Material 2 Desc:					
Material 3:			85		
Material 3 Desc:			SOFT		
Formation Top Depth:			1.8300000429153442		
Formation End Depth:			3.9600000381469727		
Formation End Depth UOM:			m		
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:			1007145635		
Layer:			2		
Color:			6		
General Color:			BROWN		
Material 1:			05		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		1.83000000429153442			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007145634			
Layer:		1			
Color:		2			
General Color:		GREY			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:					
Material 2 Desc:					
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007145646			
Layer:		3			
Plug From:		0.91000000262260437			
Plug To:		3.96000000381469727			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007145644			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007145645			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		0.91000000262260437			
Plug Depth UOM:		m			
 <u>Method of Construction & Well</u> <u>Use</u>					
Method Construction ID:		1007145643			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		1007145633			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007145639			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		0.9100000262260437			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007145640			
Layer:		1			
Slot:		10			
Screen Top Depth:		0.9100000262260437			
Screen End Depth:		3.9600000381469727			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
<u>Water Details</u>					
Water ID:		1007145638			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007145637			
Diameter:		5.679999828338623			
Depth From:		0.0			
Depth To:		3.9600000381469727			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
43	1 of 1	SE/133.2	76.9 / -0.93	275 Bank Street Ottawa ON K2P 2L6	EHS
Order No:	20101027019			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	ON
Report Date:	11/2/2010			Search Radius (km):	0.25
Date Received:	10/27/2010 11:39:28 AM			X:	-75.696426
Previous Site Name:				Y:	45.415638
Lot/Building Size:					
Additional Info Ordered:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
44	1 of 1	ENE/133.4	76.9 / -0.90	355 COOPER ST OTTAWA ON	WWIS
Well ID: 7305579				Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st: Test Hole				Data Entry Status:	
Use 2nd: Monitoring				Data Src:	
Final Well Status: Test Hole				Date Received: 02/13/2018	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No: Z212304				Contractor: 7241	
Tag: A182713				Form Version: 7	
Constructn Method:				Owner:	
Elevation (m):				County: OTTAWA-CARLETON	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality: OTTAWA CITY					
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/730\7305579.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 01/09/2018					
Year Completed: 2018					
Depth (m): 7.62					
Latitude: 45.4169356279409					
Longitude: -75.6960877624537					
X: -75.69608760028636					
Y: 45.41693562108875					
Path: 730\7305579.pdf					
<u>Bore Hole Information</u>					
Bore Hole ID: 1006985631				Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone: 18	
Code OB:				East83: 445537.00	
Code OB Desc:				North83: 5029504.00	
Open Hole:				Org CS: UTM83	
Cluster Kind:				UTMRC: 4	
Date Completed: 01/09/2018				UTMRC Desc: margin of error : 30 m - 100 m	
Remarks:				Location Method: wwr	
Location Method Desc: on Water Well Record					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID: 1007145594					
Layer: 3					
Color: 2					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		4.570000171661377			
Formation End Depth:		7.619999885559082			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007145593			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.6100000143051147			
Formation End Depth:		4.570000171661377			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007145592			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.6100000143051147			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007145604			
Layer:		3			
Plug From:		3.9600000381469727			
Plug To:		7.619999885559082			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007145603			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		3.9600000381469727			
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007145602			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007145601			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007145591			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007145597			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.570000171661377			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007145598			
Layer:		1			
Slot:		10			
Screen Top Depth:		4.570000171661377			
Screen End Depth:		7.619999885559082			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
<u>Water Details</u>					
Water ID:		1007145596			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole ID: Diameter: Depth From: Depth To: Hole Depth UOM: Hole Diameter UOM:		1007145595 8.25 0.0 7.6199998855559082 m cm			

45	1 of 12	SSE/134.3	78.0 / 0.16	Ontario Addiction Treatment Centres 401 Somerset Street, West Ottawa ON K2P 0K1	GEN

Generator Info

Generator No:	ON8183220	Choice of Contact:	
Approval Years:	2010	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	621110
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Offices of Physicians		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

45	2 of 12	SSE/134.3	78.0 / 0.16	Dedicated National Pharmacy (In Receivership) 401 Somerset St West Ottawa ON K2P 0K1	GEN

Generator Info

Generator No:	ON8383037	Choice of Contact:	
Approval Years:	2010	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	446110
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Pharmacies and Drug Stores		

Waste Detail(s)

Waste Class:	261
Waste Class Name:	PHARMACEUTICALS

45	3 of 12	SSE/134.3	78.0 / 0.16	Dedicated National Pharmacy (In Receivership) 401 Somerset St West Ottawa ON K2P 0K1	GEN

Generator Info

Generator No:	ON8383037	Choice of Contact:	
Approval Years:	2011	Contaminated Fac:	
Status:		MHSW Facility:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No:				SIC Code:	446110
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Pharmacies and Drug Stores			
<u>Waste Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
45	4 of 12	SSE/134.3	78.0 / 0.16	Ontario Addiction Treatment Centres 401 Somerset Street, West Ottawa ON K2P 0K1	GEN
<u>Generator Info</u>					
Generator No:		ON8183220		Choice of Contact:	
Approval Years:		2011		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	
Country:				621110	
Co Admin:					
Phone No Admin:					
SIC Description:		Offices of Physicians			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
45	5 of 12	SSE/134.3	78.0 / 0.16	Ontario Addiction Treatment Centres 401 Somerset Street, West Ottawa ON K2P 0K1	GEN
<u>Generator Info</u>					
Generator No:		ON8183220		Choice of Contact:	
Approval Years:		2012		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	
Country:				621110	
Co Admin:					
Phone No Admin:					
SIC Description:		Offices of Physicians			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
45	6 of 12	SSE/134.3	78.0 / 0.16	Ontario Addiction Treatment Centres 401 Somerset Street, West Ottawa ON	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON8183220			Choice of Contact:	
Approval Years:	2013			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	621110
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		OFFICES OF PHYSICIANS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
45	7 of 12	SSE/134.3	78.0 / 0.16	Ontario Addiction Treatment Centres 401 Somerset Street, West Ottawa ON K2P0K1	GEN
<u>Generator Info</u>					
Generator No:	ON8183220			Choice of Contact:	CO_OFFICIAL
Approval Years:	2015			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	621110
Country:	Canada				
Co Admin:		Rhonda Daiter			
Phone No Admin:		4168166110 Ext.			
SIC Description:		OFFICES OF PHYSICIANS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
45	8 of 12	SSE/134.3	78.0 / 0.16	Ontario Addiction Treatment Centres 401 Somerset Street, West Ottawa ON K2P0K1	GEN
<u>Generator Info</u>					
Generator No:	ON8183220			Choice of Contact:	CO_OFFICIAL
Approval Years:	2016			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	621110
Country:	Canada				
Co Admin:		Rhonda Daiter			
Phone No Admin:		4168166110 Ext.			
SIC Description:		OFFICES OF PHYSICIANS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
45	9 of 12	SSE/134.3	78.0 / 0.16	Ontario Addiction Treatment Centres 401 Somerset Street, West Ottawa ON K2P0K1	GEN

Generator Info

Generator No:	ON8183220	Choice of Contact:	CO_OFFICIAL
Approval Years:	2014	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	621110
Country:	Canada		
Co Admin:	Rhonda Daiter		
Phone No Admin:	4168166110 Ext.		
SIC Description:	OFFICES OF PHYSICIANS		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

45	10 of 12	SSE/134.3	78.0 / 0.16	Canadian Addiction Treatment Clinics LP 401 Somerset Street, West Ottawa ON K2P0K1	GEN

Generator Info

Generator No:	ON8183220	Choice of Contact:	
Approval Years:	As of Dec 2018	Contaminated Fac:	
Status:	Registered	MHSW Facility:	
PO Box No:		SIC Code:	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	Pathological wastes

45	11 of 12	SSE/134.3	78.0 / 0.16	Canadian Addiction Treatment Clinics LP 401 Somerset Street, West Ottawa ON K2P0K1	GEN

Generator Info

Generator No:	ON8183220	Choice of Contact:	
Approval Years:	As of Jul 2020	Contaminated Fac:	
Status:	Registered	MHSW Facility:	
PO Box No:		SIC Code:	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		312 P Pathological wastes			

45	12 of 12	SSE/134.3	78.0 / 0.16	Canadian Addiction Treatment Clinics LP 401 Somerset Street, West Ottawa ON K2P0K1	GEN

Generator Info

Generator No:	ON8183220	Choice of Contact:	
Approval Years:	As of Jan 2021	Contaminated Fac:	
Status:	Registered	MHSW Facility:	
PO Box No:		SIC Code:	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	Pathological wastes

2017 Generator Info

Gen No:	ON8183220	Choice of Contact:	CO_OFFICIAL
ID:	32026	Phone No Official:	647-988-4071 Ext.
Contaminated Fac:	N	Phone No Admin:	647-208-8510 Ext.
MHSW Facility:	N	County Ont:	RENFREW
NAICS Code1:	621110	County Out:	
NAICS Code2:		District:	402
NAICS Code3:			
Gen Name:	Canadian Addiction Treatment Clinics LP		
Gen Div:			
Gen Op Name:	Ontario Addiction Treatment Centres		
Gen Op Div:	O.A.T.C. Ottawa		
Site Adrs1:	401 Somerset Street, West		
Site Bldg:	OATC Ottawa		
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K2P0K1		
Site Country:	Canada		
Co Official:	Raffi Laras		
Co Admin:	Robyn Yack		

2018 Generator Info

Gen No:	ON8183220	Choice of Contact:	CO_OFFICIAL
ID:	32626	Phone No Official:	647-208-8510 Ext.
Contaminated Fac:	N	Phone No Admin:	613-915-5245 Ext.
MHSW Facility:	N	County Ont:	RENFREW
NAICS Code1:	621110	County Out:	
NAICS Code2:		District:	402
NAICS Code3:			
Gen Name:	Canadian Addiction Treatment Clinics LP		
Gen Div:			
Gen Op Name:	Ontario Addiction Treatment Centres		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gen Op Div: Site Adrs1: Site Bldg: Site Pobox: Province In: Site Adrs2: Site City: Province Out: Site Postal Code: Site Country: Co Official: Co Admin:		O.A.T.C. Ottawa 401 Somerset Street, West OATC Ottawa ONTARIO Ottawa K2P0K1 Canada Robyn Yack Lai Leon			
<u>2019 Generator Info</u>					
Gen No: ID: Contaminated Fac: MHSW Facility: NAICS Code1: NAICS Code2: NAICS Code3: Gen Name: Gen Div: Gen Op Name: Gen Op Div: Site Adrs1: Site Bldg: Site Pobox: Province In: Site Adrs2: Site City: Province Out: Site Postal Code: Site Country: Co Official: Co Admin:	ON8183220 32999 N N 621110 Canadian Addiction Treatment Clinics LP Ontario Addiction Treatment Centres O.A.T.C. Ottawa 401 Somerset Street, West OATC Ottawa ONTARIO Ottawa K2P0K1 Canada Michael Liu Lai Leon	Choice of Contact: Phone No Official: Phone No Admin: County Ont: County Out: District:	CO_OFFICIAL 4372150418 Ext. 613-915-5245 Ext. RENFREW 402		
<u>2020 Generator Info</u>					
Gen No: ID: Contaminated Fac: MHSW Facility: NAICS Code1: NAICS Code2: NAICS Code3: Gen Name: Gen Div: Gen Op Name: Gen Op Div: Site Adrs1: Site Bldg: Site Pobox: Province In: Site Adrs2: Site City: Province Out: Site Postal Code: Site Country: Co Official: Co Admin:	ON8183220 32723 N N 621110 Canadian Addiction Treatment Clinics LP Ontario Addiction Treatment Centres O.A.T.C. Ottawa 401 Somerset Street, West OATC Ottawa ONTARIO Ottawa K2P0K1 Canada Michael Liu Lai Leon	Choice of Contact: Phone No Official: Phone No Admin: County Ont: County Out: District:	CO_OFFICIAL 4372150418 Ext. 613-915-5245 Ext. RENFREW 402		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
46	1 of 2	E/134.3	76.9 / -0.90	OTTAWA HYDRO 375 COOPER STREET TRANSFORMER OTTAWA CITY ON K2P 0G8	SPL
Ref No: 117139				Municipality No: 20101	
Year:				Nature of Damage:	
Incident Dt: 8/13/1995				Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt: 8/13/1995				Impact to Health:	
Dt Document Closed:				Agency Involved:	
Site No:					
MOE Response:					
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					
Site Name:					
Site Address:					
Site Region:					
Site Municipality:		OTTAWA CITY			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:					
Client Type:					
Source Type:					
Incident Cause:		COOLING SYSTEM LEAK			
Incident Preceding Spill:					
Incident Reason:		UNKNOWN			
Incident Summary:		OTTAWA HYDRO-15 LITERS TRANSFORMER OIL TO GRND, PCB TEST PENDING.			
Environment Impact:		POSSIBLE			
Health Env Consequence:					
Nature of Impact:		Soil contamination			
Contaminant Qty:					
Contaminant Qty 1:					
Contaminant Unit:					
Contaminant Code:					
Contaminant Name:					
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:		LAND			
Activity Preceding Spill:					
Property 2nd Watershed:					
Property Tertiary Watershed:					
Sector Type:					
SAC Action Class:					
Call Report Locatn Geodata:					
Time Reported:					
System Facility Address:					
46	2 of 2	E/134.3	76.9 / -0.90	375 Cooper Street Ottawa ON K2P 0G8	EHS
Order No: 20090506031				Nearest Intersection: Cooper Street and Bank Street	
Status: C				Municipality:	
Report Type: Standard Report				Client Prov/State: ON	
Report Date: 5/14/2009				Search Radius (km): 0.25	
Date Received: 5/6/2009				X: -75.696198	
Previous Site Name:				Y: 45.41659	

155 erisinfo.com | Environmental Risk Information Services Order No: 25011400345

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	Silt			Geologic Group: Geologic Period: Depositional Gen:	
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218394543 9.8 14.3 Black Bedrock Shale	CLAY. GREY,FIRM.		Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218394542 5.2 9.8 Grey Till Sand Silt			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Compact
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218394544 14.3 Black Bedrock Limestone			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218394540 0 2.1 Sand Silt Gravel			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Compact
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
Source Name: Source Details: Confiden 1:	Urban Geology Automated Information System (UGAIS) File: OTTAWA2.txt RecordID: 058010 NTS_Sheet: 31G05G				

Source

Source List

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Identifier: 1 Source Type: Data Survey Source Date: 1956-1972 Scale or Resolution: Varies Source Name: Urban Geology Automated Information System (UGAIS) Source Originators: Geological Survey of Canada					
Horizontal Datum: NAD27 Vertical Datum: Mean Average Sea Level Projection Name: Universal Transverse Mercator					
49	1 of 7	SW/142.5	77.9 / 0.07	SEALTEST DIVISION OF AULT FOODS; 453 COOPER STREET OTTAWA ON K2P 0H1	NPCB
Company Code: 00463 Industry: Food/Beverage/Water Site Status: Transaction Date: 10/29/1990 Inspection Date: 11/26/1987					
49	2 of 7	SW/142.5	77.9 / 0.07	AULT FOODS 453 COOPER STREET OTTAWA WINCHESTER 490 GORDON STREET OTTAWA CITY ON K2P 0H1	SPL
Ref No: 8572 Year: Incident Dt: 8/24/1988 Dt MOE Arvl on Scn: MOE Reported Dt: 8/24/1988 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: OTTAWA CITY Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: VALVE/FITTING LEAK OR FAILURE Incident Preceding Spill: Incident Reason: MATERIAL FAILURE Incident Summary: AULT FOODS- AMMONIA LEAK TO ATMOSPHERE FROM VALVE IN COOLING SYSTEM Environment Impact: Health Env Consequence: Nature of Impact: OTHER Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1:					
Municipality No: 20101 Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant UN No 1: Receiving Medium: AIR Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:					
49	3 of 7	SW/142.5	77.9 / 0.07	AULT FOODS 453 COOPER ST.AT KENT ST. OTTAWA OTTAWA DAIRY OTTAWA CITY ON K2P 0H1	SPL
Ref No: 42547 Year: Incident Dt: 10/24/1990 Dt MOE Arvl on Scn: MOE Reported Dt: 10/24/1990 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: OTTAWA CITY Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: OTHER CAUSE (N.O.S.) Incident Preceding Spill: Incident Reason: UNKNOWN Incident Summary: AULT FOODS-130L. DIESEL :TO GROUND AND SEWERS. Environment Impact: NOT ANTICIPATED Health Env Consequence: Nature of Impact: Other Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: LAND / WATER Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata:					
Municipality No: 20101 Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Time Reported: System Facility Address:					
49	4 of 7	SW/142.5	77.9 / 0.07	AULT FOODS LIMITED 453 COOPER STREET OTTAWA ON K2P 0H1	GEN
Generator Info					
Generator No:	ON0632408			Choice of Contact:	
Approval Years:	88			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	1041
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	FLUID MILK IND.				
Waste Detail(s)					
Waste Class:	213				
Waste Class Name:	PETROLEUM DISTILLATES				
Waste Detail(s)					
Waste Class:	252				
Waste Class Name:	WASTE OILS & LUBRICANTS				
49	5 of 7	SW/142.5	77.9 / 0.07	AULT FOODS LIMITED 453 COOPER STREET OTTAWA ON K2P 0H1	GEN
Generator Info					
Generator No:	ON0632408			Choice of Contact:	
Approval Years:	89,90			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	1041
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	FLUID MILK IND.				
Waste Detail(s)					
Waste Class:	122				
Waste Class Name:	ALKALINE WASTES - OTHER METALS				
Waste Detail(s)					
Waste Class:	212				
Waste Class Name:	ALIPHATIC SOLVENTS				
Waste Detail(s)					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
49	6 of 7	SW/142.5	77.9 / 0.07	AULT FOODS LIMITE(OUT OF BUSINESS)03-320 453 COOPER STREET OTTAWA ON K2P 0H1	GEN
<u>Generator Info</u>					
Generator No:		ON0632408		Choice of Contact:	
Approval Years:		92,93,94,95,96,97,98		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	1041
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		FLUID MILK IND.			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
49	7 of 7	SW/142.5	77.9 / 0.07	453 Cooper Street Ottawa ON K2P 0H1	EHS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Order No:	23111500012			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	20-NOV-23			Search Radius (km):	.25
Date Received:	15-NOV-23			X:	-75.6988326
Previous Site Name:				Y:	45.4154862
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans; City Directory				

50	1 of 1	NNW/145.1	77.9 / 0.07	195 BANK ST. OTTAWA ON	WWIS
Well ID:	7246053			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Observation Wells			Date Received:	08/05/2015
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z209011			Contractor:	7241
Tag:	A178455			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	LANARK
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	DRUMMOND TOWNSHIP				
Site Info:					

Bore Hole Information

Bore Hole ID:	1005541565	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	399333.00
Code OB Desc:		North83:	4973764.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	9
Date Completed:	07/04/2015	UTMRC Desc:	unknown UTM
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock

Materials Interval

Formation ID:	1005693476
Layer:	2
Color:	2
General Color:	GREY
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	06

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		1.5			
Formation End Depth:		8.84000015258789			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005693475			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:		85			
Material 2 Desc:		SOFT			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005693486			
Layer:		3			
Plug From:		7.010000228881836			
Plug To:		8.84000015258789			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005693484			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005693485			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		7.010000228881836			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1005693483			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
 <u>Pipe Information</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pipe ID:		1005693474			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1005693479			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		7.320000171661377			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1005693480			
Layer:		1			
Slot:		10			
Screen Top Depth:		7.320000171661377			
Screen End Depth:		8.84000015258789			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
 <u>Water Details</u>					
Water ID:		1005693478			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1005693477			
Diameter:		8.25			
Depth From:		0.0			
Depth To:		8.84000015258789			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
51	1 of 1	NW/145.2	77.9 / 0.07	ON	WWIS
Well ID:	1503876			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Domestic			Data Entry Status:	
Use 2nd:	0			Data Src:	1
Final Well Status:	Water Supply			Date Received:	03/20/1948
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:				Contractor:	3566
Tag:				Form Version:	1
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):				https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1503876.pdf	
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		02/12/1948			
Year Completed:		1948			
Depth (m):		22.86			
Latitude:		45.4175315702752			
Longitude:		-75.6987318200623			
X:		-75.6987316583455			
Y:		45.41753156300752			
Path:		150\1503876.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		10025919		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445330.70
Code OB Desc:				North83:	5029572.00
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	9
Date Completed:		02/12/1948		UTMRC Desc:	unknown UTM
Remarks:				Location Method:	p9
Location Method Desc:		Original Pre1985 UTM Rel Code 9: unknown UTM			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		930997781			
Layer:		2			
Color:					
General Color:					
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		28.0			
Formation End Depth:		75.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		930997780			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Color:					
General Color:					
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		28.0			
Formation End Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		961503876			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		10574489			
Casing No:		1			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		930044586			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		75.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Casing</u>					
Casing ID:		930044585			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		30.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991503876			
Pump Set At:					
Static Level:		8.0			
Final Level After Pumping:		12.0			
Recommended Pump Depth:					
Pumping Rate:		10.0			
Flowing Rate:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Recommended Pump Rate:		10.0			
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:		0			
Pumping Duration MIN:		30			
Flowing:		No			
<u>Water Details</u>					
Water ID:		933456890			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:					
Water Found Depth UOM:		ft			

52	1 of 1	NW/145.4	77.9 / 0.07	ON	BORE
Borehole ID:		613321		Inclin FLG:	No
OGF ID:		215514620		SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:		Borehole		Piezometer:	No
Use:				Primary Name:	
Completion Date:		FEB-1948		Municipality:	
Static Water Level:		11.0		Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	45.417533
Total Depth m:		22.9		Longitude DD:	-75.698732
Depth Ref:		Ground Surface		UTM Zone:	18
Depth Elev:				Easting:	445331
Drill Method:				Northing:	5029572
Orig Ground Elev m:		67.1		Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:		72.5			
Concession:					
Location D:					
Survey D:					
Comments:					

Borehole Geology Stratum

Geology Stratum ID:		218394641		Mat Consistency:	
Top Depth:		0		Material Moisture:	
Bottom Depth:		8.5		Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:		Silt		Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		SILT.			
Geology Stratum ID:		218394642		Mat Consistency:	Loose
Top Depth:		8.5		Material Moisture:	
Bottom Depth:		22.9		Material Texture:	
Material Color:		Grey		Non Geo Mat Type:	
Material 1:		Shale		Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 4: Gsc Material Description: Stratum Description:					
Depositional Gen: SHALE. 0075ED. BEDROCK. BEDROCK. STIFF. CLAY. GREY,STIFF. SAND. LOOSE, WATER **Note: Many records provided by the department have a truncated [Stratum Description] field.					
Source					
Source Type: Data Survey Source Orig: Geological Survey of Canada Source Date: 1956-1972 Confidence: Observatio: Source Name: Urban Geology Automated Information System (UGAIS) Source Details: File: OTTAWA2.txt RecordID: 05829 NTS_Sheet: Confiden 1:					
Source Appl: Spatial/Tabular Source Iden: 1 Scale or Res: Varies Horizontal: NAD27 Verticalda: Mean Average Sea Level					
Source List					
Source Identifier: 1 Source Type: Data Survey Source Date: 1956-1972 Scale or Resolution: Varies Source Name: Urban Geology Automated Information System (UGAIS) Source Originators: Geological Survey of Canada					
Horizontal Datum: NAD27 Vertical Datum: Mean Average Sea Level Projection Name: Universal Transverse Mercator					
53	1 of 1	ESE/146.0	76.9 / -0.93	Biz Point Inc. 273 Bank St Ottawa ON K2P 1X5	SCT
Established: 2004 Plant Size (ft²): Employment:					
--Details-- Description: Digital Printing SIC/NAICS Code: 323115					
54	1 of 2	S/146.3	77.9 / 0.07	OTTAWA COMMUNITY HOUSING CORPORATION 395 SOMERSET STREET OTTAWA ON	GEN
Generator Info					
Generator No: ON3877609 Approval Years: 2011 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 531112					
54	2 of 2	S/146.3	77.9 / 0.07	Black & McDonald Ltd. 395 Somerset Ottawa ON K2L 4X8	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON5677772			Choice of Contact:	
Approval Years:	As of Oct 2019			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	251 L				
Waste Class Name:	Waste oils/sludges (petroleum based)				
<u>2019 Generator Info</u>					
Gen No:	ON5677772			Choice of Contact:	CO_OFFICIAL
ID:	22730			Phone No Official:	613-731-1182 Ext.2518
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	531310			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	Black & McDonald Ltd.				
Gen Div:					
Gen Op Name:	Black & McDonald Ltd.				
Gen Op Div:					
Site Adrs1:	395 Somerset				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K2L 4X8				
Site Country:	Canada				
Co Official:	Olivier OO Obiono				
Co Admin:					
<u>2020 Generator Info</u>					
Gen No:	ON5677772			Choice of Contact:	CO_OFFICIAL
ID:	22463			Phone No Official:	613-731-1182 Ext.2518
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	531310			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	Black & McDonald Ltd.				
Gen Div:					
Gen Op Name:	Black & McDonald Ltd.				
Gen Op Div:					
Site Adrs1:	395 Somerset				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K2L 4X8				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Country:		Canada			
Co Official:		Olivier OO Obiono			
Co Admin:					
55	1 of 1	E/146.9	76.2 / -1.62	315 COOPER ST Ottawa ON	WWIS
Well ID:		7312996		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring		Data Entry Status:	
Use 2nd:		Test Hole		Data Src:	
Final Well Status:		Test Hole		Date Received:	06/19/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z277582		Contractor:	7241
Tag:		A215904		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/731\7312996.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		03/02/2018			
Year Completed:		2018			
Depth (m):		6.096			
Latitude:		45.4167302493654			
Longitude:		-75.6958168402749			
X:		-75.69581667838541			
Y:		45.41673024236072			
Path:		731\7312996.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1007108673		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445558.00
Code OB Desc:				North83:	5029481.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		03/02/2018		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1007367777			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		06			
Material 3 Desc:		SILT			
Formation Top Depth:		1.0			
Formation End Depth:		10.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007367776			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:		02			
Material 1 Desc:		TOPSOIL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007367778			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		10.0			
Formation End Depth:		20.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007367787			
Layer:		2			
Plug From:		1.0			
Plug To:		9.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007367788			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		3			
Plug From:		9.0			
Plug To:		20.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007367786			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007367785			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007367775			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007367781			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		10.0			
Casing Diameter:		1.3799999952316284			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1007367782			
Layer:		1			
Slot:		10			
Screen Top Depth:		10.0			
Screen End Depth:		20.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.6799999475479126			
 <u>Water Details</u>					
Water ID:		1007367780			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1007367779			
Diameter:		2.375			
Depth From:		0.0			
Depth To:		20.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>56</u>	1 of 1	SW/154.9	77.9 / 0.07	ON	BORE
Borehole ID:	613280			Inclin FLG:	No
OGF ID:	215514581			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:				Primary Name:	
Completion Date:				Municipality:	
Static Water Level:	12.2			Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	45.415283
Total Depth m:	-999			Longitude DD:	-75.698704
Depth Ref:	Ground Surface			UTM Zone:	18
Depth Elev:				Easting:	445331
Drill Method:				Northing:	5029322
Orig Ground Elev m:	73.2			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	73.1				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218394474			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	18.3			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	TILL.				
Geology Stratum ID:	218394475			Mat Consistency:	Dense
Top Depth:	18.3			Material Moisture:	
Bottom Depth:				Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Bedrock			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	BEDROCK. WATER STABLE AT 200.0 FEET. UNSPECIFIED. DENSE. UNSPECIFIED. DENSE. UNSPECIFIED.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	1956-1972 M			Scale or Res: Horizontal: Verticalda:	Varies NAD27 Mean Average Sea Level
Urban Geology Automated Information System (UGAIS) File: OTTAWA2.txt RecordID: 057880 NTS_Sheet: 31G05G Logs are approximately correct. Lack of information. Doubtful terminology.					
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
57	1 of 7	NW/154.9	77.9 / 0.07	OTTAWA MAGAZINE INC. 192 BANK STREET OTTAWA ON K2P 1W8	GEN
Generator Info					
Generator No: Approval Years: Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:	ON0897800 86,87,88,89,90 OTHER PUBLISHING IND.			Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:	 2839
Waste Detail(s)					
Waste Class: Waste Class Name:	123 ALKALINE PHOSPHATES				
57	2 of 7	NW/154.9	77.9 / 0.07	OTTAWA MAGAZINE INC. 192 BANK STREET OTTAWA ON K2P 1W8	GEN
Generator Info					
Generator No: Approval Years: Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:	ON0897800 92,93,97,98 OTHER PUBLISHING IND			Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:	 2839
Waste Detail(s)					
Waste Class: Waste Class Name:	123 ALKALINE PHOSPHATES				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
57	3 of 7	NW/154.9	77.9 / 0.07	OTTAWA MAGAZINE INC. 29-278 192 BANK STREET OTTAWA ON K2P 1W8	GEN

Generator Info

Generator No:	ON0897800	Choice of Contact:	
Approval Years:	94,95,96	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	2839
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	OTHER PUBLISHING IND		

Waste Detail(s)

Waste Class:	123
Waste Class Name:	ALKALINE PHOSPHATES

57	4 of 7	NW/154.9	77.9 / 0.07	OTTAWA MAGAZINE INCORPORATED 192 BANK STREET OTTAWA ON K2P 1W8	GEN

Generator Info

Generator No:	ON0897800	Choice of Contact:	
Approval Years:	99,00,01	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	2839
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	OTHER PUBLISHING IND.		

Waste Detail(s)

Waste Class:	123
Waste Class Name:	ALKALINE PHOSPHATES

57	5 of 7	NW/154.9	77.9 / 0.07	OTTAWA(SEE&USE ON0897800 OTTAWA) 192 BANK STREET OTTAWA ON K2P 1W8	GEN

Generator Info

Generator No:	ON0923900	Choice of Contact:	
Approval Years:	86,87,88,89,90	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	2839
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	OTHER PUBLISHING IND.		

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		123 ALKALINE PHOSPHATES			
57	6 of 7	NW/154.9	77.9 / 0.07	OTTAWA(SEE&USE ON0897800 OTTAWA) 29-290 192 BANK STREET OTTAWA ON K2P 1W8	GEN
Generator Info					
Generator No:		ON0923900		Choice of Contact:	
Approval Years:		92,93,94,95,96,97,98		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	2839
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		OTHER PUBLISHING IND			
57	7 of 7	NW/154.9	77.9 / 0.07	Cdn Council Tobacco Control 192 Bank St Ottawa ON K2P 1W8	SCT
Established:		01-DEC-74			
Plant Size (ft²):		5000			
Employment:					
--Details--					
Description:		Other Membership Organizations			
SIC/NAICS Code:		813990			
Description:		Social Advocacy Organizations			
SIC/NAICS Code:		813310			
58	1 of 1	NNE/156.4	76.9 / -0.93	153 Nepean Street Ottawa ON K2P 0B5	EHS
Order No:		20090909031		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Custom Report		Client Prov/State:	ON
Report Date:		9/10/2009		Search Radius (km):	0.25
Date Received:		9/9/2009		X:	-75.69705
Previous Site Name:				Y:	45.417807
Lot/Building Size:					
Additional Info Ordered:					
59	1 of 1	ENE/156.8	76.9 / -0.90	355 COOPER ST OTTAWA ON	WWIS
Well ID:		7305581		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Test Hole		Data Entry Status:	
Use 2nd:		Monitoring		Data Src:	
Final Well Status:		Observation Wells		Date Received:	02/13/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z212305		Contractor:	7241

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Tag:	A182694			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/730\7305581.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		01/09/2018			
Year Completed:		2018			
Depth (m):		7.62			
Latitude:		45.4170721165401			
Longitude:		-75.6958466010876			
X:		-75.69584643863357			
Y:		45.41707210997362			
Path:		730\7305581.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1006985637		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445556.00
Code OB Desc:				North83:	5029519.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		01/09/2018		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007145622			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		4.570000171661377			
Formation End Depth:		7.619999885559082			
Formation End Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007145620			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		1.8300000429153442			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007145621			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		1.8300000429153442			
Formation End Depth:		4.570000171661377			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007145630			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007145631			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		3.9600000381469727			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007145632			
Layer:		3			
Plug From:		3.9600000381469727			
Plug To:		7.619999885559082			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Use</u>					
Method Construction ID:		1007145629			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007145619			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007145625			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.570000171661377			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007145626			
Layer:		1			
Slot:		19			
Screen Top Depth:		457.0			
Screen End Depth:		7.619999885559082			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
<u>Water Details</u>					
Water ID:		1007145624			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007145623			
Diameter:		8.25			
Depth From:		0.0			
Depth To:		7.619999885559082			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>60</u>	1 of 1	SE/157.1	76.9 / -0.93	Ottawa Dairy Well Nepean ON	OOGW
Licence No:	F019784		Well Compl:	31692	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well ID:	32035			County:	Ottawa/Carleton
Well Compl ID:	31692			Block:	
W Class ID:	2366			Lot:	D
UWI Code:	F019784			Conc:	CBF
Permit Date:				Surface Lat NAD83:	45.41535722
Depth(m):	365.76			Surface Long NAD83:	-75.69641
Well Pool:				Bottom Lat NAD83:	45.41535722
Completion Date:				Bottom Long NAD83:	-75.69641
Depth Reached:				Lot Sides (m):	X
Capped Date:				E/W (m):	X
Class ID:				Latitude Nad27:	
DB Source:				Longitude Nad27:	
Status as of:	August 2024			bottom lat27:	
Start Date:				bottom long27:	
SPUD Date:				Lateral:	No
Class:	NFW			Accuracy:	500.00
Grnd Elev:	72.6			Method:	Part Lot Centroid
KB Elev:				Parent:	
TVD:	365.76			Prod Top:	
PBTD:				Prod Bot:	
TD Form:	March			PROPD Depth:	365.76
Workover D:				Location Method:	Part Lot Centroid
Operator:	Unknown			Location Accuracy:	Within 500 metres
Township:	Nepean			Dt Obtained:	2009-6-5 0:00:00
Target:	ORD			Well Status Type:	Natural Gas Well
Classification:	NEW FIELD WILDCAT			Well Status Mode:	No Well Found
Well Name:	Ottawa Dairy Well				
Target Desc:	GEOLOGICAL AGE OF FORMATION REACHED				
Status Type Desc:	A WELL PRESENTLY OR FORMERLY USED TO PRODUCE NATURAL GAS FROM A RESERVOIR				
Status Mode Desc:	A WELL THAT COULD NOT BE LOCATED IN THE FIELD BY A PETROLEUM INSPECTOR				
Classification Desc:					
Cement Rec:					
Comments:	By J.Clark [OGSR] using PetroGIS.				

Details

License No:	F019784	Elevation (m):	
Geology Formation:	March	Static Level (m):	n/a
Type of Water:	n/a	Geology/Water:	Geology
Source:	FORM 7	Elevatn / Top (m):	/ 362.16
Top (m):	362.16		
License No:	F019784	Elevation (m):	
Geology Formation:	March	Static Level (m):	n/a
Type of Water:	n/a	Geology/Water:	Geology
Source:	MNRF	Elevatn / Top (m):	/ 362.16
Top (m):	362.16		
License No:	F019784	Elevation (m):	
Geology Formation:	Trenton Group	Static Level (m):	n/a
Type of Water:	n/a	Geology/Water:	Geology
Source:	MNRF	Elevatn / Top (m):	/ 145.76
Top (m):	145.76		
License No:	F019784	Elevation (m):	
Geology Formation:	Beekmantown Group	Static Level (m):	n/a
Type of Water:	n/a	Geology/Water:	Geology
Source:	MNRF	Elevatn / Top (m):	/ 289.01
Top (m):	289.01		
License No:	F019784	Elevation (m):	
Geology Formation:	Rockcliffe	Static Level (m):	n/a
Type of Water:	n/a	Geology/Water:	Geology
Source:	FORM 7	Elevatn / Top (m):	/ 238.72
Top (m):	238.72		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
License No: Geology Formation: Type of Water: Source: Top (m):	F019784 Trenton Group n/a FORM 7 145.76			Elevation (m): Static Level (m): Geology/Water: Elevatn / Top (m):	n/a Geology / 145.76
License No: Geology Formation: Type of Water: Source: Top (m):	F019784 Lindsay n/a FORM 7 145.76			Elevation (m): Static Level (m): Geology/Water: Elevatn / Top (m):	n/a Geology / 145.76
License No: Geology Formation: Type of Water: Source: Top (m):	F019784 Oxford n/a FORM 7 289.01			Elevation (m): Static Level (m): Geology/Water: Elevatn / Top (m):	n/a Geology / 289.01
License No: Geology Formation: Type of Water: Source: Top (m):	F019784 Lindsay n/a MNRF 145.76			Elevation (m): Static Level (m): Geology/Water: Elevatn / Top (m):	n/a Geology / 145.76
License No: Geology Formation: Type of Water: Source: Top (m):	F019784 Oxford n/a MNRF 289.01			Elevation (m): Static Level (m): Geology/Water: Elevatn / Top (m):	n/a Geology / 289.01
License No: Geology Formation: Type of Water: Source: Top (m):	F019784 Beekmantown Group n/a FORM 7 289.01			Elevation (m): Static Level (m): Geology/Water: Elevatn / Top (m):	n/a Geology / 289.01
License No: Geology Formation: Type of Water: Source: Top (m):	F019784 Lindsay n/a MNRF - QA Code -1			Elevation (m): Static Level (m): Geology/Water: Elevatn / Top (m):	1 n/a Geology 1 / -1
License No: Geology Formation: Type of Water: Source: Top (m):	F019784 Rockcliffe n/a MNRF 238.72			Elevation (m): Static Level (m): Geology/Water: Elevatn / Top (m):	n/a Geology / 238.72

[61](#)

1 of 4

W/157.4

77.9 / 0.07

MCEVOY-SHIELDS FUNERAL HOMES LTD.
235 KENT STREET
OTTAWA ON K2P 1Z9

GEN

Generator Info

Generator No: ONF047200
Approval Years: 88,89,90,00,01
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: FUNERAL HOMES

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 9731

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
61	2 of 4	W/157.4	77.9 / 0.07	MCEVOY-SHIELDS FUNERAL HOMES LTD. 44-472 235 KENT STREET OTTAWA ON K2P 1Z9	GEN
<u>Generator Info</u>					
Generator No:		ONF047200	Choice of Contact:		
Approval Years:		92,93,94,95,96,97,98,99	Contaminated Fac:		
Status:			MHSW Facility:		
PO Box No:			SIC Code: 9731		
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		FUNERAL HOMES			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
61	3 of 4	W/157.4	77.9 / 0.07	Service Corporation International Canada 235 Kent Street Ottawa ON K2P 1Z9	GEN
<u>Generator Info</u>					
Generator No:		ON4365854	Choice of Contact:		
Approval Years:		02,03,04	Contaminated Fac:		
Status:			MHSW Facility:		
PO Box No:			SIC Code: 812210		
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Funeral Homes			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
61	4 of 4	W/157.4	77.9 / 0.07	Charlesfort Development Corporation 235 Kent Street Ottawa ON K2P 1Z9	GEN
<u>Generator Info</u>					
Generator No:		ON8782981	Choice of Contact:		
Approval Years:		06	Contaminated Fac:		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:				MHSW Facility: SIC Code: 236110	
		Residential Building Construction			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		145 PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		221 LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		251 OIL SKIMMINGS & SLUDGES			
62	1 of 1	NE/157.6	76.9 / -0.93	287 Lisgar Street Ottawa ON	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:		20150506131 C Standard Report 13-MAY-15 06-MAY-15 City Directory		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.696248 Y: 45.41748	
63	1 of 7	NE/157.6	76.9 / -0.93	Claridge Homes Corporation 287 Lisgar Ottawa ON	GEN
<u>Generator Info</u>					
Generator No: Approval Years: Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:		ON8802785 2011 		Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 236110	
63	2 of 7	NE/157.6	76.9 / -0.93	CLARIDGE HOMES (CENTRETOWN) INC. 287 LISGAR STREET OTTAWA ON	GEN
<u>Generator Info</u>					
Generator No:		ON5102371		Choice of Contact:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Years: 2012 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: Real Estate Property Managers Contaminated Fac: MHSW Facility: SIC Code: 531310					
63	3 of 7	NE/157.6	76.9 / -0.93	Claridge Homes (287 Lisgar) Inc. 287 Lisgar Street City of Ottawa, Ontario CITY OF OTTAWA ON EBR Registry No: 012-4615 Ministry Ref No: 3167-9YDHTN Notice Type: Instrument Decision Notice Stage: Notice Date: November 18, 2015 Proposal Date: July 14, 2015 Year: 2015 Instrument Type: (OWRA s. 34) - Permit to Take Water Off Instrument Name: Posted By: Company Name: Claridge Homes (287 Lisgar) Inc. Site Address: Location Other: Proponent Name: Proponent Address: 210 Gladstone Avenue , Suite 2001, Ottawa Ontario, Canada K2P 0Y6 Comment Period: URL: Summary: Site Location Details: 287 Lisgar Street City of Ottawa, Ontario CITY OF OTTAWA	PTTW
63	4 of 7	NE/157.6	76.9 / -0.93	Claridge Homes Limited Partnership 287 Lisgar Street Ottawa ON K2P 0E1 Generator Info Generator No: ON6723433 Approval Years: 2015 Status: PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description: REAL ESTATE PROPERTY MANAGERS Choice of Contact: CO_OFFICIAL Contaminated Fac: No MHSW Facility: No SIC Code: 531310 Waste Detail(s) Waste Class: 241 Waste Class Name: HALOGENATED SOLVENTS	GEN
63	5 of 7	NE/157.6	76.9 / -0.93	Claridge Homes 287 Lisgar Street Ottawa ON K2P 0E1	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON5558599			Choice of Contact:	
Approval Years:	As of Dec 2017			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	221 L				
Waste Class Name:	Light fuels				
<u>2017 Generator Info</u>					
Gen No:	ON5558599			Choice of Contact:	CO_OFFICIAL
ID:	21964			Phone No Official:	613-293-5467 Ext.
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	236110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	Claridge Homes				
Gen Div:					
Gen Op Name:	Claridge Homes				
Gen Op Div:					
Site Adrs1:	287 Lisgar Street				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K2P 0E1				
Site Country:	Canada				
Co Official:	MICHEL Bourgon				
Co Admin:					
<u>2017 Generator Manifest</u>					
ID:	46722			Sum Received Qty:	36580.0
Generator No:	ON5558599			Waste Class Name:	LIGHT FUELS
Receiver Type:	035			Count Manifests:	4
Waste Char:	L			District:	402
Waste Code:	221				

63	6 of 7	NE/157.6	76.9 / -0.93	CLARIDGE HOMES (287 LISGAR) INC. 287 LISGAR STREET ON Ottawa ON	RSC
RSC No:	225922			X:	-75.69631167598878
RA No:				Y:	45.41751727450763
Status:	FILED			Latitude:	45.41751728
Filing Date:				Longitude:	-75.69631168
Date Ack:				UTM Coordinates:	
Date Returned:				Latitude Longitude:	
Approval Date:	July 17, 2019			Accuracy Estimate:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Cert Date: Cert Prop Use No: Curr Property Use: Intended Prop Use: Restoration Type: Soil Type: Criteria: Stratified (Y/N): Audit (Y/N): Entire Leg Prop. (Y/N): CPU Issu Sect 1686: Business Name: Address: Legal Desc: Site Pin: Asmt Roll No: Project Type: Approval Type: Applicable Standards: PDF Link: Measurement Method: Mailing Address: Telephone: Fax: Email: Postal Code: K2P 0E1 Ministry District: MOE District: Ottawa SWP Area Name: Rideau Valley Qual Person Name: PAUL HURST Consultant: CLARIDGE HOMES (287 LISGAR) INC. 287 LISGAR STREET ON 04115-0250 (LT) POST2011 RSC based on Phase One and Two ESAs with RA https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=225922					
63	7 of 7	NE/157.6	76.9 / -0.93	Claridge Homes (Carson) Inc. 287 Lisgar Avenue Ottawa ON K2P 1K8	SPL
Ref No: 5656-BLBMXB Year: Incident Dt: 2020/01/30 Dt MOE Arvl on Scn: MOE Reported Dt: 2020/01/30 Dt Document Closed: 2020/07/17 Site No: NA MOE Response: No Site County/District: Site Geo Ref Meth: Site District Office: Ottawa Nearest Watercourse: Site Name: Condo high rise<UNOFFICIAL> Site Address: 287 Lisgar Avenue Site Region: Eastern Site Municipality: Ottawa Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Claridge Homes (Carson) Inc. Client Type: Corporation Source Type: Tank - Above Ground Incident Cause: Incident Preceding Spill: Overflow/Surcharge Incident Reason: Operator/Human Error Incident Summary: TSSA FSB: 3L diesel fuel to concrete during re-fill Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: 3 L Contaminant Qty 1: 3 Contaminant Unit: L Contaminant Code: 13 Contaminant Name: DIESEL FUEL Contaminant Limit 1: Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: 2 - Minor Environment Agency Involved:					

186 erisinfo.com | Environmental Risk Information Services Order No: 25011400345

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Geo Ref Meth: Site District Office: Ottawa District Office Nearest Watercourse: Site Name: Site Address: 239 Nepean St Site Region: Site Municipality: OTTAWA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Container/Drum/Tote Incident Cause: Incident Preceding Spill: Accident/Collision Incident Reason: Unknown Incident Summary: Aroma: Grease Spill to Asphalt Environment Impact: 1 Minor Impact Health Env Consequence: Nature of Impact: Contaminant Qty: 0 other - see notes Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: GREASE (N.O.S.) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Property 2nd Watershed: Lower Ottawa Property Tertiary Watershed: 02LA-Rideau Sector Type: LIMITED-SERVICE EATING PLACES SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00003907176"],"wkts":["POINT (-75.6996737000 45.4168536000)","creation_date":"2021-04-23"} Time Reported: System Facility Address:					
66	1 of 1	NE/164.4	76.9 / -0.93	Nepean Street Ottawa ON K2P 0B6	EHS
Order No: 20191216143 Status: C Report Type: Custom Report Report Date: 22-JAN-20 Date Received: 16-DEC-19 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.69650595 Y: 45.4177047					
67	1 of 1	WSW/164.8	77.8 / -0.01	KENT ST Ottawa ON	WWIS
Well ID: 7344656 Construction Date: Use 1st: Use 2nd:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Final Well Status:	Abandoned-Other			Date Received:	10/22/2019
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z286433			Contractor:	7543
Tag:	A191626			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7344656.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	09/19/2019				
Year Completed:	2019				
Depth (m):					
Latitude:	45.41578047162				
Longitude:	-75.6995243523525				
X:	-75.69952418970436				
Y:	45.41578046508941				
Path:	734\7344656.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1007687167			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445267.00
Code OB Desc:				North83:	5029378.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	09/19/2019			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1008087392				
Layer:	3				
Plug From:	0.0				
Plug To:	0.5				
Plug Depth UOM:	ft				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1008087390				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Plug From:		115.0			
Plug To:		351.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008087391			
Layer:		2			
Plug From:		0.5			
Plug To:		115.0			
Plug Depth UOM:		ft			
 <u>Pipe Information</u>					
Pipe ID:		1008084812			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008090670			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
 <u>Water Details</u>					
Water ID:		1008090120			
Layer:		1			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		25.0			
Water Found Depth UOM:		ft			
 <u>Hole Diameter</u>					
Hole ID:		1008088008			
Diameter:		2.0			
Depth From:		6.0			
Depth To:		35.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
68	1 of 1	SW/167.0	78.9 / 1.07	281 kent st Ottawa ON	WWIS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well ID:	7354243			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:	Monitoring			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	02/19/2020
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z302715			Contractor:	7241
Tag:	A282350			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1008173940			Tag No:	A282350
Depth M:	7.13			Contractor:	7241
Year Completed:	2020			Latitude:	45.4151642801855
Well Completed Dt:	01/24/2020			Longitude:	-75.6987243509288
Audit No:	Z302715			Y:	45.415164273072726
Path:				X:	-75.69872418905746
<u>Bore Hole Information</u>					
Bore Hole ID:	1008173940			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445329.00
Code OB Desc:				North83:	5029309.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	01/24/2020			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008251397				
Layer:	3				
Color:	2				
General Color:	GREY				
Material 1:	06				
Material 1 Desc:	SILT				
Material 2:	28				
Material 2 Desc:	SAND				
Material 3:	85				
Material 3 Desc:	SOFT				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation Top Depth:		4.0			
Formation End Depth:		7.130000114440918			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1008251395			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:		27			
Material 2 Desc:		OTHER			
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1008251396			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		4.0			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1008252365			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1008252366			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		3.7200000286102295			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1008252367			
Layer:		3			
Plug From:		3.7200000286102295			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:		7.130000114440918			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008253333			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008250036			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008253675			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.03000020980835			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1008254026			
Layer:		1			
Slot:		10			
Screen Top Depth:		4.03000020980835			
Screen End Depth:		7.130000114440918			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008254369			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1008252992			
Diameter:		8.300000190734863			
Depth From:		0.0			
Depth To:		7.130000114440918			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
69	1 of 7	NW/167.0	77.6 / -0.24	City of Ottawa 210 Gloucester Ottawa ON K2P 2K4	GEN
<u>Generator Info</u>					
Generator No:	ON7180209			Choice of Contact:	CO_OFFICIAL
Approval Years:	2016			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	913910
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:	913910				
<u>Waste Detail(s)</u>					
Waste Class:	251				
Waste Class Name:	OIL SKIMMINGS & SLUDGES				
69	2 of 7	NW/167.0	77.6 / -0.24	City of Ottawa 210 Gloucester Ottawa ON K2P 2K4	GEN
<u>Generator Info</u>					
Generator No:	ON7180209			Choice of Contact:	CO_OFFICIAL
Approval Years:	2015			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	913910
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:	913910				
<u>Waste Detail(s)</u>					
Waste Class:	251				
Waste Class Name:	OIL SKIMMINGS & SLUDGES				
69	3 of 7	NW/167.0	77.6 / -0.24	City of Ottawa 210 Gloucester Ottawa ON K2P 2K4	GEN
<u>Generator Info</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: Approval Years: Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:	ON7180209 2014 Canada 913910			Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:	CO_OFFICIAL No No 913910
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:	251 OIL SKIMMINGS & SLUDGES				
69	4 of 7	NW/167.0	77.6 / -0.24	City of Ottawa Parks, Bldg & Grounds Services Branch 210 Gloucester Ottawa ON K2P 2K4	GEN
<u>Generator Info</u>					
Generator No: Approval Years: Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:	ON7180209 As of Dec 2018 Registered Canada 			Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:	
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:	251 L Waste oils/sludges (petroleum based)				
69	5 of 7	NW/167.0	77.6 / -0.24	City of Ottawa Parks, Bldg & Grounds Services Branch 210 Gloucester Ottawa ON K2P 2K4	GEN
<u>Generator Info</u>					
Generator No: Approval Years: Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:	ON7180209 As of Jul 2020 Registered Canada 			Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:	
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:	251 L Waste oils/sludges (petroleum based)				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
69	6 of 7	NW/167.0	77.6 / -0.24	City of Ottawa Parks, Bldg & Grounds Services Branch 210 Gloucester Ottawa ON K2P 2K4	GEN

Generator Info

Generator No:	ON7180209	Choice of Contact:
Approval Years:	As of Nov 2021	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	251 L
Waste Class Name:	Waste oils/sludges (petroleum based)

69	7 of 7	NW/167.0	77.6 / -0.24	City of Ottawa 210 Gloucester Ottawa ON K2P 2K4	GEN

Generator Info

Generator No:	ON7180209	Choice of Contact:
Approval Years:	As of Oct 2022	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	251 L
Waste Class Name:	OIL SKIMMINGS & SLUDGES

2017 Generator Info

Gen No:	ON7180209	Choice of Contact:	CO_OFFICIAL
ID:	28165	Phone No Official:	613-580-2424 Ext.12085
Contaminated Fac:	N	Phone No Admin:	
MHSW Facility:	N	County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	913910	County Out:	
NAICS Code2:		District:	402
NAICS Code3:			
Gen Name:	City of Ottawa		
Gen Div:	Parks, Bldg & Grounds Services Branch		
Gen Op Name:	City of Ottawa		
Gen Op Div:	Parks, Bldg & Grounds Services Branch		
Site Adrs1:	210 Gloucester		
Site Bldg:	Parking Garage #3		
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2P 2K4			
Site Country:		Canada			
Co Official:		Randy Villeneuve			
Co Admin:					
 <u>2018 Generator Info</u>					
Gen No:	ON7180209			Choice of Contact:	CO_OFFICIAL
ID:	28621			Phone No Official:	613-580-2424 Ext.12085
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	913910			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		City of Ottawa			
Gen Div:		Parks, Bldg & Grounds Services Branch			
Gen Op Name:		City of Ottawa			
Gen Op Div:		Parks, Bldg & Grounds Services Branch			
Site Adrs1:		210 Gloucester			
Site Bldg:		Parking Garage #3			
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2P 2K4			
Site Country:		Canada			
Co Official:		Randy Villeneuve			
Co Admin:					
 <u>2019 Generator Info</u>					
Gen No:	ON7180209			Choice of Contact:	CO_OFFICIAL
ID:	28914			Phone No Official:	613-580-2424 Ext.12085
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	913910			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		City of Ottawa			
Gen Div:		Parks, Bldg & Grounds Services Branch			
Gen Op Name:		City of Ottawa			
Gen Op Div:		Parks, Bldg & Grounds Services Branch			
Site Adrs1:		210 Gloucester			
Site Bldg:		Parking Garage #3			
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2P 2K4			
Site Country:		Canada			
Co Official:		Randy Villeneuve			
Co Admin:					
 <u>2020 Generator Info</u>					
Gen No:	ON7180209			Choice of Contact:	CO_OFFICIAL
ID:	28602			Phone No Official:	613-580-2424 Ext.12085
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)

197 erisinfo.com | Environmental Risk Information Services Order No: 25011400345

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC/NAICS Code:		339950			
70	2 of 3	NE/168.1	76.9 / -0.93	Koffman Signs Ltd. 146 Nepean St Ottawa ON K2P 0B6	SCT
Established:		1956			
Plant Size (ft²):		2000			
Employment:					
--Details--					
Description:		Sign Manufacturing			
SIC/NAICS Code:		339950			
70	3 of 3	NE/168.1	76.9 / -0.93	Marilena Guerra 146 Nepean Street Ottawa ON	GEN
<u>Generator Info</u>					
Generator No:		ON7033731		Choice of Contact:	
Approval Years:		2013		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	
Country:				561210	
Co Admin:					
Phone No Admin:					
SIC Description:		FACILITIES SUPPORT SERVICES			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
71	1 of 1	ESE/168.2	76.4 / -1.38	343 Somerset Street West Ottawa ON	EHS
Order No:		20140905028		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Custom Report		Client Prov/State:	
Report Date:		10-SEP-14		Search Radius (km):	
Date Received:		05-SEP-14		X:	
Previous Site Name:				Y:	
Lot/Building Size:				-75.69567	
Additional Info Ordered:				45.415889	
72	1 of 1	N/168.3	77.9 / 0.07	170 Gloucester Street Ottawa ON K2P 0A6	EHS
Order No:		20181210018		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State:	
Report Date:		14-DEC-18		Search Radius (km):	
Date Received:		10-DEC-18		X:	
Previous Site Name:				Y:	
Lot/Building Size:				-75.697857	
				45.417974	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans; City Directory			
73	1 of 1	ENE/168.3	76.2 / -1.62	355 Cooper St Ottawa ON K2P0G8	EHS
Order No: 20170821056		Nearest Intersection:			
Status: C		Municipality:			
Report Type: Standard Report		Client Prov/State:		ON	
Report Date: 28-AUG-17		Search Radius (km):		.25	
Date Received: 21-AUG-17		X:		-75.695658	
Previous Site Name:		Y:		45.417026	
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans; City Directory			
74	1 of 1	ESE/168.6	77.0 / -0.82	SOMERSET ROADWAY OTTAWA ON	WWIS
Well ID: 1535586		Flowing (Y/N):			
Construction Date:		Flow Rate:			
Use 1st:		Data Entry Status:			
Use 2nd:		Data Src:			
Final Well Status: Observation Wells		Date Received:		06/24/2005	
Water Type:		Selected Flag:		TRUE	
Casing Material:		Abandonment Rec:			
Audit No: Z30507		Contractor:		1844	
Tag: A020628		Form Version:		3	
Constructn Method:		Owner:			
Elevation (m):		County:		OTTAWA-CARLETON	
Elevatn Reliabilty:		Lot:			
Depth to Bedrock:		Concession:			
Well Depth:		Concession Name:			
Overburden/Bedrock:		Easting NAD83:			
Pump Rate:		Northing NAD83:			
Static Water Level:		Zone:			
Clear/Cloudy:		UTM Reliability:			
Municipality: OTTAWA CITY					
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/153\1535586.pdf			
Additional Detail(s) (Map)					
Well Completed Date: 04/27/2005					
Year Completed: 2005					
Depth (m): 6					
Latitude: 45.4156771009064					
Longitude: -75.6958166864399					
X: -75.69581652396467					
Y: 45.415677094118095					
Path: 153\1535586.pdf					
Bore Hole Information					
Bore Hole ID: 11316125		Elevation:			
DP2BR:		Elevrc:			
Spatial Status:		Zone:		18	
Code OB:		East83:		445557.00	
Code OB Desc:		North83:		5029364.00	
Open Hole:		Org CS:		UTM83	
Cluster Kind:		UTMRC:		4	
Date Completed: 04/27/2005		UTMRC Desc:		margin of error : 30 m - 100 m	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB	
Remarks:		Location Method Desc:		on Water Well Record	Location Method:	WWF
Elevrc Desc:						
Location Source Date:						
Improvement Location Source:						
Improvement Location Method:						
Source Revision Comment:						
Supplier Comment:						
<u>Overburden and Bedrock</u>						
<u>Materials Interval</u>						
Formation ID:		932996683				
Layer:		3				
Color:		2				
General Color:		GREY				
Material 1:		06				
Material 1 Desc:		SILT				
Material 2:						
Material 2 Desc:						
Material 3:						
Material 3 Desc:						
Formation Top Depth:		1.2000000476837158				
Formation End Depth:		6.0				
Formation End Depth UOM:		m				
<u>Overburden and Bedrock</u>						
<u>Materials Interval</u>						
Formation ID:		932996682				
Layer:		2				
Color:		6				
General Color:		BROWN				
Material 1:		28				
Material 1 Desc:		SAND				
Material 2:						
Material 2 Desc:						
Material 3:						
Material 3 Desc:						
Formation Top Depth:		0.800000011920929				
Formation End Depth:		1.2000000476837158				
Formation End Depth UOM:		m				
<u>Overburden and Bedrock</u>						
<u>Materials Interval</u>						
Formation ID:		932996681				
Layer:		1				
Color:		2				
General Color:		GREY				
Material 1:		11				
Material 1 Desc:		GRAVEL				
Material 2:						
Material 2 Desc:						
Material 3:						
Material 3 Desc:						
Formation Top Depth:		0.0				
Formation End Depth:		0.800000011920929				
Formation End Depth UOM:		m				
<u>Annular Space/Abandonment</u>						
<u>Sealing Record</u>						

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		933271640			
Layer:		1			
Plug From:		0.0			
Plug To:		2.5			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		961535586			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		11330980			
Casing No:		1			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		930855429			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0			
Casing Diameter:		50.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		933413326			
Layer:		1			
Slot:		#10			
Screen Top Depth:		3.0			
Screen End Depth:		6.0			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.5			
 <u>Hole Diameter</u>					
Hole ID:		11533635			
Diameter:		20.0			
Depth From:		0.0			
Depth To:		6.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
75	1 of 2	NNW/172.4	77.9 / 0.07	O'Brien Publishing Inc. 176 Gloucester St Suite 400 Ottawa ON K2P 0A6	SCT
Established:		01-AUG-82			
Plant Size (ft²):		5000			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Employment:					
--Details--					
Description:		Periodical Publishers			
SIC/NAICS Code:		511120			
75	2 of 2	NNW/172.4	77.9 / 0.07	176 Gloucester St Ottawa ON K2P0A6	EHS
Order No:		20170523032		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State: ON	
Report Date:		26-MAY-17		Search Radius (km): .25	
Date Received:		23-MAY-17		X: -75.698263	
Previous Site Name:				Y: 45.417922	
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans			
76	1 of 1	SE/175.0	76.9 / -0.93	PE4776 - 352 Somerset Street West Ottawa ON K2P 0J9	EHS
Order No:		21120900110		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State: ON	
Report Date:		14-DEC-21		Search Radius (km): .25	
Date Received:		09-DEC-21		X: -75.6961474	
Previous Site Name:				Y: 45.415304	
Lot/Building Size:					
Additional Info Ordered:					
77	1 of 2	W/176.6	77.9 / 0.07	HUDSON PARK CONDOS 245 KENT STREET OTTAWA ON K2P 0A5	GEN
Generator Info					
Generator No:		ON7365454		Choice of Contact: CO_OFFICIAL	
Approval Years:		2015		Contaminated Fac: No	
Status:				MHSW Facility: No	
PO Box No:				SIC Code: 531111	
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:		LESSORS OF RESIDENTIAL BUILDINGS AND DWELLINGS (EXCEPT SOCIAL HOUSING PROJECTS)			
Waste Detail(s)					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
77	2 of 2	W/176.6	77.9 / 0.07	Charlesfort Development Corporation 235 and 245 Kent Street, Ottawa, Ontario, K2P 1Z9 OTTAWA ON	RSC
RSC No:		45110		X: -75.69971671492041	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2017 Generator Info</u>					
Gen No:	ON5614596			Choice of Contact:	CO_OFFICIAL
ID:	22176			Phone No Official:	613-822-0624 Ext.
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	531111			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		Regional Group			
Gen Div:					
Gen Op Name:		Regional Group			
Gen Op Div:					
Site Adrs1:		152 Gloucester St			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2P 0A6			
Site Country:		Canada			
Co Official:		Manny Agulink			
Co Admin:					
<u>2017 Generator Manifest</u>					
ID:	46933			Sum Received Qty:	200.0
Generator No:	ON5614596			Waste Class Name:	LIGHT FUELS
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	402
Waste Code:	221				
<u>80</u>	1 of 1	NE/180.4	76.9 / -0.93	ENBRIDGE GAS INC 142 NEPEAN ST,,OTTAWA,ON,K2P 2N2,CA ON	PINC
Incident Id:				Pipe Material:	
Incident No:	2859636			Fuel Category:	
Incident Reported Dt:	6/3/2020			Health Impact:	
Type:	FS-Pipeline Incident			Environment Impact:	
Status Code:				Property Damage:	
Tank Status:	Pipeline Damage Reason Est			Service Interrupt:	
Task No:				Enforce Policy:	
Spills Action Centre:				Public Relation:	
Fuel Type:				Pipeline System:	
Fuel Occurrence Tp:				PSIG:	
Date of Occurrence:				Attribute Category:	
Occurrence Start Dt:				Regulator Location:	
Depth:				Method Details:	
Customer Acct Name:		ENBRIDGE GAS INC			
Incident Address:		142 NEPEAN ST,,OTTAWA,ON,K2P 2N2,CA			
Operation Type:					
Pipeline Type:					
Regulator Type:					
Summary:					
Reported By:					
Affiliation:					
Occurrence Desc:					
Damage Reason:					
Notes:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
81	1 of 1	ESE/182.1	76.9 / -0.93	352/348/346 Somerset & 349 MacLaren Ottawa ON	EHS
Order No: 20001102002				Nearest Intersection: Bank and Somerset	
Status: C				Municipality:	
Report Type: Site Report				Client Prov/State: ON	
Report Date: 11/3/00				Search Radius (km): 0.25	
Date Received: 11/2/00				X: -75.695818	
Previous Site Name:				Y: 45.415198	
Lot/Building Size:					
Additional Info Ordered:					
82	1 of 1	E/186.3	75.9 / -1.93	ALLAN KWAI 331 SOMERSET ST. W., SWM OTTAWA CITY ON K2P 0J8	CA
Certificate #: 3-1581-97-					
Application Year: 97					
Issue Date: 10/28/1997					
Approval Type: Municipal sewage					
Status: Approved					
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					
83	1 of 2	SE/186.4	76.9 / -0.93	296 BANK ST. OTTAWA ON	WWIS
Well ID: 7246842				Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st: Monitoring and Test Hole				Data Entry Status:	
Use 2nd: 0				Data Src:	
Final Well Status: Observation Wells				Date Received: 08/24/2015	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No: Z208884				Contractor: 7241	
Tag: A165621				Form Version: 7	
Constructn Method:				Owner:	
Elevation (m):				County: OTTAWA-CARLETON	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality: OTTAWA CITY					
Site Info:					
PDF URL (Map):				https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/724\7246842.pdf	
Additional Detail(s) (Map)					
Well Completed Date: 07/17/2015					
Year Completed: 2015					
Depth (m): 6.096					
Latitude: 45.4150891021901					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Longitude:		-75.6962951247751			
X:		-75.69629496298303			
Y:		45.41508909517127			
Path:		724\7246842.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1005625955			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445519.00
Code OB Desc:				North83:	5029299.00
Open Hole:				Org CS:	G83dd
Cluster Kind:				UTMRC:	4
Date Completed:	07/17/2015			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005704585				
Layer:	1				
Color:	2				
General Color:	GREY				
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	1.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005704587				
Layer:	3				
Color:					
General Color:					
Material 1:	34				
Material 1 Desc:	TILL				
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	10.0				
Formation End Depth:	20.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005704586				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		1.0			
Formation End Depth:		10.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1005704596			
Layer:		2			
Plug From:		1.0			
Plug To:		9.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1005704597			
Layer:		3			
Plug From:		9.0			
Plug To:		20.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1005704595			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1005704594			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005704584			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005704590			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From:		0.0			
Depth To:		10.0			
Casing Diameter:		1.3799999952316284			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1005704591			
Layer:		1			
Slot:		10			
Screen Top Depth:		10.0			
Screen End Depth:		20.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.059999942779541			
 <u>Water Details</u>					
Water ID:		1005704589			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
 <u>Hole Diameter</u>					
Hole ID:		1005704588			
Diameter:		2.375			
Depth From:		0.0			
Depth To:		20.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>83</u>	2 of 2	SE/186.4	76.9 / -0.93	296 BANK ST. OTTAWA ON	WWIS
Well ID:	7246843			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Observation Wells			Date Received:	08/24/2015
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z208885			Contractor:	7241
Tag:	A163032			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/724\7246843.pdf				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		07/17/2015			
Year Completed:		2015			
Depth (m):		3.048			
Latitude:		45.4150891021901			
Longitude:		-75.6962951247751			
X:		-75.69629496298303			
Y:		45.41508909517127			
Path:		724\7246843.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1005625970			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445519.00
Code OB Desc:				North83:	5029299.00
Open Hole:				Org CS:	G83dd
Cluster Kind:				UTMRC:	4
Date Completed:	07/17/2015			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005704599				
Layer:	1				
Color:	2				
General Color:	GREY				
Material 1:					
Material 1 Desc:					
Material 2:	73				
Material 2 Desc:	HARD				
Material 3:					
Material 3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	1.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005704600				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	05				
Material 1 Desc:	CLAY				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	1.0				
Formation End Depth:	10.0				
Formation End Depth UOM:	ft				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005704609			
Layer:		2			
Plug From:		1.0			
Plug To:		2.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005704610			
Layer:		3			
Plug From:		2.5			
Plug To:		10.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005704608			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005704607			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005704598			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005704603			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0			
Casing Diameter:		1.3799999952316284			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1005704604			
Layer:		1			
Slot:		10			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Top Depth: 3.0 Screen End Depth: 10.0 Screen Material: 5 Screen Depth UOM: ft Screen Diameter UOM: inch Screen Diameter: 1.659999966621399					
<u>Water Details</u>					
Water ID: 1005704602 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: ft					
<u>Hole Diameter</u>					
Hole ID: 1005704601 Diameter: 2.375 Depth From: 0.0 Depth To: 10.0 Hole Depth UOM: ft Hole Diameter UOM: inch					
84	1 of 1	SW/187.4	78.9 / 1.07	281 kent st Ottawa ON	WWIS
Well ID: 7354245 Construction Date: Use 1st: Test Hole Use 2nd: Monitoring Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z302708 Tag: A269066 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 02/19/2020 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID: 1008173994 Depth M: 6.1 Year Completed: 2020 Well Completed Dt: 01/20/2020 Audit No: Z302708 Path:					
Tag No: A269066 Contractor: 7241 Latitude: 45.4149837991 Longitude: -75.6987988081002 Y: 45.41498379233774 X: -75.69879864591043					
<u>Bore Hole Information</u>					
Bore Hole ID: 1008173994 DP2BR:					
Elevation: Elevrc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Spatial Status:				Zone:	18
Code OB:				East83:	445323.00
Code OB Desc:				North83:	5029289.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		01/20/2020	UTMRC Desc:		margin of error : 30 m - 100 m
Remarks:		Location Method:		wwr	
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1008251401			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:		27			
Material 1 Desc:		OTHER			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1008251403			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		4.0			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1008251402			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		0.3100000023841858			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:		4.0			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008252372			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.7899999618530273			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008252373			
Layer:		3			
Plug From:		2.7899999618530273			
Plug To:		6.099999904632568			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008252371			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008253335			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008250038			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008253677			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1008254028			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		6.099999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
 <u>Results of Well Yield Testing</u>					
 <u>Pumping Test Method Desc:</u>					
Pump Test ID:		1008254371			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
 <u>Hole Diameter</u>					
Hole ID:		1008252994			
Diameter:		8.300000190734863			
Depth From:		0.0			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>85</u>	1 of 1	SW/188.0	78.9 / 1.07	TRANSPORT TRUCK KENT ST & COOPER ST. MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON	SPL
Ref No:	86705			Municipality No:	20101
Year:				Nature of Damage:	
Incident Dt:	6/9/1993			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	6/9/1993			Impact to Health:	
Dt Document Closed:				Agency Involved:	
Site No:					
MOE Response:					
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					
Site Name:					
Site Address:					
Site Region:					
Site Municipality:		OTTAWA CITY			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: PIPE/HOSE LEAK Incident Preceding Spill: Incident Reason: EQUIPMENT FAILURE Incident Summary: SEALTEST DAIRY-10L DIESELFUEL TO PAVED LOT,CLEANUPCOMPLETED. Environment Impact: NOT ANTICIPATED Health Env Consequence: Nature of Impact: Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: LAND Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:					
86	1 of 8	SSW/189.0	77.8 / 0.01	SOMERSET SUNOCO 429 SOMERSET ST OTTAWA ON K2P0K1	PRT
Location ID: 11098 Type: retail Expiry Date: 1996-03-31 Capacity (L): 75009 Licence #: 0055856001					
86	2 of 8	SSW/189.0	77.8 / 0.01	CLARRIDGE HOMES 419-429 SOMERSET STREET OTTAWA ON K2P 2P5	GEN
<u>Generator Info</u>					
Generator No: ON8399115 Approval Years: 01 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: NON-RES. BLDG. OPER.					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 7512					
<u>Waste Detail(s)</u>					
Waste Class: 221 Waste Class Name: LIGHT FUELS					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
86	3 of 8	SSW/189.0	77.8 / 0.01	Clarridge Homes 419-429 SOMERSET ST. OTTAWA ON K1N 6W8	GEN
<u>Generator Info</u>					
Generator No:	ON8399115			Choice of Contact:	
Approval Years:	02,03,04			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	531111
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Lessors of Res. Buildings (exc. Soc. Housing)			
<u>Waste Detail(s)</u>					
Waste Class:	221				
Waste Class Name:	LIGHT FUELS				
86	4 of 8	SSW/189.0	77.8 / 0.01	SAVEWAY GAS & FUELS LTD 429 SOMERSET ST W OTTAWA ON K2P 0K1	DTNK
<u>Delisted Expired Fuel Safety Facilities</u>					
Instance No:	10169745			Expired Date:	8/1/1990
Status:	EXPIRED			Max Hazard Rank:	
Instance ID:				Facility Location:	
Instance Type:	FS Facility			Facility Type:	
Instance Creation Dt:				Fuel Type 2:	
Instance Install Dt:				Fuel Type 3:	
Item Description:				Panam Related:	
Manufacturer:				Panam Venue Nm:	
Model:				External Identifier:	
Serial No:				Item:	
ULC Standard:				Piping Steel:	
Quantity:				Piping Galvanized:	
Unit of Measure:				Tank Single Wall St:	
Overfill Prot Type:				Piping Underground:	
Creation Date:				Tank Underground:	
Next Periodic Str DT:				Source:	
TSSA Base Sched Cycle 2:					
TSSAMax Hazard Rank 1:					
TSSA Risk Based Periodic Yn:					
TSSA Volume of Directives:					
TSSA Periodic Exempt:					
TSSA Statutory Interval:					
TSSA Recd Insp Interva:					
TSSA Recd Tolerance:					
TSSA Program Area:					
TSSA Program Area 2:					
Description:					
Original Source:	EXP				
Record Date:	Up to May 2013				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
86	5 of 8	SSW/189.0	77.8 / 0.01	MARK TAZA 429 SOMERSET ST W OTTAWA ON K2P 0K1	DTNK

Delisted Expired Fuel Safety
Facilities

Instance No:	9822476	Expired Date:	11/8/1996
Status:	EXPIRED	Max Hazard Rank:	
Instance ID:		Facility Location:	
Instance Type:	FS Facility	Facility Type:	
Instance Creation Dt:		Fuel Type 2:	
Instance Install Dt:		Fuel Type 3:	
Item Description:		Panam Related:	
Manufacturer:		Panam Venue Nm:	
Model:		External Identifier:	
Serial No:		Item:	
ULC Standard:		Piping Steel:	
Quantity:		Piping Galvanized:	
Unit of Measure:		Tank Single Wall St:	
Overfill Prot Type:		Piping Underground:	
Creation Date:		Tank Underground:	
Next Periodic Str DT:		Source:	
TSSA Base Sched Cycle 2:			
TSSAMax Hazard Rank 1:			
TSSA Risk Based Periodic Yn:			
TSSA Volume of Directives:			
TSSA Periodic Exempt:			
TSSA Statutory Interval:			
TSSA Recd Insp Interva:			
TSSA Recd Tolerance:			
TSSA Program Area:			
TSSA Program Area 2:			
Description:			
Original Source:	EXP		
Record Date:	Up to May 2013		

86	6 of 8	SSW/189.0	77.8 / 0.01	MARK TAZA 429 SOMERSET ST W OTTAWA ON	DTNK

Delisted Expired Fuel Safety
Facilities

Instance No:	10907010	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	
Instance ID:	51574	Facility Location:	
Instance Type:	FS Piping	Facility Type:	
Instance Creation Dt:		Fuel Type 2:	
Instance Install Dt:		Fuel Type 3:	
Item Description:		Panam Related:	
Manufacturer:		Panam Venue Nm:	
Model:		External Identifier:	
Serial No:		Item:	
ULC Standard:		Piping Steel:	
Quantity:		Piping Galvanized:	
Unit of Measure:		Tank Single Wall St:	
Overfill Prot Type:		Piping Underground:	
Creation Date:		Tank Underground:	
Next Periodic Str DT:		Source:	
TSSA Base Sched Cycle 2:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
TSSAMax Hazard Rank 1: TSSA Risk Based Periodic Yn: TSSA Volume of Directives: TSSA Periodic Exempt: TSSA Statutory Interval: TSSA Recd Insp Interva: TSSA Recd Tolerance: TSSA Program Area: TSSA Program Area 2: Description: Original Source: Record Date:					
		FS Piping EXP Up to Mar 2012			
86	7 of 8	SSW/189.0	77.8 / 0.01	MARK TAZA 429 SOMERSET ST W OTTAWA ON	EXP
Inventory No: 10907002 Inventory Status: EXPIRED Installation Year: 1992 Capacity: 27280 Capacity Unit: Tank Type: Manufacturer: Model: Description: AS PER REPORT E053213 Previous Fuel Type: Gasoline					
Tank Material: Fiberglass (FRP) Corrosion Protect: Fiberglass Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK					
86	8 of 8	SSW/189.0	77.8 / 0.01	MARK TAZA 429 SOMERSET ST W OTTAWA ON	EXP
Inventory No: 10906990 Inventory Status: EXPIRED Installation Year: 1992 Capacity: 45460 Capacity Unit: Tank Type: Manufacturer: Model: Description: AS PER REPORT E053213 Previous Fuel Type: Gasoline					
Tank Material: Fiberglass (FRP) Corrosion Protect: Fiberglass Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK					
87	1 of 1	ENE/189.6	76.2 / -1.61	355 COOPER ST Ottawa ON	WWIS
Well ID: 7312995 Construction Date: Use 1st: Test Hole Use 2nd: Monitoring Final Well Status: Test Hole Water Type: Casing Material: Audit No: Z212308 Tag: A199385 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 06/19/2018 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):				https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/731\7312995.pdf	
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		03/02/2018			
Year Completed:		2018			
Depth (m):		6.1			
Latitude:		45.4173616927019			
Longitude:		-75.6955945372303			
X:		-75.6955943750171			
Y:		45.4173616862778			
Path:		731\7312995.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1007108655		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445576.00
Code OB Desc:				North83:	5029551.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		03/02/2018		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007367753			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		11			
Material 3 Desc:		GRAVEL			
Formation Top Depth:		0.0			
Formation End Depth:		1.2200000286102295			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007367754			
Layer:		2			
Color:		6			
General Color:		BROWN			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		1.2200000286102295			
Formation End Depth:		3.0999999046325684			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007367755			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		85			
Material 2 Desc:		SOFT			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		3.0999999046325684			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007367763			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007367764			
Layer:		2			
Plug From:					
Plug To:					
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007367765			
Layer:		3			
Plug From:					
Plug To:					
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007367762			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		1007367752			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007367758			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Casing Diameter:		4.070000171661377			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007367759			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		6.099999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
<u>Water Details</u>					
Water ID:		1007367757			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007367756			
Diameter:		8.25			
Depth From:		0.0			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

88	1 of 1	NW/193.5	77.6 / -0.23	186 Bank St Ottawa ON K2P1W6	EHS
Order No:	20161128012			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	01-DEC-16			Search Radius (km):	.25
Date Received:	28-NOV-16			X:	-75.698933
Previous Site Name:				Y:	45.417958
Lot/Building Size:					
Additional Info Ordered:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
89	1 of 1	WNW/194.6	76.9 / -0.93	230 Gloucester St Ottawa ON K2P0A9	EHS
Order No: 20140428057				Nearest Intersection:	
Status: C				Municipality:	
Report Type: Custom Report				Client Prov/State: ON	
Report Date: 02-MAY-14				Search Radius (km): .25	
Date Received: 28-APR-14				X: -75.699994	
Previous Site Name:				Y: 45.417065	
Lot/Building Size:					
Additional Info Ordered:					
90	1 of 1	E/195.0	75.9 / -1.93	327 Somerset St W Ottawa ON K2P0J8	EHS
Order No: 20151130011				Nearest Intersection:	
Status: C				Municipality:	
Report Type: Custom Report				Client Prov/State: ON	
Report Date: 03-DEC-15				Search Radius (km): .25	
Date Received: 30-NOV-15				X: -75.695217	
Previous Site Name:				Y: 45.416108	
Lot/Building Size:					
Additional Info Ordered:					
91	1 of 1	SW/195.3	78.9 / 1.07	81 kent st Ottawa ON	WWIS
Well ID: 7354244				Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st: Test Hole				Data Entry Status:	
Use 2nd: Monitoring				Data Src:	
Final Well Status: Monitoring and Test Hole				Date Received: 02/19/2020	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No: Z302714				Contractor: 7241	
Tag: A269067				Form Version: 7	
Constructn Method:				Owner:	
Elevation (m):				County: OTTAWA-CARLETON	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality: OTTAWA CITY					
Site Info:					
Additional Detail(s) (Map)					
Bore Hole ID: 1008173985				Tag No: A269067	
Depth M: 6.1				Contractor: 7241	
Year Completed: 2020				Latitude: 45.4148762609929	
Well Completed Dt: 01/20/2020				Longitude: -75.6987207988945	
Audit No: Z302714				Y: 45.41487625439337	
Path:				X: -75.69872063714445	

Bore Hole Information

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID:	1008173985			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445329.00
Code OB Desc:				North83:	5029277.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	01/20/2020			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008251399				
Layer:	2				
Color:	6				
General Color:	BROWN				
Material 1:	05				
Material 1 Desc:	CLAY				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	66				
Material 3 Desc:	DENSE				
Formation Top Depth:	0.3100000023841858				
Formation End Depth:	4.0				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008251400				
Layer:	3				
Color:	2				
General Color:	GREY				
Material 1:	06				
Material 1 Desc:	SILT				
Material 2:	28				
Material 2 Desc:	SAND				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	4.0				
Formation End Depth:	6.099999904632568				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1008251398				
Layer:	1				
Color:	8				
General Color:	BLACK				
Material 1:	11				
Material 1 Desc:	GRAVEL				
Material 2:	27				
Material 2 Desc:	OTHER				
Material 3:	77				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008252370			
Layer:		3			
Plug From:		2.7899999618530273			
Plug To:		6.099999904632568			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008252369			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.7899999618530273			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008252368			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1008253334			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1008250037			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1008253676			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen ID:		1008254027			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		6.099999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008254370			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
 <u>Hole Diameter</u>					
Hole ID:		1008252993			
Diameter:		8.300000190734863			
Depth From:		0.0			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
92	1 of 23	SE/197.4	76.9 / -0.93	HARTMAN'S YOUR INDEPENDENT GROCER 296 BANK STREET OTTAWA ON K2P 1X8	PES
Detail Licence No:				Operator Box:	
Licence No:				Operator Class:	
Status:				Operator No:	
Approval Date:				Operator Type:	
Report Source:				Oper Area Code:	
Licence Type:	Vendor			Oper Phone No:	
Licence Type Code:				Operator Ext:	
Licence Class:				Operator Lot:	
Licence Control:				Oper Concession:	
Latitude:				Operator Region:	
Longitude:				Operator District:	
Lot:				Operator County:	
Concession:				Op Municipality:	
Region:				Post Office Box:	
District:				MOE District:	
County:				SWP Area Name:	
Trade Name:					
PDF URL:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
92	2 of 23	SE/197.4	76.9 / -0.93	HARTMAN'S YOUR INDEPENDENT GROCER 296 BANK STREET OTTAWA ON K2P 1X8	PES
Detail Licence No: 23-01-10066-0 Licence No: 10066 Status: Approval Date: Report Source: Licence Type: Limited Vendor Licence Type Code: 23 Licence Class: 01 Licence Control: 0 Latitude: Longitude: Lot: Concession: Region: 4 District: 2 County: 15 Trade Name: PDF URL:		Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: Oper Phone No: Operator Ext: Operator Lot: Oper Concession: Operator Region: 4 Operator District: 2 Operator County: 15 Op Municipality: Post Office Box: MOE District: SWP Area Name:			
92	3 of 23	SE/197.4	76.9 / -0.93	HARTMAN'S YOUR INDEPENDENT GROCER 296 BANK ST OTTAWA ON K2P 1X8	PES
Detail Licence No: Licence No: Status: Approval Date: Report Source: Licence Type: Limited Vendor Licence Type Code: 23 Licence Class: Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:		Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: Oper Phone No: Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:			
92	4 of 23	SE/197.4	76.9 / -0.93	HARTMAN'S YOUR INDEPENDENT GROCER 296 BANK ST OTTAWA ON K2P 1X8	PES
Detail Licence No: Licence No: Status: Approval Date: Report Source: Licence Type: Vendor Licence Type Code: Licence Class: Licence Control: Latitude:		Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: Oper Phone No: Operator Ext: Operator Lot: Oper Concession: Operator Region:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:					
Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:					
92	5 of 23	SE/197.4	76.9 / -0.93	Parson Refrigeration (1985) Ltd. 296 Bank St. Ottawa ON K2P 1X8	SPL
Ref No: 5430-849QV8 Year: Incident Dt: Dt MOE Arvl on Scn: MOE Reported Dt: 4/6/2010 Dt Document Closed: Site No: MOE Response: No Field Response Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Hartman's Independant Grocer<UNOFFICIAL> Site Address: Site Region: Site Municipality: Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Parson Refrigeration (1985) Ltd. Client Type: Source Type: Incident Cause: Valve / Fitting Leak Or Failure Incident Preceding Spill: Incident Reason: Spill Incident Summary: Parsons Ref: 235 lbs R507 to Air Environment Impact: Not Anticipated Health Env Consequence: Nature of Impact: Air Pollution Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: 38 Contaminant Name: REFRIGERANT GAS, N.O.S. Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Other SAC Action Class: Air Spills - Gases and Vapours Call Report Locatn Geodata: Time Reported: System Facility Address:					
Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
92	6 of 23	SE/197.4	76.9 / -0.93	Bank and Somerset Holdings Limited 296 Bank Street Ottawa ON K2P 1X8	CA
Certificate #: Application Year: Issue Date: Approval Type: Status: Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:		5155-5W4MG7 2004 3/1/2004 Municipal and Private Sewage Works Approved			
92	7 of 23	SE/197.4	76.9 / -0.93	HARTMAN'S YOUR INDEPENDENT GROCER 296 BANK ST OTTAWA ON K2P 1X8	PES
Detail Licence No: Licence No: Status: Approval Date: Report Source: Licence Type: Licence Type Code: Licence Class: Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:		23-01-16480-0 LIMITED	Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: Oper Phone No: Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:		
92	8 of 23	SE/197.4	76.9 / -0.93	Parson Refrigeration (1985) Ltd. 296 Bank St Ottawa ON	SPL
Ref No: Year: Incident Dt: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region:		7666-9ZVTFZ 8/30/2015 8/30/2015 10/1/2015 NA No	Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:		
		Your Independent Grocer<UNOFFICIAL> 296 Bank St			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Municipality: Ottawa Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Parson Refrigeration (1985) Ltd. Client Type: Source Type: Incident Cause: Incident Preceding Spill: Incident Reason: Equipment Failure Incident Summary: Parson's Refrigeration 136 kgs R507 to atm Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: 136 kg Contaminant Qty 1: 136 Contaminant Unit: kg Contaminant Code: 38 Contaminant Name: REFRIGERANT GAS, N.O.S. Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Unknown / N/A SAC Action Class: Air Spills - Gases and Vapours Call Report Locatn Geodata: Time Reported: System Facility Address:					
92	9 of 23	SE/197.4	76.9 / -0.93	296 Bank St Ottawa ON K2P1X8	EHS
Order No: 20150427034 Status: C Report Type: Standard Report Report Date: 11-MAY-15 Date Received: 04-MAY-15 Previous Site Name: Lot/Building Size: Additional Info Ordered: City Directory Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.696543 Y: 45.41482					
92	10 of 23	SE/197.4	76.9 / -0.93	MASSINE ENTERPRISES INC. O/A MASSINE'S YOUR INDEPENDENT GROCER 296 BANK ST OTTAWA ON K2P1X8	PES
Detail Licence No: Licence No: 17671 Status: Approval Date: Report Source: Legacy Licenses (Excluding TS) Licence Type: Limited Vendor Licence Type Code: 23 Licence Class: 01 Licence Control: Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: 613 Oper Phone No: 2348692 Operator Ext: Operator Lot: Oper Concession:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:				Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:	
92	11 of 23	SE/197.4	76.9 / -0.93	LOBLAWS INC O/A BANK STREET YOUR INDEPENDENT GROCER 296 BANK ST OTTAWA ON K2P1X8	PES
Detail Licence No: Licence No: Status: Approval Date: Report Source: Licence Type: Licence Type Code: Licence Class: Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:	17343 Legacy Licenses (Excluding TS) Limited Vendor 23 01			Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: Oper Phone No: Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:	613 2348692
92	12 of 23	SE/197.4	76.9 / -0.93	HARTMAN'S YOUR INDEPENDENT GROCER 296 BANK ST OTTAWA ON K2P1X8	PES
Detail Licence No: Licence No: Status: Approval Date: Report Source: Licence Type: Licence Type Code: Licence Class: Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:	16480 Legacy Licenses (Excluding TS) Limited Vendor 23 01			Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: Oper Phone No: Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:	613 2348692
92	13 of 23	SE/197.4	76.9 / -0.93	Bank and Somerset Holdings Limited 296 Bank Street Ottawa ON K2P 1X8	ECA

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval No: 5155-5W4MG7 Approval Date: 2004-03-01 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Rideau Valley Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS Business Name: Bank and Somerset Holdings Limited Address: 296 Bank Street Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/5932-5SUMTJ-14.pdf PDF Site Location:					
92	14 of 23	SE/197.4	76.9 / -0.93	Loblaw Companies Limited 296 Bank St. Ottawa ON K2P 1X8	GEN
Generator Info					
Generator No: ON9102901 Approval Years: 2016 Status: PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description: SUPERMARKETS AND OTHER GROCERY (EXCEPT CONVENIENCE) STORES					
Choice of Contact: CO_OFFICIAL					
Contaminated Fac: No					
MHSW Facility: No					
SIC Code: 445110					
Waste Detail(s)					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
92	15 of 23	SE/197.4	76.9 / -0.93	Loblaw Companies Limited 296 Bank St. Ottawa ON K2P 1X8	GEN
Generator Info					
Generator No: ON9102901 Approval Years: 2015 Status: PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description: SUPERMARKETS AND OTHER GROCERY (EXCEPT CONVENIENCE) STORES					
Choice of Contact: CO_OFFICIAL					
Contaminated Fac: No					
MHSW Facility: No					
SIC Code: 445110					
Waste Detail(s)					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
92	16 of 23	SE/197.4	76.9 / -0.93	LOBLAWS INC. 296 Bank St.	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Ottawa ON K2P 1X8					
<u>Generator Info</u>					
Generator No:	ON9102901			Choice of Contact:	
Approval Years:	As of Dec 2018			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	212 I				
Waste Class Name:	Aliphatic solvents and residues				
<u>Waste Detail(s)</u>					
Waste Class:	261 A				
Waste Class Name:	Pharmaceuticals				
<u>Waste Detail(s)</u>					
Waste Class:	312 P				
Waste Class Name:	Pathological wastes				
92	17 of 23	SE/197.4	76.9 / -0.93	HARTMAN'S YOUR INDEPENDENT GROCER 296 BANK ST OTTAWA ON K2P1X8	PES
Detail Licence No:				Operator Box:	
Licence No:	10066			Operator Class:	
Status:				Operator No:	
Approval Date:				Operator Type:	
Report Source:	Legacy Licenses (Excluding TS)			Oper Area Code:	613
Licence Type:	Retail Vendor Class 03			Oper Phone No:	2348692
Licence Type Code:	21			Operator Ext:	
Licence Class:	03			Operator Lot:	
Licence Control:				Oper Concession:	
Latitude:				Operator Region:	
Longitude:				Operator District:	
Lot:				Operator County:	
Concession:				Op Municipality:	
Region:				Post Office Box:	
District:				MOE District:	
County:				SWP Area Name:	
Trade Name:					
PDF URL:					
92	18 of 23	SE/197.4	76.9 / -0.93	HARTMAN'S YOUR INDEPENDENT GROCER 296 BANK ST OTTAWA ON K2P1X8	PES
Detail Licence No:	23-01-10066-0			Operator Box:	
Licence No:	10066			Operator Class:	
Status:				Operator No:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Date: Report Source: Legacy Licenses (Excluding TS) Licence Type: Limited Vendor Licence Type Code: 23 Licence Class: 01 Licence Control: 0 Latitude: Longitude: Lot: Concession: Region: 4 District: 2 County: 15 Trade Name: PDF URL:					
Operator Type: Oper Area Code: 613 Oper Phone No: 2348692 Operator Ext: Operator Lot: Oper Concession: Operator Region: 4 Operator District: 2 Operator County: 15 Op Municipality: Post Office Box: MOE District: SWP Area Name:					

92	19 of 23	SE/197.4	76.9 / -0.93	LOBLAWS INC. 296 Bank St. Ottawa ON K2P 1X8	GEN

Generator Info

Generator No:	ON9102901	Choice of Contact:
Approval Years:	As of Jul 2020	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	261 A
Waste Class Name:	Pharmaceuticals

Waste Detail(s)

Waste Class:	212 I
Waste Class Name:	Aliphatic solvents and residues

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	Pathological wastes

92	20 of 23	SE/197.4	76.9 / -0.93	LOBLAWS INC. 296 Bank St. Ottawa ON K2P 1X8	GEN

Generator Info

Generator No:	ON9102901	Choice of Contact:
Approval Years:	As of Nov 2021	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		261 A			
Waste Class Name:		Pharmaceuticals			
<u>Waste Detail(s)</u>					
Waste Class:		212 I			
Waste Class Name:		Aliphatic solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			

92	21 of 23	SE/197.4	76.9 / -0.93	LOBLAWS INC. 296 Bank St. Ottawa ON K2P 1X8	GEN

Generator Info

Generator No:	ON9102901	Choice of Contact:	
Approval Years:	As of Oct 2022	Contaminated Fac:	
Status:	Registered	MHSW Facility:	
PO Box No:		SIC Code:	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	212 I
Waste Class Name:	ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class:	261 A
Waste Class Name:	PHARMACEUTICALS

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	PATHOLOGICAL WASTES

2017 Generator Info

Gen No:	ON9102901	Choice of Contact:	CO_ADMIN
ID:	35559	Phone No Official:	905 459 2500 Ext.61368
Contaminated Fac:	N	Phone No Admin:	8552770388 Ext.
MHSW Facility:	N	County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	445110	County Out:	
NAICS Code2:		District:	402

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
NAICS Code3:					
Gen Name:		LOBLAWS INC.			
Gen Div:					
Gen Op Name:		Your Independent Grocer			
Gen Op Div:					
Site Adrs1:		296 Bank St.			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2P 1X8			
Site Country:		Canada			
Co Official:		Dan Romano			
Co Admin:		Craig Hudak			
<u>2017 Generator Manifest</u>					
ID:	63768			Sum Received Qty:	9.7
Generator No:	ON9102901			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	1
Waste Char:	P			District:	402
Waste Code:	312				
<u>2018 Generator Info</u>					
Gen No:	ON9102901			Choice of Contact:	CO_ADMIN
ID:	36248			Phone No Official:	905 459 2500 Ext.61368
Contaminated Fac:	N			Phone No Admin:	8552770388 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	445110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		LOBLAWS INC.			
Gen Div:					
Gen Op Name:		Your Independent Grocer			
Gen Op Div:					
Site Adrs1:		296 Bank St.			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2P 1X8			
Site Country:		Canada			
Co Official:		Dan Romano			
Co Admin:		Craig Hudak			
<u>2018 Generator Manifest</u>					
ID:	64264			Sum Received Qty:	1.9
Generator No:	ON9102901			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	1
Waste Char:	P			District:	402
Waste Code:	312				
<u>2019 Generator Info</u>					
Gen No:	ON9102901			Choice of Contact:	CO_ADMIN
ID:	36752			Phone No Official:	905 459 2500 Ext.61368

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminated Fac:	N			Phone No Admin:	8552770388 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	445110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		LOBLAWS INC.			
Gen Div:					
Gen Op Name:		Your Independent Grocer			
Gen Op Div:					
Site Adrs1:		296 Bank St.			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2P 1X8			
Site Country:		Canada			
Co Official:		Dan Romano			
Co Admin:		Craig Hudak			
<u>2019 Generator Manifest</u>					
ID:	64282			Sum Received Qty:	9.0
Generator No:	ON9102901			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	1
Waste Char:	P			District:	402
Waste Code:	312				
<u>2020 Generator Info</u>					
Gen No:	ON9102901			Choice of Contact:	CO_ADMIN
ID:	36494			Phone No Official:	905 459 2500 Ext.61368
Contaminated Fac:	N			Phone No Admin:	8552770388 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	445110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		LOBLAWS INC.			
Gen Div:					
Gen Op Name:		Your Independent Grocer			
Gen Op Div:					
Site Adrs1:		296 Bank St.			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2P 1X8			
Site Country:		Canada			
Co Official:		Morgan Lamprey			
Co Admin:		Craig Hudak			
<u>2020 Generator Manifest</u>					
ID:	60391			Sum Received Qty:	11.0
Generator No:	ON9102901			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	1
Waste Char:	P			District:	402
Waste Code:	312				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2020 Generator Manifest</u>					
ID:	60390			Sum Received Qty:	7.0
Generator No:	ON9102901			Waste Class Name:	PHARMACEUTICALS
Receiver Type:	030			Count Manifests:	1
Waste Char:	A			District:	402
Waste Code:	261				
<u>2021 Generator Info</u>					
Gen No:	ON9102901			Choice of Contact:	CO_ADMIN
ID:	37441			Phone No Official:	905 459 2500 Ext.61368
Contaminated Fac:	N			Phone No Admin:	8552770388 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	445110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	LOBLAWS INC.				
Gen Div:					
Gen Op Name:	Your Independent Grocer				
Gen Op Div:					
Site Adrs1:	296 Bank St.				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K2P 1X8				
Site Country:	Canada				
Co Official:	Morgan Lamprey				
Co Admin:	Craig Hudak				
<u>2021 Generator Manifest</u>					
ID:	63136			Sum Received Qty:	2.56
Generator No:	ON9102901			Waste Class Name:	PHARMACEUTICALS
Receiver Type:	030			Count Manifests:	1
Waste Char:	A			District:	402
Waste Code:	261				
<u>2021 Generator Manifest</u>					
ID:	63137			Sum Received Qty:	36.28
Generator No:	ON9102901			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	2
Waste Char:	P			District:	402
Waste Code:	312				
92	22 of 23	SE/197.4	76.9 / -0.93	296 Bank Street 296 Bank Street OTTAWA ON	SPL
Ref No:	1-1Z3N61			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	7/24/2022 8:00:00 PM			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	7/25/2022 12:46:27 AM			Impact to Health:	0 No Impact
Dt Document Closed:	7/28/2022 12:31:04 PM			Agency Involved:	
Site No:					
MOE Response:	Desktop Response				
Site County/District:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Geo Ref Meth: Site District Office: Ottawa District Office Nearest Watercourse: Site Name: 296 Bank Street Site Address: 296 Bank Street Site Region: Site Municipality: OTTAWA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: MASSINE'S YOUR INDEPENDENT GROCER Client Type: Private Business Source Type: Valve/Fitting/Piping Incident Cause: Incident Preceding Spill: Process Upset Incident Reason: Equipment failure/malfunction Incident Summary: Refrigerant Leak R507 Environment Impact: 0 No Impact Health Env Consequence: Nature of Impact: Contaminant Qty: 10 kilogram (kg) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: REFRIGERANT GAS R 404A Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Air; Land Activity Preceding Spill: Normal operations Property 2nd Watershed: Lower Ottawa Property Tertiary Watershed: 02KF - Central Ottawa - Mississippi Sector Type: SUPERMARKETS AND OTHER GROCERY (EXCEPT CONVENIENCE) STORES SAC Action Class: Ozone Depleting Substances Call Report Locatn Geodata: {"integration_ids":["PR00003948017"],"wks":["POINT (-75.6963383000 45.4149865000)","POINT (-75.6963383000 45.4149865000)"],"creation_date":"2022-07-25"} Time Reported: System Facility Address: 296 BANK ST, OTTAWA, ON K2P 1X8					

92	23 of 23	SE/197.4	76.9 / -0.93	296 Bank Street, Ottawa ON	SPL
Ref No: 1-1UZA10 Year: Incident Dt: 6/26/2022 8:13:43 PM Dt MOE Arvl on Scn: MOE Reported Dt: 6/26/2022 8:13:47 PM Dt Document Closed: 8/3/2022 9:40:27 AM Site No: MOE Response: Desktop Response Site County/District: Site Geo Ref Meth: Site District Office: Ottawa District Office Nearest Watercourse: Site Name: Site Address: 296 Bank Street, Ottawa Site Region: Site Municipality: Site Lot: Site Conc:					
Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: 0 No Impact Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: MASSINE'S YOUR INDEPENDENT GROCER Client Type: Private Business Source Type: Incident Cause: Incident Preceding Spill: Leak/Break Incident Reason: Incident Summary: Parson Refrigeration: 136.5 kg R507A to atmosphere - Independent Environment Impact: 1 Minor Impact Health Env Consequence: Nature of Impact: Contaminant Qty: 136.5 kilogram (kg) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: REFRIGERANT GASES (N.O.S.) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Normal operations Property 2nd Watershed: Lower Ottawa Property Tertiary Watershed: Sector Type: REFRIGERATED WAREHOUSING AND STORAGE SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00003948017"],"wkts":["POINT (-75.6963383000 45.4149865000)"],"creation_date":"2022-06-26"} Time Reported: System Facility Address:					

93	1 of 3	SE/198.0	76.9 / -0.93	380 & 386 Somerset St W/296 Bank St Ottawa ON	EHS
Order No: 20040317015 Status: C Report Type: Custom Report Report Date: 3/26/04 Date Received: 3/17/04 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Bank St & Sommerset St W Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -75.696447 Y: 45.415117					

93	2 of 3	SE/198.0	76.9 / -0.93	DUFRESNE PILING COMPANY (1967) LTD. 380 SOMERSET STREET WEST OTTAWA ON K2P 2R2	GEN
Generator Info					
Generator No: ON3389146 Approval Years: 04 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: Contract Drilling (except Oil and Gas)					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 213117					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
93	3 of 3	SE/198.0	76.9 / -0.93	380 Somerset St W Ottawa ON K2P2R2	EHS
Order No:		20160106113	Nearest Intersection:		
Status:		C	Municipality:		
Report Type:		Standard Report	Client Prov/State: ON		
Report Date:		13-JAN-16	Search Radius (km): .25		
Date Received:		06-JAN-16	X: -75.696869		
Previous Site Name:			Y: 45.41488		
Lot/Building Size:					
Additional Info Ordered:		City Directory			
94	1 of 6	NE/199.7	76.9 / -0.93	GVT. OF CAN. - NATIONAL DEFENCE CRAD/DSIS-NATIONAL DEFENCE HEADQUARTERS 190 O'CONNOR ST. OTTAWA ON K1A 1G8	GEN
<u>Generator Info</u>					
Generator No:		ON0046540	Choice of Contact:		
Approval Years:		86,87,88,89,90	Contaminated Fac:		
Status:			MHSW Facility:		
PO Box No:			SIC Code: 8111		
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		DEFENCE SERVICES			
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
94	2 of 6	NE/199.7	76.9 / -0.93	GVT. OF CAN. - NATIONAL DEFENCE 190 O'CONNOR STREET DIRECTORATE, SCIENTIFIC INFORMAT.SERVICE OTTAWA ON K1A 1G8	GEN
<u>Generator Info</u>					
Generator No:		ON0046540	Choice of Contact:		
Approval Years:		92,93,97	Contaminated Fac:		
Status:			MHSW Facility:		
PO Box No:			SIC Code: 8111		
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		DEFENCE SERVICES			
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
94	3 of 6	NE/199.7	76.9 / -0.93	GVT. OF CAN. - NATIONAL DEFENCE 18-192 CRAD/DSIS-NATIONAL DEFENCE	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
				HEADQUARTERS 190 O'CONNOR ST. OTTAWA ON K1A 1G8	
<u>Generator Info</u>					
Generator No:	ON0046540			Choice of Contact:	
Approval Years:	94,95,96			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	8111
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		DEFENCE SERVICES			
<u>Waste Detail(s)</u>					
Waste Class:	264				
Waste Class Name:	PHOTOPROCESSING WASTES				
94	4 of 6	NE/199.7	76.9 / -0.93	DEPT. OF NATIONAL DEFENCE DEFENCE RESEARCH DEVELOPMENT BRANCH 190 O'CONNOR STREET OTTAWA ON K1A 0K2	GEN
<u>Generator Info</u>					
Generator No:	ON0046540			Choice of Contact:	
Approval Years:	98,99,00,01,04			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	8111
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		DEFENCE SERVICES			
<u>Waste Detail(s)</u>					
Waste Class:	264				
Waste Class Name:	PHOTOPROCESSING WASTES				
<u>Waste Detail(s)</u>					
Waste Class:	213				
Waste Class Name:	PETROLEUM DISTILLATES				
<u>Waste Detail(s)</u>					
Waste Class:	145				
Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES				
94	5 of 6	NE/199.7	76.9 / -0.93	Canadian Council on Social 190 O'Connor St Suite 100 Ottawa ON K2P 2R3	SCT
Established:	1920				
Plant Size (ft²):					
Employment:	13				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
--Details--					
Description:		Periodical Publishers			
SIC/NAICS Code:		511120			
Description:		Social Advocacy Organizations			
SIC/NAICS Code:		813310			
Description:		Civic and Social Organizations			
SIC/NAICS Code:		813410			
Description:		Business Associations			
SIC/NAICS Code:		813910			
94	6 of 6	NE/199.7	76.9 / -0.93	190 O'connor St Ottawa ON K2P2R3	EHS
Order No:		20150123005		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Custom Report		Client Prov/State: ON	
Report Date:		28-JAN-15		Search Radius (km): .25	
Date Received:		23-JAN-15		X: -75.69601	
Previous Site Name:				Y: 45.417916	
Lot/Building Size:					
Additional Info Ordered:					
95	1 of 1	ESE/206.1	75.9 / -1.93	338 SOMERSET STREET WEST OTTAWA ON	WWIS
Well ID:		7046637		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Observation Wells		Date Received: 07/17/2007	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No:		Z74024		Contractor: 7241	
Tag:		A061568		Form Version: 3	
Constructn Method:				Owner:	
Elevation (m):				County: OTTAWA-CARLETON	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7046637.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		06/22/2007			
Year Completed:		2007			
Depth (m):		8.23			
Latitude:		45.4157256058949			
Longitude:		-75.6952421522528			
X:		-75.69524199044142			
Y:		45.41572559951513			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Path:		704\7046637.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	23046637			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445602.00
Code OB Desc:				North83:	5029369.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	06/22/2007			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	30346637				
Layer:	3				
Color:	6				
General Color:	BROWN				
Material 1:	06				
Material 1 Desc:	SILT				
Material 2:	05				
Material 2 Desc:	CLAY				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	1.5				
Formation End Depth:	3.6600000858306885				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	30446637				
Layer:	4				
Color:	2				
General Color:	GREY				
Material 1:	05				
Material 1 Desc:	CLAY				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	3.6600000858306885				
Formation End Depth:	6.099999904632568				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	30246637				
Layer:	2				
Color:	6				
General Color:	BROWN				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		05			
Material 3 Desc:		CLAY			
Formation Top Depth:		0.9100000262260437			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		30546637			
Layer:		5			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		91			
Material 2 Desc:		WATER-BEARING			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		6.099999904632568			
Formation End Depth:		8.229999542236328			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		30146637			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		02			
Material 1 Desc:		TOPSOIL			
Material 2:		81			
Material 2 Desc:		SANDY			
Material 3:		11			
Material 3 Desc:		GRAVEL			
Formation Top Depth:		0.0			
Formation End Depth:		0.9100000262260437			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		44001302			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:					
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		44001303			
Layer:		3			
Plug From:					
Plug To:					
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		44001304			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		25946637			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		29046637			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		42146637			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.880000114440918			
Casing Diameter:		3.809999942779541			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		43146637			
Layer:		1			
Slot:		10			
Screen Top Depth:		4.880000114440918			
Screen End Depth:		8.2299999542236328			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					
<u>Hole Diameter</u>					
Hole ID:		46000804			
Diameter:		8.890000343322754			
Depth From:		0.0			
Depth To:		8.2299999542236328			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>96</u>	1 of 1	NNE/207.0	76.9 / -0.93	154 O'CONNOR STREET Ottawa ON	WWIS
Well ID:	7130914			Flowing (Y/N):	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Test Hole			Date Received:	10/01/2009
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	M04512			Contractor:	1844
Tag:	A074637			Form Version:	5
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7130914.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		07/25/2009			
Year Completed:		2009			
Depth (m):					
Latitude:		45.4184813159654			
Longitude:		-75.6965029748894			
X:		-75.69650281301982			
Y:		45.41848130899689			
Path:		713\7130914.pdf			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7130914.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		07/25/2009			
Year Completed:		2009			
Depth (m):					
Latitude:		45.4182748476945			
Longitude:		-75.6964109677093			
X:		-75.69641080581984			
Y:		45.41827484126243			
Path:		713\7130914.pdf			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7130914.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		07/25/2009			
Year Completed:		2009			
Depth (m):		6.1			
Latitude:		45.4183986736524			
Longitude:		-75.6967703654323			
X:		-75.69677020277072			
Y:		45.41839866740095			
Path:		713\7130914.pdf			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7130914.pdf			
<u>Additional Detail(s) (Map)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Completed Date: 07/24/2009					
Year Completed: 2009					
Depth (m):					
Latitude: 45.4182463650946					
Longitude: -75.696653461001					
X: -75.69665329876628					
Y: 45.41824635803526					
Path: 713\7130914.pdf					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7130914.pdf					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 07/24/2009					
Year Completed: 2009					
Depth (m):					
Latitude: 45.4184908620674					
Longitude: -75.6964136232383					
X: -75.69641346122059					
Y: 45.41849085549298					
Path: 713\7130914.pdf					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7130914.pdf					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 07/25/2009					
Year Completed: 2009					
Depth (m):					
Latitude: 45.4181746720951					
Longitude: -75.6966014544894					
X: -75.69660129172455					
Y: 45.41817466498256					
Path: 713\7130914.pdf					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7130914.pdf					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 07/24/2009					
Year Completed: 2009					
Depth (m):					
Latitude: 45.4183812181676					
Longitude: -75.6966806818897					
X: -75.69668052039385					
Y: 45.41838121127087					
Path: 713\7130914.pdf					
<u>Bore Hole Information</u>					
Bore Hole ID:	1002832735	Elevation:			
DP2BR:		Elevrc:			
Spatial Status:		Zone: 18			
Code OB:		East83: 445513.00			
Code OB Desc:		North83: 5029653.00			
Open Hole:		Org CS: UTM83			
Cluster Kind:	This is a record from cluster log sheet	UTMRC: 3			
Date Completed:	07/25/2009	UTMRC Desc: margin of error : 10 - 30 m			
Remarks:		Location Method: wwr			
Location Method Desc:	on Water Well Record				
Elevrc Desc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002832739			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1002832738			
Method Construction Code:					
Method Construction:					
Other Method Construction:		GEOPROBE			
<u>Pipe Information</u>					
Pipe ID:		1002832740			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002832742			
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		3.799999952316284			
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1002832741			
Layer:					
Slot:					
Screen Top Depth:		3.799999952316284			
Screen End Depth:		6.800000190734863			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1002832743			
Pump Set At:					
Static Level:					
Final Level After Pumping:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Recommended Pump Depth: Pumping Rate: Flowing Rate: Recommended Pump Rate: Levels UOM: Rate UOM: Water State After Test Code: Water State After Test: Pumping Test Method: Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1002832737			
Diameter:		20.0			
Depth From:					
Depth To:		6.800000190734863			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:	1002832771			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445498.00
Code OB Desc:				North83:	5029642.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3
Date Completed:	07/25/2009			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1002832775			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1002832774			
Method Construction Code:					
Method Construction:					
Other Method Construction:		GEOPROBE			
<u>Pipe Information</u>					
Pipe ID:		1002832776			
Casing No:		0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002832778			
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		3.0			
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1002832777			
Layer:					
Slot:					
Screen Top Depth:		3.0			
Screen End Depth:		5.900000095367432			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1002832779			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1002832773			
Diameter:		20.0			
Depth From:					
Depth To:		5.900000095367432			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:	1002832753			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445494.00

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB Desc:				North83:	5029650.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3
Date Completed:	07/24/2009			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1002832757			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1002832756			
Method Construction Code:					
Method Construction:					
Other Method Construction:		GEOPROBE			
<u>Pipe Information</u>					
Pipe ID:		1002832758			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002832760			
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		3.0			
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1002832759			
Layer:					
Slot:					
Screen Top Depth:		3.0			
Screen End Depth:		6.099999904632568			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:	1002832761				
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:	1002832755				
Diameter:	20.0				
Depth From:					
Depth To:	6.099999904632568				
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
<u>Bore Hole Information</u>					
Bore Hole ID:	1002730412			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445485.00
Code OB Desc:				North83:	5029667.00
Open Hole:	No			Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	07/25/2009			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1002832795				
Layer:	5				
Color:	2				
General Color:	GREY				
Material 1:	05				
Material 1 Desc:	CLAY				
Material 2:	84				
Material 2 Desc:	SILTY				
Material 3:	28				
Material 3 Desc:	SAND				
Formation Top Depth:	1.5				
Formation End Depth:	4.800000190734863				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1002832791			
Layer:		1			
Color:					
General Color:					
Material 1:		27			
Material 1 Desc:		OTHER			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.10000000149011612			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1002832793			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		01			
Material 2 Desc:		FILL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.4000000059604645			
Formation End Depth:		0.5			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1002832796			
Layer:		6			
Color:		8			
General Color:		BLACK			
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		4.800000190734863			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1002832794			
Layer:		4			
Color:		6			
General Color:		BROWN			
Material 1:		05			
Material 1 Desc:		CLAY			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2:		01			
Material 2 Desc:		FILL			
Material 3:		81			
Material 3 Desc:		SANDY			
Formation Top Depth:		0.5			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1002832792			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		01			
Material 3 Desc:		FILL			
Formation Top Depth:		0.10000000149011612			
Formation End Depth:		0.4000000059604645			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1002832799			
Layer:		1			
Plug From:		0.10000000149011612			
Plug To:		2.4000000953674316			
Plug Depth UOM:		m			
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1002832802			
Method Construction Code:		H			
Method Construction:		Geoprobe			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1002832789			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Screen</u>					
Screen ID:		1002832800			
Layer:		1			
Slot:		10			
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		3.799999952316284			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1002832790			
Pump Set At:					
Static Level:		6.800000190734863			
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:					
Water State After Test Code:		0			
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1002832798			
Diameter:		10.0			
Depth From:		4.800000190734863			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1002832797			
Diameter:		20.0			
Depth From:		0.0			
Depth To:		4.800000190734863			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:	1002832744			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445513.00
Code OB Desc:				North83:	5029677.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3
Date Completed:	07/24/2009			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1002832748			
Layer:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From: Plug To: Plug Depth UOM:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:	1002832747				
Method Construction Code:					
Method Construction:					
Other Method Construction:	GEOPROBE				
<u>Pipe Information</u>					
Pipe ID:	1002832749				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1002832751				
Layer:					
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:					
Depth To:	3.0				
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:	m				
<u>Construction Record - Screen</u>					
Screen ID:	1002832750				
Layer:					
Slot:					
Screen Top Depth:	3.0				
Screen End Depth:	6.099999904632568				
Screen Material:					
Screen Depth UOM:	m				
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:	1002832752				
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1002832746			
Diameter:		20.0			
Depth From:					
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:	1002832762			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445492.00
Code OB Desc:				North83:	5029665.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3
Date Completed:	07/24/2009			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002832766			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1002832765			
Method Construction Code:					
Method Construction:					
Other Method Construction:		GEOPROBE			
<u>Pipe Information</u>					
Pipe ID:		1002832767			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002832769			
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		3.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:					
		m			
<u>Construction Record - Screen</u>					
Screen ID:					
		1002832768			
Layer:					
Slot:					
Screen Top Depth:					
		3.0			
Screen End Depth:					
		6.099999904632568			
Screen Material:					
Screen Depth UOM:					
		m			
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:					
		1002832770			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:					
		1002832764			
Diameter:					
		20.0			
Depth From:					
Depth To:					
		6.099999904632568			
Hole Depth UOM:					
		m			
Hole Diameter UOM:					
		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:					
		1002832780			
DP2BR:					
Spatial Status:					
Code OB:					
Code OB Desc:					
Open Hole:					
Cluster Kind:					
		This is a record from cluster log sheet			
Date Completed:					
		07/25/2009			
Remarks:					
Location Method Desc:					
		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Elevation:					
Elevrc:					
Zone:					
		18			
East83:					
		445506.00			
North83:					
		5029676.00			
Org CS:					
		UTM83			
UTMRC:					
		3			
UTMRC Desc:					
		margin of error : 10 - 30 m			
Location Method:					
		www			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002832784			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1002832783			
Method Construction Code:					
Method Construction:					
Other Method Construction:		GEOPROBE			
<u>Pipe Information</u>					
Pipe ID:		1002832785			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002832787			
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		3.700000047683716			
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1002832786			
Layer:					
Slot:					
Screen Top Depth:		3.700000047683716			
Screen End Depth:		6.699999809265137			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1002832788			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Levels UOM: Rate UOM: Water State After Test Code: Water State After Test: Pumping Test Method: Pumping Duration HR: Pumping Duration MIN: Flowing:					
Hole Diameter					
Hole ID:		1002832782			
Diameter:		20.0			
Depth From:					
Depth To:		6.699999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

97	1 of 1	E/210.2	75.9 / -1.93	311 SOMERSET Ottawa ON	WWIS
Well ID:		7391114		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Monitoring and Test Hole		Date Received:	
Water Type:				06/29/2021	
Casing Material:				Selected Flag:	
Audit No:		Z364138		TRUE	
Tag:		A302951		Abandonment Rec:	
Constructn Method:				Contractor:	
Elevation (m):				7241	
Elevatn Reliabilty:				Form Version:	
Depth to Bedrock:				7	
Well Depth:				Owner:	
Overburden/Bedrock:				County:	
Pump Rate:				OTTAWA-CARLETON	
Static Water Level:				Lot:	
Clear/Cloudy:				Concession:	
Municipality:		OTTAWA CITY		Concession Name:	
Site Info:				Easting NAD83:	
				Northing NAD83:	
				Zone:	
				UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/739\7391114.pdf			

Additional Detail(s) (Map)

Well Completed Date:		05/25/2021			
Year Completed:		2021			
Depth (m):					
Latitude:		45.4164743671495			
Longitude:		-75.6949701625181			
X:		-75.69497000126127			
Y:		45.41647436047882			
Path:		739\7391114.pdf			

Bore Hole Information

Bore Hole ID:		1008704352		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				18	
Code OB Desc:				East83:	
				445624.00	
				North83:	
				5029452.00	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed: 05/25/2021				UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc: on Water Well Record					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:				1009852403	
Layer:				3	
Color:				6	
General Color:				BROWN	
Material 1:				05	
Material 1 Desc:				CLAY	
Material 2:				28	
Material 2 Desc:				SAND	
Material 3:				85	
Material 3 Desc:				SOFT	
Formation Top Depth:				2.130000114440918	
Formation End Depth:				3.6600000858306885	
Formation End Depth UOM:				m	
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:				1009852404	
Layer:				4	
Color:				2	
General Color:				GREY	
Material 1:				05	
Material 1 Desc:				CLAY	
Material 2:				06	
Material 2 Desc:				SILT	
Material 3:				85	
Material 3 Desc:				SOFT	
Formation Top Depth:				3.6600000858306885	
Formation End Depth:				10.359999656677246	
Formation End Depth UOM:				m	
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:				1009852405	
Layer:				5	
Color:				2	
General Color:				GREY	
Material 1:				06	
Material 1 Desc:				SILT	
Material 2:				11	
Material 2 Desc:				GRAVEL	
Material 3:				66	
Material 3 Desc:				DENSE	
Formation Top Depth:				10.359999656677246	
Formation End Depth:				14.329999923706055	
Formation End Depth UOM:				m	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1009852402			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		2.130000114440918			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1009852401			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		02			
Material 1 Desc:		TOPSOIL			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009853461			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009853462			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		10.970000267028809			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009853463			
Layer:		3			
Plug From:		10.970000267028809			
Plug To:		14.329999923706055			
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Method of Construction & Well Use</u>					
Method Construction ID:	1009854839				
Method Construction Code:	5				
Method Construction:	Air Percussion				
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:	1009764984				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1009855217				
Layer:	1				
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:	0.0				
Depth To:	11.279999732971191				
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:	m				
<u>Construction Record - Screen</u>					
Screen ID:	1009855613				
Layer:	1				
Slot:	10				
Screen Top Depth:	11.279999732971191				
Screen End Depth:	14.329999923706055				
Screen Material:	5				
Screen Depth UOM:	m				
Screen Diameter UOM:	cm				
Screen Diameter:	6.03000020980835				
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:	1009856077				
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:	m				
Rate UOM:	LPM				
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:	0				
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:	No				
<u>Hole Diameter</u>					
Hole ID:	1009854398				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		2.130000114440918			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
98	1 of 1	E/217.6	75.9 / -1.93	311 SOMERSET Ottawa ON	WWIS
Well ID:		7391113		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Monitoring and Test Hole		Date Received: 06/29/2021	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No:		Z364081		Contractor: 7241	
Tag:		A302973		Form Version: 7	
Constructn Method:				Owner:	
Elevation (m):				County: OTTAWA-CARLETON	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/739\7391113.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		05/26/2021			
Year Completed:		2021			
Depth (m):					
Latitude:		45.4162588191639			
Longitude:		-75.6948908336928			
X:		-75.69489067198141			
Y:		45.416258812091236			
Path:		739\7391113.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1008704349		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone: 18	
Code OB:				East83: 445630.00	
Code OB Desc:				North83: 5029428.00	
Open Hole:				Org CS: UTM83	
Cluster Kind:				UTMRC: 4	
Date Completed:		05/26/2021		UTMRC Desc: margin of error : 30 m - 100 m	
Remarks:				Location Method: wwr	
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1009852399			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		3.6600000858306885			
Formation End Depth:		11.279999732971191			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1009852400			
Layer:		5			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		11.279999732971191			
Formation End Depth:		13.100000381469727			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1009852396			
Layer:		1			
Color:		2			
General Color:		GREY			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1009852398			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		85			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3 Desc:		SOFT			
Formation Top Depth:		2.440000057220459			
Formation End Depth:		3.6600000858306885			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1009852397			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		2.440000057220459			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009853458			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009853460			
Layer:		3			
Plug From:		9.75			
Plug To:		13.100000381469727			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009853459			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		9.75			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1009854838			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1009764983			
Casing No:		0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Comment: Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1009855216			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		10.050000190734863			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1009855612			
Layer:		1			
Slot:		10			
Screen Top Depth:		10.050000190734863			
Screen End Depth:		13.100000381469727			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1009856076			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:		No			
<u>Hole Diameter</u>					
Hole ID:		1009854397			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		13.100000381469727			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
99	1 of 1	S/218.4	77.9 / 0.07	429 MC LEARN Ottawa ON	WWIS
Well ID:	7233874			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	

268 erisinfo.com | Environmental Risk Information Services Order No: 25011400345

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation Top Depth:		1.2200000286102295			
Formation End Depth:		3.0999999046325684			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1005436483			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		4.880000114440918			
Formation End Depth:		5.099999904632568			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1005436482			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		84			
Material 2 Desc:		SILTY			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		3.0999999046325684			
Formation End Depth:		4.880000114440918			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1005436480			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		28			
Material 3 Desc:		SAND			
Formation Top Depth:		0.0			
Formation End Depth:		1.2200000286102295			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1005436491			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005436492			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005436493			
Layer:		3			
Plug From:		2.740000009536743			
Plug To:		6.099999904632568			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005436490			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005436479			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005436486			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005436487			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		6.099999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water ID:		1005436485			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1005436484			
Diameter:		15.319999694824219			
Depth From:		0.0			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
100	1 of 1	SW/219.0	78.9 / 1.07	290-292 Kent Street UTM Zone:18 Easting: 445333.64 Northing:5029231.41 Ottawa ON	SPL
Ref No:	4021-AWFPQL			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	2018/03/01			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	2018/03/01			Impact to Health:	2 - Minor Environment
Dt Document Closed:				Agency Involved:	
Site No:	NA				
MOE Response:	No				
Site County/District:					
Site Geo Ref Meth:					
Site District Office:	Ottawa				
Nearest Watercourse:					
Site Name:	drain/ CB<UNOFFICIAL>				
Site Address:	290-292 Kent Street UTM Zone:18 Easting:445333.64 Northing:5029231.41				
Site Region:	Eastern				
Site Municipality:	Ottawa				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:					
Client Type:					
Source Type:	Unknown / N/A				
Incident Cause:					
Incident Preceding Spill:	Dumping				
Incident Reason:	Deliberate Act				
Incident Summary:	City of Ottawa: cooking grease to drive, walk, CB				
Environment Impact:					
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:	0 other - see incident description				
Contaminant Qty 1:	0				
Contaminant Unit:	other - see incident description				
Contaminant Code:	46				
Contaminant Name:	COOKING GREASE				
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:	n/a				
Receiving Medium:	Land; Surface Water; Source Water Zone				
Activity Preceding Spill:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Unknown / N/A SAC Action Class: Land Spills Call Report Locatn Geodata: Time Reported: System Facility Address:					
101	1 of 1	E/219.4	75.9 / -1.93	311 Somerset St W Ottawa ON	WWIS
Well ID: 7382859 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z343100 Tag: A302968 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 03/17/2021 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
Additional Detail(s) (Map)					
Bore Hole ID: 1008639565 Depth M: Year Completed: 2021 Well Completed Dt: 02/19/2021 Audit No: Z343100 Path:					
Tag No: A302968 Contractor: 7241 Latitude: 45.4165650729785 Longitude: -75.6948562475249 Y: 45.41656506610067 X: -75.69485608593011					
Bore Hole Information					
Bore Hole ID: 1008639565 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 02/19/2021 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Elevation: Elevrc: Zone: 18 East83: 445633.00 North83: 5029462.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
Overburden and Bedrock					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:		1009823647			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		4.0			
Formation End Depth:		10.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1009823645			
Layer:		1			
Color:		2			
General Color:		GREY			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:					
Material 2 Desc:					
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		2.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1009823646			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:					
Material 2 Desc:					
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		2.0			
Formation End Depth:		4.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1009823648			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation Top Depth:		10.0			
Formation End Depth:		22.5			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009824853			
Layer:		3			
Plug From:		11.5			
Plug To:		22.5			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009824851			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009824852			
Layer:		2			
Plug From:		1.0			
Plug To:		11.5			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1009826151			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1009718441			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1009826572			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		12.5			
Casing Diameter:		2.046999931335449			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen ID: 1009826983 Layer: 1 Slot: 10 Screen Top Depth: 12.5 Screen End Depth: 22.5 Screen Material: 5 Screen Depth UOM: m Screen Diameter UOM: cm Screen Diameter: 2.369999885559082					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc: Pump Test ID: 1009827398 Pump Set At: Static Level: Final Level After Pumping: Recommended Pump Depth: Pumping Rate: Flowing Rate: Recommended Pump Rate: Levels UOM: m Rate UOM: LPM Water State After Test Code: Water State After Test: Pumping Test Method: 0 Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID: 1009825711 Diameter: 4.5 Depth From: 0.0 Depth To: 22.5 Hole Depth UOM: m Hole Diameter UOM: cm					
102	1 of 1	NE/220.8	76.9 / -0.93	172 O'Connor Ottawa ON K2P 1T5	EHS
Order No: 20080327001 Status: C Report Type: Complete Report Report Date: 4/4/2008 Date Received: 3/27/2008 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps And /or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -75.69635 Y: 45.418209					
103	1 of 2	SE/221.6	76.9 / -0.87	FOSTER SPORT CENTER 305 BANK STREET OTTAWA ON K2P 1X7	GEN
<u>Generator Info</u>					
Generator No: ON1098700 Approval Years: 88,89,90 Status:					
Choice of Contact: Contaminated Fac: MHSW Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No: Country: Co Admin: Phone No Admin: SIC Description:					
		BICYCLE SHOPS		SIC Code: 6542	
<u>Waste Detail(s)</u>					
		213		Waste Class:	
		PETROLEUM DISTILLATES		Waste Class Name:	
103	2 of 2	SE/221.6	76.9 / -0.87	FOSTER SPORT CENTER 15-418 305 BANK STREET OTTAWA ON K2P 1X7	GEN
<u>Generator Info</u>					
Generator No:	ON1098700			Choice of Contact:	
Approval Years:	92,93,94,95,96,97,98			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 6542	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	BICYCLE SHOPS				
<u>Waste Detail(s)</u>					
		213		Waste Class:	
		PETROLEUM DISTILLATES		Waste Class Name:	
104	1 of 2	N/222.5	77.9 / 0.07	BLACK PHOTO(OUT OF BUS.) 181 BANK STREET, UNITS 121-122 L'ESPLANADE OTTAWA ON K2P 1W5	GEN
<u>Generator Info</u>					
Generator No:	ON1338155			Choice of Contact:	
Approval Years:	97,98			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 6571	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	CAMERA/PHOTO. SUPPLY				
<u>Waste Detail(s)</u>					
		264		Waste Class:	
		PHOTOPROCESSING WASTES		Waste Class Name:	
104	2 of 2	N/222.5	77.9 / 0.07	BLACK PHOTO CORPORATION 171-181 BANK STREET, UNITS 121-122 OTTAWA ON K2P 1W5	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON1338160			Choice of Contact:	
Approval Years:	97,98,99,00,01			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	6571
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		CAMERA/PHOTO. SUPPLY			
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			

105	1 of 1	SSE/222.5	77.9 / 0.07	PSL Mechanical 415 McLaren St Ottawa ON K2P 2C8	GEN

Generator Info

Generator No:	ON7631710	Choice of Contact:	
Approval Years:	As of Dec 2018	Contaminated Fac:	
Status:	Registered	MHSW Facility:	
PO Box No:		SIC Code:	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	212 L
Waste Class Name:	Aliphatic solvents and residues

2018 Generator Info

Gen No:	ON7631710	Choice of Contact:	CO_OFFICIAL
ID:	30405	Phone No Official:	613-240-2795 Ext.
Contaminated Fac:	N	Phone No Admin:	
MHSW Facility:	N	County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	238220	County Out:	
NAICS Code2:		District:	402
NAICS Code3:			
Gen Name:	PSL Mechanical		
Gen Div:			
Gen Op Name:	PSL Mechanical		
Gen Op Div:			
Site Adrs1:	415 McLaren St		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K2P 2C8		
Site Country:	Canada		
Co Official:	Eric Eric		
Co Admin:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2018 Generator Manifest</u>					
ID:	56888			Sum Received Qty:	780.0
Generator No:	ON7631710			Waste Class Name:	ALIPHATIC SOLVENTS
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	402
Waste Code:	212				
106	1 of 5	ESE/224.5	75.9 / -1.93	CDIA Report Newsletter 338 Somerset St W Unit 4 Ottawa ON K2P 0J9	SCT
Established:					
Plant Size (ft²):					
Employment:	3				
--Details--					
Description:		Periodical Publishers			
SIC/NAICS Code:		511120			
106	2 of 5	ESE/224.5	75.9 / -1.93	Enbridge Gas Distribution Inc. 338 Sommerset West Ottawa ON	SPL
Ref No:	5203-7QJJV4			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:				Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	3/27/2009			Impact to Health:	
Dt Document Closed:				Agency Involved:	
Site No:					
MOE Response:					
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					
Site Name:	Vespa<UNOFFICIAL>				
Site Address:					
Site Region:					
Site Municipality:	Ottawa				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:	Enbridge Gas Distribution Inc.				
Client Type:					
Source Type:					
Incident Cause:	Other Transport Accident				
Incident Preceding Spill:					
Incident Reason:	Error- Operator error				
Incident Summary:	Enbridge, Regulator strike, Evac, rd closed, safe				
Environment Impact:	Confirmed				
Health Env Consequence:					
Nature of Impact:	Air Pollution; Human Health/Safety				
Contaminant Qty:					
Contaminant Qty 1:					
Contaminant Unit:	other - see incident description				
Contaminant Code:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:		NATURAL GAS (METHANE) Pipeline Air Spills - Gases and Vapours			
106	3 of 5	ESE/224.5	75.9 / -1.93	whatif? Technologies Inc. 338 Somerset St W Unit 3 Ottawa ON K2P 0J9	SCT
Established: Plant Size (ft²): Employment:		01-AUG-89 1500			
--Details--					
Description: SIC/NAICS Code:		Computer Systems Design and Related Services 541510			
Description: SIC/NAICS Code:		Software Publishers 511210			
106	4 of 5	ESE/224.5	75.9 / -1.93	338 SOMERSET STREET WEST OTTAWA ON	HINC
External File Num: Fuel Occurrence Type: Date of Occurrence: Fuel Type Involved: Status Desc: Job Type Desc: Oper. Type Involved: Service Interruptions: Property Damage: Fuel Life Cycle Stage: Root Cause: Reported Details: Fuel Category: Occurrence Type: Affiliation: County Name: Approx. Quant. Rel: Nearby body of water: Enter Drainage Syst.: Approx. Quant. Unit: Environmental Impact:		FS INC 0903-01589 Vapour Release 3/27/2009 Natural Gas Completed - No Action Required Incident/Near-Miss Occurrence (FS) Commercial (e.g. restaurant, business unit, etc) No No Utilization Service riser damage due to mechanical impact. Gaseous Fuel Incident Industry Stakeholder (Licensee/Registration/Certificate Holder, Facility Owner, etc.) Ottawa			
106	5 of 5	ESE/224.5	75.9 / -1.93	338 Somerset Street West Ottawa Ontario Ottawa ON K2P 0J9	EHS
Order No: Status: Report Type:		20191203166 C Standard Report		Nearest Intersection: Municipality: Client Prov/State:	
				ON	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Report Date: 06-DEC-19 Search Radius (km): .25 Date Received: 03-DEC-19 X: -75.695144 Previous Site Name: Y: 45.415602 Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
107	1 of 19	WNW/224.8	76.9 / -0.93	QUADRELLE MANAGEMENT LTD. 340 LAURIER AVENUE WEST OTTAWA ON K1A 0P9	CA
Certificate #: 8-4113-98- Application Year: 98 Issue Date: 8/27/1998 Approval Type: Industrial air Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: 350 KW EMERGENCY GENERATOR Contaminants: Emission Control:					
107	2 of 19	WNW/224.8	76.9 / -0.93	PRIVATE BUSINESS 340 LAURIER AVE (N.O.S.) OTTAWA CITY ON	SPL
Ref No: 243533 Municipality No: 20107 Year: Nature of Damage: Incident Dt: 10/29/2002 Discharger Report: Dt MOE Arvl on Scn: Material Group: MOE Reported Dt: 10/29/2002 Impact to Health: Dt Document Closed: Agency Involved: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: OTTAWA CITY Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: PIPE/HOSE LEAK Incident Preceding Spill: Incident Reason: ERROR Incident Summary: ONLY ENTERPRISE: 1800 L ETHYLENE GLYCOL TO PROPERTY AND SEWER. Environment Impact: POSSIBLE Health Env Consequence: Nature of Impact: Multi Media Pollution Contaminant Qty:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: LAND, WATER Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:					
107	3 of 19	WNW/224.8	76.9 / -0.93	JER OTTAWA ULC 340 LAURIER AVENUE WEST OTTAWA ON K1A 0P9	GEN
<u>Generator Info</u>					
Generator No:	ON0383914			Choice of Contact:	
Approval Years:	01			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	9999
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	OTHER SERVICES				
<u>Waste Detail(s)</u>					
Waste Class:	213				
Waste Class Name:	PETROLEUM DISTILLATES				
<u>Waste Detail(s)</u>					
Waste Class:	242				
Waste Class Name:	HALOGENATED PESTICIDES				
<u>Waste Detail(s)</u>					
Waste Class:	252				
Waste Class Name:	WASTE OILS & LUBRICANTS				
<u>Waste Detail(s)</u>					
Waste Class:	263				
Waste Class Name:	ORGANIC LABORATORY CHEMICALS				
<u>Waste Detail(s)</u>					
Waste Class:	145				
Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		222			
Waste Class Name:		HEAVY FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		266			
Waste Class Name:		PHENOLIC WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			

[107](#)

4 of 19

WNW/224.8

76.9 / -0.93

JER OTTAWA ULC
340 LAURIER AVENUE WEST SIR WILFRID
LAURIER BUILDING
OTTAWA ON K1A 0P9

GEN

Generator Info

Generator No: ON0383914
Approval Years: 02,03,04
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class: 264
Waste Class Name: PHOTOPROCESSING WASTES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		266			
Waste Class Name:		PHENOLIC WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		222			
Waste Class Name:		HEAVY FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		242			
Waste Class Name:		HALOGENATED PESTICIDES			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
107	5 of 19	WNW/224.8	76.9 / -0.93	OTTAWA 340 LAURIER AVENUE WEST INC. 340 LAURIER AVENUE WEST OTTAWA ON K1A 0P9	GEN

Generator Info

Generator No:	ON4067296	Choice of Contact:	
Approval Years:	04,05	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	541611
Country:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Co Admin: Phone No Admin: SIC Description: Administrative Management and General Management Consulting Services					
<u>Waste Detail(s)</u>					
Waste Class: 213 Waste Class Name: PETROLEUM DISTILLATES					
<u>Waste Detail(s)</u>					
Waste Class: 252 Waste Class Name: WASTE OILS & LUBRICANTS					
<u>Waste Detail(s)</u>					
Waste Class: 263 Waste Class Name: ORGANIC LABORATORY CHEMICALS					
<u>Waste Detail(s)</u>					
Waste Class: 331 Waste Class Name: WASTE COMPRESSED GASES					
<u>Waste Detail(s)</u>					
Waste Class: 145 Waste Class Name: PAINT/PIGMENT/COATING RESIDUES					
<u>Waste Detail(s)</u>					
Waste Class: 212 Waste Class Name: ALIPHATIC SOLVENTS					

107	6 of 19	WNW/224.8	76.9 / -0.93	Public Works and Government Services Canada 340 Laurier Street Ottawa ON K1P 5K3	GEN

Generator Info

Generator No:	ON9217037	Choice of Contact:	
Approval Years:	04,05,06	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	562990
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	All Other Waste Management Services		

Waste Detail(s)

Waste Class: 112
Waste Class Name: ACID WASTE - HEAVY METALS

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:	121				
Waste Class Name:	ALKALINE WASTES - HEAVY METALS				
 <u>Waste Detail(s)</u>					
Waste Class:	146				
Waste Class Name:	OTHER SPECIFIED INORGANICS				
 <u>Waste Detail(s)</u>					
Waste Class:	212				
Waste Class Name:	ALIPHATIC SOLVENTS				
107	7 of 19	WNW/224.8	76.9 / -0.93	340 Laurier Avenue West Ottawa ON K1A 0P9	EHS
Order No:	20100713013			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	7/21/2010			Search Radius (km):	0.25
Date Received:	7/13/2010			X:	-75.699767
Previous Site Name:				Y:	45.417867
Lot/Building Size:					
Additional Info Ordered:					
107	8 of 19	WNW/224.8	76.9 / -0.93	340 Laurier Avenue Ottawa ON	EHS
Order No:	20101012037			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	ON
Report Date:	10/19/2010			Search Radius (km):	0.25
Date Received:	10/12/2010 3:43:56 PM			X:	-75.699927
Previous Site Name:				Y:	45.418037
Lot/Building Size:					
Additional Info Ordered:					
107	9 of 19	WNW/224.8	76.9 / -0.93	Public Works and Government Services Canada 340 Laurier Street Ottawa ON	GEN
 <u>Generator Info</u>					
Generator No:	ON9217037			Choice of Contact:	
Approval Years:	2009			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	562990
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	All Other Waste Management Services				
 <u>Waste Detail(s)</u>					
Waste Class:	112				
Waste Class Name:	ACID WASTE - HEAVY METALS				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:	121				
Waste Class Name:	ALKALINE WASTES - HEAVY METALS				
<u>Waste Detail(s)</u>					
Waste Class:	146				
Waste Class Name:	OTHER SPECIFIED INORGANICS				
<u>Waste Detail(s)</u>					
Waste Class:	212				
Waste Class Name:	ALIPHATIC SOLVENTS				
107	10 of 19	WNW/224.8	76.9 / -0.93	OTTAWA - 340 LAURIER WEST INC 340 LAURIER AVENUE WEST OTTAWA ON K1N 0P9	EASR
Approval No:	R-003-9302648588			MOE District:	
Status:	REGISTERED			Municipality:	OTTAWA
Date:	2013-01-30			Latitude:	
Record Type:	EASR			Longitude:	
Link Source:	MOFA			Geometry X:	
Project Type:	Heating System			Geometry Y:	
Full Address:					
Approval Type:	EASR-Heating System				
SWP Area Name:					
PDF NAICS Code:					
PDF URL:					
PDF Site Location:					
107	11 of 19	WNW/224.8	76.9 / -0.93	O&Y ENTERPRISE 340 LAURIER Avenue West OTTAWA ON K1A0P8	NPRI
NPRI ID:	8800001959			Org ID:	
Other ID:				Submit Date:	
No Other ID:				Last Modified:	
Track ID:				Contact ID:	
Report ID:				Cont Type:	MED
Report Type:				Contact Title:	Mr.
Rpt Type ID:				Cont First Name:	DAVID
Report Year:	2004			Cont Last Name:	CORDICK
Not-Current Rpt?:				Contact Position:	Property Manager
Yr of Last Filed Rpt:				Contact Fax:	
Fac ID:				Contact Ph.:	
Fac Name:	340 LAURIER AVE. WEST			Cont Area Code:	613
Fac Address1:				Contact Tel.:	7830917
Fac Address2:				Contact Ext.:	
Fac Postal Zip:				Cont Fax Area Cde:	613
Facility Lat:				Contact Fax:	2346581
Facility Long:				Contact Email:	dcordick@oyp.com
DLS (Last Filed Rpt):				Latitude:	
Facility DLS:				Longitude:	
Datum:				UTM Zone:	
Facility Cmnts:				UTM Northing:	
URL:				UTM Easting:	
No of Empl.:	1			Waste Streams:	
Parent Co.:				No Streams:	
No Parent Co.:				Waste Off Sites:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pollut Prev Cmnts: Stacks: No of Stacks: Canadian SIC Code (2 digit): Canadian SIC Code: SIC Code Description: American SIC Code: NAICS Code (2 digit): NAICS 2 Description: NAICS Code (4 digit): NAICS 4 Description: NAICS Code (6 digit): NAICS 6 Description:				No Off Sites: Shutdown: No of Shutdown:	
		53			
		Real Estate and Rental and Leasing			
		5311			
		Lessors of Real Estate			
		531120			
		Lessors of Non-Residential Buildings (except Mini-Warehouses)			
<u>Substance Release Report</u>					
CAS No:		11104-93-1			
Report ID:					
Rpt Period:		2004			
Subst Released:		Nitrogen oxides (expressed as NO2)			
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
CAS No:		811-97-2			
Report ID:					
Rpt Period:		2004			
Subst Released:		HFC-134a Hydrofluorocarbon			
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
CAS No:		7446-09-5			
Report ID:					
Rpt Period:		2004			
Subst Released:		Sulphur dioxide			
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
107	12 of 19	WNW/224.8	76.9 / -0.93	OTTAWA - 340 LAURIER WEST INC 340 LAURIER AVENUE WEST OTTAWA ON K1N 0P9	EASR
Approval No:		R-003-9302648588	MOE District:		
Status:		REGISTERED	Municipality:		OTTAWA
Date:		2013-01-30	Latitude:		
Record Type:		EASR	Longitude:		
Link Source:		MOFA	Geometry X:		
Project Type:		Heating System	Geometry Y:		
Full Address:					
Approval Type:		EASR-Heating System			
SWP Area Name:					
PDF NAICS Code:					
PDF URL:					
PDF Site Location:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
107	13 of 19	WNW/224.8	76.9 / -0.93	Starlight Investments 340 Laurier Ave West Ottawa ON K1A 0P9	GEN

Generator Info

Generator No:	ON5301151	Choice of Contact:	CO_OFFICIAL
Approval Years:	2016	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	238220
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:	PLUMBING, HEATING AND AIR-CONDITIONING CONTRACTORS		

Waste Detail(s)

Waste Class:	212
Waste Class Name:	ALIPHATIC SOLVENTS

2017 Generator Info

Gen No:	ON5301151	Choice of Contact:	CO_OFFICIAL
ID:	20988	Phone No Official:	613-913-0141 Ext.
Contaminated Fac:	N	Phone No Admin:	
MHSW Facility:	N	County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	238220	County Out:	
NAICS Code2:		District:	402
NAICS Code3:			
Gen Name:	Starlight Investments		
Gen Div:			
Gen Op Name:	Starlight Investments		
Gen Op Div:			
Site Adrs1:	340 Laurier Ave West		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K1A 0P9		
Site Country:	Canada		
Co Official:	Geof Gainsford		
Co Admin:			

2017 Generator Manifest

ID:	45429	Sum Received Qty:	8256.0
Generator No:	ON5301151	Waste Class Name:	ALIPHATIC SOLVENTS
Receiver Type:	035	Count Manifests:	1
Waste Char:	L	District:	402
Waste Code:	212		

107	14 of 19	WNW/224.8	76.9 / -0.93	TNC 340 Laurier Ltd. 340 Laurier Ave West ottawa ON K1A 0P8	GEN

Generator Info

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON8056777 Approval Years: 2016 Status: PO Box No: Country: Canada Co Admin: Shane Paulin Phone No Admin: 613 274 3742 Ext.224 SIC Description: REAL ESTATE PROPERTY MANAGERS Choice of Contact: CO_ADMIN Contaminated Fac: No MHSW Facility: No SIC Code: 531310					
<u>Waste Detail(s)</u>					
Waste Class: 251 Waste Class Name: OIL SKIMMINGS & SLUDGES					
107	15 of 19	WNW/224.8	76.9 / -0.93	TNC 340 Laurier Ltd 340 Laurier Ottawa ON K1A 0P9	GEN
<u>Generator Info</u>					
Generator No: ON2961230 Approval Years: 2014 Status: PO Box No: Country: Canada Co Admin: Kevin Spirak Phone No Admin: 6132743742 Ext.224 SIC Description: REAL ESTATE PROPERTY MANAGERS Choice of Contact: CO_OFFICIAL Contaminated Fac: No MHSW Facility: No SIC Code: 531310					
<u>Waste Detail(s)</u>					
Waste Class: 148 Waste Class Name: INORGANIC LABORATORY CHEMICALS					
<u>Waste Detail(s)</u>					
Waste Class: 135 Waste Class Name: REACTIVE ANION WASTES					
<u>Waste Detail(s)</u>					
Waste Class: 122 Waste Class Name: ALKALINE WASTES - OTHER METALS					
<u>Waste Detail(s)</u>					
Waste Class: 212 Waste Class Name: ALIPHATIC SOLVENTS					
<u>Waste Detail(s)</u>					
Waste Class: 211 Waste Class Name: AROMATIC SOLVENTS					
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
Waste Detail(s)					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
107	16 of 19	WNW/224.8	76.9 / -0.93	Epic Realty Partners 340 Laurier Ave. Ottawa ON K1P 5K3	GEN
Generator Info					
Generator No:		ON6191200		Choice of Contact:	CO_OFFICIAL
Approval Years:		2014		Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	521310
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:		521310			
Waste Detail(s)					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
107	17 of 19	WNW/224.8	76.9 / -0.93	Demo Core 340 Laurier Ave. Ottawa ON K1A 0P9	GEN
Generator Info					
Generator No:		ON8037772		Choice of Contact:	
Approval Years:		As of Nov 2021		Contaminated Fac:	
Status:		Registered		MHSW Facility:	
PO Box No:				SIC Code:	
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:					
Waste Detail(s)					
Waste Class:		243 D			
Waste Class Name:		PCB			
Waste Detail(s)					
Waste Class:		212 L			
Waste Class Name:		Aliphatic solvents and residues			
Waste Detail(s)					
Waste Class:		145 L			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
<u>2020 Generator Info</u>					
Gen No:	ON8037772			Choice of Contact:	CO_OFFICIAL
ID:	32097			Phone No Official:	613-806-1871 Ext.
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	562990			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	Demo Core				
Gen Div:					
Gen Op Name:	Demo Core				
Gen Op Div:					
Site Adrs1:	340 Laurier Ave.				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K1A 0P9				
Site Country:	Canada				
Co Official:	Richard Lovering				
Co Admin:					
<u>2020 Generator Manifest</u>					
ID:	55217			Sum Received Qty:	1000.0
Generator No:	ON8037772			Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	402
Waste Code:	145				
<u>2020 Generator Manifest</u>					
ID:	55218			Sum Received Qty:	4200.0
Generator No:	ON8037772			Waste Class Name:	ALIPHATIC SOLVENTS
Receiver Type:	035			Count Manifests:	2
Waste Char:	L			District:	402
Waste Code:	212				
<u>2021 Generator Info</u>					
Gen No:	ON8037772			Choice of Contact:	CO_OFFICIAL
ID:	32835			Phone No Official:	613-806-1871 Ext.
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	562990			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	Demo Core				
Gen Div:					
Gen Op Name:	Demo Core				
Gen Op Div:					
Site Adrs1:	340 Laurier Ave.				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Ottawa				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Province Out: Site Postal Code: K1A 0P9 Site Country: Canada Co Official: Richard Lovering Co Admin:					
107	18 of 19	WNW/224.8	76.9 / -0.93	340 TNC Laurier Ltd. 340 Laurier Avenue Ottawa ON K1A 0P9	GEN
Generator Info Generator No: ON5707800 Approval Years: As of Nov 2021 Status: Registered PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description: Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
Waste Detail(s) Waste Class: 212 L Waste Class Name: Aliphatic solvents and residues					
107	19 of 19	WNW/224.8	76.9 / -0.93	340 TNC Laurier Ltd. 340 Laurier Avenue Ottawa ON K1A 0P9	GEN
Generator Info Generator No: ON5707800 Approval Years: As of Oct 2022 Status: Registered PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description: Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
Waste Detail(s) Waste Class: 212 L Waste Class Name: ALIPHATIC SOLVENTS					
2021 Generator Info Gen No: ON5707800 ID: 22859 Contaminated Fac: N MHSW Facility: N NAICS Code1: 531310 NAICS Code2: NAICS Code3: Gen Name: 340 TNC Laurier Ltd. Gen Div: Gen Op Name: 340 TNC Laurier Ltd. Choice of Contact: Phone No Official: 613-553-9967 Ext. Phone No Admin: County Ont: OTTAWA CARLTON (RM) County Out: District: 402					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gen Op Div: Site Adrs1: 340 Laurier Avenue Site Bldg: Site Pobox: Province In: ONTARIO Site Adrs2: Site City: Ottawa Province Out: Site Postal Code: K1A 0P9 Site Country: Canada Co Official: Kerrie Kossatz Co Admin:					
<u>2021 Generator Manifest</u>					
ID:	45234			Sum Received Qty:	21790.0
Generator No:	ON5707800			Waste Class Name:	ALIPHATIC SOLVENTS
Receiver Type:	035			Count Manifests:	3
Waste Char:	L			District:	402
Waste Code:	212				
<u>108</u>	1 of 1	NNE/225.7	76.9 / -0.93	DARLING INTERNATIONAL CANADA INC.	SPL
OTTAWA ON					
Ref No:	1-8BVEOL			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	Jun 27,2024 03:00:00 PM			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	Jun 28,2024 08:08:54 AM			Impact to Health:	
Dt Document Closed:				Agency Involved:	
Site No:					
MOE Response:	Desktop Response				
Site County/District:					
Site Geo Ref Meth:					
Site District Office:	Ottawa District Office				
Nearest Watercourse:					
Site Name:					
Site Address:					
Site Region:					
Site Municipality:	OTTAWA				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:	DARLING INTERNATIONAL CANADA INC.				
Client Type:	Private Business				
Source Type:	Truck - Transport/Hauling				
Incident Cause:					
Incident Preceding Spill:	Leak/Break				
Incident Reason:	Human error (Specify)				
Incident Summary:	Darling International: 185 kg cooking oil to road way, cleaned				
Environment Impact:					
Health Env Consequence:	Low				
Nature of Impact:					
Contaminant Qty:	180 kilogram (kg)				
Contaminant Qty 1:					
Contaminant Unit:					
Contaminant Code:					
Contaminant Name:	COOKING OIL				
Contaminant Limit 1:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Transportation Property 2nd Watershed: Lower Ottawa Property Tertiary Watershed: 02KF - Central Ottawa - Mississippi Sector Type: RENDERING AND MEAT PROCESSING FROM CARCASSES SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00003890365"],"wkts":["POINT (-75.6967322000 45.4183908000)"],"creation_date":"2024-06-28"} Time Reported: System Facility Address:					
109	1 of 1	NE/225.9	76.6 / -1.21	OTTAWA CITY - SOMERSET ST. O'CONNOR ST./NEPEAN ST. OTTAWA CITY ON	CA
Certificate #: 3-0495-92- Application Year: 92 Issue Date: 5/12/1992 Approval Type: Municipal sewage Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
110	1 of 1	E/226.5	75.9 / -1.93	311 Somerset Street West Ottawa ON K2P 0J8	EHS
Order No: 21011400150 Status: C Report Type: Custom Report Report Date: 22-JAN-21 Date Received: 14-JAN-21 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.6947834 Y: 45.4162153					
111	1 of 9	NNW/227.7	77.9 / 0.07	OLYMPIA & YORK DEVELOPMENTS LTD. L'ESPLANADE LAURIER; 171 BANK STREET LEVEL II OTTAWA ON K2P 1W5	NPCB
Company Code: 00163C Industry: Other Site Status: Transaction Date: 10/8/1993 Inspection Date: 7/21/1993 --Details-- Label: Serial No.: PCB Type/Code: Inerteen Location: Item/State:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
No. of Items: Manufacturer: Status: In-Use Contents: 1433.00 L					
111	2 of 9	NNW/227.7	77.9 / 0.07	ROSTRUST INVESTMENTS INC. 171 BANK STREET LEVEL II BANK STREET LEVEL II OTTAWA ON	NPCB
Company Code: 00163C Industry: Site Status: Transaction Date: Inspection Date:					
--Details--					
Label: Serial No.: PCB Type/Code: Location: Item/State: No. of Items: Manufacturer: Status: In-Use Contents:					
111	3 of 9	NNW/227.7	77.9 / 0.07	171 Bank St Ottawa ON K2P 1W5	EHS
Order No: 20000919004 Status: C Report Type: Complete Report Report Date: 9/21/00 Date Received: 9/14/00 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Ottawa Carleton Client Prov/State: ON Search Radius (km): 0.30 X: -75.697803 Y: 45.418652					
111	4 of 9	NNW/227.7	77.9 / 0.07	CAMPBELL AND KENNEDY ELECTRIC LTD. M2-171 BANK ST. OTTAWA ON K2P 1W5	GEN
Generator Info					
Generator No: ON0043400 Approval Years: 86,87,88,89,90,92,93,94 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: *** NOT DEFINED ***					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 0000					
111	5 of 9	NNW/227.7	77.9 / 0.07	O & Y PROPERTIES INC. 171 BANK STREET L'ESPLANADE LAURIER OTTAWA ON K2P 1W5	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON0383905			Choice of Contact:	
Approval Years:	94,95,96,97,98			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	7512
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	NON-RES. BLDG. OPER.				
<u>Waste Detail(s)</u>					
Waste Class:	213				
Waste Class Name:	PETROLEUM DISTILLATES				
<u>Waste Detail(s)</u>					
Waste Class:	252				
Waste Class Name:	WASTE OILS & LUBRICANTS				
111	6 of 9	NNW/227.7	77.9 / 0.07	O & Y PROPERTIES INC. L'ESPLANADE LAURIER 171 BANK STREET OTTAWA ON K2P 1W5	GEN
<u>Generator Info</u>					
Generator No:	ON0383905			Choice of Contact:	
Approval Years:	99,00,01			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	7512
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	NON-RES. BLDG. OPER.				
<u>Waste Detail(s)</u>					
Waste Class:	213				
Waste Class Name:	PETROLEUM DISTILLATES				
<u>Waste Detail(s)</u>					
Waste Class:	252				
Waste Class Name:	WASTE OILS & LUBRICANTS				
111	7 of 9	NNW/227.7	77.9 / 0.07	ROSTRUST INVESTMENTS INC. 171 BANK STREET (L'ESPLANADE LAURIER) OTTAWA ON K2P 1W5	GEN
<u>Generator Info</u>					
Generator No:	ON2079000			Choice of Contact:	
Approval Years:	95,96,97,98,99,00,01,02,03,04			Contaminated Fac:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status:				MHSW Facility:	
PO Box No:				SIC Code:	7512
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		NON-RES. BLDG. OPER.			
<u>Waste Detail(s)</u>					
Waste Class:		243			
Waste Class Name:		PCB'S			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
111	8 of 9	NNW/227.7	77.9 / 0.07	ROSTRUST INVESTMENTS INC. 171 BANK STREET LEVEL 2 L'Esplanade Laurier Ottawa ON K2P 1W5	NPCB
Company Code:		O0163C			
Industry:		Other			
Site Status:		In- Use			
Transaction Date:		7/21/1993			
Inspection Date:		7/21/1993			
<u>--Details--</u>					
Label:					
Serial No.:					
PCB Type/Code:		Askarel/Askarel			
Location:					
Item/State:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
No. of Items: Manufacturer: Status: In-Use Contents: Label: Serial No.: PCB Type/Code: Askarel/Inerteen Location: Small Transformer Vault Item/State: No. of Items: Manufacturer: Status: In-Use Contents: Label: Serial No.: PCB Type/Code: Askarel/Inerteen Location: Trans. Vault/ P1 Level N. Side Item/State: No. of Items: Manufacturer: Status: In-Use Contents:					
111	9 of 9	NNW/227.7	77.9 / 0.07	ROSTRUST INVESTMENTS INC. L'ESPLANADE LAURIER 171 BANK STREET LEVEL II OTTAWA ON K2P 1W5	NPCB
Company Code: 00163C Industry: OTHER Site Status: INSPECTED SITES (NON FEDERAL) Transaction Date: 10/6/1996 Inspection Date: 7/21/1993 --Details-- Label: OR21842 Serial No.: PCB Type/Code: ASKAREL/ASKAREL Location: Item/State: TRANSFORMER/FULL No. of Items: 1 Manufacturer: Status: IN-USE Contents: 3250 L Label: OR21836 Serial No.: C-31S-0783 PCB Type/Code: ASKAREL/INERTEEN Location: TRANS. VAULTLP1 LEVEL N. SIDE Item/State: TRANSFORMER/FULL No. of Items: 1 Manufacturer: WESTINGHOUSE Status: IN-USE Contents: 1433 L Label: OR21837 Serial No.: B-31S-0783 PCB Type/Code: ASKAREL/INERTEEN Location: TRANS. VAULTLP1 LEVEL N. SIDE Item/State: TRANSFORMER/FULL No. of Items: 1					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Manufacturer:		WESTINGHOUSE			
Status:		IN-USE			
Contents:		1433 L			
Label:		OR21838			
Serial No.:		C-31S-0782			
PCB Type/Code:		ASKAREL/INERTEEN			
Location:		TRANS. VAULTLP1 LEVEL N. SIDE			
Item/State:		TRANSFORMER/FULL			
No. of Items:		1			
Manufacturer:		WESTINGHOUSE			
Status:		IN-USE			
Contents:		1433 L			
Label:		OR21839			
Serial No.:		A-31S-0782			
PCB Type/Code:		ASKAREL/INERTEEN			
Location:		TRANS. VAULTLP1 LEVEL N. SIDE			
Item/State:		TRANSFORMER/FULL			
No. of Items:		1			
Manufacturer:		WESTINGHOUSE			
Status:		IN-USE			
Contents:		1433 L			
Label:		OR21840			
Serial No.:		A-31S-0783			
PCB Type/Code:		ASKAREL/INERTEEN			
Location:		SMALL TRANSFORMER VAULT			
Item/State:		TRANSFORMER/FULL			
No. of Items:		1			
Manufacturer:		WESTINGHOUSE			
Status:		IN-USE			
Contents:		1433 L			
Label:		OR21841			
Serial No.:		B-31S-0782			
PCB Type/Code:		ASKAREL/INERTEEN			
Location:		SMALL TRANSFORMER VAULT			
Item/State:		TRANSFORMER/FULL			
No. of Items:		1			
Manufacturer:		WESTINGHOUSE			
Status:		IN-USE			
Contents:		1433 L			
Label:		OR21843			
Serial No.:					
PCB Type/Code:		ASKAREL/ASKAREL			
Location:					
Item/State:		TRANSFORMER/FULL			
No. of Items:		1			
Manufacturer:					
Status:		IN-USE			
Contents:		3250 L			
<u>112</u>	1 of 8	NW/228.1	76.8 / -0.96	SHOPPERS DRUG MART #988 174 BANK ST OTTAWA ON K2P1W6	PES
Detail Licence No:				Operator Box:	
Licence No:	16739			Operator Class:	
Status:				Operator No:	
Approval Date:				Operator Type:	
Report Source:	Legacy Licenses (Excluding TS)			Oper Area Code:	613
Licence Type:	Limited Vendor			Oper Phone No:	2325723

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Licence Type Code: Licence Class: Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:	23 01			Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:	

112	2 of 8	NW/228.1	76.8 / -0.96	B. Surani Drugs Ltd. (910) 174 BANK ST OTTAWA ON K1P 5N7	GEN

Generator Info

Generator No:	ON6683154	Choice of Contact:	CO_ADMIN
Approval Years:	2016	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	446110
Country:	Canada		
Co Admin:	Nastran Najafi-Fard		
Phone No Admin:	4164931220 Ext.3218		
SIC Description:	446110		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class:	261
Waste Class Name:	PHARMACEUTICALS

112	3 of 8	NW/228.1	76.8 / -0.96	B. Surani Drugs Ltd. (910) 174 BANK ST OTTAWA ON K1P 5N7	GEN

Generator Info

Generator No:	ON6683154	Choice of Contact:	CO_ADMIN
Approval Years:	2015	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	446110
Country:	Canada		
Co Admin:	Nastran Najafi-Fard		
Phone No Admin:	4164931220 Ext.3218		
SIC Description:	446110		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
112	4 of 8	NW/228.1	76.8 / -0.96	B. Surani Drugs Ltd. (910) 174 BANK ST OTTAWA ON K1P 5N7	GEN
<u>Generator Info</u>					
Generator No:		ON6683154		Choice of Contact:	
Approval Years:		As of Dec 2018		Contaminated Fac:	
Status:		Registered		MHSW Facility:	
PO Box No:				SIC Code:	
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		261 A			
Waste Class Name:		Pharmaceuticals			
<u>Waste Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
112	5 of 8	NW/228.1	76.8 / -0.96	SHOPPERS DRUG MART #988 174 BANK ST OTTAWA ON K2P1W6	PES
Detail Licence No:				Operator Box:	
Licence No:		12805		Operator Class:	
Status:				Operator No:	
Approval Date:				Operator Type:	
Report Source:		Legacy Licenses (Excluding TS)		Oper Area Code:	
Licence Type:		Limited Vendor		Oper Phone No:	
Licence Type Code:		23		Operator Ext:	
Licence Class:		01		Operator Lot:	
Licence Control:				Oper Concession:	
Latitude:				Operator Region:	
Longitude:				Operator District:	
Lot:				Operator County:	
Concession:				Op Municipality:	
Region:				Post Office Box:	
District:				MOE District:	
County:				SWP Area Name:	
Trade Name:					
PDF URL:					
112	6 of 8	NW/228.1	76.8 / -0.96	B. Surani Drugs Ltd. (910) 174 BANK ST OTTAWA ON K1P 5N7	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON6683154			Choice of Contact:	
Approval Years:	As of Jul 2020			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	261 A				
Waste Class Name:	Pharmaceuticals				
<u>Waste Detail(s)</u>					
Waste Class:	312 P				
Waste Class Name:	Pathological wastes				
112	7 of 8	NW/228.1	76.8 / -0.96	B. Surani Drugs Ltd. (910) 174 BANK ST OTTAWA ON K1P 5N7	GEN
<u>Generator Info</u>					
Generator No:	ON6683154			Choice of Contact:	
Approval Years:	As of Nov 2021			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	312 P				
Waste Class Name:	Pathological wastes				
<u>Waste Detail(s)</u>					
Waste Class:	261 A				
Waste Class Name:	Pharmaceuticals				
112	8 of 8	NW/228.1	76.8 / -0.96	B. Surani Drugs Ltd. (910) 174 BANK ST OTTAWA ON K1P 5N7	GEN
<u>Generator Info</u>					
Generator No:	ON6683154			Choice of Contact:	
Approval Years:	As of Oct 2022			Contaminated Fac:	
Status:	Registered			MHSW Facility:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
 <u>Waste Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		PATHOLOGICAL WASTES			
 <u>Waste Detail(s)</u>					
Waste Class:		261 A			
Waste Class Name:		PHARMACEUTICALS			
 <u>2017 Generator Info</u>					
Gen No:	ON6683154			Choice of Contact:	CO_ADMIN
ID:	26278			Phone No Official:	613-232-5723 Ext.
Contaminated Fac:	N			Phone No Admin:	4164931220 Ext.3218
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	446110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		B. Surani Drugs Ltd. (910)			
Gen Div:					
Gen Op Name:		Shoppers Drug Mart 988			
Gen Op Div:					
Site Adrs1:		174 BANK ST			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		OTTAWA			
Province Out:					
Site Postal Code:		K1P 5N7			
Site Country:		Canada			
Co Official:		Bashir Surani			
Co Admin:		Nastran Najafi-Fard			
 <u>2017 Generator Manifest</u>					
ID:	52105			Sum Received Qty:	5.0
Generator No:	ON6683154			Waste Class Name:	PHARMACEUTICALS
Receiver Type:	030			Count Manifests:	1
Waste Char:	A			District:	402
Waste Code:	261				
 <u>2018 Generator Info</u>					
Gen No:	ON6683154			Choice of Contact:	CO_ADMIN
ID:	26637			Phone No Official:	613-232-5723 Ext.
Contaminated Fac:	N			Phone No Admin:	4164931220 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	446110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		B. Surani Drugs Ltd. (910)			
Gen Div:					
Gen Op Name:		Shoppers Drug Mart 988			
Gen Op Div:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Adrs1:		174 BANK ST			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		OTTAWA			
Province Out:					
Site Postal Code:		K1P 5N7			
Site Country:		Canada			
Co Official:		Bashir Surani			
Co Admin:		Pharmacy Operations Development			
<u>2018 Generator Manifest</u>					
ID:	52010			Sum Received Qty:	11.0
Generator No:	ON6683154			Waste Class Name:	PHARMACEUTICALS
Receiver Type:	030			Count Manifests:	2
Waste Char:	A			District:	402
Waste Code:	261				
<u>2018 Generator Manifest</u>					
ID:	52011			Sum Received Qty:	5.5
Generator No:	ON6683154			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	1
Waste Char:	P			District:	402
Waste Code:	312				
<u>2019 Generator Info</u>					
Gen No:	ON6683154			Choice of Contact:	CO_ADMIN
ID:	26862			Phone No Official:	613-232-5723 Ext.
Contaminated Fac:	N			Phone No Admin:	4164931220 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	446110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		B. Surani Drugs Ltd. (910)			
Gen Div:					
Gen Op Name:		Shoppers Drug Mart 988			
Gen Op Div:					
Site Adrs1:		174 BANK ST			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		OTTAWA			
Province Out:					
Site Postal Code:		K1P 5N7			
Site Country:		Canada			
Co Official:		Bashir Surani			
Co Admin:		Pharmacy Operations Development			
<u>2019 Generator Manifest</u>					
ID:	51959			Sum Received Qty:	13.0
Generator No:	ON6683154			Waste Class Name:	PHARMACEUTICALS
Receiver Type:	030			Count Manifests:	2
Waste Char:	A			District:	402
Waste Code:	261				
<u>2019 Generator Manifest</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
ID:	51960			Sum Received Qty:	4.0
Generator No:	ON6683154			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	1
Waste Char:	P			District:	402
Waste Code:	312				
<u>2020 Generator Info</u>					
Gen No:	ON6683154			Choice of Contact:	CO_ADMIN
ID:	26587			Phone No Official:	613-232-5723 Ext.
Contaminated Fac:	N			Phone No Admin:	4164931220 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	446110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		B. Surani Drugs Ltd. (910)			
Gen Div:					
Gen Op Name:		Shoppers Drug Mart 988			
Gen Op Div:					
Site Adrs1:		174 BANK ST			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		OTTAWA			
Province Out:					
Site Postal Code:		K1P 5N7			
Site Country:		Canada			
Co Official:		Bashir Surani			
Co Admin:		Pharmacy Operations Development			
<u>2020 Generator Manifest</u>					
ID:	48490			Sum Received Qty:	7.0
Generator No:	ON6683154			Waste Class Name:	PHARMACEUTICALS
Receiver Type:	030			Count Manifests:	1
Waste Char:	P			District:	402
Waste Code:	261				
<u>2020 Generator Manifest</u>					
ID:	48489			Sum Received Qty:	7.7
Generator No:	ON6683154			Waste Class Name:	PHARMACEUTICALS
Receiver Type:	030			Count Manifests:	2
Waste Char:	A			District:	402
Waste Code:	261				
<u>2020 Generator Manifest</u>					
ID:	48491			Sum Received Qty:	6.5
Generator No:	ON6683154			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	1
Waste Char:	P			District:	402
Waste Code:	312				
<u>2021 Generator Info</u>					
Gen No:	ON6683154			Choice of Contact:	CO_ADMIN
ID:	27053			Phone No Official:	613-232-5723 Ext.
Contaminated Fac:	N			Phone No Admin:	4164931220 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
NAICS Code1: NAICS Code2: NAICS Code3: Gen Name: Gen Div: Gen Op Name: Gen Op Div: Site Adrs1: Site Bldg: Site Pobox: Province In: Site Adrs2: Site City: Province Out: Site Postal Code: Site Country: Co Official: Co Admin:	446110	B. Surani Drugs Ltd. (910) Shoppers Drug Mart 988 174 BANK ST ONTARIO OTTAWA K1P 5N7 Canada Bashir Surani Pharmacy Operations Development		County Out: District: 402	
<u>2021 Generator Manifest</u>					
ID: Generator No: Receiver Type: Waste Char: Waste Code:	50354 ON6683154 030 P 312			Sum Received Qty: Waste Class Name: Count Manifests: District:	16.6 PATHOLOGICAL WASTES 1 402
<u>2021 Generator Manifest</u>					
ID: Generator No: Receiver Type: Waste Char: Waste Code:	50353 ON6683154 030 A 261			Sum Received Qty: Waste Class Name: Count Manifests: District:	12.24 PHARMACEUTICALS 2 402
<u>113</u>	1 of 2	ESE/228.4	75.9 / -1.93	326 Somerset St W Ottawa ON K2P0J9	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:	20170203024 C Standard Report 08-FEB-17 03-FEB-17 			Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:	 ON .25 -75.69486 45.415713
<u>113</u>	2 of 2	ESE/228.4	75.9 / -1.93	EnviroCentre 326 Somerset St. West Ottawa ON K2P 0J9	GEN
<u>Generator Info</u>					
Generator No: Approval Years: Status: PO Box No: Country: Co Admin: Phone No Admin:	ON4708690 As of Nov 2021 Registered Canada 			Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		263 I			
Waste Class Name:		Misc. waste organic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		263 L			
Waste Class Name:		Misc. waste organic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			
<u>Waste Detail(s)</u>					
Waste Class:		148 C			
Waste Class Name:		Misc. wastes and inorganic chemicals			
<u>2021 Generator Info</u>					
Gen No:	ON4708690			Choice of Contact:	CO_OFFICIAL
ID:	18572			Phone No Official:	613-894-4121 Ext.
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	541620			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	EnviroCentre				
Gen Div:					
Gen Op Name:	EnviroCentre				
Gen Op Div:					
Site Adrs1:	326 Somerset St. West				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K2P 0J9				
Site Country:	Canada				
Co Official:	Melanie Johnston				
Co Admin:					
<u>2021 Generator Manifest</u>					
ID:	39879			Sum Received Qty:	240.0
Generator No:	ON4708690			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	035			Count Manifests:	1
Waste Char:	I			District:	402
Waste Code:	263				
114	1 of 1	E/228.5	75.9 / -1.93	234 O'connor St Ottawa ON K2P1T9	EHS
Order No:	20150626030			Nearest Intersection:	
Status:	C			Municipality:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Report Type: Standard Report Report Date: 06-JUL-15 Date Received: 26-JUN-15 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Client Prov/State: ON Search Radius (km): .25 X: -75.694742 Y: 45.416336					
115	1 of 15	SSW/230.4	78.9 / 1.07	BUDGET CAR & TRUCK RENTALS OF OTTAWA 443 SOMERSET ST W OTTAWA ON K1R 5J7	PRT
Location ID: 11099 Type: private Expiry Date: Capacity (L): 22730.00 Licence #: 0001026975					
115	2 of 15	SSW/230.4	78.9 / 1.07	443 Somerset St. West Ottawa ON K1R 5J7	EHS
Order No: 20050328084 Status: C Report Type: Report Date: 4/6/2005 Date Received: 3/28/2005 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -75.698785 Y: 45.414569					
115	3 of 15	SSW/230.4	78.9 / 1.07	BUDGET CAR & TRUCK RENTALS OF OTTAWA 443 SOMERSET ST W OTTAWA ON K1R 5J7	FSTH
License Issue Date: 1/11/1991 Tank Status: Licensed Tank Status As Of: August 2007 Operation Type: Private Fuel Outlet Facility Type: Gasoline Station - Self Serve					
--Details-- Status: Not-Active Year of Installation: 1990 Corrosion Protection: Capacity: 22500 Tank Fuel Type: Liquid Fuel Single Wall UST - Gasoline					
115	4 of 15	SSW/230.4	78.9 / 1.07	Budget Car Inc 443 Somerset St. West Ottawa ON K1R 5J7	GEN
Generator Info					
Generator No: ON4197992 Approval Years: 06,07,08 Status: PO Box No:					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 532111					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Country: Co Admin: Phone No Admin: SIC Description:					
		Passenger Car Rental			
Waste Detail(s)					
Waste Class:	150				
Waste Class Name:	INERT INORGANIC WASTES				
115	5 of 15	SSW/230.4	78.9 / 1.07	Avraham Holdings Inc. 443 SOMERSET ST W ON OTTAWA ON	RSC
RSC No:	46025			X:	-75.69887048934635
RA No:				Y:	45.41457830204852
Status:	FILED			Latitude:	45.4145783
Filing Date:				Longitude:	-75.69887049
Date Ack:				UTM Coordinates:	
Date Returned:				Latitude Longitude:	
Approval Date:	January 22, 2009			Accuracy Estimate:	
Cert Date:				Measurement Method:	
Cert Prop Use No:				Mailing Address:	
Curr Property Use:				Telephone:	
Intended Prop Use:				Fax:	
Restoration Type:				Email:	
Soil Type:				Postal Code:	K1R 5J7
Criteria:				Ministry District:	
Stratified (Y/N):				MOE District:	Ottawa
Audit (Y/N):				SWP Area Name:	Rideau Valley
Entire Leg Prop. (Y/N):				Qual Person Name:	Peter J. Roberts
CPU Issu Sect 1686:				Consultant:	
Business Name:	Avraham Holdings Inc.				
Address:	443 SOMERSET ST W ON				
Legal Desc:					
Site Pin:	04120-0037 (LT)				
Asmt Roll No:					
Project Type:	PRE2011				
Approval Type:	RSC based on Phase One and Two ESAs				
Applicable Standards:					
PDF Link:	https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=46025				
115	6 of 15	SSW/230.4	78.9 / 1.07	Budget Car Inc 443 Somerset St. West Ottawa ON K1R 5J7	GEN
Generator Info					
Generator No:	ON4197992			Choice of Contact:	
Approval Years:	2010			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	532111
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	Passenger Car Rental				
Waste Detail(s)					
Waste Class:	150				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		INERT INORGANIC WASTES			
115	7 of 15	SSW/230.4	78.9 / 1.07	Budget Car Inc 443 Somerset St. West Ottawa ON K1R 5J7	GEN
<u>Generator Info</u>					
Generator No:		ON4197992		Choice of Contact:	
Approval Years:		2011		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 532111	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Passenger Car Rental			
<u>Waste Detail(s)</u>					
Waste Class:		150			
Waste Class Name:		INERT INORGANIC WASTES			
115	8 of 15	SSW/230.4	78.9 / 1.07	Budget Car Inc 443 Somerset St. West Ottawa ON K1R 5J7	GEN
<u>Generator Info</u>					
Generator No:		ON4197992		Choice of Contact:	
Approval Years:		2012		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 532111	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Passenger Car Rental			
<u>Waste Detail(s)</u>					
Waste Class:		150			
Waste Class Name:		INERT INORGANIC WASTES			
115	9 of 15	SSW/230.4	78.9 / 1.07	Budget Car Inc 443 Somerset St. West Ottawa ON	GEN
<u>Generator Info</u>					
Generator No:		ON4197992		Choice of Contact:	
Approval Years:		2013		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 532111	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		150			
Waste Class Name:		INERT INORGANIC WASTES			
115	10 of 15	SSW/230.4	78.9 / 1.07	Budget Car Inc 443 Somerset St. West Ottawa ON K1R 5J7	GEN
<u>Generator Info</u>					
Generator No:		ON4197992		Choice of Contact:	CO_OFFICIAL
Approval Years:		2016		Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	532111
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:		532111			
<u>Waste Detail(s)</u>					
Waste Class:		150			
Waste Class Name:		INERT INORGANIC WASTES			
115	11 of 15	SSW/230.4	78.9 / 1.07	Budget Car Inc 443 Somerset St. West Ottawa ON K1R 5J7	GEN
<u>Generator Info</u>					
Generator No:		ON4197992		Choice of Contact:	CO_OFFICIAL
Approval Years:		2015		Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	532111
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:		532111			
<u>Waste Detail(s)</u>					
Waste Class:		150			
Waste Class Name:		INERT INORGANIC WASTES			
115	12 of 15	SSW/230.4	78.9 / 1.07	Budget Car Inc 443 Somerset St. West Ottawa ON K1R 5J7	GEN
<u>Generator Info</u>					
Generator No:		ON4197992		Choice of Contact:	CO_OFFICIAL
Approval Years:		2014		Contaminated Fac:	No
Status:				MHSW Facility:	No

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description: 532111 Waste Detail(s) Waste Class: 150 Waste Class Name: INERT INORGANIC WASTES					
115	13 of 15	SSW/230.4	78.9 / 1.07	Budget Car Inc 443 Somerset St. West Ottawa ON K1R 5J7	GEN
Generator Info Generator No: ON4197992 Approval Years: As of Dec 2018 Status: Registered PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description: Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
Waste Detail(s) Waste Class: 150 L Waste Class Name: Inert organic wastes					
115	14 of 15	SSW/230.4	78.9 / 1.07	Budget Car Inc 443 Somerset St. West Ottawa ON K1R 5J7	GEN
Generator Info Generator No: ON4197992 Approval Years: As of Jul 2020 Status: Registered PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description: Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
Waste Detail(s) Waste Class: 150 L Waste Class Name: Inert organic wastes					
2017 Generator Info Gen No: ON4197992 ID: 16745 Contaminated Fac: N MHSW Facility: N Choice of Contact: CO_OFFICIAL Phone No Official: 613-521-7541 Ext.257 Phone No Admin: County Ont: OTTAWA CARLTON (RM)					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
NAICS Code1: NAICS Code2: NAICS Code3: Gen Name: Gen Div: Gen Op Name: Gen Op Div: Site Adrs1: Site Bldg: Site Pobox: Province In: Site Adrs2: Site City: Province Out: Site Postal Code: Site Country: Co Official: Co Admin:	532111			County Out: District: 402	
		Budget Car Inc			
		Budget Car Inc			
		443 Somerset St. West			
		ONTARIO			
		Ottawa			
		K1R 5J7			
		Canada			
		Jerome MacLean			
<u>2018 Generator Info</u>					
Gen No: ID: Contaminated Fac: MHSW Facility: NAICS Code1: NAICS Code2: NAICS Code3: Gen Name: Gen Div: Gen Op Name: Gen Op Div: Site Adrs1: Site Bldg: Site Pobox: Province In: Site Adrs2: Site City: Province Out: Site Postal Code: Site Country: Co Official: Co Admin:	ON4197992 16730 N N 532111			Choice of Contact: Phone No Official: Phone No Admin: County Ont: County Out: District:	CO_OFFICIAL 613-521-7541 Ext.257 OTTAWA CARLTON (RM) 402
		Budget Car Inc			
		Budget Car Inc			
		443 Somerset St. West			
		ONTARIO			
		Ottawa			
		K1R 5J7			
		Canada			
		Jerome MacLean			
<u>2019 Generator Info</u>					
Gen No: ID: Contaminated Fac: MHSW Facility: NAICS Code1: NAICS Code2: NAICS Code3: Gen Name: Gen Div: Gen Op Name: Gen Op Div: Site Adrs1: Site Bldg: Site Pobox: Province In: Site Adrs2: Site City: Province Out:	ON4197992 16594 N N 532111			Choice of Contact: Phone No Official: Phone No Admin: County Ont: County Out: District:	CO_OFFICIAL 613-521-7541 Ext.257 OTTAWA CARLTON (RM) 402
		Budget Car Inc			
		Budget Car Inc			
		443 Somerset St. West			
		ONTARIO			
		Ottawa			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Postal Code:		K1R 5J7			
Site Country:		Canada			
Co Official:		Jerome MacLean			
Co Admin:					
<u>2020 Generator Info</u>					
Gen No:		ON4197992		Choice of Contact:	CO_OFFICIAL
ID:		16310		Phone No Official:	613-521-7541 Ext.257
Contaminated Fac:		N		Phone No Admin:	
MHSW Facility:		N		County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:		532111		County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		Budget Car Inc			
Gen Div:					
Gen Op Name:		Budget Car Inc			
Gen Op Div:					
Site Adrs1:		443 Somerset St. West			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K1R 5J7			
Site Country:		Canada			
Co Official:		Jerome MacLean			
Co Admin:					
115	15 of 15	SSW/230.4	78.9 / 1.07	BUDGET CAR & TRUCK RENTALS OF OTTAWA 443 SOMERSET ST W OTTAWA ON	EXP
Inventory No:		10907017		Tank Material:	Fiberglass (FRP)
Inventory Status:		Inactive		Corrosion Protect:	Coating
Installation Year:		1990		Overfill Protection:	
Capacity:		22500		Inventory Context:	FS Liquid Fuel Tank
Capacity Unit:				Inventory Item:	FS LIQUID FUEL TANK
Tank Type:					
Manufacturer:					
Model:					
Description:		UNDERGROUND TANK			
Previous Fuel Type:		Gasoline			
116	1 of 1	NNE/230.9	76.9 / -0.93	154 O'CONNOR ST Ottawa ON	WWIS
Well ID:		7139448		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Test Hole		Date Received:	02/02/2010
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		M05547		Contractor:	1844
Tag:		A083149		Form Version:	5
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:		OTTAWA CITY		Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7139448.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		12/21/2009			
Year Completed:		2009			
Depth (m):					
Latitude:		45.4185876082455			
Longitude:		-75.696785470579			
X:		-75.69678530881946			
Y:		45.4185876010596			
Path:		713\7139448.pdf			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7139448.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		12/18/2009			
Year Completed:		2009			
Depth (m):					
Latitude:		45.4183822314461			
Longitude:		-75.6965145379183			
X:		-75.69651437613874			
Y:		45.41838222392617			
Path:		713\7139448.pdf			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7139448.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		12/17/2009			
Year Completed:		2009			
Depth (m):		11.3			
Latitude:		45.4185977002246			
Longitude:		-75.6966066563327			
X:		-75.6966064938307			
Y:		45.41859769295709			
Path:		713\7139448.pdf			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7139448.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		12/16/2009			
Year Completed:		2009			
Depth (m):					
Latitude:		45.4187143962036			
Longitude:		-75.6966592166827			
X:		-75.69665905512896			
Y:		45.41871438942594			
Path:		713\7139448.pdf			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7139448.pdf			
<u>Additional Detail(s) (Map)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Completed Date: 12/18/2009					
Year Completed: 2009					
Depth (m):					
Latitude: 45.4184994730278					
Longitude: -75.6964776355485					
X: -75.69647747424747					
Y: 45.41849946626058					
Path: 713\7139448.pdf					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7139448.pdf					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 12/21/2009					
Year Completed: 2009					
Depth (m):					
Latitude: 45.418595907093					
Longitude: -75.6969006044651					
X: -75.69690044225729					
Y: 45.41859590032445					
Path: 713\7139448.pdf					
<u>Bore Hole Information</u>					
Bore Hole ID: 1003266348					
DP2BR:					
Spatial Status:					
Code OB:					
Code OB Desc:					
Open Hole:					
Cluster Kind: This is a record from cluster log sheet					
Date Completed: 12/21/2009					
Remarks:					
Location Method Desc: on Water Well Record					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID: 1003266352					
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well Use</u>					
Method Construction ID: 1003266351					
Method Construction Code:					
Method Construction:					
Other Method Construction: HSA					
<u>Pipe Information</u>					
Pipe ID: 1003266353					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing No: Comment: Alt Name:		0			
<u>Construction Record - Casing</u>					
Casing ID:		1003266355			
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		7.699999809265137			
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003266354			
Layer:					
Slot:					
Screen Top Depth:		7.699999809265137			
Screen End Depth:		10.699999809265137			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1003266356			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1003266350			
Diameter:		20.0			
Depth From:					
Depth To:		10.699999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:	1002934566			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB:				East83:	445498.00
Code OB Desc:				North83:	5029689.00
Open Hole:	No			Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	12/17/2009			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003266359			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		01			
Material 3 Desc:		FILL			
Formation Top Depth:		0.6000000238418579			
Formation End Depth:		1.2000000476837158			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003266361			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:		91			
Material 3 Desc:		WATER-BEARING			
Formation Top Depth:		3.0			
Formation End Depth:		4.300000190734863			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003266363			
Layer:		6			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		81			
Material 2 Desc:		SANDY			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		5.5			
Formation End Depth:		6.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003266358			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		01			
Material 2 Desc:		FILL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.6000000238418579			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003266360			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		91			
Material 2 Desc:		WATER-BEARING			
Material 3:		84			
Material 3 Desc:		SILTY			
Formation Top Depth:		1.2000000476837158			
Formation End Depth:		3.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003266362			
Layer:		5			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:					
Material 2 Desc:					
Material 3:		61			
Material 3 Desc:		CLAYEY			
Formation Top Depth:		4.300000190734863			
Formation End Depth:		5.5			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003266364			
Layer:		7			
Color:		6			
General Color:		BROWN			
Material 1:		17			
Material 1 Desc:		SHALE			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2:					
Material 2 Desc:					
Material 3:		68			
Material 3 Desc:		DRY			
Formation Top Depth:		6.0			
Formation End Depth:		11.300000190734863			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003266367			
Layer:		1			
Plug From:		0.5			
Plug To:		7.0			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1003266371			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:		HSA			
<u>Pipe Information</u>					
Pipe ID:		1003266357			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003266368			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		8.300000190734863			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003266369			
Layer:		1			
Slot:		10			
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		5.800000190734863			
<u>Hole Diameter</u>					
Hole ID:		1003266366			
Diameter:		10.0			
Depth From:		6.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth To:		11.300000190734863			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		1003266365			
Diameter:		20.0			
Depth From:		0.0			
Depth To:		6.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Bore Hole Information</u>					
Bore Hole ID:	1003266312			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445475.00
Code OB Desc:				North83:	5029689.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	4
Date Completed:	12/21/2009			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1003266316				
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:	1003266315				
Method Construction Code:					
Method Construction:					
Other Method Construction:	HSA				
 <u>Pipe Information</u>					
Pipe ID:	1003266317				
Casing No:	0				
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:	1003266319				
Layer:					
Material:	5				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		7.699999809265137			
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003266318			
Layer:					
Slot:					
Screen Top Depth:		7.699999809265137			
Screen End Depth:		10.699999809265137			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1003266320			
Pump Set At:					
Static Level:		7.699999809265137			
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1003266314			
Diameter:		20.0			
Depth From:					
Depth To:		10.699999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:		1003266330		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:		This is a record from cluster log sheet		UTMRC:	
Date Completed:		12/18/2009		UTMRC Desc:	
Remarks:				Location Method:	
Location Method Desc:		on Water Well Record		wwr	
Elevrc Desc:					
Location Source Date:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003266334			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003266333			
Method Construction Code:					
Method Construction:					
Other Method Construction:		HSA			
<u>Pipe Information</u>					
Pipe ID:		1003266335			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003266337			
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		7.699999809265137			
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003266336			
Layer:					
Slot:					
Screen Top Depth:		7.699999809265137			
Screen End Depth:		10.699999809265137			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1003266338			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pumping Rate: Flowing Rate: Recommended Pump Rate: Levels UOM: m Rate UOM: Water State After Test Code: Water State After Test: Pumping Test Method: Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1003266332			
Diameter:		20.0			
Depth From:					
Depth To:		10.699999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:	1003266339			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445505.00
Code OB Desc:				North83:	5029665.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	4
Date Completed:	12/18/2009			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003266343			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1003266342			
Method Construction Code:					
Method Construction:					
Other Method Construction:		HSA			
<u>Pipe Information</u>					
Pipe ID:		1003266344			
Casing No:		0			
Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003266346			
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		7.699999809265137			
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003266345			
Layer:					
Slot:					
Screen Top Depth:		7.699999809265137			
Screen End Depth:		10.699999809265137			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1003266347			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1003266341			
Diameter:		20.0			
Depth From:					
Depth To:		10.699999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:	1003266321			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445494.00
Code OB Desc:				North83:	5029702.00

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	4
Date Completed:	12/16/2009			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003266325			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1003266324			
Method Construction Code:					
Method Construction:					
Other Method Construction:		HSA			
<u>Pipe Information</u>					
Pipe ID:		1003266326			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003266328			
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		7.699999809265137			
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003266327			
Layer:					
Slot:					
Screen Top Depth:		7.699999809265137			
Screen End Depth:		10.699999809265137			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pumping Test Method Desc: Pump Test ID: 1003266329 Pump Set At: Static Level: Final Level After Pumping: Recommended Pump Depth: Pumping Rate: Flowing Rate: Recommended Pump Rate: Levels UOM: m Rate UOM: Water State After Test Code: Water State After Test: Pumping Test Method: Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID: 1003266323 Diameter: 20.0 Depth From: Depth To: 10.699999809265137 Hole Depth UOM: m Hole Diameter UOM: cm					

117	1 of 1	S/231.1	77.9 / 0.07	429 MC LEARN OTTAWA ON	WWIS
Well ID: 7233875 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z198210 Tag: A173761 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 12/15/2014 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/723\7233875.pdf					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 11/06/2014 Year Completed: 2014 Depth (m): 6.1 Latitude: 45.4143871652221 Longitude: -75.6977434596111 X: -75.6977432983287 Y: 45.41438715832119					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Path:		723\7233875.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1005260617			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445405.00
Code OB Desc:				North83:	5029222.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	11/06/2014			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1005436584				
Layer:	3				
Color:	6				
General Color:	BROWN				
Material 1:	05				
Material 1 Desc:	CLAY				
Material 2:					
Material 2 Desc:					
Material 3:	84				
Material 3 Desc:	SILTY				
Formation Top Depth:	3.0999999046325684				
Formation End Depth:	4.880000114440918				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1005436583				
Layer:	2				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	05				
Material 2 Desc:	CLAY				
Material 3:	84				
Material 3 Desc:	SILTY				
Formation Top Depth:	1.2200000286102295				
Formation End Depth:	3.0999999046325684				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1005436582				
Layer:	1				
Color:	6				
General Color:	BROWN				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		28			
Material 3 Desc:		SAND			
Formation Top Depth:		0.0			
Formation End Depth:		1.2200000286102295			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005436585			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		4.880000114440918			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005436595			
Layer:		3			
Plug From:		2.740000009536743			
Plug To:		6.099999904632568			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005436593			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005436594			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005436592			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		1005436581			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005436588			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005436589			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		6.099999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1005436587			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005436586			
Diameter:		15.319999694824219			
Depth From:		0.0			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

<u>118</u>	1 of 1	SSW/232.5	78.9 / 1.07	KENT ST Ottawa ON	WWIS
Well ID:	7344660			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	10/22/2019
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z286434			Contractor:	7543
Tag:				Form Version:	7

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:			NEPEAN TOWNSHIP	Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7344660.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		09/19/2019			
Year Completed:		2019			
Depth (m):					
Latitude:		45.4144372636735			
Longitude:		-75.6983830952806			
X:		-75.69838293273064			
Y:		45.414437257125776			
Path:		734\7344660.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1007687179		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445355.00
Code OB Desc:				North83:	5029228.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		09/19/2019		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Pipe Information</u>					
Pipe ID:		1008243515			
Casing No:		0			
Comment:					
Alt Name:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008244307			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Levels UOM: Rate UOM: Water State After Test Code: Water State After Test: Pumping Test Method: Pumping Duration HR: Pumping Duration MIN: Flowing:					
		ft			
		GPM			
		0			
<u>Water Details</u>					
Water ID:		1008244205			
Layer:		1			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		41.0			
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1008244050			
Diameter:		2.0			
Depth From:		6.0			
Depth To:		46.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>119</u>	1 of 2	SSW/233.0	78.9 / 1.07	UNKNOWN SOMERSET AND KENT STREET OTTAWA CITY ON	<u>SPL</u>
Ref No:	103840			Municipality No:	20101
Year:				Nature of Damage:	
Incident Dt:	8/11/1994			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	8/11/1994			Impact to Health:	
Dt Document Closed:				Agency Involved:	
Site No:					
MOE Response:					
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					
Site Name:					
Site Address:					
Site Region:					
Site Municipality:	OTTAWA CITY				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:					
Client Type:					
Source Type:					
Incident Cause:	UNKNOWN				
Incident Preceding Spill:					
Incident Reason:	UNKNOWN				
Incident Summary:	OTTAWA HYDRO-GASOLINE FOUND IN EXCAVATION SITE.				
Environment Impact:	CONFIRMED				
Health Env Consequence:					

333 erisinfo.com | Environmental Risk Information Services Order No: 25011400345

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Nothing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: OTHER CONTAINER LEAK Incident Preceding Spill: Incident Reason: UNKNOWN Incident Summary: PRIVATE OWNER - 30 L GASOLINE TO ROAD/CATCH BASIN. F/D, WORKS,SEWER. Environment Impact: POSSIBLE Health Env Consequence: Nature of Impact: Multi Media Pollution Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: LAND / WATER Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:					

121	1 of 1	E/233.5	75.9 / -1.93	311 SONERSET Ottawa ON	WWIS
Well ID:	7391115			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06/29/2021
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z364139			Contractor:	7241
Tag:	A302952			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/739\7391115.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	05/25/2021				
Year Completed:	2021				
Depth (m):					
Latitude:	45.4163771485905				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Longitude:		-75.6946750112729			
X:		-75.69467484910098			
Y:		45.41637714214935			
Path:		739\7391115.pdf			
 <u>Bore Hole Information</u>					
Bore Hole ID:	1008704355			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445647.00
Code OB Desc:				North83:	5029441.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	05/25/2021			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1009852407				
Layer:	2				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	11				
Material 2 Desc:	GRAVEL				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	0.3100000023841858				
Formation End Depth:	2.740000009536743				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1009852408				
Layer:	3				
Color:	6				
General Color:	BROWN				
Material 1:	05				
Material 1 Desc:	CLAY				
Material 2:	28				
Material 2 Desc:	SAND				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	2.740000009536743				
Formation End Depth:	3.3499999046325684				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1009852410				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		5			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		11.279999732971191			
Formation End Depth:		14.9399995803833			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1009852409			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		3.3499999046325684			
Formation End Depth:		11.279999732971191			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1009852406			
Layer:		1			
Color:		2			
General Color:		GREY			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1009853464			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1009853465			
Layer:		2			
Plug From:		0.3100000023841858			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:		11.579999923706055			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009853466			
Layer:		3			
Plug From:		11.579999923706055			
Plug To:		14.9399995803833			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1009854840			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1009764985			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1009855218			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		11.890000343322754			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1009855614			
Layer:		1			
Slot:		10			
Screen Top Depth:		11.890000343322754			
Screen End Depth:		14.9399995803833			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1009856078			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:		No			
Hole Diameter					
Hole ID:		1009854399			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		14.9399995803833			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

122	1 of 1	NE/234.0	76.6 / -1.21	ON	WWIS
Well ID: 7391814					
Construction Date:					
Use 1st:					
Use 2nd:					
Final Well Status:					
Water Type:					
Casing Material:					
Audit No: C52802					
Tag: A290213					
Constructn Method:					
Elevation (m):					
Elevatn Reliability:					
Depth to Bedrock:					
Well Depth:					
Overburden/Bedrock:					
Pump Rate:					
Static Water Level:					
Clear/Cloudy:					
Municipality: NEPEAN TOWNSHIP					
Site Info:					
Flowing (Y/N):					
Flow Rate:					
Data Entry Status: Yes					
Data Src:					
Date Received: 07/07/2021					
Selected Flag: TRUE					
Abandonment Rec:					
Contractor: 7329					
Form Version: 8					
Owner:					
County: OTTAWA-CARLETON					
Lot:					
Concession:					
Concession Name:					
Easting NAD83:					
Northing NAD83:					
Zone:					
UTM Reliability:					

Additional Detail(s) (Map)

Bore Hole ID:	1008709217	Tag No:	A290213
Depth M:		Contractor:	7329
Year Completed:	2021	Latitude:	45.41814326594
Well Completed Dt:	03/10/2021	Longitude:	-75.6958469769054
Audit No:	C52802	Y:	45.41814325905426
Path:		X:	-75.69584681493654

Bore Hole Information

Bore Hole ID:	1008709217	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	445557.00
Code OB Desc:		North83:	5029638.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	03/10/2021	UTMRC Desc:	margin of error : 30 m - 100 m

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
123	1 of 21	N/234.2	77.9 / 0.07	HEALTH AND WELFARE CANADA HEALTH UNIT#28, 10TH FL., WEST TOWER 300 LAURIER AVE. WEST (TBC) OTTAWA ON K1A 0R5	GEN
<u>Generator Info</u>					
Generator No:		ON0095618		Choice of Contact:	
Approval Years:		92,93,97		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 8635	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		PUB. HEALTH CLINICS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
123	2 of 21	N/234.2	77.9 / 0.07	GVT OF CAN-HEALTH&WELFARE CAN.MED.16-304 SER.BR,UNIT#28,10TH FL. W. TOWER 300 LAURIER AVE. WEST,C/O 301 ELGIN ST OTTAWA ON K1A 0L3	GEN
<u>Generator Info</u>					
Generator No:		ON0095618		Choice of Contact:	
Approval Years:		94,95,96		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 8635	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		PUB. HEALTH CLINICS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
123	3 of 21	N/234.2	77.9 / 0.07	HEALTH AND WELFARE CANADA 300 LAURIER AVE. WEST (T.B.C) HEALTH UNIT #28, 10TH FLOOR WEST TOWER OTTAWA ON K1A 0R5	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON0095618			Choice of Contact:	
Approval Years:	98,99,00,01			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	8635
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		PUB. HEALTH CLINICS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
123	4 of 21	N/234.2	77.9 / 0.07	GVT. OF CAN.-SUPPLY AND SERVICES OLYMPIA PRINTING PLANT,LEVEL P1,W. TOWER L'ESPLANADE LAURIER,300 LAURIER AVE. W OTTAWA ON K1A 0M7	GEN
<u>Generator Info</u>					
Generator No:	ON0249609			Choice of Contact:	
Approval Years:	86,87,88,89,90			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	2849
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		OTHER PRINTING IND.			
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
123	5 of 21	N/234.2	77.9 / 0.07	GVT. OF CAN.(OUT OF BUS) 18-208 OLYMPIA PRINTING PLANT,LEVEL P1,W. TOWER L'ESPLANADE LAURIER,300 LAURIER AVE. W OTTAWA ON K1A 0M7	GEN
<u>Generator Info</u>					
Generator No:	ON0249609			Choice of Contact:	
Approval Years:	92,93,94,95,96,97			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	2849
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		OTHER PRINTING IND.			
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Detail(s)					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
123	6 of 21	N/234.2	77.9 / 0.07	GVT. OF CAN.(OUT OF BUSINESS) OLYMPIA PRINTING PLANT,LEVEL P1,W. TOWER L'ESPLANADE LAURIER,300 LAURIER AVE. W OTTAWA ON K1A 0M7	GEN
Generator Info					
Generator No:		ON0249609		Choice of Contact:	
Approval Years:		98		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 2849	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		OTHER PRINTING IND.			
Waste Detail(s)					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Detail(s)					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
123	7 of 21	N/234.2	77.9 / 0.07	Public Works and Government Services Canada 300 Laurier Ave Ottawa ON K0A 0S5	GEN
Generator Info					
Generator No:		ON5652014		Choice of Contact:	
Approval Years:		04,05,06,07,08		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 562990	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		All Other Waste Management Services			
Waste Detail(s)					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Detail(s)					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		243			
Waste Class Name:		PCB'S			

123	8 of 21	N/234.2	77.9 / 0.07	in front of 300 Laurier Avenue<UNOFFICIAL> Ottawa ON	SPL
Ref No:	2068-69ELAE			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	2/8/2005			Discharger Report:	0
Dt MOE Arvl on Scn:				Material Group:	Oil
MOE Reported Dt:	2/8/2005			Impact to Health:	
Dt Document Closed:				Agency Involved:	
Site No:					
MOE Response:					
Site County/District:					
Site Geo Ref Meth:					
Site District Office:	Ottawa				
Nearest Watercourse:					
Site Name:	in front of 300 Laurier Avenue<UNOFFICIAL>				
Site Address:					
Site Region:					
Site Municipality:	Ottawa				
Site Lot:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary: Waste Management-25 L Hydraulic Oil to CB Environment Impact: Possible Health Env Consequence: Nature of Impact: Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: HYDRAULIC OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Water Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Other Motor Vehicle SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:					
123	9 of 21	N/234.2	77.9 / 0.07	Public Works and Government Services Canada 300 Laurier Ave Ottawa ON	GEN
<u>Generator Info</u>					
Generator No:	ON5652014			Choice of Contact:	
Approval Years:	2009			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	911910
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Other Federal Government Public Administration			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		243			
Waste Class Name:		PCBS			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			

123	10 of 21	N/234.2	77.9 / 0.07	Public Works and Government Services Canada 300 Laurier Ave Ottawa ON	GEN

Generator Info

Generator No:	ON5652014	Choice of Contact:	
Approval Years:	2010	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	911910
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Other Federal Government Public Administration		

Waste Detail(s)

Waste Class:	331
Waste Class Name:	WASTE COMPRESSED GASES

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		243			
Waste Class Name:		PCBS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
123	11 of 21	N/234.2	77.9 / 0.07	Public Works and Government Services Canada 300 Laurier Ave Ottawa ON	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON5652014			Choice of Contact:	
Approval Years:	2011			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	911910
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Other Federal Government Public Administration			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		243			
Waste Class Name:		PCBS			
123	12 of 21	N/234.2	77.9 / 0.07	Public Works and Government Services Canada 300 Laurier Ave Ottawa ON K0A 0S5	GEN
<u>Generator Info</u>					
Generator No:	ON5652014			Choice of Contact:	
Approval Years:	2012			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	911910
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	Other Federal Government Public Administration				
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		243			
Waste Class Name:		PCBS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			

123	13 of 21	N/234.2	77.9 / 0.07	Public Works and Government Services Canada 300 Laurier Ave Ottawa ON	GEN

Generator Info

Generator No:	ON5652014	Choice of Contact:	
Approval Years:	2013	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	911910
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	148
Waste Class Name:	INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		243			
Waste Class Name:		PCBS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
123	14 of 21	N/234.2	77.9 / 0.07	Public Works and Government Services Canada 300 Laurier Ave Ottawa ON K0A0S5	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON5652014			Choice of Contact:	CO_ADMIN
Approval Years:	2016			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	911910
Country:	Canada				
Co Admin:		Brian Stoneman			
Phone No Admin:		613-993-5639 Ext.			
SIC Description:		911910			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		243			
Waste Class Name:		PCBS			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
123	15 of 21	N/234.2	77.9 / 0.07	Public Works and Government Services Canada 300 Laurier Ave Ottawa ON K0A0S5	GEN
<u>Generator Info</u>					
Generator No:	ON5652014			Choice of Contact:	CO_ADMIN
Approval Years:	2015			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	911910
Country:	Canada				
Co Admin:	Brian Stoneman				
Phone No Admin:	613-993-5639 Ext.				
SIC Description:	911910				
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		243			
Waste Class Name:		PCBS			

123	16 of 21	N/234.2	77.9 / 0.07	Public Works and Government Services Canada 300 Laurier Ave Ottawa ON K0A0S5	GEN

Generator Info

Generator No:	ON5652014	Choice of Contact:	CO_ADMIN
Approval Years:	2014	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	911910
Country:	Canada		
Co Admin:	Brian Stoneman		
Phone No Admin:	613-993-5639 Ext.		
SIC Description:	911910		

Waste Detail(s)

Waste Class:	148
Waste Class Name:	INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		243			
Waste Class Name:		PCBS			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
123	17 of 21	N/234.2	77.9 / 0.07	Public Services & Procurement Canada RPB 300 Laurier Ave Ottawa ON K0A 0S5	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON5652014			Choice of Contact:	
Approval Years:	As of Dec 2018			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	212 L				
Waste Class Name:	Aliphatic solvents and residues				
<u>Waste Detail(s)</u>					
Waste Class:	148 C				
Waste Class Name:	Misc. wastes and inorganic chemicals				
<u>Waste Detail(s)</u>					
Waste Class:	221 I				
Waste Class Name:	Light fuels				
<u>Waste Detail(s)</u>					
Waste Class:	243 D				
Waste Class Name:	PCB				
<u>Waste Detail(s)</u>					
Waste Class:	331 I				
Waste Class Name:	Waste compressed gases including cylinders				
<u>Waste Detail(s)</u>					
Waste Class:	252 L				
Waste Class Name:	Waste crankcase oils and lubricants				
<u>Waste Detail(s)</u>					
Waste Class:	263 I				
Waste Class Name:	Misc. waste organic chemicals				
<u>Waste Detail(s)</u>					
Waste Class:	312 P				
Waste Class Name:	Pathological wastes				
<u>Waste Detail(s)</u>					
Waste Class:	145 I				
Waste Class Name:	Wastes from the use of pigments, coatings and paints				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		112 C			
Waste Class Name:		Acid solutions - containing heavy metals			
<u>Waste Detail(s)</u>					
Waste Class:		121 C			
Waste Class Name:		Alkaline slutions - containing heavy metals			
<u>Waste Detail(s)</u>					
Waste Class:		146 R			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
<u>Waste Detail(s)</u>					
Waste Class:		145 L			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
<u>Waste Detail(s)</u>					
Waste Class:		146 T			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
123	18 of 21	N/234.2	77.9 / 0.07	Public Services & Procurement Canada RPB 300 Laurier Ave Ottawa ON K0A 0S5	GEN

Generator Info

Generator No:	ON5652014	Choice of Contact:
Approval Years:	As of Jul 2020	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	146 R
Waste Class Name:	Other specified inorganic sludges, slurries or solids

Waste Detail(s)

Waste Class:	145 L
Waste Class Name:	Wastes from the use of pigments, coatings and paints

Waste Detail(s)

Waste Class:	112 C
Waste Class Name:	Acid solutions - containing heavy metals

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		148 C			
Waste Class Name:		Misc. wastes and inorganic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		221 I			
Waste Class Name:		Light fuels			
<u>Waste Detail(s)</u>					
Waste Class:		243 D			
Waste Class Name:		PCB			
<u>Waste Detail(s)</u>					
Waste Class:		145 I			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
<u>Waste Detail(s)</u>					
Waste Class:		263 I			
Waste Class Name:		Misc. waste organic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			
<u>Waste Detail(s)</u>					
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
<u>Waste Detail(s)</u>					
Waste Class:		146 T			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
<u>Waste Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
<u>Waste Detail(s)</u>					
Waste Class:		212 L			
Waste Class Name:		Aliphatic solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class:		121 C			
Waste Class Name:		Alkaline slutions - containing heavy metals			
123	19 of 21	N/234.2	77.9 / 0.07	Public Services & Procurement Canada RPB 300 Laurier Ave	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Ottawa ON K0A 0S5					
<u>Generator Info</u>					
Generator No:	ON5652014			Choice of Contact:	
Approval Years:	As of Nov 2021			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	312 P				
Waste Class Name:	Pathological wastes				
<u>Waste Detail(s)</u>					
Waste Class:	145 L				
Waste Class Name:	Wastes from the use of pigments, coatings and paints				
<u>Waste Detail(s)</u>					
Waste Class:	263 I				
Waste Class Name:	Misc. waste organic chemicals				
<u>Waste Detail(s)</u>					
Waste Class:	146 T				
Waste Class Name:	Other specified inorganic sludges, slurries or solids				
<u>Waste Detail(s)</u>					
Waste Class:	146 R				
Waste Class Name:	Other specified inorganic sludges, slurries or solids				
<u>Waste Detail(s)</u>					
Waste Class:	121 C				
Waste Class Name:	Alkaline slutions - containing heavy metals				
<u>Waste Detail(s)</u>					
Waste Class:	243 D				
Waste Class Name:	PCB				
<u>Waste Detail(s)</u>					
Waste Class:	212 L				
Waste Class Name:	Aliphatic solvents and residues				
<u>Waste Detail(s)</u>					
Waste Class:	112 C				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		Acid solutions - containing heavy metals			
<u>Waste Detail(s)</u>					
Waste Class:		148 C			
Waste Class Name:		Misc. wastes and inorganic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			
<u>Waste Detail(s)</u>					
Waste Class:		145 I			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
<u>Waste Detail(s)</u>					
Waste Class:		221 I			
Waste Class Name:		Light fuels			
<u>Waste Detail(s)</u>					
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			

[123](#)

20 of 21

N/234.2

77.9 / 0.07

Public Services & Procurement Canada
300 Laurier Ave
Ottawa ON K0A 0S5

GEN

Generator Info

Generator No: ON5652014
Approval Years: As of Oct 2022
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 221 I
Waste Class Name: LIGHT FUELS

Waste Detail(s)

Waste Class: 243 D
Waste Class Name: PCBS

Waste Detail(s)

Waste Class: 148 C
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		121 C			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		146 R			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		331 I			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		263 I			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		146 T			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		145 I			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		252 L			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		212 L			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		145 L			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		112 C			
Waste Class Name:		ACID WASTE - HEAVY METALS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2017 Generator Info</u>					
Gen No:	ON5652014			Choice of Contact:	CO_ADMIN
ID:	22333			Phone No Official:	613-736-3207 Ext.
Contaminated Fac:	N			Phone No Admin:	613-736-3207 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	911910			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		Public Services & Procurement Canada			
Gen Div:		RPB			
Gen Op Name:		PSPC			
Gen Op Div:		ESD			
Site Adrs1:		300 Laurier Ave			
Site Bldg:		Esplanade Laurier			
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K0A 0S5			
Site Country:		Canada			
Co Official:		Brian Stoneman			
Co Admin:		Brian Stoneman			
<u>2017 Generator Manifest</u>					
ID:	47115			Sum Received Qty:	160.0
Generator No:	ON5652014			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	203
Waste Code:	252				
<u>2017 Generator Manifest</u>					
ID:	47114			Sum Received Qty:	1140.0
Generator No:	ON5652014			Waste Class Name:	OTHER SPECIFIED INORGANICS
Receiver Type:	035			Count Manifests:	2
Waste Char:	T			District:	203
Waste Code:	146				
<u>2018 Generator Info</u>					
Gen No:	ON5652014			Choice of Contact:	CO_ADMIN
ID:	22536			Phone No Official:	613-736-3207 Ext.
Contaminated Fac:	N			Phone No Admin:	613-736-3207 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	911910			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		Public Services & Procurement Canada			
Gen Div:		RPB			
Gen Op Name:		PSPC			
Gen Op Div:		ESD			
Site Adrs1:		300 Laurier Ave			
Site Bldg:		Esplanade Laurier			
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K0A 0S5			
Site Country:		Canada			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Co Official:		Brian Stoneman			
Co Admin:		Brian Stoneman			
<u>2018 Generator Manifest</u>					
ID:	47000			Sum Received Qty:	269.0
Generator No:	ON5652014			Waste Class Name:	ALKALINE WASTES - HEAVY METALS
Receiver Type:	035			Count Manifests:	2
Waste Char:	C			District:	203
Waste Code:	121				
<u>2018 Generator Manifest</u>					
ID:	47005			Sum Received Qty:	130.0
Generator No:	ON5652014			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	035			Count Manifests:	2
Waste Char:	L			District:	203
Waste Code:	252				
<u>2018 Generator Manifest</u>					
ID:	47002			Sum Received Qty:	1390.0
Generator No:	ON5652014			Waste Class Name:	OTHER SPECIFIED INORGANICS
Receiver Type:	035			Count Manifests:	8
Waste Char:	T			District:	203
Waste Code:	146				
<u>2018 Generator Manifest</u>					
ID:	47006			Sum Received Qty:	80.0
Generator No:	ON5652014			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	035			Count Manifests:	1
Waste Char:	I			District:	203
Waste Code:	263				
<u>2018 Generator Manifest</u>					
ID:	47004			Sum Received Qty:	3280.0
Generator No:	ON5652014			Waste Class Name:	ALIPHATIC SOLVENTS
Receiver Type:	035			Count Manifests:	2
Waste Char:	L			District:	203
Waste Code:	212				
<u>2018 Generator Manifest</u>					
ID:	46999			Sum Received Qty:	132.0
Generator No:	ON5652014			Waste Class Name:	ACID WASTE - HEAVY METALS
Receiver Type:	035			Count Manifests:	2
Waste Char:	C			District:	203
Waste Code:	112				
<u>2018 Generator Manifest</u>					
ID:	47001			Sum Received Qty:	180.0
Generator No:	ON5652014			Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES
Receiver Type:	035			Count Manifests:	2
Waste Char:	I			District:	203
Waste Code:	145				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2018 Generator Manifest</u>					
ID:	47003			Sum Received Qty:	1845.0
Generator No:	ON5652014			Waste Class Name:	ALIPHATIC SOLVENTS
Receiver Type:	035			Count Manifests:	1
Waste Char:	I			District:	203
Waste Code:	212				
<u>2019 Generator Info</u>					
Gen No:	ON5652014			Choice of Contact:	CO_ADMIN
ID:	22615			Phone No Official:	613-736-3207 Ext.
Contaminated Fac:	N			Phone No Admin:	613-736-3207 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	911910			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		Public Services & Procurement Canada			
Gen Div:		RPB			
Gen Op Name:		PSPC			
Gen Op Div:		ESD			
Site Adrs1:		300 Laurier Ave			
Site Bldg:		Esplanade Laurier			
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K0A 0S5			
Site Country:		Canada			
Co Official:		Brian Stoneman			
Co Admin:		Brian Stoneman			
<u>2019 Generator Manifest</u>					
ID:	46688			Sum Received Qty:	40.0
Generator No:	ON5652014			Waste Class Name:	ALKALINE WASTES - HEAVY METALS
Receiver Type:	035			Count Manifests:	1
Waste Char:	C			District:	203
Waste Code:	121				
<u>2019 Generator Manifest</u>					
ID:	46690			Sum Received Qty:	50.0
Generator No:	ON5652014			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	203
Waste Code:	252				
<u>2019 Generator Manifest</u>					
ID:	46689			Sum Received Qty:	870.0
Generator No:	ON5652014			Waste Class Name:	OTHER SPECIFIED INORGANICS
Receiver Type:	035			Count Manifests:	5
Waste Char:	T			District:	203
Waste Code:	146				
<u>2020 Generator Info</u>					
Gen No:	ON5652014			Choice of Contact:	CO_OFFICIAL
ID:	22347			Phone No Official:	613-736-3207 Ext.
Contaminated Fac:	N			Phone No Admin:	613-816-2543 Ext.

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	911910			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		Public Services & Procurement Canada			
Gen Div:		RPB			
Gen Op Name:		PSPC			
Gen Op Div:		ESD			
Site Adrs1:		300 Laurier Ave			
Site Bldg:		Esplanade Laurier			
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K0A 0S5			
Site Country:		Canada			
Co Official:		Brian Stoneman			
Co Admin:		Andre Latreille			
<u>2020 Generator Manifest</u>					
ID:	43330			Sum Received Qty:	20.0
Generator No:	ON5652014			Waste Class Name:	ALKALINE WASTES - HEAVY METALS
Receiver Type:	035			Count Manifests:	1
Waste Char:	C			District:	203
Waste Code:	121				
<u>2020 Generator Manifest</u>					
ID:	43333			Sum Received Qty:	8330.0
Generator No:	ON5652014			Waste Class Name:	ALIPHATIC SOLVENTS
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	402
Waste Code:	212				
<u>2020 Generator Manifest</u>					
ID:	43332			Sum Received Qty:	120.0
Generator No:	ON5652014			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	203
Waste Code:	252				
<u>2020 Generator Manifest</u>					
ID:	43331			Sum Received Qty:	790.0
Generator No:	ON5652014			Waste Class Name:	OTHER SPECIFIED INORGANICS
Receiver Type:	035			Count Manifests:	2
Waste Char:	T			District:	203
Waste Code:	146				
<u>2021 Generator Info</u>					
Gen No:	ON5652014			Choice of Contact:	CO_OFFICIAL
ID:	22617			Phone No Official:	613-736-3207 Ext.
Contaminated Fac:	N			Phone No Admin:	613-816-2543 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	911910			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		Public Services & Procurement Canada			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gen Div:		RPB			
Gen Op Name:		PSPC			
Gen Op Div:		ESD			
Site Adrs1:		300 Laurier Ave			
Site Bldg:		Esplanade Laurier			
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K0A 0S5			
Site Country:		Canada			
Co Official:		Brian Stoneman			
Co Admin:		Andre Latreille			
<u>2021 Generator Manifest</u>					
ID:	44955			Sum Received Qty:	210.0
Generator No:	ON5652014			Waste Class Name:	OTHER SPECIFIED INORGANICS
Receiver Type:	035			Count Manifests:	1
Waste Char:	T			District:	203
Waste Code:	146				
<u>2021 Generator Manifest</u>					
ID:	44954			Sum Received Qty:	5.0
Generator No:	ON5652014			Waste Class Name:	ALKALINE WASTES - HEAVY METALS
Receiver Type:	035			Count Manifests:	1
Waste Char:	C			District:	203
Waste Code:	121				
<u>2021 Generator Manifest</u>					
ID:	44956			Sum Received Qty:	160.0
Generator No:	ON5652014			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	203
Waste Code:	252				
123	21 of 21	N/234.2	77.9 / 0.07	300 Laurier Avenue Ottawa ON	FRST
Tank System ID:	55263			Tank Sys Prov F:	Ontario
EC No:	55090			Tank Sys PO BOX:	
Internal No:				Tank Sys Postal Cd:	
Is Perm Withdrwl:	FALSE			Sys Record City:	
Removed Date:				Sys Record Prov E:	
Withdrawn Date:				Sys Record Prov F:	
Temp Withdrawn Dt:				Sys Record PO BOX:	
Tank Use E:	Power Generation			Sys Rec Postal Cd:	
Tank Use F:	Production d'énergie			System Rec Same as:	TRUE
Year of Manufact:				Location Latitude:	
Emerg Plan Same as:	TRUE			Location Longitude:	
Operator Contact:				Creation Date:	28-Oct-2020 00:00:00
Owner Contact:				Creation By:	Section 19
Tank System City:	Ottawa			Modified Date:	30-Nov-2020 00:00:00
Tank Sys Prov E:	Ontario			Modified By:	
Tank Use:					
Tank Manufacturer:	AT&S Division GilFab				
Tank System Address:	300 Laurier Avenue				
Sys Record Address:					
System Descr:	Emergency Generator-Based Building Storage Tanks System (3 AST) located at the Esplanade Laurier Building,				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
				300 Laurier Avenue, Ottawa, Ontario. 10,200 D / W steel pressure-rated main tanks supply the 1,217 L S / W steel day tank which is located in a steel rupture basin. The main tanks, duplex pumpset, pump control panel and automatic tank gauging system are located in Diesel Room P-301. The day tank is located in generator room P-124-B.	
				Certification System Installer: Certification System Remover: Group Name: Master Group Name: Owner Email: Operator Email: Land Owner E: Land Owner F:	
				Federal entity under Financial Administration Act Entité fédérale sous la loi sur la gestion des finances publiques	
				<u>Service Months</u>	
				Service Months E: Service Months F:	August Août
				Service Months E: Service Months F:	May Mai
				Service Months E: Service Months F:	November Novembre
				Service Months E: Service Months F:	July Juillet
				Service Months E: Service Months F:	December Décembre
				Service Months E: Service Months F:	February Février
				Service Months E: Service Months F:	January Janvier
				Service Months E: Service Months F:	October Octobre
				Service Months E: Service Months F:	March Mars
				Service Months E: Service Months F:	June Juin
				Service Months E: Service Months F:	September Septembre
				Service Months E: Service Months F:	April Avril
				<u>Tanks Details</u>	
				Tank ID: Tank Capacity: Tank Type E: Tank Type F: Date of Install: Date Withdrawn Tk: Date Removed Tank: Tank Desc: Tank Stdd No E: Tank Std No F: Tank Std No Other:	91328 1217 Aboveground Hors sol 2008 1,217L S/W steel day tank which is located in a steel rupture basin located in generator room P-124-B. ULC-S602 ULC-S602
				Dt Withdrwn Piping: Date Remvd Piping: Tk Type of Pump E: Tk Type of Pump F: Piping Type E: Piping Type F: Piping Diam Unit:	 No oil-water separator Aucun Séparateur huile-eau Aboveground Hors sol mm

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Tank Constr Material E:		Steel			
Tank Constr Material F:		Acier			
Tank Constr Material Other:					
Internal No:					
Tank Content E:		Diesel			
Tank Content F:		Diesel			
Tank Content Other:					
Piping Diameter:		20;25;50			
Spill Containment E:		None			
Spill Containment F:		Aucun			
Spill Containment Other:					
Product Transfer Area:		same as main tank #1			
Date Wthdrwn Other					
Component:					
Date Removed Other					
Component:					
 <u>Piping Construction Materials</u>					
Component E:		Steel			
Component F:		Acier			
Other:					
 <u>Piping Secondary Containment</u>					
Tank ID:		91328			
Component E:		None			
Component F:		Aucun			
Other:					
 <u>Tank Corrosion Protection</u>					
Component E:		Painted			
Component F:		Peinturé			
Other:					
 <u>Piping Corrosion Protection</u>					
Component E:		Painted			
Component F:		Peinturé			
Other:					
 <u>Tank Leak Detection</u>					
Component E:		Continuous external tank leak monitoring (Sensor cable system)			
Component F:		Surveillance externe et en continu de l'étanchéité des reservoirs			
Other:					
 <u>Tank Leak Detection</u>					
Component E:		Visual inspection			
Component F:		Inspection visuelle			
Other:					
 <u>Piping Leak Detection</u>					
Component E:		Visual inspection			
Component F:		Inspection visuelle			
Other:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sump Leak Detection</u>					
Component E:		No sump for storage tank system			
Component F:		Aucun puisard pour le système de stockage			
Other:					
<u>Tank Secondary Containment</u>					
Component E:		Containment tank assembly			
Component F:		Ensemble réservoir de confinement			
Other:					
<u>Tank Overflow Protection</u>					
Component E:		Overfill alarm and overfill automatic shutoff			
Component F:		Alarme anti-débordement et dispositif d'arrêt automatique anti-débordement			
Other:					
<u>Tanks Details</u>					
Tank ID:	91326			<i>Dt Withdrwn Piping:</i>	
Tank Capacity:	10200			<i>Date Remvd Piping:</i>	
Tank Type E:	Aboveground			<i>Tk Type of Pump E:</i>	No oil-water separator
Tank Type F:	Hors sol			<i>Tk Type of Pump F:</i>	Aucun Séparateur huile-eau
Date of Install:	2008			<i>Piping Type E:</i>	Aboveground
Date Withdrawn Tk:				<i>Piping Type F:</i>	Hors sol
Date Removed Tank:				<i>Piping Diam Unit:</i>	mm
Tank Desc:	10,200L D/W steel pressure-rated main tank #1 supply the 1,217 L S/W steel day tank. Located in Diesel Room P-301				
Tank Stdd No E:	Other				
Tank Std No F:	Autre				
Tank Std No Other:	ASME Standard no additional information				
Tank Constr Material E:	Steel				
Tank Constr Material F:	Acier				
Tank Constr Material Other:					
Internal No:	Diesel Tank #1 – 10-250-02				
Tank Content E:	Diesel				
Tank Content F:	Diesel				
Tank Content Other:					
Piping Diameter:	25;50;100				
Spill Containment E:	Spill box at fill point (aboveground tank)				
Spill Containment F:	Boîte de confinement de déversement au site de remplissage (réservoir hors sol)				
Spill Containment Other:					
Product Transfer Area:	The PTA near the fill connection consists of concrete pad next to the entrance and exit to the parking garage. The fuel delivery truck parks on the asphalt on Gloucester Street on the East-Southeast side of the building approximately 10 metres from the fill station area. The truck will be visible from the fill connections during the entire product transfer operation.				
Date Withdrwn Other					
Component:					
Date Removed Other					
Component:					
<u>Piping Construction Materials</u>					
Component E:	Steel				
Component F:	Acier				
Other:					
<u>Piping Secondary Containment</u>					
Tank ID:	91326				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Component E: Component F: Other:		None Aucun			
<u>Tank Corrosion Protection</u>					
Component E: Component F: Other:		Painted Peinturé			
<u>Piping Corrosion Protection</u>					
Component E: Component F: Other:		Painted Peinturé			
<u>Tank Leak Detection</u>					
Component E: Component F: Other:		Automatic tank gauging Jaugeage automatique			
<u>Tank Leak Detection</u>					
Component E: Component F: Other:		Interstitial monitoring – double walled tank Surveillance interstitielle- réservoir à double paroi			
<u>Tank Leak Detection</u>					
Component E: Component F: Other:		Visual inspection Inspection visuelle			
<u>Piping Leak Detection</u>					
Component E: Component F: Other:		Visual inspection Inspection visuelle			
<u>Sump Leak Detection</u>					
Component E: Component F: Other:		No sump for storage tank system Aucun puisard pour le système de stockage			
<u>Tank Secondary Containment</u>					
Component E: Component F: Other:		Other impermeable barrier (specify) Autre barrière imperméable (spécifiez) Concrete dyke			
<u>Tank Secondary Containment</u>					
Component E: Component F: Other:		Double Walled Double paroi			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Tank Overflow Protection</u>					
Component E:		Overfill alarm and overfill automatic shutoff			
Component F:		Alarme anti-débordement et dispositif d'arrêt automatique anti-débordement			
Other:					
<u>Tank Overflow Protection</u>					
Component E:		Method – trained personnel in attendance at all times			
Component F:		Méthode - Personels qualifiés présents en tout temps			
Other:					
<u>Tanks Details</u>					
Tank ID:	91327			<i>Dt Withdrwn Piping:</i>	
Tank Capacity:	10200			<i>Date Remvd Piping:</i>	
Tank Type E:	Aboveground			<i>Tk Type of Pump E:</i>	No oil-water separator
Tank Type F:	Hors sol			<i>Tk Type of Pump F:</i>	Aucun Séparateur huile-eau
Date of Install:	2008			<i>Piping Type E:</i>	Aboveground
Date Withdrawn Tk:				<i>Piping Type F:</i>	Hors sol
Date Removed Tank:				<i>Piping Diam Unit:</i>	mm
Tank Desc:	10,200L D/W steel pressure-rated main tank #2 supply the 1,217 L S/W steel day tank. Located in Diesel Room P-301				
Tank Stdd No E:	Other				
Tank Std No F:	Autre				
Tank Std No Other:	ASME Standard no additional information				
Tank Constr Material E:	Steel				
Tank Constr Material F:	Acier				
Tank Constr Material Other:					
Internal No:					
Tank Content E:	Diesel				
Tank Content F:	Diesel				
Tank Content Other:					
Piping Diameter:	25;50;100				
Spill Containment E:	Spill box at fill point (aboveground tank)				
Spill Containment F:	Boîte de confinement de déversement au site de remplissage (réservoir hors sol)				
Spill Containment Other:					
Product Transfer Area:	same as Main Tank #1				
Date Withdrwn Other					
Component:					
Date Removed Other					
Component:					
<u>Piping Construction Materials</u>					
Component E:	Steel				
Component F:	Acier				
Other:					
<u>Piping Secondary Containment</u>					
Tank ID:	91327				
Component E:	None				
Component F:	Aucun				
Other:					
<u>Tank Corrosion Protection</u>					
Component E:	Painted				
Component F:	Peinturé				
Other:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Piping Corrosion Protection</u>					
Component E:		Painted			
Component F:		Peinturé			
Other:					
<u>Tank Leak Detection</u>					
Component E:		Automatic tank gauging			
Component F:		Jaugeage automatique			
Other:					
<u>Tank Leak Detection</u>					
Component E:		Visual inspection			
Component F:		Inspection visuelle			
Other:					
<u>Tank Leak Detection</u>					
Component E:		Interstitial monitoring – double walled tank			
Component F:		Surveillance interstitielle- réservoir à double paroi			
Other:					
<u>Piping Leak Detection</u>					
Component E:		Visual inspection			
Component F:		Inspection visuelle			
Other:					
<u>Sump Leak Detection</u>					
Component E:		No sump for storage tank system			
Component F:		Aucun puisard pour le système de stockage			
Other:					
<u>Tank Secondary Containment</u>					
Component E:		Other impermeable barrier (specify)			
Component F:		Autre barrière imperméable (spécifiez)			
Other:		Concrete dyke			
<u>Tank Secondary Containment</u>					
Component E:		Double Walled			
Component F:		Double paroi			
Other:					
<u>Tank Overflow Protection</u>					
Component E:		Method – trained personnel in attendance at all times			
Component F:		Méthode - Personels qualifiés présents en tout temps			
Other:					
<u>Tank Overflow Protection</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Component E:		Overfill alarm and overfill automatic shutoff			
Component F:		Alarme anti-débordement et dispositif d'arrêt automatique anti-débordement			
Other:					
124	1 of 14	NNE/234.3	76.9 / -0.93	SHELL CANADA PRODUCTS LTD. 154 O'CONNER STREET SERVICE STATION OTTAWA CITY ON	SPL
Ref No:		105417		Municipality No:	20101
Year:				Nature of Damage:	
Incident Dt:		9/20/1994		Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:		9/20/1994		Impact to Health:	
Dt Document Closed:				Agency Involved:	
Site No:					
MOE Response:					
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					
Site Name:					
Site Address:					
Site Region:					
Site Municipality:		OTTAWA CITY			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:					
Client Type:					
Source Type:					
Incident Cause:		UNDERGROUND TANK LEAK			
Incident Preceding Spill:					
Incident Reason:		UNKNOWN			
Incident Summary:		SHELL-UKN QTY WASTE OIL TO GROUND,UG TANK FAILED PRESSURE TEST.			
Environment Impact:		POSSIBLE			
Health Env Consequence:					
Nature of Impact:		Soil contamination			
Contaminant Qty:					
Contaminant Qty 1:					
Contaminant Unit:					
Contaminant Code:					
Contaminant Name:					
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:		LAND			
Activity Preceding Spill:					
Property 2nd Watershed:					
Property Tertiary Watershed:					
Sector Type:					
SAC Action Class:					
Call Report Locatn Geodata:					
Time Reported:					
System Facility Address:					
124	2 of 14	NNE/234.3	76.9 / -0.93	SHELL CANADA PRODUCTS LTD. 154 O'CONNOR ST. SHELL CANADA GAS STATION SERVICE STATION OTTAWA CITY ON K2P 1T5	SPL

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
124	4 of 14	NNE/234.3	76.9 / -0.93	BYTOWN TOWING & AUTOCARE LTD 154 O'CONNOR ST AT GLOUCESTER OTTAWA ON K2P 1T5	FSTH
License Issue Date: Tank Status: Tank Status As Of: Operation Type: Facility Type:		9/6/2002 Pending Renewal August 2007 Retail Fuel Outlet Gasoline Station - Full Serve			
--Details--					
Status:		Active			
Year of Installation:		1980			
Corrosion Protection:					
Capacity:		22700			
Tank Fuel Type:		Liquid Fuel Single Wall UST - Gasoline			
Status:		Active			
Year of Installation:		1980			
Corrosion Protection:					
Capacity:		22700			
Tank Fuel Type:		Liquid Fuel Single Wall UST - Gasoline			
Status:		Active			
Year of Installation:		1980			
Corrosion Protection:					
Capacity:		22700			
Tank Fuel Type:		Liquid Fuel Single Wall UST - Gasoline			
124	5 of 14	NNE/234.3	76.9 / -0.93	BYTOWN TOWING & AUTOCARE LTD 154 O'CONNOR ST AT GLOUCESTER OTTAWA ON K2P 1T5	FSTH
License Issue Date: Tank Status: Tank Status As Of: Operation Type: Facility Type:		9/6/2002 Licensed December 2008 Retail Fuel Outlet Gasoline Station - Full Serve			
--Details--					
Status:		Active			
Year of Installation:		1979			
Corrosion Protection:					
Capacity:		22700			
Tank Fuel Type:		Liquid Fuel Single Wall UST - Gasoline			
Status:		Active			
Year of Installation:		1979			
Corrosion Protection:					
Capacity:		22700			
Tank Fuel Type:		Liquid Fuel Single Wall UST - Gasoline			
Status:		Active			
Year of Installation:		1979			
Corrosion Protection:					
Capacity:		22700			
Tank Fuel Type:		Liquid Fuel Single Wall UST - Gasoline			
Status:		Active			
Year of Installation:		1980			
Corrosion Protection:					
Capacity:		22700			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Tank Fuel Type:		Liquid Fuel Single Wall UST - Gasoline			
124	6 of 14	NNE/234.3	76.9 / -0.93	154 O'Connor Street Ottawa ON K2P 1T5	EHS
Order No: 20090529016 Status: C Report Type: Standard Report Report Date: 6/9/2009 Date Received: 5/29/2009 Previous Site Name: Lot/Building Size: Lot: 30 m X 30 m Additional Info Ordered: Fire Insur. Maps and/or Sire Plans		Nearest Intersection: O'Connor Street & Gloucester Street Municipality: Ottawa Client Prov/State: ON Search Radius (km): 0.25 X: -75.696715 Y: 45.418523			
124	7 of 14	NNE/234.3	76.9 / -0.93	BYTOWN TOWING & AUTOCARE LTD 154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	DTNK
<u>Delisted Expired Fuel Safety Facilities</u>					
Instance No: 10905102 Status: EXPIRED Instance ID: 51358 Instance Type: FS Piping Instance Creation Dt: Instance Install Dt: Item Description: Manufacturer: Model: Serial No: ULC Standard: Quantity: Unit of Measure: Overfill Prot Type: Creation Date: Next Periodic Str DT: TSSA Base Sched Cycle 2: TSSAMax Hazard Rank 1: TSSA Risk Based Periodic Yn: TSSA Volume of Directives: TSSA Periodic Exempt: TSSA Statutory Interval: TSSA Recd Insp Interva: TSSA Recd Tolerance: TSSA Program Area: TSSA Program Area 2: Description: FS Piping Original Source: EXP Record Date: Up to Mar 2012		Expired Date: Max Hazard Rank: Facility Location: Facility Type: Fuel Type 2: Fuel Type 3: Panam Related: Panam Venue Nm: External Identifier: Item: Piping Steel: Piping Galvanized: Tank Single Wall St: Piping Underground: Tank Underground: Source:			
124	8 of 14	NNE/234.3	76.9 / -0.93	BYTOWN TOWING & AUTOCARE LTD 154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	DTNK

Delisted Expired Fuel Safety Facilities

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Instance No: 10905070 Status: EXPIRED Instance ID: 51351 Instance Type: FS Piping Instance Creation Dt: Instance Install Dt: Item Description: Manufacturer: Model: Serial No: ULC Standard: Quantity: Unit of Measure: Overfill Prot Type: Creation Date: Next Periodic Str DT: TSSA Base Sched Cycle 2: TSSAMax Hazard Rank 1: TSSA Risk Based Periodic Yn: TSSA Volume of Directives: TSSA Periodic Exempt: TSSA Statutory Interval: TSSA Recd Insp Interva: TSSA Recd Tolerance: TSSA Program Area: TSSA Program Area 2: Description: FS Piping Original Source: EXP Record Date: Up to Mar 2012 Expired Date: Max Hazard Rank: Facility Location: Facility Type: Fuel Type 2: Fuel Type 3: Panam Related: Panam Venue Nm: External Identifier: Item: Piping Steel: Piping Galvanized: Tank Single Wall St: Piping Underground: Tank Underground: Source:					
124	9 of 14	NNE/234.3	76.9 / -0.93	Shell Canada Products 154 O+Connor Street Ottawa ON K2P 1T5	GEN
<u>Generator Info</u>					
Generator No: ON7522524 Approval Years: 2009 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: Other Gasoline Stations Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 447190					
<u>Waste Detail(s)</u>					
Waste Class: 221 Waste Class Name: LIGHT FUELS					
<u>Waste Detail(s)</u>					
Waste Class: 251 Waste Class Name: OIL SKIMMINGS & SLUDGES					
124	10 of 14	NNE/234.3	76.9 / -0.93	Shell Canada Products 154 O+Connor Street Ottawa ON K2P 1T5	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON7522524			Choice of Contact:	
Approval Years:	2010			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	447190
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Other Gasoline Stations			
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
124	11 of 14	NNE/234.3	76.9 / -0.93	BYTOWN TOWING & AUTOCARE LTD 154 O'CONNOR ST AT GLOUCESTER OTTAWA ON K2P 1T5	DTNK

**Delisted Expired Fuel Safety
Facilities**

Instance No:	9587344	Expired Date:	3/24/2013 15:03
Status:	EXPIRED	Max Hazard Rank:	
Instance ID:		Facility Location:	
Instance Type:	FS Facility	Facility Type:	
Instance Creation Dt:		Fuel Type 2:	
Instance Install Dt:		Fuel Type 3:	
Item Description:		Panam Related:	
Manufacturer:		Panam Venue Nm:	
Model:		External Identifier:	
Serial No:		Item:	
ULC Standard:		Piping Steel:	
Quantity:		Piping Galvanized:	
Unit of Measure:		Tank Single Wall St:	
Overfill Prot Type:		Piping Underground:	
Creation Date:		Tank Underground:	
Next Periodic Str DT:		Source:	
TSSA Base Sched Cycle 2:			
TSSAMax Hazard Rank 1:			
TSSA Risk Based Periodic Yn:			
TSSA Volume of Directives:			
TSSA Periodic Exempt:			
TSSA Statutory Interval:			
TSSA Recd Insp Interva:			
TSSA Recd Tolerance:			
TSSA Program Area:			
TSSA Program Area 2:			
Description:			
Original Source:	EXP		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Record Date:		Up to May 2013			
124	12 of 14	NNE/234.3	76.9 / -0.93	BYTOWN TOWING & AUTOCARE LTD 154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	EXP
Inventory No:		10905094	Tank Material:		Fiberglass (FRP)
Inventory Status:		EXPIRED	Corrosion Protect:		Fiberglass
Installation Year:		1980	Overfill Protection:		
Capacity:		22700	Inventory Context:		FS Liquid Fuel Tank
Capacity Unit:			Inventory Item:		FS LIQUID FUEL TANK
Tank Type:					
Manufacturer:					
Model:					
Description:		2009VBS			
Previous Fuel Type:		Gasoline			
124	13 of 14	NNE/234.3	76.9 / -0.93	BYTOWN TOWING & AUTOCARE LTD 154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	EXP
Inventory No:		10905079	Tank Material:		Fiberglass (FRP)
Inventory Status:		EXPIRED	Corrosion Protect:		Fiberglass
Installation Year:		1980	Overfill Protection:		
Capacity:		22700	Inventory Context:		FS Liquid Fuel Tank
Capacity Unit:			Inventory Item:		FS LIQUID FUEL TANK
Tank Type:					
Manufacturer:					
Model:					
Description:		2009VBS; 2008V; Veeder Root			
Previous Fuel Type:		Gasoline			
124	14 of 14	NNE/234.3	76.9 / -0.93	BYTOWN TOWING & AUTOCARE LTD 154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	EXP
Inventory No:		10905061	Tank Material:		Fiberglass (FRP)
Inventory Status:		EXPIRED	Corrosion Protect:		Fiberglass
Installation Year:		1980	Overfill Protection:		
Capacity:		22700	Inventory Context:		FS Liquid Fuel Tank
Capacity Unit:			Inventory Item:		FS LIQUID FUEL TANK
Tank Type:					
Manufacturer:					
Model:					
Description:		2009VBS; 2008V; Veeder Root			
Previous Fuel Type:		Gasoline			
125	1 of 1	ESE/235.6	75.9 / -1.93	324 Somerset Street West Ottawa ON K2P 0J9	EHS
Order No:		20041214013	Nearest Intersection:		Somerset Street West
Status:		C	Municipality:		
Report Type:		Custom Report	Client Prov/State:		ON
Report Date:		12/16/04	Search Radius (km):		0.25
Date Received:		12/14/04	X:		-75.694783
Previous Site Name:			Y:		45.415917
Lot/Building Size:					
Additional Info Ordered:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
126	1 of 1	E/235.7	75.9 / -1.93	311 Somerset St W Ottawa ON	WWIS
Well ID: 7382782 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z338246 Tag: A302969 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 03/18/2021 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID: 1008639334 Depth M: Year Completed: 2021 Well Completed Dt: 02/19/2021 Audit No: Z338246 Path: Tag No: A302969 Contractor: 7241 Latitude: 45.416179135269 Longitude: -75.6946725832926 Y: 45.41617912839754 X: -75.6946724209724					
<u>Bore Hole Information</u>					
Bore Hole ID: 1008639334 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 02/19/2021 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 18 East83: 445647.00 North83: 5029419.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID: 1009823460 Layer: 3 Color: 2 General Color: GREY Material 1: 06 Material 1 Desc: SILT Material 2: 05					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2 Desc:		CLAY			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		5.0			
Formation End Depth:		9.0			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1009823459			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:		01			
Material 2 Desc:		FILL			
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		2.0			
Formation End Depth:		5.0			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1009823461			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		9.0			
Formation End Depth:		20.0			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1009823458			
Layer:		1			
Color:		2			
General Color:		GREY			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		0.0			
Formation End Depth:		2.0			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1009824634			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		3			
Plug From:		9.0			
Plug To:		20.0			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009824633			
Layer:		2			
Plug From:		1.0			
Plug To:		9.0			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009824632			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1009826068			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1009718364			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1009826494			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		10.0			
Casing Diameter:		2.046999931335449			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1009826907			
Layer:		1			
Slot:		10			
Screen Top Depth:		10.0			
Screen End Depth:		20.0			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		2.375			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:	1009827322				
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:	m				
Rate UOM:	LPM				
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:	0				
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:	1009825630				
Diameter:	4.5				
Depth From:	0.0				
Depth To:	20.0				
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
127	1 of 1	ESE/235.7	75.9 / -1.93	322 SOMERSET STREET WEST OTTAWA ON	HINC
External File Num:	FS INC 0611-04091				
Fuel Occurrence Type:	Pipeline Strike				
Date of Occurrence:	11/27/2006				
Fuel Type Involved:	Natural Gas				
Status Desc:	Completed - Causal Analysis(End)				
Job Type Desc:	Incident/Near-Miss Occurrence (FS)				
Oper. Type Involved:	Commercial (e.g. restaurant, business unit, etc)				
Service Interruptions:	No				
Property Damage:	No				
Fuel Life Cycle Stage:	Utilization				
Root Cause:	Root Cause: Equipment/Material/Component:No Procedures:Yes Maintenance:No Design:No Training:Yes Management:No Human Factors:No				
Reported Details:					
Fuel Category:	Gaseous Fuel				
Occurrence Type:	Incident				
Affiliation:	Industry Stakeholder (Licensee/Registration/Certificate Holder, Facility Owner, etc.)				
County Name:	Ottawa				
Approx. Quant. Rel:					
Nearby body of water:					
Enter Drainage Syst.:					
Approx. Quant. Unit:					
Environmental Impact:					
128	1 of 1	S/235.9	77.9 / 0.07	19 MCLAREN ON	WWIS
Well ID:	7233876			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	12/15/2014
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z188288			Contractor:	7241
Tag:	A173762			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/723\7233876.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	11/06/2014				
Year Completed:	2014				
Depth (m):	6.1				
Latitude:	45.4143425525272				
Longitude:	-75.6976790084398				
X:	-75.69767884602885				
Y:	45.41434254629924				
Path:	723\7233876.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1005260627			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445410.00
Code OB Desc:				North83:	5029217.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	11/06/2014			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005436710				
Layer:	4				
Color:	2				
General Color:	GREY				
Material 1:	05				
Material 1 Desc:	CLAY				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	85				
Material 3 Desc:	SOFT				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation Top Depth:		4.880000114440918			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1005436708			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		05			
Material 3 Desc:		CLAY			
Formation Top Depth:		1.2200000286102295			
Formation End Depth:		3.0999999046325684			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1005436709			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		3.0999999046325684			
Formation End Depth:		4.880000114440918			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1005436707			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		28			
Material 3 Desc:		SAND			
Formation Top Depth:		0.0			
Formation End Depth:		1.2200000286102295			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1005436720			
Layer:		3			
Plug From:		2.740000009536743			
Plug To:		6.099999904632568			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005436718			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005436719			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005436717			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:		AIR PERCUSSION AND DIRECT PUSH			
<u>Pipe Information</u>					
Pipe ID:		1005436706			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005436713			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005436714			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		6.099999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water ID: 1005436712 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: m					
<u>Hole Diameter</u>					
Hole ID: 1005436711 Diameter: 15.319999694824219 Depth From: 0.0 Depth To: 6.099999904632568 Hole Depth UOM: m Hole Diameter UOM: cm					
129	1 of 1	SSW/236.3	78.9 / 1.07	KENT ST Ottawa ON	WWIS
Well ID: 7344655 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Z287916 Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info: PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7344655.pdf					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: Year Completed: Depth (m): Latitude: 45.414401261268 Longitude: -75.6983826515015 X: -75.69838248986439 Y: 45.41440125401358 Path: 734\7344655.pdf					
<u>Bore Hole Information</u>					
Bore Hole ID: 1007687164 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole:					
Elevation: Elevrc: Zone: 18 East83: 445355.00 North83: 5029224.00 Org CS: UTM83					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Cluster Kind: Date Completed: Remarks: Location Method Desc: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:		on Water Well Record		UTMRC: UTMRC Desc: Location Method:	4 margin of error : 30 m - 100 m WWF
<u>Pipe Information</u>					
Pipe ID: Casing No: Comment: Alt Name:		1008243512 0			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc: Pump Test ID: Pump Set At: Static Level: Final Level After Pumping: Recommended Pump Depth: Pumping Rate: Flowing Rate: Recommended Pump Rate: Levels UOM: Rate UOM: Water State After Test Code: Water State After Test: Pumping Test Method: Pumping Duration HR: Pumping Duration MIN: Flowing:		1008244304			
		ft GPM			
		0			
130	1 of 1	E/237.3	75.9 / -1.93	ON	WWIS
Well ID: Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Tag: Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:		7211110 Monitoring Abandoned-Other Z096856 A152341 OTTAWA CITY		Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: Selected Flag: Abandonment Rec: Contractor: Form Version: Owner: County: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	11/14/2013 TRUE Yes 6894 7 OTTAWA-CARLETON
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/721\7211110.pdf			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:					
Year Completed:					
Depth (m):					
Latitude:		45.4162783751036			
Longitude:		-75.6946354577708			
X:		-75.69463529630052			
Y:		45.416278368040004			
Path:		721\7211110.pdf			
 <u>Bore Hole Information</u>					
Bore Hole ID:		1004633069		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:				UTMRC Desc:	
Remarks:				Location Method:	
Location Method Desc:		on Water Well Record		margin of error : 10 - 30 m	
Elevrc Desc:				wwr	
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1004895719			
Layer:		1			
Plug From:		57.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1004895718			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1004895711			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1004895715			
Layer:					
Material:					
Open Hole or Material:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From: Depth To: Casing Diameter: Casing Diameter UOM: inch Casing Depth UOM: ft					
<u>Construction Record - Screen</u>					
Screen ID: 1004895716 Layer: Slot: Screen Top Depth: Screen End Depth: Screen Material: Screen Depth UOM: ft Screen Diameter UOM: inch Screen Diameter:					
<u>Water Details</u>					
Water ID: 1004895714 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: ft					
<u>Hole Diameter</u>					
Hole ID: 1004895713 Diameter: Depth From: Depth To: Hole Depth UOM: ft Hole Diameter UOM: inch					
131	1 of 1	ENE/238.3	75.9 / -1.93	335 Cooper Street Ottawa ON K2P 0G5	EHS
Order No: 21041400015 Status: C Report Type: Standard Report Report Date: 19-APR-21 Date Received: 14-APR-21 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.6947608 Y: 45.4171295					
132	1 of 1	W/238.7	76.6 / -1.23	KENT ST Ottawa ON	WWIS
Well ID: 7344659 Construction Date: Use 1st: Use 2nd: Final Well Status: Abandoned-Other Water Type: Casing Material: Audit No: Z286432 Tag: A157400 Constructn Method:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 10/22/2019 Selected Flag: TRUE Abandonment Rec: Yes Contractor: 7543 Form Version: 7 Owner:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:			NEPEAN TOWNSHIP	County: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	OTTAWA-CARLETON
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7344659.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		09/19/2019			
Year Completed:		2019			
Depth (m):					
Latitude:		45.4169618920396			
Longitude:		-75.7006253201517			
X:		-75.70062515816296			
Y:		45.41696188495833			
Path:		734\7344659.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1007687176		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445182.00
Code OB Desc:				North83:	5029510.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		09/19/2019		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008087393			
Layer:		2			
Plug From:		0.5			
Plug To:		21.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008087395			
Layer:		1			
Plug From:		0.0			
Plug To:		0.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1008087394			
Layer:		3			
Plug From:		21.0			
Plug To:					
Plug Depth UOM:		ft			
<u>Pipe Information</u>					
Pipe ID:		1008084813			
Casing No:		0			
Comment:					
Alt Name:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008090671			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
133	1 of 1	E/240.2	75.9 / -1.93	311 SOMERSET Ottawa ON	WWIS
Well ID:	7391112			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06/29/2021
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z364080			Contractor:	7241
Tag:	A302972			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/739\7391112.pdf				
<u>Additional Detail(s) (Map)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Completed Date:		05/26/2021			
Year Completed:		2021			
Depth (m):					
Latitude:		45.4162876088694			
Longitude:		-75.6945972286121			
X:		-75.69459706670887			
Y:		45.41628760214662			
Path:		739\7391112.pdf			
 <u>Bore Hole Information</u>					
Bore Hole ID:	1008704346			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445653.00
Code OB Desc:				North83:	5029431.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	05/26/2021			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1009852393				
Layer:	3				
Color:	6				
General Color:	BROWN				
Material 1:	05				
Material 1 Desc:	CLAY				
Material 2:	28				
Material 2 Desc:	SAND				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	2.740000009536743				
Formation End Depth:	3.9600000381469727				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1009852394				
Layer:	4				
Color:	2				
General Color:	GREY				
Material 1:	05				
Material 1 Desc:	CLAY				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	3.9600000381469727				
Formation End Depth:	10.670000076293945				
Formation End Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1009852395			
Layer:		5			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		10.670000076293945			
Formation End Depth:		13.100000381469727			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1009852391			
Layer:		1			
Color:		2			
General Color:		GREY			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1009852392			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		2.740000009536743			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009853456			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		9.75			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1009853455			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009853457			
Layer:		3			
Plug From:		9.75			
Plug To:		13.100000381469727			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1009854837			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1009764982			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1009855215			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		10.050000190734863			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1009855611			
Layer:		1			
Slot:		10			
Screen Top Depth:		10.050000190734863			
Screen End Depth:		13.100000381469727			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1009856075			
Pump Set At:					
Static Level:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Final Level After Pumping: Recommended Pump Depth: Pumping Rate: Flowing Rate: Recommended Pump Rate: Levels UOM: m Rate UOM: LPM Water State After Test Code: Water State After Test: Pumping Test Method: 0 Pumping Duration HR: Pumping Duration MIN: Flowing: No					
Hole Diameter					
Hole ID: 1009854396 Diameter: 11.430000305175781 Depth From: 0.0 Depth To: 13.100000381469727 Hole Depth UOM: m Hole Diameter UOM: cm					
134	1 of 1	E/241.2	75.9 / -1.93	340 Cooper street Ottawa ON Ottawa ON K2P 0G7	EHS
Order No: 24050100428 Status: C Report Type: Standard Report Report Date: 06-MAY-24 Date Received: 01-MAY-24 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.6946303 Y: 45.4168781					
135	1 of 1	N/242.8	77.9 / 0.07	171 Bank Street Ottawa ON K2P 1W5	EHS
Order No: 22121300111 Status: C Report Type: Standard Report Report Date: 16-DEC-22 Date Received: 13-DEC-22 Previous Site Name: Lot/Building Size: Additional Info Ordered: City Directory					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.6977959 Y: 45.4186492					
136	1 of 1	NW/243.2	76.9 / -0.93	340 Laurier Ave W Ottawa ON K1P 5K3	EHS
Order No: 20191127033 Status: C Report Type: Standard Report Report Date: 02-DEC-19 Date Received: 27-NOV-19 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.699898 Y: 45.417983					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
137	1 of 1	NW/244.0	76.8 / -0.96	Ambassador-Mondrian Inc. 324 LAURIER AVE W ON OTTAWA ON	RSC
RSC No: 40506 RA No: Status: FILED Filing Date: Date Ack: Date Returned: Approval Date: December 14, 2007 Cert Date: Cert Prop Use No: Curr Property Use: Intended Prop Use: Restoration Type: Soil Type: Criteria: Stratified (Y/N): Audit (Y/N): Entire Leg Prop. (Y/N): CPU Issu Sect 1686: Business Name: Address: Legal Desc: Site Pin: 04114 - 0045 LT Asmt Roll No: Project Type: PRE2011 Approval Type: RSC based on Phase One and Two ESAs Applicable Standards: PDF Link: https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=40506 X: -75.69833577615664 Y: 45.418893184025585 Latitude: 45.41889318 Longitude: -75.69833578 UTM Coordinates: Latitude Longitude: Accuracy Estimate: Measurement Method: Mailing Address: Telephone: Fax: Email: Postal Code: K1P 0A4 Ministry District: MOE District: Ottawa SWP Area Name: Rideau Valley Qual Person Name: Mark S D'Arcy Consultant:					
138	1 of 1	SSW/245.2	78.9 / 1.07	ON	BORE
Borehole ID: 613260 OGF ID: 215514562 Status: Type: Borehole Use: Completion Date: JAN-1965 Static Water Level: 7.3 Primary Water Use: Sec. Water Use: Total Depth m: -999 Depth Ref: Ground Surface Depth Elev: Drill Method: Orig Ground Elev m: 74.3 Elev Reliabil Note: DEM Ground Elev m: 74.3 Concession: Location D: Survey D: Comments: Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 45.414383 Longitude DD: -75.698693 UTM Zone: 18 Easting: 445331 Northing: 5029222 Location Accuracy: Accuracy: Not Applicable					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218394390 Top Depth: 1.2 Bottom Depth: 2.4 Material Color: Grey Material 1: Clay Mat Consistency: Stiff Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	Silt			Geologic Group: Geologic Period: Depositional Gen:	
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218394391 2.4 9.3 Grey Till Sand	CLAY. GREY,STIFF.		Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Hard
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218394389 0 1.2 Fill			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Compact
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218394392 9.3 Black Bedrock Shale Silt			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Hard
Gsc Material Description: Stratum Description:		BEDROCK. BLACK,FOSSILIFEROUS,FRACTURED,WATER STABLE AT 219.6 FEET.BEDROCK. BROWN, VERY HARD.			
Source					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
Source Name: Source Details: Confiden 1:	Urban Geology Automated Information System (UGAIS) File: OTTAWA2.txt RecordID: 057680 NTS_Sheet: 31G05G				
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
139	1 of 1	SSW/245.6	78.9 / 1.07	ON	WWIS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well ID:	7211109			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	11/14/2013
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z096858			Contractor:	6894
Tag:	A152335			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/721\7211109.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:					
Year Completed:					
Depth (m):					
Latitude:	45.4144341369687				
Longitude:	-75.6988942716743				
X:	-75.69889410989069				
Y:	45.41443413003447				
Path:	721\7211109.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1004633020			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	445315.00
Code OB Desc:				North83:	5029228.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:				UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1004895710				
Layer:	1				
Plug From:	57.0				
Plug To:	0.0				
Plug Depth UOM:	ft				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Method of Construction & Well Use</u>					
Method Construction ID:	1004895709				
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:	1004895702				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1004895706				
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:	inch				
Casing Depth UOM:	ft				
<u>Construction Record - Screen</u>					
Screen ID:	1004895707				
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:	ft				
Screen Diameter UOM:	inch				
Screen Diameter:					
<u>Water Details</u>					
Water ID:	1004895705				
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:	ft				
<u>Hole Diameter</u>					
Hole ID:	1004895704				
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM:	ft				
Hole Diameter UOM:	inch				
140	1 of 3	ENE/246.0	75.9 / -1.93	257 Lisgar Street Ottawa ON K2P 0C7	EHS
Order No:	20120807057			Nearest Intersection:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: C Report Type: Standard Report Report Date: 16-AUG-12 Date Received: 07-AUG-12 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.695015 Y: 45.418005					

140	2 of 3	ENE/246.0	75.9 / -1.93	Taggart Corporation Ltd. 257 Lisgar Street Ottawa ON K2P 0C7	GEN

Generator Info

Generator No:	ON7376374	Choice of Contact:	
Approval Years:	As of Jan 2021	Contaminated Fac:	
Status:	Registered	MHSW Facility:	
PO Box No:		SIC Code:	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	221 L
Waste Class Name:	Light fuels

2020 Generator Info

Gen No:	ON7376374	Choice of Contact:	CO_OFFICIAL
ID:	29367	Phone No Official:	613-822-0624 Ext.
Contaminated Fac:	N	Phone No Admin:	
MHSW Facility:	N	County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	236210	County Out:	
NAICS Code2:		District:	402
NAICS Code3:			
Gen Name:	Taggart Corporation Ltd.		
Gen Div:			
Gen Op Name:	Taggart Corporation Ltd.		
Gen Op Div:			
Site Adrs1:	257 Lisgar Street		
Site Bldg:	Wentworth Plaza		
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K2P 0C7		
Site Country:	Canada		
Co Official:	David Brouse		
Co Admin:			

140	3 of 3	ENE/246.0	75.9 / -1.93	Taggart Group Ltd 257 Lisgar St Ottawa ON K2P1P0	GEN

Generator Info

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON2733971 Approval Years: As of Nov 2021 Status: Registered PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description: Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
<u>Waste Detail(s)</u>					
Waste Class: 243 D Waste Class Name: PCB					
<u>2021 Generator Info</u>					
Gen No: ON2733971 ID: 10014 Contaminated Fac: N MHSW Facility: N NAICS Code1: 238210 NAICS Code2: NAICS Code3: Gen Name: Taggart Group Ltd Gen Div: Gen Op Name: Taggart Realty Gen Op Div: Site Adrs1: 257 Lisgar St Site Bldg: Wentworth Centre Site Pobox: Province In: ONTARIO Site Adrs2: Site City: Ottawa Province Out: Site Postal Code: K2P1P0 Site Country: Canada Co Official: Craig Humphrey Co Admin: Choice of Contact: CO_OFFICIAL Phone No Official: 6132347000 Ext. Phone No Admin: County Ont: OTTAWA CARLTON (RM) County Out: District: 402					
<u>2021 Generator Manifest</u>					
ID: 29236 Generator No: ON2733971 Receiver Type: 035 Waste Char: D Waste Code: 243 Sum Received Qty: 18750.0 Waste Class Name: PCBS Count Manifests: 1 District: 202					
141	1 of 1	ESE/246.3	75.9 / -1.95	341 Maclaren St Ottawa ON K2P2E2	EHS
Order No: 20170203026 Status: C Report Type: Standard Report Report Date: 08-FEB-17 Date Received: 03-FEB-17 Previous Site Name: Lot/Building Size: Additional Info Ordered: Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.695005 Y: 45.415271					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
142	1 of 8	ENE/246.4	75.9 / -1.93	Tartan Land Corporation 331 Cooper Street, Suite 400 Ottawa ON K2P 0G5	CA
Certificate #:		7703-4KFM9J			
Application Year:		00			
Issue Date:		5/19/00			
Approval Type:		Municipal & Private sewage			
Status:		Approved			
Application Type:		New Certificate of Approval			
Client Name:		South Nepean Development Corporation			
Client Address:		427 Laurier Ave. W., Unit 300			
Client City:		Ottawa			
Client Postal Code:					
Project Description:		Storm and Sanitary Sewers to be constructed in the City of Nepean.			
Contaminants:					
Emission Control:					
142	2 of 8	ENE/246.4	75.9 / -1.93	Tartan Land Corporation 331 Cooper Street, Suite 400 Ottawa ON K2P 0G5	CA
Certificate #:		3476-4KFMVT			
Application Year:		00			
Issue Date:		7/13/00			
Approval Type:		Municipal & Private water			
Status:		Revoked and/or Replaced			
Application Type:		New Certificate of Approval			
Client Name:		South Nepean Development Corporation			
Client Address:		427 Laurier Ave. W., Unit 300			
Client City:		Ottawa			
Client Postal Code:					
Project Description:		Watermains to be constructed in the City of Nepean			
Contaminants:					
Emission Control:					
142	3 of 8	ENE/246.4	75.9 / -1.93	Tartan Land Corporation 331 Cooper Street, Suite 400 Ottawa ON K2P 0G5	CA
Certificate #:		3735-4M5HET			
Application Year:		00			
Issue Date:		7/13/00			
Approval Type:		Municipal & Private water			
Status:		Approved			
Application Type:		Amended CofA			
Client Name:		South Nepean Development Corporation			
Client Address:		427 Laurier Ave. W., Unit 300			
Client City:		Ottawa			
Client Postal Code:		K1R 7Y2			
Project Description:		Amend C/A to correct description of works			
Contaminants:					
Emission Control:					
142	4 of 8	ENE/246.4	75.9 / -1.93	South Nepean Development Corporation 331 Cooper Street, Suite 400 Ottawa ON K1R 7Y2	ECA
Approval No:		3735-4M5HET		MOE District: Ottawa	
Approval Date:		2000-07-13		City:	
Status:		Approved		Longitude: -75.69465	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Record Type: ECA Latitude: 45.417255 Link Source: IDS Geometry X: SWP Area Name: Rideau Valley Geometry Y: Approval Type: ECA-Municipal and Private Water Works Project Type: Municipal and Private Water Works Business Name: South Nepean Development Corporation Address: 331 Cooper Street, Suite 400 Full Address: Full PDF Link: PDF Site Location:					
142	5 of 8	ENE/246.4	75.9 / -1.93	South Nepean Development Corporation 331 Cooper Street, Suite 400 Ottawa ON	ECA
Approval No: 7703-4KFM9J MOE District: Ottawa Approval Date: 2000-05-19 City: Status: Approved Longitude: -75.69465 Record Type: ECA Latitude: 45.417255 Link Source: IDS Geometry X: SWP Area Name: Rideau Valley Geometry Y: Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS Business Name: South Nepean Development Corporation Address: 331 Cooper Street, Suite 400 Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/3341-4K9RJV-14.pdf PDF Site Location:					
142	6 of 8	ENE/246.4	75.9 / -1.93	South Nepean Development Corporation 331 Cooper Street, Suite 400 Ottawa ON	ECA
Approval No: 3476-4KFMVT MOE District: Ottawa Approval Date: 2000-07-13 City: Status: Revoked and/or Replaced Longitude: -75.69465 Record Type: ECA Latitude: 45.417255 Link Source: IDS Geometry X: SWP Area Name: Rideau Valley Geometry Y: Approval Type: ECA-Municipal and Private Water Works Project Type: Municipal and Private Water Works Business Name: South Nepean Development Corporation Address: 331 Cooper Street, Suite 400 Full Address: Full PDF Link: PDF Site Location:					
142	7 of 8	ENE/246.4	75.9 / -1.93	Enbridge Gas Distribution Inc. 331 Cooper St. Ottawa ON	SPL
Ref No: 2853-B52NE2 Municipality No: Year: Nature of Damage: Incident Dt: 2018/09/28 Discharger Report: Dt MOE Arvl on Scn: Material Group: MOE Reported Dt: 2018/09/28 Impact to Health: 0 - No Impact Dt Document Closed: Agency Involved: Site No: NA MOE Response: No Site County/District:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Geo Ref Meth: Site District Office: Ottawa Nearest Watercourse: Site Name: 1 Inch IP Plastic Service Damage <UNOFFICIAL> Site Address: 331 Cooper St. Site Region: Eastern Site Municipality: Ottawa Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Enbridge Gas Distribution Inc. Client Type: Corporation Source Type: Valve/Fitting/Piping Incident Cause: Incident Preceding Spill: Leak/Break Incident Reason: Operator/Human Error Incident Summary: TSSA/FSB: 1" IP Plastic Line Strike - Made Safe Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: 0 other - see incident description Contaminant Qty 1: 0 Contaminant Unit: other - see incident description Contaminant Code: 35 Contaminant Name: NATURAL GAS (METHANE) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: 1075 Receiving Medium: Air Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Miscellaneous Industrial SAC Action Class: TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill Call Report Locatn Geodata: Time Reported: System Facility Address:					
142	8 of 8	ENE/246.4	75.9 / -1.93	PIPELINE HIT 1" 331 COOPER ST,,OTTAWA,ON,K2P 0G5,CA ON	PINC
Incident Id: Incident No: 2409866 Incident Reported Dt: 10/1/2018 Type: FS-Pipeline Incident Status Code: Tank Status: Pipeline Damage Reason Est Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Depth: Customer Acct Name: PIPELINE HIT 1" Incident Address: 331 COOPER ST,,OTTAWA,ON,K2P 0G5,CA Operation Type: Pipeline Type: Regulator Type:					
Pipe Material: Fuel Category: Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category: Regulator Location: Method Details:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes:					
143	1 of 10	S/246.7	77.9 / 0.07	441 MACLAREN STREET OTTAWA ON K2P 2H3	EHS
Order No: 20070216001 Status: C Report Type: CAN - Custom Report Report Date: 2/23/2007 Date Received: 2/16/2007 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps And /or Site Plans Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): 0.25 X: -75.69777 Y: 45.414087					
143	2 of 10	S/246.7	77.9 / 0.07	441 MacLaren Ottawa ON	EHS
Order No: 20111024070 Status: C Report Type: Standard Report Report Date: 11/2/2011 Date Received: 10/24/2011 3:21:35 PM Previous Site Name: Lot/Building Size: 0.3 acres Additional Info Ordered: Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: 0 Y: 0					
143	3 of 10	S/246.7	77.9 / 0.07	Dental Anaesthesia Group 441 MacLaren Street Suite 370 Ottawa ON	GEN
Generator Info Generator No: ON6259500 Approval Years: 2013 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: OFFICES OF DENTISTS Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 621210					
Waste Detail(s) Waste Class: 261 Waste Class Name: PHARMACEUTICALS					
143	4 of 10	S/246.7	77.9 / 0.07	Sedation Dental Group Suite 370 441 MacLaren St Ottawa ON K2P 2H3	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON8313130			Choice of Contact:	CO_ADMIN
Approval Years:	2016			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	621210
Country:	Canada				
Co Admin:	Penny Petersen				
Phone No Admin:	613-232-3725 Ext.225				
SIC Description:	OFFICES OF DENTISTS				
<u>Waste Detail(s)</u>					
Waste Class:	261				
Waste Class Name:	PHARMACEUTICALS				
<u>Waste Detail(s)</u>					
Waste Class:	212				
Waste Class Name:	ALIPHATIC SOLVENTS				
<u>Waste Detail(s)</u>					
Waste Class:	262				
Waste Class Name:	DETERGENTS/SOAPS				
<u>Waste Detail(s)</u>					
Waste Class:	263				
Waste Class Name:	ORGANIC LABORATORY CHEMICALS				
<u>Waste Detail(s)</u>					
Waste Class:	312				
Waste Class Name:	PATHOLOGICAL WASTES				
<u>Waste Detail(s)</u>					
Waste Class:	114				
Waste Class Name:	OTHER INORGANIC ACID WASTES				
143	5 of 10	S/246.7	77.9 / 0.07	Elevation Elevator Inc. 441 MacLaren Ottawa ON K2P 2R2	GEN

Generator Info

Generator No:	ON8244897	Choice of Contact:	CO_OFFICIAL
Approval Years:	2015	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	238291
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:	ELEVATOR AND ESCALATOR INSTALLATION CONTRACTORS		

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
143	6 of 10	S/246.7	77.9 / 0.07	Sedation Dental Group Suite 370 441 MacLaren St Ottawa ON K2P 2H3	GEN
<u>Generator Info</u>					
Generator No:		ON8313130	Choice of Contact:		CO_ADMIN
Approval Years:		2015	Contaminated Fac:		No
Status:			MHSW Facility:		No
PO Box No:			SIC Code:		621210
Country:		Canada			
Co Admin:		Penny Petersen			
Phone No Admin:		613-232-3725 Ext.225			
SIC Description:		OFFICES OF DENTISTS			
<u>Waste Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
143	7 of 10	S/246.7	77.9 / 0.07	Dental Anaesthesia Group Suite 370 441 MacLaren St Ottawa ON K2P 2H3	GEN
<u>Generator Info</u>					
Generator No:		ON8313130	Choice of Contact:		CO_ADMIN
Approval Years:		2014	Contaminated Fac:		No
Status:			MHSW Facility:		No
PO Box No:			SIC Code:		621210
Country:		Canada			
Co Admin:		Penny Petersen			
Phone No Admin:		613-232-3725 Ext.225			
SIC Description:		OFFICES OF DENTISTS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
143	8 of 10	S/246.7	77.9 / 0.07	Sedation Dental Group Suite 370 441 MacLaren St	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Ottawa ON K2P 2H3					
<u>Generator Info</u>					
Generator No:	ON8313130			Choice of Contact:	
Approval Years:	As of Dec 2018			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	261 A				
Waste Class Name:	Pharmaceuticals				
<u>Waste Detail(s)</u>					
Waste Class:	262 L				
Waste Class Name:	Detergents and soaps				
<u>Waste Detail(s)</u>					
Waste Class:	263 I				
Waste Class Name:	Misc. waste organic chemicals				
<u>Waste Detail(s)</u>					
Waste Class:	312 P				
Waste Class Name:	Pathological wastes				
<u>Waste Detail(s)</u>					
Waste Class:	114 C				
Waste Class Name:	Other inorganic acid wastes				
<u>Waste Detail(s)</u>					
Waste Class:	212 I				
Waste Class Name:	Aliphatic solvents and residues				
143	9 of 10	S/246.7	77.9 / 0.07	Sedation Dental Group Suite 370 441 MacLaren St Ottawa ON K2P 2H3	GEN

Generator Info

Generator No:	ON8313130	Choice of Contact:
Approval Years:	As of Jul 2020	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		114 C			
Waste Class Name:		Other inorganic acid wastes			
<u>Waste Detail(s)</u>					
Waste Class:		261 A			
Waste Class Name:		Pharmaceuticals			
<u>Waste Detail(s)</u>					
Waste Class:		263 I			
Waste Class Name:		Misc. waste organic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
<u>Waste Detail(s)</u>					
Waste Class:		262 L			
Waste Class Name:		Detergents and soaps			
<u>Waste Detail(s)</u>					
Waste Class:		212 I			
Waste Class Name:		Aliphatic solvents and residues			
<u>143</u>	10 of 10	S/246.7	77.9 / 0.07	Sedation Dental Group Suite 370 441 MacLaren St Ottawa ON K2P 2H3	GEN

Generator Info

Generator No: ON8313130
Approval Years: As of Nov 2021
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 261 A
Waste Class Name: Pharmaceuticals

Waste Detail(s)

Waste Class: 312 P
Waste Class Name: Pathological wastes

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		263 I			
Waste Class Name:		Misc. waste organic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		262 L			
Waste Class Name:		Detergents and soaps			
<u>Waste Detail(s)</u>					
Waste Class:		114 C			
Waste Class Name:		Other inorganic acid wastes			
<u>Waste Detail(s)</u>					
Waste Class:		212 I			
Waste Class Name:		Aliphatic solvents and residues			
144	1 of 1	SW/246.7	78.9 / 1.07	447 Somerset Street West Ottawa ON K1R 5J7	EHS
Order No:	20191128029			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Site Report			Client Prov/State:	ON
Report Date:	29-NOV-19			Search Radius (km):	.001
Date Received:	28-NOV-19			X:	-75.69907
Previous Site Name:				Y:	45.414481
Lot/Building Size:					
Additional Info Ordered:					
145	1 of 3	WNW/248.0	75.7 / -2.08	I C ASSALY CONSTRUCTION 199 KENT ST OTTAWA ON K2P2K8	PRT
Location ID:	19565				
Type:	retail				
Expiry Date:	1993-01-31				
Capacity (L):	1000				
Licence #:	0076347020				
145	2 of 3	WNW/248.0	75.7 / -2.08	I C ASSALY CONSTRUCTION 199 KENT ST OTTAWA ON	DTNK
<u>Delisted Expired Fuel Safety Facilities</u>					
Instance No:	9893415			Expired Date:	
Status:	EXPIRED			Max Hazard Rank:	
Instance ID:	397701			Facility Location:	
Instance Type:	FS Facility			Facility Type:	
Instance Creation Dt:				Fuel Type 2:	
Instance Install Dt:				Fuel Type 3:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Item Description: Manufacturer: Model: Serial No: ULC Standard: Quantity: Unit of Measure: Overfill Prot Type: Creation Date: Next Periodic Str DT: TSSA Base Sched Cycle 2: TSSAMax Hazard Rank 1: TSSA Risk Based Periodic Yn: TSSA Volume of Directives: TSSA Periodic Exempt: TSSA Statutory Interval: TSSA Recd Insp Interva: TSSA Recd Tolerance: TSSA Program Area: TSSA Program Area 2: Description: Original Source: Record Date:		Panam Related: Panam Venue Nm: External Identifier: Item: Piping Steel: Piping Galvanized: Tank Single Wall St: Piping Underground: Tank Underground: Source:			
		FS Propane Refill Cntr - Cylr Fill EXP Up to Mar 2012			

145	3 of 3	WNW/248.0	75.7 / -2.08	Kent Towers<UNOFFICIAL> 199 Kent st Ottawa ON	SPL
Ref No: Year: Incident Dt: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary: Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code:		0255-BPBMVU 2020/04/28 2020/05/05 2020/07/17 NA No Ottawa Kent Towers<UNOFFICIAL> 199 Kent st Eastern Ottawa 5029544 445168 Kent Towers<UNOFFICIAL> Tank - Indoors Leak/Break Equipment Failure TSSA FSB: small amount dsl dripped inside to floor from tank 0 other - see incident description 0 other - see incident description 13		Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:	2 - Minor Environment

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:		DIESEL FUEL 1202 Land Miscellaneous Communal Land Spills			
146	1 of 11	WNW/248.1	76.9 / -0.87	360 Laurier Ave West Ottawa ON K1P 1C8	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:		20001109006 C Complete Report 11/14/00 11/10/00 11 story 13 underground parking		Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:	Kent St. ON 0.25 -75.700168 45.41804
146	2 of 11	WNW/248.1	76.9 / -0.87	HEALTH AND WELFARE CANADA HEALTH UNIT#31, 2ND FL., NORONO BLDG. 360 LAURIER AVE. WEST (HWC) OTTAWA ON K1P 1C8	GEN
<u>Generator Info</u>					
Generator No: Approval Years: Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:		ON0095619 92,93,97 PUB. HEALTH CLINICS		Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:	8635
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		312 PATHOLOGICAL WASTES			
146	3 of 11	WNW/248.1	76.9 / -0.87	GVT OF CAN-HEALTH&WELFARE CAN.MED.16-305 SER.BR,UNIT#31,2ND FL.,NORONO BLDG. 360 LAURIER AVE. WEST,C/O 301 ELGIN ST OTTAWA ON K1P 1C8	GEN
<u>Generator Info</u>					
Generator No: Approval Years:		ON0095619 94,95,96		Choice of Contact: Contaminated Fac:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:					
		PUB. HEALTH CLINICS		MHSW Facility: SIC Code: 8635	
Waste Detail(s)					
Waste Class: Waste Class Name:		312 PATHOLOGICAL WASTES			
146	4 of 11	WNW/248.1	76.9 / -0.87	HEALTH AND WELFARE CANADA 360 LAURIER AVE. WEST (HWC) HEALTH UNIT #31, 2ND FLOOR, NORONO BLDG. OTTAWA ON K1P 5K3	GEN
Generator Info					
Generator No: Approval Years: Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:		ON0095619 98,99,00,01 PUB. HEALTH CLINICS		Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 8635	
Waste Detail(s)					
Waste Class: Waste Class Name:		312 PATHOLOGICAL WASTES			
146	5 of 11	WNW/248.1	76.9 / -0.87	360 Laurier Avenue West Ottawa ON K1P 1C8	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:		20051122010 C Custom Report 11/25/2005 11/22/2005 		Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:	ON 0.25 -75.700331 45.417995
146	6 of 11	WNW/248.1	76.9 / -0.87	360 Laurier Avenue West Limited 360 Laurier Avenue West Ottawa K1P 6E2 CITY OF OTTAWA ON	EBR
EBR Registry No: Ministry Ref No: Notice Type: Notice Stage: Notice Date: Proposal Date: Year: Instrument Type: Off Instrument Name:		010-2243 5377-794PWB Instrument Decision March 13, 2008 December 03, 2007 2007 (EPA s. 9) - Approval for discharge into the natural environment other than water (i.e. Air)		Decision Posted: Exception Posted: Section: Act 1: Act 2: Site Location Map:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Posted By: Company Name: 360 Laurier Avenue West Limited Site Address: Location Other: Proponent Name: Proponent Address: 130 Slater Street, Ottawa Ontario, Canada K1P 6E2 Comment Period: URL: Summary: Site Location Details: 360 Laurier Avenue West Ottawa K1P 6E2 CITY OF OTTAWA					
146	7 of 11	WNW/248.1	76.9 / -0.87	360 Laurier Avenue West Limited 360 Laurier Ave W Ottawa ON	CA
Certificate #: 0625-7CFSTA Application Year: 2008 Issue Date: 3/7/2008 Approval Type: Air Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
146	8 of 11	WNW/248.1	76.9 / -0.87	360 Laurier Avenue West Limited 360 Laurier Ave W Ottawa ON K1P 6E2	ECA
Approval No: 0625-7CFSTA Approval Date: 2008-03-07 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Rideau Valley Approval Type: ECA-AIR Project Type: AIR Business Name: 360 Laurier Avenue West Limited Address: 360 Laurier Ave W Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/5377-794PWB-13.pdf PDF Site Location:					
MOE District: Ottawa City: Longitude: -75.70044 Latitude: 45.417706 Geometry X: Geometry Y:					
146	9 of 11	WNW/248.1	76.9 / -0.87	360 Laurier Avenue West Ottawa ON K1P 1C8	EHS
Order No: 20180517212 Status: C Report Type: Standard Report Report Date: 22-MAY-18 Date Received: 17-MAY-18 Previous Site Name:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.700467 Y: 45.417716					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Lot/Building Size: Additional Info Ordered:					
146	10 of 11	WNW/248.1	76.9 / -0.87	360 Laurier Ave W Ottawa ON K1P1C8	EHS
Order No: 20170601026 Status: C Report Type: Standard Report Report Date: 06-JUN-17 Date Received: 01-JUN-17 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.700442 Y: 45.417707			
146	11 of 11	WNW/248.1	76.9 / -0.87	OTT A360 LAURIER INC. 360 Laurier AVE W Ottawa ON	RSC
RSC No: B-403-7293203464 RA No: Status: Active Filing Date: Date Ack: Date Returned: Approval Date: August 8, 2024 Cert Date: Cert Prop Use No: Curr Property Use: Intended Prop Use: Restoration Type: Soil Type: Criteria: Stratified (Y/N): Audit (Y/N): Entire Leg Prop. (Y/N): CPU Issu Sect 1686: Business Name: OTT A360 LAURIER INC. Address: 360 Laurier AVE W Legal Desc: Site Pin: 04114-0048 (LT) Asmt Roll No: Project Type: RSC based on Phase One and Two ESAs Approval Type: RSC-RSC based on Phase One and Two ESAs Applicable Standards: PDF Link: https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=3605420		X: -75.7005555544451 Y: 45.4177777684349 Latitude: 45.41777778 Longitude: -75.70055556 UTM Coordinates: Latitude Longitude: Accuracy Estimate: Measurement Method: Mailing Address: Telephone: Fax: Email: Postal Code: K1P 1C8 Ministry District: MOE District: Ottawa SWP Area Name: Rideau Valley Qual Person Name: Karyn Munch Consultant:			
147	1 of 1	W/248.2	76.9 / -0.93	PRIVATE OWNER 280 GLOUCESTER ST(ST. PATRICK CHURCH) STORAGE TANK/BARREL OTTAWA CITY ON K1R 5E4	SPL
Ref No: 100318 Year: Incident Dt: 5/25/1994 Dt MOE Arvl on Scn: MOE Reported Dt: 5/25/1994 Dt Document Closed: Site No: MOE Response:		Municipality No: 20101 Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved: DEWAN FUELS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary: Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:					
148	1 of 1	S/248.2	77.9 / 0.07	2732685 Ontario Inc. 429 MacLaren Street Ottawa ON K2P 0M7	GEN
Generator Info Generator No: Approval Years: Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: ON9573081 As of Oct 2022 Registered Canada Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
Waste Detail(s) Waste Class: 261 L					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		PHARMACEUTICALS			
<u>Waste Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		PATHOLOGICAL WASTES			
149	1 of 1	E/248.4	75.9 / -1.93	KEN RALPH 231 O'CONNOR ST.,OTTAWA,ON,K2P 1T8,CA ON	PINC
Incident Id:				Pipe Material:	
Incident No:		1602812		Fuel Category:	
Incident Reported Dt:		3/24/2015		Health Impact:	
Type:		FS-Pipeline Incident		Environment Impact:	
Status Code:				Property Damage:	
Tank Status:		Pipeline Damage Reason Est		Service Interrupt:	
Task No:				Enforce Policy:	
Spills Action Centre:				Public Relation:	
Fuel Type:				Pipeline System:	
Fuel Occurrence Tp:				PSIG:	
Date of Occurrence:				Attribute Category:	
Occurrence Start Dt:				Regulator Location:	
Depth:				Method Details:	
Customer Acct Name:		KEN RALPH			
Incident Address:		231 O'CONNOR ST.,OTTAWA,ON,K2P 1T8,CA			
Operation Type:					
Pipeline Type:					
Regulator Type:					
Summary:					
Reported By:					
Affiliation:					
Occurrence Desc:					
Damage Reason:					
Notes:					
150	1 of 2	SW/248.5	78.9 / 1.07	447 Somerset Street West Ottawa ON K1R 5J7	EHS
Order No:		21102700721		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State:	ON
Report Date:		01-NOV-21		Search Radius (km):	.25
Date Received:		27-OCT-21		X:	-75.699105
Previous Site Name:				Y:	45.4144756
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans			
150	2 of 2	SW/248.5	78.9 / 1.07	447 Somerset Street West Ottawa ON K1R 5J7	EHS
Order No:		24061000493		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State:	ON
Report Date:		13-JUN-24		Search Radius (km):	.25
Date Received:		10-JUN-24		X:	-75.699105
Previous Site Name:				Y:	45.4144756
Lot/Building Size:					
Additional Info Ordered:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
151	1 of 2	SE/248.9	76.9 / -0.93	384 MacLaren Street, Ottawa ON	INC
Incident No:		710966	Any Health Impact: No		
Incident ID:		2867936	Any Enviro Impact: No		
Instance No:			Service Intrap: Yes		
Status Code:		Causal Analysis Complete	Was Prop Damaged: Yes		
Incident Status:			Reside App. Type:		
Incident Severity:			Commer App. Type:		
Task No:		3664254	Indus App. Type:		
Attribute Category:		FS-Perform L1 Incident Insp	Institut App. Type:		
Context:			Depth Ground Cover: N/A		
Date of Occurrence:		2012/01/03 00:00:00	Operation Pressure: 65		
Time of Occurrence:		01:49:00	Equipment Type:		
Occr Insp Start Dt:		2012/01/03 00:00:00	Equipment Model:		
Incident Creat On:			Serial No:		
Instance Creat Dt:			Cylinder Capacity:		
Instance Install Dt:			Cylinder Cap Units:		
Approx Quant Rel:			Cylinder Mat Type:		
Tank Capacity:			Pump Flow Rate Cap:		
Fuels Occur Type:		Vapour Release	Contam. Migrated:		
Occur Type Rpt:			Near Body of Water:		
Occur Category:			Drainage System:		
Fuel Type Involved:		Natural Gas	Sub Surface Contam:		
Fuel Type Reported:			Tank Material Type:		
Enforcement Policy:		NULL	Tank Storage Type:		
Prc Escalation Req:		NULL	Tank Location Type:		
Item:					
Item Description:					
Device Installed Location:					
Venting Type:					
Vent Conn Mater:					
Vent Chimney Mater:					
Pipeline Type:		Service / Riser Distribution Pipeline			
Pipeline Involved:					
Pipe Material:		Steel			
Regulator Location:		Outside			
Regulator Type:		Service Regulator (up to 60 psi intake)			
Liquid Prop Make:					
Liquid Prop Model:					
Liquid Prop Serial No:					
Liquid Prop Notes:					
Inventory Address:		384 MacLaren Street, Ottawa - Vapour Release			
Invent Postal Code:					
Notes:					
Contact Natural Env:					
Aff Prop Use Water:					
Occurence Narrative:		Sidewalk machine struck meter set, snapping off steel riser at ground level.			
Operation Type Involved:		Commercial (e.g. restaurant, business unit, etc)			
151	2 of 2	SE/248.9	76.9 / -0.93	Enbridge Gas Distribution Inc. 384 MacLaren St Ottawa ON K2P 0M8	SPL
Ref No:		2456-8Q6D6F	Municipality No:		
Year:			Nature of Damage:		
Incident Dt:		03-JAN-12	Discharger Report:		
Dt MOE Arvl on Scn:			Material Group:		
MOE Reported Dt:		03-JAN-12	Impact to Health:		
Dt Document Closed:			Agency Involved:		
Site No:					
MOE Response:		Referral to others			
Site County/District:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: 384 MacLaren St<UNOFFICIAL> Site Address: 384 MacLaren St Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Enbridge Gas Distribution Inc. Client Type: Source Type: Incident Cause: Discharge or Emission to Air Incident Preceding Spill: Incident Reason: Equipment/Vehicles Incident Summary: TSSA: 1/2 Inch Line Strike, made safe Environment Impact: Not Anticipated Health Env Consequence: Nature of Impact: Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: 35 Contaminant Name: NATURAL GAS (METHANE) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Sewage - Municipal/Private and Commercial Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Pipeline SAC Action Class: TSSA - Fuel Safety Branch Call Report Locatn Geodata: Time Reported: System Facility Address:					
152	1 of 1	SE/249.4	76.9 / -0.93	Soundmaster Ltd. 386 MacLaren St Ottawa ON K2P 0M8	SCT
Established: 01-OCT-47 Plant Size (ft²): 2000 Employment:					
--Details--					
Description: Radio and Television Broadcasting and Wireless Communications Equipment Manufacturing SIC/NAICS Code: 334220					
Description: Semiconductor and Other Electronic Component Manufacturing SIC/NAICS Code: 334410					
Description: Audio and Video Equipment Manufacturing SIC/NAICS Code: 334310					
Description: Audio and Video Equipment Manufacturing SIC/NAICS Code: 334310					

<i>Map Key</i>	<i>Number of Records</i>	<i>Direction/ Distance (m)</i>	<i>Elev/Diff (m)</i>	<i>Site</i>	<i>DB</i>

Unplottable Summary

Total: **95** Unplottable sites

DB	Company Name/Site Name	Address	City	Postal
CA	City of Ottawa	Somerset St W	Ottawa ON	
CA	THE DOUGLAS MACDONALD DEV. CORP.	COMMERCIAL PLAZA BANK STREET	OTTAWA CITY ON	
CA	MINISTRY OF TRANSPORTATION	HIGHWAY #31, LAT. CATCHBASINS	OTTAWA CITY ON	
CA	OTTAWA CITY	COOPER ST.	OTTAWA CITY ON	
CA	MACDONALD DEVELOPMENT CORP.	BANK ST.	OTTAWA CITY ON	
CA	MACDONALD DEVELOPMENT CORP.-PLAZA	EASEMENT-BANK STREET	OTTAWA CITY ON	
CA	OTTAWA CITY	GLOUCESTER STREET	OTTAWA CITY ON	
CA	OTTAWA CITY	NEPEAN STREET	OTTAWA CITY ON	
CA	OSSORY CANADA INC.	PRIVATE BLDG. BANK ST.	OTTAWA CITY ON	
CA	R.M. OF OTTAWA-CARLETON	SOMERSET STREET	OTTAWA CITY ON	
CA	City of Ottawa	Somerset St W	Ottawa ON	
CA	The Filmore Inc.	Nepean Street	Ottawa ON	
CA	South Nepean Development Corporation		Ottawa ON	
CA	Urbandale Corporation		Ottawa ON	
CA	South Nepean Development Corporation		Ottawa ON	
CA	Urbandale Corporation		Ottawa ON	
CA	Claridge Homes (Church St.) Inc.		Ottawa ON	
CA	Claridge Homes (Cooper St) Inc.		Ottawa ON	

CA	R.M. OF OTTAWA-CARLETON	GLOUCESTER ST.	OTTAWA CITY ON
CA	Taggart Residential Developments Ltd.		Ottawa ON
CA	City of Ottawa	Bank St Bank Street from Somerset Street to Catherine Street	Ottawa ON
CA	Urbandale Corporation		Ottawa ON
CA	Urbandale Corporation		Ottawa ON
CA	Tartan Land Corporation and 1503916 Ontario Limited		Ottawa ON
CA	City of Ottawa	Bank St from Laurier Avenue to Somerest Street	Ottawa ON
CA	South Nepean Development Corporation		Ottawa ON
CA	Taggart Residential Developments Ltd.		Ottawa ON
CA	South Nepean Development Corporation		Ottawa ON
CA	Urbandale Corporation		Ottawa ON
CA	Urbandale Corporation		Ottawa ON
CA	Urbandale Corporation		Ottawa ON
CA	Urbandale Corporation		Ottawa ON
CA	Urbandale Corporation		Ottawa ON
CA	Urbandale Corporation		Ottawa ON
CA	Urbandale Corporation		Ottawa ON
CA	Urbandale Corporation		Ottawa ON
CA	Urbandale Corporation		Ottawa ON
CA	Urbandale Corporation		Ottawa ON
CA	Taggart Residential Developments Ltd.		Ottawa ON
CA	Taggart Residential Developments Ltd.		Ottawa ON
CA	Taggart Construction Limited	Mobile Facility	Ottawa ON
CA	Taggart Residential Developments Ltd.		Ottawa ON
CA	R.M. OF OTTAWA-CARLETON	MACLAREN ST/BANK ST/CARTIER ST	OTTAWA CITY ON

CA	OTTAWA CITY	MACLAREN ST. COMBINED SEWERS	OTTAWA CITY ON	
CA	OTTAWA CITY	GLOUCESTER ST./NEPEAN ST.	OTTAWA CITY ON	
CA	CITY OF OTTAWA - GLOUCESTER ST.	GLOUCESTER/LYON/BANK STS.	OTTAWA CITY ON	
CONV	Loblaws Companies Limited		Ottawa ON	
CONV	SHELL CANADA PRODUCTS LIMITED		DON MILLS ON	
CONV	Taggart Construction Limited		Ottawa ON	
CONV	Taggart Construction Limited	Bank Street	South Ottawa ON	
DTNK	UPI ENERGY LP*	HWY 31	OTTAWA ON	
DTNK	W O STINSON & SON LTD*	HWY 31	OTTAWA ON	
EBR	Taggart Construction Limited	Mobile Facility Ottawa Ontario Ottawa	ON	
ECA	The Bell Telephone Company of Canada or Bell Canada	Multiple Sites Across Ontario	Ottawa ON	H3B 2M8
ECA	South Nepean Development Corporation		Ottawa ON	K1P 0B6
ECA	Taggart Commercial Developments Ltd.		Ottawa ON	K2P 1P9
ECA	City of Ottawa	Somerset St W	Ottawa ON	K1P 1J1
ECA	Urbandale Corporation		Ottawa ON	K1G 2H5
ECA	Urbandale Corporation		Ottawa ON	K1G 2H5
ECA	Taggart Construction Limited	Mobile Facility	Ottawa ON	K1V 8Y3
ECA	Urbandale Corporation		Ottawa ON	K1G 2H5
ECA	Taggart Aggregates Ltd.		Ottawa ON	K1V 8Y3
ECA	Taggart Miller Environmental Services Inc.		Ottawa ON	K2P 1P9
ECA	City of Ottawa	Bank St from Laurier Avenue to Somerest Street	Ottawa ON	K1P 1J1
ECA	City of Ottawa	Bank St	Ottawa ON	K2H 5E3

ECA	The Bell Telephone Company of Canada or Bell Canada	Multiple Sites Across Ontario	Ottawa ON	H3B 2M8
ECA	Taggart Miller Environmental Services Inc.		Ottawa ON	K2P 1P9
ECA	Taggart Aggregates Ltd.	Mobile Facility	Ottawa ON	K1V 8Y3
ECA	Taggart Miller Environmental Services Inc.		Ottawa ON	K2P 1P9
ECA	South Nepean Development Corporation		Ottawa ON	K1P 0B6
ECA	Urbandale Corporation		Ottawa ON	K1G 2H5
ECA	City of Ottawa	Bank St from Laurier Avenue to Somerest Street	Ottawa ON	K1P 1J1
ECA	The Filmore Inc.	Nepean Street	Ottawa ON	K2A 0E7
EHS		Bank St	Ottawa ON	
EHS		Bank St	Ottawa ON	
GEN	Hydro Ottawa Ltd.	Bank St	Ottawa ON	
NPCB	DEPARTMENT OF NATIONAL DEFENCE		OTTAWA ON	K1R 3J7
NPCB	DEPARTMENT OF NATIONAL DEFENCE		OTTAWA ON	K1R 3J7
NPCB	DEPARTMENT OF NATIONAL DEFENCE		OTTAWA ON	K1R 3J7
NPCB	Department of National Defence		Ottawa ON	
OOGW	Ottawa Dairy Well		ON	
PRT	NAZIMA MEDEWAR	HWY 31	OTTAWA ON	
SPL	QUEENSWAY TANK LINES	CANADIAN TIRE GAS BAR BANK STREET TANK TRUCK (CARGO)	OTTAWA CITY ON	
SPL	LOBLAWS		OTTAWA CITY ON	
SPL	PIONEER PETROLEUMS LTD.	BANK STREET SOUTH PIONEER GAS STATION. SERVICE STATION	OTTAWA CITY ON	
SPL	ESSO PETROLEUM CANADA	BANK STREET SERVICE STATION	OTTAWA CITY ON	
SPL	OTTAWA-CARLETON, R.M. OF	KENT ST REGULATOR TO OTTAWA RIVER ON N.R.C. PROPERTY SANITARY SEWER SYSTEM	OTTAWA CITY ON	

SPL	OC TRANSP	BANK ST. SOUTH MOTOR VEHICLE (OPERATING FLUID)	OTTAWA CITY ON	
SPL	Shell Canada Products Limited	Shell Canada	Ottawa ON	
SPL	Loblaws Properties Limited	Loblaws	Ottawa ON	
SPL	City of Ottawa	between O'Connor St & Bank St	Ottawa ON	
SPL	OLRT Constructors	Road allowance between Broken Front Concessions C and D in front of Lot D geographic township of Nepean	Ottawa ON	
SPL	Bell Canada		Ottawa ON	
SPL		Kent Street near Bank Street	Ottawa ON	
SPL	Taggart Aggregates Ltd.		Ottawa ON	
SPL	Taggart Construction Limited		Ottawa ON	
WDS	Taggart Miller Environmental Services Inc.		Ottawa ON	K2P 1P9

Unplottable Report

Site: City of Ottawa
Somerset St W Ottawa ON

Database:
CA

Certificate #: 6180-8JKNNV
Application Year: 2011
Issue Date: 7/22/2011
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: THE DOUGLAS MACDONALD DEV. CORP.
COMMERCIAL PLAZA BANK STREET OTTAWA CITY ON

Database:
CA

Certificate #: 7-1304-86-
Application Year: 86
Issue Date: 10/28/1986
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: MINISTRY OF TRANSPORTATION
HIGHWAY #31, LAT. CATCHBASINS OTTAWA CITY ON

Database:
CA

Certificate #: 3-1342-93-
Application Year: 93
Issue Date: 12/31/1993
Approval Type: Municipal sewage
Status: Preliminary approval
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: OTTAWA CITY
COOPER ST. OTTAWA CITY ON

Database:
CA

Certificate #: 3-1897-88-
Application Year: 88

Issue Date: 10/14/1988
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **MACDONALD DEVELOPMENT CORP.**
BANK ST. OTTAWA CITY ON

Database:
CA

Certificate #: 3-1072-88-
Application Year: 88
Issue Date: 9/28/1988
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **MACDONALD DEVELOPMENT CORP.-PLAZA**
EASEMENT-BANK STREET OTTAWA CITY ON

Database:
CA

Certificate #: 3-1864-86-
Application Year: 86
Issue Date: 12/19/1986
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **OTTAWA CITY**
GLOUCESTER STREET OTTAWA CITY ON

Database:
CA

Certificate #: 3-0827-86-
Application Year: 86
Issue Date: 7/2/1986
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: OTTAWA CITY
NEPEAN STREET OTTAWA CITY ON

Database:
CA

Certificate #: 3-0887-87-
Application Year: 87
Issue Date: 6/15/1987
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: OSSORY CANADA INC.
PRIVATE BLDG. BANK ST. OTTAWA CITY ON

Database:
CA

Certificate #: 3-0515-87-
Application Year: 87
Issue Date: 4/23/1987
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: R.M. OF OTTAWA-CARLETON
SOMERSET STREET OTTAWA CITY ON

Database:
CA

Certificate #: 7-0096-88-
Application Year: 88
Issue Date: 2/10/1988
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: City of Ottawa
Somerset St W Ottawa ON

Database:
CA

Certificate #: 0195-8HMLH2
Application Year: 2011
Issue Date: 6/15/2011
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:

Contaminants:
Emission Control:

Site: The Filmore Inc.
Nepean Street Ottawa ON

Database:
CA

Certificate #: 9532-62ULPC
Application Year: 2004
Issue Date: 7/14/2004
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: South Nepean Development Corporation
Ottawa ON

Database:
CA

Certificate #: 9472-823Q7E
Application Year: 2010
Issue Date: 1/29/2010
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Urbandale Corporation
Ottawa ON

Database:
CA

Certificate #: 8787-5YQRUU
Application Year: 2004
Issue Date: 5/10/2004
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: South Nepean Development Corporation
Ottawa ON

Database:
CA

Certificate #: 8529-72CKGR
Application Year: 2007
Issue Date: 5/7/2007
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:

Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Urbandale Corporation**
 Ottawa ON

Database:
CA

Certificate #: 8145-7TYK8L
Application Year: 2009
Issue Date: 7/17/2009
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Claridge Homes (Church St.) Inc.**
 Ottawa ON

Database:
CA

Certificate #: 7739-5NWLL5
Application Year: 2003
Issue Date: 6/27/2003
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Claridge Homes (Cooper St) Inc.**
 Ottawa ON

Database:
CA

Certificate #: 7666-5SKKLX
Application Year: 2003
Issue Date: 10/23/2003
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **R.M. OF OTTAWA-CARLETON**
 GLOUCESTER ST. OTTAWA CITY ON

Database:
CA

Certificate #: 7-0911-88-

Application Year: 88
Issue Date: 7/7/1988
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Taggart Residential Developments Ltd.**
Ottawa ON

Database:
CA

Certificate #: 7167-6SJU4P
Application Year: 2006
Issue Date: 8/17/2006
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **City of Ottawa**
Bank St Bank Street from Somerset Street to Catherine Street Ottawa ON

Database:
CA

Certificate #: 7054-7L4LKY
Application Year: 2008
Issue Date: 11/28/2008
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Urbandale Corporation**
Ottawa ON

Database:
CA

Certificate #: 6829-6Y7RQX
Application Year: 2007
Issue Date: 2/19/2007
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Urbandale Corporation**
 Ottawa ON

Database:
CA

Certificate #: 5942-6BWPUR
Application Year: 2005
Issue Date: 5/3/2005
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Tartan Land Corporation and 1503916 Ontario Limited**
 Ottawa ON

Database:
CA

Certificate #: 5203-6DCNQK
Application Year: 2005
Issue Date: 6/16/2005
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **City of Ottawa**
 Bank St from Laurier Avenue to Somerest Street Ottawa ON

Database:
CA

Certificate #: 4804-7DGNT6
Application Year: 2008
Issue Date: 4/8/2008
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **South Nepean Development Corporation**
 Ottawa ON

Database:
CA

Certificate #: 4639-6ZBK9E
Application Year: 2007
Issue Date: 3/25/2007
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:

Project Description:
Contaminants:
Emission Control:

Site: **Taggart Residential Developments Ltd.**
Ottawa ON

Database:
CA

Certificate #: 4595-77ZKND
Application Year: 2007
Issue Date: 10/15/2007
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **South Nepean Development Corporation**
Ottawa ON

Database:
CA

Certificate #: 4449-7XVU9J
Application Year: 2009
Issue Date: 11/18/2009
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Urbandale Corporation**
Ottawa ON

Database:
CA

Certificate #: 3681-7QWNXY
Application Year: 2009
Issue Date: 4/9/2009
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Urbandale Corporation**
Ottawa ON

Database:
CA

Certificate #: 2869-6KVTJC
Application Year: 2006
Issue Date: 1/12/2006
Approval Type: Municipal and Private Sewage Works
Status: Approved

Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Urbandale Corporation**
 Ottawa ON

Database:
CA

Certificate #: 2169-5WVM7Y
Application Year: 2004
Issue Date: 3/12/2004
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Urbandale Corporation**
 Ottawa ON

Database:
CA

Certificate #: 2160-765JJX
Application Year: 2007
Issue Date: 8/16/2007
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Urbandale Corporation**
 Ottawa ON

Database:
CA

Certificate #: 1998-6Y7KJ9
Application Year: 2007
Issue Date: 2/12/2007
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Urbandale Corporation**
 Ottawa ON

Database:
CA

Certificate #: 1830-6H3P2S
Application Year: 2005
Issue Date: 10/14/2005
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Urbandale Corporation**
Ottawa ON

Database:
CA

Certificate #: 1712-6N6RR7
Application Year: 2006
Issue Date: 3/27/2006
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Urbandale Corporation**
Ottawa ON

Database:
CA

Certificate #: 1130-6BLHGE
Application Year: 2005
Issue Date: 4/21/2005
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Taggart Residential Developments Ltd.**
Ottawa ON

Database:
CA

Certificate #: 1090-89DRC4
Application Year: 2010
Issue Date: 9/23/2010
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Taggart Residential Developments Ltd.
Ottawa ON

Database:
CA

Certificate #: 1047-6MPLMW
Application Year: 2006
Issue Date: 3/24/2006
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Taggart Construction Limited
Mobile Facility Ottawa ON

Database:
CA

Certificate #: 0636-7KEL2F
Application Year: 2008
Issue Date: 11/19/2008
Approval Type: Air
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Taggart Residential Developments Ltd.
Ottawa ON

Database:
CA

Certificate #: 0092-6MUKH2
Application Year: 2006
Issue Date: 3/13/2006
Approval Type: Municipal and Private Sewage Works
Status: Revoked and/or Replaced
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: R.M. OF OTTAWA-CARLETON
MACLAREN ST/BANK ST/CARTIER ST OTTAWA CITY ON

Database:
CA

Certificate #: 7-0590-97-
Application Year: 97
Issue Date: 7/7/1997
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:

Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: OTTAWA CITY
MACLAREN ST. COMBINED SEWERS OTTAWA CITY ON

Database:
CA

Certificate #: 3-0270-97-
Application Year: 97
Issue Date: 5/7/1997
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: OTTAWA CITY
GLOUCESTER ST./NEPEAN ST. OTTAWA CITY ON

Database:
CA

Certificate #: 3-0550-94-
Application Year: 94
Issue Date: 5/27/1994
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: CITY OF OTTAWA - GLOUCESTER ST.
GLOUCESTER/LYON/BANK STS. OTTAWA CITY ON

Database:
CA

Certificate #: 7-0091-90-
Application Year: 90
Issue Date: 2/16/1990
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Loblaw Companies Limited
Ottawa ON

Database:
CONV

File No: 097267
Crown Brief No:
Court Location:
Publication City:

Location:
Region:
Ministry District:

Publication Title:
Act:
Act(s):
First Matter:
Second Matter:
Investigation 1:
Investigation 2:
Penalty Imposed:
Description:

On April 19, 2011, Loblaw Companies Limited/Les Compagnies Loblaw Limitee pleaded guilty to one violation under the Environmental Protection Act for causing the discharge of a refrigerant into the air within a building or into the natural environment. The Court heard that the company owns and operates a property in Ottawa. The company uses a refrigeration contractor to install, maintain and service the equipment at this location. During such work, a release of refrigerant was reported to the ministry. The release was inside a building that was vented via exhaust fans to the natural environment. The refrigerant contains hydrochlorofluorocarbon and is considered an ozone depleting substance. The company was charged following an investigation by the ministry's Investigations and Enforcement Branch. The company was fined \$30,000 plus a victim fine surcharge and was given 30 days to pay the fine.

Background:
URL:

Additional Details

Publication Date:
Count: 1
Act: EPA
Regulation:
Section:
Act/Regulation/Section: EPA
Date of Offence:
Date of Conviction:
Date Charged: April 19, 2011
Charge Disposition: fine, victim fine surcharge
Fine: \$30,000
Synopsis:

Site: SHELL CANADA PRODUCTS LIMITED
DON MILLS ON

Database:
CONV

File No:
Crown Brief No:
Court Location:
Publication City:
Publication Title:
Act:
Act(s):
First Matter:
Second Matter:
Investigation 1:
Investigation 2:
Penalty Imposed:
Description: DISCHARGING A CONTAMINANT - ADVERSE EFFECT
Background:
URL:

Location:
Region: SOUTH EAST REGION
Ministry District:

Additional Details

Publication Date:
Count: 1
Act: EPA
Regulation:
Section: 13(1)
Act/Regulation/Section: EPA- -13(1)
Date of Offence:
Date of Conviction:
Date Charged: 92/05/12
Charge Disposition:
Fine: 90000
Synopsis:

Site: Taggart Construction Limited
Ottawa ON

Database:
CONV

File No: 012802

Location:

Crown Brief No:

Region:

Court Location:

Ministry District:

Publication City:

Publication Title:

Act:

Act(s):

First Matter:

Second Matter:

Investigation 1:

Investigation 2:

Penalty Imposed:

Description:

Taggart Construction Limited, Paterson Group Inc. and Robert Passmore have been fined \$5,000 each, totalling \$15,000 plus a victim fine surcharge, after pleading guilty on January 15, 2009 to violations under the Ontario Water Resources Act. Taggart Construction Limited and Paterson Group Inc. were convicted of failing to comply with a Provincial Officer Order by taking more than 50,000 litres of water per day, and Mr. Passmore was convicted of giving false or misleading information to the ministry. The parties were given six months to pay the fine. The Court heard that Taggart Construction Limited was contracted by a developer to install municipal services at a subdivision in Ottawa which required dewatering activities. After being issued a Provincial Officer Order to restrict water taking activities to below 50,000 litres per day until a permit had been obtained, Taggart hired Paterson Group Inc. to submit an application for the permit. Taggart then pumped over 50,000 litres of water based on information provided by Paterson Group employee, Mr. Passmore, that the go ahead to pump had been given when a permit had yet to be issued. In an interview with ministry investigators, Mr. Passmore denied giving Taggart verbal approval to pump in excess of 50,000 litres per day. Taggart Construction Limited, Paterson Group Inc. and Mr. Passmore were charged following an investigation by the Ministry of the Environment's Investigations and Enforcement Branch.

Background:

URL:

Additional Details

Publication Date:

Count: 1

Act: OWRA

Regulation:

Section:

Act/Regulation/Section: OWRA

Date of Offence:

Date of Conviction:

Date Charged: January 15, 2009

Charge Disposition: fine, victim fine surcharge

Fine: \$5,000

Synopsis:

Site: Taggart Construction Limited
Bank Street South Ottawa ON

Database:
CONV

File No: 010503

Location:

Crown Brief No:

Region:

Court Location:

Ministry District:

Publication City:

Publication Title:

Act:

Act(s):

First Matter:

Second Matter:

Investigation 1:

Investigation 2:

Penalty Imposed:

Description:

On December 3, 2009, Taggart Construction Limited pleaded guilty to one violation under the Ontario Water Resources Act for failing to comply with a Provincial Officer Order to submit weekly water taking records showing daily water taking volumes. The company was contracted to install municipal services for the Findlay Creek Subdivision located on Bank Street in South Ottawa. A ministry inspection of the construction site in the fall of 2007 revealed concerns with water taking activities and a Provincial Officer Order was issued. One of the requirements

of the Order, related to keeping accurate water taking records and submitting them to the ministry, was not complied with. The company was charged following an investigation by the ministry's Investigations and Enforcement Branch and was fined \$5,000 plus victim fine surcharge. The company was given 30 days to pay the fine.

Background:
URL:

Additional Details

Publication Date:
Count: 1
Act: Provincial Officer Order
Regulation:
Section:
Act/Regulation/Section: Provincial Officer Order
Date of Offence:
Date of Conviction:
Date Charged: December 3, 2009
Charge Disposition: fine, victim fine surcharge
Fine: \$5,000
Synopsis:

Site: UPI ENERGY LP*
HWY 31 OTTAWA ON

Database:
DTNK

Delisted Expired Fuel Safety
Facilities

Instance No:	10454099	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	
Instance ID:	18935	Facility Location:	
Instance Type:	FS Highway Tank - Gas/Diesel	Facility Type:	
Instance Creation Dt:		Fuel Type 2:	
Instance Install Dt:		Fuel Type 3:	
Item Description:		Panam Related:	
Manufacturer:		Panam Venue Nm:	
Model:		External Identifier:	
Serial No:		Item:	
ULC Standard:		Piping Steel:	
Quantity:		Piping Galvanized:	
Unit of Measure:		Tank Single Wall St:	
Overfill Prot Type:		Piping Underground:	
Creation Date:		Tank Underground:	
Next Periodic Str DT:		Source:	
TSSA Base Sched Cycle 2:			
TSSAMax Hazard Rank 1:			
TSSA Risk Based Periodic Yn:			
TSSA Volume of Directives:			
TSSA Periodic Exempt:			
TSSA Statutory Interval:			
TSSA Recd Insp Interva:			
TSSA Recd Tolerance:			
TSSA Program Area:			
TSSA Program Area 2:			
Description:	FS HIGHWAY TANK - GASOLINE/DIESEL		
Original Source:	EXP		
Record Date:	Up to Mar 2012		

Site: W O STINSON & SON LTD*
HWY 31 OTTAWA ON

Database:
DTNK

Delisted Expired Fuel Safety
Facilities

Instance No:	10449391	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	
Instance ID:	18397	Facility Location:	
Instance Type:	FS Highway Tank - Gas/Diesel	Facility Type:	
Instance Creation Dt:		Fuel Type 2:	
Instance Install Dt:		Fuel Type 3:	
Item Description:		Panam Related:	
Manufacturer:		Panam Venue Nm:	
Model:		External Identifier:	
Serial No:		Item:	
ULC Standard:		Piping Steel:	
Quantity:		Piping Galvanized:	
Unit of Measure:		Tank Single Wall St:	
Overfill Prot Type:		Piping Underground:	
Creation Date:		Tank Underground:	
Next Periodic Str DT:		Source:	
TSSA Base Sched Cycle 2:			
TSSAMax Hazard Rank 1:			
TSSA Risk Based Periodic Yn:			
TSSA Volume of Directives:			
TSSA Periodic Exempt:			
TSSA Statutory Interval:			
TSSA Recd Insp Interva:			
TSSA Recd Tolerance:			
TSSA Program Area:			
TSSA Program Area 2:			
Description:	FS HIGHWAY TANK - GASOLINE/DIESEL		
Original Source:	EXP		
Record Date:	Up to Mar 2012		

Site: **Taggart Construction Limited**
Mobile Facility Ottawa Ontario Ottawa ON

Database:
EBR

EBR Registry No:	IA07E0165	Decision Posted:	
Ministry Ref No:	8556-6XWUA3	Exception Posted:	
Notice Type:	Instrument Decision	Section:	
Notice Stage:		Act 1:	
Notice Date:	December 09, 2008	Act 2:	
Proposal Date:	January 30, 2007	Site Location Map:	
Year:	2007		
Instrument Type:	(EPA s. 9) - Approval for discharge into the natural environment other than water (i.e. Air)		
Off Instrument Name:			
Posted By:			
Company Name:	Taggart Construction Limited		
Site Address:			
Location Other:			
Proponent Name:			
Proponent Address:	3187 Albion Rd S, Ottawa Ontario, K1V 8Y3		
Comment Period:			
URL:			
Summary:			

Site Location Details:

Mobile Facility Ottawa Ontario Ottawa

Site: **The Bell Telephone Company of Canada or Bell Canada**
Multiple Sites Across Ontario Ottawa ON H3B 2M8

Database:
ECA

Approval No:	6207-CZZPLF	MOE District:	North Bay
Approval Date:	July 31, 2024	City:	
Status:	Approved	Longitude:	
Record Type:	ECA	Latitude:	
Link Source:	IDS	Geometry X:	-9016878.7543000001
SWP Area Name:		Geometry Y:	5700582.7322999965
Approval Type:	ECA-AIR		
Project Type:	AIR		

Business Name: The Bell Telephone Company of Canada or Bell Canada
Address: Multiple Sites Across Ontario
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/4515-CV9N3P-14.pdf>
PDF Site Location: Multiple Sites Across Ontario

Site: **South Nepean Development Corporation**
Ottawa ON K1P 0B6

Database:
ECA

Approval No: 4449-7XVU9J
Approval Date: 2009-11-18
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: South Nepean Development Corporation
Address:
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/3074-7XRQV2-14.pdf>
PDF Site Location:

Site: **Taggart Commercial Developments Ltd.**
Ottawa ON K2P 1P9

Database:
ECA

Approval No: 7279-9A3ND2
Approval Date: 2013-07-31
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: Taggart Commercial Developments Ltd.
Address:
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/8903-99ELG5-14.pdf>
PDF Site Location:

Site: **City of Ottawa**
Somerset St W Ottawa ON K1P 1J1

Database:
ECA

Approval No: 0195-8HMLH2
Approval Date: 2011-06-15
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: City of Ottawa
Address: Somerset St W
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/3106-8HFGKN-14.pdf>
PDF Site Location:

Site: **Urbandale Corporation**
Ottawa ON K1G 2H5

Database:
ECA

Approval No: 4781-4ZEKPM
Approval Date: 2001-08-21
Status: Approved
MOE District:
City:
Longitude:

Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-INDUSTRIAL SEWAGE WORKS
Project Type: INDUSTRIAL SEWAGE WORKS
Business Name: Urbandale Corporation
Address:
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/1402-4Z2HBD-14.pdf>
PDF Site Location:

Latitude:
Geometry X:
Geometry Y:

Site: **Urbandale Corporation**
Ottawa ON K1G 2H5

Database:
ECA

Approval No: 8787-5YQRUU
Approval Date: 2004-05-10
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: Urbandale Corporation
Address:
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/3747-5YPLC8-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: **Taggart Construction Limited**
Mobile Facility Ottawa ON K1V 8Y3

Database:
ECA

Approval No: 0636-7KEL2F
Approval Date: 2008-11-19
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-AIR
Project Type: AIR
Business Name: Taggart Construction Limited
Address: Mobile Facility
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/8556-6XWUA3-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: **Urbandale Corporation**
Ottawa ON K1G 2H5

Database:
ECA

Approval No: 1830-6H3P2S
Approval Date: 2005-10-14
Status: Revoked and/or Replaced
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: Urbandale Corporation
Address:
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/9122-6F6R74-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: **Taggart Aggregates Ltd.**

Database:
ECA

Ottawa ON K1V 8Y3

Approval No:	3704-CEYLJQ	MOE District:	Ottawa
Approval Date:	August 7, 2022	City:	
Status:	Approved	Longitude:	
Record Type:	ECA	Latitude:	
Link Source:	IDS	Geometry X:	-8458534.5194000006
SWP Area Name:	Rideau Valley	Geometry Y:	5654574.0473000035
Approval Type:	ECA-AIR		
Project Type:	AIR		
Business Name:	Taggart Aggregates Ltd.		
Address:			
Full Address:			
Full PDF Link:	https://www.accessenvironment.ene.gov.on.ca/instruments/0325-C63K3A-13.pdf		
PDF Site Location:	Portable Crushing Plant in Fernbank Quarry Lot Lots 13 and 14, Concession 10 Ottawa City, Ontario		

Site: **Taggart Miller Environmental Services Inc.**
Ottawa ON K2P 1P9

Database:
ECA

Approval No:	0376-CZBQFJ	MOE District:	North Bay
Approval Date:	January 22, 2024	City:	
Status:	Approved	Longitude:	
Record Type:	ECA	Latitude:	
Link Source:	IDS	Geometry X:	-9016878.7543000001
SWP Area Name:		Geometry Y:	5700582.7322999965
Approval Type:	ECA-INDUSTRIAL SEWAGE WORKS		
Project Type:	INDUSTRIAL SEWAGE WORKS		
Business Name:	Taggart Miller Environmental Services Inc.		
Address:			
Full Address:			
Full PDF Link:	https://www.accessenvironment.ene.gov.on.ca/instruments/5267-CWNM4G-14.pdf		
PDF Site Location:	Capital Region Resource Recovery Centre Lot 22-25, Concession XI Ottawa City,		

Site: **City of Ottawa**
Bank St from Laurier Avenue to Somerest Street Ottawa ON K1P 1J1

Database:
ECA

Approval No:	4804-7DGNT6	MOE District:	
Approval Date:	2008-04-08	City:	
Status:	Approved	Longitude:	
Record Type:	ECA	Latitude:	
Link Source:	IDS	Geometry X:	
SWP Area Name:		Geometry Y:	
Approval Type:	ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS		
Project Type:	MUNICIPAL AND PRIVATE SEWAGE WORKS		
Business Name:	City of Ottawa		
Address:	Bank St from Laurier Avenue to Somerest Street		
Full Address:			
Full PDF Link:	https://www.accessenvironment.ene.gov.on.ca/instruments/2768-7DDL4E-14.pdf		
PDF Site Location:			

Site: **City of Ottawa**
Bank St Ottawa ON K2H 5E3

Database:
ECA

Approval No:	0699-D49N2H	MOE District:	Ottawa
Approval Date:	April 18, 2024	City:	
Status:	Approved	Longitude:	
Record Type:	ECA	Latitude:	
Link Source:	IDS	Geometry X:	-8415176.869
SWP Area Name:	South Nation	Geometry Y:	5672372.244
Approval Type:	ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS		
Project Type:	MUNICIPAL AND PRIVATE SEWAGE WORKS		

Business Name: City of Ottawa
Address: Bank St
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/2206-D3QL9H-14.pdf>
PDF Site Location: Bank Street
City of Ottawa, Ontario

Site: *The Bell Telephone Company of Canada or Bell Canada
Multiple Sites Across Ontario Ottawa ON H3B 2M8*

Database:
ECA

Approval No: 1529-B8QPS5
Approval Date: 2019-12-11
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-AIR
Project Type: AIR
Business Name: The Bell Telephone Company of Canada or Bell Canada
Address: Multiple Sites Across Ontario
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/9060-AW6T5N-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: *Taggart Miller Environmental Services Inc.
Ottawa ON K2P 1P9*

Database:
ECA

Approval No: 2172-BAGR2C
Approval Date: 2019-10-07
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-AIR
Project Type: AIR
Business Name: Taggart Miller Environmental Services Inc.
Address:
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/0412-AW7KNR-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: *Taggart Aggregates Ltd.
Mobile Facility Ottawa ON K1V 8Y3*

Database:
ECA

Approval No: 2795-BB6LGF
Approval Date: 2019-09-03
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-AIR
Project Type: AIR
Business Name: Taggart Aggregates Ltd.
Address: Mobile Facility
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/1998-B6BKSQ-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: *Taggart Miller Environmental Services Inc.
Ottawa ON K2P 1P9*

Database:
ECA

Approval No: 4742-B3ULFF
Approval Date: 2019-03-07
Status: Approved

MOE District:
City:
Longitude:

Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-INDUSTRIAL SEWAGE WORKS
Project Type: INDUSTRIAL SEWAGE WORKS
Business Name: Taggart Miller Environmental Services Inc.
Address:
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/9364-AW7KFR-13.pdf>
PDF Site Location:

Latitude:
Geometry X:
Geometry Y:

Site: **South Nepean Development Corporation**
Ottawa ON K1P 0B6

Database:
ECA

Approval No: 9472-823Q7E
Approval Date: 2010-01-29
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: South Nepean Development Corporation
Address:
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/1781-7YHPPP-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: **Urbandale Corporation**
Ottawa ON K1G 2H5

Database:
ECA

Approval No: 0666-5YQRZ3
Approval Date: 2004-05-10
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-Municipal Drinking Water Systems
Project Type: Municipal Drinking Water Systems
Business Name: Urbandale Corporation
Address:
Full Address:
Full PDF Link:
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: **City of Ottawa**
Bank St from Laurier Avenue to Somerest Street Ottawa ON K1P 1J1

Database:
ECA

Approval No: 8654-7DGNMN
Approval Date: 2008-04-08
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-Municipal Drinking Water Systems
Project Type: Municipal Drinking Water Systems
Business Name: City of Ottawa
Address: Bank St from Laurier Avenue to Somerest Street
Full Address:
Full PDF Link:
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: **The Filmore Inc.**

Database:
ECA

Nepean Street Ottawa ON K2A 0E7

Approval No:	9532-62ULPC	MOE District:
Approval Date:	2004-07-14	City:
Status:	Approved	Longitude:
Record Type:	ECA	Latitude:
Link Source:	IDS	Geometry X:
SWP Area Name:		Geometry Y:
Approval Type:	ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS	
Project Type:	MUNICIPAL AND PRIVATE SEWAGE WORKS	
Business Name:	The Filmore Inc.	
Address:	Nepean Street	
Full Address:		
Full PDF Link:	https://www.accessenvironment.ene.gov.on.ca/instruments/4647-5ZMJ4E-14.pdf	
PDF Site Location:		

<u>Site:</u>	Bank St Ottawa ON	Database:
		EHS

Order No:	20031121005	Nearest Intersection:	See Faxed Map
Status:	C	Municipality:	
Report Type:	Basic Report	Client Prov/State:	ON
Report Date:	11/25/03	Search Radius (km):	0.50
Date Received:	11/21/03	X:	-75.654252
Previous Site Name:		Y:	45.363635
Lot/Building Size:			
Additional Info Ordered:			

<u>Site:</u>	Bank St Ottawa ON	Database:
		EHS

Order No:	20060427021	Nearest Intersection:	
Status:	C	Municipality:	
Report Type:	Custom Report	Client Prov/State:	ON
Report Date:	5/5/2006	Search Radius (km):	0.25
Date Received:	4/26/2006	X:	-75.670288
Previous Site Name:		Y:	45.364953
Lot/Building Size:			
Additional Info Ordered:			

<u>Site:</u>	Hydro Ottawa Ltd. Bank St Ottawa ON	Database:
		GEN

Generator Info

Generator No:	ON8798860	Choice of Contact:
Approval Years:	03,04	Contaminated Fac:
Status:		MHSW Facility:
PO Box No:		SIC Code:
Country:		
Co Admin:		
Phone No Admin:		
SIC Description:		

<u>Site:</u>	DEPARTMENT OF NATIONAL DEFENCE OTTAWA ON K1R 3J7	Database:
		NPCB

Company Code:	O3014PH
Industry:	NATIONAL DEFENCE
Site Status:	DELETED FEDERAL SITES
Transaction Date:	12/6/1997
Inspection Date:	

Site: DEPARTMENT OF NATIONAL DEFENCE
OTTAWA ON K1R 3J7

Database:
[NPCB](#)

Company Code: O3009
Industry: NATIONAL DEFENCE
Site Status: FEDERAL FACILITIES (IN USE)
Transaction Date: 2/11/1993
Inspection Date:

Site: DEPARTMENT OF NATIONAL DEFENCE
OTTAWA ON K1R 3J7

Database:
[NPCB](#)

Company Code: O3014
Industry: NATIONAL DEFENCE
Site Status: DELETED FEDERAL SITES
Transaction Date: 12/8/1998
Inspection Date: 1/21/1994

--Details--

Label: DO02600
Serial No.: 162825
PCB Type/Code: MINERAL OIL/ULTRA LOW
Location:
Item/State: TRANSFORMER/FULL
No. of Items: 1
Manufacturer:
Status: STORED FOR DISPOSAL
Contents: 68 L

Label: DO02599
Serial No.: 851123
PCB Type/Code: MINERAL OIL/LOW
Location:
Item/State: TRANSFORMER/FULL
No. of Items: 1
Manufacturer:
Status: STORED FOR DISPOSAL
Contents: 91 L

Site: Department of National Defence
Ottawa ON

Database:
[NPCB](#)

Company Code: O3014
Industry: National Defence
Site Status: Stored for Disposal
Transaction Date: 1/21/1994
Inspection Date: 1/21/1994

--Details--

Label:
Serial No.:
PCB Type/Code: Mineral Oil/Low
Location:
Item/State:
No. of Items:
Manufacturer:
Status: Stored for disposal
Contents:

Label:
Serial No.:
PCB Type/Code: Mineral Oil/Ultra Low
Location:

Item/State:
No. of Items:
Manufacturer:
Status: Stored for disposal
Contents:

Site: Ottawa Dairy Well
ON

Database:
OOGW

Licence No:	N000085	Well Compl:	21017
Well ID:	21285	County:	Ottawa/Carleton
Well Compl ID:	21017	Block:	
W Class ID:		Lot:	
UWI Code:	N000085	Conc:	
Permit Date:		Surface Lat NAD83:	
Depth(m):		Surface Long NAD83:	
Well Pool:		Bottom Lat NAD83:	
Completion Date:		Bottom Long NAD83:	
Depth Reached:		Lot Sides (m):	X
Capped Date:		E/W (m):	X
Class ID:		Latitude Nad27:	
DB Source:		Longitude Nad27:	
Status as of:	August 2024	bottom lat27:	
Start Date:		bottom long27:	
SPUD Date:		Lateral:	No
Class:		Accuracy:	
Grnd Elev:		Method:	
KB Elev:		Parent:	
TVD:		Prod Top:	
PBTD:		Prod Bot:	
TD Form:		PROPD Depth:	
Workover D:		Location Method:	
Operator:	Unknown	Location Accuracy:	Unknown
Township:		Dt Obtained:	
Target:		Well Status Type:	Location
Classification:		Well Status Mode:	Unknown
Well Name:	Ottawa Dairy Well		
Target Desc:			
Status Type Desc:	A LOCATION FOR WHICH MINISTRY RECORDS INDICATE A WELL HAS BEEN DRILLED BUT FOR WHICH NO STATUS INFORMATION IS AVAILABLE		
Status Mode Desc:	A WELL FOR WHICH THERE IS NO AVAILABLE INFORMATION ON MODE IN MINISTRY RECORDS		
Classification Desc:			
Cement Rec:			
Comments:			

Site: NAZIMA MEDEWAR
HWY 31 OTTAWA ON

Database:
PRT

Location ID: 11082
Type: retail
Expiry Date: 1996-03-31
Capacity (L): 36368
Licence #: 0016234001

Site: QUEENSWAY TANK LINES
CANADIAN TIRE GAS BAR BANK STREET TANK TRUCK (CARGO) OTTAWA CITY ON

Database:
SPL

Ref No:	41622	Municipality No:	20101
Year:		Nature of Damage:	
Incident Dt:	10/2/1990	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	
MOE Reported Dt:	10/2/1990	Impact to Health:	
Dt Document Closed:		Agency Involved:	MCCR
Site No:			
MOE Response:			
Site County/District:			

Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name:
Site Address:
Site Region:
Site Municipality: OTTAWA CITY
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name:
Client Type:
Source Type:
Incident Cause: CONTAINER OVERFLOW
Incident Preceding Spill:
Incident Reason: ERROR
Incident Summary: QUEENSWAY TANK LINES: 4 LGASOLINE SPILLED AT GAS BAR
Environment Impact: NOT ANTICIPATED
Health Env Consequence:
Nature of Impact:
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: LOBLAWS
OTTAWA CITY ON

Database:
[SPL](#)

Ref No:	49925	Municipality No:	20101
Year:		Nature of Damage:	
Incident Dt:	5/1/1991	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	
MOE Reported Dt:	5/1/1991	Impact to Health:	
Dt Document Closed:		Agency Involved:	
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:			
Site Address:			
Site Region:			
Site Municipality:	OTTAWA CITY		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			

Client Name:
Client Type:
Source Type:
Incident Cause: PIPE/HOSE LEAK
Incident Preceding Spill:
Incident Reason: OVERSTRESS/OVERPRESSURE
Incident Summary: LOBLAWS - HYDRAULIC OIL TO GROUND AND CATCHBASIN FROM BROKEN HOSE
Environment Impact: POSSIBLE
Health Env Consequence:
Nature of Impact: Water course or lake
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: PIONEER PETROLEUMS LTD.
 BANK STREET SOUTH PIONEER GAS STATION. SERVICE STATION OTTAWA CITY ON

Database:
 SPL

Ref No:	137358	Municipality No:	20101
Year:		Nature of Damage:	
Incident Dt:	2/20/1997	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	
MOE Reported Dt:	2/20/1997	Impact to Health:	
Dt Document Closed:		Agency Involved:	
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:			
Site Address:			
Site Region:			
Site Municipality:	OTTAWA CITY		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			
Client Name:			
Client Type:			
Source Type:			
Incident Cause:	CONTAINER OVERFLOW		
Incident Preceding Spill:			
Incident Reason:	ERROR		
Incident Summary:	PIONEER PETROLEUMS-4L GASOLINE TO GROUND,UNSAFESPILL RESPONSE BY STAFF.		
Environment Impact:	NOT ANTICIPATED		
Health Env Consequence:			
Nature of Impact:			
Contaminant Qty:			
Contaminant Qty 1:			
Contaminant Unit:			
Contaminant Code:			

Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: ESSO PETROLEUM CANADA
BANK STREET SERVICE STATION OTTAWA CITY ON

Database:
SPL

Ref No:	147934	Municipality No:	20101
Year:		Nature of Damage:	
Incident Dt:	10/16/1997	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	
MOE Reported Dt:	10/16/1997	Impact to Health:	
Dt Document Closed:		Agency Involved:	
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:			
Site Address:			
Site Region:			
Site Municipality:	OTTAWA CITY		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			
Client Name:			
Client Type:			
Source Type:			
Incident Cause:	PIPE/HOSE LEAK		
Incident Preceding Spill:			
Incident Reason:	DAMAGE BY MOVING EQUIPMENT		
Incident Summary:	ESSO SERVICE STATION: 40 L GASOLINE TO GROUND		
Environment Impact:	NOT ANTICIPATED		
Health Env Consequence:			
Nature of Impact:			
Contaminant Qty:			
Contaminant Qty 1:			
Contaminant Unit:			
Contaminant Code:			
Contaminant Name:			
Contaminant Limit 1:			
Contam Limit Freq 1:			
Contaminant UN No 1:			
Receiving Medium:	LAND		
Activity Preceding Spill:			
Property 2nd Watershed:			
Property Tertiary Watershed:			
Sector Type:			
SAC Action Class:			
Call Report Locatn Geodata:			
Time Reported:			
System Facility Address:			

Site: OTTAWA-CARLETON, R.M. OF
KENT ST REGULATOR TO OTTAWA RIVER ON N.R.C. PROPERTY SANITARY SEWER SYSTEM OTTAWA CITY ON

Database:
[SPL](#)

Ref No: 153191 **Municipality No:** 20101
Year: **Nature of Damage:**
Incident Dt: 3/9/1998 **Discharger Report:**
Dt MOE Arvl on Scn: **Material Group:**
MOE Reported Dt: 3/10/1998 **Impact to Health:**
Dt Document Closed: **Agency Involved:**
Site No:
MOE Response:
Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name:
Site Address:
Site Region:
Site Municipality: OTTAWA CITY
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name:
Client Type:
Source Type:
Incident Cause: PIPE/HOSE LEAK
Incident Preceding Spill:
Incident Reason: STORM/FLOOD/WIND
Incident Summary: OTTAWA CARLETON R.M.- LEAK OF RAW UNCHLORINATED SEWAGE, PIPE CRACKED.
Environment Impact: POSSIBLE
Health Env Consequence:
Nature of Impact: Soil contamination
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: OC TRANSP
BANK ST. SOUTH MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON

Database:
[SPL](#)

Ref No: 223917 **Municipality No:** 20107
Year: **Nature of Damage:**
Incident Dt: 4/11/2002 **Discharger Report:**
Dt MOE Arvl on Scn: **Material Group:**
MOE Reported Dt: 4/11/2002 **Impact to Health:**
Dt Document Closed: **Agency Involved:**
Site No:
MOE Response:
Site County/District:
Site Geo Ref Meth:

Site District Office:
Nearest Watercourse:
Site Name:
Site Address:
Site Region:
Site Municipality: OTTAWA CITY
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name:
Client Type:
Source Type:
Incident Cause: PIPE/HOSE LEAK
Incident Preceding Spill:
Incident Reason: UNKNOWN
Incident Summary: SPILL OF DIESEL FUEL TO GRND, CLEAN UP CREW ON THE WAY
Environment Impact: POSSIBLE
Health Env Consequence:
Nature of Impact: Soil contamination
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: Shell Canada Products Limited
 Shell Canada Ottawa ON

Database:
 SPL

Ref No:	6267-5M2K7H	Municipality No:	
Year:		Nature of Damage:	
Incident Dt:	4/28/2003	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	Oil
MOE Reported Dt:	4/28/2003	Impact to Health:	
Dt Document Closed:		Agency Involved:	
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:	Ottawa		
Nearest Watercourse:			
Site Name:	LOADING RACK 1<UNOFFICIAL>		
Site Address:			
Site Region:	Eastern		
Site Municipality:	Ottawa		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			
Client Name:	Shell Canada Products Limited		

Client Type:
Source Type:
Incident Cause:
Incident Preceding Spill:
Incident Reason:
Incident Summary: Shell - 1L gasoline
Environment Impact: Possible
Health Env Consequence:
Nature of Impact: Other Impact(s)
Contaminant Qty: 1 L
Contaminant Qty 1:
Contaminant Unit: L
Contaminant Code: 12
Contaminant Name: GASOLINE
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: Land
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class: Spills
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: Loblaw Properties Limited
 Loblaws Ottawa ON

Database:
 SPL

Ref No:	2287-7FNKE6	Municipality No:
Year:		Nature of Damage:
Incident Dt:		Discharger Report:
Dt MOE Arvl on Scn:		Material Group:
MOE Reported Dt:	6/16/2008	Impact to Health:
Dt Document Closed:	9/8/2008	Agency Involved:
Site No:		
MOE Response:	No Field Response	
Site County/District:		
Site Geo Ref Meth:		
Site District Office:	Ottawa	
Nearest Watercourse:		
Site Name:	Loblaws	
Site Address:		
Site Region:		
Site Municipality:	Ottawa	
Site Lot:		
Site Conc:		
Site Geo Ref Accu:		
Site Map Datum:		
Northing:	NA	
Easting:	NA	
Entity Operating Name:		
Client Name:	Loblaw Properties Limited	
Client Type:		
Source Type:		
Incident Cause:	Discharge or Emission to Air	
Incident Preceding Spill:		
Incident Reason:	Equipment Failure - Malfunction of system components	
Incident Summary:	Loblaws, 625 lb of R22 released to atmosphere.	
Environment Impact:	Not Anticipated	
Health Env Consequence:		
Nature of Impact:	Air Pollution	
Contaminant Qty:	625 lb	
Contaminant Qty 1:	625	
Contaminant Unit:	lb	
Contaminant Code:	38	
Contaminant Name:	FREON R-22 (CFC)	

Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium:
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Other
SAC Action Class: Air Spills - Gases and Vapours
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: City of Ottawa
between O'Connor St & Bank St Ottawa ON

Database:
[SPL](#)

Ref No:	8730-97QGQG	Municipality No:
Year:		Nature of Damage:
Incident Dt:	15-MAY-13	Discharger Report:
Dt MOE Arvl on Scn:		Material Group:
MOE Reported Dt:	15-MAY-13	Impact to Health:
Dt Document Closed:		Agency Involved:
Site No:		
MOE Response:	No Field Response	
Site County/District:		
Site Geo Ref Meth:		
Site District Office:		
Nearest Watercourse:		
Site Name:	Albert Street<UNOFFICIAL>	
Site Address:	between O'Connor St & Bank St	
Site Region:		
Site Municipality:	Ottawa	
Site Lot:		
Site Conc:		
Site Geo Ref Accu:		
Site Map Datum:		
Northing:		
Easting:		
Entity Operating Name:		
Client Name:	City of Ottawa	
Client Type:		
Source Type:		
Incident Cause:	Leak/Break	
Incident Preceding Spill:		
Incident Reason:	Equipment Failure	
Incident Summary:	OC Transpo Bus, 20 L coolant to c/b	
Environment Impact:	Not Anticipated	
Health Env Consequence:		
Nature of Impact:	Surface Water Pollution	
Contaminant Qty:	20 L	
Contaminant Qty 1:	20	
Contaminant Unit:	L	
Contaminant Code:	27	
Contaminant Name:	COOLANT N.O.S.	
Contaminant Limit 1:		
Contam Limit Freq 1:		
Contaminant UN No 1:		
Receiving Medium:		
Activity Preceding Spill:		
Property 2nd Watershed:		
Property Tertiary Watershed:		
Sector Type:	Motor Vehicle	
SAC Action Class:	Watercourse Spills	
Call Report Locatn Geodata:		
Time Reported:		
System Facility Address:		

Site:	OLRT Constructors <i>Road allowance between Broken Front Concessions C and D in front of Lot D geographic township of Nepean</i> Ottawa ON	Database: SPL
Ref No:	2862-9XEKED	Municipality No:
Year:		Nature of Damage:
Incident Dt:	6/12/2015	Discharger Report:
Dt MOE Arvl on Scn:		Material Group:
MOE Reported Dt:	6/12/2015	Impact to Health:
Dt Document Closed:		Agency Involved:
Site No:	0706-92ET4A	
MOE Response:	N	
Site County/District:		
Site Geo Ref Meth:	1-10 metres eg. Good Quality GPS	
Site District Office:		
Nearest Watercourse:		
Site Name:	Ottawa Light Rail Transit - East Portal	
Site Address:	Road allowance between Broken Front Concessions C and D in front of Lot D geographic township of Nepean	
Site Region:		
Site Municipality:	Ottawa	
Site Lot:		
Site Conc:		
Site Geo Ref Accu:	GIS Software	
Site Map Datum:	NAD83	
Northing:	5030149	
Easting:	446343	
Entity Operating Name:		
Client Name:	OLRT Constructors	
Client Type:		
Source Type:		
Incident Cause:	Leak/Break	
Incident Preceding Spill:		
Incident Reason:	Equipment Failure	
Incident Summary:	OLRT: hyd oil to grd, ctnd clng 2 L	
Environment Impact:		
Health Env Consequence:		
Nature of Impact:	Land	
Contaminant Qty:	2 L	
Contaminant Qty 1:	2	
Contaminant Unit:	L	
Contaminant Code:	15	
Contaminant Name:	HYDRAULIC OIL	
Contaminant Limit 1:		
Contam Limit Freq 1:		
Contaminant UN No 1:		
Receiving Medium:		
Activity Preceding Spill:		
Property 2nd Watershed:		
Property Tertiary Watershed:		
Sector Type:		
SAC Action Class:	Land Spills	
Call Report Locatn Geodata:		
Time Reported:		
System Facility Address:		

Site:	Bell Canada Ottawa ON	Database: SPL
Ref No:	8881-9J2J33	Municipality No:
Year:		Nature of Damage:
Incident Dt:	2014/04/10	Discharger Report:
Dt MOE Arvl on Scn:		Material Group:
MOE Reported Dt:	2014/04/10	Impact to Health:
Dt Document Closed:	2014/11/04	Agency Involved:
Site No:	NA	
MOE Response:	Referral to others	
Site County/District:		
Site Geo Ref Meth:		

Site District Office:
Nearest Watercourse:
Site Name: 3212 Richmond Rd<UNOFFICIAL>
Site Address:
Site Region:
Site Municipality: Ottawa
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name: Bell Canada
Client Type:
Source Type:
Incident Cause: Leak/Break
Incident Preceding Spill:
Incident Reason: Equipment Failure
Incident Summary: Bell Canada: possible >100 kg freon to atm.
Environment Impact: Confirmed
Health Env Consequence:
Nature of Impact: Air Pollution
Contaminant Qty: 0 other - see incident description
Contaminant Qty 1: 0
Contaminant Unit: other - see incident description
Contaminant Code: 38
Contaminant Name: FREON R-22 (CFC)
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium:
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Pipeline/Components
SAC Action Class: Air Spills - Gases and Vapours
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site:
Kent Street near Bank Street Ottawa ON

Database:
SPL

Ref No:	5751-ABLQJZ	Municipality No:
Year:		Nature of Damage:
Incident Dt:	2016/07/06	Discharger Report:
Dt MOE Arvl on Scn:		Material Group:
MOE Reported Dt:	2016/07/06	Impact to Health:
Dt Document Closed:		Agency Involved:
Site No:	NA	
MOE Response:	No	
Site County/District:		
Site Geo Ref Meth:		
Site District Office:		
Nearest Watercourse:		
Site Name:	CB in Roadway<UNOFFICIAL>	
Site Address:	Kent Street near Bank Street	
Site Region:		
Site Municipality:	Ottawa	
Site Lot:		
Site Conc:		
Site Geo Ref Accu:		
Site Map Datum:		
Northing:	5029483	
Easting:	445423	
Entity Operating Name:		
Client Name:		

Client Type:
Source Type:
Incident Cause:
Incident Preceding Spill: Operator/Human error
Incident Reason: Maintenance
Incident Summary: Ottawa: 45 kgs Aggregate to CB. Cntd, clnd.
Environment Impact:
Health Env Consequence:
Nature of Impact:
Contaminant Qty: 45 kg
Contaminant Qty 1: 45
Contaminant Unit: kg
Contaminant Code: 99
Contaminant Name: SAND/GRAVEL
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: Surface Water
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Miscellaneous Communal
SAC Action Class: Land Spills
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: Taggart Aggregates Ltd.
 Ottawa ON

Database:
 SPL

Ref No: 6604-BAFN75
Year:
Incident Dt: 3/20/2019
Dt MOE Arvl on Scn:
MOE Reported Dt: 3/20/2019
Dt Document Closed: 3/22/2019
Site No: NA
MOE Response: No
Site County/District:
Site Geo Ref Meth:
Site District Office: Ottawa
Nearest Watercourse:
Site Name: Fernbank Quarry<UNOFFICIAL>
Site Address:
Site Region: Eastern
Site Municipality: Ottawa
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name: Taggart Aggregates Ltd.
Client Type: Corporation
Source Type:
Incident Cause:
Incident Preceding Spill:
Incident Reason:
Incident Summary: Quarry blast causing rattling at residential properties
Environment Impact:
Health Env Consequence:
Nature of Impact:
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:

Municipality No:
Nature of Damage:
Discharger Report:
Material Group:
Impact to Health: 0 - No Impact
Agency Involved:

Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium:
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: Taggart Construction Limited
Ottawa ON

Database:
[SPL](#)

Ref No:	7584-BB3KRQ	Municipality No:	
Year:		Nature of Damage:	
Incident Dt:	4/4/2019	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	
MOE Reported Dt:	4/9/2019	Impact to Health:	
Dt Document Closed:		Agency Involved:	
Site No:	NA		
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:	Ottawa		
Nearest Watercourse:			
Site Name:	1896 John Quinn rd, Metcalfe<UNOFFICIAL>		
Site Address:			
Site Region:	Eastern		
Site Municipality:	Ottawa		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			
Client Name:	Taggart Construction Limited		
Client Type:	Corporation		
Source Type:			
Incident Cause:			
Incident Preceding Spill:			
Incident Reason:			
Incident Summary:	Mobile Crusher Relocation - 2019		
Environment Impact:			
Health Env Consequence:			
Nature of Impact:			
Contaminant Qty:			
Contaminant Qty 1:			
Contaminant Unit:			
Contaminant Code:			
Contaminant Name:			
Contaminant Limit 1:			
Contam Limit Freq 1:			
Contaminant UN No 1:			
Receiving Medium:			
Activity Preceding Spill:			
Property 2nd Watershed:			
Property Tertiary Watershed:			
Sector Type:			
SAC Action Class:			
Call Report Locatn Geodata:			
Time Reported:			
System Facility Address:			

Site: Taggart Miller Environmental Services Inc.
Ottawa ON K2P 1P9

Database:
WDS

Approval No: 4538-B8EMLT
Mob Unit Cert No:
EBR Registry No:
Status: Approved
Facility Type:
Record Type: ECA
Link Source: IDS
Project Type: WASTE DISPOSAL SITES
Application Status:

Issue Date: 2019-12-13

Input Date:

Date Received:

Est Closure Date:

Mobile Capacity:

Mobile Units:

Mobile Description:

Prop City:

Prop Postal:

Prop Phone:

Serial Link:

Approval Type: ECA-WASTE DISPOSAL SITES

Proponent:

Prop Address:

Proponent County/District:

Full Address:

Site Lot:

Waste Class Code:

Waste Class:

Waste Type:

Waste Type Other:

Waste Description:

Landfill Monitoring:

Landfill Ctrl Type:

Site Closing Description:

Project Description:

Municipalities Served:

Approval Description:

Other Approvals/Permits:

PDF URL:

<https://www.accessenvironment.ene.gov.on.ca/instruments/1994-AW7JS8-14.pdf>

PDF Site Location:

Total Area (ha):
Landfill Cap (m³):
Transfer Area (ha):
Transfer Cap (m³):
Transfer Cert No:
Inciner. Area (ha):
Inciner. Cap (t):
Process Area (m³):
Process Cap (m³/d):
Process Vol (m³):
Process Feed (m³):
Site Concession:
Site Region/County:
SWP Area Name:
MOE District:
District Office:
Latitude:
Longitude:
Geometry X:
Geometry Y:

Appendix: Database Descriptions

*Environmental Risk Information Services (ERIS) can search the following databases. The extent of historical information varies with each database and current information is determined by what is publicly available to ERIS at the time of update. **Note:** Databases denoted with " * " indicates that the database will no longer be updated. See the individual database description for more information.*

Abandoned Aggregate Inventory:

Provincial

[AAGR](#)

The MAAP Program maintains a database of abandoned pits and quarries. Please note that the database is only referenced by lot and concession and city/town location. The database provides information regarding the location, type, size, land use, status and general comments.*

Government Publication Date: Sept 2002*

Aggregate Inventory:

Provincial

[AGR](#)

This database of licensed and permitted pits and quarries is maintained by the Ontario Ministry of Natural Resources and Forestry (MNRF), as regulated under the Aggregate Resources Act, R.S.O. 1990. Aggregate site data has been divided into active and inactive sites. Active sites may be further subdivided into partial surrenders. In partial surrenders, defined areas of a site are inactive while the rest of the site remains active.

Government Publication Date: Up to Nov 2024

Abandoned Mine Information System:

Provincial

[AMIS](#)

The Abandoned Mines Information System contains data on known abandoned and inactive mines located on both Crown and privately held lands. The information was provided by the Ministry of Northern Development and Mines (MNDM), with the following disclaimer: "the database provided has been compiled from various sources, and the Ministry of Northern Development and Mines makes no representation and takes no responsibility that such information is accurate, current or complete". Reported information includes official mine name, status, background information, mine start/end date, primary commodity, mine features, hazards and remediation.

Government Publication Date: 1800-Apr 2024

Anderson's Waste Disposal Sites:

Private

[ANDR](#)

The information provided in this database was collected by examining various historical documents which aimed to characterize the likely position of former waste disposal sites from 1860 to present. The research initiative behind the creation of this database was to identify those sites that are missing from the Ontario MOE Waste Disposal Site Inventory, as well as to provide revisions and corrections to the positions and descriptions of sites currently listed in the MOE inventory. In addition to historic waste disposal facilities, the database also identifies certain auto wreckers and scrap yards that have been extrapolated from documentary sources. Please note that the data is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1860s-Present

Aboveground Storage Tanks:

Provincial

[AST](#)

Historical listing of aboveground storage tanks made available by the Department of Natural Resources and Forestry. Includes tanks used to hold water or petroleum. This dataset has been retired as of September 25, 2014 and will no longer be updated.

Government Publication Date: May 31, 2014

Automobile Wrecking & Supplies:

Private

[AUWR](#)

This database provides an inventory of known locations that are involved in the scrap metal, automobile wrecking/recycling, and automobile parts & supplies industry. Information is provided on the company name, location and business type.

Government Publication Date: 1999-Apr 30, 2024

Borehole:

Provincial

[BORE](#)

A borehole is the generalized term for any narrow shaft drilled in the ground, either vertically or horizontally. The information here includes geotechnical investigations or environmental site assessments, mineral exploration, or as a pilot hole for installing piers or underground utilities. Information is from many sources such as the Ministry of Transportation (MTO) boreholes from engineering reports and projects from the 1950 to 1990's in Southern Ontario. Boreholes from the Ontario Geological Survey (OGS) including The Urban Geology Analysis Information System (UGAIS) and the York Peel Durham Toronto (YPDT) database of the Conservation Authority Moraine Coalition. This database will include fields such as location, stratigraphy, depth, elevation, year drilled, etc. For all water well data or oil and gas well data for Ontario please refer to WWIS and OOGW.

Government Publication Date: 1875-Jul 2018

Certificates of Approval:

Provincial CA

This database contains the following types of approvals: Air & Noise, Industrial Sewage, Municipal & Private Sewage, Waste Management Systems and Renewable Energy Approvals. The MOE in Ontario states that any facility that releases emissions to the atmosphere, discharges contaminants to ground or surface water, provides potable water supplies, or stores, transports or disposes of waste, must have a Certificate of Approval before it can operate lawfully. Fields include approval number, business name, address, approval date, approval type and status. This database will no longer be updated, as CofA's have been replaced by either Environmental Activity and Sector Registry (EASR) or Environmental Compliance Approval (ECA). Please refer to those individual databases for any information after Oct.31, 2011.

Government Publication Date: 1985-Oct 30, 2011*

Dry Cleaning Facilities:

Federal CDRY

List of dry cleaning facilities made available by Environment and Climate Change Canada. Environment and Climate Change Canada's Tetrachloroethylene (Use in Dry Cleaning and Reporting Requirements) Regulations (SOR/2003-79) are intended to reduce releases of tetrachloroethylene to the environment from dry cleaning facilities.

Government Publication Date: Jan 2004-Dec 2022

Commercial Fuel Oil Tanks:

Provincial CFOT

Locations of commercial underground fuel oil tanks. This is not a comprehensive or complete inventory of commercial fuel tanks in the province; this listing is a copy of records of registered commercial underground fuel oil tanks obtained under Access to Public Information.

Note that the following types of tanks do not require registration: waste oil tanks in apartments, office buildings, residences, etc.; aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023

Chemical Manufacturers and Distributors:

Private CHEM

This database includes information from both a one time study conducted in 1992 and private source and is a listing of facilities that manufacture or distribute chemicals. The production of these chemical substances may involve one or more chemical reactions and/or chemical separation processes (i.e. fractionation, solvent extraction, crystallization, etc.).

Government Publication Date: 1999-Jan 31, 2020

Chemical Register:

Private CHM

This database includes a listing of locations of facilities within the Province or Territory that either manufacture and/or distributes chemicals.

Government Publication Date: 1999-Apr 30, 2024

Compressed Natural Gas Stations:

Private CNG

Canada has a network of public access compressed natural gas (CNG) refuelling stations. These stations dispense natural gas in compressed form at 3,000 pounds per square inch (psi), the pressure which is allowed within the current Canadian codes and standards. The majority of natural gas refuelling is located at existing retail gasoline that have a separate refuelling island for natural gas. This list of stations is made available by the Canadian Natural Gas Vehicle Alliance.

Government Publication Date: Dec 2012 -May 2024

Inventory of Coal Gasification Plants and Coal Tar Sites:

Provincial COAL

This inventory includes both the "Inventory of Coal Gasification Plant Waste Sites in Ontario-April 1987" and the Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario-November 1988) collected by the MOE. It identifies industrial sites that produced and continue to produce or use coal tar and other related tars. Detailed information is available and includes: facility type, size, land use, information on adjoining properties, soil condition, site operators/occupants, site description, potential environmental impacts and historic maps available. This was a one-time inventory.*

Government Publication Date: Apr 1987 and Nov 1988*

Compliance and Convictions:

Provincial CONV

This database summarizes the fines and convictions handed down by the Ontario courts beginning in 1989. Companies and individuals named here have been found guilty of environmental offenses in Ontario courts of law.

Government Publication Date: 1989-Oct 2024

Certificates of Property Use:

Provincial CPU

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include CPU's on the registry such as (EPA s. 168.6) - Certificate of Property Use.

Government Publication Date: 1994 - Nov 30, 2024

Drill Hole Database:

Provincial

[DRL](#)

The Ontario Drill Hole Database (ODHD) is offered by the Province of Ontario's Ministry of Mines. The dataset contains information for over 164,000 percussion, overburden, sonic and diamond-drill holes. The presence of assay results with cutoff values for gold, silver, copper, zinc, lead, nickel and platinum group elements is noted. Drill hole data are compiled from assessment files that have been submitted to the ministry in accordance with the Ontario Mining Act (OMA). Source assessment file numbers are captured for cross reference with the Ontario Assessment File Database (OAFD). Please note that limited data is available for southern Ontario, as it was the last area to be completed. The database was created when surveys submitted to the Ministry were converted in the Assessment File Research Image Database (AFRI) project. However, the degree of accuracy (coordinates) as to the exact location of drill holes is dependent upon the source document submitted. Levels of accuracy used to locate holes are: centering on the mining claim; a sketch of the mining claim; a 1:50,000 map; a detailed company map; or from submitted a "Report of Work".

Government Publication Date: 1886 - Aug 2024**Delisted Fuel Tanks:**

Provincial

[DTNK](#)

List of fuel storage tank sites that were once found in - and have since been removed from - the list of fuel storage tanks made available by the regulatory agency under Access to Public Information.

Government Publication Date: Oct 2023**Environmental Activity and Sector Registry:**

Provincial

[EASR](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. The EASR allows businesses to register certain activities with the ministry, rather than apply for an approval. The registry is available for common systems and processes, to which preset rules of operation can be applied. The EASR is currently available for: heating systems, standby power systems and automotive refinishing. Businesses whose activities aren't subject to the EASR may apply for an ECA (Environmental Compliance Approval). Please see our ECA database.

Government Publication Date: Oct 2011-Oct 31, 2024**Environmental Registry:**

Provincial

[EBR](#)

The Environmental Registry lists proposals, decisions and exceptions regarding policies, Acts, instruments, or regulations that could significantly affect the environment. Through the Registry, thirteen provincial ministries notify the public of upcoming proposals and invite their comments. For example, if a local business is requesting a permit, license, or certificate of approval to release substances into the air or water; these are notified on the registry. Data includes: Approval for discharge into the natural environment other than water (i.e. Air) - EPA s. 9, Approval for sewage works - OWRA s. 53(1), and EPA s. 27 - Approval for a waste disposal site. For information regarding Permit to Take Water (PTTW), Certificate of Property Use (CPU) and (ORD) Orders please refer to those individual databases.

Government Publication Date: 1994 - Nov 30, 2024**Environmental Compliance Approval:**

Provincial

[ECA](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. In the past, a business had to apply for multiple approvals (known as certificates of approval) for individual processes and pieces of equipment. Today, a business either registers itself, or applies for a single approval, depending on the types of activities it conducts. Businesses whose activities aren't subject to the EASR may apply for an ECA. A single ECA addresses all of a business's emissions, discharges and wastes. Separate approvals for air, noise and waste are no longer required. This database will also include Renewable Energy Approvals. For certificates of approval prior to Nov 1st, 2011, please refer to the CA database. For all Waste Disposal Sites please refer to the WDS database.

Government Publication Date: Oct 2011-Oct 31, 2024**Environmental Effects Monitoring:**

Federal

[EEM](#)

The Environmental Effects Monitoring program assesses the effects of effluent from industrial or other sources on fish, fish habitat and human usage of fisheries resources. Since 1992, pulp and paper mills have been required to conduct EEM studies under the Pulp and Paper Effluent Regulations. This database provides information on the mill name, geographical location and sub-lethal toxicity data.

Government Publication Date: 1992-2007***ERIS Historical Searches:**

Private

[EHS](#)

ERIS has compiled a database of all environmental risk reports completed since March 1999. Available fields for this database include: site location, date of report, type of report, and search radius. As per all other databases, the ERIS database can be referenced on both the map and "Statistical Profile" page.

Government Publication Date: 1999-Aug 31, 2024**Environmental Issues Inventory System:**

Federal

[EIIS](#)

The Environmental Issues Inventory System was developed through the implementation of the Environmental Issues and Remediation Plan. This plan was established to determine the location and severity of contaminated sites on inhabited First Nation reserves, and where necessary, to remediate those that posed a risk to health and safety; and to prevent future environmental problems. The EIIS provides information on the reserve under investigation, inventory number, name of site, environmental issue, site action (Remediation, Site Assessment), and date investigation completed.

Government Publication Date: 1992-2001*

Emergency Management Historical Event:

Provincial

EMHE

List of locations of historical occurrences of emergency events, including those assigned to the Ministry of Natural Resources by Order-In-Council (OIC) under the Emergency Management and Civil Protection Act, as well as events where MNR provided requested emergency response assistance. Many of these events will have involved community evacuations, significant structural loss, and/or involvement of MNR emergency response staff. These events fall into one of ten (10) type categories: Dam Failure; Drought / Low Water; Erosion; Flood; Forest Fire; Soil and Bedrock Instability; Petroleum Resource Center Event, EMO Requested Assistance, Continuity of Operations Event, Other Requested Assistance. EMHE record details are reproduced by ERIIS under License with the Ontario Ministry of Natural Resources © Queen's Printer for Ontario, 2017.

Government Publication Date: Apr 30, 2022

Environmental Penalty Annual Report:

Provincial

EPAR

This database contains data from Ontario's annual environmental penalty report published by the Ministry of the Environment and Climate Change. These reports provide information on environmental penalties for land or water violations issued to companies in one of the nine industrial sectors covered by the Municipal Industrial Strategy for Abatement (MISA) regulations.

Government Publication Date: Jan 1, 2011 - Dec 31, 2023

List of Expired Fuels Safety Facilities:

Provincial

EXP

List of facilities and tanks for which there was once a fuel registration. This is not a comprehensive or complete inventory of expired tanks/tank facilities in the province; this listing is a copy of previously registered tanks and facilities obtained under Access to Public Information. Includes private fuel outlets, bulk plants, fuel oil tanks, gasoline stations, marinas, propane filling stations, liquid fuel tanks, piping systems, etc; includes tanks which have been removed from the ground.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023

Federal Convictions:

Federal

FCON

Environment Canada maintains a database referred to as the "Environmental Registry" that details prosecutions under the Canadian Environmental Protection Act (CEPA) and the Fisheries Act (FA). Information is provided on the company name, location, charge date, offence and penalty.

Government Publication Date: 1988-Jun 2007*

Contaminated Sites on Federal Land:

Federal

FCS

The Federal Contaminated Sites Inventory includes information on known federal contaminated sites under the custodianship of departments, agencies and consolidated Crown corporations as well as those that are being or have been investigated to determine whether they have contamination arising from past use that could pose a risk to human health or the environment. The inventory also includes non-federal contaminated sites for which the Government of Canada has accepted some or all financial responsibility. It does not include sites where contamination has been caused by, and which are under the control of, enterprise Crown corporations, private individuals, firms or other levels of government. Includes fire training sites and sites at which Per- and Polyfluoroalkyl Substances (PFAS) are a concern.

Government Publication Date: Jun 2000-Sep 2024

Fisheries & Oceans Fuel Tanks:

Federal

FOFT

Fisheries & Oceans Canada maintains an inventory of aboveground & underground fuel storage tanks located on Fisheries & Oceans property or controlled by DFO. Our inventory provides information on the site name, location, tank owner, tank operator, facility type, storage tank location, tank contents & capacity, and date of tank installation.

Government Publication Date: 1964-Sep 2019

Federal Identification Registry for Storage Tank Systems (FIRSTS):

Federal

FRST

A list of federally regulated Storage tanks from the Federal Identification Registry for Storage Tank Systems (FIRSTS). FIRSTS is Environment and Climate Change Canada's database of storage tank systems subject to the Storage Tank for Petroleum Products and Allied Petroleum Products Regulations. The main objective of the Regulations is to prevent soil and groundwater contamination from storage tank systems located on federal and aboriginal lands. Storage tank systems that do not have a valid identification number displayed in a readily visible location on or near the storage tank system may be refused product delivery.

Government Publication Date: Oct 31, 2021

Fuel Storage Tank:

Provincial

FST

List of registered private and retail fuel storage tanks. This is not a comprehensive or complete inventory of private and retail fuel storage tanks in the province; this listing is a copy of registered private and retail fuel storage tanks, obtained under Access to Public Information.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023

Fuel Storage Tank - Historic:

Provincial

FSTH

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks. Public records of private fuel storage tanks are only available since the registration became effective in September 1989. This information is now collected by the Technical Standards and Safety Authority.

Government Publication Date: Pre-Jan 2010*

Ontario Regulation 347 Waste Generators Summary:

Provincial

GEN

Regulation 347 of the Ontario EPA defines a waste generation site as any site, equipment and/or operation involved in the production, collection, handling and/or storage of regulated wastes. A generator of regulated waste is required to register the waste generation site and each waste produced, collected, handled, or stored at the site. This database contains the registration number, company name and address of registered generators including the types of hazardous wastes generated. It includes data on waste generating facilities such as: drycleaners, waste treatment and disposal facilities, machine shops, electric power distribution etc. This information is a summary of all years from 1986 including the most currently available data. Some records may contain, within the company name, the phrase "See & Use..." followed by a series of letters and numbers. This occurs when one company is amalgamated with or taken over by another registered company. The number listed as "See & Use", refers to the new ownership and the other identification number refers to the original ownership. This phrase serves as a link between the 2 companies until operations have been fully transferred.

Government Publication Date: 1986-Nov 30, 2022

Greenhouse Gas Emissions from Large Facilities:

Federal

GHG

List of greenhouse gas emissions from large facilities made available by Environment Canada. Greenhouse gas emissions in kilotonnes of carbon dioxide equivalents (kt CO2 eq).

Government Publication Date: 2013-Dec 2022

TSSA Historic Incidents:

Provincial

HINC

List of historic incidences of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen recorded by the TSSA in their previous incident tracking system. The TSSA's Fuels Safety Program administers the Technical Standards & Safety Act 2000, providing fuel-related safety services associated with the safe transportation, storage, handling and use of fuels such as gasoline, diesel, propane, natural gas and hydrogen. Under this Act, the TSSA regulates fuel suppliers, storage facilities, transport trucks, pipelines, contractors and equipment or appliances that use fuels. Records are not verified for accuracy or completeness. This is not a comprehensive or complete inventory of historical fuel spills and leaks in the province. This listing is a copy of the data captured at one moment in time and is hence limited by the record date provided here.

Government Publication Date: 2006-June 2009*

Indian & Northern Affairs Fuel Tanks:

Federal

IAFT

The Department of Indian & Northern Affairs Canada (INAC) maintains an inventory of aboveground & underground fuel storage tanks located on both federal and crown land. Our inventory provides information on the reserve name, location, facility type, site/facility name, tank type, material & ID number, tank contents & capacity, and date of tank installation.

Government Publication Date: 1950-Aug 2003*

Fuel Oil Spills and Leaks:

Provincial

INC

Listing of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen reported to the Spills Action Centre (SAC). This is not a comprehensive or complete inventory of fuel-related leaks, spills, and incidents in the province; this listing is a copy of incidents reported to the SAC, obtained under Access to Public Information. Includes incidents from fuel-related hazards such as spills, fires, and explosions. Records are not verified for accuracy or completeness.

Government Publication Date: 31 Oct, 2023

Landfill Inventory Management Ontario:

Provincial

LIMO

The Landfill Inventory Management Ontario (LIMO) database is updated every year, as the Ministry of the Environment, Conservation and Parks compiles new and updated information. Includes small and large landfills currently operating as well as those which are closed and historic. Operators of larger landfills provide landfill information for the previous operating year to the ministry for LIMO including: estimated amount of total waste received, landfill capacity, estimated total remaining landfill capacity, fill rates, engineering designs, reporting and monitoring details, size of location, service area, approved waste types, leachate of site treatment, contaminant attenuation zone and more. The small landfills include information such as site owner, site location and certificate of approval # and status.

Government Publication Date: Mar 31, 2022

Canadian Mine Locations:

Private

MINE

This information is collected from the Canadian & American Mines Handbook. The Mines database is a national database that provides over 290 listings on mines (listed as public companies) dealing primarily with precious metals and hard rocks. Listed are mines that are currently in operation, closed, suspended, or are still being developed (advanced projects). Their locations are provided as geographic coordinates (x, y and/or longitude, latitude). As of 2002, data pertaining to Canadian smelters and refineries has been appended to this database.

Government Publication Date: 1998-2009*

Mineral Occurrences:

Provincial

MNR

In the early 70's, the Ministry of Northern Development and Mines created an inventory of approximately 19,000 mineral occurrences in Ontario, in regard to metallic and industrial minerals, as well as some information on building stones and aggregate deposits. Please note that the "Horizontal Positional Accuracy" is approximately +/- 200 m. Many reference elements for each record were derived from field sketches using pace or chain/tape measurements against claim posts or topographic features in the area. The primary limiting factor for the level of positional accuracy is the scale of the source material. The testing of horizontal accuracy of the source materials was accomplished by comparing the plan metric (X and Y) coordinates of that point with the coordinates of the same point as defined from a source of higher accuracy.

Government Publication Date: 1846-Feb 2024

National Analysis of Trends in Emergencies System (NATES):

Federal

NATE

In 1974 Environment Canada established the National Analysis of Trends in Emergencies System (NATES) database, for the voluntary reporting of significant spill incidents. The data was to be used to assist in directing the work of the emergencies program. NATES ran from 1974 to 1994. Extensive information is available within this database including company names, place where the spill occurred, date of spill, cause, reason and source of spill, damage incurred, and amount, concentration, and volume of materials released.

Government Publication Date: 1974-1994*

Non-Compliance Reports:

Provincial

NCPL

The Ministry of the Environment provides information about non-compliant discharges of contaminants to air and water that exceed legal allowable limits, from regulated industrial and municipal facilities. A reported non-compliance failure may be in regard to a Control Order, Certificate of Approval, Sectoral Regulation or specific regulation/act.

Government Publication Date: Dec 31, 2022

National Defense & Canadian Forces Fuel Tanks:

Federal

NDFT

The Department of National Defense and the Canadian Forces maintains an inventory of all aboveground & underground fuel storage tanks located on DND lands. Our inventory provides information on the base name, location, tank type & capacity, tank contents, tank class, date of tank installation, date tank last used, and status of tank as of May 2001. This database will no longer be updated due to the new National Security protocols which have prohibited any release of this database.

Government Publication Date: Up to May 2001*

National Defense & Canadian Forces Spills:

Federal

NDSP

The Department of National Defense and the Canadian Forces maintains an inventory of spills to land and water. All spill sites have been classified under the "Transportation of Dangerous Goods Act - 1992". Our inventory provides information on the facility name, location, spill ID #, spill date, type of spill, as well as the quantity of substance spilled & recovered.

Government Publication Date: Mar 1999-Nov 2023

National Defence & Canadian Forces Waste Disposal Sites:

Federal

NDWD

The Department of National Defence and the Canadian Forces maintains an inventory of waste disposal sites located on DND lands. Where available, our inventory provides information on the base name, location, type of waste received, area of site, depth of site, year site opened/closed and status.

Government Publication Date: 2001-Apr 2007*

National Energy Board Pipeline Incidents:

Federal

NEBI

Locations of pipeline incidents from 2008 to present, made available by the Canada Energy Regulator (CER) - previously the National Energy Board (NEB). Includes incidents reported under the Onshore Pipeline Regulations and the Processing Plant Regulations related to pipelines under federal jurisdiction, does not include incident data related to pipelines under provincial or territorial jurisdiction.

Government Publication Date: 2008-Jun 30, 2021

National Energy Board Wells:

Federal

NEBP

The NEBW database contains information on onshore & offshore oil and gas wells that are outside provincial jurisdiction(s) and are thereby regulated by the National Energy Board. Data is provided regarding the operator, well name, well ID No./UWI, status, classification, well depth, spud and release date.

Government Publication Date: 1920-Feb 2003*

National Environmental Emergencies System (NEES):

Federal

[NEES](#)

In 2000, the Emergencies program implemented NEES, a reporting system for spills of hazardous substances. For the most part, this system only captured data from the Atlantic Provinces, some from Quebec and Ontario and a portion from British Columbia. Data for Alberta, Saskatchewan, Manitoba and the Territories was not captured. However, NEES is also a repository for previous Environment Canada spill datasets. NEES is composed of the historic datasets ' or Trends ' which dates from approximately 1974 to present. NEES Trends is a compilation of historic databases, which were merged and includes data from NATES (National Analysis of Trends in Emergencies System), ARTS (Atlantic Regional Trends System), and NEES. In 2001, the Emergencies Program determined that variations in reporting regimes and requirements between federal and provincial agencies made national spill reporting and trend analysis difficult to achieve. As a consequence, the department has focused efforts on capturing data on spills of substances which fall under its legislative authority only (CEPA and FA). As such, the NEES database will be decommissioned in December 2004.

Government Publication Date: 1974-2003***National PCB Inventory:**

Federal

[NPCB](#)

Environment Canada's National PCB inventory includes information on in-use PCB containing equipment in Canada including federal, provincial and private facilities. Federal out-of-service PCB containing equipment and PCB waste owned by the federal government or by federally regulated industries such as airlines, railway companies, broadcasting companies, telephone and telecommunications companies, pipeline companies, etc. are also listed. Although it is not Environment Canada's mandate to collect data on non-federal PCB waste, the National PCB inventory includes some information on provincial and private PCB waste and storage sites. Some addresses provided may be Head Office addresses and are not necessarily the location of where the waste is being used or stored.

Government Publication Date: 1988-2008***National Pollutant Release Inventory:**

Federal

[NPR2](#)

The National Pollutant Release Inventory (NPRI) is Canada's public inventory of pollutant releases (to air, water and land), disposals, and transfers for recycling. The inventory, managed by Environment and Climate Change Canada, tracks over 300 substances. Under the authority of the Canadian Environmental Protection Act (CEPA), owners or operators of facilities that meet published reporting requirements are required to report to the NPRI.

Government Publication Date: Feb 2024**National Pollutant Release Inventory - Historic:**

Federal

[NPRI](#)

Environment Canada has defined the National Pollutant Release Inventory ("NPRI") as a federal government initiative designed to collect comprehensive national data regarding releases to air, water, or land, and waste transfers for recycling for more than 300 listed substances. This data holds historic records; current records are found in NPR2.

Government Publication Date: 1993-May 2017**Oil and Gas Wells:**

Private

[OGWE](#)

The Nickle's Energy Group (publisher of the Daily Oil Bulletin) collects information on drilling activity including operator and well statistics. The well information database includes name, location, class, status and depth. The main Nickle's database is updated on a daily basis, however, this database is updated on a monthly basis. More information is available at www.nickles.com.

Government Publication Date: 1988-May 31, 2024**Ontario Oil and Gas Wells:**

Provincial

[OOGW](#)

In 1998, the Ministry of Natural Resources (MNR) handed over to the Ontario Oil, Gas and Salt Resources (OGSR) Corporation, the responsibility of maintaining a database of oil and gas wells drilled in Ontario. The OGSR Library has over 20,000+ wells in their database. Information available for all wells in the ERIS database includes well owner/operator, location, permit issue date, and well cap date, license number, status, depth and the primary target (rock unit) of the well being drilled. All geology/stratigraphy table information, plus all water table information is also provided for each well record.

Government Publication Date: 1800-Aug 2024**Inventory of PCB Storage Sites:**

Provincial

[OPCB](#)

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of PCB storage sites within the province. Ontario Regulation 11/82 (Waste Management - PCB) and Regulation 347 (Generator Waste Management) under the Ontario EPA requires the registration of inactive PCB storage equipment and/or disposal sites of PCB waste with the Ontario Ministry of Environment. This database contains information on: 1) waste quantities; 2) major and minor sites storing liquid or solid waste; and 3) a waste storage inventory.

Government Publication Date: 1987-Oct 2004; 2012-Dec 2013**Orders:**

Provincial

[ORD](#)

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include Orders on the registry such as (EPA s. 17) - Order for remedial work, (EPA s. 18) - Order for preventative measures, (EPA s. 43) - Order for removal of waste and restoration of site, (EPA s. 44) - Order for conformity with Act for waste disposal sites, (EPA s. 136) - Order for performance of environmental measures.

Government Publication Date: 1994 - Nov 30, 2024

Canadian Pulp and Paper:

Private

PAP

This information is part of the Pulp and Paper Canada Directory. The Directory provides a comprehensive listing of the locations of pulp and paper mills and the products that they produce.

Government Publication Date: 1999, 2002, 2004, 2005, 2009-2014

Parks Canada Fuel Storage Tanks:

Federal

PCFT

Canadian Heritage maintains an inventory of known fuel storage tanks operated by Parks Canada, in both National Parks and at National Historic Sites. The database details information on site name, location, tank install/removal date, capacity, fuel type, facility type, tank design and owner/operator.

Government Publication Date: 1920-Jan 2005*

Pesticide Register:

Provincial

PES

The Ontario Ministry of the Environment and Climate Change maintains a database of licensed operators and vendors of registered pesticides.

Government Publication Date: Oct 2011-Oct 31, 2024

Ontario PFAS Spills:

Provincial

PFAS

This specific list of spills includes those incidents where one or more of the listed contaminants are identified in the PFAS Structure List and/or PFAS Chemicals Without Explicit Structure List made available by the United States Environmental Protection Agency (US EPA), is originally sourced from the Ministry of the Environment, Conservation and Parks spills related data. Information from 1988-2002 was part of the ORIS (Occurrence Reporting Information System). The SAC (Spills Action Centre) handles all spills reported in Ontario. Regulations for spills in Ontario are part of the MOE's Environmental Protection Act, Part X.

Government Publication Date: 1988-Mar 2024; May 2024

NPRI Reporters - PFAS Substances:

Federal

PFCH

The National Pollutant Release Inventory (NPRI) is Canada's public inventory of releases, disposals, and transfers, tracking over 320 pollutants. Per - and polyfluoroalkyl substances (PFAS) are a group of over 4,700 human-made substances for which adverse environmental and health effects have been observed. This listing of PFAS substance reporters includes those NPRI facilities that reported substances that are found in either: a) the Comprehensive Global Database of PFASs compiled by the Organisation for Economic Co-operation and Development (OECD), b) the US Environmental Protection Agency (US EPA) Master List of PFAS Substances, c) the US EPA list of PFAS chemicals without explicit structures, or d) the US EPA list of PFAS structures (encompassing the largest set of structures having sufficient levels of fluorination to potentially impart PFAS-type properties).

Government Publication Date: Feb 2024

Potential PFAS Handlers from NPRI:

Federal

PFHA

The National Pollutant Release Inventory (NPRI) is Canada's public inventory of releases, disposals, and transfers, tracking over 320 pollutants. Per - and polyfluoroalkyl substances (PFAS) are a group of over 4,700 human-made substances for which adverse environmental and health effects have been observed. This list of potential PFAS handlers includes those NPRI facilities that reported business activity (NAICS code) included in the US Environmental Protection Agency (US EPA) list of Potential PFAS-Handling Industry Sectors, further described as operating in industry sectors where literature reviews indicate that PFAS may be handled and/or released. Inclusion of a facility in this listing does not indicate that PFAS are being manufactured, processed, used, or released by the facility - these are facilities that potentially handle PFAS based on their industrial profile.

Government Publication Date: Feb 2024

Pipeline Incidents:

Provincial

PINC

List of pipeline incidents (strikes, leaks, spills). This is not a comprehensive or complete inventory of pipeline incidents in the province; this listing is an historical copy of records previously obtained under Access to Public Information. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2021

Potential PFAS Handlers from EASR:

Provincial

PPHA

The Ontario Environmental Activity and Sector Registry (EASR), described in Ontario Regulation 245/11, allows businesses with less complex operations - and hence not requiring an Environmental Compliance Approval - to register their activities with the Ontario Ministry of the Environment, Conservation and Parks (MECP). This list of potential PFAS handlers includes those EASR facilities that reported business activity (NAICS code) included in the US Environmental Protection Agency (US EPA) list of Potential PFAS-Handling Industry Sectors, further described as operating in industry sectors where literature reviews indicate that PFAS may be handled and/or released. Inclusion of a facility in this listing does not indicate that PFAS are being manufactured, processed, used.

Government Publication Date: Jun 30, 2024

Private and Retail Fuel Storage Tanks:

Provincial

PRT

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks and licensed retail fuel outlets. This database includes an inventory of locations that have gasoline, oil, waste oil, natural gas and/or propane storage tanks on their property. The MCCR no longer collects this information. This information is now collected by the Technical Standards and Safety Authority (TSSA).

Government Publication Date: 1989-1996*

Permit to Take Water:

Provincial

PTTW

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include PTTW's on the registry such as OWRA s. 34 - Permit to take water.

Government Publication Date: 1994 - Nov 30, 2024

Ontario Regulation 347 Waste Receivers Summary:

Provincial

REC

Part V of the Ontario Environmental Protection Act ("EPA") regulates the disposal of regulated waste through an operating waste management system or a waste disposal site operated or used pursuant to the terms and conditions of a Certificate of Approval or a Provisional Certificate of Approval. Regulation 347 of the Ontario EPA defines a waste receiving site as any site or facility to which waste is transferred by a waste carrier. A receiver of regulated waste is required to register the waste receiving facility. This database represents registered receivers of regulated wastes, identified by registration number, company name and address, and includes receivers of waste such as: landfills, incinerators, transfer stations, PCB storage sites, sludge farms and water pollution control plants. This information is a summary of all years from 1986 including the most currently available data.

Government Publication Date: 1986-1990, 1992-2021

Record of Site Condition:

Provincial

RSC

The Record of Site Condition (RSC) is part of the Ministry of the Environment's Brownfields Environmental Site Registry. Protection from environmental cleanup orders for property owners is contingent upon documentation known as a record of site condition (RSC) being filed in the Environmental Site Registry. In order to file an RSC, the property must have been properly assessed and shown to meet the soil, sediment and groundwater standards appropriate for the use (such as residential) proposed to take place on the property. The Record of Site Condition Regulation (O. Reg. 153/04) details requirements related to site assessment and clean up. RSCs filed after July 1, 2011 will also be included as part of the new (O.Reg. 511/09). The Government of Ontario states that it is not responsible for the accuracy of the information in this Registry.

Government Publication Date: 1997-Sept 2001, Oct 2004-Nov 2024

Retail Fuel Storage Tanks:

Private

RST

This database includes an inventory of retail fuel outlet locations (including marinas) that have on their property gasoline, oil, waste oil, natural gas and / or propane storage tanks.

Government Publication Date: 1999-Apr 30, 2024

Scott's Manufacturing Directory:

Private

SCT

Scott's Directories is a data bank containing information on over 200,000 manufacturers across Canada. Even though Scott's listings are voluntary, it is the most comprehensive database of Canadian manufacturers available. Information concerning a company's address, plant size, and main products are included in this database.

Government Publication Date: 1992-Mar 2011*

Ontario Spills:

Provincial

SPL

List of spills and incidents made available by the Ministry of the Environment, Conservation and Parks. This database identifies information such as location (approximate), type and quantity of contaminant, date of spill, environmental impact, cause, nature of impact, etc. Information from 1988-2002 was part of the ORIS (Occurrence Reporting Information System). The SAC (Spills Action Centre) handles all spills reported in Ontario. Regulations for spills in Ontario are part of the MOE's Environmental Protection Act, Part X.

Government Publication Date: 1988-Jun 2024; Aug 2024; Oct 2024

Wastewater Discharger Registration Database:

Provincial

SRDS

Facilities that report either municipal treated wastewater effluent or industrial wastewater discharges under the Effluent Monitoring and Effluent Limits (EMEL) and Municipal/Industrial Strategy for Abatement Regulations. The Municipal/Industrial Strategy for Abatement (MISA) division of the Ontario Ministry of Environment keeps record of direct dischargers of toxic pollutants within nine sectors including: Electric Power Generation, Mining, Petroleum Refining, Organic Chemicals, Inorganic Chemicals, Pulp & Paper, Metal Casting, Iron & Steel, and Quarries.

Government Publication Date: 1990-Dec 31, 2021

Anderson's Storage Tanks:

Private

TANK

The information provided in this database was collected by examining various historical documents, which identified the location of former storage tanks, containing substances such as fuel, water, gas, oil, and other various types of miscellaneous products. Information is available in regard to business operating at tank site, tank location, permit year, permit & installation type, no. of tanks installed & configuration and tank capacity. Data contained within this database pertains only to the city of Toronto and is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1915-1953*

Transport Canada Fuel Storage Tanks:

Federal

TCFT

List of fuel storage tanks currently or previously owned or operated by Transport Canada. This inventory also includes tanks on The Pickering Lands, which refers to 7,530 hectares (18,600 acres) of land in Pickering, Markham, and Uxbridge owned by the Government of Canada since 1972; properties on this land has been leased by the government since 1975, and falls under the Site Management Policy of Transport Canada, but is administered by Public Works and Government Services Canada. This inventory provides information on the site name, location, tank age, capacity and fuel type.

Government Publication Date: 1970 - Apr 2024

Variances for Abandonment of Underground Storage Tanks:

Provincial

VAR

Listing of variances granted for storage tank abandonment. This is not a comprehensive or complete inventory of tank abandonment variances in the province; this listing is a copy of tank abandonment variance records previously obtained under Access to Public Information. In Ontario, registered underground storage tanks must be removed within two years of disuse; if removal of a tank is not feasible, an application may be sought for a variance from this code requirement.

Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Waste Disposal Sites - MOE CA Inventory:

Provincial

WDS

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of known open (active or inactive) and closed disposal sites in the Province of Ontario. Active sites maintain a Certificate of Approval, are approved to receive and are receiving waste. Inactive sites maintain Certificate(s) of Approval but are not receiving waste. Closed sites are not receiving waste. The data contained within this database was compiled from the MOE's Certificate of Approval database. Locations of these sites may be cross-referenced to the Anderson database described under ERI's Private Source Database section, by the CA number. All new Environmental Compliance Approvals handed out after Oct 31, 2011 for Waste Disposal Sites will still be found in this database.

Government Publication Date: Oct 2011 - Oct 31, 2024

Waste Disposal Sites - MOE 1991 Historical Approval Inventory:

Provincial

WDSH

In June 1991, the Ontario Ministry of Environment, Waste Management Branch, published the "June 1991 Waste Disposal Site Inventory", of all known active and closed waste disposal sites as of October 30st, 1990. For each "active" site as of October 31st 1990, information is provided on site location, site/CA number, waste type, site status and site classification. For each "closed" site as of October 31st 1990, information is provided on site location, site/CA number, closure date and site classification. Locations of these sites may be cross-referenced to the Anderson database described under ERI's Private Source Database section, by the CA number.

Government Publication Date: Up to Oct 1990*

Water Well Information System:

Provincial

WWIS

This database describes locations and characteristics of water wells found within Ontario in accordance with Regulation 903. It includes such information as coordinates, construction date, well depth, primary and secondary use, pump rate, static water level, well status, etc. Also included are detailed stratigraphy information, approximate depth to bedrock and the approximate depth to the water table.

Government Publication Date: Dec 31 2023

Definitions

Database Descriptions: This section provides a detailed explanation for each database including: source, information available, time coverage, and acronyms used. They are listed in alphabetic order.

Detail Report: This is the section of the report which provides the most detail for each individual record. Records are summarized by location, starting with the project property followed by records in closest proximity.

Distance: The distance value is the distance between plotted points, not necessarily the distance between the sites' boundaries. All values are an approximation.

Direction: The direction value is the compass direction of the site in respect to the project property and/or center point of the report.

Elevation: The elevation value is taken from the location at which the records for the site address have been plotted. All values are an approximation. Source: Google Elevation API.

Executive Summary: This portion of the report is divided into 3 sections:

'Report Summary'- Displays a chart indicating how many records fall on the project property and, within the report search radii.

'Site Report Summary'-Project Property'- This section lists all the records which fall on the project property. For more details, see the 'Detail Report' section.

'Site Report Summary-Surrounding Properties'- This section summarizes all records on adjacent properties, listing them in order of proximity from the project property. For more details, see the 'Detail Report' section.

Map Key: The map key number is assigned according to closest proximity from the project property. Map Key numbers always start at #1. The project property will always have a map key of '1' if records are available. If there is a number in brackets beside the main number, this will indicate the number of records on that specific property. If there is no number in brackets, there is only one record for that property.

The symbol and colour used indicates 'elevation': the red inverted triangle will dictate 'ERIS Sites with Lower Elevation', the yellow triangle will dictate 'ERIS Sites with Higher Elevation' and the orange square will dictate 'ERIS Sites with Same Elevation.'

Unplottables: These are records that could not be mapped due to various reasons, including limited geographic information. These records may or may not be in your study area, and are included as reference.

APPENDIX 3

QUALIFICATIONS OF ASSESSORS



PATERSON GROUP

solution oriented engineering



Kuldeep Panchal Junior Environmental Scientist

Kuldeep Panchal is a Junior Environmental Scientist with Paterson Group in Ottawa, Ontario. Kuldeep received his Bachelor of Civil Engineering in 2017, Charotar University of Sciences & Technology. In 2019 He earned his Master's in Environmental Engineering, from the University of Ottawa. In his time at Paterson with Environmental Division, Kuldeep has been involved in primarily residential and commercial development projects predominantly within the National Capital Region, where he conducted Phase I Environmental Site Assessments (ESAs) to MECP and CSA standards and conducted environmental and geotechnical subsurface investigations. His current scope of work consists of environmental investigation, reporting, field inspections, soil and groundwater sampling, supervising the remediation of contaminated sites, and ensuring compliance with applicable regulatory standards.

EDUCATION

Master's Environmental Engineering, 2019
University of Ottawa, Ottawa, ON

Bachelor of Civil Engineering, 2017
Charotar University of Sciences & Technology,
Gujarat, India

LICENCE/PROFFESIONAL AFFILIATIONS

E.I.T. (Engineer in Training) with PEO
CCIL (Canadian Council of Independent Laboratories)
– Type QF
TDG (Transportation of Dangerous Goods) – Type A
Packages

YEARS OF EXPERIENCE

With Paterson: 3

Other Firms: 1.5

OFFICE LOCATION

9 Auriga Drive
Ottawa, Ontario, K2E 7T9

SELECT LIST OF PROJECTS

- CSA Phase I Environmental Site Assessments (ESAs) – Various Sites, Ottawa, ON
- Mattamy Homes – Fairwinds Phase 8 – Environmental subsurface investigation – Ottawa, ON
- Soil and Groundwater sampling – Various Sites, Ottawa, ON
- CECCE – 205 Scholastic – Micro Piling – Ottawa, ON
- Minto – Quinn's Pointe – Stage 4 – Site Servicing and Soil Inspections – Ottawa, ON
- W.H. MacSweyn – Prepared Compaction Plan and Road Works – Ottawa, ON
- Minto – Brookline – Site Servicing – Ottawa, ON
- Various High Rise and Commercial Projects – Material Testing – Ottawa, ON
- Proposal Preparation for Material Testing – Various Projects

PROFESSIONAL EXPERIENCE

March 2024 to present – **Junior Environmental Scientist, Environmental Division, Paterson Group, Ottawa, Ontario**

- Conduct Phase I – Environmental Site Assessments (ESAs) to CSA and O.Reg. 153/04 Standards.
- Responsible for the application of environmental, hydrological, and/or geotechnical principles and practices in the identification and delineation of soil and groundwater contamination plumes while ensuring compliance with federal, provincial, and/or municipal legal and regulatory requirements.
- Presenting analytical test results, interpretations, assessments, recommendations and/or conclusions in a final technical report.
- Field experience in the supervision of drilling and excavation contractors, inspection of aboveground and underground fuel storage tanks, soil and rock classification, and soil and groundwater field sampling.
- Coordination of contractors while directly reporting to intermediate and senior management to ensure completion of project on schedule and within budget.

July 2023 to February 2024 – **Project Coordinator, Materials Testing, Paterson Group, Ottawa, Ontario**

- Prepares technical reports for existing clients, such as geotechnical summaries, and foundation assessments.
- Compiles proposals for various private and government-based tenders.
- Aids with project-related procurements.
- Prepares and reviews training and Standard Operating Procedures (SOP's) documents for the Materials Testing Department.
- Works closely with Director or Project Managers within the Materials Testing Department to ensure reports are completed on time.
- Actively takes part in extra training and the training of field staff.
- Assists the Director or Project Manager and field staff with various site inspections.

May 2021 to July 2023 – **Field Technologist, Materials Testing – Paterson Group, Ottawa, ON**

- Geotechnical investigations include test pitting programs for various types of subsurface soils investigations.
- Prepares geotechnical investigation reports and slope stability analysis with accompanying recommendations.
- Field inspections and material testing include but not limited to compaction, proof rolling, concrete testing, mortar/grout testing, subgrade reviews, bearing medium evaluations, bearing surface inspections, rebar inspections, both footings and walls, and asphalt sampling.
- Specialty testing such as, cover meter inspections, Piling and Micro Piling, excavation reviews, thermocouple installation and readings, Schmidt hammer testing, granular sampling, light weight fill, and crack monitoring.

June 2017 to June 2018 – **Site Engineer, Sheth Enterprise – Surat, Gujarat, India**

- Used theoretical knowledge of construction work in practical scenarios.
- Was responsible for handling multiple residential construction sites in Surat area.
- Performed duties such as site inspections, supervision of workers and the coordination between contractors and design engineers.
- Trained civil engineering graduates during their internships on the construction sites.

February 2017 to April 2017 – **Environmental Laboratory Trainee – Detox Corporation Pvt. Ltd. – Surat, Gujarat, India**

- Performed analysis of environmental samples which were collected on a regular basis adhering to the safety regulations.
- Understood the design plans of water and wastewater treatment plants.
- Implemented various regulations and limits of parameters in water and wastewater discharge.
- Performed analysis of samples using apparatus such as a Bomb Calorimeter and a Spectrophotometer.
- Conducted a variety of tests on water and wastewater using methods such as Biochemical Oxygen Demand (BOD) and Chemical Oxygen Demand (COD) tests.
- Learned how to formulate environmental impact assessment reports.
- Authored professional reports listing the characteristics of tested waste and hazardous waste.
- Gathered and prepared reports on Quality Assurance (QA) of environmental waste.



PATERSON GROUP

solution oriented engineering



Michael Beaudoin, P.Eng., QP_{ESA} **Senior Project Manager**

Michael received his Bachelor of Engineering from Carleton University in 2010 in Environmental Engineering. Michael joined the Paterson Group in the Environmental Division. Michael has worked for Paterson for approximately 14 years and has accrued extensive field and office experience. Michael's experience working in the field ranges from Phase I site reviews, Phase II investigations, remediation site inspections and designated substance surveys. Through his years of field experience, Michael has obtained invaluable knowledge on contractor relationships, budgets, time management, consultant/owner relation, quality data and information, and working with a variety of different personnel and situations. Michael has moved into a more senior role by becoming a qualified person for environmental assessments, overseeing small to large scale environmental projects, which include, Phase I and II reports, Record of Site Conditions and Brownfield Applications. Michael has assisted with Mark D'Arcy in the development of young staff and continuous improvement of Paterson internal systems.

EDUCATION

B.Eng. 2010, Environmental Engineering
Carleton University
Ottawa, ON

LICENCE/ PROFESSIONAL AFFILIATIONS

Professional Engineers of Ontario

YEARS OF EXPERIENCE

With Paterson: 14

OFFICE LOCATION

9 Auriga Drive, Ottawa, Ontario, K2E 7T9

SELECT LIST OF PROJECTS

- Rideau Street Reconstruction, Ottawa, ON Phase I ESA, Phase II ESA, (Field Manager)
- Main Street Reconstruction, Ottawa, ON Phase I ESA, Phase II ESA, (Field Manager)
- Woodroffe Avenue Reconstruction, Ottawa, ON Phase I ESA, Phase II ESA, (Field Manager)
- Westboro Connection Development, Ottawa ON, Phase II ESA, Remediation Supervision (Field Manager)
- Riverview Development – Kingston, ON, Phase I ESA, Phase II ESA, and filing of multiple RSCs in the MECP Environmental Site Registry (Project Manager)
- West Village Development – Kingston, ON, Phase I ESA, Phase II ESA, and filing of multiple RSCs in the MECP Environmental Site Registry (Project Manager)
- Moon Development – 245 Rideau Street, Ottawa, ON, Phase I ESA, Phase II ESA, and RSC Filing (Project Manager)
- ESAP Project, Ottawa, ON
- Record of Site Condition Filings – Residential and Commercial Development Properties, Various Sites, Ottawa, Kingston ON.
- Designated Substance Surveys, Ottawa, ON
- Phase I and Phase II Investigations in accordance with CSA standards and O.Reg 153/04

PROFESSIONAL EXPERIENCE

November 2010 to present, **Environmental Engineer, Paterson Group, Ottawa, Ontario**

- Provide on-site environmental expertise for various soil and groundwater remediation projects including but not limited to the following: Riverview Development, West Village, Westboro Connection, ESAP Project, and 405 Terminal Avenue.
- Oversee Phase I and Phase II Investigations in accordance with CSA standards and O.Reg 153/04 on a variety of residential and commercial developments.
- Responsible for filing Records of Site Condition with the MECP Environmental Site Registry.
- Completing Designated Substance Surveys (including Air Quality Testing)
- Problem solving to help advance or maintain project schedules.
- Complete environmental reports with recommendations for environmental concerns.
- Liaising with contractors, consultants and government officials.
- Provide cost estimates for environment field programs and construction costs.
- Review RFI's, submittals, monthly progress reports and other various construction related work.