

# **Geotechnical Investigation**

## **Proposed Development**

1867 Alta Vista Drive  
Ottawa, Ontario

Prepared for TC United

Report PG7401-1 Revision 2 dated December 12, 2025

## Table of Contents

|                                                       | PAGE      |
|-------------------------------------------------------|-----------|
| <b>1.0 Introduction .....</b>                         | <b>1</b>  |
| <b>2.0 Proposed Development .....</b>                 | <b>1</b>  |
| <b>3.0 Method of Investigation .....</b>              | <b>2</b>  |
| 3.1 Field Investigation .....                         | 2         |
| 3.2 Field Survey .....                                | 3         |
| 3.3 Laboratory Testing .....                          | 3         |
| 3.4 Analytical Testing .....                          | 4         |
| <b>4.0 Observations .....</b>                         | <b>5</b>  |
| 4.1 Surface Conditions .....                          | 5         |
| 4.2 Subsurface Profile .....                          | 5         |
| 4.3 Groundwater .....                                 | 6         |
| <b>5.0 Discussion .....</b>                           | <b>7</b>  |
| 5.1 Geotechnical Assessment .....                     | 7         |
| 5.2 Site Grading and Preparation .....                | 7         |
| 5.3 Foundation Design .....                           | 9         |
| 5.4 Design for Earthquakes .....                      | 10        |
| 5.5 Basement Floor Slab .....                         | 10        |
| 5.6 Basement Wall .....                               | 10        |
| 5.7 Rock Anchor Design .....                          | 12        |
| 5.8 Pavement Design .....                             | 14        |
| <b>6.0 Design and Construction Precautions .....</b>  | <b>18</b> |
| 6.1 Foundation Drainage and Backfill .....            | 18        |
| 6.2 Protection of Footings Against Frost Action ..... | 19        |
| 6.3 Excavation Side Slopes .....                      | 20        |
| 6.4 Pipe Bedding and Backfill .....                   | 22        |
| 6.5 Groundwater Control .....                         | 23        |
| 6.6 Winter Construction .....                         | 23        |
| 6.7 Corrosion Potential and Sulphate .....            | 24        |
| 6.8 Slope Stability Assessment .....                  | 24        |
| <b>7.0 Recommendations .....</b>                      | <b>27</b> |
| <b>8.0 Statement of Limitations .....</b>             | <b>28</b> |

---

## **Appendices**

### **Appendix 1**

Soil Profile and Test Data Sheets  
Symbols and Terms  
Borehole Logs by Others  
Concrete Core Compressive Strength Results  
Analytical Testing Results

### **Appendix 2**

Figure 1 – Key Plan  
Figures 2 & 3 - Slope Stability Analysis Cross-Sections  
Drawing PG7401-1 – Test Hole Location Plan

## **1.0 Introduction**

Paterson Group (Paterson) was commissioned by TC United to conduct a geotechnical investigation for the proposed development to be located at 1867 Alta Vista Drive in the City of Ottawa, Ontario (refer to Figure 1 – Key Plan in Appendix 2 for the general site location).

The objectives of the geotechnical investigation were to:

- ☐ Determine the subsoil and groundwater conditions at this site by means of test holes.
- ☐ Provide geotechnical recommendations pertaining to design of the proposed development including construction considerations which may affect the design.

This report has been prepared specifically and solely for the aforementioned project which is described herein. It contains our findings and includes geotechnical recommendations pertaining to the design and construction of the subject development, as they are understood at the time of writing this report.

## **2.0 Proposed Development**

Based on the available conceptual plan, it is understood that the proposed development at the subject site will consist of a multi-storey building with 1 to 2 levels of underground parking. At finished grades, the proposed building will be surrounded by asphalt-paved access lanes and landscaped amenity areas.

It is also expected that the proposed building will be municipally serviced.

## **3.0 Method of Investigation**

### **3.1 Field Investigation**

#### **Field Program**

The field program for the geotechnical investigation was conducted on December 20, 2024 and consisted of advancing 3 boreholes to a maximum depth of 7.8 m and 4 test pits down to a maximum depth of 3.1 m. The test hole locations were determined by Paterson personnel and distributed in a manner to provide general coverage of the subject site taking into consideration site features and underground utilities.

Further, a previous investigation at the subject site was conducted by others on September 19 and 20, 2022, and consisted of 8 boreholes advanced to a maximum depth of 6.2 m below the existing ground surface.

The test hole locations are presented on Drawing PG7401-1 – Test Hole Location Plan included in Appendix 2.

The boreholes were advanced using a track-mounted auger drill rig operated by a two-person crew. The drilling procedure consisted of augering and rock coring to the required depths at the selected borehole locations, and sampling and testing the soil and bedrock. The test pits were advanced using a backhoe and backfilled with the excavated soil upon the completion of logging and sampling. All fieldwork was conducted under the full-time supervision of our personnel under the direction of a senior engineer.

#### **Sampling and In Situ Testing**

The soil samples were collected from the boreholes using a 50 mm diameter split-spoon (SS) sampler or from the drill auger flights (AU). Rock cores were obtained using 47.6 mm inside diameter coring equipment. Grab samples (G) were collected at selected intervals from the test pit sidewalls. The samples were initially classified on site, placed in sealed plastic bags or core boxes, and transported to our laboratory.

The depths at which the drill auger, split-spoon, rock core, and grab samples were recovered from the boreholes and test pits are shown as AU, SS, RC and G, respectively, on the Soil Profile and Test Data sheets in Appendix 1.

The subsurface conditions observed in the test holes were recorded in detail in the field. The soil profiles are logged on the Soil Profile and Test Data sheets in Appendix 1 of this report.

## **Groundwater**

Groundwater monitoring well was installed in borehole BH 3-24 to permit long-term groundwater measurement subsequent to the field investigation. Flexible polyethylene standpipes were installed in the remaining boreholes to permit further groundwater measurement.

Typical monitoring well construction details are described below:

- 1.5 m of slotted 51 mm diameter PVC screen at the base of the boreholes.
- 51 mm diameter PVC riser pipe from the top of the screen to the ground surface.
- No. 3 silica sand backfill within annular space around screen.
- 300 mm thick bentonite hole plug directly above PVC slotted screen.
- Clean backfill from top of bentonite plug to the ground surface.

The groundwater observations are discussed in Section 4.3 and are presented in the Soil Profile and Test Data sheets in Appendix 1. Refer to the Soil Profile and Test Data sheets in Appendix 1 for specific well construction details.

## **3.2 Field Survey**

The test hole locations, and ground surface elevation at each test hole location, were surveyed by Paterson using a high precision GPS unit and referenced to a geodetic datum. The locations of the test holes are presented on Drawing PG7401-1 – Test Hole Location Plan in Appendix 2.

## **3.3 Laboratory Testing**

Soil samples were recovered from the subject site and visually examined in our laboratory to review the results of the field logging. Unconfined compressive strength testing was carried out by Paterson on bedrock samples from borehole BH 1-24. The results of the testing are discussed in Section 4.2 and are provided in Appendix 1.

Soil samples and bedrock cores will be stored for a period of 1 month after this report is completed. They will then be discarded, unless we are otherwise directed.

### **3.4 Analytical Testing**

One (1) soil sample was submitted for analytical testing to assess the corrosion potential for exposed ferrous metals and the potential of sulphate attacks against subsurface concrete structures. The sample was submitted to determine the concentration of sulphate and chloride, the resistivity, and the pH of the sample. The results are presented in Appendix 1 and are discussed further in Section 6.7.

## **4.0 Observations**

### **4.1 Surface Conditions**

The subject site is currently vacant, but was historically occupied by a 2-storey building which was demolished around 2017. The north and south portions of the site are mainly covered in asphalt pads used for vehicle parking. The ground surface slopes downward gradually from south to north, from approximate geodetic elevation 74.3 m to 72.3 m.

A creek was observed to be running north-south adjacent to the eastern boundary of the site. The creek corridor was observed to be approximately 1 to 2 m wide, 2 to 3 m deep, and surrounded by dense vegetation and mature trees.

This parcel is generally bordered by commercial buildings to the north and south, Alta Vista Drive to the west, and densely vegetated vacant land to the east.

### **4.2 Subsurface Profile**

#### **Overburden**

Generally, the soil profile at the test holes consists of a layer of fill underlain by glacial till and bedrock. The fill was generally observed to consist of brown silty sand with traces of clay, gravel, brick, and metal fragments, extending to approximate depths ranging between 0.9 to 5 m below the existing ground surface.

The glacial till was encountered immediately underlying the fill, and was observed to consist of very dense, brown silty sand to sandy silt with gravel, cobbles, and boulders.

Refusal to augering was generally encountered at depths of about 4.6 m to 6.2 m below existing ground surface.

Reference should be made to the Soil Profile and Test Data sheets in Appendix 1 for the details of the soil profile encountered at each borehole location.

#### **Bedrock**

Bedrock was cored at boreholes BH 1-24 and BH 2-24, and was observed to consist of shale interbedded with limestone, and based on the recovered bedrock core, was generally poor to fair in quality.

From available geological mapping, the subject site is located in an area where the bedrock consists of interbedded limestone and dolomite of the Carlsbad formation, with an overburden drift thickness of 2 to 3 m.

### Unconfined Compressive Strength Testing of Bedrock Core Samples

The bedrock cores in borehole BH 1-24 were tested for their unconfined compressive strength. The results of the testing are summarized in Table 1 below and are also presented on the Unconfined Compressive Strength Testing Results sheets in Appendix 1.

| <b>Table 1 – Summary of Unconfined Bedrock Compressive Strength Testing Results</b> |               |                            |                                              |
|-------------------------------------------------------------------------------------|---------------|----------------------------|----------------------------------------------|
| <b>Borehole</b>                                                                     | <b>Sample</b> | <b>Test Core Depth (m)</b> | <b>Unconfined Compressive Strength (MPa)</b> |
| BH 1-24                                                                             | RC2           | 7.05 - 7.20                | 27                                           |
| BH 1-24                                                                             | RC2           | 7.20 - 7.35                | 39                                           |

## 4.3 Groundwater

The groundwater level was recorded at borehole BH 3-24 on January 3<sup>rd</sup>, 2025. The measured groundwater level reading is presented in Table 1 below, and is also shown on the Soil Profile and Test Data sheet in Appendix 2.

| <b>Table 2 – Summary of Groundwater Levels</b>                                                                                                                                                                               |                                     |                                   |                      |                                |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------|-----------------------------------|----------------------|--------------------------------|
| <b>Test Hole Number</b>                                                                                                                                                                                                      | <b>Ground Surface Elevation (m)</b> | <b>Measured Groundwater Level</b> |                      | <b>Date Recorded</b>           |
|                                                                                                                                                                                                                              |                                     | <b>Depth (m)</b>                  | <b>Elevation (m)</b> |                                |
| BH 3-24                                                                                                                                                                                                                      | 74.01                               | 1.70                              | 72.31                | January 3 <sup>rd</sup> , 2025 |
| <b>Note:</b><br>-The ground surface elevation at each test hole location was surveyed using a high precision GPS and are referenced to a geodetic datum.<br>- '*' Indicates groundwater monitoring well installed by others. |                                     |                                   |                      |                                |

Based on these observations, the long-term groundwater level is expected to range between approximately 1.5 to 2.5 m below ground surface.

However, it should be noted that groundwater levels are subject to seasonal fluctuations, therefore, the groundwater levels could vary at the time of construction.

## **5.0 Discussion**

### **5.1 Geotechnical Assessment**

From a geotechnical perspective, the subject site is suitable for the proposed development. The proposed building is recommended to be founded on conventional spread footings bearing on the clean, surface sounded bedrock, or on lean concrete which is placed directly over the clean, surface sounded bedrock.

If more than 1 underground parking level is considered for the proposed development, then bedrock removal would likely be required. The above and other considerations are discussed further in the following sections.

### **5.2 Site Grading and Preparation**

#### **Stripping Depth**

Topsoil and deleterious fill, such as those containing organic materials, should be stripped from under the building, paved areas, pipe bedding, and other settlement sensitive structures.

#### **Bedrock Removal**

If bedrock removal is required, it can be accomplished by hoe ramming where the bedrock is weathered and/or where only small quantities of the bedrock need to be removed. Sound bedrock may be removed by line drilling in conjunction with controlled blasting and/or hoe ramming.

Prior to considering blasting operations, the blasting effects on the existing services, buildings and other structures should be addressed. A pre-blast or pre-construction survey of the existing structures located in proximity to the blasting operations should be completed prior to commencing site activities.

The extent of the survey should be determined by the blasting consultant and should be sufficient to respond to any inquiries/claims related to the blasting operations. The blasting operations should be planned and conducted under the supervision of a licensed professional engineer who is an experienced blasting consultant.

## **Vibration Considerations**

Construction operations are the cause of vibrations, and possibly, sources of nuisance to the community. Therefore, means to reduce the vibration levels should be incorporated in the construction operations to maintain, as much as possible, a cooperative environment with the residents.

The following construction equipment could be a source of vibrations: piling rig, hoe ram, compactor, dozer, crane, truck traffic, etc. Vibrations, whether caused by blasting operations or by construction operations, could be the cause of the source of detrimental vibrations on the nearby buildings and structures. Therefore, it is recommended that all vibrations be limited.

Two parameters are used to determine the permissible vibrations, namely, the maximum peak particle velocity and the frequency. For low frequency vibrations, the maximum allowable peak particle velocity is less than that for high frequency vibrations. As a guideline, the peak particle velocity should be less than 15 mm/s between frequencies of 4 to 12 Hz, and 50 mm/s above a frequency of 40 Hz (interpolate between 12 and 40 Hz).

It should be noted that these guidelines are for today's construction standards. Considering that these guidelines are above perceptible human level and, in some cases, could be very disturbing to some people, it is recommended that a pre-construction survey be completed to minimize the risks of claims during or following the construction of the proposed building.

## **Fill Placement**

Fill used for grading beneath the building footprint, unless otherwise specified, should consist of clean imported granular fill, such as Ontario Provincial Standard Specifications (OPSS) Granular A or Granular B Type II. Imported fill should be tested and approved prior to delivery to the site.

Non-specified existing fill along with site-excavated soil can be placed as general landscaping fill where surface settlement is a minor concern. The backfill materials should be spread in thin lifts and at a minimum compacted by the tracks of the spreading equipment to minimize voids. If non-specified backfill, reviewed and approved by Paterson, is to be placed to build up the subgrade level for areas to be paved, the fill should be compacted in maximum 300 mm lifts and compacted to 98% of the material's SPMDD.

If excavated rock is to be used as fill, it should be suitably fragmented to produce a well-graded material with a maximum particle size of 300 mm. This can be assessed at the time of construction. Site generated blast rock fill should be compacted using a suitably sized smooth drum vibratory roller when considered for placement.

### **Lean Concrete Filled Trenches**

Where bedrock is encountered below the underside of footing (USF) elevation, zero-entry vertical trenches should be excavated to the clean, surface sounded bedrock, and backfilled with lean concrete (minimum **17 MPa** 28-day compressive strength) up to the founding elevation. Typically, the excavation side walls will be used as the form to support the concrete. The trench excavation should be at least 150 mm wider than all sides of the footing (strip and pad footings) at the base of the excavation. The additional width of the concrete poured against an undisturbed trench sidewall will suffice in providing a direct transfer of the footing load to the underlying bedrock. Once the trench excavation is approved by the geotechnical engineer, lean concrete can be poured up to the proposed founding elevation.

## **5.3 Foundation Design**

### **Bearing Resistance Values**

Footings supported on clean, surface sounded bedrock, or on lean concrete which is placed directly over the clean, surface-sounded bedrock, can be designed using a factored bearing resistance value at serviceability limit states (SLS) and ultimate limit states (ULS) of **3,000 kPa**. A geotechnical resistance factor of 0.5 was applied to this bearing resistance value.

A clean, surface-sounded bedrock bearing surface should be free of loose materials, and have no near surface seams, voids, fissures or open joints which can be detected from surface sounding with a rock hammer.

Footings supported on clean, surface sounded bedrock, or on lean concrete which is placed directly on the clean, surface sounded bedrock, and designed for the bearing resistance values provided herein, will be subjected to negligible post-construction total and differential settlements.

### **Lateral Support**

The bearing medium under footing-supported structures is required to be provided with adequate lateral support with respect to excavations and different foundation levels. Adequate lateral support is provided to a sound bedrock bearing medium

when a plane extending horizontally and vertically from the footing perimeter at a minimum of 1H:6V (or shallower) passes only through sound bedrock or a material of the same or higher capacity as the bedrock, such as concrete.

## 5.4 Design for Earthquakes

The site class for seismic site response can be taken as **Class X<sub>c</sub>**. If a higher seismic site class is required (such as a velocity in the range of Class X<sub>A</sub> or X<sub>B</sub>), then a site-specific shear wave velocity test may be completed to accurately determine the applicable seismic site classification for foundation design of the proposed building, as presented in Table 4.1.8.4.A of the Ontario Building Code (OBC) 2024. The soils underlying the site are not susceptible to liquefaction.

## 5.5 Basement Floor Slab

The existing fill, glacial till, or bedrock will provide a suitable founding medium for the basement floor slab. It is anticipated that the basement area for the proposed building will be mostly parking and the recommended pavement structures noted in Section 5.8 will be applicable.

However, if storage or other uses of the lower level will involve the construction of a concrete floor slab, the upper 200 mm of sub-slab fill is recommended to consist of 19 mm clear crushed stone.

Any soft areas in the basement slab subgrade should be removed and backfilled with appropriate backfill material prior to placing fill. OPSS Granular A or Granular B Type II, with a maximum particle size of 50 mm, is recommended for backfilling below the floor slab. All backfill material within the footprint of the proposed building should be placed in maximum 300 mm thick loose layers and compacted to a minimum of 98% of the SPMDD.

In consideration of the groundwater conditions at the site, an underslab drainage system, consisting of lines of perforated drainage pipe subdrains connected to a positive outlet, should be provided in the subfloor fill under the lower basement floor. This is discussed further in Section 6.1.

## 5.6 Basement Wall

There are several combinations of backfill materials and retained soils that could be applicable for the basement walls of the proposed building. However, the conditions can be well-represented by assuming the retained soil consists of a

material with an angle of internal friction of 30 degrees and a drained unit weight of 20 kN/m<sup>3</sup> (effective unit weight 13 kN/m<sup>3</sup>).

### **Lateral Earth Pressures**

The static horizontal earth pressure ( $P_o$ ) can be calculated using a triangular earth pressure distribution equal to  $K_o \cdot \gamma \cdot H$  where:

$K_o$  = at-rest earth pressure coefficient of the applicable retained soil (0.5)

$\gamma$  = unit weight of fill of the applicable retained soil (kN/m<sup>3</sup>)

$H$  = height of the wall (m)

An additional pressure having a magnitude equal to  $K_o \cdot q$  and acting on the entire height of the wall should be added to the above diagram for any surcharge loading,  $q$  (kPa), that may be placed at ground surface adjacent to the wall. The surcharge pressure will only be applicable for static analyses and should not be used in conjunction with the seismic loading case.

Actual earth pressures could be higher than the “at-rest” case if care is not exercised during the compaction of the backfill materials to maintain a minimum separation of 0.3 m from the walls with the compaction equipment.

### **Seismic Earth Pressures**

The total seismic force ( $P_{AE}$ ) includes both the earth force component ( $P_o$ ) and the seismic component ( $\Delta P_{AE}$ ).

The seismic earth force ( $\Delta P_{AE}$ ) can be calculated using  $0.375 \cdot a_c \cdot H^2/g$  where:

$a_c = (1.45 - a_{max}/g) a_{max}$

$\gamma$  = unit weight of fill of the applicable retained soil (kN/m<sup>3</sup>)

$H$  = height of the wall (m)

$g$  = gravity, 9.81 m/s<sup>2</sup>

The peak ground acceleration, ( $a_{max}$ ), for the Ottawa area is 0.326 g according to the OBC 2024. Note that the vertical seismic coefficient is assumed to be zero.

The earth force component ( $P_o$ ) under seismic conditions can be calculated using  $P_o = 0.5 K_o \cdot \gamma \cdot H^2$ , where  $K = 0.5$  for the soil conditions noted above.

The total earth force ( $P_{AE}$ ) is considered to act at a height,  $h$  (m), from the base of the wall, where:

$$h = \{P_o \cdot (H/3) + \Delta P_{AE} \cdot (0.6 \cdot H)\} / P_{AE}$$

The earth forces calculated are unfactored. For the ULS case, the earth loads should be factored as live loads, as per OBC 2024.

## 5.7 Rock Anchor Design

### Overview of Anchor Features

The geotechnical design of grouted rock anchors in sedimentary bedrock is based upon two possible failure modes. The anchor can fail either by shear failure along the grout/rock interface or a 60 to 90 degree pullout of rock cone with the apex of the cone near the middle of the bonded length of the anchor.

Interaction may develop between the failure cones of anchors that are relatively close to one another resulting in a total group capacity smaller than the sum of the load capacity of each individual anchor.

A third failure mode of shear failure along the grout/steel interface should be reviewed by the structural engineer to ensure all typical failure modes have been reviewed. The anchor should be provided with a bonded length at the base of the anchor which will provide the anchor capacity, as well an unbonded length between the rock surface and the top of the bonded length. Permanent anchors should be provided with corrosion protection. As a minimum, the entire drill hole should be filled with cementitious grout. The free anchor length is provided by installing a plastic sleeve to act as a bond break, with the sleeve filled with grout or a corrosion inhibiting mastic.

Double corrosion protection can be provided with factory assembled systems, such as those available from Dywidag Systems or Williams Form Engineering Corp. Recognizing the importance of the anchors for the long-term performance of the foundation of the proposed building, any permanent rock anchors for this project are recommended to be provided with double corrosion protection.

### Grout to Rock Bond

The Canadian Foundation Engineering Manual recommends a maximum allowable grout to rock bond stress (for sound rock) of 1/30 of the unconfined compressive strength (UCS) of either the grout or rock (but less than 1.3 MPa) for an anchor of minimum length (depth) of 3 m.

Generally, the UCS of sound shale bedrock ranges between about 25 and 40 MPa, which is similar in strength to most routine grouts. A factored tensile grout to rock bond resistance value at ULS of **1.0 MPa**, incorporating a resistance factor of 0.3, can be calculated. A minimum grout strength of 40 MPa is recommended.

### Rock Cone Uplift

As discussed previously, the geotechnical capacity of the rock anchors depends on the dimensions of the rock anchors and the configuration of the anchorage system. Based on existing bedrock information, a **Rock Mass Rating (RMR) of 65** was assigned to the bedrock, and Hoek and Brown parameters (**m and s**) were taken as **0.821 and 0.00293**, respectively.

### Recommended Rock Anchor Lengths

Parameters used to calculate rock anchor lengths are provided in Table 3 below:

| <b>Table 3 – Parameters used in Rock Anchor Review</b> |                                  |
|--------------------------------------------------------|----------------------------------|
| Grout to Rock Bond Strength – Factored at ULS          | 1.0 MPa                          |
| Compressive Strength – Grout                           | 40 MPa                           |
| Rock Mass Rating (RMR) – Good Quality Shale            | 65                               |
| Hoek and Brown Parameters                              | m=0.821 and s=0.00293            |
| Unconfined Compressive Strength – Shale Bedrock        | 40 MPa                           |
| Unit weight – Submerged Bedrock                        | 15.2 kN/m <sup>3</sup>           |
| Apex Angle of Failure Cone                             | 60°                              |
| Apex of Failure Cone                                   | Mid-point of fixed anchor length |

The fixed anchor length will depend on the diameter of the drill holes. Recommended anchor lengths for a 75 mm and 125 mm diameter hole are provided in Table 4 on the next page. The factored tensile resistance values given in Table 4 are based on a single anchor with no group influence effects.

A detailed analysis of the anchorage system, including potential group influence effects, could be provided once the details of the loading for the proposed building are determined.

| <b>Table 4 – Recommended Rock Anchor Lengths – Grouted Rock Anchor</b> |                           |                        |                     |                                         |
|------------------------------------------------------------------------|---------------------------|------------------------|---------------------|-----------------------------------------|
| <b>Diameter of Drill Hole (mm)</b>                                     | <b>Anchor Lengths (m)</b> |                        |                     | <b>Factored Tensile Resistance (kN)</b> |
|                                                                        | <b>Bonded Length</b>      | <b>Unbonded Length</b> | <b>Total Length</b> |                                         |
| 75                                                                     | 0.9                       | 1.1                    | 2.0                 | 210                                     |
|                                                                        | 1.8                       | 1.2                    | 3.0                 | 420                                     |
|                                                                        | 4.0                       | 1.2                    | 5.0                 | 900                                     |
|                                                                        | 5.0                       | 1.0                    | 6.0                 | 1150                                    |
| 125                                                                    | 0.7                       | 1.4                    | 2.1                 | 250                                     |
|                                                                        | 1.2                       | 1.7                    | 2.9                 | 470                                     |
|                                                                        | 2.0                       | 1.9                    | 3.9                 | 800                                     |
|                                                                        | 3.0                       | 2.0                    | 5.0                 | 1150                                    |

### Other Considerations

The anchor drill holes should be within 1.5 to 2 times the rock anchor tendon diameter and should be flushed clean prior to grouting under inspection from geotechnical personnel. A tremie tube is recommended to place grout from the bottom of the anchor holes. Compressive strength testing is recommended to be completed for the rock anchor grout. A set of grout cubes should be tested for each day that grout is prepared.

The geotechnical capacity of each rock anchor should be proof tested at the time of construction. More information on testing can be provided upon request.

## 5.8 Pavement Design

### Lowest Underground Parking Level

For design purposes, it is recommended that the rigid pavement structure for the lowest underground parking level of the proposed building consist of Category C2, 32 MPa concrete at 28 days with air entrainment of 5 to 8%. The recommended rigid pavement structure is further presented in Table 5 on the next page.

| <b>Table 5 - Recommended Rigid Pavement Structure - Lower Parking Level</b>                                             |                                                                      |
|-------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------|
| <b>Thickness (mm)</b>                                                                                                   | <b>Material Description</b>                                          |
| 125                                                                                                                     | <b>Exposure Class C2 – 32 MPa Concrete</b> (5 to 8% Air Entrainment) |
| 300                                                                                                                     | <b>BASE</b> – OPSS Granular A Crushed Stone                          |
| <b>SUBGRADE</b> - Existing imported fill, or OPSS Granular B Type I or II material placed over in situ soil or bedrock. |                                                                      |

To control cracking due to shrinking of the concrete floor slab, it is recommended that strategically located saw cuts be used to create control joints within the concrete floor slab of the lower underground parking level. The control joints are generally recommended to be located at the center of the column lines and spaced at approximately 24 to 36 times the slab thickness (for example; a 0.15 m thick slab should have control joints spaced between 3.6 and 5.4 m). The joints should be cut between 25 and 30% of the thickness of the concrete floor slab and completed as early as 4 hours after the concrete has been poured during warm temperatures, and up to 12 hours during cooler temperatures.

### **Pavement Structure Over Podium Deck**

The pavement structures presented in Tables 6 and 7 should be used for car only parking areas, at grade access lanes and heavy loading parking areas over the top of the podium structure, should they be required.

| <b>Table 6 - Recommended Pavement Structure - Car Only Parking Areas Over Podium Deck</b>       |                                                                     |
|-------------------------------------------------------------------------------------------------|---------------------------------------------------------------------|
| <b>Thickness (mm)</b>                                                                           | <b>Material Description</b>                                         |
| 50                                                                                              | <b>Wear Course</b> – HL-3 or Superpave 12.5 Asphaltic Concrete      |
| 200*                                                                                            | <b>BASE</b> – OPSS Granular A Crushed Stone                         |
| See below**                                                                                     | <b>Thermal Break**</b> – Rigid Insulation (See Following Paragraph) |
| n/a                                                                                             | <b>Waterproofing Membrane and IKO Protection Board</b>              |
| <b>SUBGRADE</b> – Reinforced concrete podium deck                                               |                                                                     |
| * Thickness of base course is dependent on grade of insulation as noted in proceeding paragraph |                                                                     |
| ** If specified by others, not required from a geotechnical perspective                         |                                                                     |

| <b>Table 7 - Recommended Pavement Structure – Access Lanes, Fire Truck Lane, Ramp, and Heavy Loading Areas Over Podium Deck</b>                                                                                                 |                                                                     |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------|
| <b>Thickness (mm)</b>                                                                                                                                                                                                           | <b>Material Description</b>                                         |
| 40                                                                                                                                                                                                                              | <b>Wear Course</b> – HL-3 or Superpave 12.5 Asphaltic Concrete      |
| 50                                                                                                                                                                                                                              | <b>Binder Course</b> – HL-8 or Superpave 19.0 Asphaltic Concrete    |
| 300*                                                                                                                                                                                                                            | <b>BASE</b> – OPSS Granular A Crushed Stone                         |
| See below**                                                                                                                                                                                                                     | <b>Thermal Break**</b> – Rigid Insulation (See Following Paragraph) |
| n/a                                                                                                                                                                                                                             | <b>Waterproofing Membrane and IKO Protection Board</b>              |
| <b>SUBGRADE</b> – Reinforced concrete podium deck<br>* Thickness of base course is dependent on grade of insulation as noted in proceeding paragraph<br>** If specified by others, not required from a geotechnical perspective |                                                                     |

The transition between the pavement structure over the podium deck subgrade and soil subgrade beyond the footprint of the podium deck is recommended to be transitioned to match the pavement structures provided in the following section.

For this transition, a 5H:1V is recommended between the two subgrade surfaces. Further, the base layer thickness should be increased to a minimum thickness of 500 mm below the top of the podium slab a minimum of 1.5 m from the face of the foundation wall prior to providing the recommended taper.

Should the proposed podium deck be specified to be provided a thermal break by the use of a layer of rigid insulation below the pavement structure, its placement within the pavement structure is recommended to be as per the above-noted tables. The layer of rigid insulation is recommended to consist of a DOW Chemical High-Load 100 (HI-100), High-Load 60 (HI-60), or High-Load 40 (HI-40). The base layer thickness will be dependent on the grade of insulation considered for this project and should be reassessed by the geotechnical consultant once pertinent design details have been prepared.

The higher grades of insulation have more resistance to deformation under wheel-loading and require less granular cover to avoid being crushing by vehicular loading. It should be noted that SM (Styrofoam) rigid insulation is **not** considered suitable for this application.

### **Pavement Structure on Overburden Soils**

The following pavement structures may be considered for at-grade car only parking and heavy traffic areas, should they be required. The proposed pavement structures are shown in Tables 8 and 9, on the next page.

| <b>Table 8 - Recommended Pavement Structure - Car-Only Parking Areas</b>                                                     |                                                                |
|------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------|
| <b>Thickness (mm)</b>                                                                                                        | <b>Material Description</b>                                    |
| 50                                                                                                                           | <b>Wear Course</b> – HL-3 or Superpave 12.5 Asphaltic Concrete |
| 150                                                                                                                          | <b>BASE</b> – OPSS Granular A Crushed Stone                    |
| 300                                                                                                                          | <b>SUBBASE</b> – OPSS Granular B Type II                       |
| <b>SUBGRADE</b> - Either in situ soils, bedrock or OPSS Granular B Type I or II material placed over in situ soil or bedrock |                                                                |

| <b>Table 9 - Recommended Pavement Structure - Heavy-Truck Traffic and Loading Areas</b>                                      |                                                                  |
|------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------|
| <b>Thickness (mm)</b>                                                                                                        | <b>Material Description</b>                                      |
| 40                                                                                                                           | <b>Wear Course</b> – HL-3 or Superpave 12.5 Asphaltic Concrete   |
| 50                                                                                                                           | <b>Binder Course</b> – HL-8 or Superpave 19.0 Asphaltic Concrete |
| 150                                                                                                                          | <b>BASE</b> – OPSS Granular A Crushed Stone                      |
| 450                                                                                                                          | <b>SUBBASE</b> – OPSS Granular B Type II                         |
| <b>SUBGRADE</b> - Either in situ soils, bedrock or OPSS Granular B Type I or II material placed over in situ soil or bedrock |                                                                  |

Minimum Performance Graded (PG) 58-34 asphalt cement should be used for this project. If soft spots develop in the subgrade during compaction or due to construction traffic, the affected areas should be excavated and replaced with OPSS Granular B Type II material.

The pavement granular (base and subbase) should be placed in maximum 300 mm thick lifts and compacted to a minimum of 99% of the material's SPMDD using suitable compaction equipment.

## 6.0 Design and Construction Precautions

### 6.1 Foundation Drainage and Backfill

It is anticipated that the proposed building foundation walls located below finished grades be blind-poured and placed against a composite drainage board and waterproofing membrane which is fastened to the temporary shoring system and/or vertical bedrock face.

For the portion of the composite drainage board and waterproofing membrane installed against vertical bedrock face, if encountered within the depth of excavation, the following is recommended:

- ☐ Line drill the excavation perimeter (usually at 150 to 200 mm spacing).
- ☐ Mechanically remove bedrock along the foundation walls, up to approximately 150 mm from the finished vertical excavation face.
- ☐ Grind the bedrock surface up to the outer face of the line drilled holes to create a satisfactory surface for the waterproofing membrane and/or composite drainage board.
- ☐ If bedrock overbreaks occur, shotcrete these areas to fill in cavities and to smooth out angular features of the bedrock surface, as required based on site inspection by Paterson.
- ☐ Place a composite drainage board, such as Delta Drain 6000 or equivalent, against the prepared vertical bedrock surface. The composite drainage layer should extend from the finished grade to the underside of the footing.
- ☐ Place a suitable waterproofing membrane (such as Grace Preprufe 275 or approved equivalent) over the composite drainage board. The waterproofing membrane should extend from the finished grade to the underside of the footing.
- ☐ Pour the foundation wall against the waterproofing membrane and composite drainage board.

It is recommended that 100 mm diameter sleeves at 3 m centres be cast at the foundation wall/footing interface to allow for the infiltration of water that breaches the waterproofing system to flow to an interior perimeter drainage pipe. The perimeter drainage pipe should direct water to sump pit(s) within the lower basement area.

Elevators and any other pits located below the underslab drainage system should be waterproofed. A full waterproofing detail for the foundation walls and the mechanical pits can be provided by Paterson, if required.

### **Perimeter and Underslab Drainage System**

The perimeter and underslab drainage system is recommended to control water infiltration below the underground parking level slab and to re-direct water from the buildings foundation drainage system to the building's sump pit(s). For preliminary design purposes, it is recommended that 100 mm perforated pipes provided with a geosock, surrounded on all sides by a minimum 150 mm thick layer of 19 mm clear crushed stone, be placed at approximate 6 m centres underlying the underground parking level slab.

The perimeter drainage system should be mechanically connected to the 100 mm drainage sleeves and gravity connected to the underslab drainage system, which in turn is connected to the building's sump pit(s).

The spacing of the underslab drainage system should be confirmed by the geotechnical consultant at the time of completing the excavation when water infiltration can be better assessed.

### **Foundation Backfill**

Where the foundation walls are not poured directly against the temporary shoring system, the exterior of the perimeter foundation walls can be backfilled with the site excavated soils, provided that they are maintained in an unfrozen state and at a suitable moisture content for compaction. Imported granular materials, such as clean sand or OPSS Granular B Type II granular material, should otherwise be used for this purpose.

## **6.2 Protection of Footings Against Frost Action**

Perimeter footings of heated structures are recommended to be insulated against the deleterious effects of frost action. A minimum 1.5 m thick soil cover, or an equivalent combination of soil cover and foundation insulation should be provided in this regard.

Exterior unheated footings, such as isolated exterior piers, are more prone to deleterious movement associated with frost action than the exterior walls of the structure proper and require additional protection, such as soil cover of 2.1 m or a combination of soil cover and foundation insulation.

However, the footings are generally not expected to require protection against frost action due to the founding depth. Unheated structures such as the access ramp may require insulation for protection against the deleterious effects of frost action.

### **6.3 Excavation Side Slopes**

The side slopes of excavations in the overburden materials should be either cut back at acceptable slopes or should be retained by shoring systems from the start of the excavation until the structure is backfilled.

#### **Unsupported Side Slopes**

The excavation side slopes above the groundwater level extending to a maximum depth of 3 m should be cut back at 1H:1V or flatter. The flatter slope is required for excavation below groundwater level. The subsurface soil at this site is considered to be mainly a Type 2 and 3 soil according to the Occupational Health and Safety Act and Regulations for Construction Projects.

Excavation side slopes carried out for the building footprint are recommended to be provided with surface protection from erosion by rain and surface water runoff, where shoring is not anticipated to be implemented. This can be accomplished by covering the entire surface of the excavation side slopes with tarps secured between the top and bottom of the overburden excavation, and approved by Paterson personnel at the time of construction. It is further recommended to maintain a relatively dry surface along the bottom of the excavation footprint to mitigate the potential for sloughing of the side slopes.

Excavated soil should not be stockpiled directly at the top of excavations and heavy equipment should be kept away from the excavation sides.

Slopes in excess of 3 m in height should be periodically inspected by the geotechnical consultant in order to detect if the slopes are exhibiting signs of distress. It is recommended that a trench box be used at all times to protect personnel working in trenches with steep or vertical sides.

It is expected that services will be installed by “cut and cover” methods and excavations will not be left open for extended periods of time.

## Temporary Shoring

Temporary shoring may be required for the overburden soils to complete the required excavations, where insufficient room is available for open cut methods. The shoring requirements, designed by a structural engineer specializing in those works, will depend on the depth of the excavation, the proximity of the adjacent structures and the elevation of the adjacent building foundations and underground services. The design and implementation of these temporary systems will be the responsibility of the excavation contractor and their design team.

Inspections and approval of the temporary system will also be the responsibility of the designer. The geotechnical information provided below is to assist the designer in completing a suitable and safe shoring system. The designer should consider the impact of a significant precipitation event and designate design measures to ensure that precipitation will not negatively impact the shoring system or soils supported by the system. Any changes to the approved shoring design system should be reported immediately to the owner's structural designer prior to implementation.

The temporary shoring system should consist of a soldier pile and lagging system. Any additional loading due to street traffic, neighbouring buildings, construction equipment, adjacent structures and facilities, etc., should be included in the earth pressures described below. These systems could be cantilevered, anchored, or braced.

The earth pressures acting on the temporary shoring system may be calculated with the parameters presented in Table 10, presented below.

| <b>Table 10 – Soil Parameters</b>                     |               |
|-------------------------------------------------------|---------------|
| <b>Parameters</b>                                     | <b>Values</b> |
| Active Earth Pressure Coefficient ( $K_a$ )           | 0.33          |
| Passive Earth Pressure Coefficient ( $K_p$ )          | 3             |
| At-Rest Earth Pressure Coefficient ( $K_o$ )          | 0.5           |
| Dry Unit Weight ( $\gamma$ ), kN/m <sup>3</sup>       | 20            |
| Effective Unit Weight ( $\gamma$ ), kN/m <sup>3</sup> | 13            |

The active earth pressure should be calculated where wall movements are permissible while the at-rest pressure should be calculated if no movement is permissible. The dry unit weight should be calculated above the groundwater level while the effective unit weight should be calculated below the groundwater level.

The hydrostatic groundwater pressure should be included to the earth pressure distribution wherever the effective unit weight are calculated for earth pressures. If the groundwater level is lowered, the dry unit weight for the soil should be calculated to full weight, with no hydrostatic groundwater pressure component.

For design purposes, the minimum factor of safety of 1.5 should be calculated.

### **Bedrock Stabilization**

The excavation side slopes in sound bedrock can be carried out using vertical side walls. A minimum 1 m horizontal ledge should be left between the bottom of the overburden excavation and the top of the bedrock surface to provide an area to allow for potential sloughing or to provide a stable base for the overburden shoring system.

The requirement for bedrock stabilization measures such as temporary chainlink fencing, shotcrete, and/or rock bolts, particularly for the upper weathered bedrock, should be evaluated during the excavation operations and should be discussed with the structural engineer during the design stage of the project.

## **6.4 Pipe Bedding and Backfill**

Bedding and backfill materials should be in accordance with the most recent Material Specifications and Standard Detail Drawings from the Department of Public Works and Services, Infrastructure Services Branch of the City of Ottawa.

The pipe bedding for sewer and water pipes should consist of at least 150 mm of OPSS Granular A material for areas over a soil subgrade. The material should be placed in maximum 300 mm thick lifts and compacted to a minimum of 99% of its SPMDD. The bedding material should extend at a minimum to the spring line of the pipe.

The cover material, which should consist of OPSS Granular A crushed stone, should extend from the spring line of the pipe to a minimum of 300 mm above the obvert of the pipe. The material should be placed in maximum 300 mm thick lifts and compacted to a minimum of 99% of its SPMDD.

Generally, it should be possible to re-use the moist (not wet) silty sand to sandy silt and glacial till above the cover material if the excavation and filling operations are carried out in dry weather conditions.

Where hard surface areas are considered above the trench backfill, the trench backfill material within the frost zone (about 1.8 m below finished grade) should consist of the soils exposed at the trench walls to minimize differential frost heaving. The trench backfill should be placed in maximum 300 mm thick loose lifts and compacted to a minimum of 95% of the SPMDD.

## **6.5 Groundwater Control**

It is anticipated that groundwater infiltration into the excavations should be relatively low to moderate, and controllable using open sumps. The contractor should be prepared to direct water away from all bearing surfaces and subgrades, regardless of the source, to prevent disturbance to the founding medium.

### **Permit to Take Water**

A temporary Ministry of Environment, Conservation and Parks (MECP) permit to take water (PTTW) may be required if more than 400,000 L/day of ground and/or surface water are to be pumped during the construction phase. At least 4 to 5 months should be allowed for completion of the application and issuance of the permit by the MECP.

For typical ground or surface water volumes being pumped during the construction phase, typically between 50,000 to 400,000 L/day, it is required to register on the Environmental Activity and Sector Registry (EASR). A minimum of two to four weeks should be allotted for completion of the EASR registration and the Water Taking and Discharge Plan to be prepared by a Qualified Persons as stipulated under O.Reg. 63/16.

### **Adverse Effects of Dewatering on Adjacent Properties**

Given the glacial till and bedrock soils present at the subject site and its vicinity, the neighbouring structures are expected to be founded on the glacial till or bedrock surface, which are not susceptible to settlement from dewatering. Therefore, no issues are expected with respect to groundwater lowering that would cause damage to adjacent structures surrounding the proposed development.

## **6.6 Winter Construction**

Precautions must be taken if winter construction is considered for this project. The subsoil conditions at this site consist of frost susceptible materials. In the presence of water and freezing conditions, ice could form within the soil mass. Heaving and settlement upon thawing could occur.

In the event of construction during below zero temperatures, the founding stratum should be protected from freezing temperatures using straw, propane heaters and tarpaulins or other suitable means.

In this regard, the base of the excavations should be insulated from sub-zero temperatures immediately upon exposure and until such time as heat is adequately supplied to the building and the footings are protected with sufficient soil cover to prevent freezing at founding level.

Trench excavations and pavement construction are also difficult activities to complete during freezing conditions without introducing frost into the subgrade or in the excavation walls and bottoms. Precautions should be taken if such activities are to be carried out during freezing conditions.

## **6.7 Corrosion Potential and Sulphate**

The analytical test results of the soil sample indicate that the sulphate content is less than 0.1%. These results along with the chloride and pH value are indicative that Type 10 Portland cement (Type GU) would be appropriate for this site. The chloride content and the pH of the sample indicate they are not significant factors in creating a corrosive environment for exposed ferrous metals at this site, whereas the resistivity is indicative of a severe to very aggressive environment.

## **6.8 Slope Stability Assessment**

As part of the ongoing geotechnical investigation, Paterson has conducted a review of the slope along the creek adjacent to the eastern boundary of the site.

Based on the current field investigation and available topographic information, a cross-section was analyzed for slope stability using SLIDE, a computer program for two-dimensional slope stability analysis. Overall, 1 slope cross-section throughout the above-noted locations was analyzed as part of the slope stability analysis.

### **Slope Stability Analysis**

The slope stability analysis was modelled in SLIDE, a computer program which permits a two-dimensional slope stability analysis calculating several methods including the Bishop's method, which is a widely accepted slope analysis method. The program calculates a factor of safety, which represents the ratio of the forces resisting failure to forces favoring failure.

Theoretically, a factor of safety of 1.0 represents a condition where the slope is stable. However, due to intrinsic limitations of the calculation methods and the variability of the subsurface soil and groundwater conditions, a factor of safety greater than 1.0 is generally required for the failure risk to be considered acceptable.

A minimum factor of safety of 1.5 is generally recommended for conditions where the slope failure would comprise permanent structures. An analysis considering seismic loading was also completed. A horizontal acceleration of 0.18 g was considered for the sections for the seismic loading condition. A factor of safety of 1.1 is considered to be satisfactory for stability analyses including seismic loading. It should be noted that only the figures with the lowest factor of safety are presented and considered the governing factors.

One (1) slope cross-section (Section A-A') was studied as the worst case scenario. The cross-section location is presented in Drawing PG7401-1 – Test Hole Location Plan in Appendix 2. It should be noted that details of the slope height and slope angle at the cross-section locations are presented in Figures 2 and 3 in Appendix 2, based on the topographic data obtained during the field investigation, as well as the available topographic data.

The effective and total strength soil parameters used for the static and seismic analyses were chosen based on the subsoil information recovered during the site investigation. The effective and total strength soil parameters used for the analyses are presented in Table 11 below.

| <b>Table 11 – Effective and Total Stress Soil Parameters</b> |                                     |                             |                |
|--------------------------------------------------------------|-------------------------------------|-----------------------------|----------------|
| Soil Layer                                                   | Unit Weight<br>(kN/m <sup>3</sup> ) | Friction Angle<br>(degrees) | Cohesion (kPa) |
| Topsoil                                                      | 16                                  | 28                          | 5              |
| Fill                                                         | 20                                  | 35                          | -              |
| Glacial Till                                                 | 20                                  | 38                          | -              |
| Bedrock                                                      | 22                                  | -                           | 1,000+         |

### **Stable Slope Allowance**

The result of the static analysis, shown on Figure 2 in Appendix 2, indicates a factor of safety of 1.32. The result of the seismic analysis, shown on Figure 3, indicates a factor of safety of 0.72, respectively. As a result, a **stable slope allowance of 1.8 m** is required from the top of the slope at this site, which extends to the required factors of safety of 1.5 and 1.1 under static and seismic analysis conditions, respectively.

## **Toe Erosion Allowance**

Since the slopes are in direct contact with an active watercourse, erosion of the toe of slope is considered to be a notable factor contributing to the stability of the subject slopes.

The toe erosion allowance is based on the nature of the soils, the observed current erosion activities, and the width and location of the current watercourse, and has been determined in accordance with the City of Ottawa's Slope Stability Guidelines for Development Application in the City of Ottawa (2004) and the Ontario Ministry of Natural Resource Technical Guide – River and Stream Systems: Erosion Hazard Limit (2002).

Generally, subsurface conditions at the toe of slope were observed to consist of a layer of glacial till underlain by bedrock. Based on this and the consistency of the subsoil materials encountered throughout our investigation and field review along the watercourse, a **toe erosion allowance of 1 m** is recommended to be considered for the associated Limit of Hazard Lands.

## **Erosion Access Allowance**

Based on our review and current guidelines, a **6 m erosion access allowance** is recommended from the top of the stable slope for the slopes to allow for future maintenance of the slope.

## **Limit of Hazard Lands**

Based on these observations and the results of the slope stability analysis, Paterson has established a Limit of Hazard Lands setback from the observed top of the slope. The Limit of Hazard Lands is determined by a combination of stable slope allowance, toe erosion allowance, and erosion access allowance.

As a result, a Limit of Hazard Lands designation of **8.8 m** is required from the top of the slope along the creek at the subject site. This Limit of Hazard Land setback is shown on the attached Drawing PG7401-1 - Test Hole Location Plan, located in Appendix 2.

It is recommended that the existing vegetation on the slope faces not be removed, as it plays a vital role in maintaining slope stability and mitigating erosion.

## 7.0 Recommendations

It is recommended that the following be carried out by Paterson once preliminary and future details of the proposed development have been prepared:

- ☐ Review preliminary and detailed servicing plan, from a geotechnical perspective.
- ☐ Review of the geotechnical aspects of the foundation drainage systems prior to construction, if applicable.
- ☐ Review of the geotechnical aspects of the excavation contractor's shoring design, if not designed by Paterson, prior to construction, if applicable.

It is a requirement for the foundation design data provided herein to be applicable that a material testing and observation program be performed by the geotechnical consultant. The following aspects of the program should be performed by Paterson:

- ☐ Review and inspection of the installation of the foundation drainage and waterproofing systems.
- ☐ Observation of all bearing surfaces prior to the placement of concrete.
- ☐ Sampling and testing of the concrete and fill materials.
- ☐ Periodic observation of the condition of unsupported excavation side slopes in excess of 3 m in height, if applicable.
- ☐ Observation of all subgrades prior to backfilling and follow-up field density tests to determine the level of compaction achieved.
- ☐ Field density tests to determine the level of compaction achieved.
- ☐ Sampling and testing of the bituminous concrete including mix design reviews.

A report confirming that these works have been conducted in general accordance with our recommendations could be issued upon the completion of a satisfactory inspection program by the geotechnical consultant. All excess soil must be handled as per *Ontario Regulation 406/19: On-Site and Excess Soil Management*.

## 8.0 Statement of Limitations

The recommendations provided herein are in accordance with the present understanding of the project. Paterson requests permission to review the recommendations when the drawings and specifications are completed.

A soils investigation is a limited sampling of a site. Should any conditions at the site be encountered which differ from those at the test locations, Paterson requests immediate notification to permit reassessment of our recommendations.

The recommendations provided herein should only be used by the design professionals associated with this project. They are not intended for contractors bidding on or undertaking the work. The latter should evaluate the factual information provided in this report and determine the suitability and completeness for their intended construction schedule and methods. Additional testing may be required for their purposes.

The present report applies only to the project described in this document. Use of this report for purposes other than those described herein or by person(s) other than TC United, or their agents is not authorized without review by Paterson for the applicability of our recommendations to the alternative use of the report.

### Paterson Group Inc.



Kevin A. Pickard, P.Eng.



Scott S. Dennis, P.Eng.

### Report Distribution:

- ☐ TC United
- ☐ Paterson Group

# APPENDIX 1

SOIL PROFILE AND TEST DATA SHEETS

SYMBOLS AND TERMS

BOREHOLE LOGS BY OTHERS

CONCRETE CORE COMPRESSIVE STRENGTH RESULTS

ANALYTICAL TESTING RESULTS

**COORD. SYS.:** MTM ZONE 9      **EASTING:** 370447.07      **NORTHING:** 5029287.66      **ELEVATION:** 72.63

**PROJECT:** Proposed Residential Development

**FILE NO. :** PG7401

**BORINGS BY:** CME-55 Track Mounted Drill Rig

**REMARKS:**
**DATE:** December 20, 2024

**HOLE NO. :** BH 1-24

| SAMPLE DESCRIPTION                                                                                | STRATA PLOT | DEPTH (m) | SAMPLE       |              |                      |                  | <div> <div>■ GASTECH (ppm)</div> <div>□ GASTECH (% LEL)</div> </div> |     |     |     | PIEZOMETER CONSTRUCTION | ELEVATION (m) |
|---------------------------------------------------------------------------------------------------|-------------|-----------|--------------|--------------|----------------------|------------------|----------------------------------------------------------------------|-----|-----|-----|-------------------------|---------------|
|                                                                                                   |             |           | TYPE AND NO. | RECOVERY (%) | N, Nc OR RQD         | ANALYTICAL TESTS | 50                                                                   | 100 | 150 | 200 |                         |               |
|                                                                                                   |             |           |              |              |                      |                  | <div>▲ PID (ppm)</div> <div>△ PID (% LEL)</div>                      |     |     |     |                         |               |
| GROUND SURFACE                                                                                    |             |           |              |              |                      |                  | 20                                                                   | 40  | 60  | 80  |                         |               |
| <b>ASPHALT</b>                                                                                    |             | 0         | AU 1         |              |                      |                  |                                                                      |     |     |     |                         |               |
| 0.08m [ 72.55m ]                                                                                  |             |           |              |              |                      |                  |                                                                      |     |     |     |                         |               |
| <b>FILL:</b> Compact, brown silty sand, with gravel and crushed stone                             |             |           |              |              |                      |                  |                                                                      |     |     |     |                         |               |
| 0.69m [ 71.94m ]                                                                                  |             |           |              |              |                      |                  |                                                                      |     |     |     |                         | 72            |
| <b>FILL:</b> Stiff, brown silty clay, with sand, gravel and cobbles                               |             | 1         | SS 2         | 71           | 4-23-7-7<br>30       |                  |                                                                      |     |     |     |                         |               |
| 1.45m [ 71.18m ]                                                                                  |             |           |              |              |                      |                  |                                                                      |     |     |     |                         |               |
| <b>FILL:</b> Dense, brown silty sand, with gravel and cobbles                                     |             | 2         | SS 3         | 67           | 12-18-17-17<br>35    |                  |                                                                      |     |     |     |                         | 71            |
|                                                                                                   |             |           |              |              |                      |                  |                                                                      |     |     |     |                         |               |
|                                                                                                   |             |           | SS 4         | 87           | 10-15-32-27<br>47    |                  |                                                                      |     |     |     |                         | 70            |
| 2.97m [ 69.66m ]                                                                                  |             |           |              |              |                      |                  |                                                                      |     |     |     |                         |               |
| <b>GLACIAL TILL:</b> Very dense, grey silty sand to sandy silt, with gravel, cobbles and boulders |             | 3         | SS 5         | 92           | 20-30-30-22<br>60    |                  |                                                                      |     |     |     |                         | 69            |
|                                                                                                   |             |           |              |              |                      |                  |                                                                      |     |     |     |                         |               |
|                                                                                                   |             | 4         | SS 6         | 75           | 13-15-15-19<br>30    |                  |                                                                      |     |     |     |                         |               |
|                                                                                                   |             |           |              |              |                      |                  |                                                                      |     |     |     |                         |               |
|                                                                                                   |             |           | SS 7         | 100          | 18-50-/-/<br>50/0.15 |                  |                                                                      |     |     |     |                         | 68            |
| 5.49m [ 67.14m ]                                                                                  |             |           |              |              |                      |                  |                                                                      |     |     |     |                         |               |
| <b>BEDROCK:</b> Weathered                                                                         |             |           | SS 8         | 51           | 50-/-/<br>50/0.05    |                  |                                                                      |     |     |     |                         | 67            |
| 6.10m [ 66.53m ]                                                                                  |             |           |              |              |                      |                  |                                                                      |     |     |     |                         |               |
| <b>BEDROCK:</b> Poor to fair quality shale, interbedded with limestone                            |             | 6         | SS 9         | 0            | 50-/-/<br>50/0.03    |                  |                                                                      |     |     |     |                         |               |
|                                                                                                   |             |           |              |              |                      |                  |                                                                      |     |     |     |                         |               |
|                                                                                                   |             |           | RC 1         | 100          | RQD 47               |                  |                                                                      |     |     |     |                         | 66            |
|                                                                                                   |             | 7         |              |              |                      |                  |                                                                      |     |     |     |                         |               |
|                                                                                                   |             |           | RC 2         | 92           | RQD 32               |                  |                                                                      |     |     |     |                         | 65            |
| 7.72m [ 64.91m ]                                                                                  |             |           |              |              |                      |                  |                                                                      |     |     |     |                         |               |
| <b>End of Borehole</b>                                                                            |             | 8         |              |              |                      |                  |                                                                      |     |     |     |                         | 64            |
|                                                                                                   |             |           |              |              |                      |                  |                                                                      |     |     |     |                         |               |
|                                                                                                   |             | 9         |              |              |                      |                  |                                                                      |     |     |     |                         |               |

DISCLAIMER: THE DATA PRESENTED IN THIS LOG IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHO IT WAS PRODUCED. THIS LOG SHOULD BE READ IN CONJUNCTION WITH ITS COORESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.

|                                                   |                           |                             |                                |
|---------------------------------------------------|---------------------------|-----------------------------|--------------------------------|
| <b>COORD. SYS.:</b> MTM ZONE 9                    | <b>EASTING:</b> 370459.66 | <b>NORTHING:</b> 5029249.36 | <b>ELEVATION:</b> 73.61        |
| <b>PROJECT:</b> Proposed Residential Development  |                           |                             | <b>FILE NO. :</b> PG7401       |
| <b>BORINGS BY:</b> CME-55 Track Mounted Drill Rig |                           |                             | <b>HOLE NO. :</b> BH 2-24      |
| <b>REMARKS:</b>                                   |                           |                             | <b>DATE:</b> December 20, 2024 |

| SAMPLE DESCRIPTION                                                                                                    | STRATA PLOT | DEPTH (m) | SAMPLE       |              |                      |                     | <div> <div> <div>■</div> <div>□</div> </div> <div> <div>GASTECH (ppm)</div> <div>GASTECH (% LEL)</div> </div> </div> |     |     |     | PIEZOMETER<br>CONSTRUCTION | ELEVATION (m) |
|-----------------------------------------------------------------------------------------------------------------------|-------------|-----------|--------------|--------------|----------------------|---------------------|----------------------------------------------------------------------------------------------------------------------|-----|-----|-----|----------------------------|---------------|
|                                                                                                                       |             |           | TYPE AND NO. | RECOVERY (%) | N, Nc OR RQD         | ANALYTICAL<br>TESTS | 50                                                                                                                   | 100 | 150 | 200 |                            |               |
|                                                                                                                       |             |           |              |              |                      |                     | <div> <div>▲</div> <div>△</div> </div> <div> <div>PID (ppm)</div> <div>PID (% LEL)</div> </div>                      | 20  | 40  | 60  | 80                         |               |
| GROUND SURFACE                                                                                                        |             | 0         |              |              |                      |                     |                                                                                                                      |     |     |     |                            |               |
| <b>TOPSOIL</b> and organics<br>0.08m [ 73.53m ]                                                                       |             | 0         | AU 1         |              |                      |                     |                                                                                                                      |     |     |     |                            | 73            |
| <b>FILL:</b> Loose to compact, brown silty sand, with gravel, cobbles and crushed stone                               |             | 1         | SS 2         | 50           | 4-4-3-2<br>7         |                     |                                                                                                                      |     |     |     |                            | 72            |
|                                                                                                                       |             | 2         | SS 3         | 46           | 4-4-3-8<br>7         |                     |                                                                                                                      |     |     |     |                            | 71            |
|                                                                                                                       |             | 3         | SS 4         | 100          | 14-21-23-22<br>44    |                     |                                                                                                                      |     |     |     |                            | 70            |
| <b>GLACIAL TILL:</b> Dense, brown silty sand to sandy silt, some gravel and cobbels<br>2.59m [ 71.02m ]               |             | 4         | SS 5         | 98           | 39-54-/-/<br>54/0.15 |                     |                                                                                                                      |     |     |     |                            | 69            |
|                                                                                                                       |             | 5         | SS 6         | 51           | 50-/-/-/<br>50/0.05  |                     |                                                                                                                      |     |     |     |                            | 68            |
| <b>GLACIAL TILL:</b> Very dense, grey silty sand to sandy silt, with gravel, cobbles and boulders<br>4.11m [ 69.50m ] |             | 6         | RC 1         | 91           | RQD 15               |                     |                                                                                                                      |     |     |     |                            | 67            |
| <b>- Clay at 5.94 m depth</b><br>5.99m [ 67.62m ]                                                                     |             | 7         | RC 2         | 92           | RQD 41               |                     |                                                                                                                      |     |     |     |                            | 66            |
| <b>BEDROCK:</b> Poor quality shale, interbedded with limestone                                                        |             | 8         |              |              |                      |                     |                                                                                                                      |     |     |     |                            | 65            |
| End of Borehole<br>7.80m [ 65.81m ]                                                                                   |             | 9         |              |              |                      |                     |                                                                                                                      |     |     |     |                            |               |

DISCLAIMER: THE DATA PRESENTED IN THIS LOG IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHO IT WAS PRODUCED. THIS LOG SHOULD BE READ IN CONJUNCTION WITH ITS COORESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.

**ELEVATION:** 74.01

**FILE NO. : PG7401**

HOLE NO.: BH 3-24

**DATE:** December 20, 2024

C:\AutoCAD Drawings\Test Hole Data Files\PG74xx\PG7401\data.sqlite 2025-01-15, 14:49 Paterson\_Template MR

PAGE: 1 / 1

COORD. SYS.: MTM ZONE 9      EASTING: 370460.54      NORTHING: 5029194.69      ELEVATION: 74.00

PROJECT: Proposed Residential Development

FILE NO. : **PG7401**

BORINGS BY: Backhoe

REMARKS:

DATE: December 20, 2024

HOLE NO. : **TP 1-24**

| SAMPLE DESCRIPTION                                                                                          | STRATA PLOT | DEPTH (m) | SAMPLE       |              |              |                     | <div> <div> <div>■ GASTECH (ppm)</div> <div>□ GASTECH (% LEL)</div> </div> <div> <div>▲ PID (ppm)</div> <div>△ PID (% LEL)</div> </div> </div> |     |     |     | PIEZOMETER<br>CONSTRUCTION | ELEVATION (m) |
|-------------------------------------------------------------------------------------------------------------|-------------|-----------|--------------|--------------|--------------|---------------------|------------------------------------------------------------------------------------------------------------------------------------------------|-----|-----|-----|----------------------------|---------------|
|                                                                                                             |             |           | TYPE AND NO. | RECOVERY (%) | N, Nc OR RQD | ANALYTICAL<br>TESTS | 50                                                                                                                                             | 100 | 150 | 200 |                            |               |
|                                                                                                             |             |           |              |              |              |                     | 20                                                                                                                                             | 40  | 60  | 80  |                            |               |
| GROUND SURFACE                                                                                              |             | 0         |              |              |              |                     |                                                                                                                                                |     |     |     |                            | 74            |
| FILL: Compact, brown silty sand, with gravel, some shale fragments, trace brick                             |             |           | G 1          |              |              |                     |                                                                                                                                                |     |     |     |                            |               |
| 0.50m [ 73.50m ]                                                                                            |             |           | G 2          |              |              |                     |                                                                                                                                                |     |     |     |                            |               |
| FILL: Very dense, brown silty sand, with crushed stone, gravel and cobbles, trace concrete, metal and trash |             | 1         | G 3          |              |              |                     |                                                                                                                                                |     |     |     |                            | 73            |
|                                                                                                             |             |           | G 4          |              |              |                     |                                                                                                                                                |     |     |     |                            | 72            |
| 2.70m [ 71.30m ]                                                                                            |             | 2         | G 5          |              |              |                     |                                                                                                                                                |     |     |     |                            |               |
| End of Test Pit                                                                                             |             | 3         |              |              |              |                     |                                                                                                                                                |     |     |     |                            | 71            |
| Groundwater infiltration was observed at 0.60 m depth                                                       |             | 4         |              |              |              |                     |                                                                                                                                                |     |     |     |                            | 70            |
|                                                                                                             |             | 5         |              |              |              |                     |                                                                                                                                                |     |     |     |                            | 69            |
|                                                                                                             |             | 6         |              |              |              |                     |                                                                                                                                                |     |     |     |                            | 68            |
|                                                                                                             |             | 7         |              |              |              |                     |                                                                                                                                                |     |     |     |                            | 67            |
|                                                                                                             |             | 8         |              |              |              |                     |                                                                                                                                                |     |     |     |                            | 66            |
|                                                                                                             |             | 9         |              |              |              |                     |                                                                                                                                                |     |     |     |                            |               |

**COORD. SYS.:** MTM ZONE 9      **EASTING:** 370447.93      **NORTHING:** 5029176.78      **ELEVATION:** 74.30

**PROJECT:** Proposed Residential Development

**FILE NO. :** PG7401

**BORINGS BY:** Backhoe

**REMARKS:**
**DATE:** December 20, 2024

**HOLE NO. :** TP 2-24

| SAMPLE DESCRIPTION                                                                            | STRATA PLOT | DEPTH (m)        | SAMPLE       |              |              |                     | <div> <div> <div>■ GASTECH (ppm)</div> <div>□ GASTECH (% LEL)</div> </div> <div> <div>▲ PID (ppm)</div> <div>△ PID (% LEL)</div> </div> </div> |     |     |     | PIEZOMETER<br>CONSTRUCTION | ELEVATION (m) |
|-----------------------------------------------------------------------------------------------|-------------|------------------|--------------|--------------|--------------|---------------------|------------------------------------------------------------------------------------------------------------------------------------------------|-----|-----|-----|----------------------------|---------------|
|                                                                                               |             |                  | TYPE AND NO. | RECOVERY (%) | N, Nc OR RQD | ANALYTICAL<br>TESTS | 50                                                                                                                                             | 100 | 150 | 200 |                            |               |
|                                                                                               |             |                  |              |              |              |                     | 20                                                                                                                                             | 40  | 60  | 80  |                            |               |
| GROUND SURFACE                                                                                |             | 0                | G 1          |              |              |                     |                                                                                                                                                |     |     |     |                            | 74            |
| FILL: Compact, brown silty sand, some crushed stone and gravel, trace clay and topsoil        |             | 0.80m [ 73.50m ] | G 2          |              |              |                     |                                                                                                                                                |     |     |     |                            | 73            |
| FILL: Dense, brown silty sand, with crushed stone, gravel and cobbles, some trash and topsoil |             | 2                | G 3          |              |              |                     |                                                                                                                                                |     |     |     |                            | 72            |
| GLACIAL TILL: Compact, grey silty clay, some gravel and cobbles                               |             | 2.30m [ 72.00m ] | G 4          |              |              |                     |                                                                                                                                                |     |     |     |                            | 71            |
| End of Test Pit                                                                               |             | 2.50m [ 71.80m ] |              |              |              |                     |                                                                                                                                                |     |     |     |                            | 70            |
| Groundwater infiltration was observed at 1.05 m depth                                         |             | 3                |              |              |              |                     |                                                                                                                                                |     |     |     |                            | 69            |
|                                                                                               |             | 4                |              |              |              |                     |                                                                                                                                                |     |     |     |                            | 68            |
|                                                                                               |             | 5                |              |              |              |                     |                                                                                                                                                |     |     |     |                            | 67            |
|                                                                                               |             | 6                |              |              |              |                     |                                                                                                                                                |     |     |     |                            | 66            |
|                                                                                               |             | 7                |              |              |              |                     |                                                                                                                                                |     |     |     |                            |               |
|                                                                                               |             | 8                |              |              |              |                     |                                                                                                                                                |     |     |     |                            |               |
|                                                                                               |             | 9                |              |              |              |                     |                                                                                                                                                |     |     |     |                            |               |

DISCLAIMER: THE DATA PRESENTED IN THIS LOG IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHO IT WAS PRODUCED. THIS LOG SHOULD BE READ IN CONJUNCTION WITH ITS COORESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.

**COORD. SYS.:** MTM ZONE 9      **EASTING:** 370517.04      **NORTHING:** 5029185.02      **ELEVATION:** 74.66

**PROJECT:** Proposed Residential Development

**FILE NO. :** PG7401

**BORINGS BY:** Backhoe

**REMARKS:**
**DATE:** December 20, 2024

**HOLE NO. :** TP 3-24

| SAMPLE DESCRIPTION                                                                   | STRATA PLOT | DEPTH (m)        | SAMPLE       |              |              |                     | <div> <div> <div>■</div> <div> GASTECH (ppm)<br/> GASTECH (% LEL) </div> </div> <div> <div>▲</div> <div> PID (ppm)<br/> PID (% LEL) </div> </div> </div> |     |     |     | PIEZOMETER<br>CONSTRUCTION | ELEVATION (m) |
|--------------------------------------------------------------------------------------|-------------|------------------|--------------|--------------|--------------|---------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------|-----|-----|-----|----------------------------|---------------|
|                                                                                      |             |                  | TYPE AND NO. | RECOVERY (%) | N, Nc OR RQD | ANALYTICAL<br>TESTS | 50                                                                                                                                                       | 100 | 150 | 200 |                            |               |
|                                                                                      |             |                  |              |              |              |                     | 20                                                                                                                                                       | 40  | 60  | 80  |                            |               |
| GROUND SURFACE                                                                       |             | 0                |              |              |              |                     |                                                                                                                                                          |     |     |     |                            |               |
| FILL: Compact, brown silty sand, some gravel and cobbles, trace concrete and topsoil |             | 0.90m [ 73.75m ] | G 1          |              |              |                     |                                                                                                                                                          |     |     |     |                            | 74            |
| Compact to loose, brown <b>SILTY SAND</b> , trace gravel and cobbles to 1.50 m depth |             | 1                | G 2          |              |              |                     |                                                                                                                                                          |     |     |     |                            | 73            |
|                                                                                      |             | 2                | G 3          |              |              |                     |                                                                                                                                                          |     |     |     |                            | 72            |
|                                                                                      |             | 3                | G 4          |              |              |                     |                                                                                                                                                          |     |     |     |                            | 71            |
| 3.10m [ 71.56m ]                                                                     |             | 3                | G 5          |              |              |                     |                                                                                                                                                          |     |     |     |                            | 70            |
| End of Test Pit                                                                      |             | 4                |              |              |              |                     |                                                                                                                                                          |     |     |     |                            | 69            |
| Groundwater infiltration was observed at 2.80 m depth                                |             | 5                |              |              |              |                     |                                                                                                                                                          |     |     |     |                            | 68            |
|                                                                                      |             | 6                |              |              |              |                     |                                                                                                                                                          |     |     |     |                            | 67            |
|                                                                                      |             | 7                |              |              |              |                     |                                                                                                                                                          |     |     |     |                            | 66            |
|                                                                                      |             | 8                |              |              |              |                     |                                                                                                                                                          |     |     |     |                            |               |
|                                                                                      |             | 9                |              |              |              |                     |                                                                                                                                                          |     |     |     |                            |               |

DISCLAIMER: THE DATA PRESENTED IN THIS LOG IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHO IT WAS PRODUCED. THIS LOG SHOULD BE READ IN CONJUNCTION WITH ITS COORESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.

**COORD. SYS.:** MTM ZONE 9      **EASTING:** 370473.15      **NORTHING:** 5029261.10      **ELEVATION:** 73.25

**PROJECT:** Proposed Residential Development

**FILE NO. :** PG7401

**BORINGS BY:** Backhoe

**REMARKS:**
**DATE:** December 20, 2024

**HOLE NO. :** TP 4-24

| SAMPLE DESCRIPTION                                                                                                     | STRATA PLOT                                                                       | DEPTH (m) | SAMPLE       |              |              |                     | <div> <div> <div>■</div> <div>▲</div> </div> <div> <div>□</div> <div>△</div> </div> </div> <div> <div>GASTECH (ppm)</div> <div>GASTECH (% LEL)</div> <div>PID (ppm)</div> <div>PID (% LEL)</div> </div> |     |     |     | PIEZOMETER<br>CONSTRUCTION | ELEVATION (m) |
|------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------|-----------|--------------|--------------|--------------|---------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----|-----|-----|----------------------------|---------------|
|                                                                                                                        |                                                                                   |           | TYPE AND NO. | RECOVERY (%) | N, Nc OR RQD | ANALYTICAL<br>TESTS | 50                                                                                                                                                                                                      | 100 | 150 | 200 |                            |               |
|                                                                                                                        |                                                                                   |           |              |              |              |                     | 20                                                                                                                                                                                                      | 40  | 60  | 80  |                            |               |
| GROUND SURFACE                                                                                                         |                                                                                   | 0         | G 1          |              |              |                     |                                                                                                                                                                                                         |     |     |     |                            | 73            |
| FILL: Loose to compact, brown silty sand, some gravel and cobbles, metal, crushed stone, topsoil, asphalt, trace brick |  |           | G 2          |              |              |                     |                                                                                                                                                                                                         |     |     |     |                            | 72            |
|                                                                                                                        |                                                                                   | 1         |              |              |              |                     |                                                                                                                                                                                                         |     |     |     |                            |               |
|                                                                                                                        |                                                                                   |           | G 3          |              |              |                     |                                                                                                                                                                                                         |     |     |     |                            | 71            |
|                                                                                                                        |                                                                                   | 2         |              |              |              |                     |                                                                                                                                                                                                         |     |     |     |                            |               |
|                                                                                                                        |                                                                                   |           | G 4          |              |              |                     |                                                                                                                                                                                                         |     |     |     |                            | 71            |
| 2.60m [ 70.65m ]                                                                                                       |                                                                                   |           |              |              |              |                     |                                                                                                                                                                                                         |     |     |     |                            |               |
| End of Test Pit                                                                                                        |                                                                                   | 3         |              |              |              |                     |                                                                                                                                                                                                         |     |     |     |                            | 70            |
| Groundwater Infiltration was observed at 2.10 m depth                                                                  |                                                                                   | 4         |              |              |              |                     |                                                                                                                                                                                                         |     |     |     |                            | 69            |
|                                                                                                                        |                                                                                   | 5         |              |              |              |                     |                                                                                                                                                                                                         |     |     |     |                            | 68            |
|                                                                                                                        |                                                                                   | 6         |              |              |              |                     |                                                                                                                                                                                                         |     |     |     |                            | 67            |
|                                                                                                                        |                                                                                   | 7         |              |              |              |                     |                                                                                                                                                                                                         |     |     |     |                            | 66            |
|                                                                                                                        |                                                                                   | 8         |              |              |              |                     |                                                                                                                                                                                                         |     |     |     |                            | 65            |
|                                                                                                                        |                                                                                   | 9         |              |              |              |                     |                                                                                                                                                                                                         |     |     |     |                            |               |
|                                                                                                                        |                                                                                   |           |              |              |              |                     |                                                                                                                                                                                                         |     |     |     |                            |               |

DISCLAIMER: THE DATA PRESENTED IN THIS LOG IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHO IT WAS PRODUCED. THIS LOG SHOULD BE READ IN CONJUNCTION WITH ITS COORESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.

## SYMBOLS AND TERMS

### SOIL DESCRIPTION

Behavioural properties, such as structure and strength, take precedence over particle gradation in describing soils. Terminology describing soil structure are as follows:

|                  |   |                                                                                                                            |
|------------------|---|----------------------------------------------------------------------------------------------------------------------------|
| Desiccated       | - | having visible signs of weathering by oxidation of clay minerals, shrinkage cracks, etc.                                   |
| Fissured         | - | having cracks, and hence a blocky structure.                                                                               |
| Varved           | - | composed of regular alternating layers of silt and clay.                                                                   |
| Stratified       | - | composed of alternating layers of different soil types, e.g. silt and sand or silt and clay.                               |
| Well-Graded      | - | Having wide range in grain sizes and substantial amounts of all intermediate particle sizes (see Grain Size Distribution). |
| Uniformly-Graded | - | Predominantly of one grain size (see Grain Size Distribution).                                                             |

The standard terminology to describe the relative strength of cohesionless soils is the compactness condition, usually inferred from the results of the Standard Penetration Test (SPT) 'N' value. The SPT N value is the number of blows of a 63.5 kg hammer, falling 760 mm, required to drive a 51 mm O.D. split spoon sampler 300 mm into the soil after an initial penetration of 150 mm. An SPT N value of "P" denotes that the split-spoon sampler was pushed 300 mm into the soil without the use of a falling hammer.

| Compactness Condition | 'N' Value | Relative Density % |
|-----------------------|-----------|--------------------|
| Very Loose            | <4        | <15                |
| Loose                 | 4-10      | 15-35              |
| Compact               | 10-30     | 35-65              |
| Dense                 | 30-50     | 65-85              |
| Very Dense            | >50       | >85                |

The standard terminology to describe the strength of cohesive soils is the consistency, which is based on the undisturbed undrained shear strength as measured by the in situ or laboratory shear vane tests, unconfined compression tests, or occasionally by the Standard Penetration Test (SPT). Note that the typical correlations of undrained shear strength to SPT N value (tabulated below) tend to underestimate the consistency for sensitive silty clays, so Paterson reviews the applicable split spoon samples in the laboratory to provide a more representative consistency value based on tactile examination.

| Consistency | Undrained Shear Strength (kPa) | 'N' Value |
|-------------|--------------------------------|-----------|
| Very Soft   | <12                            | <2        |
| Soft        | 12-25                          | 2-4       |
| Firm        | 25-50                          | 4-8       |
| Stiff       | 50-100                         | 8-15      |
| Very Stiff  | 100-200                        | 15-30     |
| Hard        | >200                           | >30       |

## SYMBOLS AND TERMS (continued)

### SOIL DESCRIPTION (continued)

Cohesive soils can also be classified according to their “sensitivity”. The sensitivity,  $S_t$ , is the ratio between the undisturbed undrained shear strength and the remoulded undrained shear strength of the soil. The classes of sensitivity may be defined as follows:

|                     |                |
|---------------------|----------------|
| Low Sensitivity:    | $S_t < 2$      |
| Medium Sensitivity: | $2 < S_t < 4$  |
| Sensitive:          | $4 < S_t < 8$  |
| Extra Sensitive:    | $8 < S_t < 16$ |
| Quick Clay:         | $S_t > 16$     |

### ROCK DESCRIPTION

The structural description of the bedrock mass is based on the Rock Quality Designation (RQD).

The RQD classification is based on a modified core recovery percentage in which all pieces of sound core over 100 mm long are counted as recovery. The smaller pieces are considered to be a result of closely-spaced discontinuities (resulting from shearing, jointing, faulting, or weathering) in the rock mass and are not counted. RQD is ideally determined from NQ or larger size core. However, it can be used on smaller core sizes, such as BQ, if the bulk of the fractures caused by drilling stresses (called “mechanical breaks”) are easily distinguishable from the normal in situ fractures.

| RQD %  | ROCK QUALITY                                                 |
|--------|--------------------------------------------------------------|
| 90-100 | Excellent, intact, very sound                                |
| 75-90  | Good, massive, moderately jointed or sound                   |
| 50-75  | Fair, blocky and seamy, fractured                            |
| 25-50  | Poor, shattered and very seamy or blocky, severely fractured |
| 0-25   | Very poor, crushed, very severely fractured                  |

### SAMPLE TYPES

|    |   |                                                                                                                                   |
|----|---|-----------------------------------------------------------------------------------------------------------------------------------|
| SS | - | Split spoon sample (obtained in conjunction with the performing of the Standard Penetration Test (SPT))                           |
| TW | - | Thin wall tube or Shelby tube, generally recovered using a piston sampler                                                         |
| G  | - | "Grab" sample from test pit or surface materials                                                                                  |
| AU | - | Auger sample or bulk sample                                                                                                       |
| WS | - | Wash sample                                                                                                                       |
| RC | - | Rock core sample (Core bit size BQ, NQ, HQ, etc.). Rock core samples are obtained with the use of standard diamond drilling bits. |

## SYMBOLS AND TERMS (continued)

### PLASTICITY LIMITS AND GRAIN SIZE DISTRIBUTION

|                 |   |                                                                                                                                                 |
|-----------------|---|-------------------------------------------------------------------------------------------------------------------------------------------------|
| WC%             | - | Natural water content or water content of sample, %                                                                                             |
| LL              | - | Liquid Limit, % (water content above which soil behaves as a liquid)                                                                            |
| PL              | - | Plastic Limit, % (water content above which soil behaves plastically)                                                                           |
| PI              | - | Plasticity Index, % (difference between LL and PL)                                                                                              |
| D <sub>xx</sub> | - | Grain size at which xx% of the soil, by weight, is of finer grain sizes<br>These grain size descriptions are not used below 0.075 mm grain size |
| D <sub>10</sub> | - | Grain size at which 10% of the soil is finer (effective grain size)                                                                             |
| D <sub>60</sub> | - | Grain size at which 60% of the soil is finer                                                                                                    |
| C <sub>c</sub>  | - | Concavity coefficient = $(D_{30})^2 / (D_{10} \times D_{60})$                                                                                   |
| C <sub>u</sub>  | - | Uniformity coefficient = $D_{60} / D_{10}$                                                                                                      |

C<sub>c</sub> and C<sub>u</sub> are used to assess the grading of sands and gravels:

Well-graded gravels have:  $1 < C_c < 3$  and  $C_u > 4$

Well-graded sands have:  $1 < C_c < 3$  and  $C_u > 6$

Sands and gravels not meeting the above requirements are poorly-graded or uniformly-graded.

C<sub>c</sub> and C<sub>u</sub> are not applicable for the description of soils with more than 10% silt and clay  
(more than 10% finer than 0.075 mm or the #200 sieve)

### CONSOLIDATION TEST


|                 |   |                                                                     |
|-----------------|---|---------------------------------------------------------------------|
| p' <sub>o</sub> | - | Present effective overburden pressure at sample depth               |
| p' <sub>c</sub> | - | Preconsolidation pressure of (maximum past pressure on) sample      |
| C <sub>cr</sub> | - | Recompression index (in effect at pressures below p' <sub>c</sub> ) |
| C <sub>c</sub>  | - | Compression index (in effect at pressures above p' <sub>c</sub> )   |
| OC Ratio        |   | Overconsolidation ratio = $p'_c / p'_o$                             |
| Void Ratio      |   | Initial sample void ratio = volume of voids / volume of solids      |
| W <sub>o</sub>  | - | Initial water content (at start of consolidation test)              |

### PERMEABILITY TEST

|   |   |                                                                                                                                                                                                                                                                                                                    |
|---|---|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| k | - | Coefficient of permeability or hydraulic conductivity is a measure of the ability of water to flow through the sample. The value of k is measured at a specified unit weight for (remoulded) cohesionless soil samples, because its value will vary with the unit weight or density of the sample during the test. |
|---|---|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|

## SYMBOLS AND TERMS (continued)


### STRATA PLOT

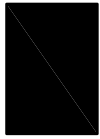


Topsoil




Asphalt

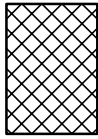


Fill

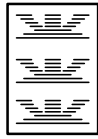


Peat

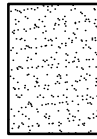


Sand

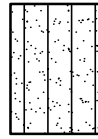


Silty Sand

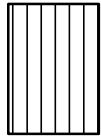


Silt

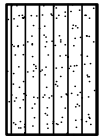


Sandy Silt

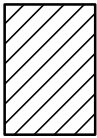


Clay

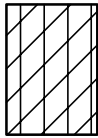


Silty Clay

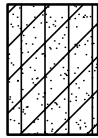


Clayey Silty Sand

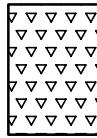

Glacial Till

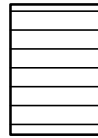


Shale

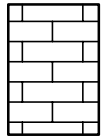


Bedrock

### MONITORING WELL AND PIEZOMETER CONSTRUCTION

#### MONITORING WELL CONSTRUCTION

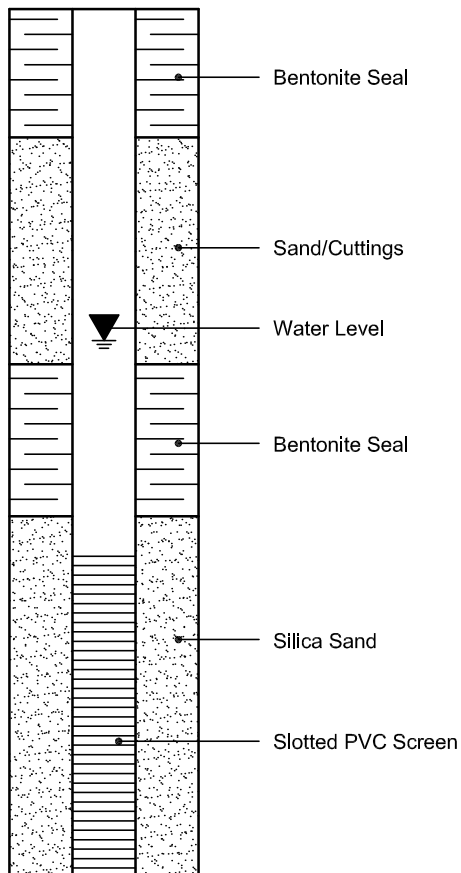

#### PIEZOMETER CONSTRUCTION

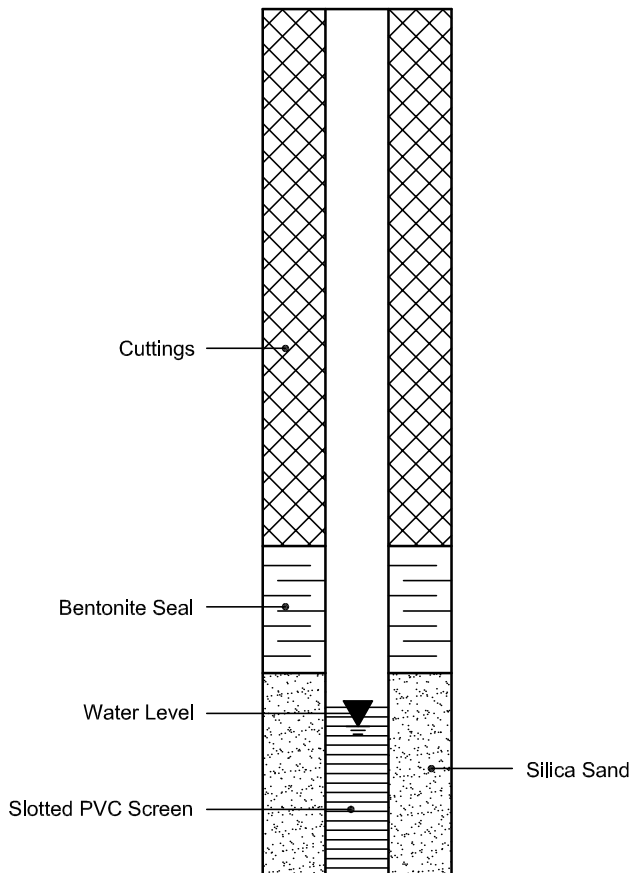


PROJECT NAME: GEOTECHNICAL &amp; HYDROGEOLOGICAL INVESTIGATIONS

LOCATION: 1867 Alta Vista Drive, Ottawa, ON

DRILLING METHOD: Truck, Soil Stem

DRILLING DATE: 19 September, 2022

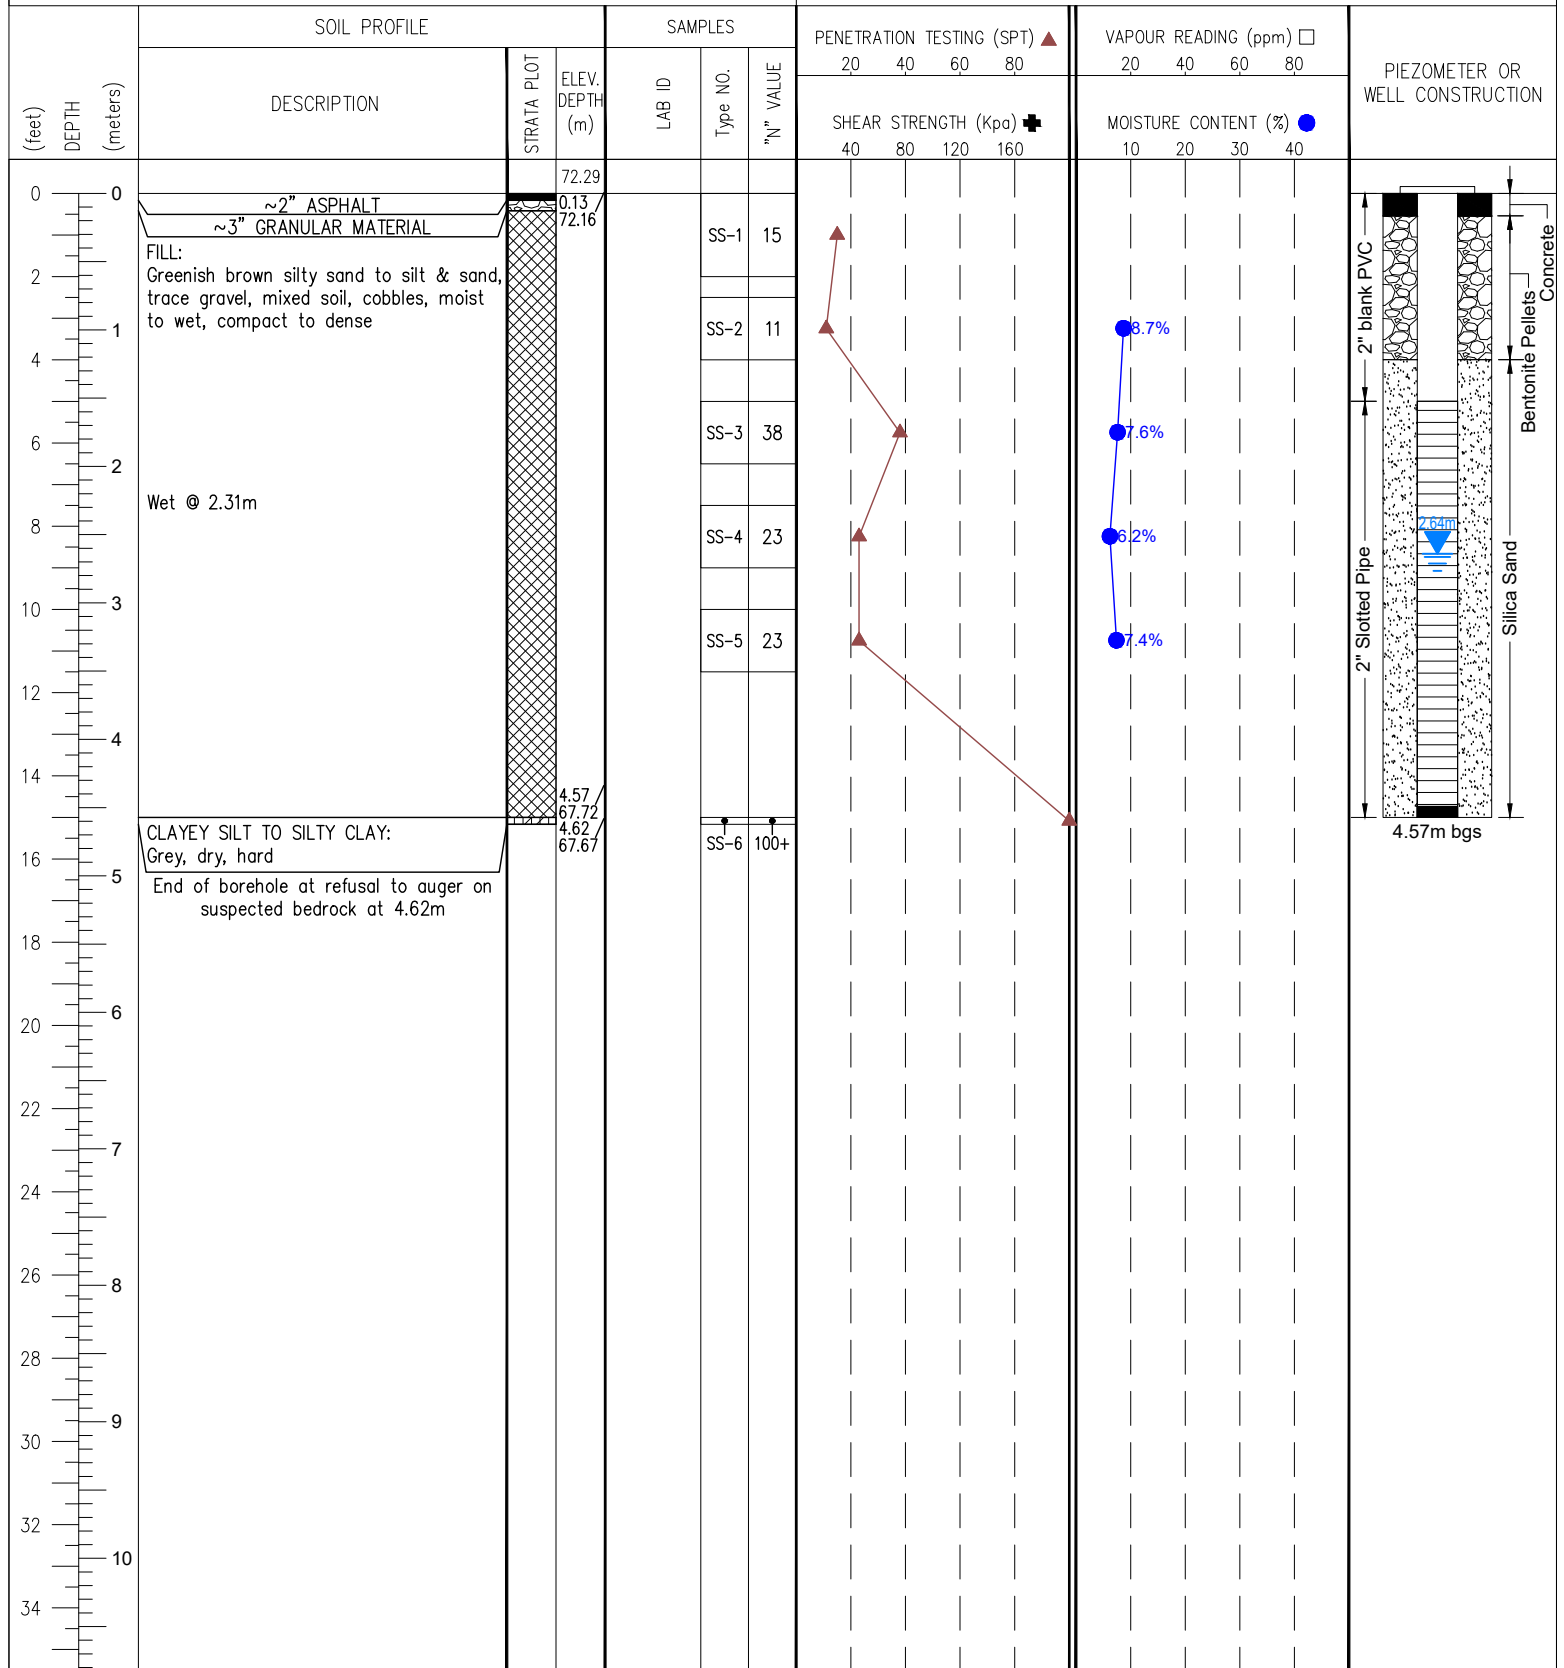

Groundwater Depth (m): on completion: 3.66m; on 7 October, 2022: 2.64m

DRAWN: D.C.

LOGGED: J.Y.

CHECKED: C.W.

PROJECT NAME: GEOTECHNICAL &amp; HYDROGEOLOGICAL INVESTIGATIONS

LOCATION: 1867 Alta Vista Drive, Ottawa, ON

DRILLING METHOD: Truck, Solid Stem

DRILLING DATE: 20 September, 2022

| (feet)<br>DEPTH<br>(meters) | SOIL PROFILE |                                                                               |                       | SAMPLES |          |           | PENETRATION TESTING (SPT) ▲ |  |  |  | VAPOUR READING (ppm) □ |  |  |  | PIEZOMETER OR<br>WELL CONSTRUCTION |
|-----------------------------|--------------|-------------------------------------------------------------------------------|-----------------------|---------|----------|-----------|-----------------------------|--|--|--|------------------------|--|--|--|------------------------------------|
|                             | DESCRIPTION  | STRATA PLOT                                                                   | ELEV.<br>DEPTH<br>(m) | LAB ID  | Type NO. | "N" VALUE | 20 40 60 80                 |  |  |  | 20 40 60 80            |  |  |  |                                    |
|                             |              |                                                                               |                       |         |          |           | SHEAR STRENGTH (Kpa) ➕      |  |  |  | MOISTURE CONTENT (%) ● |  |  |  |                                    |
| 0                           | 0            |                                                                               | 72.86                 |         |          |           |                             |  |  |  |                        |  |  |  |                                    |
|                             |              | ~3" TOPSOIL                                                                   |                       |         |          |           |                             |  |  |  |                        |  |  |  |                                    |
|                             |              | FILL:<br>Brown sand, some silt, trace clay &<br>gravel, moist, loose to dense |                       |         | SS-1     | 6         |                             |  |  |  |                        |  |  |  |                                    |
| 2                           |              |                                                                               |                       |         | SS-2     | 7         |                             |  |  |  |                        |  |  |  |                                    |
| 4                           | 1            |                                                                               |                       |         |          |           |                             |  |  |  |                        |  |  |  |                                    |
| 6                           | 2            |                                                                               |                       |         | SS-3     | 8         |                             |  |  |  |                        |  |  |  |                                    |
| 8                           |              |                                                                               |                       |         |          |           |                             |  |  |  |                        |  |  |  |                                    |
| 10                          | 3            |                                                                               |                       |         | SS-4     | 6         |                             |  |  |  |                        |  |  |  |                                    |
|                             |              |                                                                               |                       |         |          |           |                             |  |  |  |                        |  |  |  |                                    |
|                             |              |                                                                               |                       |         | SS-5     | 31        |                             |  |  |  |                        |  |  |  |                                    |
| 12                          |              | BEDROCK:<br>Grey, dry, hard                                                   | 3.51<br>69.35         |         |          |           |                             |  |  |  |                        |  |  |  |                                    |
| 14                          | 4            |                                                                               |                       |         |          |           |                             |  |  |  |                        |  |  |  |                                    |
|                             |              | Auger refusal @ 4.62m                                                         |                       |         |          |           |                             |  |  |  |                        |  |  |  |                                    |
| 16                          | 5            | End of borehole at 4.62m                                                      | 4.62<br>68.24         |         | SS-6     | 100+      |                             |  |  |  |                        |  |  |  |                                    |
| 18                          |              |                                                                               |                       |         |          |           |                             |  |  |  |                        |  |  |  |                                    |
| 20                          | 6            |                                                                               |                       |         |          |           |                             |  |  |  |                        |  |  |  |                                    |
| 22                          |              |                                                                               |                       |         |          |           |                             |  |  |  |                        |  |  |  |                                    |
| 24                          | 7            |                                                                               |                       |         |          |           |                             |  |  |  |                        |  |  |  |                                    |
| 26                          | 8            |                                                                               |                       |         |          |           |                             |  |  |  |                        |  |  |  |                                    |
| 28                          |              |                                                                               |                       |         |          |           |                             |  |  |  |                        |  |  |  |                                    |
| 30                          | 9            |                                                                               |                       |         |          |           |                             |  |  |  |                        |  |  |  |                                    |
| 32                          | 10           |                                                                               |                       |         |          |           |                             |  |  |  |                        |  |  |  |                                    |
| 34                          |              |                                                                               |                       |         |          |           |                             |  |  |  |                        |  |  |  |                                    |

Groundwater Depth (m): on completion: Dry

DRAWN: D.C.

LOGGED: J.Y.


CHECKED: C.W.

PROJECT NAME: GEOTECHNICAL &amp; HYDROGEOLOGICAL INVESTIGATIONS

LOCATION: 1867 Alta Vista Drive, Ottawa, ON

DRILLING METHOD: Truck, Solid Stem

DRILLING DATE: 19 September, 2022

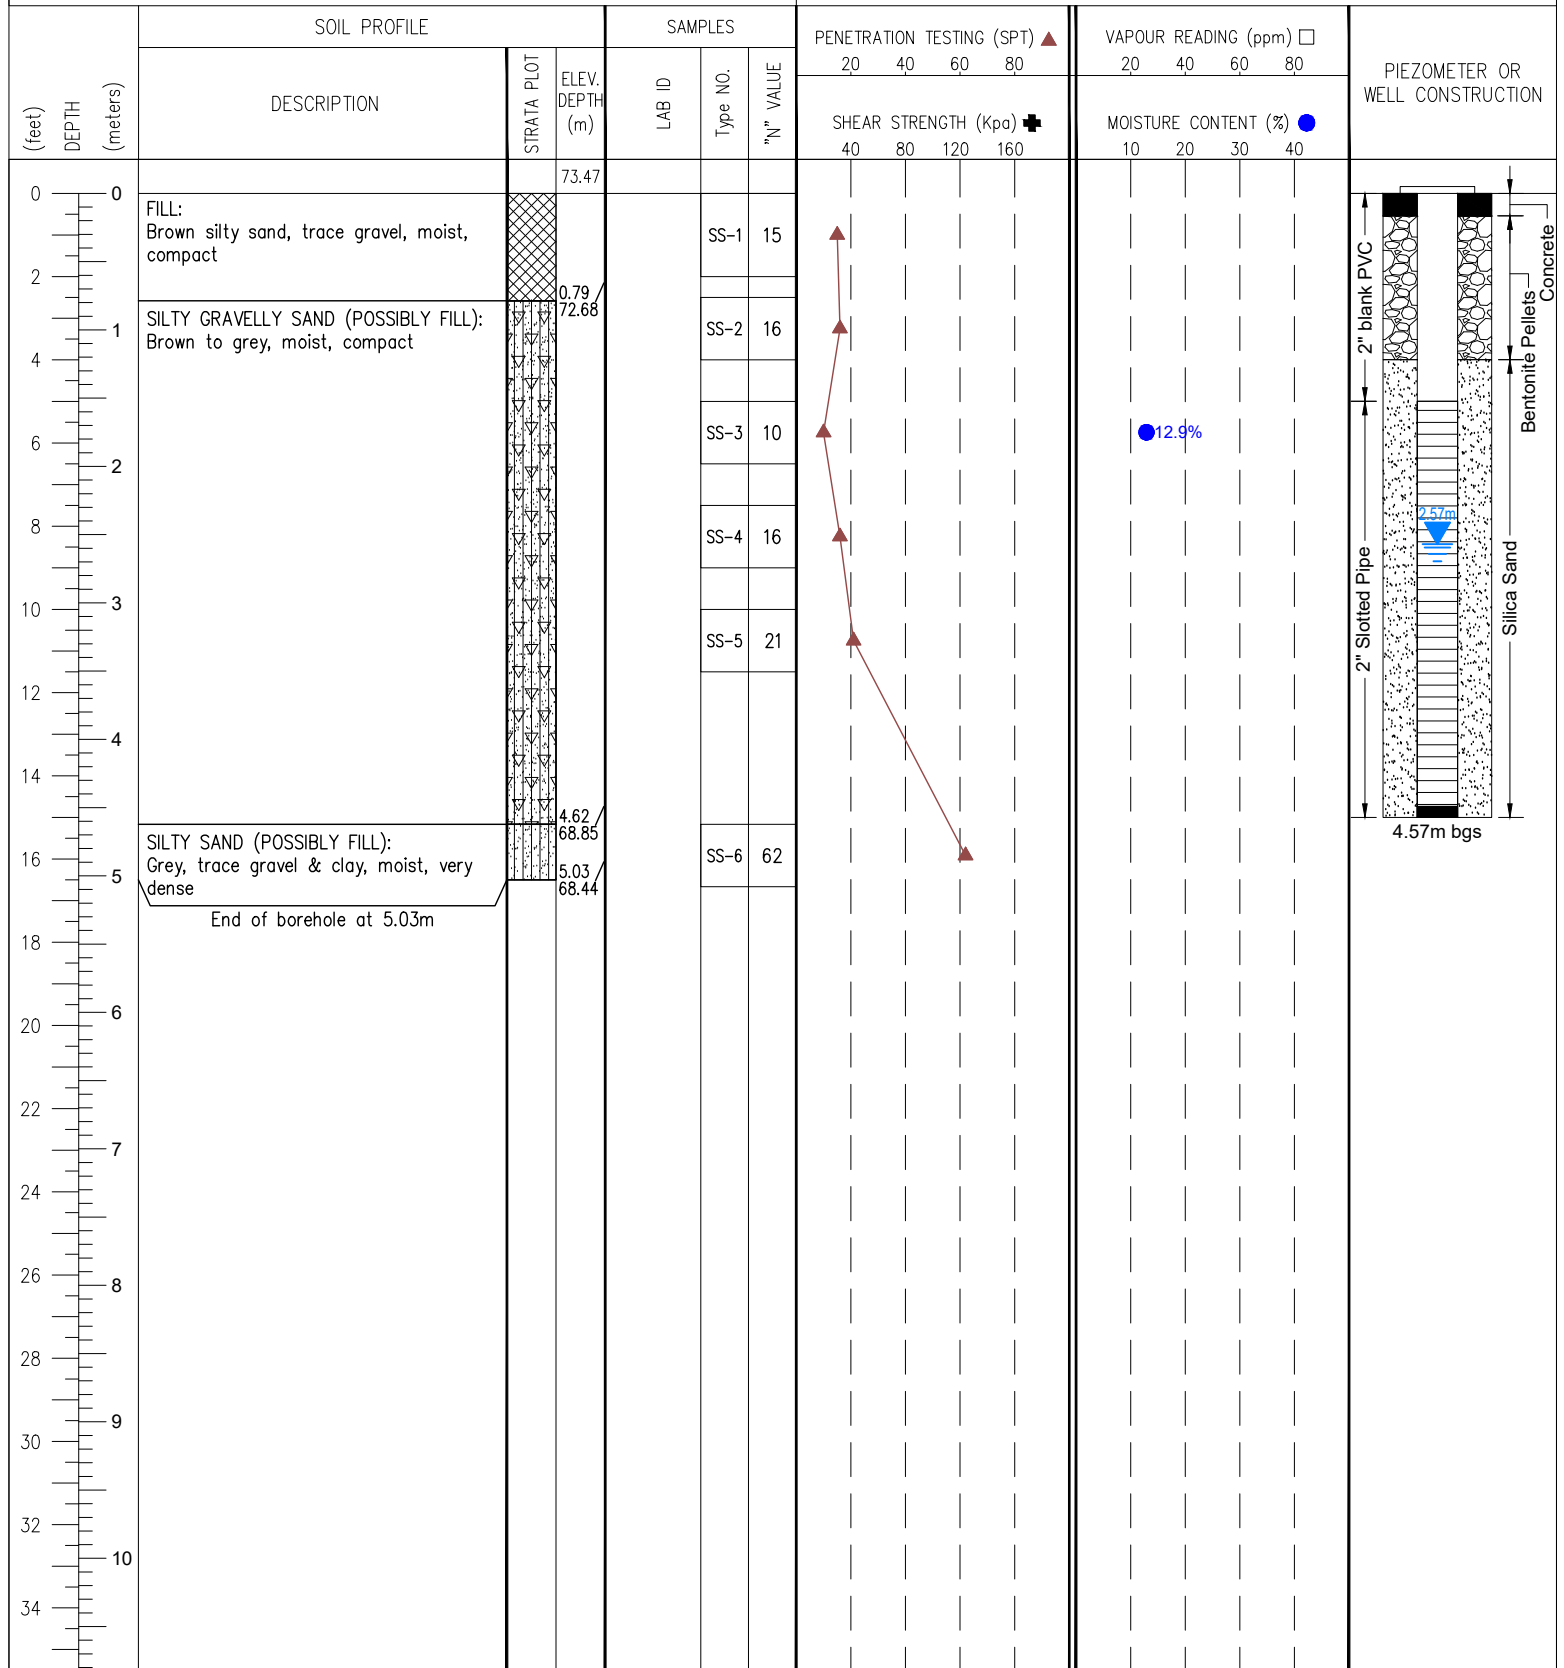


PROJECT NAME: GEOTECHNICAL &amp; HYDROGEOLOGICAL INVESTIGATIONS

LOCATION: 1867 Alta Vista Drive, Ottawa, ON

DRILLING METHOD: Truck, Solid Stem

DRILLING DATE: 19 September, 2022

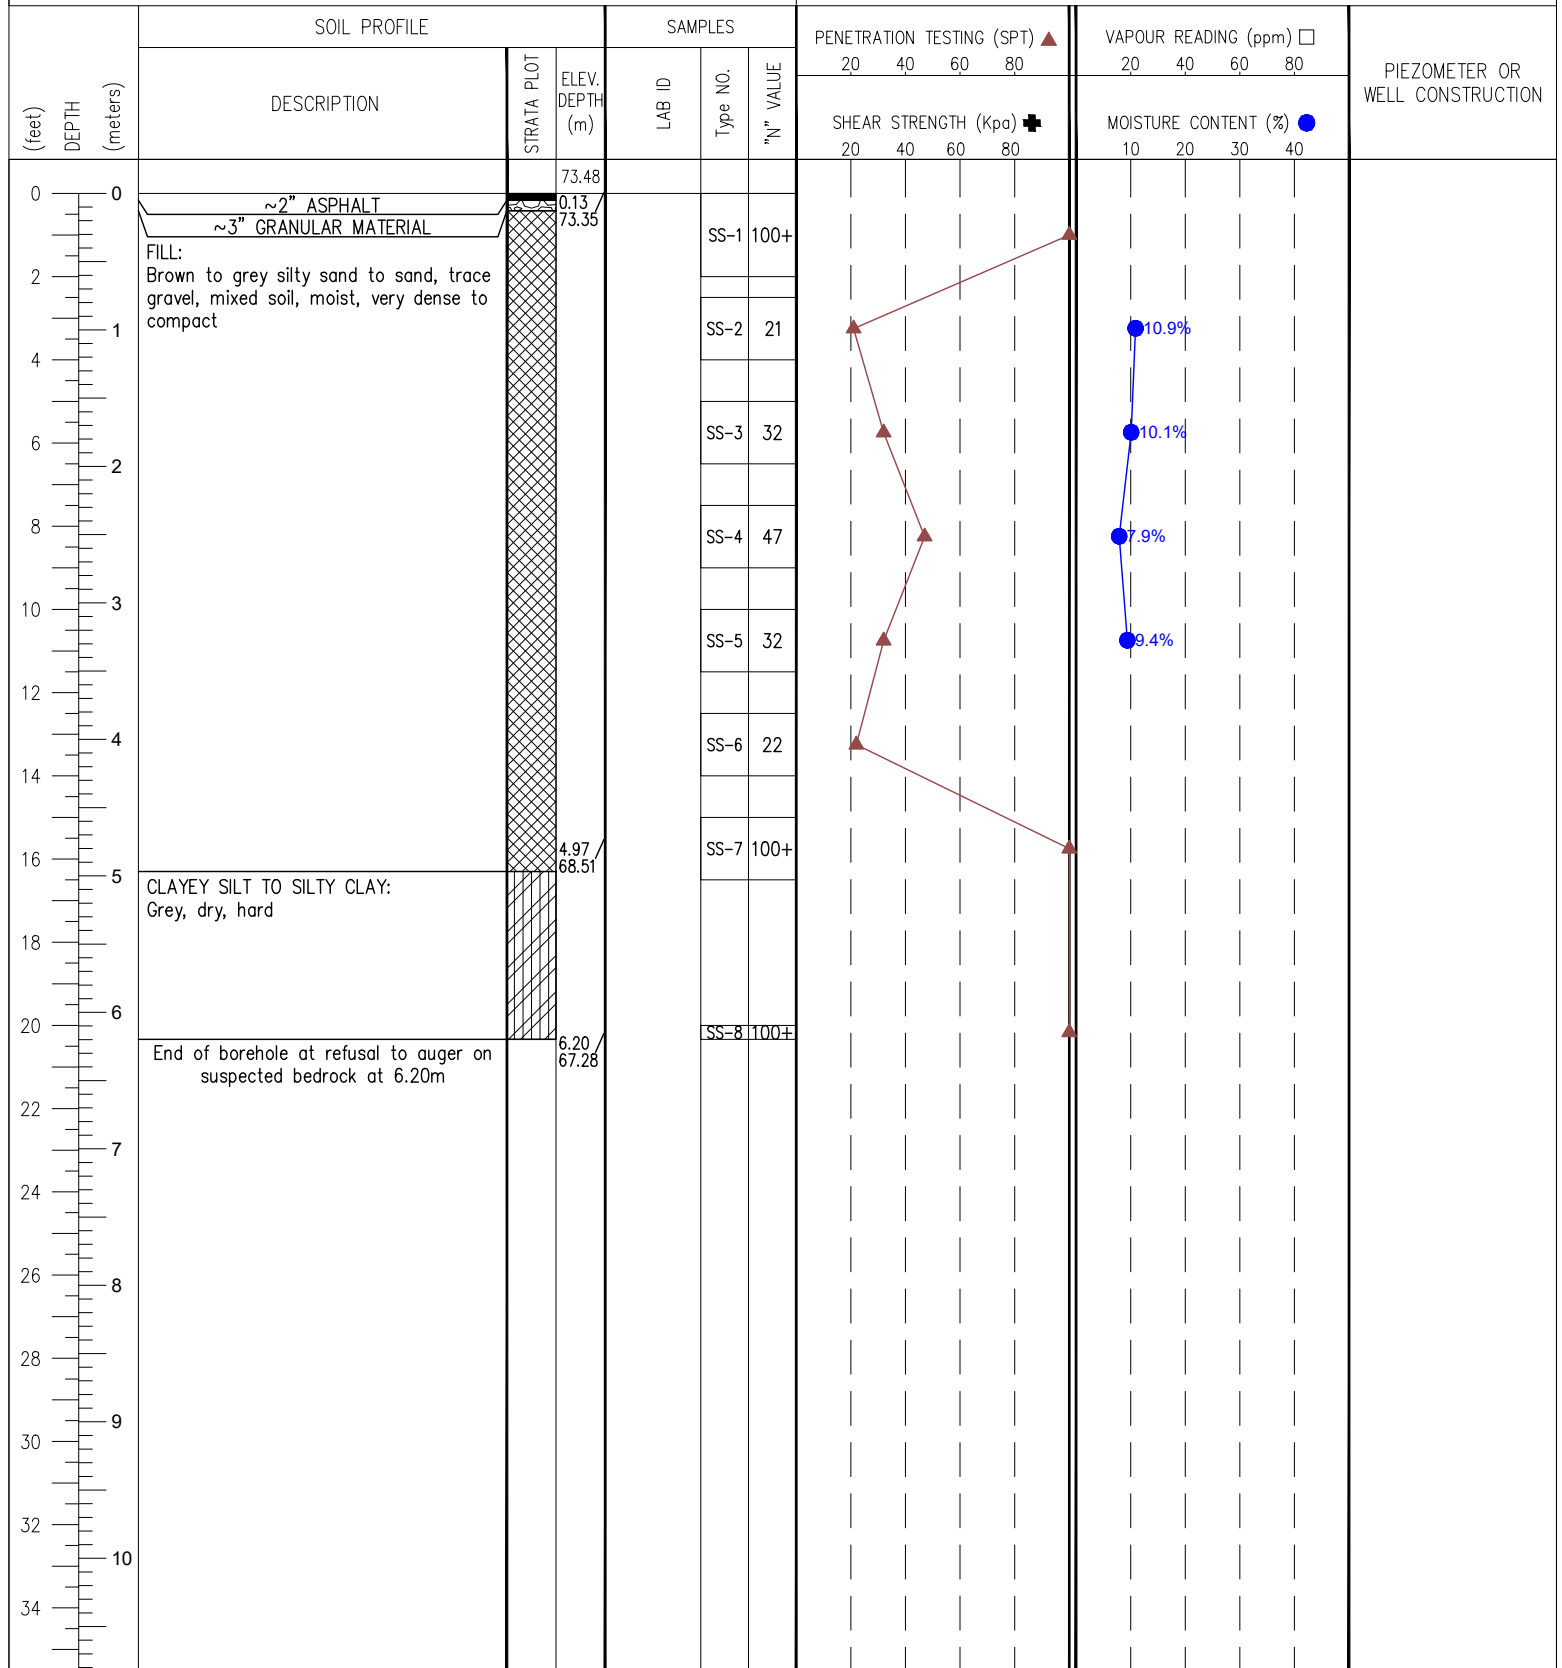

Groundwater Depth (m): on completion: Dry

DRAWN: D.C.

LOGGED: J.Y.


CHECKED: C.W.

PROJECT NAME: GEOTECHNICAL &amp; HYDROGEOLOGICAL INVESTIGATIONS

LOCATION: 1867 Alta Vista Drive, Ottawa, ON

DRILLING METHOD: Truck, Solid Stem

DRILLING DATE: 20 September, 2022

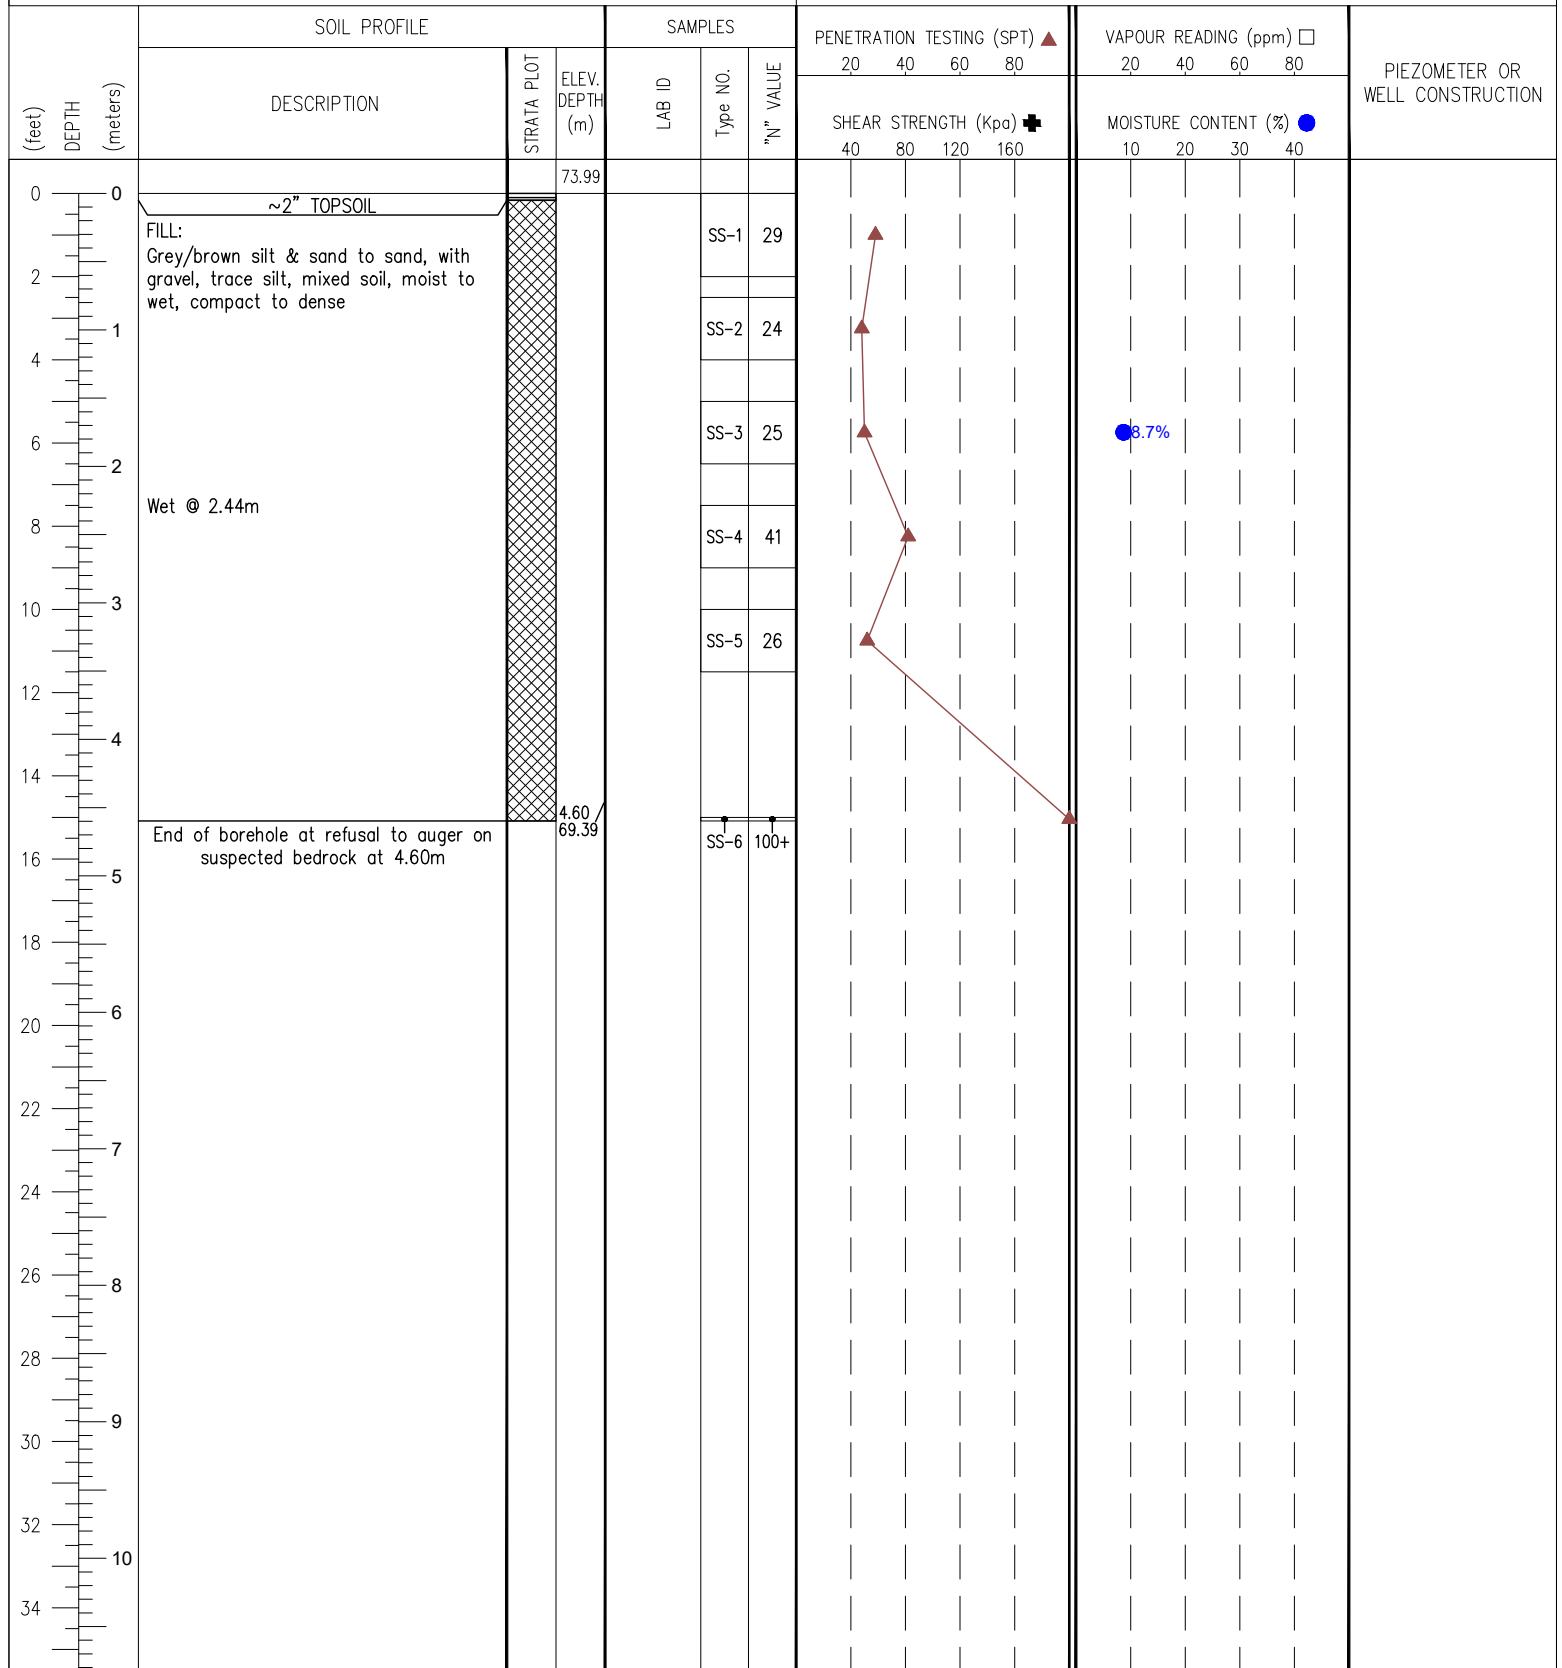

Groundwater Depth (m): on completion: 2.44m

DRAWN: D.C.

LOGGED: J.Y.


CHECKED: C.W.

PROJECT NAME: GEOTECHNICAL &amp; HYDROGEOLOGICAL INVESTIGATIONS

LOCATION: 1867 Alta Vista Drive, Ottawa, ON

DRILLING METHOD: Truck, Solid Stem

DRILLING DATE: 19 September, 2022

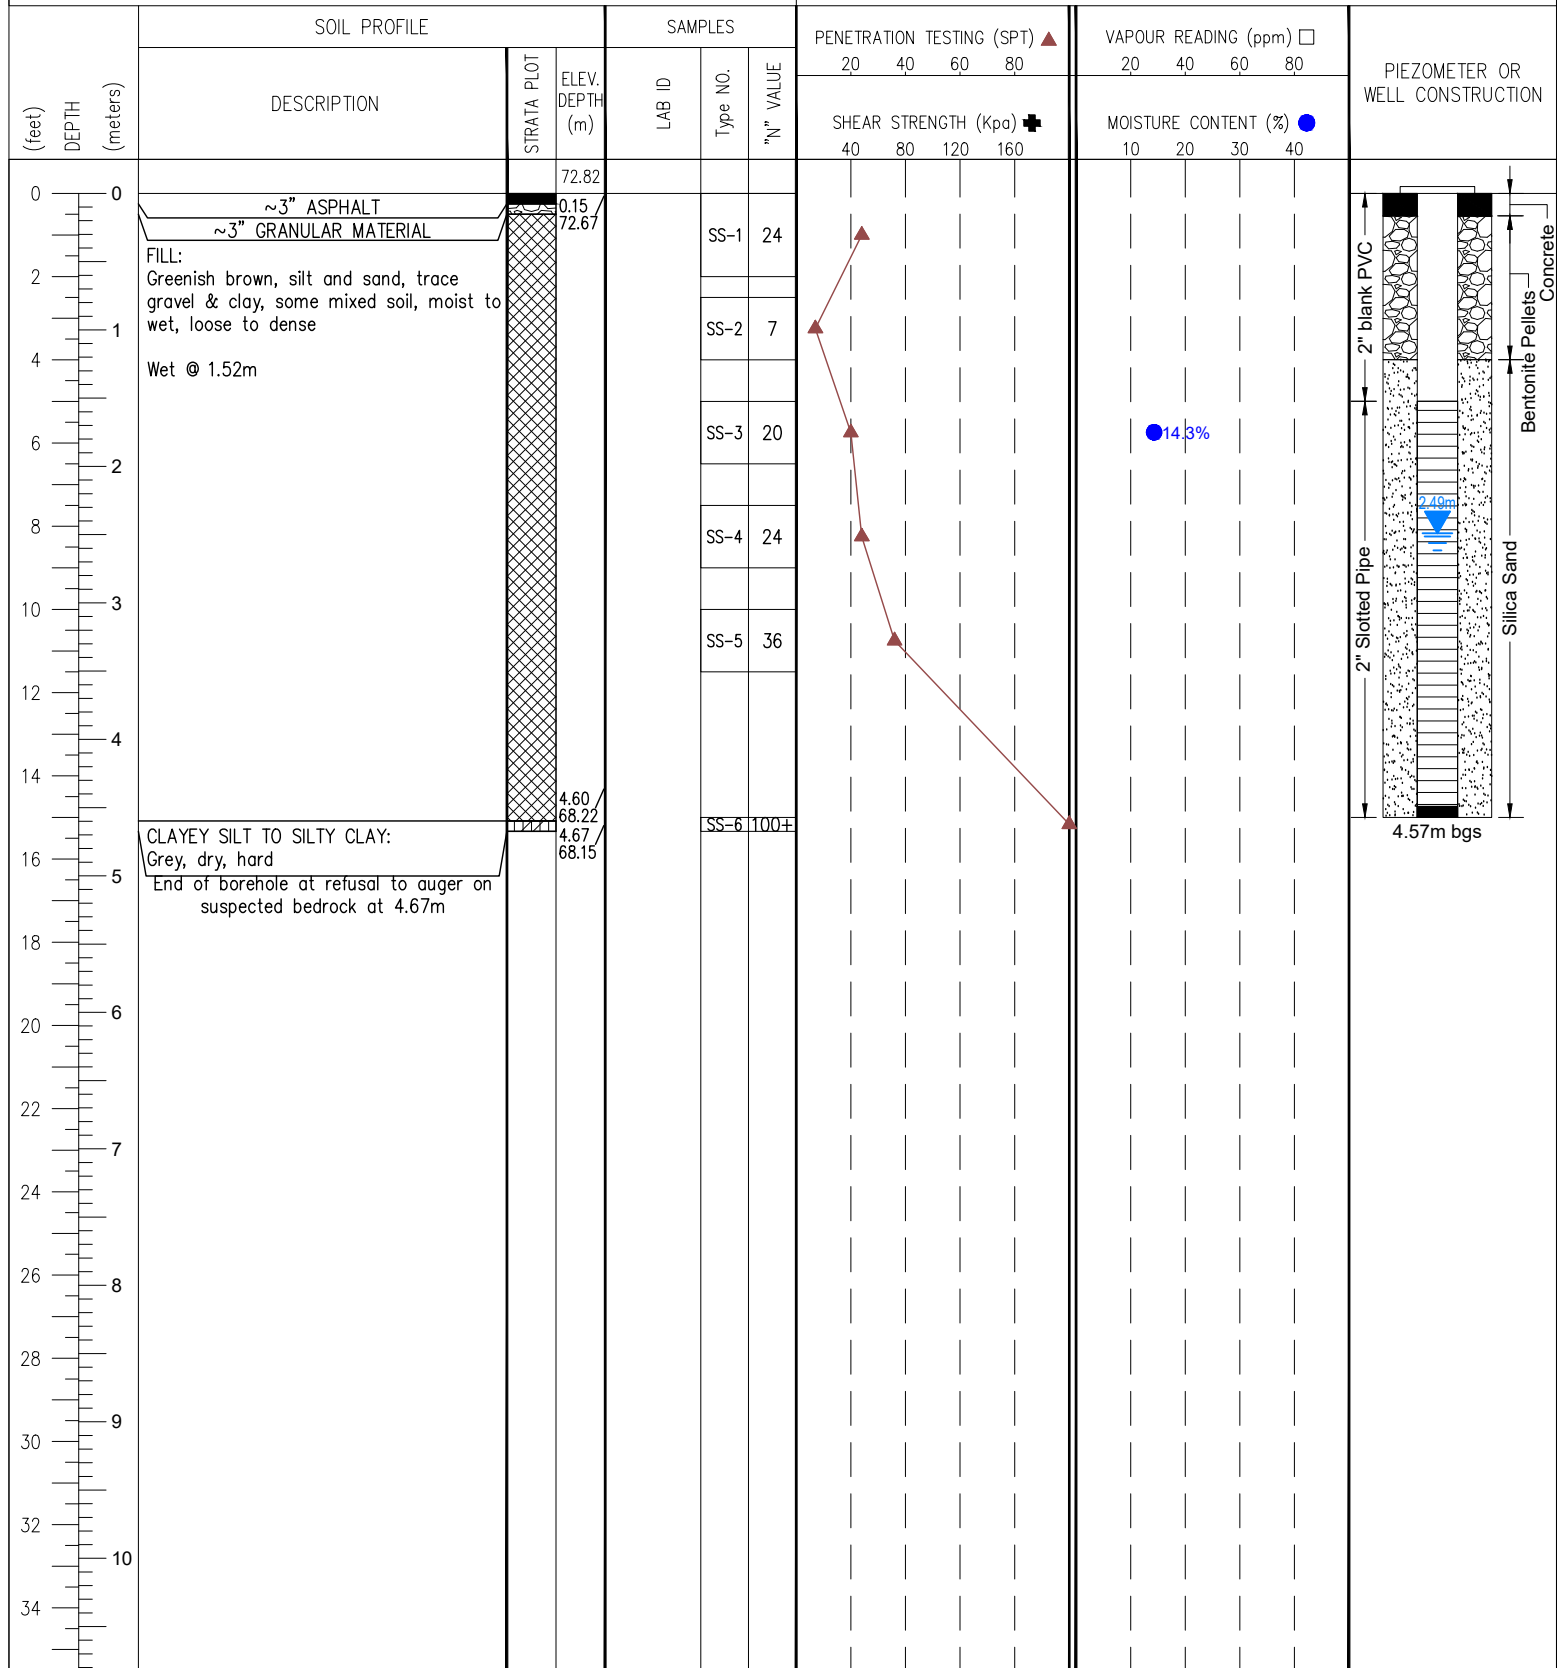

DRAWN: D.C.

LOGGED: J.Y.

CHECKED: C.W.

PROJECT NAME: GEOTECHNICAL &amp; HYDROGEOLOGICAL INVESTIGATIONS

LOCATION: 1867 Alta Vista Drive, Ottawa, ON

DRILLING METHOD: Truck, Solid Stem

DRILLING DATE: 19 September, 2022

| (feet)<br>DEPTH<br>(meters) | SOIL PROFILE                                                                                         |             | SAMPLES |          |           | PENETRATION TESTING (SPT) ▲             | VAPOUR READING (ppm) □                | PIEZOMETER OR<br>WELL CONSTRUCTION |
|-----------------------------|------------------------------------------------------------------------------------------------------|-------------|---------|----------|-----------|-----------------------------------------|---------------------------------------|------------------------------------|
|                             | DESCRIPTION                                                                                          | STRATA PLOT | LAB ID  | Type NO. | "N" VALUE | 20 40 60 80                             | 20 40 60 80                           |                                    |
|                             |                                                                                                      |             |         |          |           | SHEAR STRENGTH (Kpa) ➤<br>40 80 120 160 | MOISTURE CONTENT (%) ●<br>10 20 30 40 |                                    |
| 0                           | ~6" ASPHALT & GRANULAR MATERIAL                                                                      |             |         |          |           |                                         |                                       |                                    |
| 0                           | FILL:<br>Greyish brown silty sand to silt & sand,<br>trace gravel & clay, moist, compact to<br>dense |             |         |          |           |                                         |                                       |                                    |
| 2                           |                                                                                                      |             |         |          |           |                                         |                                       |                                    |
| 1                           |                                                                                                      |             |         |          |           |                                         |                                       |                                    |
| 4                           |                                                                                                      |             |         |          |           |                                         |                                       |                                    |
| 2                           |                                                                                                      |             |         |          |           |                                         |                                       |                                    |
| 6                           |                                                                                                      |             |         |          |           |                                         |                                       |                                    |
| 8                           |                                                                                                      |             |         |          |           |                                         |                                       |                                    |
| 10                          |                                                                                                      |             |         |          |           |                                         |                                       |                                    |
| 12                          |                                                                                                      |             |         |          |           |                                         |                                       |                                    |
| 14                          |                                                                                                      |             |         |          |           |                                         |                                       |                                    |
| 16                          | CLAYEY SILT TO SILTY CLAY:<br>Grey, dry, hard                                                        |             |         |          |           |                                         |                                       |                                    |
| 5                           | End of borehole at refusal to auger on<br>suspected bedrock at 4.62m                                 |             |         |          |           |                                         |                                       |                                    |
| 18                          |                                                                                                      |             |         |          |           |                                         |                                       |                                    |
| 20                          |                                                                                                      |             |         |          |           |                                         |                                       |                                    |
| 22                          |                                                                                                      |             |         |          |           |                                         |                                       |                                    |
| 24                          |                                                                                                      |             |         |          |           |                                         |                                       |                                    |
| 26                          |                                                                                                      |             |         |          |           |                                         |                                       |                                    |
| 28                          |                                                                                                      |             |         |          |           |                                         |                                       |                                    |
| 30                          |                                                                                                      |             |         |          |           |                                         |                                       |                                    |
| 32                          |                                                                                                      |             |         |          |           |                                         |                                       |                                    |
| 34                          |                                                                                                      |             |         |          |           |                                         |                                       |                                    |

Groundwater Depth (m): on completion: Dry

DRAWN: D.C.

LOGGED: J.Y.


CHECKED: C.W.

PROJECT NAME: GEOTECHNICAL &amp; HYDROGEOLOGICAL INVESTIGATIONS

LOCATION: 1867 Alta Vista Drive, Ottawa, ON

DRILLING METHOD: Truck, Solid Stem

DRILLING DATE: 19 September, 2022

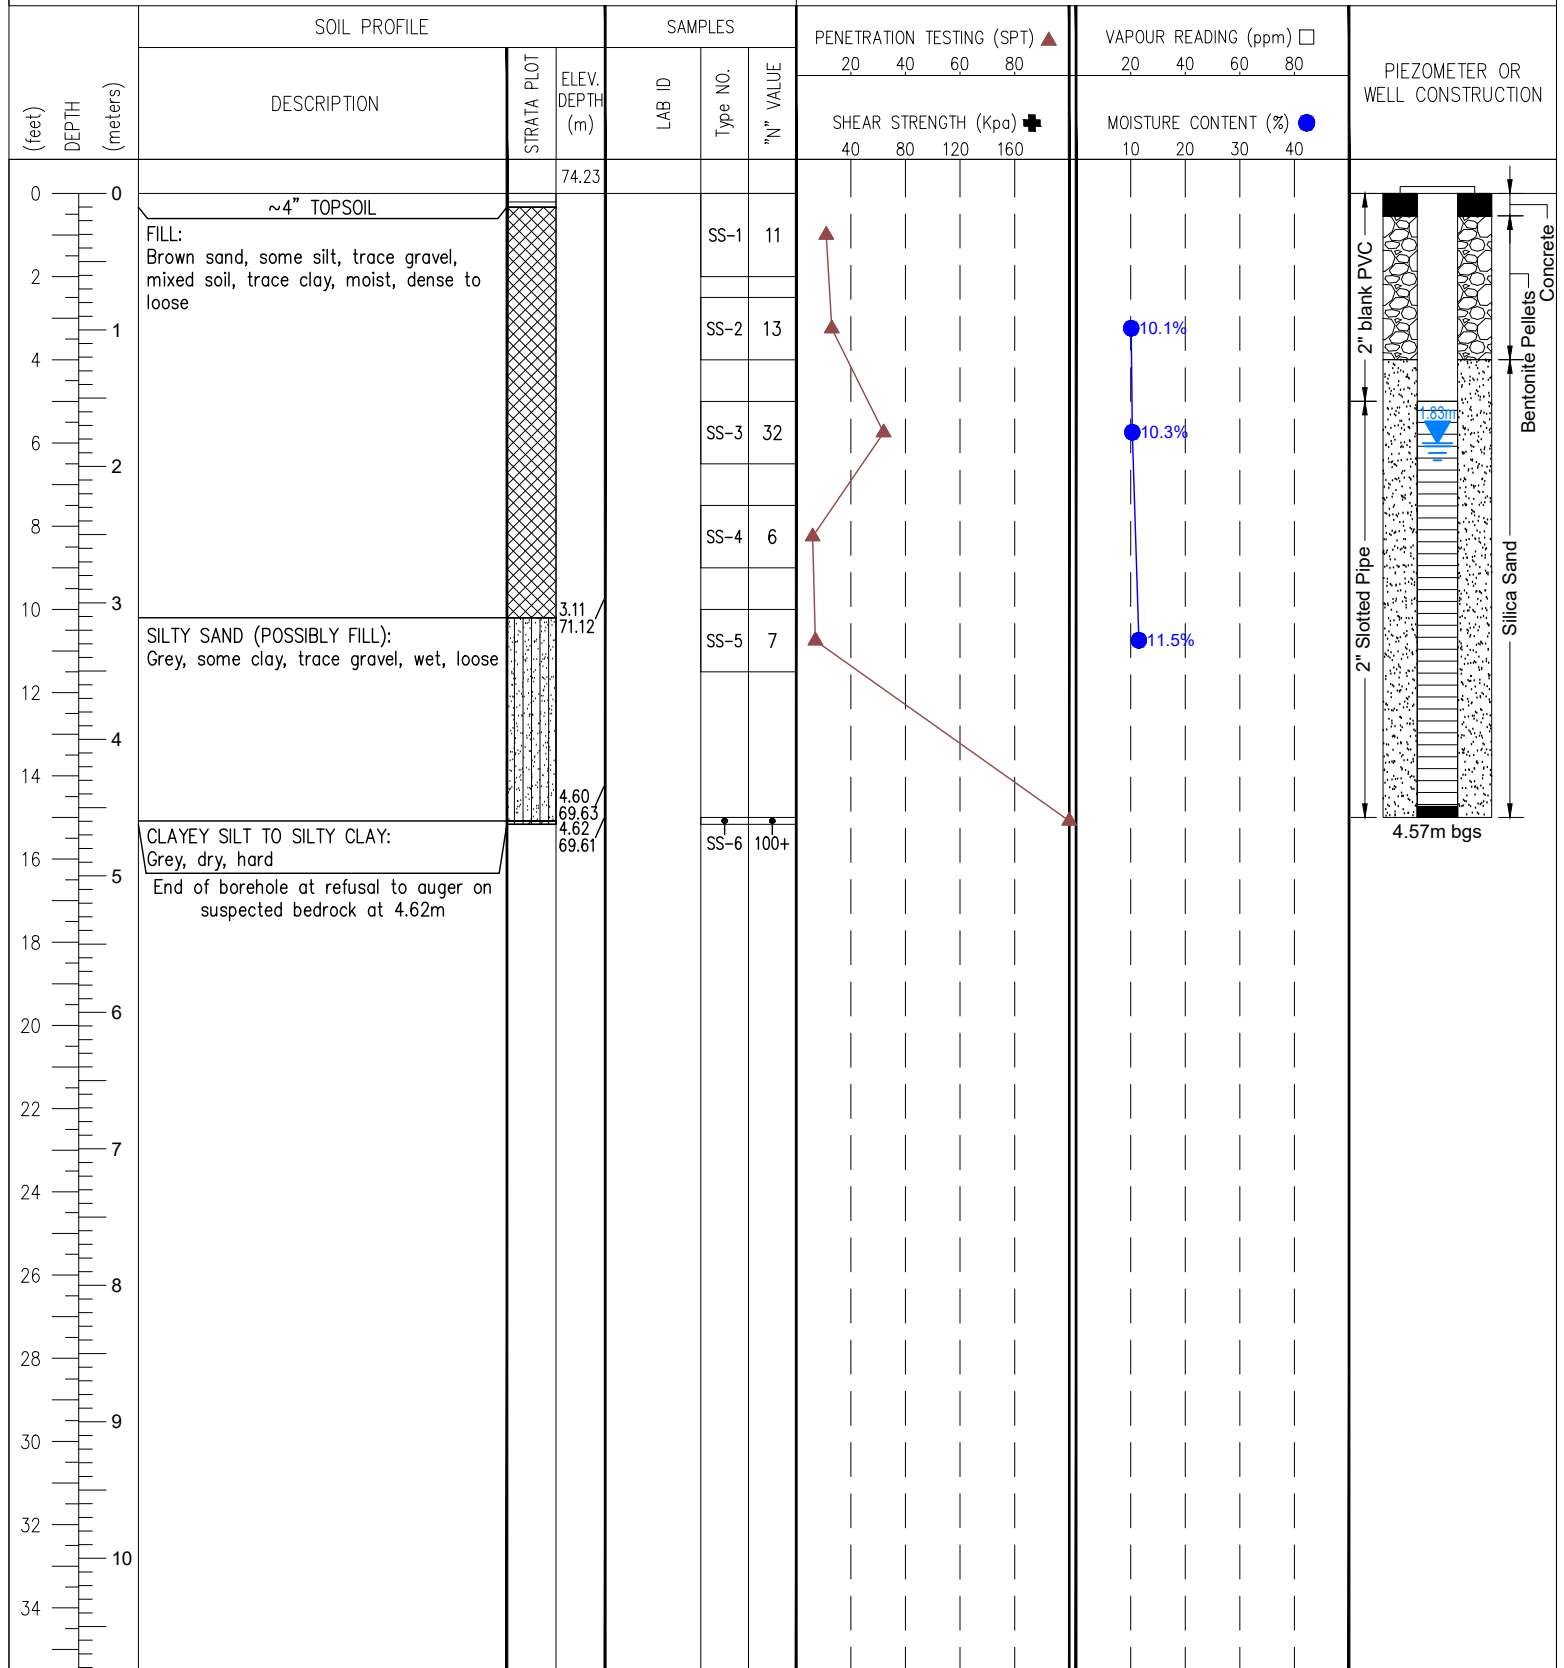

Groundwater Depth (m): on completion: 2.44m; on 7 October, 2022: 1.83m

DRAWN: D.C.

LOGGED: J.Y.

CHECKED: C.W.

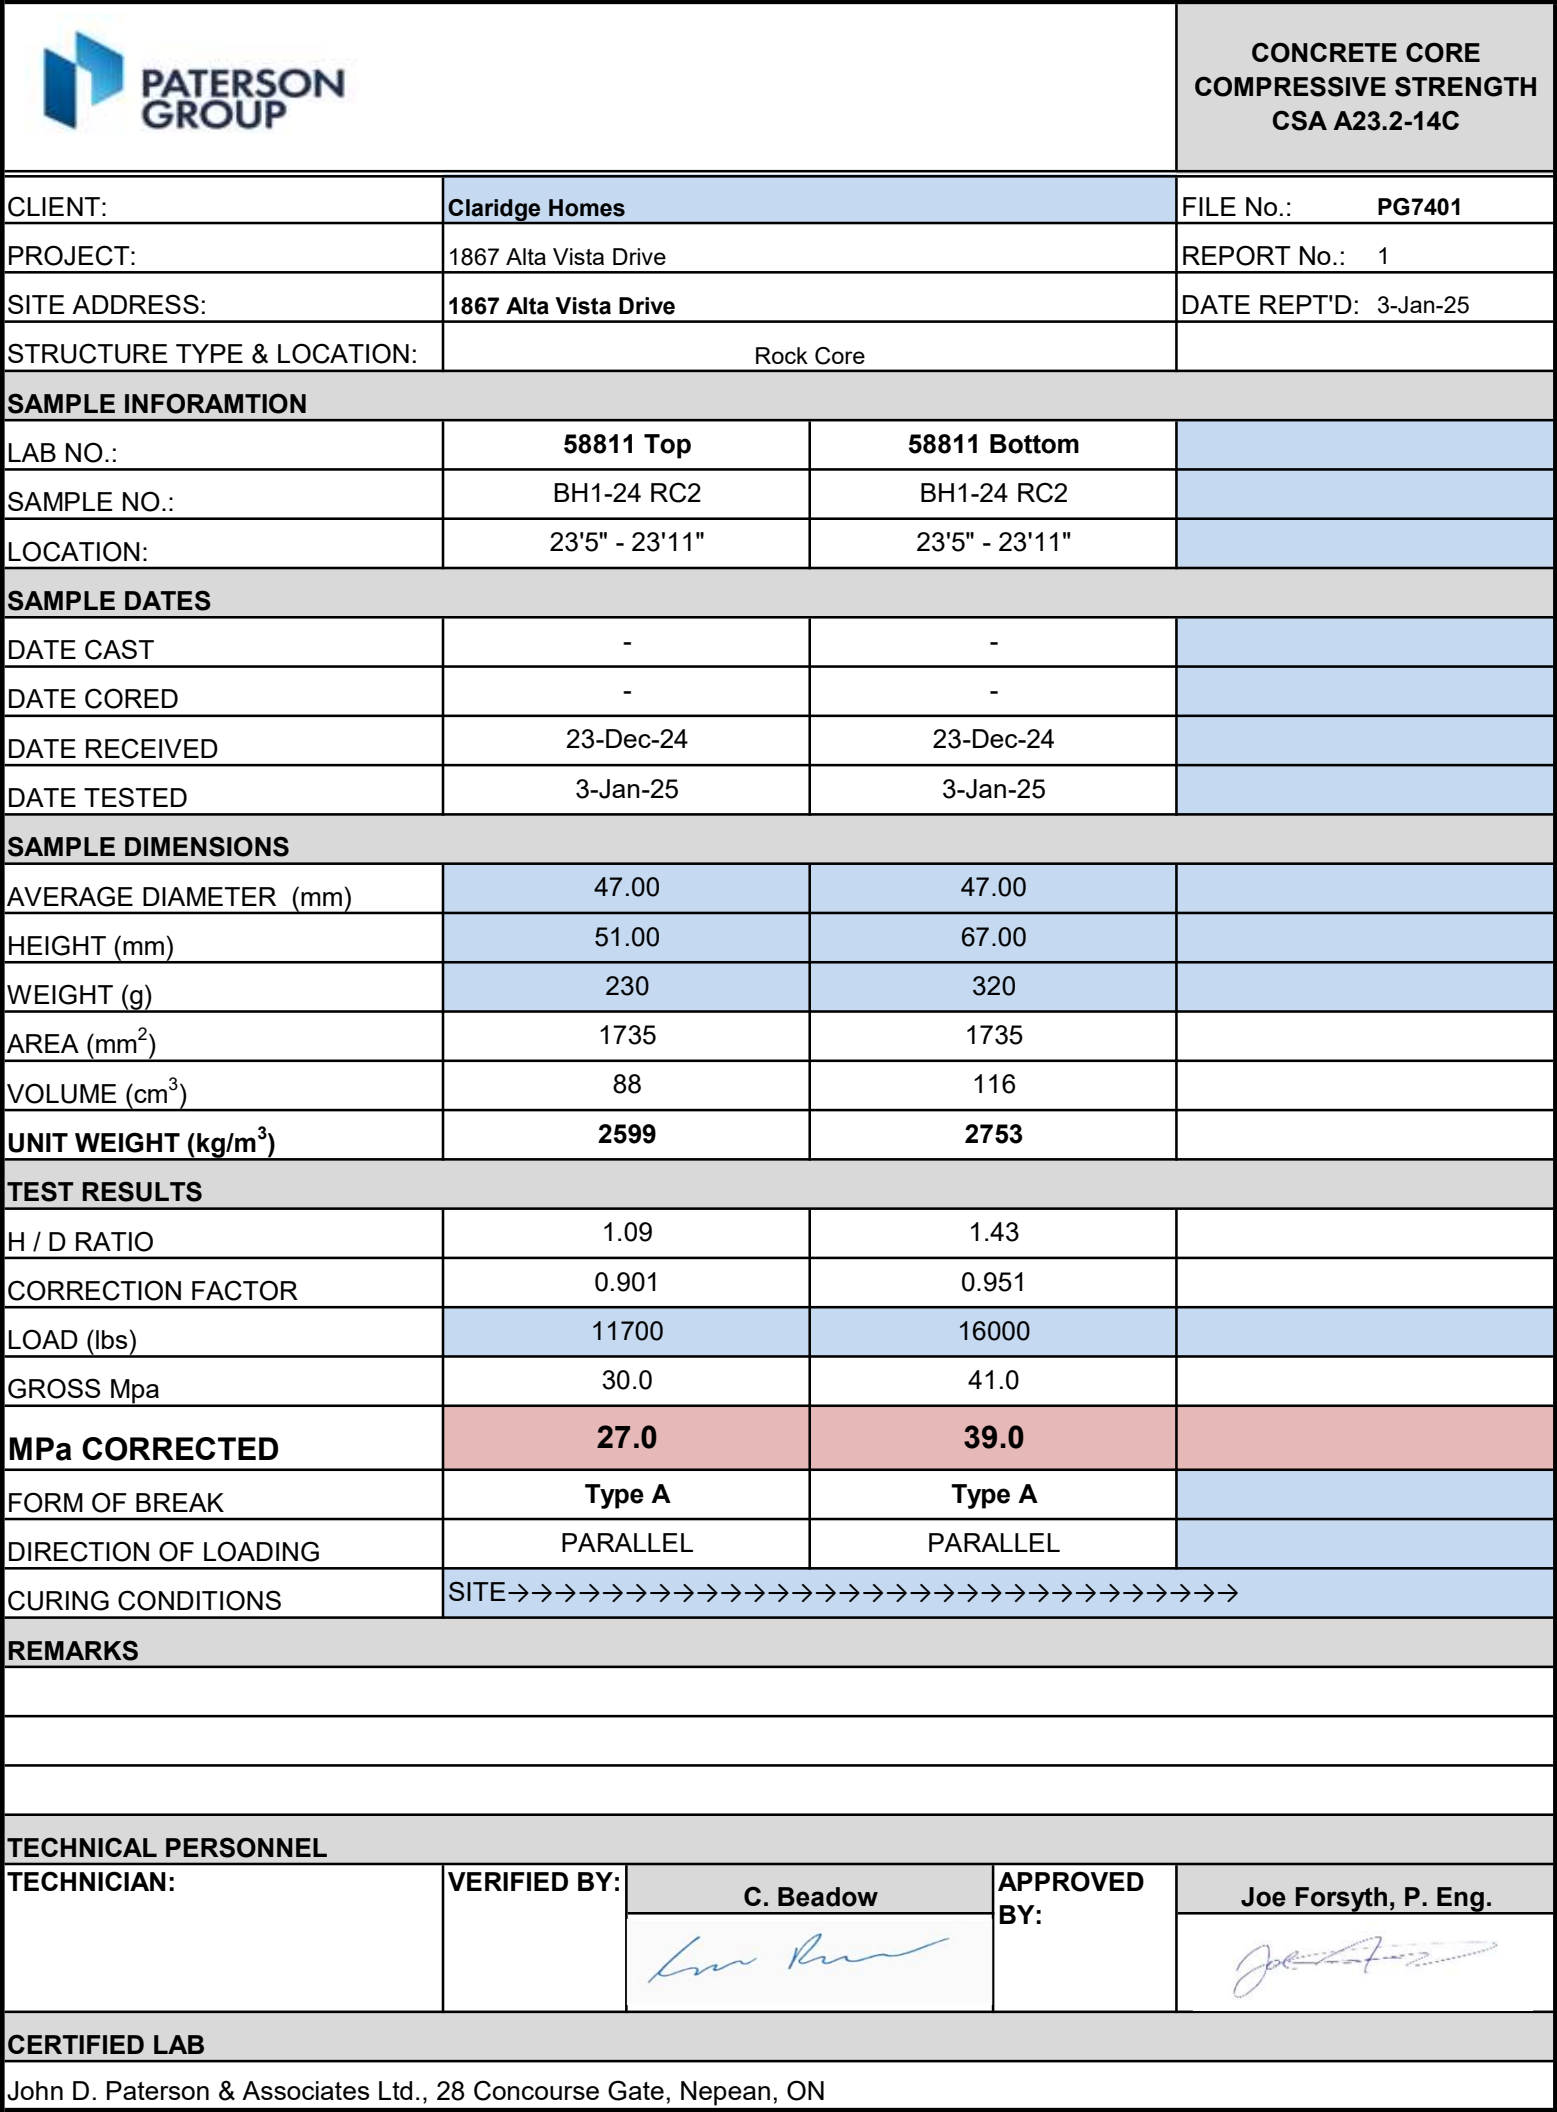


Photo 1:


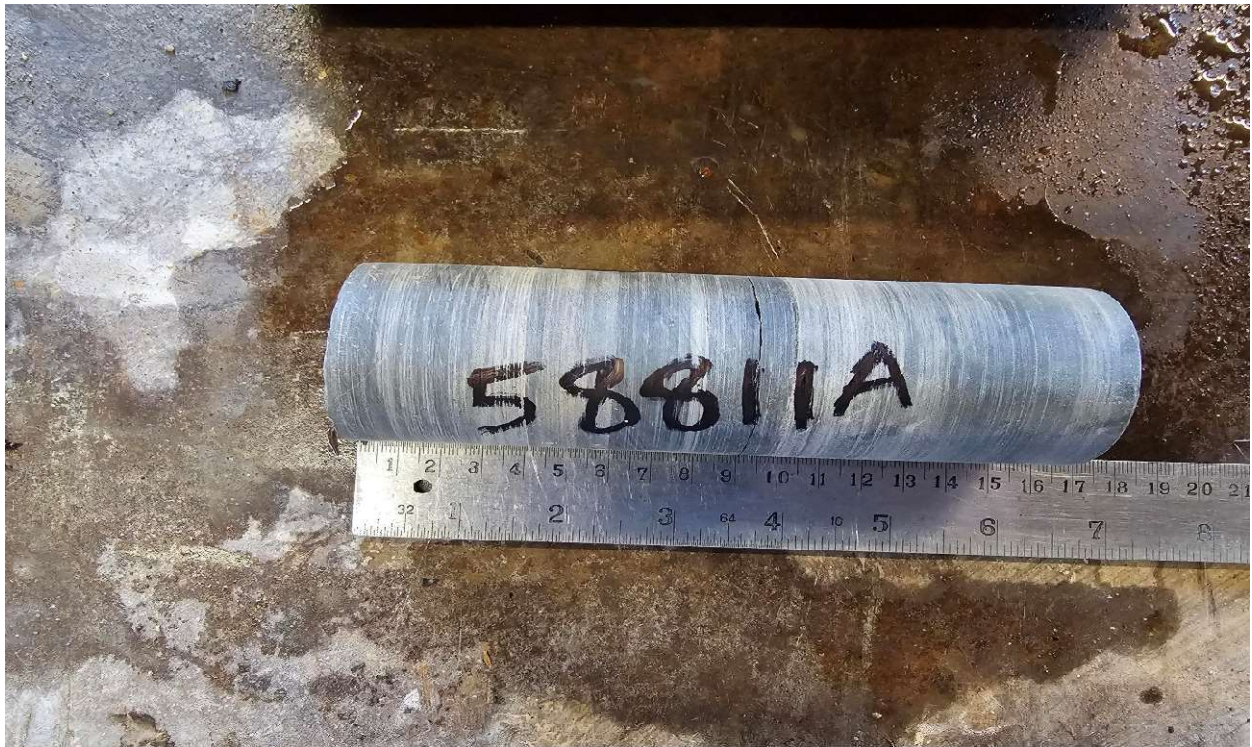


Photo 2:



Photo 3:

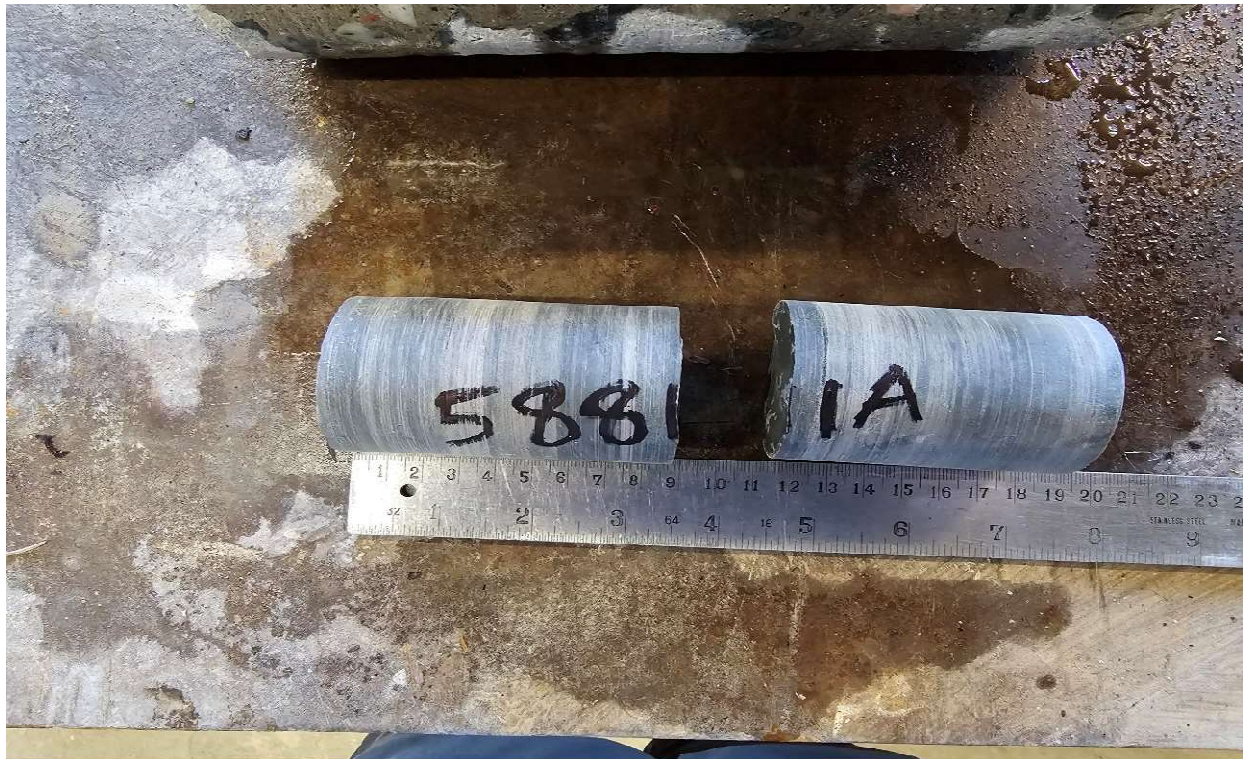

Certificate of Analysis

Report Date: 02-Jan-2025

Client: Paterson Group Consulting Engineers (Ottawa)

Order Date: 24-Dec-2024

Client PO: 62083

Project Description: PE6830

|              |                 |   |   |   |   |
|--------------|-----------------|---|---|---|---|
| Client ID:   | BH1-24 SS4      | - | - | - | - |
| Sample Date: | 20-Dec-24 09:00 | - | - | - | - |
| Sample ID:   | 2452099-01      | - | - | - | - |
| Matrix:      | Soil            | - | - | - | - |
| MDL/Units    |                 |   |   |   |   |

**Physical Characteristics**

|          |              |      |   |   |   |   |
|----------|--------------|------|---|---|---|---|
| % Solids | 0.1 % by Wt. | 91.3 | - | - | - | - |
|----------|--------------|------|---|---|---|---|

**General Inorganics**

|             |               |      |   |   |   |   |
|-------------|---------------|------|---|---|---|---|
| pH          | 0.05 pH Units | 7.16 | - | - | - | - |
| Resistivity | 0.1 Ohm.m     | 4.8  | - | - | - | - |

**Anions**


|          |         |     |   |   |   |   |
|----------|---------|-----|---|---|---|---|
| Chloride | 10 ug/g | 260 | - | - | - | - |
| Sulphate | 10 ug/g | 84  | - | - | - | - |

# APPENDIX 2

FIGURE 1 – KEY PLAN

FIGURES 2 & 3 – SLOPE STABILITY ANALYSIS CROSS-SECTIONS

DRAWING PG7401-1 – TEST HOLE LOCATION PLAN

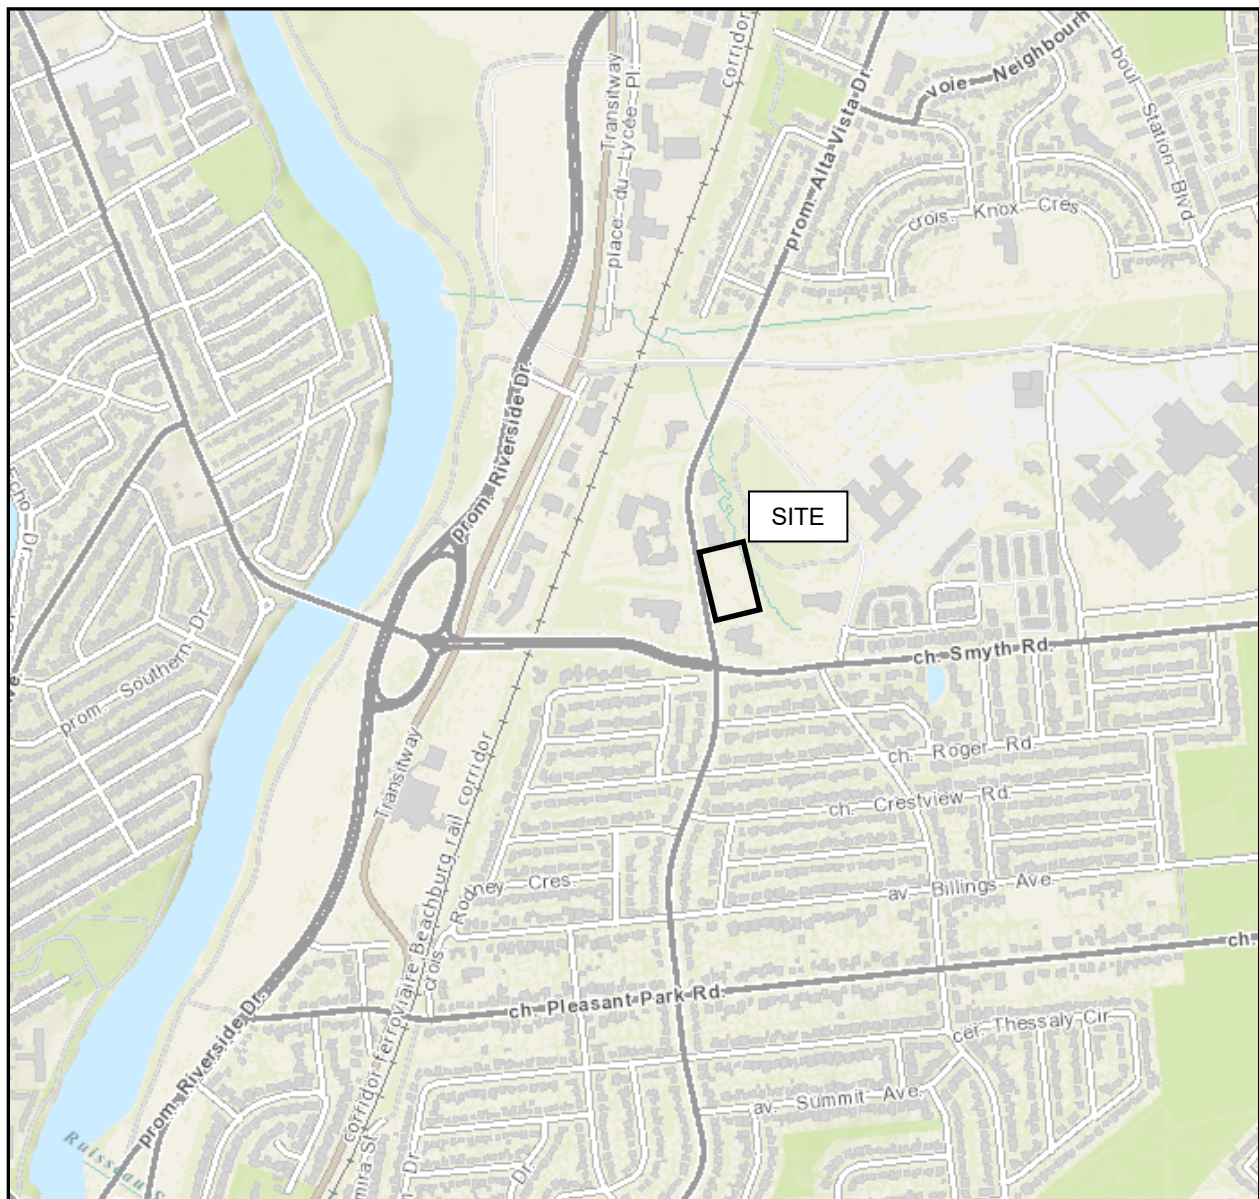



**FIGURE 1**

**KEY PLAN**




**PATERSON  
GROUP**

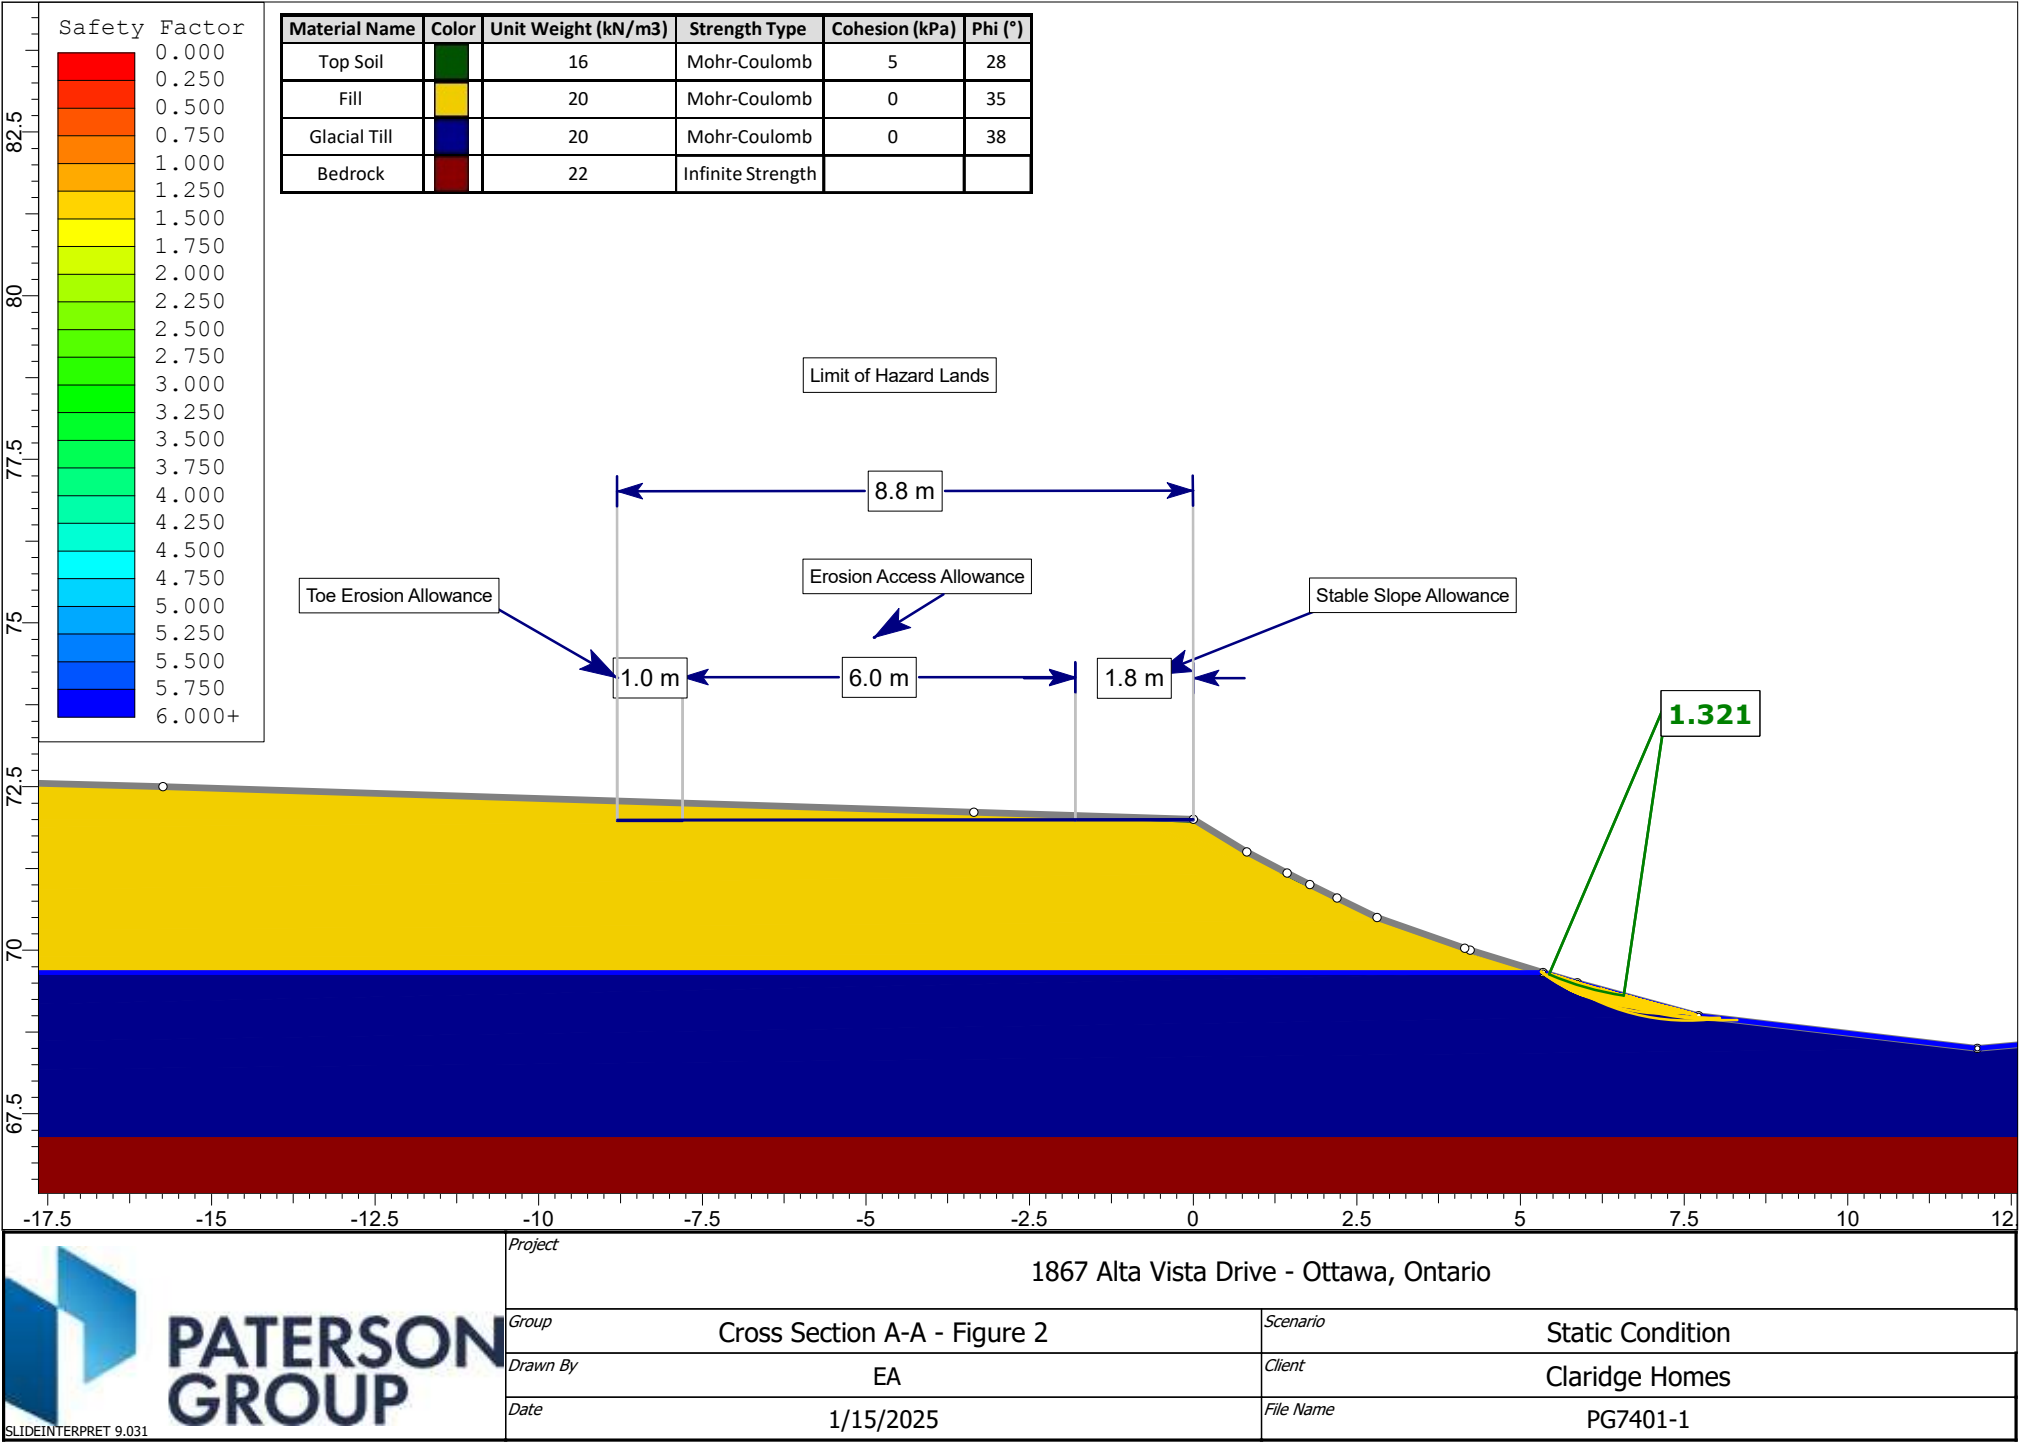

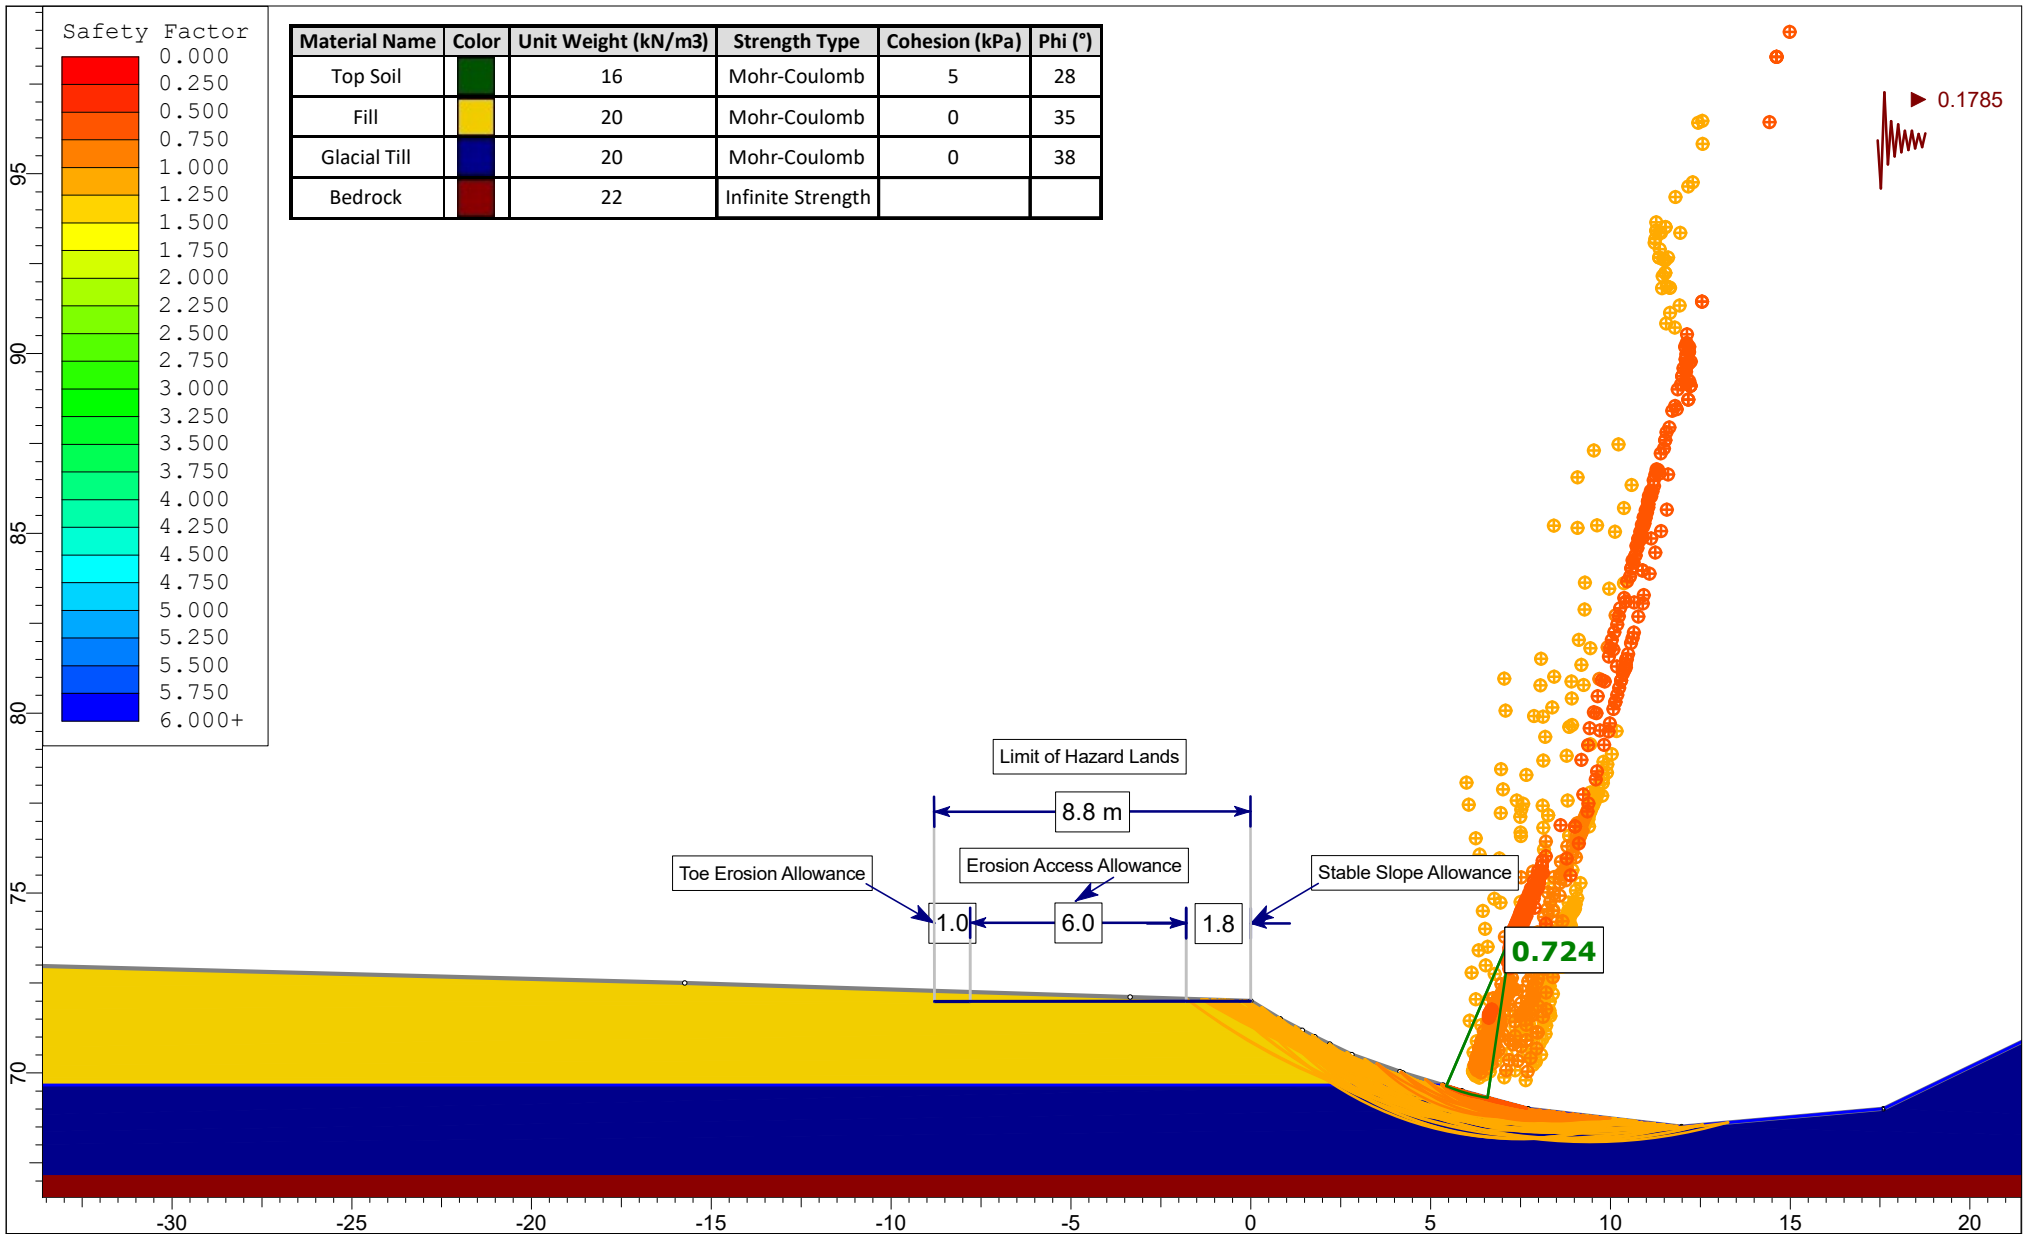

|                                                                                                                           |                                                    |  |                               |
|---------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------|--|-------------------------------|
| <br><small>SLIDEINTERPRET 9.031</small> | Project<br>1867 Alta Vista Drive - Ottawa, Ontario |  |                               |
|                                                                                                                           | Group<br>Cross Section A-A - Figure 3              |  | Scenario<br>Seismic Condition |
|                                                                                                                           | Drawn By<br>EA                                     |  | Client<br>Claridge Homes      |
|                                                                                                                           | Date<br>1/15/2025                                  |  | File Name<br>PG7401-1         |

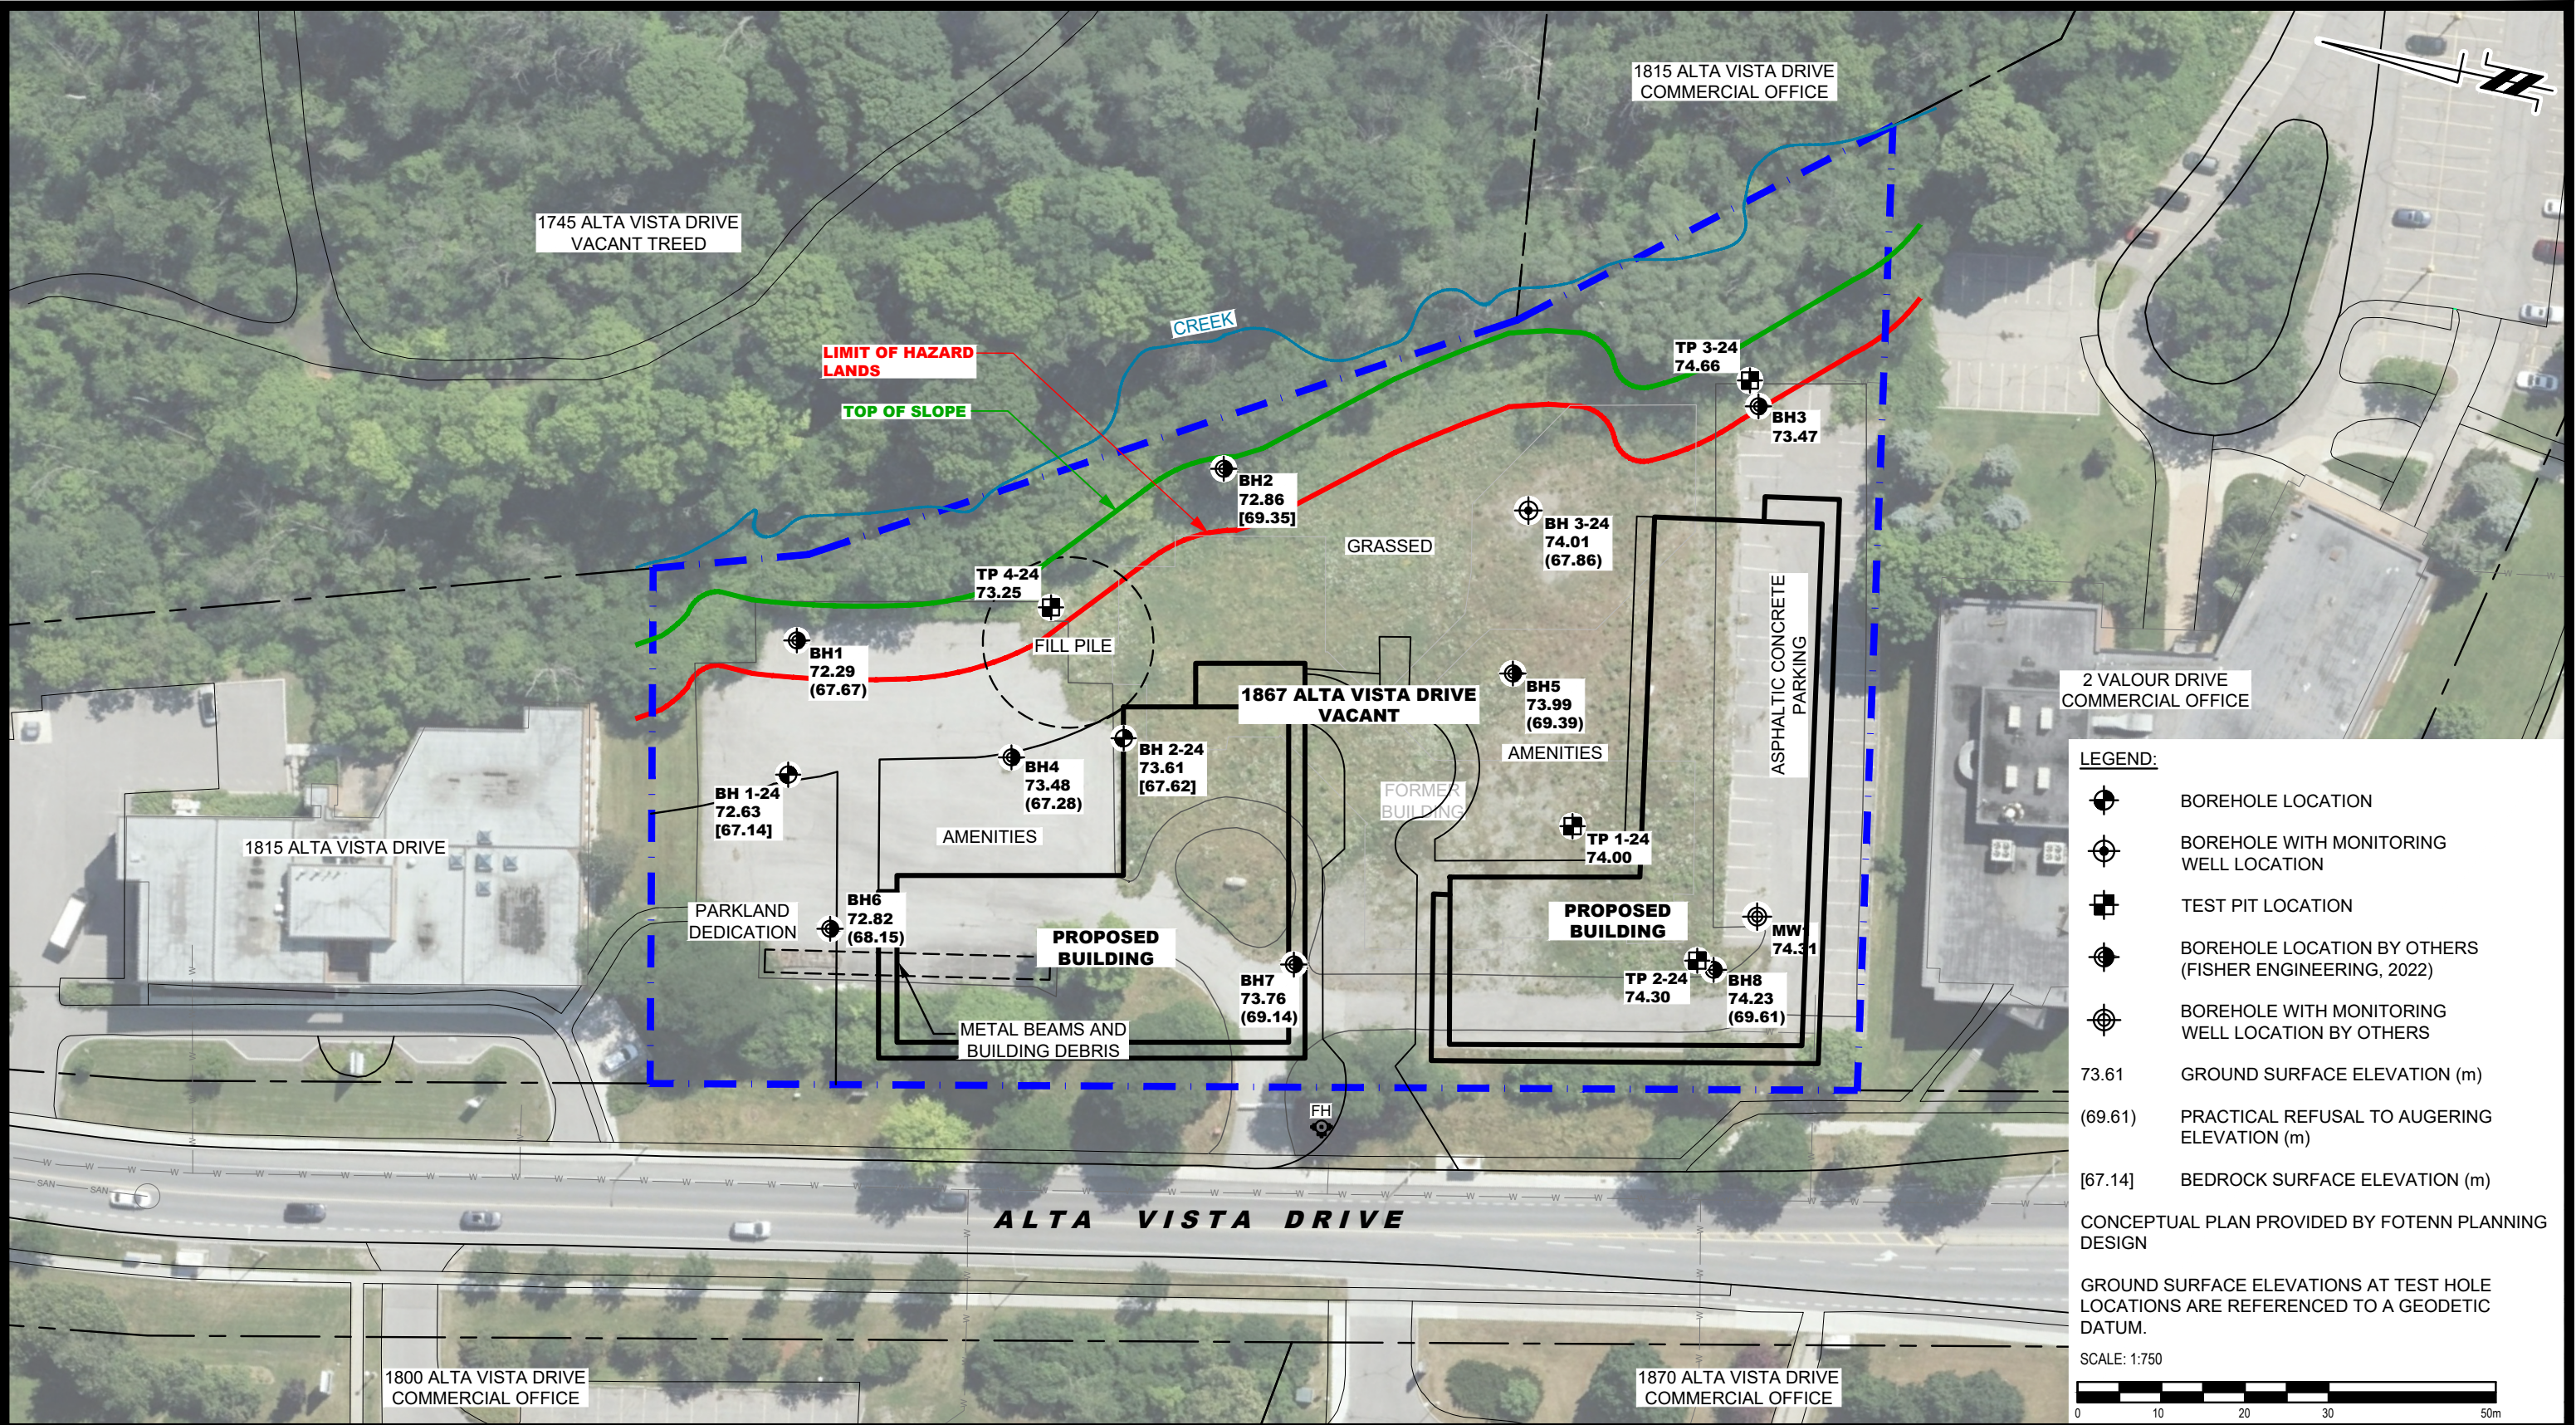

**LEGEND:**

- BOREHOLE LOCATION
- BOREHOLE WITH MONITORING WELL LOCATION
- TEST PIT LOCATION
- BOREHOLE LOCATION BY OTHERS (FISHER ENGINEERING, 2022)
- BOREHOLE WITH MONITORING WELL LOCATION BY OTHERS

73.61 GROUND SURFACE ELEVATION (m)  
(69.61) PRACTICAL REFUSAL TO AUGERING ELEVATION (m)  
[67.14] BEDROCK SURFACE ELEVATION (m)

CONCEPTUAL PLAN PROVIDED BY FOTENN PLANNING DESIGN

GROUND SURFACE ELEVATIONS AT TEST HOLE LOCATIONS ARE REFERENCED TO A GEODETIC DATUM.

SCALE: 1:750

|                                                                                                                                                                                                                    |     |                       |            |         |                                                                                                                      |                              |
|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----|-----------------------|------------|---------|----------------------------------------------------------------------------------------------------------------------|------------------------------|
| <div><div><div>PATERSON<br/>GROUP</div><div>9 AURIGA DRIVE<br/>OTTAWA, ON<br/>K2E 7T9<br/>TEL: (613) 226-7381</div></div></div> |     |                       |            |         | CLARIDGE HOMES<br>GEOTECHNICAL INVESTIGATION<br>PROPOSED DEVELOPMENT<br>1867 ALTA VISTA DRIVE<br><br>OTTAWA, ONTARIO |                              |
|                                                                                                                                                                                                                    |     |                       |            |         |                                                                                                                      |                              |
|                                                                                                                                                                                                                    |     |                       |            |         |                                                                                                                      |                              |
|                                                                                                                                                                                                                    |     |                       |            |         |                                                                                                                      |                              |
|                                                                                                                                                                                                                    | 1   | ADDED CONCEPTUAL PLAN | 21/04/2025 | PB      |                                                                                                                      |                              |
|                                                                                                                                                                                                                    | NO. | REVISIONS             | DATE       | INITIAL |                                                                                                                      |                              |
| Title: TEST HOLE LOCATION PLAN                                                                                                                                                                                     |     |                       |            |         | Scale: 1:750                                                                                                         | Date: 01/2025                |
|                                                                                                                                                                                                                    |     |                       |            |         | Drawn by: GK                                                                                                         | Report No.: PG7401-1         |
|                                                                                                                                                                                                                    |     |                       |            |         | Checked by: PB                                                                                                       | Dwg. No.:<br><b>PG7401-1</b> |
|                                                                                                                                                                                                                    |     |                       |            |         | Approved by: SD                                                                                                      |                              |