



Environmental

Geotechnical

Building Sciences

Construction Testing
& Inspection

Telephone

(866) 217.7900

(705) 742.7900

Facsimile

(705) 742.7907

Website

cambium-inc.com

Mailing Address

P.O. Box 325,
Peterborough, Ontario
Canada, K9J 6Z3

Locations

Peterborough
Kingston
Barrie
Whitby
Ottawa

Laboratory

Peterborough

July 16, 2026

Wateridge Lifestyles Ltd. and Canada Lands Corporation
420 Shoreway Drive
Ottawa, ON K4P 0G3

**Re: Addendum 1 – Subfloor Drainage System Diagram and Additional
Subsurface Information – Proposed Development – 100 Bareille Snow
Street, Ottawa, Ontario**
Cambium Reference: 24896-001 Rev.1

BACKGROUND

Cambium Inc. (Cambium) was requested by Wateridge Lifestyles Ltd. (the Client) to provide a diagram outlining the subfloor drainage system as outlined in the geotechnical investigation report (2026, July 16). In addition, Cambium advanced additional test holes at the site on March 20, 2026, as part of the hydrogeological investigation, including additional groundwater monitoring wells screened in the overburden soils. Rock probes were also advanced on the same day as the monitoring wells at the site to further delineate the bedrock depths.

This addendum provides a summary of the additional data and the requested diagram outlining the subfloor drainage system. The addendum to the report must be read in conjunction with the geotechnical report below:

- Cambium Inc. (2026, July 16). *Geotechnical investigation report – 100 Bareille-Snow Street, Ottawa* (Rev. 4, Cambium Reference No. 24896-001). Prepared for Wateridge Lifestyles Ltd. and Canada Lands Corporation.

ADDITIONAL TEST HOLES

Cambium installed a total of 3 groundwater monitoring wells, numbered MW101-26 through MW103-26, and advanced a total of 6 rock probes, numbered RP201-26 through RP206-26 on March 20, 2026. Groundwater monitoring wells were installed as part of the ongoing hydrogeological investigation and rock probes were advanced to obtain additional data at the site. Details of the locations and depths to bedrock at these test holes are provided in Table 1 below. In addition





Environmental

Geotechnical

Building Sciences

Construction Testing
& Inspection**Telephone**

(866) 217.7900

(705) 742.7900

Facsimile

(705) 742.7907

Website

cambium-inc.com

Mailing AddressP.O. Box 325,
Peterborough, Ontario
Canada, K9J 6Z3**Locations**Peterborough
Kingston
Barrie
Whitby
Ottawa**Laboratory**

Peterborough

July 16, 2026

to the table, an updated "Figure 2 – Test Hole Location Plan" is attached following the text of this letter.

Table 1 Summary of Test Holes and Depths/Elevation to Bedrock

Borehole	Location		Surface Elevation (mASL)	Bedrock or Refusal Depth/Elevation (mbgs / mASL)
	Northing	Easting		
MW101-26	5033652	450468	91.9	2.5 / 89.4
MW102-26	5033647	450544	91.3	2.5 / 88.8
MW103-26	5033729	450533	89.8	3.2 / 86.6
Rock Probes				
RP201-26	5033725	450495	89.4	1.9 / 84.5
RP202-26	5033733	450437	88.6	1.5 / 87.1
RP203-26	5033700	450449	88.7	2.2 / 86.5
RP204-26	5033649	450512	91.2	2.0 / 89.2
RP205-26	5033666	450491	91.7	2.3 / 89.4
RP206-26	5033757	450534	89.7	2.1 / 87.6

It should be noted that the above depths are based on practical refusal. It is anticipated based on consistency in refusal depths, rock coring data, and site observations that the recorded refusal depths represent the top of bedrock, however refusal may also occur on boulders within the overburden.

GROUNDWATER LEVELS

Groundwater levels were measured in the monitoring wells installed as part of the investigation. Further discussion on groundwater in reference to design is provided in the hydrogeological reports submitted separately.

Table 2 Groundwater Levels in Overburden Wells

Borehole	Surface Elevation (mASL)	Groundwater Depth/Elevation (mbgs / mASL) April 2, 2026
MW101-26	91.9	Dry
MW102-26	91.3	Dry
MW103-26	89.8	1.0 / 88.8

Groundwater levels will continue to fluctuate seasonally and in response to precipitation events.





Environmental

Geotechnical

Building Sciences

Construction Testing
& Inspection**Telephone**

(866) 217.7900

(705) 742.7900

Facsimile

(705) 742.7907

Website

cambium-inc.com

Mailing AddressP.O. Box 325,
Peterborough, Ontario
Canada, K9J 6Z3**Locations**Peterborough
Kingston
Barrie
Whitby
Ottawa**Laboratory**

Peterborough

July 16, 2026

BASEMENT DRAINAGE


As indicated in Section 5.12 of the Geotechnical Report, the subfloor drainage system should consist of minimum 100 mm diameter perforated pipes spaced at a maximum of 6 m on center. The pipes must be surrounded on all sides by a minimum of 100 mm of 19 mm clear stone, and the pipe inverts should be a minimum 300 mm below the base of the slab. An example diagram of the subfloor drainage system is attached following the text of this letter titled Figure 3 – Subfloor Drainage Layout. The diagram is provided for guidance. The exact location of the subfloor drains may be altered based on design requirements.

CLOSING

We trust that the information contained in this report meets your current requirements. If you have questions or comments regarding this document, please do not hesitate to contact the undersigned reviewer at (613) 389-2323.

Respectfully submitted,

Cambium Inc.

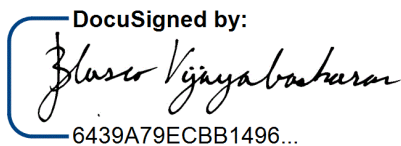DocuSigned by:

 6439A79ECBB1496...

Blasco Vijayabaskaran, P.Eng.

Geotechnical Engineer

BV

Encl. *Cambium Qualifications and Limitations*
 Figure 2- Test Hole Location Plan
 Figure 3- Subfloor Drainage Layout

\\cambiumincstorage.file.core.windows.net\projects\24800 to 24899\24896-001 Wateridge Lifestyles -GEO- Block 21 Hemlock Rd\09-Deliverables\REPORT - GEO\Addenda\Addendum 1\2026-07-16 LTR - Addendum1 - 100 Bareille Snow St, Ottawa R1.docx2.





Environmental

Geotechnical

Building Sciences

Construction Testing
& Inspection

Telephone

(866) 217.7900

(705) 742.7900

Facsimile

(705) 742.7907

Website

cambium-inc.com

Mailing Address

P.O. Box 325,
Peterborough, Ontario
Canada, K9J 6Z3

Locations

Peterborough
Kingston
Barrie
Whitby
Ottawa

Laboratory

Peterborough

July 16, 2026

CAMBIUM QUALIFICATIONS AND LIMITATIONS

Limited Warranty

In performing work on behalf of a client, Cambium relies on its client to provide instructions on the scope of its retainer and, on that basis, Cambium determines the precise nature of the work to be performed. Cambium undertakes all work in accordance with applicable accepted industry practices and standards. Unless required under local laws, other than as expressly stated herein, no other warranties or conditions, either expressed or implied, are made regarding the services, work or reports provided.

Reliance on Materials and Information

The findings and results presented in reports prepared by Cambium are based on the materials and information provided by the client to Cambium and on the facts, conditions and circumstances encountered by Cambium during the performance of the work requested by the client. In formulating its findings and results into a report, Cambium assumes that the information and materials provided by the client or obtained by Cambium from the client or otherwise are factual, accurate and represent a true depiction of the circumstances that exist. Cambium relies on its client to inform Cambium if there are changes to any such information and materials. Cambium does not review, analyze or attempt to verify the accuracy or completeness of the information or materials provided, or circumstances encountered, other than in accordance with applicable accepted industry practice. Cambium will not be responsible for matters arising from incomplete, incorrect or misleading information or from facts or circumstances that are not fully disclosed to or that are concealed from Cambium during the provision of services, work or reports.

Facts, conditions, information and circumstances may vary with time and locations and Cambium's work is based on a review of such matters as they existed at the particular time and location indicated in its reports. No assurance is made by Cambium that the facts, conditions, information, circumstances or any underlying assumptions made by Cambium in connection with the work performed will not change after the work is completed and a report is submitted. If any such changes occur or additional information is obtained, Cambium should be advised and requested to consider if the changes or additional information affect its findings or results.

When preparing reports, Cambium considers applicable legislation, regulations, governmental guidelines and policies to the extent they are within its knowledge, but Cambium is not qualified to advise with respect to legal matters. The presentation of information regarding applicable legislation, regulations, governmental guidelines and policies is for information only and is not intended to and should not be interpreted as constituting a legal opinion concerning the work completed or conditions outlined in a report. All legal matters should be reviewed and considered by an appropriately qualified legal practitioner.

Site Assessments

A site assessment is created using data and information collected during the investigation of a site and based on conditions encountered at the time and particular locations at which fieldwork is conducted. The information, sample results and data collected represent the conditions only at the specific times at which and at those specific locations from which the information, samples and data were obtained and the information, sample results and data may vary at other locations and times. To the extent that Cambium's work or report considers any locations or times other than those from which information, sample results and data was specifically received, the work or report is based on a reasonable extrapolation from such information, sample results and data but the actual conditions encountered may vary from those extrapolations.

Only conditions at the site and locations chosen for study by the client are evaluated; no adjacent or other properties are evaluated unless specifically requested by the client. Any physical or other aspects of the site chosen for study by the client, or any other matter not specifically addressed in a report prepared by Cambium, are beyond the scope of the work performed by Cambium and such matters have not been investigated or addressed.

Reliance

Cambium's services, work and reports may be relied on by the client and its corporate directors and officers, employees, and professional advisors. Cambium is not responsible for the use of its work or reports by any other party, or for the reliance on, or for any decision which is made by any party using the services or work performed by or a report prepared by Cambium without Cambium's express written consent. Any party that relies on services or work performed by Cambium or a report prepared by Cambium without Cambium's express written consent, does so at its own risk. No report of Cambium may be disclosed or referred to in any public document without Cambium's express prior written consent. Cambium specifically disclaims any liability or responsibility to any such party for any loss, damage, expense, fine, penalty or other such thing which may arise or result from the use of any information, recommendation or other matter arising from the services, work or reports provided by Cambium.


Limitation of Liability

Potential liability to the client arising out of the report is limited to the amount of Cambium's professional liability insurance coverage. Cambium shall only be liable for direct damages to the extent caused by Cambium's negligence and/or breach of contract. Cambium shall not be liable for consequential damages.

Personal Liability

The client expressly agrees that Cambium employees shall have no personal liability to the client with respect to a claim, whether in contract, tort and/or other cause of action in law. Furthermore, the client agrees that it will bring no proceedings nor take any action in any court of law against Cambium employees in their personal capacity.



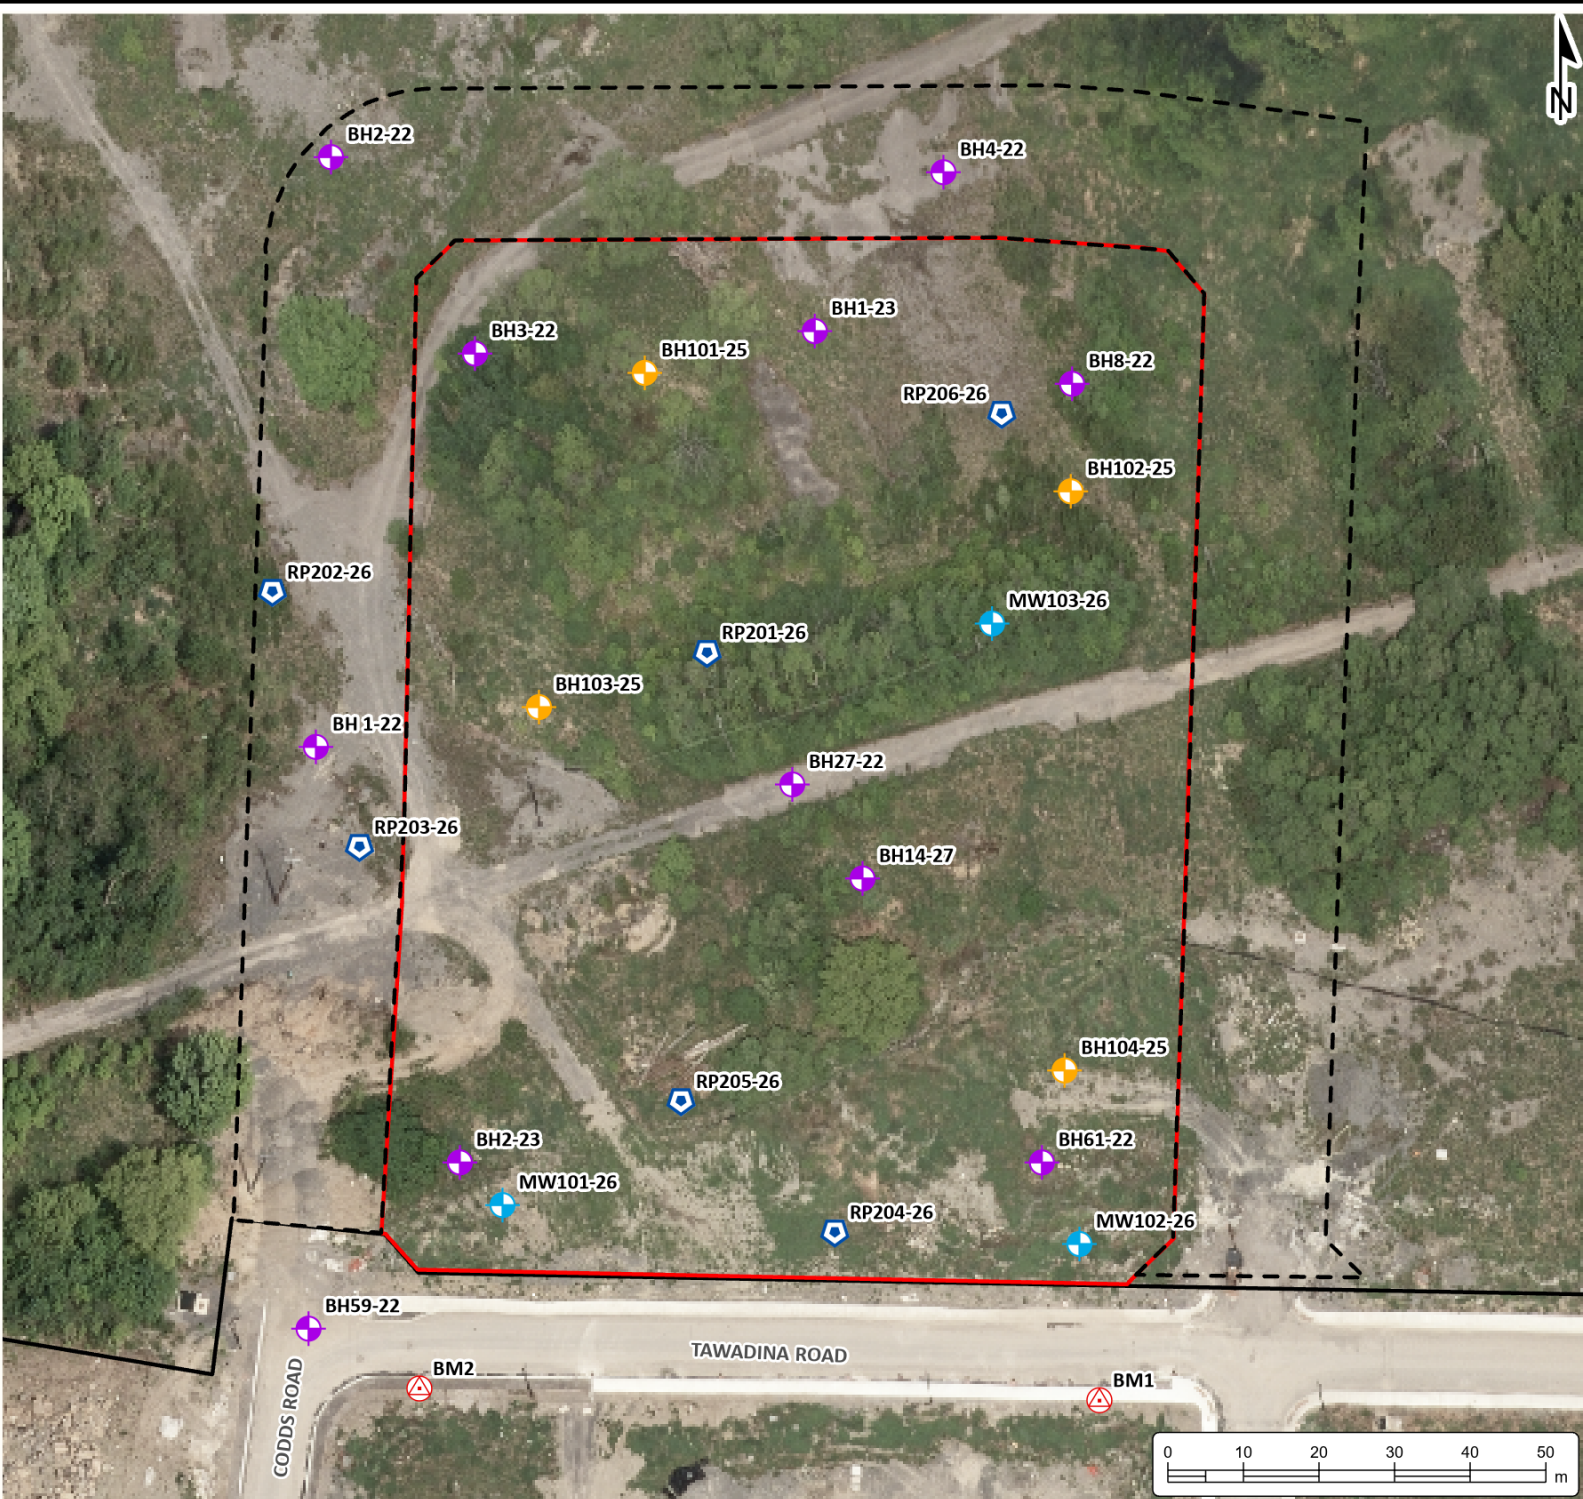

**GEOTECHNICAL
INVESTIGATION**
WATERIDGE LIFESTYLES LTD.
Block 21 - Wateridge Village
Ottawa, Ontario

LEGEND

- Benchmark
- Borehole
- Paterson Borehole
- Monitoring Well
- Rock Point
- Proposed Road
- Site (approximate)
- Subject Property (approximate)

Notes:
- BM1 and BM2 are top nut of fire hydrant.
- Aerial Imagery from the Digital Raster Acquisition Project Eastern Ontario (DRAPPE) 2024. Source: Ontario Ministry of Natural Resources and Forestry.
© Copyright: 2024 King's Printer of Ontario. All Rights Reserved.
- This document contains information licensed under the Open Government License - Ontario.
- Distances on this plan are in metres and can be converted to feet by dividing by 0.3048.
- Cambium Inc. makes every effort to ensure this map is free from errors but cannot be held responsible for any damages due to error or omissions. This map should not be used for navigation or legal purposes. It is intended for general reference use only.



194 Sophia Street
Peterborough, Ontario, K9H 1E5
Tel: (705) 742.7900 Fax: (705) 742.7907
www.cambium-inc.com

TEST HOLE LOCATION PLAN

Project No.:	24896.001	Date:	May 2026
Scale:	1:1,000	Projection:	NAD 1983 UTM Zone 18N
Created by:	NLB	Checked by:	BV
			Figure: 2

GEOTECHNICAL
INVESTIGATION
WATERRIDGE LIFESTYLES LTD>
Block - Waterridge Village
Ottawa, Ontario



LEGEND

- 100 mm Diameter Perforated Pipe
- 19 mm Clear Stone - Surrounding pipes by a minimum of 100 mm

- Notes:
- Pipes to be spaced at a maximum of 6m on center. Pipes must be surrounded on all sides by a minimum of 100 mm of 19 mm clear stone
 - Floor plan base data provided by Wateridge Lifestyles Ltd.
 - Cambium Inc. makes every effort to ensure this map is free from errors but cannot be held responsible for any damages due to error or omissions. This map should not be used for navigation or legal purposes. It is intended for general reference use only.
 - Distances on this plan are in millimeters unless otherwise noted.



194 Sophia Street
Peterborough, Ontario, K9H 1E5
Tel: 705-742-7900 Fax: 705-742-7907
www.cambium-inc.com

SUBFLOOR DRAINAGE
LAYOUT

Project No.:	Date:		
24896.001	May 2026		
Horizontal Scale:	1:250	Vertical Scale	N/A
Drawn By:	Checked By:	Figure:	
NLB	BV	3	

