

Phase I – Environmental Site Assessment

Tunney's Pasture (Block 10)

Ottawa, Ontario

Prepared for IBI Group

Report: PE6040-1

July 7, 2023



TABLE OF CONTENTS

EXECUTIVE SUMMARY	ii
1.0 INTRODUCTION	1
2.0 PHASE I PROPERTY INFORMATION.....	2
3.0 SCOPE OF INVESTIGATION	3
4.0 RECORDS REVIEW	4
4.1 General.....	4
4.2 Environmental Source Information	5
4.3 Physical Setting Sources	19
5.0 INTERVIEWS	23
6.0 SITE RECONNAISSANCE.....	24
6.1 General Requirements.....	24
6.2 Specific Observations at the Phase I Property	24
7.0 REVIEW AND EVALUATION OF INFORMATION	31
7.1 Land Use History	31
7.2 Conceptual Site Model.....	35
8.0 CONCLUSIONS	39
8.1 Assessment.....	39
8.2 Recommendations.....	41
9.0 STATEMENT OF LIMITATIONS	42
10.0 REFERENCES	43

List of Figures

Figure 1 – Key Plan

Figure 2 – Topographic Map

Drawing PE6040-1 – Site Plan

Drawing PE6040-2 – Surrounding Land Use Plan

List of Appendices

Appendix 1 Aerial Photographs
Site Photographs

Appendix 2 MECP Freedom of Information Search Results
MECP Water Well Records
TSSA Correspondence
City of Ottawa HLUI Search Response
ERIS Database Report

Appendix 3 Qualifications of Assessors

EXECUTIVE SUMMARY

Assessment

Paterson Group was retained by IBI Group to conduct a Phase I – Environmental Site Assessment (Phase I ESA) for Block 10 of the Tunney's Pasture government office complex, in the City of Ottawa, Ontario. The objective of this Phase I ESA was to research the past and current use of the site (Phase I Property) and 250 m study area (Phase I Study Area) and to identify any environmental concerns with the potential to have impacted the subject property.

According to the historical research, the Phase I Property was first developed with the Brooke Claxton building, the Environmental Health Centre and the Virus Lab building in the mid 1960's. The virus lab was demolished in the mid 2000's and the west portion of the Phase I Property has functioned as a parking area in its place since that time.

The surrounding lands within the Phase I Study Area have been developed for government purposes as part of the Tunney's Pasture government complex. Two off-site potentially contaminating activities (associated with the same property) were identified within the Phase I Study area, however, due to their separation distances as well as their cross-gradient orientation with respect to the anticipated groundwater flow to the north, these activities are not considered to pose an environmental concern to the Phase I Property.

Presently, the central portion of the Phase I Property is occupied by a high-rise office building (Brooke Claxton building) and the east portion with a government building (Environmental Health Centre), the buildings are connected on the ground level. It should be noted that at the time of the site inspection, the 50 Columbine Driveway portion of the Phase I Property (Environmental Health Centre) was undergoing demolition and access was not made available. The west portion of the Phase I Property consists of asphalt-covered vehicular parking lot, with some landscaped areas.

The surrounding lands consist of mainly of government office building, parkland, and residential land. The present-day use of the neighbouring properties are not considered to pose an environmental concern to the Phase I Property.

Based on our review of the historical and current uses of the site, the following areas of potential environmental concern (APECs) were identified on the Phase I Property.

Areas of Potential Environmental Concern					
Area of Potential Environmental Concern	Location of APEC on Phase I Property	Potentially Contaminating Activity (Table 2 – O. Reg. 153/04)	Location of PCA (On-Site or Off-Site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, Soil, and/or Sediment)
APEC 1 Three Existing On-Site Coloured Diesel Aboveground Storage Tanks (and associated vent and fill pipes x 2)	South-central portion of Phase I Property	<i>"Item 28: Gasoline and Associated products Storage in Fixed Tanks"</i>	On-Site	PHCs (F ₁ -F ₄) BTEX	Soil and Groundwater
APEC 2 Former On-Site Heating Oil Underground Storage Tank	West-central portion of Phase I Property	<i>"Item 28: Gasoline and Associated products Storage in Fixed Tanks"</i>	On-Site	PHCs (F ₁ -F ₄) BTEX PAHs	Soil and Groundwater
APEC 3 On-Site Impacted Soil and Groundwater Plume	East portion of Phase I Property	<i>"Item N/A: Known Impacted Groundwater Plume"</i>	On-Site	PHCs (F ₁ -F ₄) BTEX PAHs	Groundwater
APEC 4 Former On-Site Diesel Underground Storage Tank and Existing On-Site Aboveground Storage Tank	Southeast portion of Phase I Property	<i>"Item 28: Gasoline and Associated products Storage in Fixed Tanks"</i>	On-Site	PHCs (F ₁ -F ₄) BTEX	Soil and Groundwater
APEC 5 Former On-Site Diesel Underground Storage Tank	Southeast portion of Phase I Property	<i>"Item 28: Gasoline and Associated products Storage in Fixed Tanks"</i>	On-Site	PHCs (F ₁ -F ₄) BTEX	Soil and Groundwater
APEC 6 Existing On-Site Diesel Aboveground Storage Tank	South portion of Phase I Property	<i>"Item 28: Gasoline and Associated products Storage in Fixed Tanks"</i>	On-Site	PHCs (F ₁ -F ₄) BTEX	Soil and Groundwater
APEC 7 Existing On-Site Liquid Phase Transformers (x2)	South-central portion of Phase I Property	<i>"Item 55: Transformer Manufacturing, Processing and Use"</i>	On-Site	PHCs (F ₁ -F ₄) BTEX PCBs	Soil
APEC 8 Fill Material of Unknown Quality	Entirety of Phase I Property	<i>"Item 30: Importation of Fill Material of Unknown Quality"</i>	On-Site	PHCs (F ₁ -F ₄) BTEX Metals PAHs	Soil
APEC 9 Application of Road Salt	Within parking areas of Phase I Property	<i>"Item N/A: Application of Road Salt for De-Icing Purposes During Snow and Ice Conditions"</i>	On-Site	EC SAR	Soil

Recommendations

Based on the findings of this assessment, it is our opinion that **a Phase II – Environmental Site Assessment is required for the Phase I Property.**

The preliminary scope of work proposed for the Phase II ESA consists of the placement of six to eight boreholes across the Phase I Property, all of which will be instrumented with groundwater monitoring wells. The boreholes will be strategically placed for coverage of all identified APECs on the Phase I Property, though the final locations have not yet been established. Proposed analytical testing for both soil and groundwater samples will include petroleum hydrocarbons, benzene, toluene, ethylbenzene, xylenes, metals, volatile organic compounds, polycyclic aromatic hydrocarbons, polychlorinated biphenyls, electrical conductivity, and sodium adsorption ratio.

1.0 INTRODUCTION

At the request of IBI Group, Paterson Group (Paterson) conducted a Phase I – Environmental Site Assessment (Phase I ESA) for Block 10 of the Tunney's Pasture government office complex, in the City of Ottawa, Ontario, (Phase I Property). The objective of this Phase I ESA has been to research the past and current use of the Phase I Property, as well as the neighbouring properties within a 250 m study area (Phase I Study Area), to identify any potentially contaminating activities (PCAs) that would result in areas of potential environmental concern (APECs) on the Phase I Property.

Paterson was engaged to conduct this Phase I ESA by IBI Group, whose office can be reached by telephone at 1-416-596-1930.

This report has been prepared specifically and solely for the above-mentioned project which is described herein. It contains all of our findings and results of the environmental conditions at this site.

This Phase I ESA report has been prepared under the supervision of a Qualified Person, in general accordance with Ontario Regulation (O. Reg.) 153/04, as amended under the Environmental Protection Act, and CSA Z768-01 (reaffirmed 2022). The conclusions presented herein are based on information gathered from a limited historical review and field inspection program. The findings of the Phase I ESA are based on a review of readily available geological, historical, and regulatory information, as well as a cursory review made at the time of the field assessment. The historical research relies upon information supplied by others, such as local, provincial, and federal agencies, and was limited within the scope-of-work, time, and budget of the project herein.

In 2021, Public Service and Procurement Canada (PSPC) partnered with Canada Lands Company (CLC) under a collaboration project to leverage the strengths of each organization to deliver the long-term vision of Tunney's Pasture that includes the site's transition from a federal employment centre into a mixed-use, sustainable, transit-oriented community. CLC is a self-financing federal Crown corporation specializing in real estate and development with a mandate to transform former Government of Canada properties and reintegrates them into local communities while ensuring their long-term goals. Since the launch of this collaboration project, CLC has been committed to working with the community to define amendments to the TPMP and proposed upgrades to the existing roadway and servicing infrastructure that support both federal priorities and future development.

2.0 PHASE I PROPERTY INFORMATION

Address: Part of 120 Parkdale Avenue (50 and 70 Columbine Driveway), Block 10, Tunney's Pasture, Ottawa, Ontario.

Location: The Phase I Property is bounded to the north by Columbine Driveway and to the south by Goldenrod Driveway, in the City of Ottawa, Ontario. Refer to Figure 1 – Key Plan, as well as Drawing PE6040-1 – Site Plan, appended to this report.

Latitude and Longitude: 45° 24' 32" N, 75° 44' 14" W.

Site Description:

Configuration: Irregular.

Area: 5.9 ha (approximately).

Zoning: MC – Mixed-Use Centre Zone.

Current Use: The central portion of the Phase I Property is occupied by an 18-storey government office building (Brooke Claxton building) and the east portion of the Phase I Property is occupied by a three-storey (with one basement level) government office building (Environmental Health Centre). The west portion of the Phase I Property is occupied by a parking lot.

Services: The Phase I Property is located within a municipally serviced area.

3.0 SCOPE OF INVESTIGATION

The scope of work for this Phase I ESA is described as follows:

- ☐ Determine the historical activities occurring on the Phase I Property and in the Phase I Study Area by conducting a review of readily available records, reports, photographs, plans, mapping information, databases, and regulatory agencies;
- ☐ Investigate the existing conditions present on the Phase I Property and in the Phase I Study Area by conducting site reconnaissance;
- ☐ Conduct interviews with persons knowledgeable of current and historic operations on the Phase I Property and, if warranted, the neighbouring properties;
- ☐ Present the results of our findings in a comprehensive report in general accordance with the requirements O. Reg. 153/04, as amended under the Environmental Protection Act, and in compliance with the requirements of CSA Z768-01 (reaffirmed 2022);
- ☐ Provide a preliminary environmental site evaluation based on our findings;
- ☐ Provide preliminary remediation recommendations and further investigative work if contamination is suspected or encountered.

4.0 RECORDS REVIEW

4.1 General

Phase I ESA Study Area Determination

A radius of approximately 250 m was deemed appropriate for defining the study area for this assignment, herein referred to as the Phase I Study Area. Properties located outside of the Phase I Study Area are not considered to have had the potential to impact the Phase I Property, based on their significant separation distances.

First Developed Use Determination

Based on the historical information available for review and for the purposes of this report, the Phase I Property is considered to have been first developed with the Virus Laboratory Building in the mid 1950's. The Phase I Property was further developed in the mid 1960's with the Brooke Claxton Building and the Environmental Health Centre Building.

Fire Insurance Plans

Fire insurance plans (FIPs), dated from 1925 and 1956, were reviewed for the general area of the Phase I Property as part of this assessment. These plans contain mapping information regarding the historical property uses within the general area of the Phase I Property.

1925	The Phase I Property and neighbouring lands appears to be vacant at this time. It should be noted that the area of the Phase I Property is not covered in depth in the 1925 FIPs.
1956	No coverage of the Phase I Property was available for review from this publication, however, some of the surrounding lands to the east were depicted as residential dwellings. No significant changes were apparent with respect to these lands since the time of the previous publication.

Surrounding properties in the Phase I Study Area are depicted on Drawing PE6040-2 – Surrounding Land Use Plan, in the Figures section of this report.

City of Ottawa Street Directories

City of Ottawa street directories, were reviewed in approximate ten year intervals between 1940 and 2011 for the general area of the Phase I Property as part of this assessment.

According to the directories, the Phase I Property and surrounding lands were listed as residential, light commercial or part of the Tunney's Pasture government office complex from the 1950's to the present day.

The property addressed 140 Hinchey Avenue, approximately 210 m southeast of the Phase I Property, was listed as a retail fuel outlet in 1960 and then as an automotive service garage from 1965 to 1990. Based on the separation distance and cross-gradient orientation with respect to the Phase I Property, the use of the 140 Hinchey Avenue as a former retail fuel outlet and (existing) automotive service garage is a PCA that does not represent an environmental concern to the Phase I Property.

The location of the aforementioned PCA is depicted on Drawing PE6040-2 – Surrounding Land Use Plan.

Plan of Survey

A survey plan of the Phase I Property was not provided for review as part of this assessment.

4.2 Environmental Source Information

National Pollutant Release Inventory

A search of the National Pollutant Release Inventory (NPRI) database was conducted as part of this assessment. This federally managed database provides various reports and tracking information relating to the release of solid, liquid, or gaseous pollutants from industrial facilities into the natural environment. The search did not identify any pollutant release records for the Phase I Property.

A search of this database identified pollutant release records for the property addressed 50 Chardon Driveway, more specifically the Tunney's Pasture Central Heating and Cooling Plant, approximately 205m south of the Phase I Property. According to the database, several records of airborne discharges of sulphur dioxide, nitrogen oxide, and particulate matter (PM10 and PM2.5) were reported between 2002 and 2021. Based on the nature of airborne discharges, as well as their significant separation distances, these pollutant releases are not considered to present an environmental concern to the Phase I Property.

Ontario PCB Waste Storage Site Inventory

The Ontario Ministry of Environment, Conservation and Parks document entitled, "*Ontario Inventory of PCB Storage Sites, April 1995*" was reviewed as part of this assessment. This document identifies all recorded active and closed PCB waste storage sites situated in the Province of Ontario.

A review of this document did not identify any former PCB waste storage sites situated within the Phase I Study Area.

MECP Waste Disposal Site Inventory

The Ontario Ministry of Environment, Conservation and Parks document entitled, "*Waste Disposal Site Inventory in Ontario, 1991*" was reviewed as part of this assessment. This document includes all recorded active and closed waste disposal sites, industrial manufactured gas plants, and coal tar distillation plants situated in the Province of Ontario.

A review of this document did not identify any former waste disposal sites situated on the Phase I Property or within the Phase I Study Area.

MECP Coal Gasification Plant Inventory

The Ontario Ministry of Environment, Conservation and Parks document entitled, "*Municipal Coal Gasification Plant Site Inventory, 1991*" was reviewed as part of this assessment. This document provides a reference to the locations of former plants with respect to the Phase I Property.

A review of this document did not identify any former coal gasification plants located on the Phase I Property or within the Phase I Study Area.

MECP Waste Management Records

A request was submitted to the MECP Freedom of Information office for information with respect to waste management records for the Phase I Property.

The response from the MECP indicated that no relevant records were identified pertaining to the Phase I Property.

A waste generator record was provided in the MECP response for 120 Parkdale Avenue South, however, further inspection of the record indicates that it pertains to a property in Hamilton, Ontario with a similar name to the Phase I Property.

MECP Submissions

A request was submitted to the MECP Freedom of Information office for information with respect to reports related to environmental conditions for the Phase I Property.

The response from the MECP indicated that no relevant records were identified pertaining to the Phase I Property.

MECP Incident Reports

A request was submitted to the MECP Freedom of Information office for information with respect to records concerning environmental incidents, orders, offences, spills, discharges of contaminants, or inspections maintained by the MECP for the Phase I Property or any of the neighbouring properties.

The response from the MECP indicated that no relevant records were identified pertaining to the Phase I Property.

MECP Instruments

A request was submitted to the MECP Freedom of Information office for information with respect to certificates of approval, permits to take water, certificates of property use, or any other similar MECP issued instruments for the Phase I Property.

The response from the MECP indicated that an approval had been issued in 2005 (and resubmitted in 2006, 2007, 2008 and 2009) for the application of up to three treatments in each of up to 128 catch basins located at Tunney's Pasture. The treatment consists of the use of a larvicide (Altosid Pellets) to mitigate mosquito growth. This past use of a larvicide to the catch basins located throughout the 120 Parkdale Avenue property as a whole is not considered to represent an environmental concern to the Phase I Property.

A third occurrence report was issued in 2001, this occurrence was for a 30L glycol spill to the ground and a catch basin on a loading dock on the 120 Parkdale Avenue property. No information was provided pertaining to the specific building or area on the 120 Parkdale Avenue property where the spill occurred. Given that the spill was cleaned and vacuumed, the potential for environmental impact to the Phase I Property is considered minimal and the record is not considered to represent an environmental concern.

An approval was issued in April of 2008 for the transfer of 4000kg of Polychlorinated Biphenyl (PCB) containing electrical cable roll-off from the 120 Parkdale Avenue property to a carrier certified to transport PCB waste. The electrical cable-roll off was transported to the approved carrier in April of 2009. No environmental concerns were identified during a review of the approval and transport records.

An approval was issued in April of 2008 for the transfer of 8000kg of drained PCB containing liquid from two transformers, six breakers and six drums of oil from the 120 Parkdale Avenue property to a carrier certified to transport PCB waste. The PCB containing liquid was transported to the approved carrier in September of 2008. No environmental concerns were identified during a review of the approval and transport records.

MECP Brownfields Environmental Site Registry

A search of the MECP Brownfields Environmental Site Registry was conducted as part of this assessment. This database contains publicly available information on Records of Site Condition (RSCs) filed in the Province of Ontario between 2004 and 2022.

A review of the registry did not identify any RSCs filed for the Phase I Property, or for any properties situated within the Phase I Study Area.

Technical Standards and Safety Authority (TSSA)

The TSSA Fuels Safety Branch in Toronto was contacted electronically on March 24, 2023, as part of this assessment, to inquire about current and former fuel storage tanks, spills, and historical incidents for the Phase I Property as well as the neighbouring properties within the Phase I Study Area.

The response from the TSSA indicated that no records were identified associated with the Phase I Property or neighbouring properties provided in the request.

A copy of the correspondence with the TSSA is included in Appendix 2.

OMNRF Areas of Natural and Scientific Interest (ANSI)

A search for ANSI sites situated within the Phase I Study Area was conducted electronically via the Ontario Ministry of Natural Resources and Forestry (OMNRF) website as part of this assessment.

A review of the available mapping information did not identify any ANSI sites situated on the Phase I Property or within the Phase I Study Area.

City of Ottawa Old Landfill Sites

The document prepared by Golder Associates entitled, *“Old Landfill Management Strategy, Phase I - Identification of Sites, City of Ottawa”*, was reviewed as part of this assessment. This document identifies the details and locations of all recorded active and closed landfill sites situated in the City of Ottawa.

A review of this document did not identify any active or closed landfill sites situated on the Phase I Property or within the Phase I Study Area.

Former Industrial Sites

The report entitled “Mapping and Assessment of Former Industrial Sites, City of Ottawa” prepared by Intera Technologies Limited was also reviewed. One record for the research and processing of radioisotopes (operated from the 1950’s to c. 2000) was identified within the Phase I Study Area for the property addressed 20 Goldenrod Driveway, approximately 80 m southwest of the Phase I Property. One record for a research branch of Eldorado mining and refining Co. (operated from 1955 to the 1990’s) was identified for the property at the southeast corner of the Colombine Boulevard and Ross Street intersection, approximately 110m southwest of the Phase I Property.

Due to the nature of the historic activities and supplemental environmental investigations at the 20 Goldenrod Driveway property and the Eldorado Mining Building, these properties are not considered to represent potential environmental concerns.

City of Ottawa Historical Land Use Inventory (HLUI) Database

As part of this assessment, a requisition form was submitted to the City of Ottawa to request information from the City's Historical Land Use Inventory (HLUI) database for any environmental records pertaining to the Phase I Property as well as any properties situated within the Phase I Study Area.

The response from the City indicated that no relevant records were identified pertaining to the Phase I Property.

A copy search results have been included in Appendix 2.

ERIS Database Report

A database report, prepared by ERIS (Environmental Risk Information Services Ltd.), dated July 5, 2022, was acquired and reviewed as part of this assessment. This report provides a compilation of various provincial and federal environmental related records pertaining to any properties situated within the Phase I Study Area.

It should be noted that this ERIS report encompasses the entirety of the Tunney's Pasture complex as well as the surrounding lands within a 250 m radius. The complete ERIS report has been included in Appendix 2.

❑ On-Site Records:

The ERIS report identified 178 records pertaining to the Tunney's Pasture government office complex (six of which are previous ERIS searches), though it should be noted that only 14 of the records were identified as pertaining specifically to the Phase I Property as described in this report.

The ERIS report identified one Contaminated Site on Federal Land record for the Phase I Property, more specifically, the Environmental Health Centre (50 Columbine Driveway). The record lists that 45 m³ of soil was removed from the property between 2009 and 2010 and that an ongoing monitoring program is in place to ensure risks to human health and the environment remain neutralized, as it was determined from an assessment in 2009-2010 that natural attenuation of contamination is occurring at the site.

No further action was listed in the record. The Contaminated Sites on Federal Land record is considered to contribute to the environmental concern on the southeast corner of the Environmental Health Centre building.

The ERIS report identified two Waste Generator records for the Phase I Property, one of which pertains to the Environmental Health Science Research Bureau (50 Columbine Driveway) and the other to the Brooke Claxton Building (70 Columbine Driveway). The records are dated 2016 and 2021 with the listed waste class being strictly aliphatic solvents. These waste generator records are not considered to be representative of an environmental risk to the Phase I Property.

The ERIS report identified two Ontario Spills records for the Phase I Property. Both of which pertain to glycol/oil spills of less than 3L in November of 2015 and April of 2016, respectively. No environmental impact was expected as a result of the spills in the listing. Based on the small quantity of the spills and no suspected environmental impact, these Ontario spills records are not considered to represent an environmental concern to the Phase I Property.

The ERIS report identified five well records (and three borehole records) for the Phase I Property which are further discussed in the water well records section of this report.

☐ Off-Site Records:

The majority of the remaining records pertaining to the Tunney's Pasture government office complex describe various classes of waste products generated throughout the surrounding Tunney's Pasture government office complex. Based on the low quantities generated, as well as their physical separation distances, the generation of these waste products are not considered to pose an environmental concern to the Phase I Property.

A number of these records describe various spill events recorded throughout the surrounding Tunney's Pasture government office complex. A review of these records determined that these spills pertained primarily to airborne releases of various refrigerant chemicals, or pertained to minor quantities (<10 L) of oil related products spilled directly onto a ground surface which were instantly contained and cleaned up. As a result, these records are not considered to pose an environmental concern to the Phase I Property.

Based on the nature of their activity, their significant separation distances, and/or their down-gradient or cross-gradient orientations with respect to the known groundwater flow to the north, none of the off-site records are considered to pose an environmental concern to the Phase I Property.

Previous Engineering Reports

Numerous engineering investigations and assessments have been previously carried out for the various parcels comprising the Tunney's Pasture complex. A review was carried out of the reports done for the Phase I Property and immediately adjacent parcels to the Phase I Property, with a brief summary provided below:

Brooke Claxton Building

- ❑ *"Phase I Environmental Site Assessment – Brooke Claxton Building (Building 9), Tunney's Pasture, Ottawa, Ontario"* prepared by DST Consulting Engineers, dated March 1997.

According to the historical research, the subject site was historically used for agricultural purposes until first developed with the existing commercial office building sometime in the 1960's. The use of the subject site had not changed significantly since the time of construction. While no potential environmental concerns were identified with respect to the use of the subject site, a 2,275L AST was identified in the electrical vault room on the southeast corner of the subject building (in the basement). The tank was noted to be in good condition with no signs of leakage. Additionally, it was reported that a minor fuel spill incident occurred on the adjacent site to the east at the Environmental Health Centre building. The former fuel tank was removed from that site, along with an unspecified volume of contaminated soil, however due to its close proximity, it was recommended that a subsurface investigation be conducted to determine if any fuel contamination had migrated onto the subject site.

Although it was not considered an APEC at the time of the 1997 Phase I ESA, the presence of the AST in the basement of the subject building is considered to represent environmental concern on the Phase I Property (APEC 1). Additionally, the former fuel tank on the Environmental Health Centre portion of the Phase I Property is considered to represent an environmental concern (APEC 4).

Virus Lab

- *“Phase II Environmental Site Assessment – Virus Lab (Building 10), Tunney’s Pasture, Ottawa, Ontario”* prepared by Jacque Whitford Environmental Limited, dated October 1999.

As part of the subsurface investigation, one borehole was drilled through the basement floor slab in the southern wing of the building to determine the presence of a potentially PAH containing waterproofing membrane under the floor and assess the potential for soil impacts from a suspected, former heating oil UST. No membrane was encountered during the drilling program. A soil sample collected from underneath the floor slab was submitted for laboratory testing of PAHs, which confirmed the absence of any such parameters.

Four test pits were also excavated in the vicinity of the southwest corner of the northern wing of the building to assess for potential soil impacts related to a former heating oil underground fuel storage tank, reportedly removed in 1992. It was reported that approximately 21 metric tonnes of impacted soil had been previously removed the area surrounding the UST, in conjunction with the tank removal. However, no soil analytical results were available to determine whether any impacted soil remained in the vicinity of the former UST. No visual evidence of any contamination was identified during the field program. Four soil samples were submitted for laboratory testing of BTEX, PHCs, and PAH parameters. Based on the test results, all analyzed parameters satisfied the site standards and no further work was recommended.

The former heating oil UST is considered to represent an APEC on the Phase I Property (APEC 2).

Environmental Health Centre

- *“Phase I Environmental Site Assessment – Environmental Health Centre (Building 8), Tunney’s Pasture, Ottawa, Ontario”* prepared by Robinson Consultants, dated March 2000.

According to the historical research, the subject site was historically used for agricultural purposes until first developed with the existing commercial office building sometime in the 1960’s. The use of the subject site had not changed significantly since the time of construction. It was reported that an underground fuel storage tank, along with an unspecified volume of contaminated soil, was removed/replaced from the vicinity of the subject building in 1991, however, no documentation on this removal was available for review.

It was recommended that a subsurface investigation be made to confirm the soil and groundwater quality in the vicinity of the former underground fuel storage tank. Additionally, during the site inspection, a double wall UST was identified near the southeast corner of the subject building.

The former diesel USTs are considered to represent an APECs on the Phase I Property (APEC 4 and APEC 5).

- *“Phase II Environmental Site Assessment and Screening Level Risk Assessment – Environmental Health Centre (Building 8), Tunney’s Pasture, Ottawa, Ontario”* prepared by Trow Consulting Engineers Ltd., dated April 2003.

The subsurface investigation for this assessment was conducted in January 2003 and consisted of drilling six (6) interior and eight (8) exterior boreholes across the subject site, four of which were instrumented with groundwater monitoring well installations to access the water table. Based on the soil and groundwater testing, petroleum hydrocarbon impacted soil was identified outside and under the floor slab of the loading bay of the building. Impacted groundwater was also identified under the floor slab, in the location of a former heating oil underground storage tank, and in the shallow bedrock outside of the loading bay.

The impacted soil and groundwater plume are considered to represent an APEC on the Phase I Property (APEC 3).

- *“Supplemental Phase III Environmental Site Assessment – Environmental Health Centre (Building 8), Tunney’s Pasture, Ottawa, Ontario”* prepared by Trow Consulting Engineers Ltd., dated March 2005.

Subsurface assessment work conducted by Trow in 2003 and 2004 consisted of drilling nine (9) exterior and twelve (12) interior boreholes across the subject site, nine of which were instrumented with groundwater monitoring wells. Based on the soil and groundwater testing, the lateral extent of the soil contamination was estimated to be both inside and outside of the building footprint (approx. 44 m³ in volume), while both the overburden and bedrock groundwater beneath the building footprint was found to be impacted. Another two interior and nine exterior boreholes were later drilled to better delineate the area of impact. The estimated lateral extent of the impacted groundwater in shallow bedrock was also determined to be further east of the subject building. Following the investigation, it was recommended that remedial and risk management options be evaluated to determine which is more suitable.

The impacted soil and groundwater plume are considered to represent an APEC on the Phase I Property (APEC 3).

- ❑ *“Groundwater Monitoring and Natural Attenuation, Tunney’s Environmental Health Centre (Building 8), Tunney’s Pasture, Ottawa, Ontario”* prepared by Trow Consulting Engineers, dated March, 2007.

As previously discussed, groundwater sampling identified a dissolved phase PHC bedrock groundwater plume on the subject property. A 5-year monitored natural attenuation (MNA) program was recommended with the objective of meeting the Atlantic guidelines of 20mg/L for PHCs (F1-F4) in groundwater. Ten groundwater monitoring wells were included in the 2006 and 2007 sampling programs, with samples collected four times for each program. No free-phase product was measured in the wells and groundwater flow measurements indicated flow to the west, towards the subject building. Groundwater samples were submitted for BTEX and PHC analysis. BTEX parameters did not exceed criteria in any of the well, while one well in the centre of the plume identified PHC concentrations above the Atlantic guidelines. Lines of evidence indicated natural attenuation was likely occurring at the subject property and westward migration of the plume may be occurring. Continuation of the MNA program was recommended.

The impacted soil and groundwater plume are considered to represent an APEC on the Phase I Property (APEC 3).

- ❑ *“Environmental Compliance Audit – Environmental Health Centre (Building 8), Tunney’s Pasture, Ottawa, Ontario”* prepared by AECOM, dated 2008.

The compliance audit noted the presence of a 2,250L diesel UST located adjacent to the southeast corner of the subject building, reportedly installed in 1991 to replace the former leaking UST.

The former diesel USTs are considered to represent an APECs on the Phase I Property (APEC 4 and APEC 5).

- ❑ *“Confirmatory Soil Sampling-UST Decommissioning, Environmental Health Centre (Building 8), Tunney’s Pasture, Ottawa, Ontario”* prepared by DST, dated April 15, 2010.

Confirmatory soil sampling was conducted following the removal of a diesel UST in March 2010, located at the southeast corner of the subject building. No leaks were identified in the UST or the piping, no staining or odours were observed, and groundwater was not encountered in the 3 m deep excavation.

The tag on the UST indicated a double-walled fibreglass UST, manufactured in 1990, with a capacity of 2,295L. Seven soil samples were submitted for analytical testing of PHCs and BTEX, all of which returned results below the method detection limit and determined to meet the applicable CCME guidelines. No groundwater samples were collected as part of this confirmatory sampling.

The former diesel USTs are considered to represent an APECs on the Phase I Property (APEC 4 and APEC 5).

- ❑ *“Phase II Environmental Site Assessment, Tunney’s Pasture Complex (DFRP 08752), Buildings #6 Laboratory Centre for Disease Control, #8 Environmental Health Centre, #10 Former Virus Laboratory, #12 Animal Breeding Building, #17/23 Occupational Health Unit and #22 Sir Frederick Banting Research Centre, Ottawa, Ontario” prepared by Geofirma Engineering Ltd., dated March 31, 2014.*

The subsurface investigation for the Environmental Health Centre portion of this assessment consisted of drilling three boreholes near the on-site loading docks and laboratory areas, two of which were instrumented with groundwater monitoring well installations to access the water table. Soil and groundwater were sampled for metals, PAHs, VOCs, PHCs and glycol. Additionally, groundwater samples for BTEX/PHC analysis from wells already existing on the site to evaluate the status of a historic PHC plume on the property caused by a spill of diesel from a storage tank on the roof which entered the drain system, as well as by leakage from a former diesel UST located near the loading dock area (southeast corner of subject building).

Overall, soil results showed some low-level concentrations of PAH, PHC and metals parameters, but were generally in compliance with CCME guidelines for soil quality (there were exceedances of PAHs for CCME guidelines but strictly for values protective of aquatic health, no exceedances for human health guidelines were identified). The PHC plume was noted to remain on the subject property, with exceedances of both the CCME and MOE Standards. It is Geofirma’s opinion that the plume appears to be migrating to the north, north-east which corresponds with groundwater measurements taken during previous assessments, however, the integrity of several wells on site is questionable, and the results for both groundwater flow and groundwater quality are inconsistent with previous results. As a result, the status and migration of the PHC plume is difficult to interpret.

Inspection and repair of flush-mount casings for all wells on the subject property was recommended. Following the repairs, a complete round of groundwater sampling for BTEX and PHC parameters was recommended (with certain wells to be sampled for natural attenuation parameters).

- ❑ *“Supplemental Phase III ESA – Tunney’s Environmental Health Centre Building #8 DFRP#50064, Ottawa, Ontario”* prepared by Arcadis., dated January 6, 2016.

The investigation consisted of drilling five boreholes, all of which were completed with groundwater monitoring wells. Soil and groundwater samples (groundwater from the newly installed monitoring wells and existing wells from previous investigations) were submitted for analysis of BTEX, PHCs, PAHs and/or monitored natural attenuation parameters. Exceedances of both PHC and PAHs were detected in the soil and groundwater on the subject property. PAH impacts in groundwater were not expected to extend off site, given their low solubility and mobility. The PAH exceedances were proposed to be associated with poor quality fill at the site. Chemical and geochemical parameters indicated that natural attenuation of the PHC plume is occurring at the site, supported by a decrease in PHC concentration observed at the site and low dissolved oxygen and oxidation-reduction potential in the PHC-impacted area, in comparison to up-gradient locations.

Excavation and removal of contaminated soil at the time of the building demolition was recommended.

The former diesel USTs and known impacted soil and groundwater plume (and on-site AST) are considered to represent an APECs on the Phase I Property.

- ❑ *“Supplemental Phase III ESA – Tunney’s Pasture – EHC Building, 50 Columbine Driveway, Ottawa, Ontario”* prepared by Golder Associates, dated March, 2017.

The objective of this assessment was to identify existing data gaps in groundwater investigation that had previously been completed for the subject property and re-evaluate analytical data considering future mixed residential/commercial land use of the property.

PHC concentrations above the MOE Table 7 Standards (but below the Tier 1 FIGQGs) were identified in the monitoring well nearest to the suspected source of contamination.

Benzene concentrations above the MOE Table 7 Standards (but below the Tier 1 FIGQGs) were identified in three monitoring wells located to the east/northeast of the subject building. Various PAH concentrations above the Tier 1 FIGQGs were identified in the monitoring well nearest to the suspected source of contamination (and two other locations), however the concentrations comply with the MOE Table 7 Standards. PAH exceedances across the site were attributed to poor fill quality.

No subsurface soil investigation was conducted as part of the 2017 Golder Phase II ESA.

Golder recommended the semi-annual monitoring of the on-site sump pit connected to the municipal storm sewer network and the monitoring well closest to the suspected source of contamination for PHCs, BTEX and PAHs.

The former diesel USTs and known impacted soil and groundwater plume (and on-site AST) are considered to represent an APECs on the Phase I Property.

Site-Wide Investigation

- *"Phase One Environmental Site Assessment – Tunney's Pasture Complex, Ottawa, Ontario"* prepared by Stantec Consulting Ltd., dated January 30, 2020.

In 2020, Stantec conducted a Phase I ESA for the entirety of the Tunney's Pasture complex, including the current Phase I Property. During the review of historical information, as well as a site inspection, several APECs were identified across the site. A brief summary of the APECs identified on the respective parcels comprising the Phase I Property are outlined below:

Building #8 – Environmental Health Centre

- One 2,270 L diesel AST, located on the east side of the building;
- Former contamination of soil and groundwater in the loading dock area, associated with former USTs and/or chemical handling in this area;
- Current and former use and storage of laboratory chemicals inside the building.
- Fill material of unknown quality, located throughout the site.

Building #9 – Brooke Claxton Building

- Exterior fill pipes, located at the southeast corner of the building, used for the diesel ASTs in the basement generator room;
- Exterior diesel-powered generator, located at the northeast corner of the building;
- Fill material of unknown quality, located throughout the site.

Building #10 – Former Virus Laboratory Building

- Fill material of unknown quality, located throughout the site;
- Former heating oil UST, located within the footprint of the former building;
- Former use and storage of laboratory chemicals inside the former building.

Stantec identified recommended that a Phase II ESA be conducted to assess the soil and groundwater quality throughout the site.

4.3 Physical Setting Sources

Historical aerial photographs of the Phase I Study Area were obtained from the National Air Photo Library and reviewed in approximate ten year intervals, beginning with the earliest available photograph. Based on a review of these photographs, the following observations have been made:

1928	The Phase I Property, as well as the neighbouring lands to the north, west and south appear to be vacant at this time. Residential and commercial buildings are present to the east of the Phase I Property. Parkdale Avenue is present adjacent to the east of the Phase I Property.
1945	A structure has been developed on the southeast corner of the Phase I Property. No significant changes are apparent with respect to the surrounding lands since the time of the previous aerial photograph.
1953	No significant changes are apparent with respect to the Phase I Property since the time of the previous aerial photograph (it should be noted that only the southwest portion of the Phase I Property is visible in the 1953 aerial photograph). The neighbouring lands to the south appear to be undergoing development with the existing government office complex.

-
1965	The structure on the southeast portion of the Phase I Property has been demolished and three separate government office buildings have been developed on the west, central and east portions of the Phase I Property. Surrounding properties to the south of the Phase I Property have continued undergoing development with the existing government office complex. Goldenrod Driveway adjacent to the north and west of the Phase I Property, Columbine Driveway, adjacent to the south of the Phase I Property and Sir John A MacDonald Parkway, approximately 70m to the north of the Phase I Property, and are all present at this time.
1976	An addition to the north face of the westernmost building on the Phase I Property has been completed. Surrounding properties have continued undergoing development with the existing government office complex.
1991	No significant changes are apparent with respect to the Phase I Property since the time of the previous aerial photograph. Several properties to the east of the Phase I Property have undergone commercial redevelopment.
2005	The westernmost building on the Phase I Property has been demolished and a parking lot has been constructed in its place. An addition has been constructed to the south face of the government building approximately 50m south of the Phase I Property. The government building approximately 80m southwest of the Phase I Property has been demolished and the area appears to be used as a parking lot.
2015	A soil disturbance can be seen on the west portion of the Phase I Property. The government building approximately 135m west of the Phase I Property has been demolished and the area appears to be used as a parking lot.
2021	No significant changes are apparent with respect to the Phase I Property since the time of the previous aerial photograph. The property approximately 25m southeast is undergoing redevelopment with a multi-storey assumed residential building. The government buildings approximately 55 m south of the Phase I Property has been demolished and the lands appears to be vacant. The Phase I Property and the surrounding lands appear as they exist today.

Copies of the aerial photographs selected for review are included in Appendix 1.

Geological Maps

Geological mapping information for the Phase I Property was obtained from The Geological Survey of Canada – Urban Geology of the National Capital Area and reviewed as part of this assessment.

Based on the available mapping information, the bedrock beneath the Phase I Property generally consists of interbedded limestone and dolomite of the Gull River and Bobcaygeon Formations. The surficial geology consists of primarily Paleozoic bedrock and small areas of sand dunes and till, with an overburden ranging from approximately 0 m to 3 m in thickness.

Topographic Maps

A topographic map of the Phase I Property was obtained from the Natural Resources Canada – The Atlas of Canada website and reviewed as part of this assessment.

The topographic map indicates that the general elevation of the Phase I Property is approximately 60 m above sea level, while the regional topography within the greater area is depicted as sloping downwards to the northwest, in the general direction of the Ottawa River.

An illustration of the referenced topographic map is presented on Figure 2 – Topographic Map, appended to this report.

Physiographic Maps

A physiographic map was obtained from the Natural Resources Canada – The Atlas of Canada website and reviewed as a part of this assessment. According to the publication and available mapping information, the Phase I Property is situated within the St. Lawrence Lowlands. According to the description provided: “...*the lowlands are plain-like areas that were affected by the Pleistocene glaciations and are therefore covered by surficial deposits and other features associated with the ice sheets.*” The Phase I Property is specifically located within the Central St. Lawrence Lowland area, which is rarely more than 150 m above sea level.

Water Bodies

No water bodies are present on the Phase I Property. The nearest named water body with respect to the Phase I Property is the Ottawa River, located approximately 230 m to the north.

MECP Water Well Records

A search of the MECPs website for all drilled well records within a 250 m radius of the Phase I Property was conducted as part of this assessment. The search identified five well records for the Phase I Property, all of which pertain to monitoring wells installed in April of 2015. The monitoring wells were installed on the east portion of the Phase I Property and pertain to the known PHC plume further discussed in the previous engineering reports section of this assessment. According to the well records, the overburden stratigraphy in the vicinity of the Phase I Property generally consists of sand and gravel overtop of limestone. Limestone bedrock was generally encountered at depths ranging from 0.91 to 1.22m below ground surface.

The search identified five well records for surrounding properties within the Phase I Study Area. These records pertain to wells installed (or abandoned) between 2007 and 2018, used for groundwater observation purposes. Based on the availability of municipal services, no viable drinking water wells are anticipated to be present within the Phase I Study Area.

Based on the availability of municipal services, no viable drinking water wells are anticipated to be present within the Phase I Study Area.

The aforementioned well records have been included in Appendix 2.

5.0 INTERVIEWS

Property Owner Representative

Ms. Nathalie Labelle, with Public Services and Procurement Canada was contacted via email to respond to questioning about the environmental history of the Phase I Property.

Ms. Labelle stated that the Brooke Claxton building on the Phase I Property was built as a high-rise office building and has remained as such since its construction. According to Ms. Labelle, the Brooke Claxton building last underwent a refit in 1995 and that all heating and cooling for the subject building is supplied from the Tunney's Pasture Central Heating and Cooling Plant, located approximately 250 m to the south, and that no fuel tanks are present on the property.

Ms. Labelle was unaware of any potential environmental concerns associated with the historical and current use of the Brooke Claxton building.

6.0 SITE RECONNAISSANCE

6.1 General Requirements

A site inspection was conducted for the Phase I Property on April 12, 2023, between 12:00 PM and 1:00 PM. Weather conditions were overcast, with a temperature of approximately 10 °C. Mr. Nick Sullivan, from the Environmental Department of Paterson Group, conducted the inspection. It should be noted that access to the 50 Columbine Driveway (Environmental Health Centre) was not available at the time of the site inspection.

In addition to the Phase I Property, the uses of neighbouring properties within the Phase I Study Area were also assessed at the time of the site inspection.

6.2 Specific Observations at the Phase I Property

Site Description

The west portion of the Phase I Property (former virus laboratory) consists of a paved asphaltic concrete parking lot and landscaped areas.

The portion of the Phase I Property addressed 70 Columbine Driveway is currently occupied by an 18-storey high rise office building (Brooke Claxton building) and several ground floor loading bay that connects to the neighbouring property/building to the east, and a paved asphaltic concrete parking lot, with a landscaped area to the north.

The portion of the Phase I Property addressed 50 Columbine driveway is currently occupied by a three-storey government building (Environmental Health Centre), a ground floor parking structure (larger footprint than the building) that connects to the neighbouring property/building to the west, a paved asphaltic concrete parking lot and landscaped area to the east and north, respectively. It should be noted that at the time of the site inspection, the 50 Columbine Driveway portion of the Phase I Property (Environmental Health Centre) was undergoing demolition and access was not made available.

The site topography is relatively flat, while the regional topography appears to slope down towards the northwest, in the general direction the Ottawa River. The Phase I Property is considered to be at grade with respect to the surrounding properties.

Water drainage on the Phase I Property occurs via surface run-off towards catch basins present within the parking lot and on the adjacent streets, as well as via infiltration within the landscaped areas.

No ponded water, stressed vegetation, surficial staining, or any other indications of potential sub-surface contamination were observed on the Phase I Property at time of the site inspection.

A depiction of the Phase I Property is illustrated on Drawing PE6040-1 – Site Plan, in the Figures section of this report.

Buildings and Structures

The Phase I Property is currently occupied by two buildings, a high rise office building (Brooke Claxton building) and a government building (Environmental Health Centre), the building are connected on the ground level via a parking structure.

The portion of the Phase I Property addressed 70 Columbine Driveway is occupied by an 18-storey high rise office building with a ground floor parking structure (connected to the Environmental Health Centre) and one-storey basement. Built in the mid 1960's, the Brooke Claxton building is constructed with a concrete foundation and is finished on the exterior with steel and pre-cast concrete panels, in addition to a modified bituminous style roof. The building is currently heated via a natural gas-fired boiler system, supplied from the Tunney's Pasture Central Heating and Cooling plant approximately 250 m to the south.

The portion of the Phase I Property addressed 50 Columbine Driveway is occupied by a three-storey government building with a penthouse, a ground floor parking structure (connected to the Brooke Claxton building) and a single-storey basement. Built in the mid 1960's, the Environmental Health Centre is constructed with a concrete foundation and is finished on the exterior with metal and pre-cast concrete panels, in addition to a modified bituminous style roof. The building was in the process of being demolished at the time of the site inspection and is assumed to not currently be serviced.

Potential Environmental Concerns

❑ Fuels and Chemical Storage

An in-use, single-walled, diesel aboveground storage tank (AST) was observed adjacent to the northeast of the Brook Claxton building on the Phase I Property. The tank was installed in 2013 and has a capacity of 5,700 L. The AST is situated atop a concrete containment basin and is used to run an emergency generator. Approximately once a month the generator is turned on to ensure it is still in working order. The AST was noted to be in good condition at the time of the site inspection, with no signs of spills or staining observed in the vicinity of the tank. The presence of this tank is considered to represent an APEC on the Phase I Property (APEC 6).

Vent and fill pipes were observed protruding from the south face of the Brooke Claxton building. The vent and fill pipes and ground beneath them were noted to be in good condition at the time of the site inspection, with no visual or olfactory signs of contamination noted. The vent and fill pipes are considered to attribute to the APEC on the Phase I Property from the associated aboveground storage tanks.

No signs of underground storage tanks (USTs) were observed on the exterior of the Phase I Property at the time of the site inspection.

❑ Hazardous Materials and Unidentified Substances

At the time of the site inspection, no hazardous materials, unidentified substances, spills, surficial staining, abnormal odours, stressed vegetation, or any other indications of potential sub-surface contamination were observed on the exterior of the Phase I Property.

❑ Polychlorinated Biphenyls (PCBs) and Transformer Oil

At the time of the site inspection, no electrical transformers or any other potential sources of PCBs or transformer oil were identified on the exterior of the Phase I Property.

☐ **Waste Management**

At the time of the site inspection, all solid, non-hazardous waste materials and recyclables were observed to be stored in metal bins on the northwestern corner of the Brooke Claxton building and are collected on a regular basis by a licensed contractor. No environmental concerns were noted with respect to waste management practices on the Phase I Property.

Interior Assessment

A general description of the interior of the subject building is as follows:

- ☐ The floors consist of poured ceramic tile, concrete and carpet;
- ☐ The walls consist of drywall and concrete block;
- ☐ The ceilings consist of drywall and suspended ceiling tiles;
- ☐ Lighting throughout the building is provided by incandescent, LED, and fluorescent light fixtures.

It should be noted that at the time of the site inspection, access to the common areas of the Brooke Claxton building were not made available for review. Additionally, access to the Environmental Health Centre building was not available at the time of the site inspection as it was in the process of being demolished.

Potentially Hazardous Building Products

☐ **Asbestos-Containing Materials (ACMs)**

Based on the date of construction of the Brooke Claxton building (circa mid 1960's), it is possible that asbestos containing materials (ACMs) are present within the subject structure.

At the time of our site inspection, building materials were observed to be in good condition and do not represent an immediate concern to the building's occupants. In speaking with building staff during the site inspection, it is our understanding that an annual inspection is carried out to document the status of all identified ACMs in the subject building.

☐ **Lead-Based Paints**

Based on the age of the Brooke Claxton building (circa mid 1960's), lead-based paints may be present inside the structure, on any original or older painted surfaces. Painted surfaces were generally observed to be in good condition at the time of the site inspection and do not represent an immediate concern to the occupants.

☐ **Polychlorinated Biphenyls (PCBs) and Transformer Oil**

Two liquid, three phase transformers were identified in the basement of the Brooke Claxton building. Each transformer was noted to have an approximate capacity of 1,499 L and were situated atop respective concrete containment basins. The transformers were noted to be in good condition at the time of the site inspection, with no signs of spills or staining observed in the vicinity of the transformers. The presence of these transformers is considered to represent an environmental concern to the Phase I Property (APEC 7).

☐ **Urea Formaldehyde Foam Insulation (UFFI)**

At the time of the site inspection, UFFI was not observed inside the subject building, however, wall cavities were not exposed to allow for the inspection of insulation type.

Other Potential Environmental Concerns

☐ **Interior Fuel and Chemical Storage**

An in-use, double-walled, vacuum sealed, coloured diesel aboveground storage tank (AST) was observed within the southeast corner of the basement of the Brooke Claxton building on the Phase I Property. The tank was installed in 2008 and has a capacity of 2,275 L. The AST is situated on the concrete floor and is used to run an emergency generator. Approximately once a year the tank is refilled and approximately once a month the generator is turned on to ensure it is still in working order. The AST was noted to be in good condition at the time of the site inspection, with no signs of spills or staining observed in the vicinity of the tank. The presence of this tank is considered to represent an environmental concern to the Phase I Property (APEC 1).

Two in-use, double walled, vacuum sealed, coloured diesel ASTs were observed within the southeast corner of the basement of the Brooke Claxton Building on the Phase I Property (associated with the vent and fill pipes identified on the south face of the Brooke Claxton building). The tanks were installed in 2008 and each have a capacity of 1,000 L. The ASTs are situated atop a concrete pad and a large concrete block and are used as day tanks. The ASTs were noted to be in good condition at the time of the site inspection, with no signs of spills or staining observed in the vicinity of the tank. The presence of these tanks are considered to represent an environmental concern to the Phase I Property (APEC 1).

Chemical products identified in the subject building were observed to be predominantly limited to domestically available cleaning products, stored properly in their original containers.

☐ Ozone Depleting Substances (ODSs)

Potential sources of ODSs observed on-site include fire extinguishers and refrigerators. These appliances appeared to be in good condition at the time of the site inspection and should be regularly serviced by a licensed contractor.

☐ Wastewater Discharges

Floor drains and a sump pit were observed in the basement of the Brooke Claxton building. Water in the floor drains was noted to be clear and odourless at the time of the site inspection. Access to the sump pit was not available at the time of the site inspection. No odours or staining were noted in the general area of the sump pit at the time of the site inspection.

Wastewater from the subject building (wash water and sewage) is discharged into the City of Ottawa sanitary sewer system, whereas roof drainage is discharged via surface run-off towards catch basins located on the adjacent streets, which drain into the City of Ottawa storm water sewer system.

Neighbouring Properties

At the time of the site inspection, a survey of the neighbouring properties was conducted from publicly accessible roadways.

Land use adjacent to the Phase I Property was observed as follows:

- North:* Goldenrod Driveway, followed by vacant land and Sir John A Macdonald Parkway.
- East:* Parkdale Avenue, followed by residential and commercial buildings.
- South:* Columbine Driveway, followed by a government office building (Laboratory Centre for Disease Control) and parking lots.
- West:* Goldenrod Driveway, followed by vacant land and Sir John A Macdonald Parkway.

The property addressed 140 Hinchey Avenue, approximately 210m southeast of the Phase I Property was identified as an automotive service garage. Given the separation distance with respect to the Phase I Property, the automotive service garage is not considered to represent an environmental concern on the Phase I Property. No environmental concerns were identified with respect to the current use of the remaining adjacent properties.

The neighbouring land use within the Phase I Study Area is depicted on Drawing PE6040-2 – Surrounding Land Use Plan, in the Figures section of this report.

7.0 REVIEW AND EVALUATION OF INFORMATION

7.1 Land Use History

Based on a review of available historical information, the land use history of the Phase I Property is summarized below in Table 1.

Table 1 Land Use History – Tunney's Pasture (Block 10), Ottawa, Ontario			
Time Period	Land Use	Description	Observations
Prior to 1928	Agricultural or Other Use	Vacant Land	No historical information available prior to this time period. The Phase I Property is considered to be vacant land.
1928-1950's	Agricultural or Other Use	Vacant Land	Aerial photographs from the 1920's to the early 1950's depict the Phase I Property as vacant land during this time period.
1950's-Present	Commercial (Government) Use	Brooke Claxton Building, Environmental Health Centre, Virus Lab (demolished)	Aerial photographs from the mid 1960's to the present day, as well as previous engineering reports and a site inspection, confirm the presence of the Brooke Claxton building, the environmental Health Centre. The Virus Lab was present from the mid 1960's to the mid 2000's.

Potentially Contaminating Activities (PCAs)

Based on the findings of the Phase I ESA, nine potentially contaminating activities (PCAs), resulting in areas of potential environmental concern (APECs), were identified on the Phase I Property.

As per Table 2 – Column A of O. Reg. 153/04, as amended, the PCAs resulting in APECs on the Phase I Property are described as follows:

- ☐ Item 28: Gasoline and Associated Products Storage in Fixed Tanks; associated with the presence of the former on-site USTs and former/existing on-site ASTs (APEC 1, APEC 2 and APEC 4 to APEC 6)
- ☐ Item N/A: Known Area of PHC, BTEX and/or PAH Impacted Soil and Groundwater; associated with the known impacted soil and groundwater plume resultant from a former leaking UST (APEC 3).

- ☐ Item 55: Transformer Manufacturing, Processing and Use; associated with the presence of the two existing on-site transformers (APEC 7).
- ☐ Item 30: Importation of Fill Material of Unknown Quality; associated with the potential presence of poor-quality fill material used for grading purposes, located throughout the Phase I Property (APEC 8)
- ☐ Item N/A: Application of Road Salt for De-icing Purposes During Snow and Ice Conditions; associated with the use of road salt throughout the asphalt-covered parking lot occupying the western, north-central and eastern portions of the Phase I Property (APEC 9).

Two other off-site PCA (associated with the same property) were identified within the Phase I Study Area, which are described as follows:

- ☐ Item 28: Gasoline and Associated Products Storage in Fixed Tanks; associated with the former retail fuel outlet at the property addressed 140 Hinchey Avenue, approximately 210 m southeast of the Phase I Property.
- ☐ Item 52: Storage, maintenance, fueling and repair of equipment, vehicles, and material used to maintain transportation systems; associated with the presence of an existing automotive service at the property addressed 140 Hinchey Avenue, approximately 210 m southeast of the Phase I Property.

Based on their separation distances, as well as their down-gradient orientation with respect to the anticipated groundwater flow to the north, these activities are not considered to pose an environmental concern to the Phase I Property.

Areas of Potential Environmental Concern (APECs)

The areas of potential environmental concern identified in this Phase I ESA are summarized below in Table 2:

Table 2
Areas of Potential Environmental Concern

Area of Potential Environmental Concern	Location of APEC on Phase I Property	Potentially Contaminating Activity (Table 2 – O. Reg. 153/04)	Location of PCA (On-Site or Off-Site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, Soil, and/or Sediment)
APEC 1 Three Existing On-Site Coloured Diesel Aboveground Storage Tanks (and associated vent and fill pipes x 2)	South-central portion of Phase I Property	<i>"Item 28: Gasoline and Associated products Storage in Fixed Tanks"</i>	On-Site	PHCs (F ₁ -F ₄) BTEX	Soil and Groundwater
APEC 2 Former On-Site Heating Oil Underground Storage Tank	West-central portion of Phase I Property	<i>"Item 28: Gasoline and Associated products Storage in Fixed Tanks"</i>	On-Site	PHCs (F ₁ -F ₄) BTEX PAHs	Soil and Groundwater
APEC 3 On-Site Impacted Soil and Groundwater Plume	East portion of Phase I Property	<i>"Item N/A: Known Impacted Groundwater Plume"</i>	On-Site	PHCs (F ₁ -F ₄) BTEX PAHs	Groundwater
APEC 4 Former On-Site Diesel Underground Storage Tank and Existing On-Site Aboveground Storage Tank	Southeast portion of Phase I Property	<i>"Item 28: Gasoline and Associated products Storage in Fixed Tanks"</i>	On-Site	PHCs (F ₁ -F ₄) BTEX	Soil and Groundwater
APEC 5 Former On-Site Diesel Underground Storage Tank	Southeast portion of Phase I Property	<i>"Item 28: Gasoline and Associated products Storage in Fixed Tanks"</i>	On-Site	PHCs (F ₁ -F ₄) BTEX	Soil and Groundwater
APEC 6 Existing On-Site Diesel Aboveground Storage Tank	South portion of Phase I Property	<i>"Item 28: Gasoline and Associated products Storage in Fixed Tanks"</i>	On-Site	PHCs (F ₁ -F ₄) BTEX	Soil and Groundwater
APEC 7 Existing On-Site Liquid Phase Transformers (x2)	South-central portion of Phase I Property	<i>"Item 55: Transformer Manufacturing, Processing and Use"</i>	On-Site	PHCs (F ₁ -F ₄) BTEX PCBs	Soil

Table 2 Areas of Potential Environmental Concern					
Area of Potential Environmental Concern	Location of APEC on Phase I Property	Potentially Contaminating Activity (Table 2 – O. Reg. 153/04)	Location of PCA (On-Site or Off-Site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, Soil, and/or Sediment)
APEC 8 Fill Material of Unknown Quality	Entirety of Phase I Property	<i>"Item 30: Importation of Fill Material of Unknown Quality"</i>	On-Site	PHCs (F ₁ -F ₄) BTEX Metals PAHs	Soil
APEC 9 Application of Road Salt	Within parking areas of Phase I Property	<i>"Item N/A: Application of Road Salt for De-Icing Purposes During Snow and Ice Conditions"</i>	On-Site	EC SAR	Soil

Contaminants of Potential Concern (CPCs)

The contaminants of potential concern (CPCs) associated with the aforementioned APECs are considered to be:

- ☐ Petroleum Hydrocarbons, fractions 1 – 4 (PHCs F₁-F₄);
- ☐ Benzene, Toluene, Ethylbenzene, and Xylenes (BTEX);
- ☐ Volatile Organic Compounds (VOCs);
- ☐ Polycyclic Aromatic Hydrocarbons (PAHs);
- ☐ Polychlorinated Biphenyls (PCBs);
- ☐ Electrical Conductivity (EC);
- ☐ Sodium Adsorption Ratio (SAR);
- ☐ Metals.

These CPCs have the potential to be present in the soil matrix and/or the groundwater situated beneath the Phase I Property.

7.2 Conceptual Site Model

Geological and Hydrogeological Setting

Based on the available mapping information, the bedrock beneath the Phase I Property generally consists of interbedded limestone and dolomite of the Gull River and Bobcaygeon Formations. The surficial geology consists of primarily Paleozoic bedrock and small areas of sand dunes and till, with an overburden ranging from approximately 0 m to 3 m in thickness.

Groundwater is anticipated to be encountered within the bedrock and flow in a northerly direction towards the Ottawa River.

Water Bodies and Areas of Natural and Scientific Interest

No water bodies are present on the Phase I Property. The nearest named water body with respect to the Phase I Property is the Ottawa River, located approximately 230 m to the north.

No areas of natural and scientific interest are present on the Phase I Property or within the Phase I Study Area.

Drinking Water Wells

Based on the availability of municipal services, no potable drinking water wells are anticipated to remain in use within the Phase I Study Area.

Existing Buildings and Structures

The portion of the Phase I Property addressed 70 Columbine Driveway is occupied by an 18-storey high rise office building with a ground floor parking structure (connected to the Environmental Health Centre) and one-storey basement. Built in the mid 1960's, the Brooke Claxton building is constructed with a concrete foundation and is finished on the exterior with steel and pre-cast concrete panels, in addition to a modified bituminous style roof. The building is currently heated via a natural gas-fired boiler system, supplied from the Tunney's Pasture Central Heating and Cooling plant approximately 250 m to the south.

The portion of the Phase I Property addressed 50 Columbine Driveway is occupied by a three-storey government building with a penthouse, a ground floor parking structure (connected to the Brooke Claxton building) and a single-storey basement. Built in the mid 1960's, the Environmental Health Centre is constructed with a concrete foundation and is finished on the exterior with metal and pre-cast concrete panels, in addition to a modified bituminous style roof. The building was in the process of being demolished at the time of the site inspection and is assumed to not currently be serviced.

Current and Future Property Use

The Phase I Property is currently occupied by an asphalt-covered vehicular parking lot, with some landscaped areas.

The central portion of the Phase I Property is currently occupied by a high rise office building (Brooke Claxton building) and the east portion with a government building (Environmental Health Centre), the building are connect on the ground level via a parking structure. The west portion of the Phase I Property consists of asphalt-covered vehicular parking lot, with some landscaped areas.

It is our understanding that the Phase I Property may be redeveloped for residential purposes in the future. Due to a change in land use to a more sensitive type (commercial to residential), a record of site condition (RSC) will need to be filed with the MECP.

Neighbouring Land Use

The surrounding lands within the Phase I Study Area consist largely of commercial and government properties. Current land use is depicted on Drawing PE6040-2 – Surrounding Land Use Plan, in the Figures section of this report.

Potentially Contaminating Activities and Areas of Potential Environmental Concern

As per Section 7.1 of the Phase I ESA report, nine potentially contaminating activities (PCAs), resulting in areas of potential environmental concern (APECs), were identified on the Phase I Property. These APECs include:

- ☐ Item 28: Gasoline and Associated Products Storage in Fixed Tanks; associated with the presence of the former on-site USTs and former/existing on-site ASTs (APEC 1, APEC 2 and APEC 4 to APEC 6)

- ☐ Item N/A: Known Area of PHC, BTEX and/or PAH Impacted Soil and Groundwater; associated with the known impacted soil and groundwater plume resultant from a former leaking UST (APEC 3).
- ☐ Item 55: Transformer Manufacturing, Processing and Use; associated with the presence of the two existing on-site transformers (APEC 7).
- ☐ Item 30: Importation of Fill Material of Unknown Quality; associated with the potential presence of poor quality fill material used for grading purposes, located throughout the Phase I Property (APEC 8)
- ☐ Item N/A: Application of Road Salt for De-icing Purposes During Snow and Ice Conditions; associated with the use of road salt throughout the asphalt-covered parking lot occupying the western, north-central and eastern portions of the Phase I Property (APEC 9).

Two other off-site PCAs (associated with the same property) were identified within the Phase I Study Area but were deemed not to be of any environmental concern to the Phase I Property based on the separation distance and inferred cross-gradient orientation with respect to the known groundwater flow to the north.

Contaminants of Potential Concern

The contaminants of potential concern (CPCs) associated with the aforementioned APECs are considered to be:

- ☐ Petroleum Hydrocarbons, fractions 1 – 4 (PHCs F₁-F₄);
- ☐ Benzene, Toluene, Ethylbenzene, and Xylenes (BTEX);
- ☐ Volatile Organic Compounds (VOCs);
- ☐ Polycyclic Aromatic Hydrocarbons (PAHs);
- ☐ Polychlorinated Biphenyls (PCBs);
- ☐ Electrical Conductivity (EC);
- ☐ Sodium Adsorption Ratio (SAR);
- ☐ Metals.

These CPCs have the potential to be present in the soil matrix and/or the groundwater situated beneath the Phase I Property.

Assessment of Uncertainty and/or Absence of Information

The information available for review as part of the preparation of this Phase I ESA is considered to be sufficient to conclude that there are PCAs and APECs associated with the Phase I Property.

The presence of any PCAs was confirmed by a variety of independent sources, and as such, the conclusions of this report are not affected by uncertainty which may be present with respect to the individual sources.

8.0 CONCLUSIONS

8.1 Assessment

Paterson Group was retained by IBI Group to conduct a Phase I – Environmental Site Assessment (Phase I ESA) for Block 10 of the Tunney's Pasture government office complex, in the City of Ottawa, Ontario. The objective of this Phase I ESA was to research the past and current use of the site (Phase I Property) and 250 m study area (Phase I Study Area) and to identify any environmental concerns with the potential to have impacted the subject property.

According to the historical research, the Phase I Property was first developed with the Brooke Claxton building, the Environmental Health Centre and the Virus Lab building in the mid 1960's. The virus lab was demolished in the mid 2000's and the west portion of the Phase I Property has functioned as a parking area in its place since that time.

The surrounding lands within the Phase I Study Area have been developed for government purposes as part of the Tunney's Pasture government complex. Two off-site potentially contaminating activities (associated with the same property) were identified within the Phase I Study area, however, due to their separation distances as well as their cross-gradient orientation with respect to the anticipated groundwater flow to the north, these activities are not considered to pose an environmental concern to the Phase I Property.

Presently, the central portion of the Phase I Property is occupied by a high-rise office building (Brooke Claxton building) and the east portion with a government building (Environmental Health Centre), the buildings are connected on the ground level. It should be noted that at the time of the site inspection, the 50 Columbine Driveway portion of the Phase I Property (Environmental Health Centre) was undergoing demolition and access was not made available. The west portion of the Phase I Property consists of asphalt-covered vehicular parking lot, with some landscaped areas.

The surrounding lands consist of mainly of government office building, parkland, and residential land. The present-day use of the neighbouring properties are not considered to pose an environmental concern to the Phase I Property.

Based on our review of the historical and current uses of the site, the following areas of potential environmental concern (APECs) were identified on the Phase I Property.

Areas of Potential Environmental Concern					
Area of Potential Environmental Concern	Location of APEC on Phase I Property	Potentially Contaminating Activity (Table 2 – O. Reg. 153/04)	Location of PCA (On-Site or Off-Site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, Soil, and/or Sediment)
APEC 1 Three Existing On-Site Coloured Diesel Aboveground Storage Tanks (and associated vent and fill pipes x 2)	South-central portion of Phase I Property	<i>"Item 28: Gasoline and Associated products Storage in Fixed Tanks"</i>	On-Site	PHCs (F ₁ -F ₄) BTEX	Soil and Groundwater
APEC 2 Former On-Site Heating Oil Underground Storage Tank	West-central portion of Phase I Property	<i>"Item 28: Gasoline and Associated products Storage in Fixed Tanks"</i>	On-Site	PHCs (F ₁ -F ₄) BTEX PAHs	Soil and Groundwater
APEC 3 On-Site Impacted Soil and Groundwater Plume	East portion of Phase I Property	<i>"Item N/A: Known Impacted Groundwater Plume"</i>	On-Site	PHCs (F ₁ -F ₄) BTEX PAHs	Groundwater
APEC 4 Former On-Site Diesel Underground Storage Tank and Existing On-Site Aboveground Storage Tank	Southeast portion of Phase I Property	<i>"Item 28: Gasoline and Associated products Storage in Fixed Tanks"</i>	On-Site	PHCs (F ₁ -F ₄) BTEX	Soil and Groundwater
APEC 5 Former On-Site Diesel Underground Storage Tank	Southeast portion of Phase I Property	<i>"Item 28: Gasoline and Associated products Storage in Fixed Tanks"</i>	On-Site	PHCs (F ₁ -F ₄) BTEX	Soil and Groundwater
APEC 6 Existing On-Site Diesel Aboveground Storage Tank	South portion of Phase I Property	<i>"Item 28: Gasoline and Associated products Storage in Fixed Tanks"</i>	On-Site	PHCs (F ₁ -F ₄) BTEX	Soil and Groundwater
APEC 7 Existing On-Site Liquid Phase Transformers (x2)	South-central portion of Phase I Property	<i>"Item 55: Transformer Manufacturing, Processing and Use"</i>	On-Site	PHCs (F ₁ -F ₄) BTEX PCBs	Soil

Areas of Potential Environmental Concern					
Area of Potential Environmental Concern	Location of APEC on Phase I Property	Potentially Contaminating Activity (Table 2 – O. Reg. 153/04)	Location of PCA (On-Site or Off-Site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, Soil, and/or Sediment)
APEC 8 Fill Material of Unknown Quality	Entirety of Phase I Property	<i>"Item 30: Importation of Fill Material of Unknown Quality"</i>	On-Site	PHCs (F ₁ -F ₄) BTEX Metals PAHs	Soil
APEC 9 Application of Road Salt	Within parking areas of Phase I Property	<i>"Item N/A: Application of Road Salt for De-Icing Purposes During Snow and Ice Conditions"</i>	On-Site	EC SAR	Soil

8.2 Recommendations

Based on the findings of this assessment, it is our opinion that **a Phase II – Environmental Site Assessment is required for the Phase I Property.**

The preliminary scope of work proposed for the Phase II ESA consists of the placement of six to eight boreholes across the Phase I Property, all of which will be instrumented with groundwater monitoring wells. The boreholes will be strategically placed for coverage of all identified APECs on the Phase I Property, though the final locations have not yet been established. Proposed analytical testing for both soil and groundwater samples will include petroleum hydrocarbons, benzene, toluene, ethylbenzene, xylenes, metals, volatile organic compounds, polycyclic aromatic hydrocarbons, polychlorinated biphenyls, electrical conductivity, and sodium adsorption ratio.

9.0 STATEMENT OF LIMITATIONS

This Phase I – Environmental Site Assessment report has been prepared in general accordance with O.Reg. 153/04, as amended, and meets the requirements of CSA Z768-01 (reaffirmed 2022). The conclusions presented herein are based on information gathered from a limited historical review and field inspection program. The findings of the Phase I ESA are based on a review of readily available geological, historical, and regulatory information as well as a cursory review made at the time of the field assessment. The historical research relies on information supplied by others, such as local, provincial, and federal agencies and was limited within the scope-of-work, time, and budget of the project herein.

Should any conditions be encountered at the Phase I Property and/or historical information that differ from our findings, we request that we be notified immediately in order to allow for a reassessment.

This report was prepared for the sole use of IBI Group and the Government of Canada. Permission and notification from the above noted parties and Paterson Group will be required prior to the release of this report to any other party.

Paterson Group Inc.



Jeremy Camposarcone, B.Eng.



Adrian Menyhart, P.Eng., QP_{ESA}



Report Distribution:

- ☐ IBI Group
- ☐ Paterson Group Inc.

10.0 REFERENCES

Federal Records

- ☐ Natural Resources Canada: Air Photo Library.
- ☐ Natural Resources Canada: The Atlas of Canada.
- ☐ Geological Survey of Canada: Surficial and Subsurface Mapping.
- ☐ Environment Canada: National Pollutant Release Inventory.
- ☐ National Archives of Canada.

Provincial Records

- ☐ MECP: Freedom of Information and Privacy Office.
- ☐ MECP: Municipal Coal Gasification Plant Site Inventory, 1991.
- ☐ MECP: Waste Disposal Site Inventory, 1991.
- ☐ MECP: Brownfields Environmental Site Registry.
- ☐ MECP: Water Well Inventory.
- ☐ MECP: Ontario PCB Waste Storage Site Inventory, 1995.
- ☐ Office of Technical Standards and Safety Authority, Fuels Safety Branch.
- ☐ Ministry of Natural Resources and Forestry Areas of Natural Significance.
- ☐ Chapman, L.J., and Putnam, D.F., 1984: 'The Physiography of Southern Ontario, Third Edition', Ontario Geological Survey Special Volume 2.

Municipal Records

- ☐ City of Ottawa: GeoOttawa
- ☐ City of Ottawa: Historical Land Use Inventory Database
- ☐ City of Ottawa: document entitled, "Old Landfill Management Strategy, Phase I – Identification of Sites", prepared by Golder Associates, 2004.

Local Information Sources

- ☐ Personal Interviews.
- ☐ Previous Engineering Reports.

Public Information Sources

- ☐ ERIS Database Report.
- ☐ Google Earth.
- ☐ Google Maps/Street View.

FIGURES

FIGURE 1 – KEY PLAN

FIGURE 2 – TOPOGRAPHIC MAP

DRAWING PE6040-1 – SITE PLAN

DRAWING PE6040-2 – SURROUNDING LAND USE PLAN

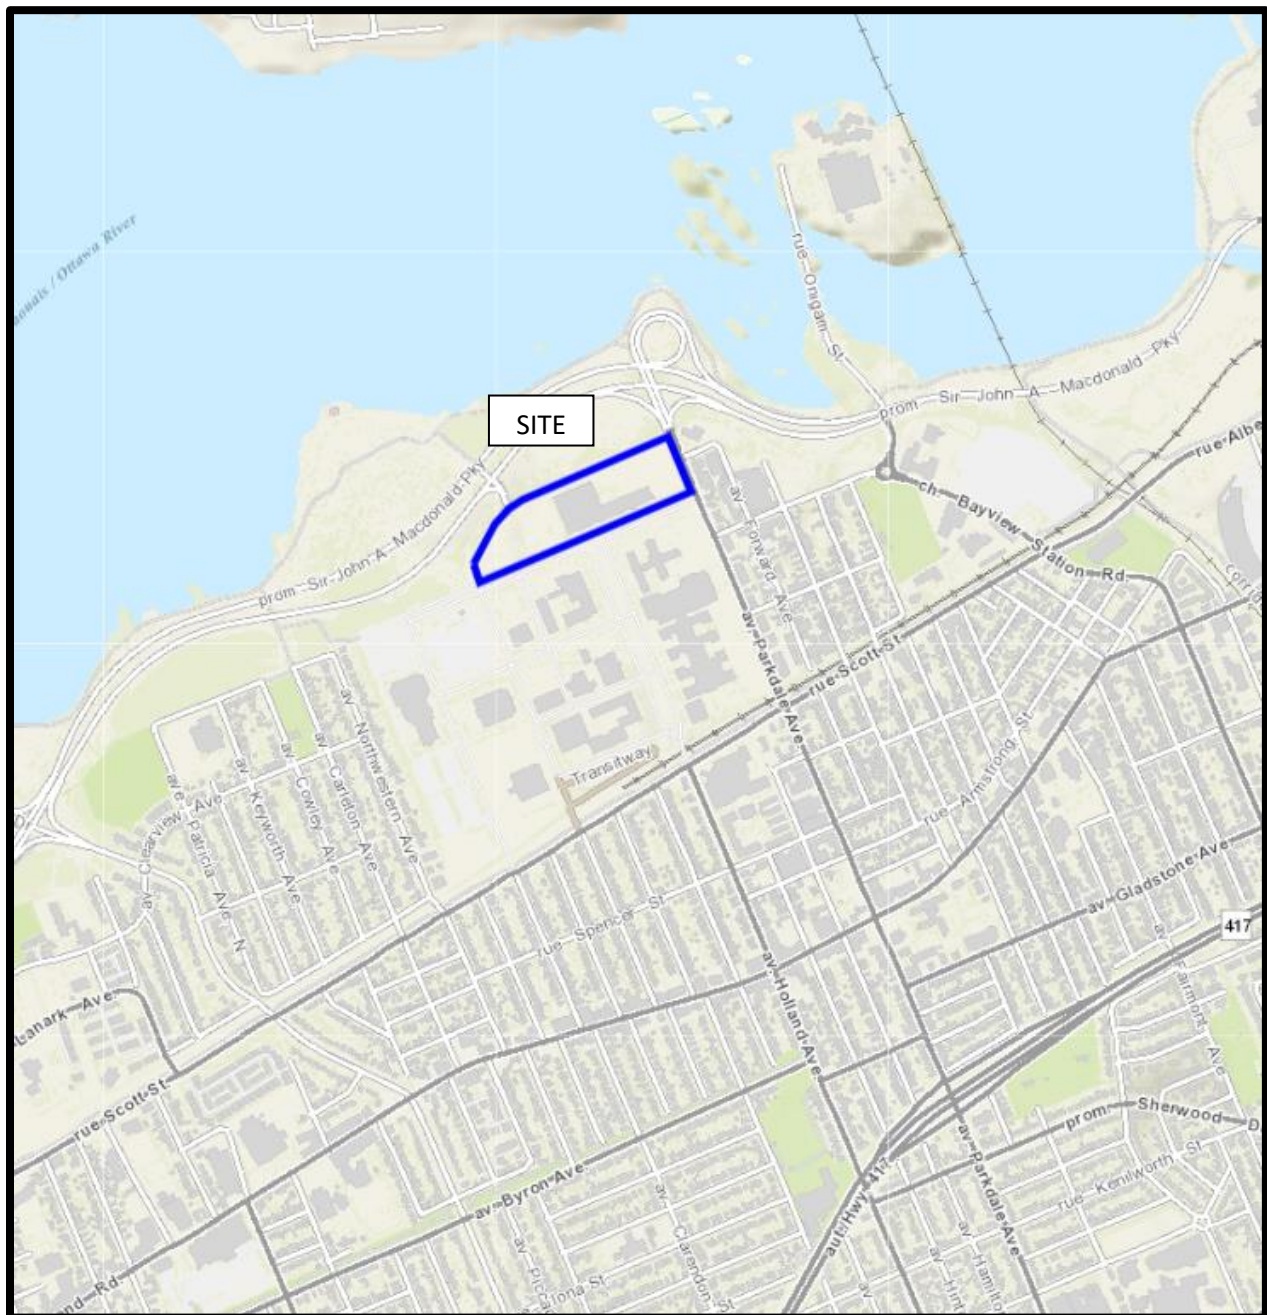


FIGURE 1
KEY PLAN


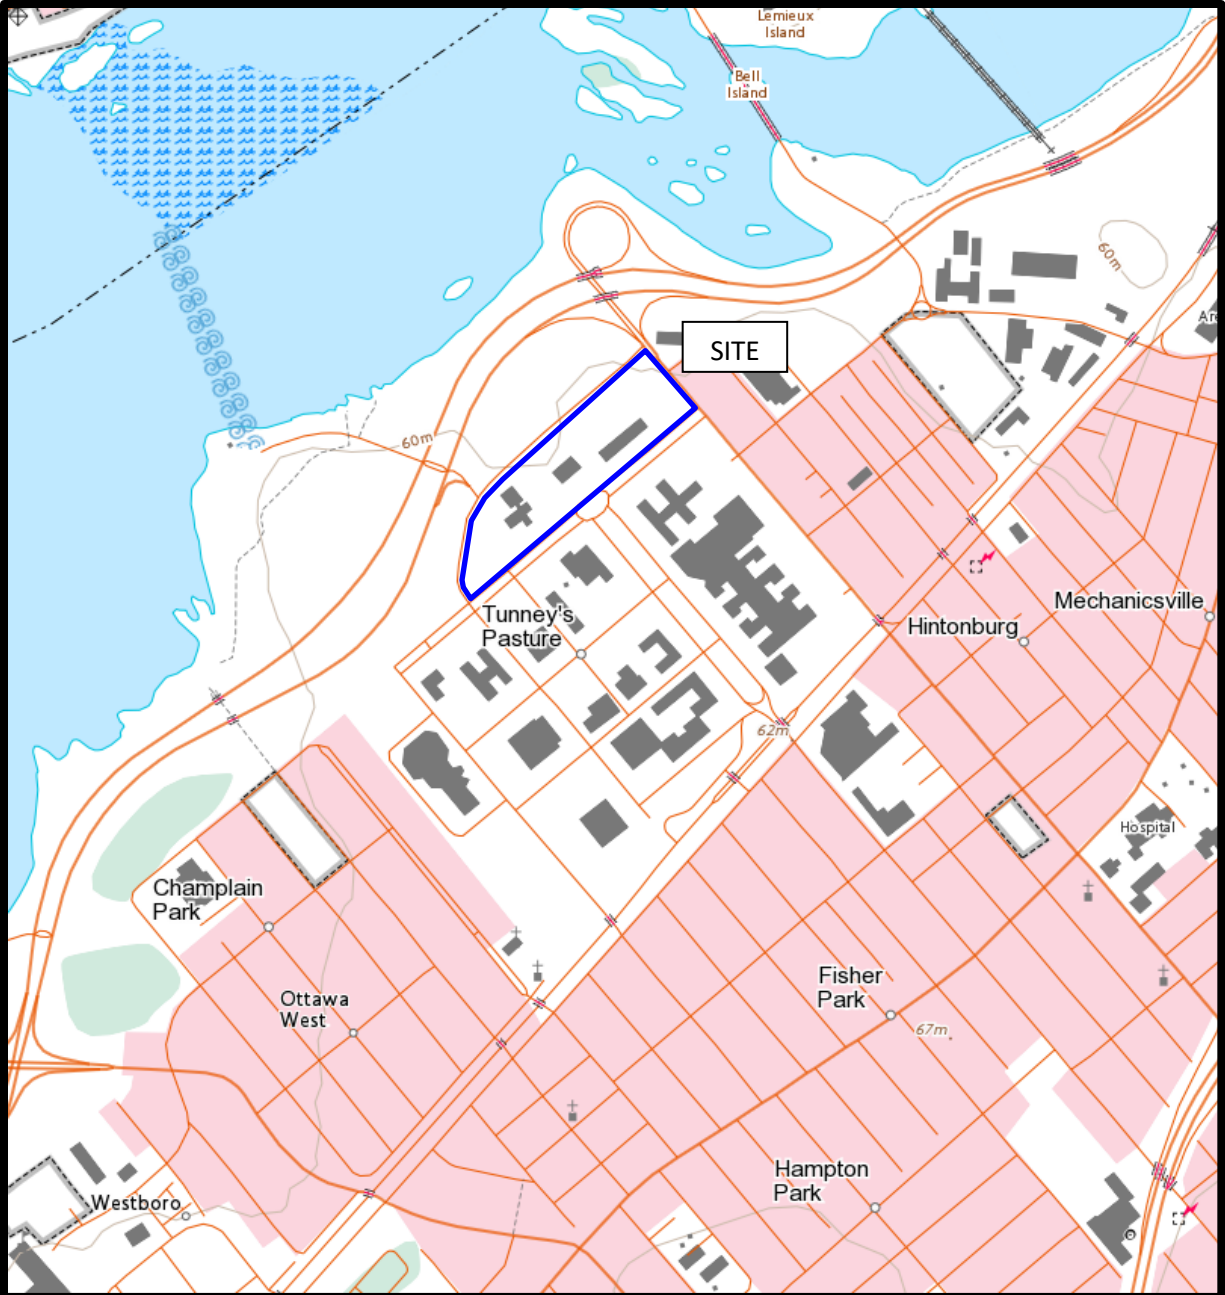


FIGURE 2
TOPOGRAPHIC MAP

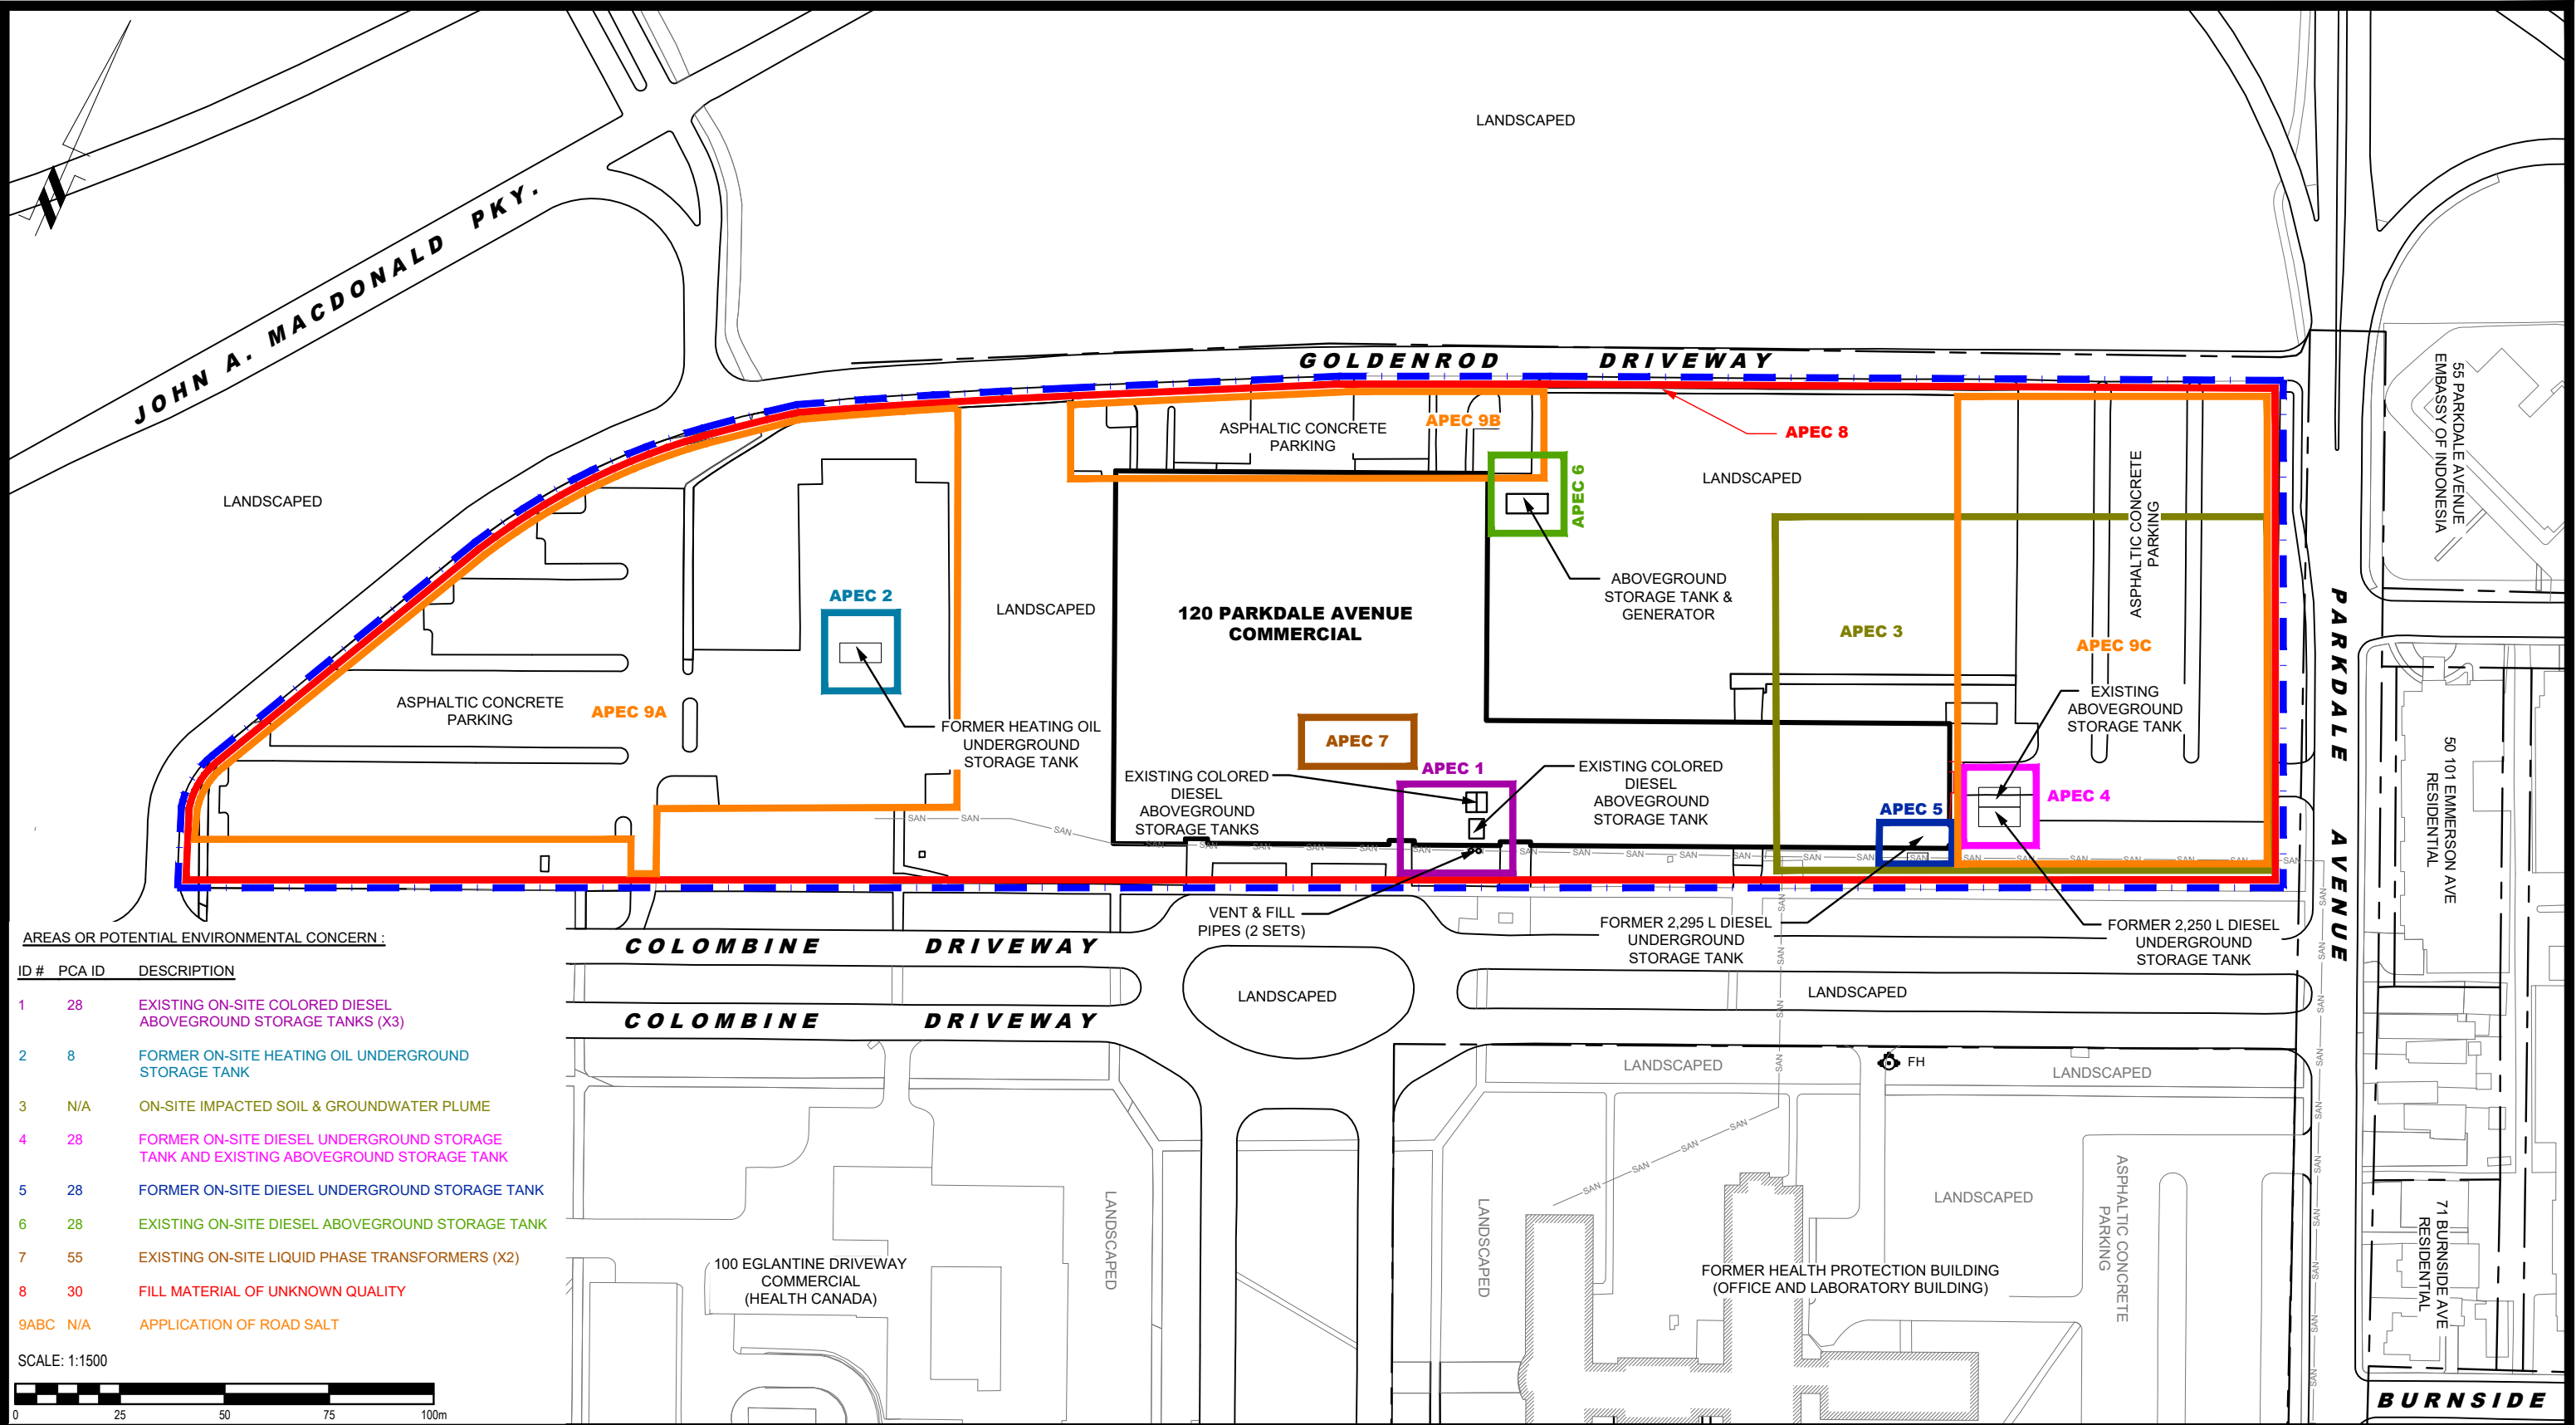

AREAS OR POTENTIAL ENVIRONMENTAL CONCERN :

ID #	PCA ID	DESCRIPTION
1	28	EXISTING ON-SITE COLORED DIESEL ABOVEGROUND STORAGE TANKS (X3)
2	8	FORMER ON-SITE HEATING OIL UNDERGROUND STORAGE TANK
3	N/A	ON-SITE IMPACTED SOIL & GROUNDWATER PLUME
4	28	FORMER ON-SITE DIESEL UNDERGROUND STORAGE TANK AND EXISTING ABOVEGROUND STORAGE TANK
5	28	FORMER ON-SITE DIESEL UNDERGROUND STORAGE TANK
6	28	EXISTING ON-SITE DIESEL ABOVEGROUND STORAGE TANK
7	55	EXISTING ON-SITE LIQUID PHASE TRANSFORMERS (X2)
8	30	FILL MATERIAL OF UNKNOWN QUALITY
9ABC	N/A	APPLICATION OF ROAD SALT

SCALE: 1:1500





PATERSON GROUP
9 AURIGA DRIVE
OTTAWA, ON
K2E 7T9
TEL: (613) 226-7381

NO.	REVISIONS	DATE	INITIAL

IBI GROUP


PHASE I - ENVIRONMENTAL SITE ASSESSMENT
TUNNEY'S PASTURE (BLOCK 10)

OTTAWA, ONTARIO


Title: SITE PLAN

Scale:	1:1500	Date:	07/2023
Drawn by:	YA	Report No.:	PE6040-1
Checked by:	JC	Dwg. No.:	PE6040-1
Approved by:	AM	Revision No.:	

PHASE I - ENVIRONMENTAL SITE ASSESSMENT STUDY AREA

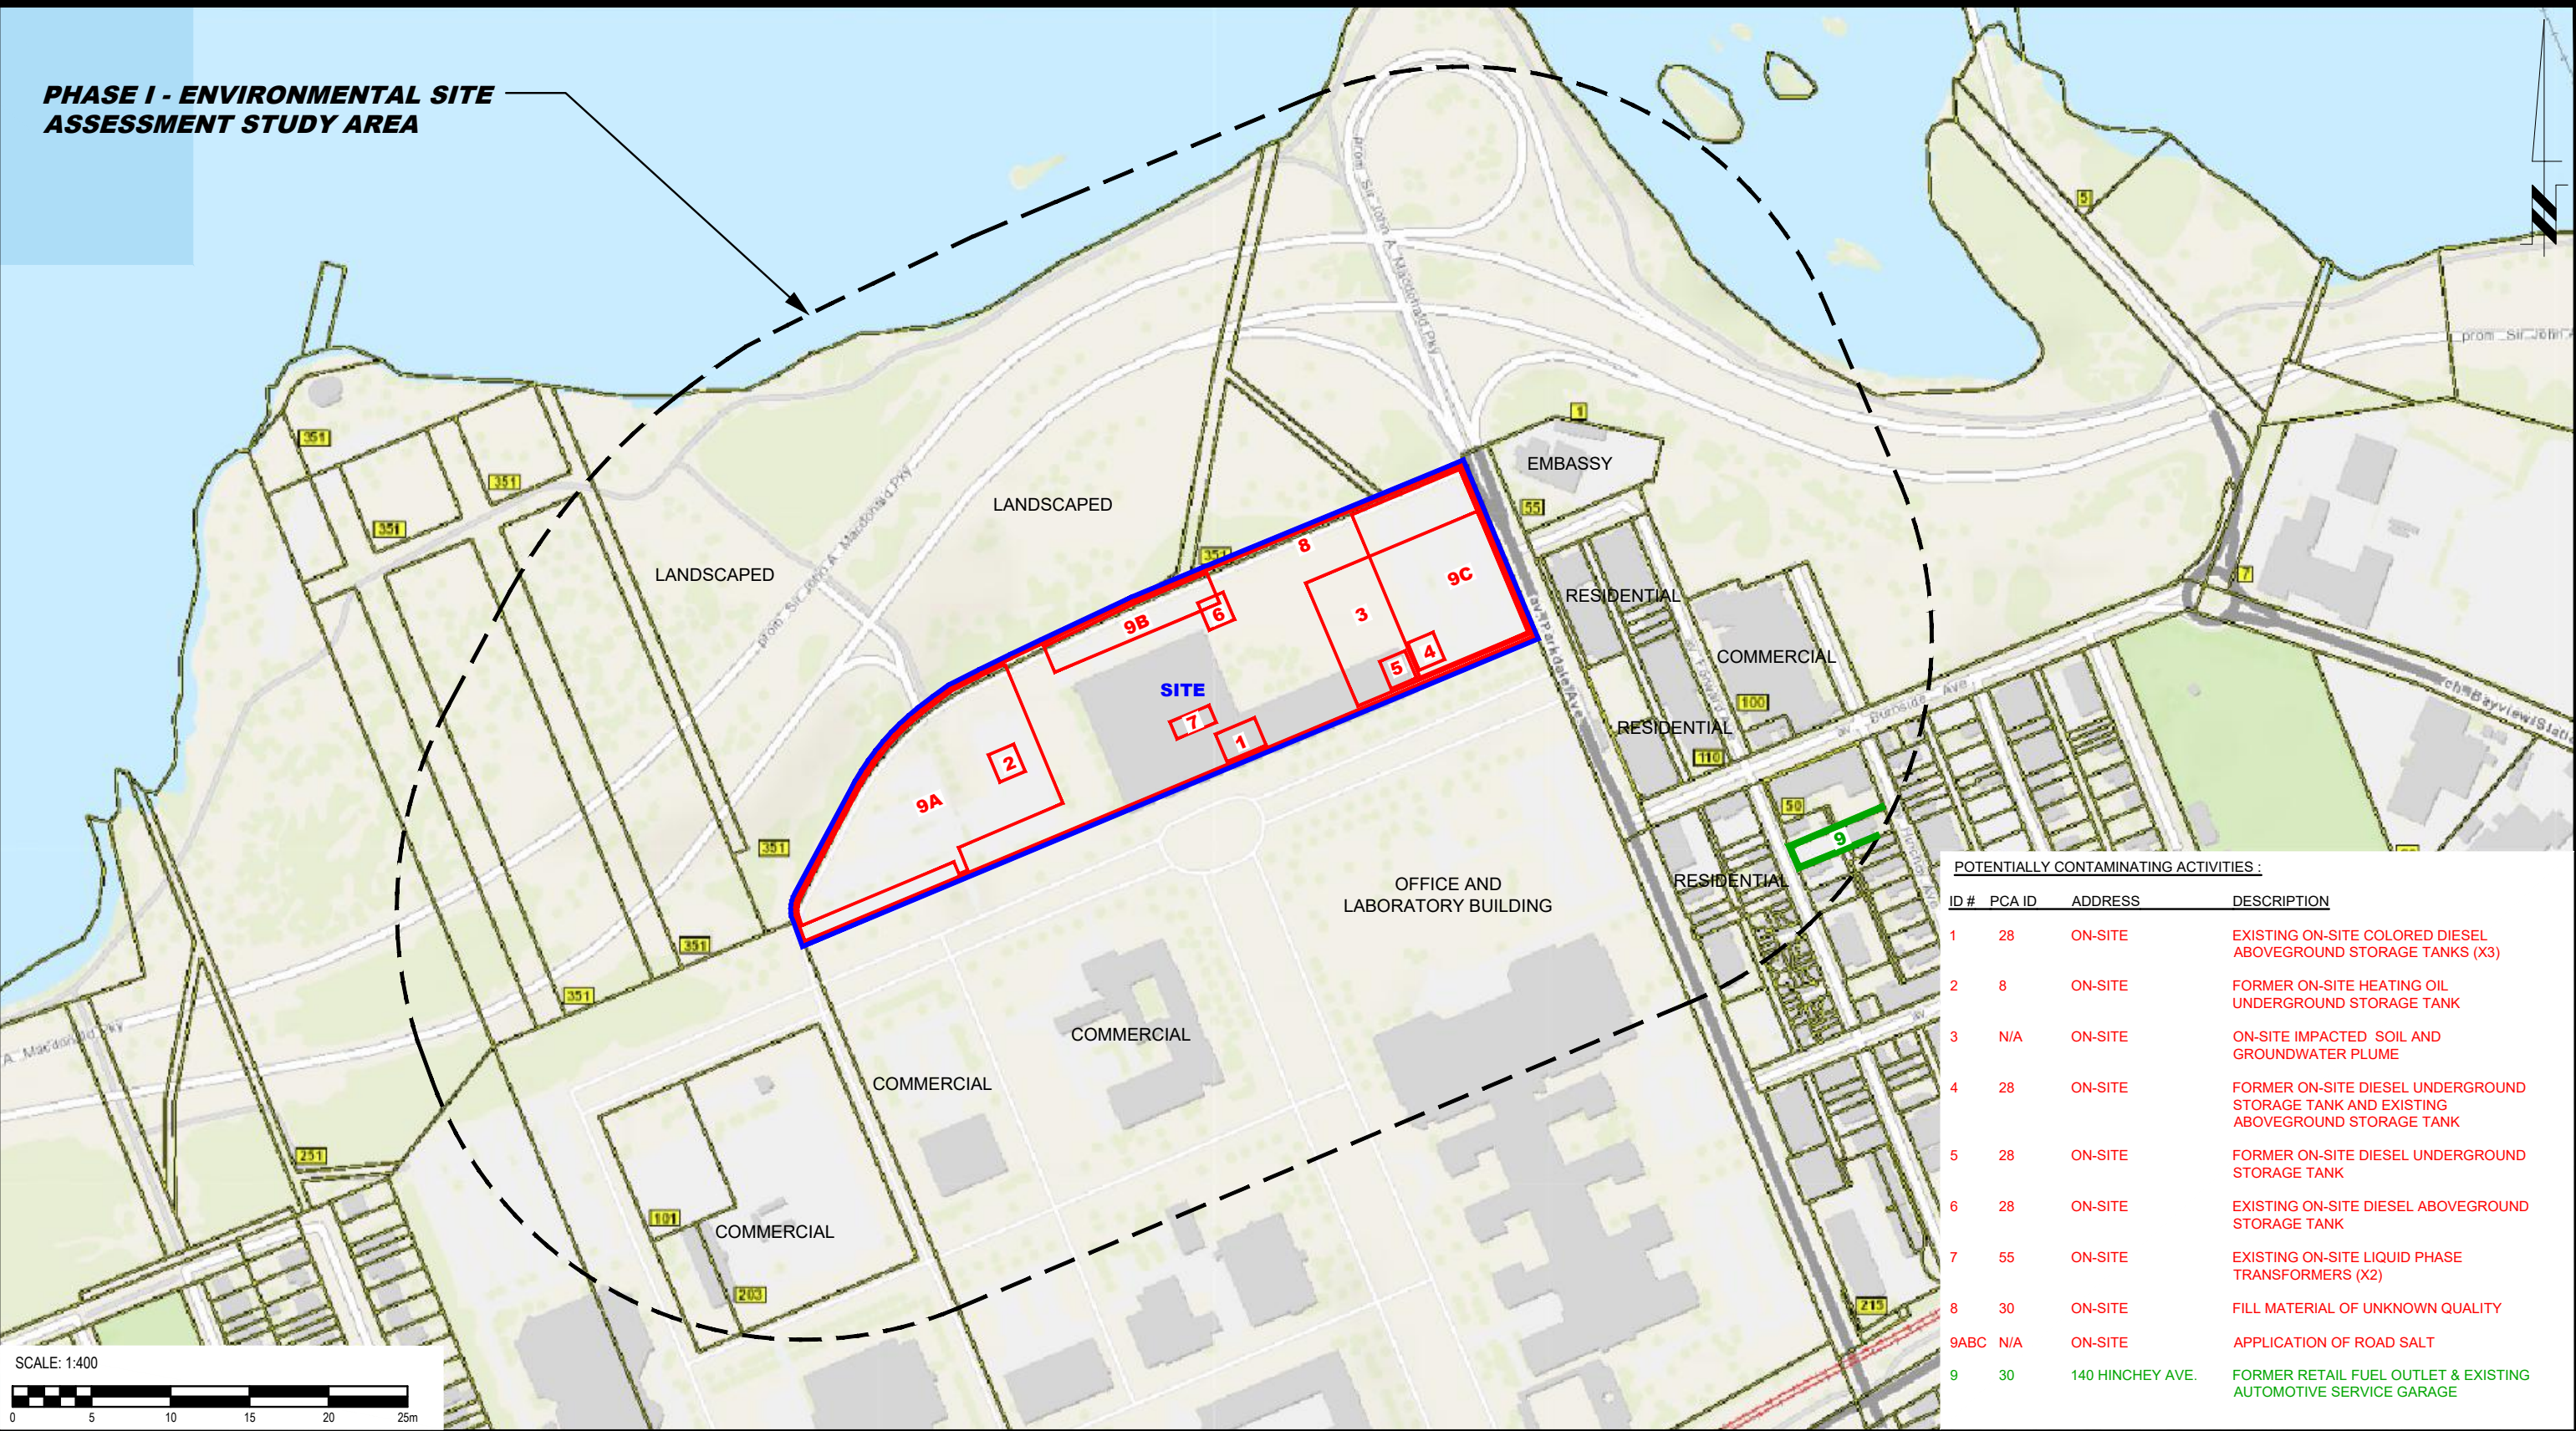

POTENTIALLY CONTAMINATING ACTIVITIES :			
ID #	PCA ID	ADDRESS	DESCRIPTION
1	28	ON-SITE	EXISTING ON-SITE COLORED DIESEL ABOVEGROUND STORAGE TANKS (X3)
2	8	ON-SITE	FORMER ON-SITE HEATING OIL UNDERGROUND STORAGE TANK
3	N/A	ON-SITE	ON-SITE IMPACTED SOIL AND GROUNDWATER PLUME
4	28	ON-SITE	FORMER ON-SITE DIESEL UNDERGROUND STORAGE TANK AND EXISTING ABOVEGROUND STORAGE TANK
5	28	ON-SITE	FORMER ON-SITE DIESEL UNDERGROUND STORAGE TANK
6	28	ON-SITE	EXISTING ON-SITE DIESEL ABOVEGROUND STORAGE TANK
7	55	ON-SITE	EXISTING ON-SITE LIQUID PHASE TRANSFORMERS (X2)
8	30	ON-SITE	FILL MATERIAL OF UNKNOWN QUALITY
9ABC	N/A	ON-SITE	APPLICATION OF ROAD SALT
9	30	140 HINCHEY AVE.	FORMER RETAIL FUEL OUTLET & EXISTING AUTOMOTIVE SERVICE GARAGE



9 AURIGA DRIVE
OTTAWA, ON
K2E 7T9
TEL: (613) 226-7381

NO.	REVISIONS	DATE	INITIAL

IBI GROUP

PHASE I - ENVIRONMENTAL SITE ASSESSMENT
TUNNEY'S PASTURE (BLOCK 10)

OTTAWA,
Title:

ONTARIO

SURROUNDING LAND USE PLAN

Scale: 1:4000

Drawn by: YA

Checked by: JC

Approved by: AM

Date: 07/2023

Report No.: PE6040-1

Dwg. No.: PE6040-2

Revision No.:

APPENDIX 1

AERIAL PHOTOGRAPHS


SITE PHOTOGRAPHS



AERIAL PHOTOGRAPH
1928




AERIAL PHOTOGRAPH
1945

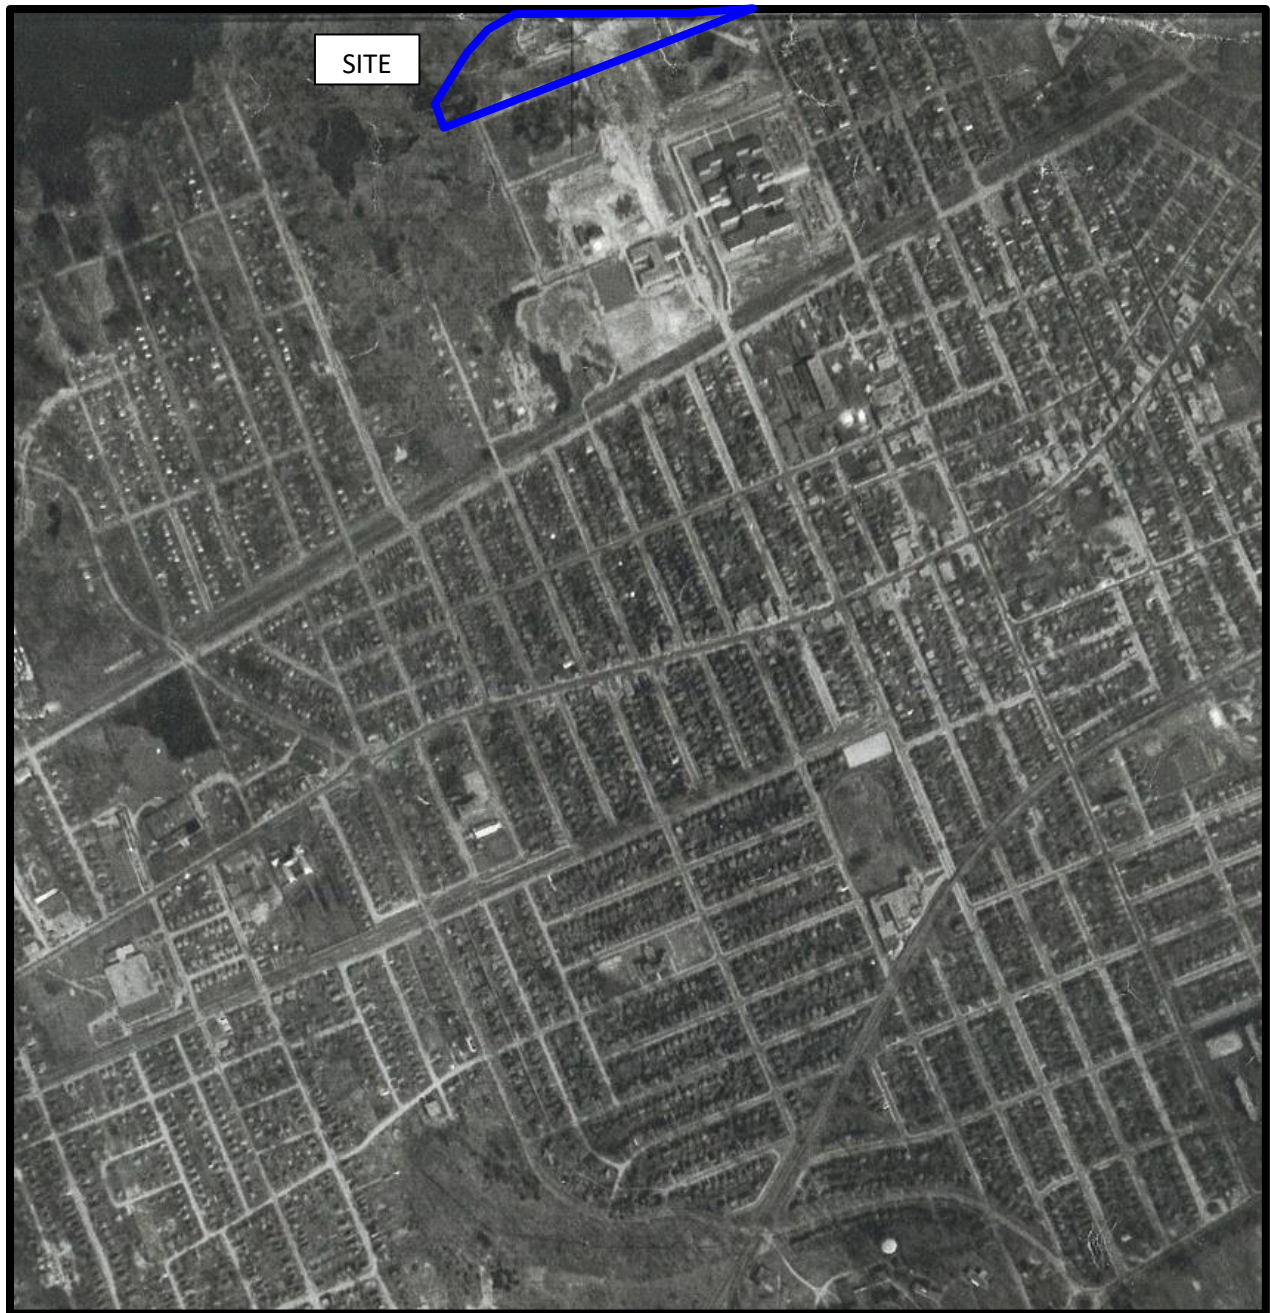


AERIAL PHOTOGRAPH
1953




AERIAL PHOTOGRAPH
1965

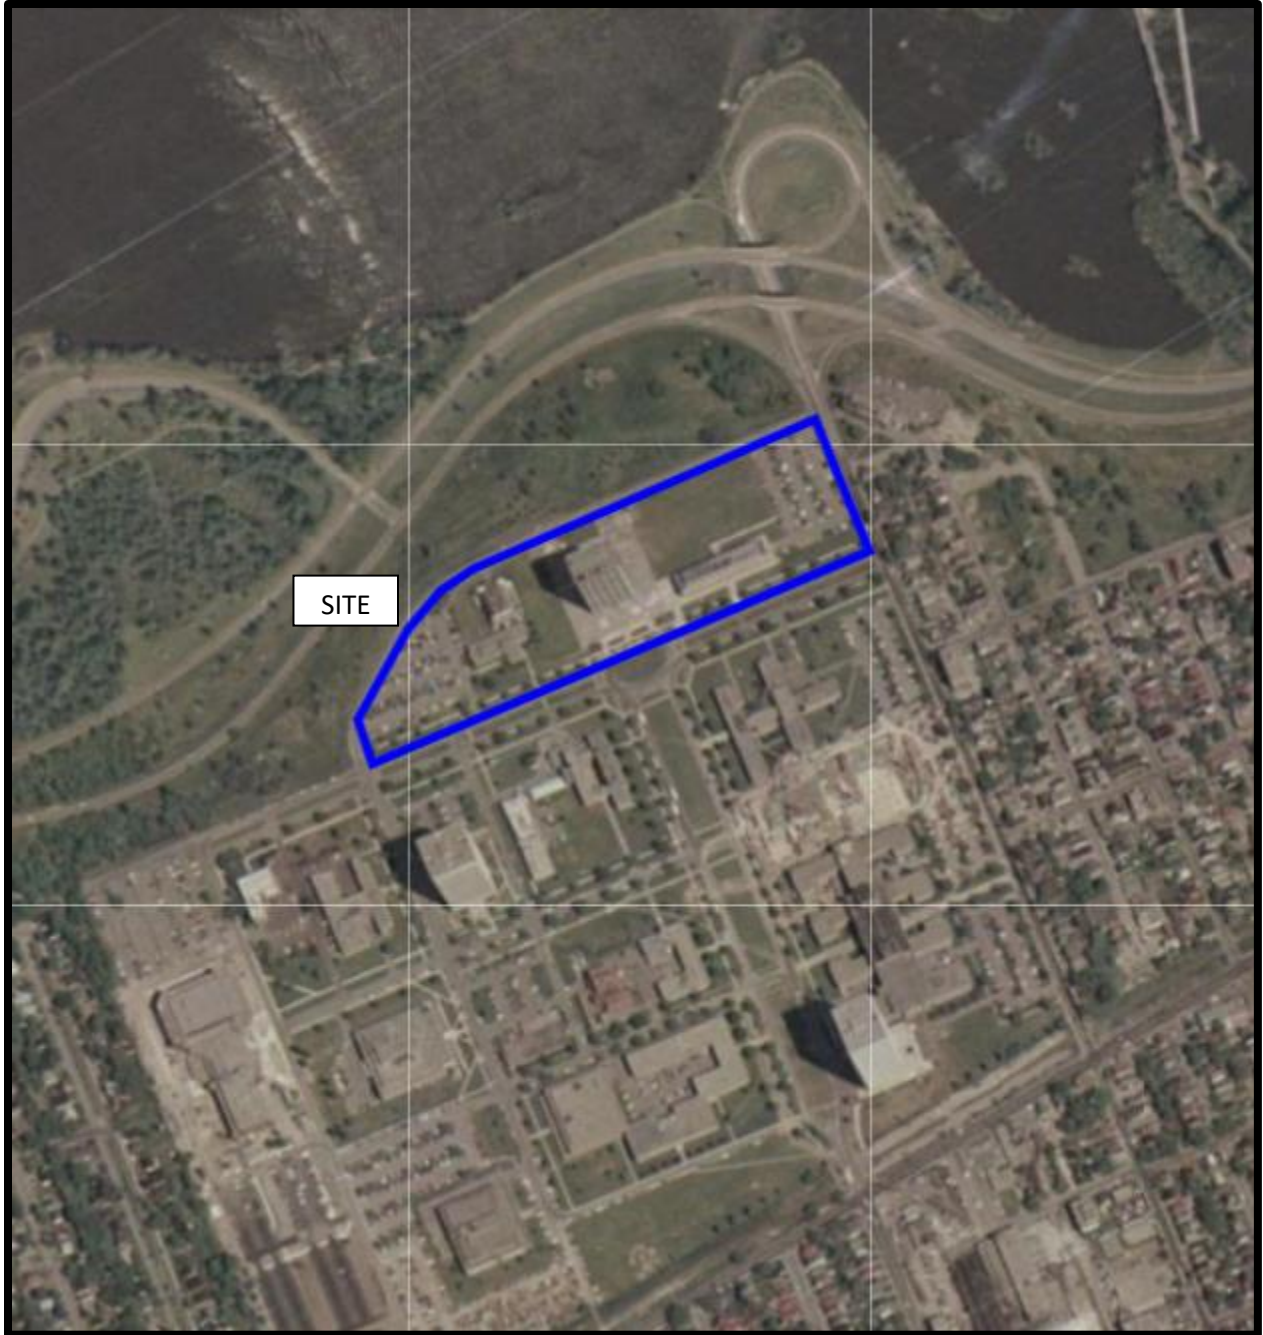

AERIAL PHOTOGRAPH
1976

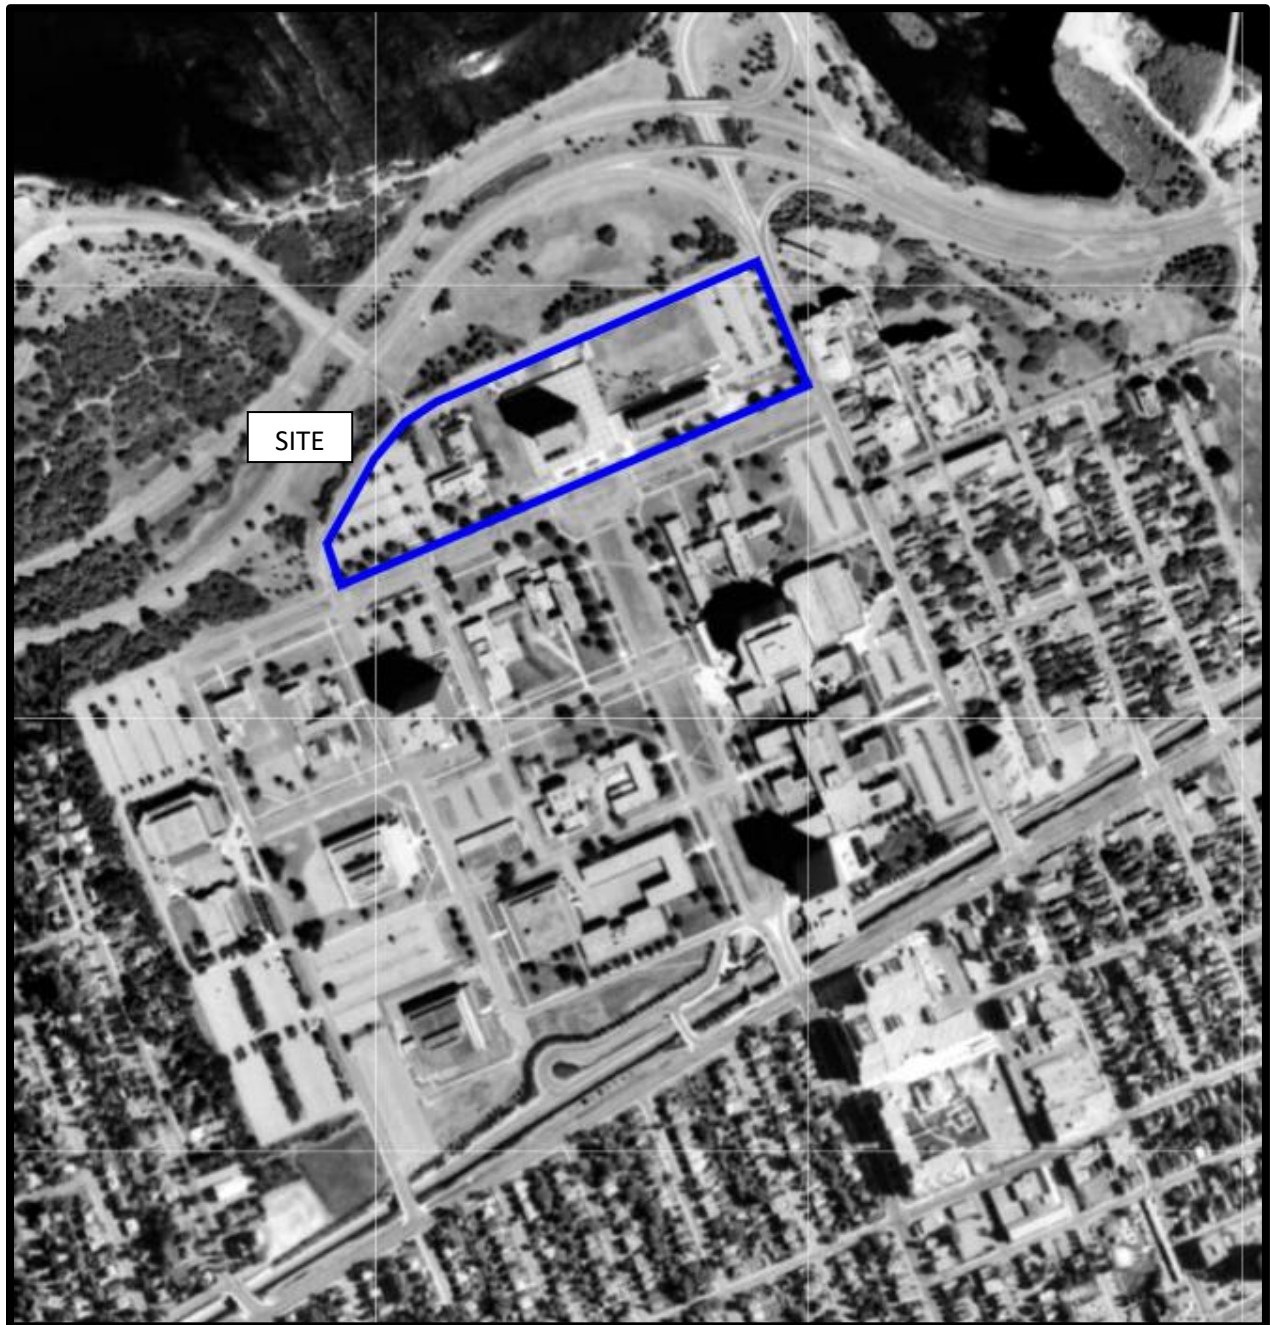

AERIAL PHOTOGRAPH
1991

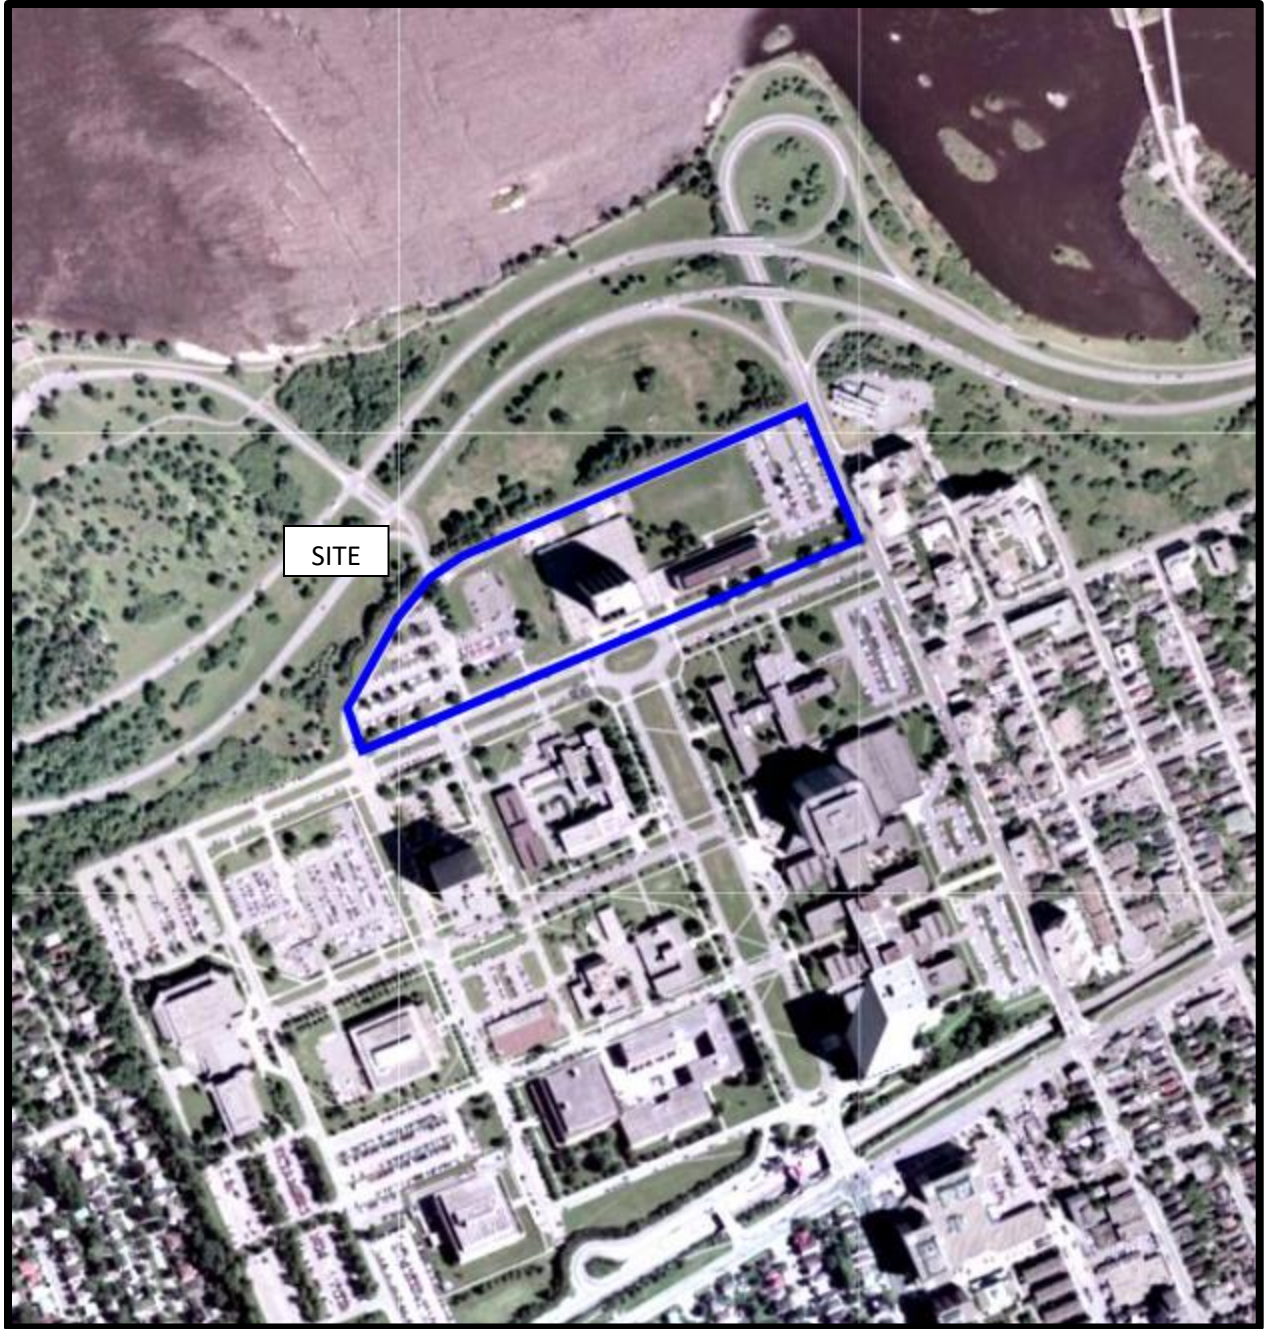

AERIAL PHOTOGRAPH
2005



AERIAL PHOTOGRAPH
2015



AERIAL PHOTOGRAPH
2021

Site Photographs

PE6040

Tunney's Pasture (Block 10), Ottawa, Ontario

April 12, 2023



Photograph 1: View of the front of the Brooke Claxton building, facing north.



Photograph 2: View of the back of the Brooke Claxton building, facing south.

Site Photographs

PE6040

Tunney's Pasture (Block 10), Ottawa, Ontario

April 12, 2023



Photograph 3: View of the vent and fill pipes on the south face of the Brooke Claxton building, facing north.



Photograph 4: View of the AST on the northeast corner of the Brooke Claxton building, facing south.

Site Photographs

PE6040

Tunney's Pasture (Block 10), Ottawa, Ontario

April 12, 2023



Photograph 5: View of the two 1,000 L ASTs in the basement of the Brooke Claxton building.



Photograph 6: View of the 2,275 L AST in the basement of the Brooke Claxton building.

Site Photographs

PE6040

Tunney's Pasture (Block 10), Ottawa, Ontario

April 12, 2023



Photograph 7: View of the two liquid phase transformers in the basement of the Brooke Claxton building.

APPENDIX 2

MECP FREEDOM OF INFORMATION SEARCH RESULTS

MECP WATER WELL RECORDS

TSSA CORRESPONDENCE

CITY OF OTTAWA HLUI SEARCH RESPONSE

ERIS DATABASE REPORT

**Ministry of the Environment,
Conservation and Parks**

Access and Privacy Office

12th Floor
40 St. Clair Avenue West
Toronto ON M4V 1M2
Tel: (416) 314-4075

**Ministère de l'Environnement, de la
Protection de la nature et des Parcs**

Bureau de l'accès à l'information et
de la protection de la vie privée

12^e étage
40, avenue St. Clair ouest
Toronto ON M4V 1M2
Tél. : (416) 314-4075



November 3, 2022

Nick Sullivan
Paterson Group Inc.
154 Colonnade Road
Ottawa, Ontario K2E 7J5
nsullivan@patersongroup.ca

Dear Nick Sullivan:

RE: MECP FOI A-2022-05347, Your Reference #: PE5791 – Decision Letter

This letter is further to your request made pursuant to the Freedom of Information and Protection of Privacy Act (the Act) relating to 101 Goldenrod Driveway, Ottawa.

After a thorough search through the files of the ministry's Ottawa District Office, Environmental Assessment and Permissions Division (EAPD), Environmental Monitoring and Reporting Branch (EMRB), Environmental Investigations and Enforcement Branch (EIEB) and Safe Drinking Water Branch (SDW), records were located in response to your request. The final decision has been made to provide full access to the requested information and a copy of the record is attached.

You may request a review of my decision within 30 days from the date of this letter by contacting the Information and Privacy Commissioner/Ontario at <http://www.ipc.on.ca>. Please note there may be a fee associated with submitting the appeal.

If you have any questions, please contact Amina Shah at 437-339-1251 or amina.shah@ontario.ca.


Yours truly,

A handwritten signature in black ink, appearing to read "A. Shah".

for

Ryan Gunn
Manager (A), Access and Privacy Office

Attachment

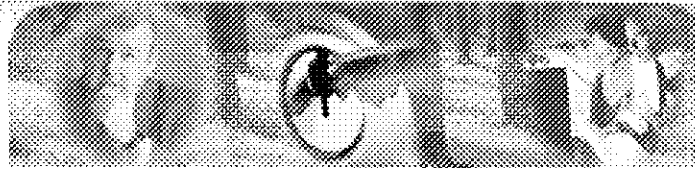
Generator Details**Registration/Notification Number**

ON6748119

Legal Company Name

Primary Name:	BGIS	Division Name:	BGIS

Company Operating Name

Primary Name:	BGIS	Division Name:	BGIS


Mailing Address

Division Building:	BGIS	Post Box Number:	BGIS
Address Line 1:	101 Goldenrod Drive	Address Line 2:	NA
Town/City:	Ottawa	Postal Code / Zip Code:	K1A 0T6
County: (if inside Ontario)	OTTAWA CARLTON (RM)	Province/State (If inside Canada/US)	ONTARIO
County: (if outside Ontario)	NA	Province / State (If outside Canada / US)	NA
Country:	Canada		

Site Location

This should be the street address of the site that is being registered. You are required to register each site that generates hazardous waste separately.

Division Building:	BGIS	Post Box Number:	BGIS
Address Line 1:	101 Goldenrod Drive		
Address Line 2:	NA		
Town/City:	Ottawa	Postal Code / Zip Code:	K1A 0T6
County: (if inside Ontario)	OTTAWA CARLTON (RM)	Province / State (If inside Canada / US)	ONTARIO
County: (if outside Ontario)	NA	Province / State (If outside Canada / US)	NA
Country:	Canada		

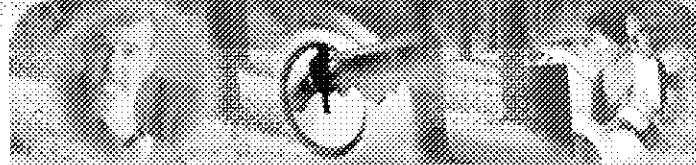

Company Name: **BGIS BGIS**
Company Number: **ON6748119 (Generator)**

Active Waste Classes

Active Waste Class Listing

[Add New Waste Class](#) [Inactive waste classes](#)

Active Off-site Waste Classes

Waste Class	View Details	Hazardous Waste Number (per waste stream)	Reg. 347 Schedules	Disposal Method	Part 2B required	Part 2B complete	Physical State	Off-Site	Status	UnRegister Waste Class
145 - I	View Details	D001	5, 13	Land Disposal	Y	Y	Liquid	Off-Site	Active	UnRegister
252 - L	View Details	N/A					Liquid	Off-Site	Active	UnRegister
262 - L	View Details	N/A					Liquid	Off-Site	Active	UnRegister
263 - I	View Details	D001	5, 13	Land Disposal	Y	Y	Liquid	Off-Site	Active	UnRegister
331 - I	View Details	D001	5, 13	Land Disposal	Y	Y	Gas	Off-Site	Active	UnRegister



INCIDENT REPORT

Reference Number:	4801-AE4JSQ	Module Type:	Spill
Status:	Recommended	File Storage Number:	SI OT OT GO 100
Program:	Waste - Hazardous & Liquid Industrial	Activity:	Spills

Caller or PO Reporting/Receiving Information

First Name:	Last Name:
Sukhi	Dhillon
Name of Company:	
Brookfield Global Integrated Solutions	

MAILING ADDRESS

Civic Address:		Unit Identifier:	
101 Goldenrod Driveway			
Delivery Designator:		Delivery Identifier:	
Municipality/ Unorganized Twp:	County/District:	Province/State:	Postal Code:
Ottawa		Ontario	
Postal Station:		Country:	Canada
Telephone Number:	Extension:	Other Number:	Email Address:
613-868-9693		613-721-5465 Home	

Date Reported to MOE:	2016/09/24	Time Reported to MOE:	10:18
Date of Incident:	2016/09/24	Time of Incident:	06:30
Incident Date Confirmation:	Actual		

Client(s)

Client Details

Site(s)

Site Details

Brookfield GIS<UNOFFICIAL>
Address: Lot: , Part: , 101 Goldenrod Driveway, Ottawa, City,
District Office: Ottawa

Incident Summary:

Brookfield GIS: 3L diesel to asphalt, cleaned

Initial Incident Description (as reported):

Created: Julian Aristizabal (Spills Action Centre) - 2016/09/24 10:18:42 AM

Caller reports that at 06:30 a transport truck (unknown) was on site and had a leak of about 3L of diesel to the asphalt from the tank. No waterways impacted. Spill was found and fully cleaned up within the hour of occurrence.

Copy emailed to EPS as it is a federal facility

SAC Action Class:

Land Spills

Non-Standard Procedure:

No

Incident Description:

Last update: Kyle Straberger (Ottawa District Office) - 2016/09/26 11:34 AM

September 26, 2016 - EO Straberger

Report of approx. 3L of diesel from a tank was reported to the ministry's Spills Action Centre. Spill was reported to not have impacted any waterways and cleaned.

No further MOECC action required at this time. Recommend File Closed.

Incident Description Continuation:

Incident Update:

Was there an MOE field response?

No

Were there samples collected / analyzed at any time?

No

Known or Suspected Health / Environmental Consequence at the Time of Incident

Health / Environmental Consequence:

0 - No Impact

Has a Water Body been impacted?

No

Receiving Environment:

Land

Incident Event:	Leak/Break
Incident Reason:	Unknown / N/A
Source Type:	Truck - Only Saddle Tanks
Sector Type:	Unknown / N/A
MOE/Other Agencies Involved:	Unknown / N/A
Was there a discharge / emission / spill of a contaminant to the environment?	
Yes	

Contaminants Table

Contaminant Name	Description	Code	UN#	Limit	Quantity	[units]	[freq]
DIESEL FUEL		13	1202		3	L	

Environmental Compliance Reporting (ECR)

Is this an air emission (measured or modelled) or wastewater (sewage) discharge exceedance that will become part of the Environmental Compliance Report? (legislation, certificate of approval, order, or guideline) No

Voluntary / Mandatory Abatement

Was there Non-Compliance/Non-Conformance Identified?	☐ Yes ☒ No

Voluntary / Mandatory Compliance Items

Type	Parent RefNo	Work Summary (may be truncated)	Date	AttainList

Waste / EGR Information

Waste / EGR Information entries:

Document Related Information

Cross Reference:	(doc link)	Task Link:	3073-AE4KPZ 
Originating Document:		Created by:	Julian Aristizabal
Date Created:	2016/09/24	Date Completed:	
Office Receiving Incident Report:	Spills Action Centre	Incident Info Received By:	Julian Aristizabal

Bring Forward Date:		Bring Forward Reason:	

Signatures

Provincial Officer:

Name:	Kyle Straberger
Badge No:	1529
Work Unit:	
District/Area Office:	Ottawa District Office
Date:	2016/09/26
Signature:	

District/Area Supervisor:

Name:	
Work Unit:	
District/Area Office:	
Date:	
Signature:	

INCIDENT REPORT

Reference Number:	0416-94LPNH	File Storage Number:	
Module:	Incident Reporting	Module Type:	Spill
Cross Reference:	(doc link)	Task Link:	4553-94LPRE 
Originating Document:		Created by:	John Tirone
Incident Report Reference Number:	0416-94LPNH 		
Date Created:	2013/02/04	Date Completed:	
Bring Forward Date:		Bring Forward Reason:	
Status:	Recommended		
Program	Water - Ground & Surface	Activity:	Spills

Is this an **air emission** (measured or modelled) or **wastewater** (sewage) **discharge exceedance** that will become part of the Environmental Compliance Report?

(legislation, certificate of approval, order, or guideline)

☐ Yes
 ☒ No
 ☐ To be determined

[Click here for Guidance](#)

Caller or PO Information

Reported By:		Name of Company:	
First Name Jennifer	Last Name Andrews	Public Works of Canada	
Contact Mailing Address			
Civic Address: 340 Albert Street		Unit Identifier:	
Delivery Designator:		Delivery Identifier:	
Municipality: Ottawa	Postal Station:	Province/State: Ontario	Postal Code: K1A 0S5
Telephone Number: (819)775-4510	Extension:	Other Number: Fax	Email Address: Jennifer.Andrews@tpsgc-pwgs.c.ca

Reported By:

MOE Information

Date & Time Reported to MOE:	2013/02/04 13:27		
Office Receiving Incident Report:	Spills Action Centre		
Incident Info Received By:	John Tirone		
MOE Response:		Site Region:	Eastern
Date & Time of MOE Arrival at Scene:			

Master Incident Report Number:			
SAC Action Class:	Land Spills		
Non-Standard Procedure:	No		
ERP Call-out Initiated:	No		

Client(s)

Client Details

Public Work Government Service Canada
Mailing Address: 3000 Merivale Rd Building M8-1, Ottawa, Ontario, Canada, K1A 0R2
Physical Address: 3000 Merivale Rd Building M8-1, Ottawa, City, Ontario, Canada, K1A 0R2
Telephone: (613)786-7958, FAX: (613)825-2107, email: jeff.current@pwgsc.gc.ca
Client #: 2452-7TQNZK, Client Type: Federal Government
Additional Address Info: Building M8-1

Site(s)

Site Details

Tunney's Pasture<UNOFFICIAL>
Address: Lot: , Part: , 101 Goldenrod Driveway, Ottawa, City,
District Office: Ottawa

Incident Information

Incident Summary:	Public Works of Canada: 2L Glycol dln <i>cannot be longer than 60 characters</i>
Incident Description:	Caller reports a spill of glycol 2L from a truck. No CB or waterways were impacted and the spill was cleaned up by a worker. 13:41 SAC(JT) to EPS briefed Graham Thomas Copy of report sent to EPS February 5, 2012, 8:58 am AEO Grothe. This spill as been cleaned. This ir can be closed

Links & Comments:	
Attachments Names:	

Date & Time of Incident	Incident Date Confirmation? Actual 2013/02/01 14:30		
Source Type:	Unknown / N/A	Sector Type:	Unknown / N/A
Nearest Watercourse:		Watershed Category Code:	
Environmental Impact:	Not Anticipated		
Nature of Impact:	Surface Water Pollution		
Incident Event:	Unknown / N/A	Incident Reason:	Unknown / N/A
Damaged Party:	No		

Contaminants Table

Contaminant Name	Code	UN#	Limit	Quantity	[units]	[freq]
GLYCOL/WATER SOLUTION	24	n/a		2	L	

Controller of Material:	Public Works of Canada	Owner of Material:	Public Works of Canada
Estimated Clean Up Cost:		Who Cleaned Up:	Controller, Owner
% Clean Up:	99 %	MOE/Other Agencies Involved:	Federal - Environment

Voluntary / Mandatory Abatement

Is there Voluntary Abatement Activity?	☒ Yes	☐ No	☐ To be determined

Voluntary / Mandatory Compliance Items

Type	Parent RefNo	Work Summary (may be truncated)	Date	AttainList
VA	0416-94LPNH	spill clean up in federal facility	2013/02/05	2013/02/05

Offence(s)

Suspected Violation(s)/Offence(s):	
Act - Regulation - Section,	
Description	
{General Offence}	

Provincial Officer:

Name:

Badge No:

Work Unit:

District/Area Office:

Date:

Signature:

District/Area Supervisor:

Name:

Work Unit:

District/Area Office:

Date:

Signature:

INCIDENT REPORT

Reference Number:	4733-87EP95	File Storage Number:	SI OC OT GO 100
Module:	Incident Reporting	Module Type:	Spill
Cross Reference:	(doc link)	Task Link:	8018-87EPLG 
Originating Document:		Created by:	Jeremy Weiss
Incident Report Reference Number:	4733-87EP95 		
Date Created:	2010/07/16	Date Completed:	2010/07/23
Bring Forward Date:		Bring Forward Reason:	
Status:	Closed		
Program	Water - Ground & Surface	Activity:	Spills

Is this an **air emission** (measured or modelled) or **wastewater** (sewage) **discharge exceedance** that will become part of the Environmental Compliance Report?

(legislation, certificate of approval, order, or guideline)

☐ Yes
 ☒ No
 ☐ To be determined

[Click here for Guidance](#)

Caller or PO Information

Reported By:		Name of Company:	
First Name John	Last Name Armstrong	W O Stinson	
Contact Mailing Address			
Civic Address: 4726 Bank Street			Unit Identifier:
Delivery Designator:			Delivery Identifier:
Municipality: Ottawa	Postal Station:	Province/State: Ontario	Postal Code: K1T 3W7
Telephone Number: (613)822-7400	Extension:	Other Number:	Email Address:

Reported By:

MOE Information

Date & Time Reported to MOE:	2010/07/16 14:05		
Office Receiving Incident Report:	Spills Action Centre		
Incident Info Received By:	Jeremy Weiss		
MOE Response:	Referral to others	Site Region:	Eastern
Date & Time of MOE Arrival at Scene:			
Master Incident Report			

Number:			
SAC Action Class:	Land Spills		
Non-Standard Procedure:	No		
ERP Call-out Initiated:	No		

Client(s)

Client Details
GAL Power Systems Limited Mailing Address: 1530 Drew Rd, Mississauga, Ontario, Canada, L5S 1W8 Physical Address: 1530 Drew Rd, Mississauga, City, Regional Municipality of Peel, Ontario, Canada, L5S 1W8 Telephone: (905)795-8877 Client #: 1343-79ZSKB, Client Type: Corporation

Site(s)

Site Details
GAL Power<UNOFFICIAL> Address: Lot: , Part: , 101 Goldenrod Driveway, Tunney's Pasture, Ottawa, City, District Office: Ottawa

Incident Information

Incident Summary:	Gal Power: 5 L coloured dsl to pvd surface. Clned cannot be longer than 60 characters
Incident Description:	Spill of 5 L coloured diesel from generator due to expansion of fuel due to temperatures and it came out the top by cap. Spill was to concrete surface w/ no waters impacted. Spill occured ~ 1230h today and has been cleaned up using absorbent materials. Caller is the fuel provider for Gal Power (101 Golden Rod Driveway, Tunney's Pasture, Ottawa), office building. 1420h - SACjw to Ottawa MOE (B. Eckert) - briefed. Friday, July 23, 2010: this incident is under the authority of Environment Canada. This incident occurred at a federal facility. No further action required. Document and file.

Links & Comments:	
Attachments Names:	

Date & Time of Incident	Incident Date Confirmation? Actual 2010/07/16 12:30		
Source Type:	Other	Sector Type:	Miscellaneous Industrial
Nearest Watercourse:	Great Lakes - St. Lawrence Lower Ottawa River Lower Ottawa River Lower Ottawa River	Watershed Category Code:	2LB02
Environmental Impact:	Not Anticipated		
Nature of Impact:			
Incident Cause:	Other Discharges	Incident Reason:	Spill
	No		

Damaged Party:

Contaminants Table

Contaminant Name	Code	UN#	Limit	Quantity	[units]	[freq]
DIESEL FUEL	13	1202		5	L	

Controller of Material:	Gal Power Inc.	Owner of Material:	Gal Power Inc.
Estimated Clean Up Cost:	\$1000.00	Who Cleaned Up:	Controller, Owner
% Clean Up:	99 %	Agencies Involved:	Environment Canada

Voluntary / Mandatory Abatement

Is there Voluntary Abatement Activity?	☐ Yes	☒ No	☐ To be determined

Voluntary / Mandatory Compliance Items

Type	Parent RefNo	Work Summary (may be truncated)	Date	AttainList

Offence(s)

Suspected Violation(s)/Offence(s):
Act - Regulation - Section, Description {General Offence}

Provincial Officer:

Name: Tor Rustad
Badge No: 392

Work Unit:

District/Area Office: Ottawa District Office
Date: 2010/07/23

Signature:

Tor Rustad

Area Supervisor:

Name: Paul Kehoe

Work Unit:

District/Area Office: Ottawa District Office
Date: 2010/07/23

Signature:

Paul Kehoe.



Ministry of the Environment, Conservation and Parks
Ministère de l'Environnement, de la Protection de la nature et des Parcs

INCIDENT REPORT

Reference Number:	2717-B4VHNV	Module Type:	Spill
Status:	Closed	File Storage Number:	SI OT OT GO 100
Program:	Waste - Solid/Non-hazardous	Activity:	Spills

Caller or PO Reporting/Receiving Information

First Name:	Last Name:
James	Marles
Name of Company:	
BGIS - Brookfield	

MAILING ADDRESS

Civic Address:		Unit Identifier:	
Delivery Designator:		Delivery Identifier:	
Municipality/ Unorganized Twp:	County/District:	Province/State:	Postal Code:
		Ontario	
Postal Station:		Country:	Canada
Telephone Number:	Extension:	Other Number:	Email Address:
613 806 4005		Fax	

Date Reported to MOE:	2018/09/23	Time Reported to MOE:	09:21
Date of Incident:	2018/09/23	Time of Incident:	07:00
Incident Date Confirmation:	Actual		

Client(s)

Client Details

Department of National Defence
Mailing Address: 6 Moro St P.O. Box 17000, CFB Kingston, Kingston, Ontario, Canada, K7K 7B4
Physical Address: 6 Moro St P.O. Box 17000, CFB Kingston, Kingston, City, County of Frontenac, Ontario, Canada, K7K 7B4
Telephone: (613)541-5010, Extension: 5280, FAX: (613)541-4495
Client #: 1198-7UVQJY, Client Type: Municipal Government

Additional Address Info: P.O. Box 17000, CFB Kingston

Site(s)

Site Details

101 Goldenrod Drive<UNOFFICIAL>

Address: Lot: , Part: , Department of National Defence , Ottawa, City,

District Office: Ottawa

GeoReference: Map Datum: , Zone: 18, Method: , UTM Easting: 442425.04, UTM Northing: 5028136.68,

UTM Location Description: ,

Incident Summary:

DND 5 L of diesel to grnd

Initial Incident Description (as reported):

Created: Julianne Dominski (Spills Action Centre) - 2018/09/23 09:21:23 AM

Caller to SAC(jd) reports a spill of approx 5 L of diesel fuel to the asphalt. They were able to contain it with absorbent and kitty litter. The spill was from a fuel truck to a rental generator. The spill occurred at the connection point (caller would consider it on the generator side). The spill has been stopped. There was a defective fuel gauge. Clean up has been completed.

Emailed report to TSSA and EC

SAC Action Class:

Land Spills

Non-Standard Procedure:

No

Incident Description:

Last update: Thandeka Ponalo (Ottawa District Office) - 2018/09/25 09:08 AM

SPA Rideau Valley

IPZ 2, score is 8.1

HVA Yes, score is 6

Spill of 5 L to Federal property. Spill cleaned up. Recommend no further action. Recommend IR be closed.

Incident Description Continuation:

Incident Update:

Was there an MOE field response?

No

Were there samples collected / analyzed at any time?

No

Known or Suspected Health / Environmental Consequence at the Time of Incident

Health / Environmental Consequence:	2 - Minor Environment

Has a Water Body been impacted?	No
Receiving Environment:	Land
Incident Event:	Leak/Break
Incident Reason:	Equipment Failure
Source Type:	Container/Drum/Tote
Sector Type:	Miscellaneous Industrial
MOE/Other Agencies Involved:	Federal - Environment
Was there a discharge / emission / spill of a contaminant to the environment?	
Yes	

Contaminants Table

Contaminant Name	Description	Code	UN#	Limit	Quantity	[units]	[freq]
DIESEL FUEL		13	1202		5	L	

Environmental Compliance Reporting (ECR)

Is this an air emission (measured or modelled) or wastewater (sewage) discharge exceedance that will become part of the Environmental Compliance Report?
(legislation, certificate of approval, order, or guideline)
No

Voluntary / Mandatory Abatement

Was there Non-Compliance/Non-Conformance Identified?	☐ Yes ☒ No

Voluntary / Mandatory Compliance Items

Type	Parent RefNo	Work Summary (may be truncated)	Date	AttainList

Waste / EGR Information

Waste / EGR Information entries:

Document Related Information

Cross Reference:	(doc link)	Task Link:	1358-B4VHTM 
Originating Document:		Created by:	Julianne Dominski
Date Created:	2018/09/23	Date Completed:	2018/09/25
Office Receiving Incident Report:	Spills Action Centre	Incident Info Received By:	Julianne Dominski
Bring Forward Date:		Bring Forward Reason:	

Signatures

Provincial Officer:

Name:	Thandeka Ponalo
Badge No:	1718
Work Unit:	Eastern Region
District/Area Office:	Ottawa District Office
Date:	2018/09/25
Signature:	

Supervisor:

Name:	Charlie Primeau
Work Unit:	Eastern Region
District/Area Office:	DWMD Ottawa Office
Date:	2018/09/25
Signature:	



Search

Go

Search Generators

Company Name	Generator#	Site Address	Company Status	Company History	Waste Classes	Site Details	Payment Details	User Details	Company Details
 BGIS BGIS	ON6748119	#BGIS, 101 Goldenrod Drive Ottawa - K1A 0T6 Canada	REGISTERED	View	View	View	View	View	View

| 1 |

back

 This indicates that this company has renewed their registration in 2022.

 This indicates that this company has registered in 2022.



Search

Go

Company Name: **BGIS BGIS**
Company Number: **ON6748119 (Generator)**

Active Waste Classes

Active Waste Class Listing

[Add New Waste Class](#) | [Inactive waste classes](#)

Active Off-site Waste Classes

Waste Class	View Details	Hazardous Waste Number (per waste stream)	Reg. 347 Schedules	Disposal Method	Part 2B required	Part 2B complete	Physical State	Off-Site	Status	UnRegister Waste Class
145 - I	View Details	D001	5, 13	Land Disposal	Y	Y	Liquid	Off-Site	Active	
252 - L	View Details	N/A					Liquid	Off-Site	Active	
262 - L	View Details	N/A					Liquid	Off-Site	Active	
263 - I	View Details	D001	5, 13	Land Disposal	Y	Y	Liquid	Off-Site	Active	
331 - I	View Details	D001	5, 13	Land Disposal	Y	Y	Gas	Off-Site	Active	

Back

Ministry of the Environment,
Conservation and Parks

Access and Privacy Office

12th Floor
40 St. Clair Avenue West
Toronto ON M4V 1M2
Tel: (416) 314-4075

Ministère de l'Environnement, de la
Protection de la nature et des Parcs

Bureau de l'accès à l'information et
de la protection de la vie privée

12^e étage
40, avenue St. Clair ouest
Toronto ON M4V 1M2
Tél. : (416) 314-4075



August 2, 2022

Nick Sullivan
Paterson Group Inc.
154 Colonnade Road
Ottawa, Ontario K2E 7J5
nsullivan@patersongroup.ca

Dear Nick Sullivan:

RE: MECP FOI A-2022-05349, Your Reference #: PE5791 – Decision Letter

This letter is further to your request made pursuant to the Freedom of Information and Protection of Privacy Act (the Act) relating to 251 Sir Frederick Banting Driveway, Ottawa.

After a thorough search through the files of the ministry's Ottawa District Office, Environmental Assessment and Permissions Division, Environmental Monitoring and Reporting Branch, Sector Enforcement Branch (formerly Environmental Investigations and Enforcement Branch and Sector Compliance Branch) and Safe Drinking Water Branch, records were located in response to your request. The final decision has been made to provide partial access to the requested information and a copy of the releasable portion of the record is attached.

Records or information that are not relevant to the request (e.g., records that are blank, outside of the date range or do not relate directly to the subject matter) have been removed and marked "Not Responsive" or 'N/R'.

To provide you with this response and in accordance with Section 57 of the Act, the fee owed is \$30.00 for 1 hour of search time @ \$30.00 per hour. **We have applied the \$30.00 for this request from your initial payment.**

You may request a review of my decision by contacting the Information and Privacy Commissioner/Ontario, 2 Bloor Street East, Suite 1400, Toronto, ON M4W 1A8 (800-387-0073 or 416-326-3333). Please note that there is a \$25.00 fee and you only have 30 days from receipt of this letter to request a review.

If you have any questions, please contact Sylwia Rynkiewicz at 437-995-1618 or sylwia.rynkiewicz@ontario.ca.

Yours truly,

A handwritten signature in black ink, appearing to read 'Sylwia', written in a cursive style.

for

Ryan Gunn
Manager (A), Access and Privacy Office

Attachment



INCIDENT REPORT

Reference Number:	0543-ACKM3K	Module Type:	ECA/CofA/Permit Non-Compliance
Status:	Recommended	File Storage Number:	SI OT OT CO 100
Program:	Water - Ground & Surface	Activity:	Spills

Caller or PO Reporting/Receiving Information

First Name:	Last Name:
Brad	Wilson
Name of Company:	
Brooke Claxton Building	

MAILING ADDRESS

Civic Address:		Unit Identifier:	
70 Colombine Driveway			
Delivery Designator:		Delivery Identifier:	
Municipality/ Unorganized Twp:	County/District:	Province/State:	Postal Code:
Ottawa		Ontario	K1A 0K9
Postal Station:		Country:	Canada
Telephone Number:	Extension:	Other Number:	Email Address:
(613)806-5832		Fax	

Date Reported to MOE:	2016/08/06	Time Reported to MOE:	12:15
Date of Incident:	2016/08/06	Time of Incident:	12:00
Incident Date Confirmation:	Actual		

Client(s)

Client Details

Site(s)

Site Details

Brooke Claxton Building<UNOFFICIAL>
Address: Lot: , Part: , 70 Colombine Driveway, Ottawa, City,
District Office: Ottawa
GeoReference: Map Datum: , Zone: 18, Method: , UTM Easting: 442342, UTM Northing: 5028619, UTM
Location Description: ,

Incident Summary:

Brooke Claxton Building: 1-2 L motor oil on pavement

Initial Incident Description (as reported):

Created: Akiko Date (Spills Action Centre) - 2016/08/06 12:15:17 PM

Caller reports that a contractor, Gal Power, was doing annual maintenance on the generator for the building. They were at the north entrance of the Brooke Claxton building and had a pail of motor oil (Kendal Super-D XA) in the truck bed, when it tipped and spilled. About 1-2 L of it dripped off the truck and on to the pavement lot. They used absorbent to contain and collect it. Gal Power will remove the absorbent and do some more sanding/sweeping to clean the pavement. No offsite impact.

Caller notes that it is a federal building. Copy sent to EPS

SPIMT: IPZ2 = 8.1

SAC Action Class:

Land Spills

Non-Standard Procedure:

No

Incident Description:

Last update: Angela Cappello (Ottawa District Office) - 2016/09/06 09:52 AM

Location Information

Latitude: 45.408712 Longitude:-75.736821
UTM Zone: 18 Easting: 442342 Northing: 5028619
Upper Tier Municipality Name: N/A
Single and/or Lower Tier Municipality Name: CITY OF OTTAWA
Township, Concession and Lot: NEPEAN CON A ON OTTAWA RIVER, LOT 35
Assessment Roll Number: 06140736013050100000
MPAC Street Address: 251 SIR FREDERICK BANTING DR, CITY OF OTTAWA

Source Water Protection Details for Location

Source Protection Area: Rideau Valley
Intake Protection Zone: 2; score is 8.1
Surface Water policies (external link to policy database)
Wellhead Protection Area: No
WHPA E (GUDI): No
Issue Contributing Area: No
Significant Groundwater Recharge Area: No
Highly Vulnerable Aquifer: Yes; score is 6
Event Based Area: No
To see if any land activities are restricted, check the policies in the source protection plan (link to external website).
Information is current as of: 2016-02-08

September 6, 2016

Spill did not leave the property, was minor in nature and was cleaned up. NFA required at this time.

Incident Description Continuation:

Incident Update:

Jonathan Kowba (Spills Action Centre) - 2016/08/06 created; 2016/08/06 last update :
20:50: Brooke Claxton Building (Brad Wilson) to SAC(JK). Caller reported an update that the contractor came back to the site and put the absorbant down and swept it up, and the spill has been cleaned up as of 20:10.

Was there an MOE field response?	No
Were there samples collected / analyzed at any time?	No
Known or Suspected Health / Environmental Consequence at the Time of Incident	
Health / Environmental Consequence:	0 - No Impact
Has a Water Body been impacted?	
No	
Receiving Environment:	Land
Incident Event:	Unknown / N/A
Incident Reason:	Operator/Human Error
MOE/Other Agencies Involved:	Federal - Environment, Province - MOE-District Office
Was there a discharge / emission / spill of a contaminant to the environment?	
Yes	

Contaminants Table

Contaminant Name	Description	Code	UN#	Limit	Quantity	[units]	[freq]
MOTOR OIL		15	1993		2	L	

Environmental Compliance Reporting (ECR)

Is this an air emission (measured or modelled) or wastewater (sewage) discharge exceedance that will become part of the Environmental Compliance Report?

(legislation, certificate of approval, order, or guideline)

No

Voluntary / Mandatory Abatement

Was there Non-Compliance/Non-Conformance Identified?

☐ Yes ☒ No

Voluntary / Mandatory Compliance Items

Type Parent RefNo Work Summary (may be truncated)

Date

AttainList

Waste / EGR Information


Waste / EGR Information entries:

Document Related Information

Cross Reference:	(doc link)	Task Link:	0681-ACKMGU 
Originating Document:		Created by:	Akiko Date
Date Created:	2016/08/06	Date Completed:	
Office Receiving Incident Report:	Spills Action Centre	Incident Info Received By:	Akiko Date
Bring Forward Date:		Bring Forward Reason:	

Signatures

Provincial Officer:

Name:	Angela Cappello
Badge No:	
Work Unit:	Ottawa District Office
District/Area Office:	Ottawa District Office
Date:	2016/09/06
Signature:	

District/Area Supervisor:

Name:	
Work Unit:	
District/Area Office:	
Date:	
Signature:	



INCIDENT REPORT

Reference Number:	5723-A8ZP4K	Module Type:	Spill
Status:	Closed	File Storage Number:	NOT FILED
Program:	Water - Ground & Surface	Activity:	Spills

Caller or PO Reporting/Receiving Information

First Name:	Last Name:
Brad	Wilson
Name of Company:	
Brookefield Global Integrated Solutions	

MAILING ADDRESS

Civic Address:		Unit Identifier:	
70 Colombine Driveway			
Delivery Designator:		Delivery Identifier:	
Municipality/ Unorganized Twp:	County/District:	Province/State:	Postal Code:
Ottawa		Ontario	
Postal Station:		Country:	Canada
Telephone Number:	Extension:	Other Number:	Email Address:
613-806-5832		Fax	

Date Reported to MOE:	2016/04/14	Time Reported to MOE:	13:59
Date of Incident:	2016/04/14	Time of Incident:	12:15
Incident Date Confirmation:	Actual		

Client(s)

Client Details

Site(s)

Site Details

Office Building - Loading Dock <UNOFFICIAL>
Address: Lot: , Part: , 70 Colombine Driveway, Ottawa, City, K1A 0K9
District Office: Ottawa

Incident Summary:

Brookefield: 1 L hydraulic fluid to concrete, cntd & dng

Initial Incident Description (as reported):

Created: Fatima Jabeen (Spills Action Centre) - 2016/04/14 01:59:14 PM

Caller (Brad Wilson, Brookefield) reporting -

A dock leveller had a hydraulic fluid line break open. It spilled out about a litre of hydraulic oil to the concrete surface. The spill was just underneath the leveller. The manufacturer details of the fluid are unknown. The spill has been contained with absorbent pads. The spill is not migrating and there are no impacts (and also no potential for impacts in case of precipitation), to any cbs on-site.

The work order for clean-up has been initiated with the other tenant on-site, for a private contractor to respond to the clean-up.

SAC to be updated when clean-up is complete.

14:22 SAC (fj) to MOECC, Ottawa: Brad Eckert, Do briefed on incident details.

18:51 SAC (jc2) to Brookfield (Brad). Left voicemail regarding cleanup update status and for a callback.

SAC Action Class:

Land Spills

Non-Standard Procedure:

No

Incident Description:

Last update: Jena Leavoy (Ottawa District Office) - 2019/02/05 02:39 PM

SPIMT Result:**Location Information**

Latitude: 45.408764 Longitude:-75.737358

UTM Zone: 18 Easting: 442300 Northing: 5028625

Upper Tier Municipality Name: N/A

Single and/or Lower Tier Municipality Name: CITY OF OTTAWA

Township, Concession and Lot: NEPEAN CON A ON OTTAWA RIVER, LOT 35

Assessment Roll Number: 06140736013050100000

MPAC Street Address: 251 SIR FREDERICK BANTING DR, CITY OF OTTAWA

Source Water Protection Details for Location

Source Protection Area: Rideau Valley

Intake Protection Zone: 2; score is 8.1

Surface Water policies (external link to policy database)

Wellhead Protection Area: No

WHPA E (GUDI): No

Issue Contributing Area: No

Significant Groundwater Recharge Area: No

Highly Vulnerable Aquifer: Yes; score is 6

Event Based Area: No

To see if any land activities are restricted, check the policies in the source protection plan (link to external website).
Information is current as of: 2016-02-08

JL - spill cleaned up. NFA required. Recommend IR be closed.

Incident Description Continuation:

Incident Update:

Chris Mutton (Spills Action Centre) - 2016/04/15 created; 2016/04/15 last update :

08:50 Brad Wilson to SAC(cm2): giving an update about the clean up. DrainAll will be on site in a couple of hours (~10:00-11:00) for clean up. They first must implement all the safety procedures in raising, shutting off, and locking the hydraulic apparatus, as the spill has gone underneath.

DrainAll will inform us when the spill has been cleaned.

Contact

DrainAll

Neil Brown

613-739-1070 (Office)

Kimberley McElcheran (Spills Action Centre) - 2016/04/15 created; 2016/04/15 last update :

16:45 - Brad (original caller) to SACKm - Brad updating SAC that the clean-up is complete. Caller stated that Drain-All collected 15 kg of solid non-hazardous material into a drum, and took it off-site.

Caller stated he will update the Ottawa DO as well.

Was there an MOE field response?	No
Were there samples collected / analyzed at any time?	No
Known or Suspected Health / Environmental Consequence at the Time of Incident	
Health / Environmental Consequence:	2 - Minor Environment

Has a Water Body been impacted?	No
Receiving Environment:	Land
Incident Event:	Leak/Break
Incident Reason:	Equipment Failure
Source Type:	Other
Specify Other:	Dock Leveler
Sector Type:	Miscellaneous Industrial
MOE/Other Agencies Involved:	Province - MOE-District Office
Was there a discharge / emission / spill of a contaminant to the environment?	
Yes	

Contaminants Table

Contaminant Name	Description	Code	UN#	Limit	Quantity	[units]	[freq]
HYDRAULIC OIL		15	n/a		1	L	

Environmental Compliance Reporting (ECR)

Is this an air emission (measured or modelled) or wastewater (sewage) discharge exceedance that will become part of the Environmental Compliance Report?

(legislation, certificate of approval, order, or guideline)

No

Voluntary / Mandatory Abatement

Was there Non-Compliance/Non-Conformance Identified?

☐ Yes ☒ No

Voluntary / Mandatory Compliance Items

Type	Parent RefNo	Work Summary (may be truncated)	Date	AttainList

Waste / EGR Information

Waste / EGR Information entries:

Document Related Information

Cross Reference:	(doc link)	Task Link:	3523-A8ZPDP 
Originating Document:		Created by:	Fatima Jabeen
Date Created:	2016/04/14	Date Completed:	2019/02/08
Office Receiving Incident Report:	Spills Action Centre	Incident Info Received By:	Fatima Jabeen
Bring Forward Date:		Bring Forward Reason:	

Signatures

Provincial Officer:

Name:	Jena Leavoy
Badge No:	

Ottawa District Office

2019/02/05

Signature:

Janabaw

Supervisor:

Name:

Charlie Primeau

Work Unit:

District/Area Office:

Date:

2019/02/08

Signature:

**Pages 11 to / à 12
are withheld pursuant to section
sont retenues en vertu de l'article**

N/R

**of the Freedom of Information and Protection of Privacy Act
de la Freedom of Information and Protection of Privacy Act**

PWGSC

Address of Well Location (Street Number/Name) 50 Colombine Driveway				Township		Lot		Concession	
County/District/Municipality				City/Town/Village Ottawa		Province Ontario		Postal Code 	
UTM Coordinates		Zone	Easting	Northing	Municipal Plan and Sublot Number			Other	
NAD 83		18	442510	5028678					

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

[illegible]

Annular Space			
Depth Set at (m/ft)		Type of Sealant Used	Volume Placed
From	To	(Material and Type)	(m ³ /ft ³)
0	.31	Concrete / Elasmount	
.31	1.5	holeplug	
1.5	6.1	sand	


Results of Well Yield Testing				
After test of well yield, water was: ☐ Clear and sand free ☐ Other, specify _____	Draw Down		Recovery	
	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:	Static Level			
	1		1	
Pump intake set at (m/ft)	2		2	
	3		3	
Pumping rate (l/min / GPM)	4		4	
	5		5	
Duration of pumping _____ hrs + _____ min	10		10	
Final water level end of pumping (m/ft)	15		15	
	20		20	
If flowing give rate (l/min / GPM)	25		25	
	30		30	
Recommended pump depth (m/ft)	40		40	
	50		50	
Recommended pump rate (l/min / GPM)	60		60	
Well production (l/min / GPM)				
Disinfected? ☐ Yes ☐ No				

Method of Construction		Well Use		
☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial	☐ Not used
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal	☐ Dewatering
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☒ Test Hole	☒ Monitoring
☐ Boring	☐ Digging	☐ Irrigation	☐ Cooling & Air Conditioning	
☐ Air percussion		☐ Industrial		
☐ Other, specify <u>Direct Push</u>		☐ Other, specify _____		

Construction Record - Casing					Status of Well
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		
			From	To	
5.70	PVC	.390	0	1.5	☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☐ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, Insufficient Supply ☐ Abandoned, Poor Water Quality ☐ Abandoned, other, specify _____ ☐ Other, specify _____

Construction Record - Screen				
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)	
			From	To
6.03	PVC	10	1.5	6.1

Water Details		Hole Diameter		
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____	Depth (m/ft) From	To	Diameter (cm/in)
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____	0	1.5	11.43
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____	1.5	6.1	7.62

Well Contractor and Well Technician Information			
Business Name of Well Contractor Strata Soil Sampling Inc.		Well Contractor's Licence No. 7 2 4 1	
Business Address (Street Number/Name) 165 Shields Court		Municipality Markham	
Province Ontario	Postal Code L3R 8V2	Business E-mail Address wrecords@stratasoil.c	
Bus. Telephone No. (inc. area code) 905-764-9304	Name of Well Technician (Last Name, First Name) Beatty Brian		
Well Technician's Licence No. 3 6 1 1 6	Signature of Technician and/or Contractor 		Date Submitted 2011 50403

Map of Well Location

Please provide a map below following instructions on the back.

50

30m

1.5m

Parkville

Colombine DriveWay

Comments:							
Well owner's information package delivered ☐ Yes ☒ No	Date Package Delivered Y Y Y Y M M D D Date Work Completed 2011 5 03 3 0						
<table border="1"> <tr> <th colspan="2">Ministry Use Only</th> </tr> <tr> <td>Audit No.</td> <td>Z 207413</td> </tr> <tr> <td>Received</td> <td>APR 22 2015</td> </tr> </table>		Ministry Use Only		Audit No.	Z 207413	Received	APR 22 2015
Ministry Use Only							
Audit No.	Z 207413						
Received	APR 22 2015						

Measurements recorded in: ☒ Metric ☐ Imperial

A178457

5-16876

Page of

PWGSC

Address of Well Location (Street Number/Name) 50 Columbine Driveway				Township		Lot		Concession	
County/District/Municipality				City/Town/Village Dufferin				Province Ontario	
Postal Code									
UTM Coordinates		Zone	Easting	Northing		Municipal Plan and Sublot Number			
NAD		83	184424	825028666					
						Other			

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

[illegible]

Annular Space			
Depth Set at (m/R)		Type of Sealant Used	Volume Placed
From	To	(Material and Type)	(m³/R³)
0	.31	Concrete / flush mount	
.31	1.22	hobply	
1.22	5.79	Sand	

Method of Construction		Well Use		
☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial	☐ Not used
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal	☐ Dewatering
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☒ Test Hole	☒ Monitoring
☐ Boring	☐ Digging	☐ Irrigation	☐ Cooling & Air Conditioning	
☒ Air percussion		☐ Industrial		
☒ Other, specify <u>Direct Push</u>		☐ Other, specify _____		

Construction Record - Casing					Status of Well
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☐ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned
			From	To	
5.20	PVC	.390	0	1.5	

Construction Record - Screen				
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)	
			From	To
6.03	PVL	10	1.5	5.79

Insufficient Supply

☐ Abandoned, Poor Water Quality

☐ Abandoned, other, specify _____

☐ Other, specify _____

Water Details		Hole Diameter		
Water found at Depth (m/ft) ☐ Gas ☐ Other, specify _____	Kind of Water: ☐ Fresh ☐ Untested	Depth (m/ft) From	To	Diameter (cm/in)
Water found at Depth (m/ft) ☐ Gas ☐ Other, specify _____	Kind of Water: ☐ Fresh ☐ Untested	0	1.5	11.43
Water found at Depth (m/ft) ☐ Gas ☐ Other, specify _____	Kind of Water: ☐ Fresh ☐ Untested	1.5	5.79	7.62
Water found at Depth (m/ft) ☐ Gas ☐ Other, specify _____	Kind of Water: ☐ Fresh ☐ Untested			

Well Contractor and Well Technician Information	
Business Name of Well Contractor Strata Soil Sampling Inc.	Well Contractor's Licence No. 7 2 4 1
Business Address (Street Number/Name) 165 Shields Court	Municipality Markham

Province	Postal Code	Business E-mail Address
Ontario	L3R 8V2	wrecords@stratasoil.com
Bus. Telephone No. (inc. area code)	Name of Well Technician (Last Name, First Name)	
905-764-9304	Beatty Brian	
Well Technician's Licence No.	Signature of Technician and/or Contractor	Date Submitted
3616		20150403

Results of Well Yield Testing				
After test of well yield, water was: ☐ Clear and sand free ☐ Other, specify _____	Draw Down		Recovery	
	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:	Static Level			
	1		1	
Pump intake set at (m/ft)	2		2	
Pumping rate (l/min / GPM)	3		3	
Duration of pumping _____ hrs + _____ min	4		4	
Final water level end of pumping (m/ft)	5		5	
If flowing give rate (l/min / GPM)	10		10	
Recommended pump depth (m/ft)	15		15	
	20		20	
Recommended pump rate (l/min / GPM)	25		25	
	30		30	
Well production (l/min / GPM)	40		40	
	50		50	
Disinfected? ☐ Yes ☐ No	60		60	

Map of Well Location

Please provide a map below following instructions on the back.

The map shows a horizontal line representing a driveway labeled "Colombine Drive Way". To the left of the driveway is a rectangle labeled "50". To the right of the driveway is a well symbol (a circle with a cross) labeled "15m". A double-headed arrow indicates a distance of "75m" from the well to the right edge of the map. On the right side of the map, there is a vertical line with an arrow pointing up and the word "Parkade" written vertically.

Comments:

Well owner's information package delivered ☐ Yes ☒ No	Date Package Delivered Y Y Y Y M M D D Date Work Completed 20150330	Ministry Use Only Audit No. Z 207414 APR 22 2015 Received

A178460

S-168716

Page of

PWGSC

Address of Well Location (Street Number/Name) 50 Colombine Driveway		Township	Lot	Concession
County/District/Municipality		City/Town/Village Ottawa	Province Ontario	Postal Code
UTM Coordinates NAD 83	Zone 18	Easting 442502	Northings 5028694	Municipal Plan and Sublot Number
				Other

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
Brn	Gravel	Sand	Soft, dry	0	1.22
Grp	lime stone		Fractured	1.22	4.57

Annular Space				Results of Well Yield Testing				
Depth Set at (m/ft)		Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)	After test of well yield, water was: ☐ Clear and sand free ☐ Other, specify _____	Draw Down		Recovery	
From	To				Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
0	.31	Concrete / Flash mount		If pumping discontinued, give reason: Pump intake set at (m/ft)	Static Level			
.31	1.5	hole plug			1		1	
1.5	4.57	Sand			2		2	

Method of Construction	Well Use
☐ Cable Tool ☐ Rotary (Conventional) ☐ Rotary (Reverse) ☐ Boring ☒ Air percussion ☐ Other, specify	☐ Public ☐ Domestic ☐ Livestock ☐ Irrigation ☐ Industrial ☐ Other, specify
☐ Diamond ☐ Jetting ☐ Driving ☐ Digging ☒ Direct Push	☐ Commercial ☐ Municipal ☒ Test Hole ☐ Cooling & Air Conditioning ☐ Not used ☐ Dewatering ☒ Monitoring

Construction Record - Casing			Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	Depth (m/ft) To
5.20	PVC	.390	0	1.5


☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☐ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, Insufficient Supply ☐ Abandoned, Poor Water Quality ☐ Abandoned, other, specify ☐ Other, specify

Construction Record - Screen				Status of Well	
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To	
6.03	PVC	10	1.5	4.57	

☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☐ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, Insufficient Supply ☐ Abandoned, Poor Water Quality ☐ Abandoned, other, specify ☐ Other, specify

Water Details		Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	Depth (m/ft) From	Diameter (cm/in) To
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	0	2.5
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	2.5	4.57
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify		7.62

Well Contractor and Well Technician Information			
Business Name of Well Contractor Strata Soil Sampling Inc.	Well Contractor's Licence No. 7241	Business Address (Street Number/Name) 165 Shields Court	Municipality Markham
Province Ontario	Postal Code L3R 8V2	Business E-mail Address wrecords@stratasoil.com	
Bus. Telephone No. (inc. area code) 905-764-9304	Name of Well Technician (Last Name, First Name) Beatty Brian	Well Technician's Licence No. 3616	Date Submitted 20150403
Signature of Technician and/or Contractor			

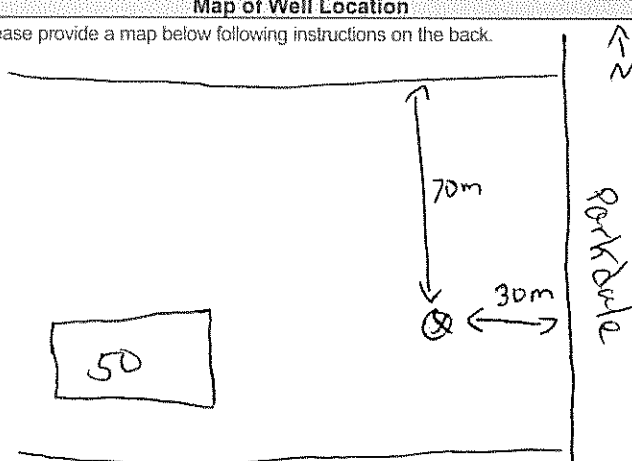Map of Well Location			
Please provide a map below following instructions on the back.			
			
Comments:			

Ministry Use Only	
Audit No. 2207415	APR 22 2015
Received	

Well owner's information package delivered ☐ Yes ☒ No	Date Package Delivered 20150330	Date Work Completed 20150330

PWGSC

Address of Well Location (Street Number/Name) 50 Colombine Driveway				Township		Lot		Concession	
County/District/Municipality				City/Town/Village Ottawa				Province Ontario	
UTM Coordinates		Zone	Easting	Northing	Municipal Plan and Sublot Number				Postal Code
NAD		83	18442453	5028718					Other

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

[illegible]

Annular Space			
Depth Set at (m/ft)		Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
From	To		
0	.31	Concrete / flush mount	
.31	1.35	1-hole plug	
1.5	4.57	Sand	

Method of Construction		Well Use		
☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial	☐ Not used
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal	☐ Dewatering
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☐ Test Hole	☐ Monitoring
☐ Boring	☐ Digging	☐ Irrigation	☐ Cooling & Air Conditioning	
☐ Air percussion		☐ Industrial		
☒ Other, specify <u>Direct Push</u>		☐ Other, specify _____		

Construction Record - Casing					Status of Well
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☐ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned,
			From	To	
5.20	PVC	.340	0	1.5	

Construction Record - Screen				
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)	
			From	To
6.03	PVC	10	1.5	4.57

Water Details		Hole Diameter		
Water found at Depth (m/ft) ☐ Gas ☐ Other, specify _____	Kind of Water: ☐ Fresh ☐ Untested	Depth (m/ft) From	To	Diameter (cm/in)
Water found at Depth (m/ft) ☐ Gas ☐ Other, specify _____	Kind of Water: ☐ Fresh ☐ Untested	0	1.83	11.43
Water found at Depth (m/ft) ☐ Gas ☐ Other, specify _____	Kind of Water: ☐ Fresh ☐ Untested	1.83	4.57	7.62
Water found at Depth (m/ft) ☐ Gas ☐ Other, specify _____	Kind of Water: ☐ Fresh ☐ Untested			

Well Contractor and Well Technician Information

Business Name of Well Contractor Strata Soil Sampling Inc.		Well Contractor's Licence No. 7 2 4 1
Business Address (Street Number/Name) 165 Shields Court		Municipality Markham
Province Ontario	Postal Code L3R 8V2	Business E-mail Address wrecords@stratasoil.c
Bus. Telephone No. (inc. area code) 905-764-9304	Name of Well Technician (Last Name, First Name) Beatty Brian	
Well Technician's Licence No. 3616	Signature of Technician and/or Contractor 	Date Submitted 20150403

Results of Well Yield Testing

After test of well yield, water was:		Draw Down		Recovery	
☐ Clear and sand free ☐ Other, <i>specify</i> _____		Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:		Static Level			
		1		1	
Pump intake set at (m/ft)		2		2	
Pumping rate (l/min / GPM)		3		3	
		4		4	
Duration of pumping _____ hrs + _____ min		5		5	
Final water level end of pumping (m/ft)		10		10	
If flowing give rate (l/min / GPM)		15		15	
		20		20	
Recommended pump depth (m/ft)		25		25	
Recommended pump rate (l/min / GPM)		30		30	
Well production (l/min / GPM)		40		40	
		50		50	
Disinfected?		60		60	
☐ Yes ☐ No					

Map of Well Location

Please provide a map below following instructions on the back.

A hand-drawn map of a property. At the top, a horizontal line is labeled "Golden Rod Driveway". To the right of this line, a vertical line is labeled "Rockdale" and has an arrow pointing upwards with the number "2" next to it. The main area of the map is a rectangle. Inside this rectangle, there is a smaller rectangle labeled "50". Above the "50" rectangle, there is a vertical double-headed arrow labeled "40m" and a horizontal double-headed arrow labeled "75m". At the bottom of the map, a horizontal line is labeled "Colombine Drive Way".

Comments:

Well owner's information package delivered ☐ Yes ☒ No	Date Package Delivered Y Y Y Y M M D D 2 0 1 5 0 3 3 0	Ministry Use Only Audit No. Z 207412 APR 22 2015 Received _____
	Date Work Completed 2 0 1 5 0 3 3 0	



Well Tag No. (Place Sticker and/or Print Below)
A178459

Measurements recorded in: ☒ Metric ☐ Imperial

Page **5168210** of

PWGCSC

Address of Well Location (Street Number/Name) **50 Colombine Driveway**
County/District/Municipality **Ottawa** Township **Ottawa** Lot Concession
City/Town/Village **Ottawa** Province **Ontario** Postal Code
UTM Coordinates Zone **18** Easting **8442482** Northing **5028713** Municipal Plan and Sublot Number Other

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)					
General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)	
Brn	Gravel	Sand	soft dry	0	1.21
Grp	limestone		Fractured	.91	6.1

Annular Space			
Depth Set at (m/ft)	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)	
0 .31	Flushmount concrete		
.31 1.22	hob plug		
1.22 6.1	Sand		

Results of Well Yield Testing			
After test of well yield, water was:		Draw Down	
☐ Clear and sand free ☐ Other, specify		Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:		Time (min)	Water Level (m/ft)
Pump intake set at (m/ft)		1	1
Pumping rate (l/min / GPM)		2	2
Duration of pumping hrs + min		3	3
Final water level end of pumping (m/ft)		4	4
If flowing give rate (l/min / GPM)		5	5
Recommended pump depth (m/ft)		10	10
Recommended pump rate (l/min / GPM)		15	15
Well production (l/min / GPM)		20	20
Disinfected?		25	25
☐ Yes ☐ No		30	30
		40	40
		50	50
		60	60

Method of Construction: ☐ Cable Tool ☐ Rotary (Conventional) ☐ Rotary (Reverse) ☐ Boring ☒ Air percussion ☐ Other, specify **Direct Push**
Well Use: ☐ Public ☐ Domestic ☐ Livestock ☐ Irrigation ☐ Industrial ☐ Commercial ☐ Municipal ☒ Test Hole ☐ Cooling & Air Conditioning ☐ Not used ☐ Dewatering ☐ Monitoring

Construction Record - Casing				Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)	From	To
5.20	PK	.340	0		1.5

Construction Record - Screen				Status of Well	
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)	From	To
6.03	PK	10	1.5		6.1

Water Details		Hole Diameter		
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	Depth (m/ft)	Diameter (cm/in)	
		From	To	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	0	1.5	11.43
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	1.5	6.1	7.62

Well Contractor and Well Technician Information
Business Name of Well Contractor: **Strata Soil Sampling Inc.** Well Contractor's Licence No.: **7 2 4 1**
Business Address (Street Number/Name): **165 Shields Court** Municipality: **Markham**
Province: **Ontario** Postal Code: **L3R 8V2** Business E-mail Address: **wrecords@stratasoil.com**

Bus. Telephone No. (inc. area code): **905-764-9304** Name of Well Technician (Last Name, First Name): **Beatty Brian**
Well Technician's Licence No.: **3 6 1 6** Signature of Technician and/or Contractor: *[Signature]* Date Submitted: **20150403**

Map of Well Location
Please provide a map below following instructions on the back.
Golden Rod Driveway
Colombine
50
40m
50m
Portale

Comments:
Well owner's information package delivered: ☐ Yes ☒ No
Date Package Delivered: **20150330**
Date Work Completed: **20150330**
Ministry Use Only
Audit No: **2207416**
APR 22 2015
Received



Instructions for Completing Form

- For use in the **Province of Ontario** only. This document is a permanent **legal** document. Please retain for future reference.
 • All Sections **must** be completed in full to avoid delays in processing. Further instructions and explanations are available on the back of this form.
 • Questions regarding completing this application can be directed to the Water Well Help Desk (Toll Free) at 1-888-396-9355.
 • **All metre measurements shall be reported to 1/10th of a metre.**
 • Please print clearly in blue or black ink only.

Well Owner's Information and Location of Well Information

First Name Pinotium Environmental		Last Name		Mailing Address (Street Number/Name, RR, Lot, Concession) 200 - 515 Legget Dr.			
County/District/Municipality Carleton		Township/City/Town/Village Ottawa		Province Ontario	Postal Code K2K 3G4	Telephone Number (include area code)	
Address of Well Location (County/District/Municipality) Carleton				Township		Lot	Concession
RR#/Street Number/Name 1065 Wellington St.				City/Town/Village Ottawa		Site/Compartment/Block/Tract etc.	
GPS Reading	NAD 83	Zone 18	Easting 442265	Northing 5028105	Unit Make/Model Garmin	Mode of Operation:	☐ Undifferentiated ☒ Averaged ☐ Differentiated, specify

Log of Overburden and Bedrock Materials (see instructions)

[illegible]

Hole Diameter			Construction Record					Test of Well Yield				
Depth	Metres	Diameter	Inside diam centimetres	Material	Wall thickness centimetres	Depth		Pumping test method	Draw Down		Recovery	
From	To	Centimetres				From	To		Time min	Water Level Metres	Time min	Water Level Metres
0	4	10	Casing					Pump intake set at - (metres)	Static Level			
			3.8	☐ Steel ☐ Fibreglass ☒ Plastic ☐ Concrete ☐ Galvanized	0.25	0	2.4	Pumping rate - (litres/min)	1		1	
				☐ Steel ☐ Fibreglass ☐ Plastic ☐ Concrete ☐ Galvanized				Duration of pumping ____hrs + ____ min	2		2	
				☐ Steel ☐ Fibreglass ☐ Plastic ☐ Concrete ☐ Galvanized				Final water level end of pumping ____metres	3		3	
				☐ Steel ☐ Fibreglass ☐ Plastic ☐ Concrete ☐ Galvanized				Recommended pump type. ☐ Shallow ☐ Deep	4		4	
								Recommended pump depth. ____metres	5		5	
								Recommended pump rate. (litres/min)	10		10	
								If flowing give rate - (litres/min)	15		15	
									20		20	
									25		25	
								If pumping discontin- ued, give reason.	30		30	
									40		40	
									50		50	
									60		60	
Water Record			Screen					No Casing or Screen				
Water found at ____ Metres	Kind of Water		Outside diam	☐ Steel ☐ Fibreglass ☒ Plastic ☐ Concrete ☐ Galvanized	Slot No.							
____ m ☐ Fresh ☐ Sulphur ☐ Gas ☐ Salty ☐ Minerals ☐ Other: _____			4.3		10	2.4	4					
____ m ☐ Fresh ☐ Sulphur ☐ Gas ☐ Salty ☐ Minerals ☐ Other: _____												
____ m ☐ Fresh ☐ Sulphur ☐ Gas ☐ Salty ☐ Minerals ☐ Other: _____												
After test of well yield, water was ☐ Clear and sediment free ☐ Other, specify _____												
Chlorinated ☐ Yes ☐ No												

Plugging and Sealing Record			☒ Annular space	☐ Abandonment
Depth set at - Metres		Material and type (bentonite slurry, neat cement slurry) etc.	Volume Placed (cubic metres)	
From	To			
0	0.3	CONCRETE		
0.3	1.8	BENTONITE		
1.8	4.	SILICA SAND		

Method of Construction			
☐ Cable Tool	☐ Rotary (air)	☐ Diamond	☐ Digging
☐ Rotary (conventional)	☐ Air percussion	☐ Jetting	☒ Other
☐ Rotary (reverse)	☐ Boring	☐ Driving	<i>DIRECT PISTON</i>

Water Use			
☐ Domestic	☐ Industrial	☐ Public Supply	☐ Other
☐ Stock	☐ Commercial	☒ Not used	
☐ Irrigation	☐ Municipal	☐ Cooling & air conditioning	

Final Status of Well			
☐ Water Supply	☐ Recharge well	☐ Unfinished	☐ Abandoned, (Other)
☒ Observation well	☐ Abandoned, insufficient supply	☐ Dewatering	
☐ Test Hole	☐ Abandoned, poor quality	☐ Replacement well	

Well Contractor/Technician Information	
Name of Well Contractor <i>ATKINS SOIL SAMPLING</i>	Well Contractor's Licence No. <i>16241</i>
Business Address (street name, number, city etc.) <i>1147 W 235th Street, Richmond Hill</i>	
Name of Well Technician (last name, first name) <i>DRAPER, IRENE</i>	Well Technician's Licence No. <i>1-338</i>
Signature of Technician/Contractor <i>[Signature]</i>	Date Submitted YYYY MM DD <i>02/05/07</i>

Location of Well			
In diagram below show distances of well from road, lot line, and building. Indicate north by arrow. - Worcington St. - - - - N  			
Audit No.	Z 66220	Date Well Completed	YYYY 2007 MM 5 DD 7
Was the well owner's information package delivered? ☐ Yes ☒ No		Date Delivered	YYYY MM DD

Ministry Use Only				
Data Source		Contractor		
		7241		
Date Received	YYYY	MM	DD	Date of Inspection
				YYYY MM DD
Remarks		Well Record Number		
JUN 14 2007				

Well Owner's Information

First Name National Capital Commission	Last Name	E-mail Address	☐ Well Constructed by Well Owner
Mailing Address (Street Number/Name, RR) 501 Awerst St		Municipality Ottawa	Province Ont
Postal Code K1P1C7		Telephone No. (inc. area code)	

Part A Construction and/or Major Alteration of a Well

Address of Well Location (Street Number/Name, RR) Ottawa River Parkway		Township City of Ottawa	Lot NA	Concession NA
County/District/Municipality Ottawa Carleton	City/Town/Village Ottawa	Province Ontario	Postal Code	
UTM Coordinates NAD 83 18 44 2104 5028351	Zone Easting 18	Northings 44 2104 5028351	GPS Unit Make Magellan	Model 200
Mode of Operation: ☐ Undifferentiated ☒ Averaged			☐ Differentiated, specify	

Overburden and Bedrock Materials (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth From (Metres)	Depth To (Metres)
grey	sand	fill		0	4.6
	limestone			4.6	45.7
Monitoring well: osm W07-3 See attached log					

Annular Space/Abandonment Sealing Record


Depth Set at (Metres)	From	To	Type of Sealant Used (Material and Type)	Volume Placed (Cubic Metres)
45.7	41.2		Sand	22.1-16.9
41.2	34.0		holeplug	16.9-12.8
34.0	29.87		Sand	12.8-8.5
29.87	22.1		holeplug	8.5-5.6
			Sand	5.6-0

Method of Construction		Water Use	
☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☐ Test Hole
☒ Rotary (Air)	☐ Digging	☐ Irrigation	☐ Cooling & Air Conditioning
☐ Air percussion	☐ Boring	☐ Industrial	
☐ Other, specify		☐ Other, specify	

Status of Well	
☐ Water Supply	☐ Dewatering Well
☐ Replacement Well	☐ Abandoned, Insufficient Supply
☐ Test Hole	☐ Abandoned, Poor Water Quality
☐ Recharge Well	☐ Abandoned, other, specify
☒ Observation and/or Monitoring Hole	
☐ Alteration (Construction)	
☐ Other, specify	

Location of Well

Please provide a map below showing:
- all property boundaries, and measurements sufficient to locate the well in relation to fixed points,
- an arrow indicating the North direction
- detailed drawings can be provided as attachments no larger than legal size (8.5" by 14")
- digital pictures of inside of well can also be provided

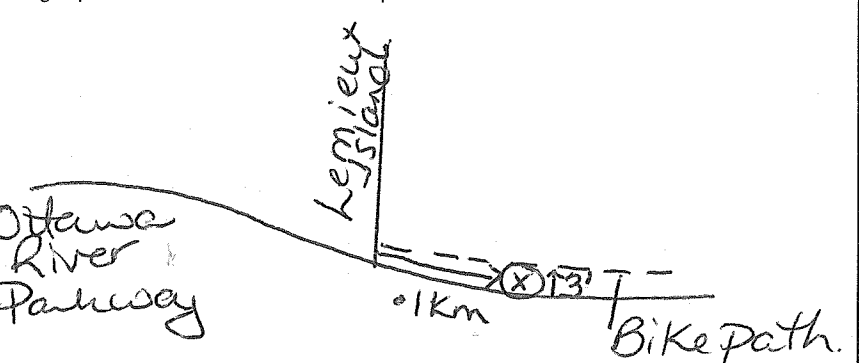

Date Well Completed (yyyy/mm/dd) 07/08/01	Was the well owner's information package delivered? ☐ Yes ☒ No	Date the Well Record and Package Delivered to Well Owner (yyyy/mm/dd) NA

Well Contractor and Well Technician Information

Business Name of Well Contractor Air Rock Drilling Co Ltd	Well Contractor's Licence No. 11119
Business Address (Street No./Name, number, RR) RR#1	Municipality Richmond
Province Ont	Postal Code K0A2A0
Bus. Telephone No. (inc. area code) 6138382170	Name of Well Technician (Last Name, First Name) Purcell Shannon
Well Technician's Licence No. 2122	Signature of Technician <i>[Signature]</i>
Date Submitted (yyyy/mm/dd) 2007-10-10	

Results of Well Yield Testing				
Check box if after test of well yield, water was: ☐ Clear and sand free ☐ Cannot develop to sand-free state If pumping discontinued, give reason: Pumping test method Pump intake set at (Metres) Pumping rate (Litres/min) Duration of pumping hrs + min Final water level end of pumping (Metres) Recommended pump type ☐ Shallow ☐ Deep Recommended pump depth Metres Recommended pump rate (Litres/min) If flowing give rate (Litres/min)	Draw Down		Recovery	
	Time (Min)	Water Level (Metres)	Time (Min)	Water Level (Metres)
	Static Level		Static Level	
	1		1	
	2		2	
	3		3	
	4		4	
	5		5	
	10		10	
	15		15	
	20		20	
	25		25	
	30		30	
	40		40	
	50		50	
	60		60	

Water Details	
Water found at Depth Metres ☐ Gas	Kind of Water ☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals
Water found at Depth Metres ☐ Gas	Kind of Water ☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals
Water found at Depth Metres ☐ Gas	Kind of Water ☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals

Casing Used	Screen Used	Casing and Well Details
☐ Galvanized ☒ Steel ☐ Fibreglass ☒ Plastic ☐ Concrete	☐ Galvanized ☐ Steel ☐ Fibreglass ☒ Plastic ☐ Concrete	Diameter of the Hole (Centimetres) 15 Depth of the Hole (Metres) 45.7 Wall Thickness (Metres) .0051

No Casing and Screen Used	
☐ Open Hole	NA
Disinfected? ☒ Yes ☐ No	Inside Diameter of the Casing (Metres) .15 / 0.038 Depth of the Casing (Metres) see attached

Ministry Use Only	
Audit No. Z 60200	Well Contractor No.
Date Received (yyyy/mm/dd) OCT 15 2007	Date of Inspection (yyyy/mm/dd)
Remarks	

Stratigraphic and Instrumentation Log: OSMW07-3

Project No: TZ974297

Location: NCC Lands - adjacent to bench

Logged By: ES

Drill Date: August 1, 2007

Hole Size: 150 mm

Project Name: Bayview Yard

Client: City of Ottawa

Entered By: ES

Drill Method: Rotary Air Hammer

Drilled By: George Downing Estate Drilling Ltd.


 300-210 Colonnade Road
 Ottawa, Ontario
 K2E 7L5

SUBSURFACE PROFILE				SAMPLES					Vapour ppm 100 200 300 400 %LEL 20 40 60 80	MONITORS			
Depth	Symbol	Description	Elevation (m)	Type	Number	Sample	N or RQD	Recovery (%)		A	B	C	D
0		Ground Surface	0.00										
0.1		OVERBURDEN	0.00										
0.2		Installed 150 mm steel casing to 4.6 m bgs.											
0.3													
0.4													
0.5													
0.6													
0.7													
0.8													
0.9													
1.0													
1.1													
1.2													
1.3													
1.4													
1.5													
1.6													
1.7													
1.8													
1.9													
2.0													
2.1													
2.2													
2.3													
2.4													
2.5													
2.6													
2.7													
2.8													
2.9													
3.0													
3.1													
3.2													
3.3													
3.4													
3.5													
3.6													
3.7													
3.8													
3.9													
4.0													
4.1													
4.2													
4.3													
4.4													
4.5													
4.6													
4.7													
4.8													
4.9													
5.0													
5.1													
5.2													
5.3													
5.4													
5.5													
5.6													
5.7													
5.8													
5.9													
6.0													
6.1													
6.2													
6.3													
6.4													
6.5													
6.6													
6.7													
6.8													
6.9													
7.0													
7.1													
7.2													
7.3													
7.4													
7.5													
7.6													
7.7													
7.8													
7.9													
8.0													
Z60200													
C#1119													
OCT 15 2007													
Elevation: 0				Casing Elevation: 0				Datum: Geodetic					
Easting: 0				Well Casing Size: 50 mm				Checked by: KH					
Northing: 0				Vapour Unit: NA				Sheet: 1 of 2					

Stratigraphic and Instrumentation Log: OSMW07-3

Project No: TZ974297

Location: NCC Lands - adjacent to bench

Logged By: ES

Drift Date: August 1, 2007

Hole Size: 150 mm

Project Name: Bayview Yard

Client: City of Ottawa

Entered By: ES

Drill Method: Rotary Air Hammer

Drilled By: George Downing Estate Drilling Ltd.


 300-210 Colonnade Road
 Ottawa, Ontario
 K2E 7L5

SUBSURFACE PROFILE				SAMPLES					MONITORS								
Depth	Symbol	Description	Elevation (m)	Type	Number	Sample	N or RQD	Recovery (%)	Vapour ppm				A	B	C	D	
									100	200	300	400					
									%LEL								
									20	40	60	80					
25																	
26																	
27																	
28																	
29																	
30																	
31		Surge of water at 30.2 mbgs.	-29.87 29.87														
32																	
33																	
34																	
35																	
36																	
37																	
38																	
39																	
40																	
41																	
42																	
43																	
44																	
45																	
46																	
47																	
48																	
49																	
50																	
51																	
52		End of Borehole	-45.72 45.72														
53																	
54																	
55																	
56																	
57																	
58																	
59																	
60																	

Elevation: 0 C# 1119
 Easting: 0
 Northing: 0 OCT 15 2007
 Casing Elevation: 0
 Well Casing Size: 50 mm
 Vapour Unit: NA
 Datum: Goodetic
 Checked by: KH
 Sheet: 2 of 2

Measurements recorded in: ☒ Metric ☐ Imperial

Page 1 of 1

A 147953

Well Owner's Information

First Name	Last Name / Organization TEGA DEVELOPMENTS	E-mail Address	☐ Well Constructed by Well Owner
Mailing Address (Street Number/Name) 200-266 COLONNADER ROAD	Municipality OTTAWA	Province ONTARIO	Postal Code K2E7K7
		Telephone No. (inc. area code) 613 632 7765	

Well Location

Address of Well Location (Street Number/Name) 111-121 PARKDALE AVENUE		Township	Lot	Concession
County/District/Municipality		City/Town/Village OTTAWA	Province Ontario	Postal Code
UTM Coordinates NAD 83	Zone 18	Eastings 4426116	Northings 50285916	Municipal Plan and Sublot Number BH2

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
BROWN	SILTY SAND	GRAVEL		0	0.6
BROWN	SILTY SAND (FILL)	GRAVEL, COBBLE, CLAY, WOOD CHIPS		0.6	1.19
GREY	BEDROCK/LIMESTONE			1.19	18.44

Annular Space			
Depth Set at (m/ft) From	To	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
0.4	14.9	BENTONITE	

Method of Construction	Well Use
☐ Cable Tool ☐ Rotary (Conventional) ☐ Rotary (Reverse) ☐ Boring ☐ Air percussion ☒ Other, specify HSA, Diamond	☐ Public ☐ Domestic ☐ Livestock ☐ Irrigation ☐ Industrial ☐ Other, specify
☒ Diamond ☐ Jetting ☐ Driving ☐ Digging	☐ Commercial ☐ Municipal ☐ Test Hole ☐ Cooling & Air Conditioning ☒ Monitoring

Construction Record - Casing				Status of Well
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From To	☐ Water Supply ☐ Replacement Well ☐ Test Hole ☐ Recharge Well ☐ Dewatering Well ☒ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, Insufficient Supply ☐ Abandoned, Poor Water Quality ☐ Abandoned, other, specify ☐ Other, specify

Construction Record - Screen			
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From To

Water Details		Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☒ Fresh ☐ Untested ☐ Gas ☐ Other, specify	Depth (m/ft) From To	Diameter (cm/in)
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	0 1.19	20.3
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	1.19 18.44	7.62


Well Contractor and Well Technician Information			
Business Name of Well Contractor EASTERN ONTARIO DIAMOND DRILLING		Well Contractor's Licence No. 7 3 2 8	
Business Address (Street Number/Name) 3780 COUNTY RD 17 PO Box 33		Municipality HAWKESBURY	
Province ONTARIO	Postal Code K6A 2K4	Business E-mail Address ontariodiamond@hawkigs.net	
Bus. Telephone No. (inc. area code) 613 632 7769		Name of Well Technician (Last Name, First Name) STEPHEN DOWNING	
Well Technician's Licence No. 3 3 2 6		Signature of Technician and/or Contractor [Signature]	
		Date Submitted 20130725	

Results of Well Yield Testing

After test of well yield, water was: ☐ Clear and sand free ☐ Other, specify	Draw Down		Recovery	
	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:	Static Level			
	1		1	
Pump intake set at (m/ft)	2		2	
Pumping rate (l/min / GPM)	3		3	
Duration of pumping hrs + min	4		4	
Final water level end of pumping (m/ft)	5		5	
If flowing give rate (l/min / GPM)	10		10	
	15		15	
	20		20	
Recommended pump depth (m/ft)	25		25	
Recommended pump rate (l/min / GPM)	30		30	
Well production (l/min / GPM)	40		40	
Disinfected?	50		50	
☐ Yes ☐ No	60		60	

Map of Well Location

Please provide a map below following instructions on the back.

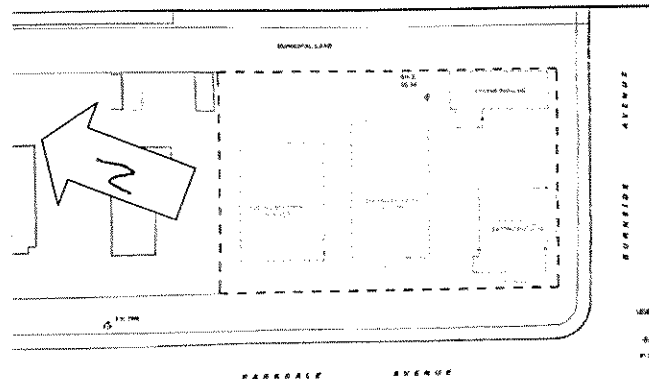

Comments:

SEE ALSO ATTACHED

Well owner's information package delivered ☐ Yes ☐ No	Date Package Delivered Y Y Y Y / M / D D 20120912	Ministry Use Only Audit No. 2171309 Reviewed
	Date Work Completed 20120912	



F.H.TBM

PARKDALE AVENUE

MUNICIPAL LANE

BH 2
60.54

EXISTING STRUCTURE
BUILDING

EXISTING STRUCTURE
BUILDING

EXISTING DWELLING

EXISTING DWELLING

BURNSIDE AVENUE

LEGEND:
Borehole location, monitoring well installed
61.28
Ground surface elevation (m)

C=1844
Z171309

AVOIT #
Z171309

TAG #
A147953

Measurements recorded in: ☐ Metric ☐ Imperial

Page _____ of _____

Well Owner's Information

First Name	Last Name / Organization	E-mail Address	☐ Well Constructed by Well Owner
	Public Works & Government Services Canada		
Mailing Address (Street Number/Name)		Municipality	Province
350 King Edward Ave		Ottawa	On.
		Postal Code	Telephone No. (inc. area code)
		K1A 0K1	613 688 0603

Well Location

Address of Well Location (Street Number/Name)		Township	Lot	Concession
100 Chardon Driveway		Ottawa		PRIVATE
County/District/Municipality		City/Town/Village	Province	Postal Code
		Ottawa	Ontario	K1Y 1G9
JTM Coordinates	Zone	Easting	North	Municipal Plan and Sublot Number
NAD	83	181442243	5028358	

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)
				From To
	fill		well with Bentonite and	
	remove casing		in ground	

Annular Space		
Depth Set at (m/ft)	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
From To		
0 2.4	Bentonite	0.1 m³

Method of Construction	Well Use
☐ Cable Tool ☐ Diamond ☐ Rotary (Conventional) ☐ Jetting ☐ Rotary (Reverse) ☐ Driving ☐ Boring ☐ Digging ☐ Air percussion ☐ Other, specify	☐ Public ☐ Commercial ☒ Not used ☐ Domestic ☐ Municipal ☐ Dewatering ☐ Livestock ☐ Test Hole ☒ Monitoring ☐ Irrigation ☐ Cooling & Air Conditioning ☐ Industrial ☐ Other, specify

Construction Record - Casing			Status of Well
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)
			From To
3.8	Plastic		
	remove		

☐ Water Supply ☐ Replacement Well ☐ Test Hole ☐ Recharge Well ☐ Dewatering Well ☐ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, Insufficient Supply ☐ Abandoned, Poor Water Quality ☒ Abandoned, other, specify ☐ Other, specify
Not used

Construction Record - Screen		
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.
		Depth (m/ft)
		From To

Water Details		Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	Depth (m/ft)	Diameter (cm/in)
		From To	
0		2.4	3.81

Well Contractor and Well Technician Information		
Business Name of Well Contractor	Well Contractor's Licence No.	
Bougeois Well Drilling Ltd.	74117	
Business Address (Street Number/Name)	Municipality	
14245 Concession 10-11	Chrysler	
Province	Postal Code	Business E-mail Address
On.	K0A 1R0	N/A

Bus. Telephone No. (inc. area code)	Name of Well Technician (Last Name, First Name)	Well owner's information package delivered	Date Package Delivered	Ministry Use Only Audit No. 284964 JUL 20 2018 Received
613 987 5291	GENIER, MICHAEL	☐ Yes ☒ No	Y Y Y Y M M D D 2018 06 06	
Well Technician's Licence No.	Signature of Technician and/or Contractor	Date Submitted		
314 93	[Signature]	2018 06 06		

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7315151
Well Audit Number: Z284965
Well Tag Number:

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	100 CHARDON DRIVEWAY	
Township	OTTAWA CITY	
Lot		
Concession		
County/District/Municipality	OTTAWA-CARLETON	

City/Town/Village	Ottawa	
Province	ON	
Postal Code	n/a	
UTM Coordinates	NAD83 — Zone 18 Easting: 442239.00 Northing: 5028353.00	
Municipal Plan and Sublot Number		
Other		

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Dep th From	Dep th To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	
0 m	6 m	BENTONITE		
		BENTONITE		

Method of Construction & Well Use

Method of Construction	Well Use	
	Monitoring	
	Not Used	

Status of Well

Abandoned-Other

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	
3.81 cm	PLASTIC			

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	

Well Contractor and Well Technician Information

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		
Recommended pump depth		
Recommended pump rate		
Well Production		
Disinfected?		

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			

1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	
20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	
0 m	6 m	3.81 cm	

Audit Number: Z284965

Date Well Completed: June 06, 2018

Date Well Record Received by MOE: July 20, 2018

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)

Jeremy Camposarcone

From: Public Information Services <publicinformationsservices@tssa.org>
Sent: March 24, 2023 6:35 PM
To: Jeremy Camposarcone
Subject: RE: PE6040 - Records Search Request

Hello,

NO RECORD FOUND IN CURRENT DATABASE

Thank you for your request for confirmation of public information. TSSA has performed a preliminary search of TSSA's current database.

- We confirm that there are no records in our database of any **fuel storage tanks** at the subject address(es).

This is not a confirmation that there are no records in the archives. For a further search in our archives, please submit an application for release of public information (PI Form) through TSSA's new Service Prepayment Portal. The associated fee must be paid via credit card (Visa or MasterCard) through a secure site.

Please follow the steps below to access the new application(s) and Service Prepayment Portal:

1. Click [Release of Public Information - TSSA](#) - TSSA and click "need a copy of a document";
2. Select the appropriate application, download it and complete it in full; and
3. Proceed to page 3 of the application and click the link TSSA Service Prepayment Portal under payment options (the link will take you the secure site to pay for the release via credit card).

Accessing the Service Prepayment Portal:

1. Select new or existing customer (*if you are an existing customer, you will need your account # & postal code to access your account);
2. Select the program area: AD (Amusement Devices), BPV (Boilers and Pressure Vessels), ED (Elevating Devices), FS (Fuels Services), OE (Operating Engineers) or SKI (Ski Lifts) and click continue;
3. Enter the application form number (obtained from bottom left corner of application form) and click continue;
 - a. When selecting the application form number from the drop-down menu, please make sure you select the application that begins with "PI" (i.e. PI-FS, PI-BPV etc.);
4. Complete the primary contact information section;
5. Complete the fees section;
6. Upload your completed application; and
7. Upload supporting documents (if required) and click continue.

Once all steps have been successfully completed, you will receive your receipt via email.

Questions? Please contact TSSA's Public Information Release team at publicinformationsservices@tssa.org.

Although TSSA believes the information provided pursuant to your request is accurate, please note that TSSA does not warrant this information in any way whatsoever.

Kind regards,



Kimberly Gage | Public Information Agent

Legal
345 Carlingview Drive
Toronto, Ontario M9W 6N9
Tel: +1 416-734-3348 | Fax: +1 416-734-3568 | E-Mail: kgage@tssa.org

www.tssa.org



From: Jeremy Camposarcone



Winner of 2022 5-Star Safety Cultures Award

<JCamposarcone@patersongroup.ca>

Sent: Friday, March 24, 2023 11:23 AM

To: Public Information Services <publicinformationservices@tssa.org>

Subject: PE6040 - Records Search Request

[CAUTION]: This email originated outside the organisation.

Please do not click links or open attachments unless you recognise the source of this email and know the content is safe.

Could you please complete a search of your records for **underground/aboveground storage tanks, historical spills, or other incidents/infractions** for the following addresses in Ottawa, Ontario:

Columbine Driveway: 50, 70
Tunney's Pasture Driveway: 200
Eglantine Driveway: 100
Chardon Driveway: 150
Goldenrod Driveway: 20, 101
Parkdale Avenue: 55, 99
Emmerson Avenue: 40

Best Regards,



Jeremy Camposarcone, B.Eng.

Junior Environmental Engineer

TEL: (613)-226-7381
CELL: (343)-999-7255

9 AURIGA DRIVE
OTTAWA ON K2E 7T9

patersongroup.ca

TEMPORARY SHORING DESIGN SERVICES ARE NOW AVAILABLE, PLEASE CONTACT US TO SEE HOW WE CAN HELP!

OUR DIRECT LINE FOR MATERIALS TESTING INSPECTION BOOKING HAS BEEN UPDATED,
PLEASE CALL **613-696-9677** TO BOOK AN INSPECTION.

This electronic message and any attached documents are intended only for the named recipients. This communication from the Technical Standards and Safety Authority may contain information that is privileged, confidential or otherwise protected from disclosure and it must not be disclosed, copied, forwarded or distributed without authorization. If you have received this message in error, please notify the sender immediately and delete the original message.



File Number: D06-03-23-0059

April 17, 2023

Nick Sullivan
Paterson Group

Sent via email: nsullivan@patersongroup.ca

Dear Nick,

Re: Information Request

101 & 203 Golden Driveway, 120 Parkdale Ave & 251 Sir Frederick Banting
Driveway **Ottawa, Ontario ("Subject Property")**

Internal Department Circulation:

The Planning, Infrastructure and Economic Development Department has the following information in response to your request for information regarding the Subject Property:

- **Environmental Remediation Unit:** The City's Environmental Remediation Unit has environmental records on file pertaining to the subject property noted above either directly on or adjacent to the subject property. To submit requests for information under the Municipal Freedom of Information and Protection of Privacy Act, please visit <https://ottawa.ca/en/city-hall/open-transparent-andaccountable-government/access-information-and-protection-privacy/accessinformation>
 - **Comment:** The Environmental Remediation Unit (ERU) has historical drawings showing the location of underground fuel storage tanks identified at this property in the Historical Land Use Inventory (HLUI). The drawings were submitted as part of permit applications for the City of Ottawa Flammable Liquids Storage Bylaw. Please contact ERU-UAE@ottawa.ca to obtain a copy of the drawings
- **Ottawa Public Health - Environmental Health:** all public inspection results are publicly available on the Ottawa Public Health website: <https://www.ottawapublichealth.ca/en/public-health-services/public-health-inspections.aspx>
- **Sewer Use Program:** The City's Sewer Use Program has found the following information pertaining to the subject property: Violations of environmental statutes, regulations or bylaws, other environmental records.

Documents Provided:

HLUI Summary Report and HLUI Map

The HLUI Summary Report Excel spreadsheet identifies HLUI area, point and line features within 250 metres of the Subject Property, as shown on the provided HLUI Map PDF. Within 500 metres of the Subject Property, landfills and Environmental Risk Management Area (ERMA) are also identified if applicable.

For more information on how to interpret the HLUI data identified in the attached excel sheet ('ADDRESS – HLUI Summary report.xlsx'), please refer to the [Overview and User Guide](#)."

Additional information may be obtained by contacting:

Ontario's Environmental Registry

The Environmental Registry found at <https://ero.ontario.ca/> contains "public notices" about environmental matters being proposed by all government ministries covered by the Environmental Bill of Rights. The public notices may contain information about proposed new laws, regulations, policies and programs or about proposals to change or eliminate existing ones. By using key words i.e. name of proponent/owner and the address one can ascertain if there is any information on the proponent and address under the following categories: Ministry, keywords, notice types, Notice Status, Acts, Instruments and published date (all years).

The Ontario Land Registry Office

Registration of real property is recorded in the Ontario Land Registry Office through the Land Titles Act or the Registry Act. Documents relating to title and other agreements that may affect your property are available to the public for a fee. It is recommended that a property search at the Land Registry Office be included in any investigation as to the historic use of your property. The City of Ottawa cannot comment on any documents to which it is not a party.

Court House
161 Elgin Street 4th Floor
Ottawa ON K2P 2K1
Tel: (613) 239-1230
Fax: (613) 239-1422

Ottawa Public Health

Ottawa Public Health inspects many different types of establishments. To view inspection results, please visit the Ottawa Public Health website: [Public Health Inspections - Ottawa Public Health](#)

Please note that Ottawa Public Health is not the lead agency on land use contamination in the City of Ottawa – contact the Ministry of Environment Conservation and Parks (MECP) for further information.

Please note, as per the HLUI Disclaimer, that the information contained in the HLUI database has been compiled from publicly available records and other sources of information. The HLUI may contain erroneous information given that the records used as sources of information may be flawed. For instance, changes in municipal addresses over time may introduce error. Accordingly, all information from the HLUI database is provided on an “as is” basis with no representation or warranty by the City with respect to the information’s accuracy or exhaustiveness in responding to the request.

Furthermore, the HLUI database and the results of this search in no way confirm the presence or absence of contamination or pollution of any kind. This information is provided on the assumption that it will not be relied upon by any person for any purpose whatsoever. The City of Ottawa denies all liability to any persons attempting to rely on any information provided from the HLUI database.

Please note that in responding to your request, the City of Ottawa does not guarantee or comment on the environmental condition of the Subject Property. You may wish to contact the Ontario Ministry of Environment and Climate Change for additional information.

If you have any further questions or comments, please contact HLUI@ottawa.ca.

Sincerely,

Adwoa Achireko

STUDENT PLANNER

Per:

Michael Boughton, MCIP, RPP
Senior Planner
Development Review East
Planning Services
Planning, Infrastructure and Economic Development Department


MB / **AA**

Enclosures: (2)

1. HLUI Map
2. HLUI Summary Report

cc: File no. D06-03-23-0059

HISTORIC LAND USE INVENTORY (HLUI) - REPORT REFERENCE MAP

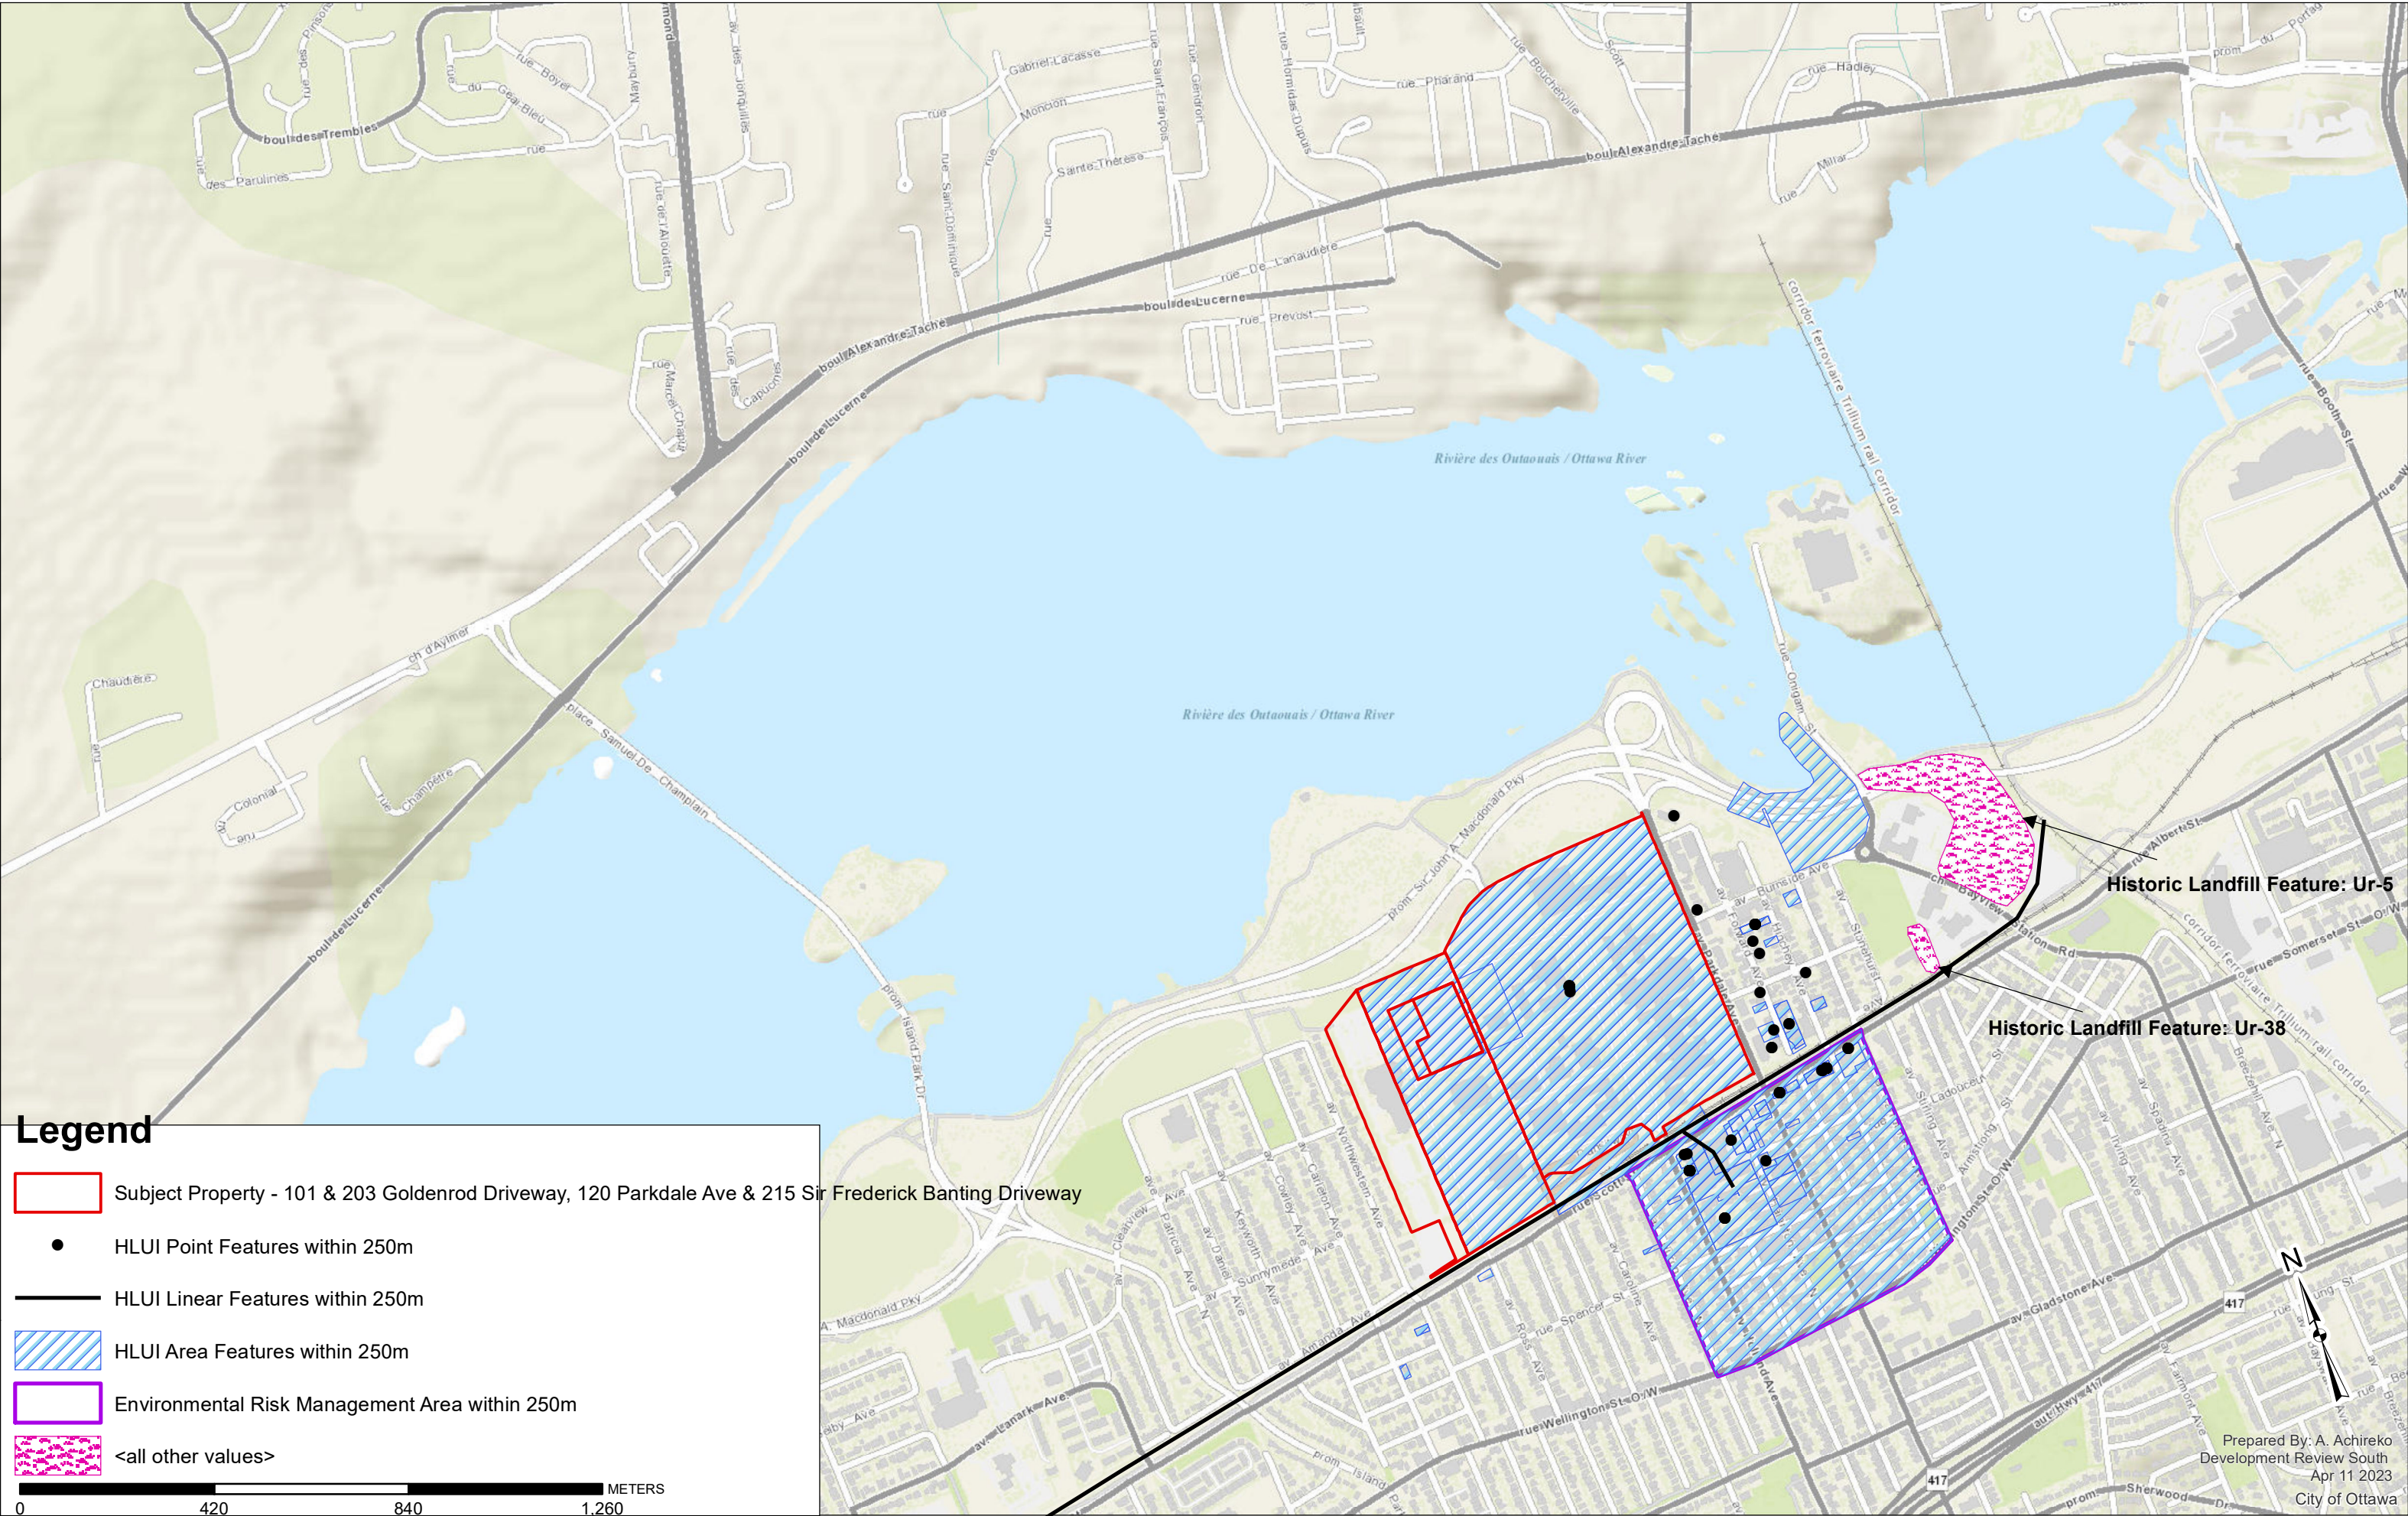

HLII SUMMARY REPORT
AREA FEATURES

OBJECTID	ACTIVITY_NAME	FACILITY_TYPE	SOURCE_UPDATE_SORTED	QAGC	YEAR	YEAR_1	ST_NUM	ST_NAME	ST_SUFFIX	ST_DIR	MUNICIPALITY	ST_NUMB2	ST_NAME2	ST_SUFFIX2	ST_DIR2	POSTAL_CODE2	PROVID2	MUNICIPALITY2	NACS	SC	COMMENTS	STORAGE_TANK	Shape_Length	Shape_Area		
5188 MCM PRINTING	Manufacturing		2001-ES	1			300 PARKDALE	AVE			300 PARKDALE	AVE				K1Y1G2	40340001	OLD OTTAWA	323114			205.2894778	2107.435174			
5208 SYNC TECH	Other services (except public administration)		2012-ES	1			1484 SCOTT	ST			1484 SCOTT	ST				K1Y2N4	40940084	OLD OTTAWA	811111			127.0041624	934.8353415			
5202 FED-CANADIAN NUCLEAR SAFETY COM	Public administration		2006-ES	1			120 PARKDALE	AVE			120 PARKDALE	AVE				K1A0L2	40320283	OLD OTTAWA	911910			2265.586097	312398.1769			
5204 FED-INDUSTRY CANADA	Public administration		2006-ES	1			120 PARKDALE	AVE			120 PARKDALE	AVE				K1A0L2	40320283	OLD OTTAWA	911910			2265.586097	312398.1769			
5225 FED-PUBLIC HEALTH	Public administration		2006-ES; 2012-ES	1			120 PARKDALE	AVE			120 PARKDALE	AVE				K1A0L2	40320283	OLD OTTAWA	911910			2265.586097	312398.1769			
7131 BEACH FOUNDRY LIMITED	Iron Foundries		1950-M; 1952-FIP-133-892; 1930-M; 1940-M; 1980-ES	1	1920-1955 c. 1920; c.		0 HINTON	ST			155E-08	OLD OTTAWA	331420	331511	294; 297;	K1Y4S2	40340192	OLD OTTAWA	331420	331511	294; 297;	Manufacturing of Electric	748.54491074	34886.741618		
7139 HENDERSON FURNITURE REPAIR LIMTE	Household Furniture Stores		2006-M	1	1980- c.		202 FORWARD	AVE			OTTAWA	196 FORWARD	AVE			K1Y1L2	155E-08	OLD OTTAWA	442110	621		137.8201436	1188.825551			
7263 OC TRANSPO			1991-AirPhoto; 2016-PID; 2017-AirPhoto	1	1991-2017; PID2016		1611 TRANSITWAY	ST			OTTAWA	1565 SCOTT	ST				40320282	OLD OTTAWA	-Nulls-			506.1624427	22402.18356			
7264 OTTAWA LIGHT RAIL TRANSIT CONSTRUCTORS			1920-1921; PID2016	1	1920-1921; PID2016		8108 TRANSITWAY	ST			OTTAWA	1565 SCOTT	ST				40320282	OLD OTTAWA	-Nulls-			22402.18356	22402.18356			
7265 P LESLIE & SON	Other Metal Fabricating Industries		1910-M; 1912-FIP-133-891; 1920-M; 1922-FIP	1	1910-1922; c. 1910-19		1536 SCOTT	ST			OTTAWA	1536 SCOTT	ST			K1Y2N5	40340019	OLD OTTAWA	238220	323214309; 424	M. 1948 - lists Campbell I	222.200915	1886.341811			
7266 CAMPBELL MOTORS PARTS SHOP	Motor Vehicle Repair Shops		1930-M; 1940-M; 1948-FIP-311-891; 1948-M;	1	1930-1994; c. 1930-19		1536 SCOTT	ST			OTTAWA	1536 SCOTT	ST			K1Y2N5	40340019	OLD OTTAWA	447110	447190633; 635	PIP1912, FIP1922 - list	222.200915	1886.341811			
7267 RENIS GOSSET CONSTRUCTION LIMITED	Industrial Construction (Other Than Buildings)		1948-FIP-311-891; 1948-M; 1956-FIP-311-14	1	1948-1956; c. 1948-19		1544 SCOTT	ST			OTTAWA	1544 SCOTT	ST			K1Y2N5	40340023	OLD OTTAWA	237110	237120411; 412;	FIP1948 - vacar lot - yan	165.7995233	2486.741618			
7270 VACHON C & SONS	Lumber and Building Materials, Wholesale		1940-M; 1950-M	1	1940-1950; c. 1940-19		50 CARRUTHERS	AVE			OTTAWA	50 CARRUTHERS	AVE			K1Y1N2	40960120	OLD OTTAWA	412110	416310511; 563	50- Listed at #50 in 18	112.0093373	916.4445815			
7402 COBIN-EVEREDY LIMITED	Motor Vehicle Repair Shops		1956-FIP-304-883; 1960-M	1	1901-1980; c. 1956-19		183 FORWARD	AVE			OTTAWA	187 FORWARD	AVE			K1Y1L1	40960072	OLD OTTAWA	333310	333413307; 635	FIP1912, FIP1922 - vacar 2 UST	154.7772367	1445.372023			
7403 UNARMED GASOLINE SERVICE STATION	Gasoline Service Stations		1956-FIP-311-1	1	1948-1956; c. 1948-19		7 HOLLAND	AVE			OTTAWA	1560 SCOTT	ST			K1Y4S8	40340192	OLD OTTAWA	447110	447190633; 635	FIP1912, FIP1922 - vacar 2 UST	124.7813089	363.565591			
7500 HONEWELL OFF-SITE MANAGEMENT	Environmental Risk Assessment		2017-CityOfOttawa RemediationUnit	1	2017																	2165.781334	30457.3803			
7731 AUTO GLASS ONTARIO	Motor Vehicle Repair Shops		1998-SC	1	1998		255 PARKDALE	AVE			OTTAWA	255 PARKDALE	AVE				40940037	OTTAWA				84.883876	356.5024084			
7732 GERVAIS MOTORS	Motor Vehicle Repair Shops		1950-1970-M; 1960-1970-M	1	1950-1970		255 PARKDALE	AVE			OTTAWA	255 PARKDALE	AVE				40940037	OTTAWA				84.883876	356.5024084			
7823 NATIONAL DEFENCE/NDHQ/DIE/PHOTO	Defence Services		2000-PID	1	2000		1 GOLDENROD	DRWY			OTTAWA	1 GOLDENROD	DRWY				40320226	OTTAWA				1641.565307	18412.1734			
7824 PARKDALE MANUFACTURING CO LTD	Sawmill, Planing Mill and Shingle Mill Products Industries		1948-M	1	1948		124 PARKDALE	AVE			OTTAWA	124 PARKDALE	AVE				40320283	OTTAWA				2265.586097	312398.1769			
7825 R MCCLELLAND	Sash, Door and Other Millwork Industries		1948-M	1	1948		110 PARKDALE	AVE			OTTAWA	110 PARKDALE	AVE				40320283	OTTAWA				2265.586097	312398.1769			
7830 CRAWFORDS MOTORS GARAGE	Gasoline Service Stations		1970-M	1	1970		140 HINCHY	AVE			OTTAWA	140 HINCHY	AVE				40960061	OTTAWA				162.3104022	1009.085029			
7943 M AND N AUTO CENTRE/LEONE'S SERV	Motor Vehicle Repair Shops		1998-SC; 2001-ES; 2006-ES; 2012-ES	1	1998		1480 SCOTT	ST			OTTAWA	1480 SCOTT	ST				40940085	OTTAWA				87.8759365	585.2659251			
7944 ERNIE'S GARAGE	Motor Vehicle Repair Shops		1948-1970-M	1	1948-1970		1480 SCOTT	ST			OTTAWA	1480 SCOTT	ST				40940085	OTTAWA				87.8759365	585.2659251			
8094 LESLIE TNSWARE COMPANY/LTD	Other Metal Fabricating Industries		1950-M	1	1950		1536 SCOTT	ST			OTTAWA	1536 SCOTT	ST				40340019	OTTAWA				222.2010871	1886.342954			
8095 CAPITAL CITY	Motor Vehicle Repair Shops		1984-PID	1	1994		1536 SCOTT	ST			OTTAWA	1536 SCOTT	ST				40340019	OTTAWA				222.2010871	1886.342954			
8096 MCALAGHLIN BROTHERS CONTRACTOR	Industrial Construction (Other Than Buildings)		1948-FIP-311-891; 1956-FIP-311-1-891	1	1948-1956		1544 SCOTT	ST			OTTAWA	1544 SCOTT	ST				40340023	OTTAWA				185.7994964	1410.79493			
8202 E B EDDY FOREST PRODUCTS LTD	Pulp and Paper Industries		1968-SC; 2001-ES	1	1968		1560 SCOTT	ST			K1Y4S8	1560 SCOTT	ST				40340192	Old Ottawa				576.8311561	3027.255094			
8240 FRANK & SONS PAINTING & DECORAT	Interior and Finishing Work		2000-PID	1	2000-2005; c. 2000-2005		144 FORWARD	AVE			OTTAWA	144 FORWARD	AVE			K1Y1L2	40960051	Old Ottawa				457.235125	90.3668798			
8298 AL KNOX TEXACO SERVICE STATION	Gasoline Service Stations		1970-M	1	1970		1570 SCOTT	ST			OTTAWA	1570 SCOTT	ST				40340192	OTTAWA				124.8034932	984.2389328			
8642 CADA CONSTRUCTION INC	Residential/Plumbing and Development		2001-ES; 2005-SelectedPhone; 2006-ES	1	2001-2004 c. 2005		18 WESTERN	AVE			K1Y0L4	18 WESTERN	AVE				40340196	OLD OTTAWA	238110	238150	423; 427	92.19689595	470.4619586			
8643 LOWREY GERRY C LIMITED	Exterior Close In Work		1960-M; 1970-M; 1980-M; 2005-SelectedPhone	1	1960-2005; c. 1960-19		18 WESTERN	AVE			K1Y0L4	18 WESTERN	AVE				40340196	OLD OTTAWA	238140	238150	423; 427	92.19689595	470.4619586			
8661 A B C ROOFERS	Exterior Close In Work		1980-M	1	1980- c. 1980		26 HOLLAND	AVE			OTTAWA	26 HOLLAND	AVE				K1Y0X4	40340046	OLD OTTAWA	238140	238150	423	78.82163492	295.2754568		
8677 SALTER & RED ELECTRIC LIMITED	Electrical and Electronic Machinery, Equipment And Supplies		2001-ES; 2004-GWSudy	1	2001-2005; c. 2001-2005		252 PARKDALE	AVE			K1Y1G2	40340001	OLD OTTAWA	332510	332710306; 306;			40340001	OLD OTTAWA	332510	332710306; 306;	Listed at 645 Wellington i	205.2894778	2107.435174		
8678 FIXALL AUTO	Automotive Body-Repairing & Painting		2017-SalesGenie	1	2017		PARKDALE	AVE			K1Y1E9	40340017	OLD OTTAWA	81112102	Jan-32 B			40340017	OLD OTTAWA	81112102	Jan-32 B		109.7767292	744.1619992		
8679 G K TOWING	Vehicle Service		2017-SalesGenie	1	2017		PARKDALE	AVE			K1Y1E9	40340017	OLD OTTAWA	48841008	Jan-49 B			40340017	OLD OTTAWA	48841008	Jan-49 B		109.7767292	744.1619992		
8680 LEONE'S SERVICE CTR LTD	Gasoline Service Stations & Oil		2017-SalesGenie	1	2017		PARKDALE	AVE			K1Y1E9	40340017	OLD OTTAWA	44790055	Jan-41			40340017	OLD OTTAWA	44790055	Jan-41		109.7767292	744.1619992		
8681 M & N AUTO CTR	Automotive Repairing & Service		2017-SalesGenie	1	2017		PARKDALE	AVE			K1Y1E9	40340017	OLD OTTAWA	81111104	Jan-38 B			40340017	OLD OTTAWA	81111104	Jan-38 B		109.7767292	744.1619992		
8682 SCINTREX TRACE CORP	Electrical and Electronic Machinery, Equipment And Supplies		2003-PID; 2005-SelectedPhone; 2006-ES; 2012	1	2003-2016; c. 2003; c.		300 PARKDALE	AVE			K1Y1G2	40340001	OLD OTTAWA	334290	812120				40340001	OLD OTTAWA	334290	812120		205.2894778	2107.435174	
8683 INSTRUMENTS LIMITED	Hardware, Tool and Cutlery Industries		1950-PID	1	1948-1984; c. 1948-19		300 PARKDALE	AVE			K1Y1G2	40340001	OLD OTTAWA	332510	332710306; 306;				40340001	OLD OTTAWA	332510	332710306; 306;	Listed at 645 Wellington i	205.2894778	2107.435174	
8844 MCM PRINTING	Commercial Printing Industries		1970-T-S; 1970-M; 1971-M; 1980-M; 1994-P	1	1970-2003; c. 1970-19		300 PARKDALE	AVE			OTTAWA	300 PARKDALE	AVE				K1Y1G2	40340001	OLD OTTAWA	323114	323151251; 281	312 to 320; FIP1922 - vacar	205.2894778	2107.435174		
8847 JOE TEGANO ROOFING CONTRACTOR	Other Converted Paper Products Industries		1970-M	1	1970- c. 1970		74 HURON	AVE		N	K1Y0V9	40340027	OLD OTTAWA	238140	238150	423			40340027	OLD OTTAWA	238140	238150	423	55.40019534	334.251743	
8764 COMMON LOOSE LEAF CO LIMITED	Petroleum Products, Wholesale		1948-FIP-311-893; 1948-M; 1956-FIP-311-14	1	1948-1956; c. 1948-19		0 PARKDALE	AVE			K1Y4S5	40340004	OLD OTTAWA	322226	323114279; 281				40340004	OLD OTTAWA	322226	323114279; 281		248.7708986	3956.410719	
8748 BASTEN FUELS LIMITED	Other Trade Work		1970-M; 1980-M	1	1960-1980; c. 1970-19		154 HINCHY	AVE			K1Y1L4	40960075	OLD OTTAWA	412110	419120	511			40960075	OLD OTTAWA	412110	419120	511	80.46539137	458.336293	
8782 SCAFFOLD - EASY REGD	Other Trade Work		1948-FIP-311-894; 1948-M; 1956-FIP-311-14	1	1912-1956; c. 1948-19		1496 SCOTT	ST			K1Y1G1	40940027	OLD OTTAWA	238291	238330	429			40940027	OLD OTTAWA	238291	238330	429	FIP1912, FIP1922 - vacar	84.883876	356.5024084
8783 AUTO-RIVAL	Motor Vehicle Repair Shops		1950-M; 1960-M; 1970-M; 1980-M; 1998-SC	1	1960-1998; c. 1950-19		255 PARKDALE	AVE			K1Y1G1	40940027	OLD OTTAWA	811112	811119	635			40940027	OLD OTTAWA	811112	811119	635	84.883876	356.5024084	
8782 STAN'S OUTBOARD LTD	Boat Motor Supplies and Repairs		1980-CD	1	1980-CD 1990		1484 SCOTT	ST			K1Y0N4	40940084	OLD OTTAWA	488410	811122				40940084	OLD OTTAWA	488410	811122		127.0041924	934.8353415	
8793 ONTARIO AUTO GLASS & RADIATORS	Other Vehicle		2005-SelectedPhone; 2006-ES; 2012-ES	1	2006-2012; ES 2006; I		1484 SCOTT	ST			K1Y2N4	40940084	OLD OTTAWA	488410	811122				40940084	OLD OTTAWA	488410	811122		127.0041924	934.8353415	
8794 A - I TOWING	Transportation and warehousing		2006-ES; 2012-ES	1	2006-2012; ES 2006; I		1484 SCOTT	ST			K1Y2N4	40940084	OLD OTTAWA	488410	811122				40940084	OLD OTTAWA	488410	811122		127.0041924	934.8353415	
8795 FOURNIER CLAIR	Motor Vehicle Repair Shops		2005-PropertyAssessment	1	2005- c. 2006		1484 SCOTT	ST			OTTAWA	1484 SCOTT	ST				40940084	OLD OTTAWA	811111	811112; 811119; 811121; 811199		127.0041924	934.8353415			
8800 BURNSIDE & SLIDELL DUMP	Dump		1922-DMD-TM-Ottawa-Sheet#14; 1948-DND	2	1940 GW Study 2004		Renfrew Watershed				OTTAWA	19 SIR JOHN A MACCPKY					40970202	OLD OTTAWA				1236.561114	44563.43982			
10529 BAKTIC MECHANICAL SERVICES	Construction		2006-ES	1	2006-ES 2006		101 TUNNEY'S PASTLOR	DRWY			OTTAWA	101 GOLDENROD	DRWY				40320226	OLD OTTAWA	233220			2272.46072				

OBJECTID	ACTIVITY_NAME	FACILITY_TYPE	TANK_LOCATD N	TANK_CON TEXT	TANK_SIZE	TANK_TYPE	TANK_STAT	SOURCE	INSTALLED ST_NUM	INSTALLED_ST_NA ME	INSTALLE D_BY_A R	INSTA LED_BY DR	COMMENT	MTM_X	MTM_Y	IMAGE_MAP	IMAGE_CERTA NTY	IMAGE_MAP _2	TANK_MATE RIAL	TANK_ID	TANK_LEAK NG	TANK_REM OVED	REMOVED_D ATE	DATE INSTA LED	NATURE OF BUSINESS	SCANNED DRAWING G	EMPRSS dwd	CAPACIT Y_UOM	MUNICIPALITY	POSTCO DE	
481 GASOLINE SERVICE STATION	Gasoline Service Station	UST						FIP1956		SCOTT			historical address - SE corner of	364774.9095	5029591.451	Volume3_311_1.jpg	1														
482 GASOLINE SERVICE STATION	Gasoline Service Station	UST						FIP1956		SCOTT			historical address - SE corner of	364781.0181	5029593.331	Volume3_311_1.jpg	1														
931		UST						FIP1948	174	FORWARD	AVE		historical address - 174 Forward	364930.2801	5029462.655	506.jpg															
942 GASOLINE SERVICE STATION	Gasoline Service Station	UST						FIP1948	50	SCOTT	ST		historical address - 50 Scott St	365074.5122	5029773.598	311.jpg															
943 GASOLINE SERVICE STATION	Gasoline Service Station	UST						FIP1948	50	SCOTT	ST		historical address - 50 Scott St	365072.9074	5029772.681	311.jpg															
1688 LEONES SERVICE CENTRE LTD	Gasoline Station - Full UST	UST	gasoline		18100	Licensed	Active	TSSA	1480	SCOTT	ST			365062.6761	5029778.291				Steel	ST8800				1990							
1689 LEONES SERVICE CENTRE LTD	Gasoline Station - Full UST	UST	gasoline		18100	Licensed	Active	TSSA	1480	SCOTT	ST			365062.6761	5029778.291				Steel	ST8801				1990							
2101		UST		fuel oil				ROW	1560	SCOTT	ST			364786.9464	5029556.016											2 tanks					
2222		UST		fuel oil				ROW	1560	SCOTT	ST			364786.9464	5029556.016											2 tanks					
3630 ST ANTOINE SCHOOL - RCSSB		not specified		fuel oil	9080	Permit		159 FORWARD	AVE				address verified from 1956 city c	364937.6263	5030025.622								04/07/1955	1 - 5000 gal fuel oil							
3931 H BISSONNETTE		not specified		gasoline	1135	Permit		173 HNCHEY	AVE					365036.9666	5029494.396								03/11/1930								
3933 P VALLANCOURT		UST		gasoline	1360	Permit		121 PARKDALE	AVE					364902.2962	5031020.812								05/06/1933								
3934 CANADIAN WELFARE COUNCIL - F G BOWIE & SONS		UST		fuel oil	22700	Permit		55 PARKDALE	AVE				address verified from 1900 city c	364752.2945	5030323.767		2						03/10/1953	1 - 5000 gal Yes							
4463 HAMILTON BULLMAN BLDG		not specified		fuel oil	4540	Permit		1 HAMILTON	AVE					364952.2	5029677.261								1962-005-14 29/05/1962	fuel oil, 1 - 1000 gal							
4464 BREWERS WAREHOUSES CO LTD		oil		4540	Permit			Bylaw No. 304-60 VAH6000;	1546	SCOTT	ST		address verified from dwg & get	364876.3461	5029622.055	FR300-VAH6000-SCOS 015E	1						18/09/1991		Yes						
5227 TUNNEY'S PASTURE - DEPT OF PUBLIC WORKS		AST		fuel oil	5329.56	Permit		Bylaw No. 8022 - P468	120	PARKDALE	AVE			364590.3158	5029930.42		2						02/01/1951	one 1174 gal Yes							
5228 TUNNEY'S PASTURE - RAW MATERIAL LAB - ELDORADO MINING - L GE	not specified	fuel oil		13620	Permit			Bylaw No. 8022 - P1012	120	PARKDALE	AVE		address verified from geotawata	364590.3158	5029930.42		2						16/07/1956	1 - 3000 gal fuel oil							
5229 ENVIRONMENTAL HEALTH LABORATORY - TUNNEY'S PASTURE	UST	diesel		2270	Permit			Bylaw No. 304-60 VAH6100;	120	PARKDALE	AVE		dwg shows ut located e of built	364590.3158	5029930.42	FR300-VAH6100-0067_0023_	2						26/10/1964		Yes						
5230 TUNNEY'S PASTURE DEVELOPMENT - CENTRAL HEATING PLANT	UST (concrete)	fuel oil		363200	Permit			Bylaw No. 304-60 VAH6100;	120	PARKDALE	AVE		also includes pins 040320228 &	364590.3158	5029930.42	FR300-VAH6100-0070_0033_	2						25/09/1967		Yes						
5231 DND COMPUTER BUILDING, TUNNEY'S PASTURE	UST	fuel oil		9080	Permit			Bylaw No. 304-60 VAH6100;	120	PARKDALE	AVE		also includes pins 040320228 &	364590.3158	5029930.42	FR300-VAH6100-0069_0033_	2						09/07/1971		Yes						
5232 TUNNEY'S PASTURE HEALTH & WELFARE BLDG	UST	gasoline		6810	Permit			Bylaw No. 304-60 VAH6100;	120	PARKDALE	AVE		and pump also includes pins 04	364590.3158	5029930.42	FR300-VAH6100-0068_0033_	2						17/07/1974		Yes						
5233 TUNNEY'S PASTURE RESEARCH CENTRE	UST	diesel		9080	Permit			Bylaw No. 304-60 VAH6100;	120	PARKDALE	AVE		rose ave at cleveview also incl	364590.3158	5029930.42	FR300-VAH6100-0352_0053_	2						07/08/1974		Yes						
5234 TUNNEY'S PASTURE STATISTICS CANADA SUB-STATION	UST	diesel		22700	Permit			Bylaw No. 304-60 VAH6100;	120	PARKDALE	AVE		also includes pins 040320228 &	364590.3158	5029930.42	FR300-VAH6100-0069_0033_	2						08/06/1978		Yes						
5249 TRINIDAD LEASEHOLDS - SIROTEK CONST	UST	gasoline		13620	Permit			Bylaw No. 8022 - P860	1560	SCOTT	ST		address verified from permit dw	364786.9464	5029556.016	Permit 880 - 1560 Scott St (a	1						02/08/1955	1 - 3000 gas Yes							
5250 TRINIDAD LEASEHOLDS - SIROTEK CONST	UST	gasoline		9080	Permit			Bylaw No. 8022 - P860	1560	SCOTT	ST		address verified from permit dw	364786.9464	5029556.016	Permit 880 - 1560 Scott St (a	1						02/08/1955	1 - 3000 gas Yes							
5251 TRINIDAD LEASEHOLDS - SIROTEK CONST	UST	fuel oil		Existing		Active		Bylaw No. 8022 - P860	1560	SCOTT	ST		address verified from permit dw	364786.9464	5029556.016	Permit 880 - 1560 Scott St (a	1						02/08/1955	1 - 3000 gas Yes							
5252 TRINIDAD LEASEHOLDS - SIROTEK CONST	UST	waste oil		Existing		Active		Bylaw No. 8022 - P860	1560	SCOTT	ST		address verified from permit dw	364786.9464	5029556.016	Permit 880 - 1560 Scott St (a	1						02/08/1955	1 - 3000 gas Yes							
5253 LIQUOR CONTROL, BD OF ONT	UST	fuel oil		4540	Permit			Bylaw No. 304-60 VAH6000;	1560	SCOTT	ST			364786.9464	5029556.016	Permit 880 - 1560 Scott St (a	1						04/12/1973		Yes						
5254 LIQUOR CONTROL, BD OF ONT	UST	fuel oil		4540	Existing	Not active		Bylaw No. 304-60 VAH6000;	1560	SCOTT	ST			364786.9464	5029556.016	Permit 880 - 1560 Scott St (a	1						1973-012-06 06/08/1957		Yes						
5255 MCCOLL-FRONTENAC OIL CO	UST	gasoline		22700	Permit			Bylaw No. 8022 - P916, 917,	1560	SCOTT	ST		address verified from permit dw	364786.9464	5029556.016	Permit 880 - 1560 Scott St (a	1						03/10/1955	1 - 5000 gal Yes							
5256 MCCOLL-FRONTENAC OIL CO	UST	gasoline		13620	Permit			Bylaw No. 8022 - P916, 917,	1560	SCOTT	ST		address verified from permit dw	364786.9464	5029556.016	Permit 880 - 1560 Scott St (a	1						03/10/1955	1 - 5000 gal Yes							
5257 MCCOLL-FRONTENAC OIL CO	UST	fuel oil		4540	Permit			Bylaw No. 8022 - P916, 917,	1560	SCOTT	ST		address verified from permit dw	364786.9464	5029556.016	Permit 880 - 1560 Scott St (a	1						03/10/1955	1 - 5000 gal Yes							
5258 MCCOLL-FRONTENAC OIL CO	UST	waste oil		4540	Permit			Bylaw No. 8022 - P916, 917,	1560	SCOTT	ST		address verified from permit dw	364786.9464	5029556.016	Permit 880 - 1560 Scott St (a	1						03/10/1955	1 - 5000 gal Yes							
5586 E GERVAIS SERVICE STATION	not specified	gasoline		4540	Permit			Bylaw No. 8022 - P958	255	PARKDALE	AVE		listed as 259 parkdale ave, SE c	364981.5341	5029724.704								04/10/1948	two 1000 gal gas tanks							
5587 E GERVAIS SERVICE STATION	not specified	gasoline		4540	Permit			Bylaw No. 8022 - P958	255	PARKDALE	AVE		also one pump island, 255 Park	364981.5341	5029724.704	FR300-VAH6000-PARD 002E	1						27/06/1969		Yes						
5588 GERVAIS MOTORS	UST	gasoline		4540	Permit			Bylaw No. 304-60 VAH6000;	255	PARKDALE	AVE		and pump, 255 Parkdale Ave	364981.5341	5029724.704	FR300-VAH6000-PARD 002E	1						06/06/1972		Yes						
5589 GERVAIS MOTORS	UST	gasoline		13620	Permit			Bylaw No. 304-60 VAH6000;	255	PARKDALE	AVE		also one pump island, 255 Park	364981.5341	5029724.704	FR300-VAH6000-PARD 002E	1						06/06/1972		Yes						
5590 GERVAIS MOTORS	UST	gasoline		22700	Permit			Bylaw No. 304-60 VAH6000;	255	PARKDALE	AVE		also one pump island, 255 Park	364981.5341	5029724.704	FR300-VAH6000-PARD 002E	1						06/06/1972		Yes						
5591 FRITZ'S GARAGE (F NEW) - SUN OIL CO	UST	gasoline		1135	Permit			Bylaw No. 8022	255	PARKDALE	AVE			364981.5341	5029724.704								16/07/1934								
5592 E FOURNIER	UST	gasoline		9080	Permit			Bylaw No. 8022 - P462	1480	SCOTT	ST			365082.3864	5029777.497		1						05/03/1951	two 2000 gal Yes							
5593 E FOURNIER	UST	gasoline		9080	Permit			Bylaw No. 8022 - P462	1480	SCOTT	ST			365082.3864	5029777.497		1						05/03/1951	two 2000 gal Yes							
5594 E FOURNIER	UST	gasoline		9080	Permit			Bylaw No. 8022 - P462	1480	SCOTT	ST			365082.3864	5029777.497		1						05/03/1951	two 2000 gal Yes							
5595 E FOURNIER	UST	oil		2270	Existing	Active		Bylaw No. 8022 - P462	1480	SCOTT	ST			365082.3864	5029777.497		1						1951-003-05 17/06/1946	two 2000 gal Yes							
5596 E FOURNIER	UST	gasoline		4540	Existing	Not active		Bylaw No. 8022 - P462	1480	SCOTT	ST			365082.3864	5029777.497		1						1951-003-05 17/06/1946	two 2000 gal Yes							
5597 E FOURNIER	UST	gasoline		4540	Existing	Not active		Bylaw No. 8022 - P462	1480	SCOTT	ST			365082.3864	5029777.497		1						1951-003-05 17/06/1946	two 2000 gal Yes							
5598 E FOURNIER	UST	gasoline		2270	Existing	Not active		Bylaw No. 8022 - P462	1480	SCOTT	ST			365082.3864	5029777.497		1						1951-003-05 17/06/1946	two 2000 gal Yes							
5599 ERNIE'S GARAGE - MCCOLL-FRONTENAC OIL CO	UST	gasoline		9080	Permit			Bylaw No. 8022 - P632	1480	SCOTT	ST			365082.3864	5029777.497		1						06/07/1953	2 - 2000 gasoline							
5600 ERNIE'S GARAGE - MCCOLL-FRONTENAC OIL CO	UST	gasoline		9080	Permit			Bylaw No. 8022 - P632	1480	SCOTT	ST			365082.3864	5029777.497		1						06/07/1953	2 - 2000 gasoline							
5601 ERNIE'S GARAGE	UST	gasoline		18160	Permit			Bylaw No. 304-60 VAH6000;	1480	SCOTT	ST			365082.3864	5029777.497	FR300-VAH6000-SCOS 014E	1						21/10/1970		Yes						
5602 ERNIE'S GARAGE	UST	gasoline		9080	Permit			Bylaw No. 304-60 VAH6000;	1480	SCOTT	ST			365082.3864	5029777.497	FR300-VAH6000-SCOS 014E	1						21/10/1970		Yes						
5603 ERNIE'S GARAGE	UST	gasoline		9080	Permit			Bylaw No. 304-60 VAH6000;	1480	SCOTT	ST			365082.3864	5029777.497	FR300-VAH6000-SCOS 014E	1						21/10/1970		Yes						
5636 WHITE SAND CONSTRUCTION - MURPHY OIL (QUEBEC) LTD	UST	gasoline		13620	Permit			Bylaw No. 304																							

HLUI SUMMARY REPORT
LINEAR FEATURES

OBJECTID	SOURCE	FEATURE	YEAR	COMMENT	NAME	Shape_Length
23	1979-Topographic Map	Abandoned Railway				6782.246565
142	1968 -Topographic Map	Abandoned Railway				165.5822185

HLUI SUMMARY REPORT
AREA FEATURES

HISTORIC LANDFILL FEATURE	The historic landfills identified within the HLUI are referenced from the City's Old Landfill Management Strategy report (OLMS, 2004). Contact the City's Environmental Remediation Unit (ERU-UAE@ottawa.ca) if you would like more information about the old landfill sites identified in the OLMS report.
ACTIVITY2	6105
ACTIVITYID	6105
ADJACENT_INDUSTRY	CP Railway Roadhouse (railway workshops and roundhouses), around 1922, NE corner of Bayview and O'Mera Ave. [Intera #62], Modern Containers Ltd. (Primary Metal Industry), 1940s, 20 Bayview Rd. [Intera #63]
ADJACENT LANDUSE	commercial on west side, open green space on the east side, recreational (Tom Brown Arena) on south side; historical landfill Ur-6 (Nepean Bay) is located immediately east of site; the zoning is ES (environmentally sensitive area) and EW[693]-h (waterway)
ADJACENT_OWNER	City of Ottawa (municipal facilities) and owners of commercial buildings on south side of Bayview Rd. west; City of Ottawa south (Tom Brown Arena); NCC east
ANDERSONSWASTEDISPOSALSITES	079 (072, 071)
COMMONNAME	Bayview Dump
COMMONNAME_FR	Dépotoire Bayview
CONCENTRTN	in excess of applicable remediation criteria [AMEC, April 2002]
DEPTH_TO_BEDROCK	between 1 and 6 m approximately to limestone bedrock (depth to bedrock increases from west to east) [AMEC, April 2002]
DEPTH_TO_GROUNDWATER	water table lies within the limestone bedrock in the western portion of site and within the fill/waste deposits in the eastern portion of site [AMEC, April 2002]
DISTANCE_TO_SURFACE_WATER	site is adjacent to Ottawa River
ECOLOGICAL	ecosystem of Nepean Bay/Ottawa River; human contact possible given that municipal facilities are located within filled area
FORMER_MUN	OTTAWA
G_GENERATION	<null>
G_NEXT_VERSION	<null>
G_VERSION	0
GLOBALID	{091AE730-9B85-4C49-B712-91CC6B7BCFCF}
GROUNDWATER_FLOW_DIRECTION	generally north with an eastern component in the eastern portion of the site [AMEC, April 2002]
INFORMATION_SOURCE	1991-WDSI/WMB/MOE
LANDFILL_1998_ID	60043S
LOCATION	between Bayview Rd., C.P. Railroad, Ottawa River Parkway and a line running approx. through the middle of the Bayview snow dump
LOCTN_REF	<null>
MAGNITUDE	heavy metal soil contamination found from 0.45 m to 5.91 BGL and impacts include the majority of the fill material which has been placed on site; volume of heavy-metal impacted soil evaluated at 260,000 cubic metres; PAH impacts occur sporadically [AMEC,
METHANE	35 % v/v gas concentration [GAL, 1980]; up to 75% v/v methane on Dec. 3, 1981 [GLL, 1982]; detailed pumping test undertaken in June 1985 and Jan. 1986 to test feasibility of gas venting system [City of Ottawa memo, June 3, 1986]; up to 53.2 % v/v methane
MOE_ID	x 1010 and x 1020 (the name and date of closure of site in the MOE 1991 Waste Disposal Site Inventory seem to indicate that these two entries correspond to the same site, despite the fact that the UTM co-ordinates [northing] are approx. 400 m apart)
OBJECTID	65
OPERATIONAL_PERIOD	1933-1946
OPERATOR	City of Ottawa
OTHER_INFO	Duplicate HLUI Activity ID # 6121 corresponding to this site. - Petroleum hydrocarbon and VOC groundwater plumes originating from source other than old landfill are currently being monitored and mitigated through pump-and-treat systems [AMEC, Jan. & Apr
OTHERREF	Gartner Lee, 1980 (Site #5); Gartner Lee, 1982 (Site #5); Intera, 1988 (LI #5); City of Ottawa Operations Branch, 1980 (Site 5); ADAMAS, 1994; AMEC, Jan. 2002, April 2002 (Parcel C); City of Ottawa Memo #PE-1880-2-3, dated Feb. 3, 1986, from Duncan Burry
OVERBURDEN	clayey sand with gravel, possibly a basal till, overlies the bedrock [AMEC, April 2002]
OWNER	City of Ottawa
OWNERCATEGORY	City
PARAMETERS	sodium, chloride, ammonia, boron, iron, phosphorous, potassium, sulphate in groundwater; heavy metals (barium, beryllium, cadmium, copper, lead, nickel, molybdenum, zinc) and PAHs (benzo(a)pyrene and dibenzo(a,h)anthracene) in soil and groundwater [AMEC,
PARENT_ID	<null>
PHYSICAL	several municipal buildings and Bayview Snow Dump (at former location of maintenance garage) located on site; asphalt and concrete paving cover on most of the site
ROAD_NAME	<null>
ROAD_TYPE	<null>
SERVICE_AREA	presumably City of Ottawa
SHAPE	Polygon
SHAPE_AREA	57505.53868
SHAPE_LEN	1186.734471
SITE_ACCES	Dépotoire Bayview
SITE_ALIAS	Ur-05
SITE_COORD	site is located on municipal property (presumably with restricted access)
SITE_ID_FR	Bayview & Slidell - Bayview Road Works Yard
SITE_IDENTIFICATION	UTM = 443300E, 5028650N (UTM coordinates revised from MOE inventory). Site #X1010 of closed sites in MOE inventory (pg133).
SITE_NAME	Ur-05
SITE_NAME_FR	Bayview Dump
SITE_STATUS	Confirmed
SIZE_HA	area approx. 7 ha
SOIL_COVER	sand and graver fill cover of varying thickness either as the primary surfacing material or as the subbase beneath asphalted areas; thickness ranges from approx. 0.1 m to several metres [AMEC, April 2002]
TOPOGRAPHY	relatively flat
UNIQUEID	Bayview DumpUr-05
UTM_NAD27_E_NOTE	(as plotted by Gartner Lee, 1980); 442880 (MOE 1991 Waste Disposal Site Inventory)
UTM_NAD27_EASTING	443250
UTM_NAD27_N_NOTE	(as plotted by Gartner Lee, 1980); 5028840 (MOE 1991 Waste Disposal Site Inventory)
UTM_NAD27_NORTHING	5028500
WASTEDEPTH	from 0.1 m along the northwest portion of site to 7.6 m at the northeast corner [ADAMAS, 1994; AMEC, April 2002]; waste was found 1 to 3 m below the surface [NCC fax dated October 1, 2002]
WASTETYPE	presumably domestic wastes based on historical City records; domestic and industrial solid waste encountered below ground level [NCC fax dated Oct. 1, 2002]
WATER_SUPPLY	municipally supplied water


HISTORIC LANDFILL FEATURE	The historic landfills identified within the HLUI are referenced from the City's Old Landfill Management Strategy report (OLMS, 2004). Contact the City's Environmental Remediation Unit (ERU-UAE@ottawa.ca) if you would like more information about the old landfill sites identified in the OLMS report.
ACTIVITY2	6122
ACTIVITYID	6122
ADJACENT_INDUSTRY	Modern Containers Ltd. (Primary Metals Industry), 1940s, 20 Bayview Rd. [Intera #63]
ADJACENT_LANDUSE	commercial on east side; residential on south and west sides; open green space on north side; the zoning is partially L3 (community leisure) and R5A[600]
ADJACENT_OWNER	H(10.7) (low rise apartment) in the general area of the site. private home owners west of Stonehurst Ave. and industries east of site
ANDERSONSWASTEDISPOSALSITES_ID	68
COMMONNAME	Laroche Park
COMMONNAME_FR	Parc Laroche
CONCENTRTN	analytical results exist but not available for review
DEPTH_TO_BEDROCK	interbedded calcarenite, bioclastic limestone, crystalline limestone and shale bedrock expected at or near surface
DEPTH_TO_GROUNDWATER	unknown
DISTANCE_TO_SURFACE_WATER	Ottawa River 350 m NNW
ECOLOGICAL	since area is used as a park, human contact is possible
FORMER_MUN	OTTAWA
G_GENERATION	<null>
G_NEXT_VERSION	<null>
G_VERSION	0
GLOBALID	[C0CCE985-4A31-4C7F-A4DC-369A11AE8138]
GROUNDWATER_FLOW_DIRECTION	assumed to be N towards the Ottawa River
INFORMATION_SOURCE	1991-WDSI/WMB/MOE
LANDFILL_1998_ID	__60045L
LOCATION	east of Stonehurst Ave: southeast portion of Laroche Park and east portion of Russian Orthodox Church property
LOCTN_REF	<null>
MAGNITUDE	analytical results exist but not available for review
METHANE	none detected during GLL survey conducted in 1988
MOE_ID	x 1021
OBJECTID	97
OPERATIONAL_PERIOD	1928-1932
OPERATOR	presumably City of Ottawa
OTHER_INFO	Several large sewage lagoons observed on 1928 aerial photographs. Earth and construction rubble used to fill lagoons and shallow low-lying areas
OTHERREF	between 1928 and 1932. [GLL, 1988]
OVERBURDEN	Gartner Lee, 1988 (Site #38); Intera, 1988 (Lf #38); AMEC, April 2002 (Parcel A)
OWNER	limited topsoil over near surface bedrock
OWNERCATEGORY	City of Ottawa (Laroche Park) and Russian Orthodox Church
PARAMETERS	City and Institutional
PARENT_ID	see "Landfill Monitoring/Remediation"
PHYSICAL	<null>
ROAD_NAME	Laroche Park is currently used as a playing field
ROAD_TYPE	<null>
SERVICE_AREA	presumably City of Ottawa
SHAPE	Polygon
SHAPE_AREA	3885.283417
SHAPE_LEN	272.130739
SITE_ACCES	Avenues Stonehurst et Bayview
SITE_ALIAS	Ur-38
SITE_COORD	area is fenced but currently accessible to the public
SITE_ID_FR	Laroche Park
SITE_IDENTIFICATION	UTM = 443050E, 5028230N, map 31G/5. Site #X1021 of closed sites in the MOE inventory (pg133).
SITE_NAME	Ur-38
SITE_NAME_FR	Stonehurst and Bayview Avenue
SITE_STATUS	Confirmed
SIZE_HA	area approx. 0.6 ha
SOIL_COVER	wastes are assumed to be covered based on land use, however thickness of cover unknown
TOPOGRAPHY	generally flat
UNIQUEID	Stonehurst and Bayview AvenueUr-38
UTM_NAD27_E_NOTE	<null>
UTM_NAD27_EASTING	443050
UTM_NAD27_N_NOTE	<null>
UTM_NAD27_NORTHING	5028230
WASTEDEPTH	unknown
WASTETYPE	unknown; cinder, ash, glass, cobbles in a silty sand textured soil encountered in probe holes
WATER_SUPPLY	municipally supplied water

Environmental Risk Management Area (ERMA)

Site ID: 1

3 HAMILTON AVENUE N – HONEYWELL SITE

Outlined in bright purple on HLUI Map

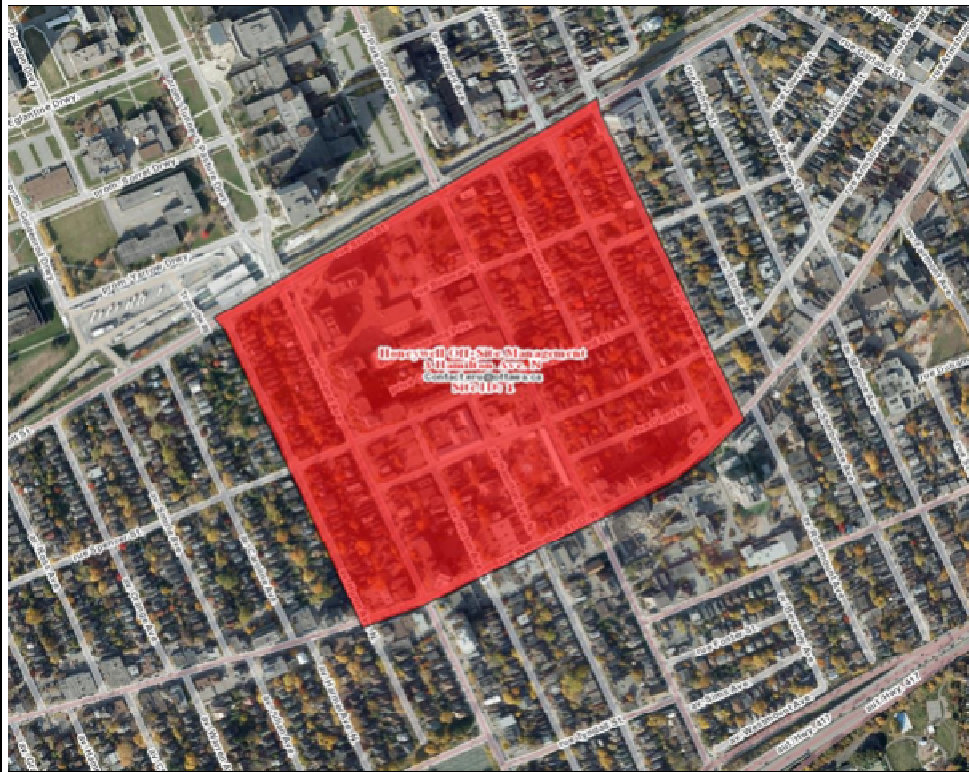

There is known groundwater contamination in this area associated with a former Honeywell manufacturing facility located at 3 Hamilton Avenue N. Concentrations of volatile organic compounds (VOCs) have been found in groundwater at various on- and off-Site locations which exceed the provincial standards. Special consideration should be given for projects involving management of groundwater (i.e. contact w/ groundwater, pumping and/or dewatering).

For more information please contact the City's Environmental Remediation Unit (ERU) at ERU-UAE@ottawa.ca



DATABASE **REPORT**

Project Property:	<i>Tunney's Pasture ROW Servicing & Redevelopment Tunney's Pasture Ottawa ON</i>
Project No:	
Report Type:	<i>RSC Report - Quote</i>
Order No:	<i>22062900235</i>
Requested by:	<i>Paterson Group Inc.</i>
Date Completed:	<i>July 5, 2022</i>

Environmental Risk Information Services

A division of Glacier Media Inc.

1.866.517.5204 | info@erisinfo.com | erisinfo.com

Table of Contents

Table of Contents.....	2
Executive Summary.....	3
Executive Summary: Report Summary.....	4
Executive Summary: Site Report Summary - Project Property.....	6
Executive Summary: Site Report Summary - Surrounding Properties.....	26
Executive Summary: Summary By Data Source.....	51
Map.....	98
Aerial.....	99
Topographic Map.....	100
Detail Report.....	101
Unplottable Summary.....	419
Unplottable Report.....	424
Appendix: Database Descriptions.....	457
Definitions.....	466

Notice: IMPORTANT LIMITATIONS and YOUR LIABILITY

Reliance on information in Report: This report DOES NOT replace a full Phase I Environmental Site Assessment but is solely intended to be used as a database review of environmental records.

License for use of information in Report: No page of this report can be used without this cover page, this notice and the project property identifier. The information in Report(s) may not be modified or re-sold.

Your Liability for misuse: Using this Service and/or its reports in a manner contrary to this Notice or your agreement will be in breach of copyright and contract and ERIS may obtain damages for such mis-use, including damages caused to third parties, and gives ERIS the right to terminate your account, rescind your license to any previous reports and to bar you from future use of the Service.

No warranty of Accuracy or Liability for ERIS: The information contained in this report has been produced by ERIS Information Limited Partnership ("ERIS") using various sources of information, including information provided by Federal and Provincial government departments. The report applies only to the address and up to the date specified on the cover of this report, and any alterations or deviation from this description will require a new report. This report and the data contained herein does not purport to be and does not constitute a guarantee of the accuracy of the information contained herein and does not constitute a legal opinion nor medical advice. Although ERIS has endeavored to present you with information that is accurate, ERIS disclaims, any and all liability for any errors, omissions, or inaccuracies in such information and data, whether attributable to inadvertence, negligence or otherwise, and for any consequences arising therefrom. Liability on the part of ERIS is limited to the monetary value paid for this report.

Trademark and Copyright: You may not use the ERIS trademarks or attribute any work to ERIS other than as outlined above. This Service and Report (s) are protected by copyright owned by ERIS Information Limited Partnership. Copyright in data used in the Service or Report(s) (the "Data") is owned by ERIS or its licensors. The Service, Report(s) and Data may not be copied or reproduced in whole or in any substantial part without prior written consent of ERIS.

Executive Summary

Property Information:

Project Property: *Tunney's Pasture ROW Servicing & Redevelopment
Tunney's Pasture Ottawa ON*

Project No:

Order Information:

Order No: *22062900235*
Date Requested: *June 29, 2022*
Requested by: *Paterson Group Inc.*
Report Type: *RSC Report - Quote*

Historical/Products:

ERIS Xplorer [*ERIS Xplorer*](#)
Topographic Map *RSC Maps*

Executive Summary: Report Summary

<i>Database</i>	<i>Name</i>	<i>Searched</i>	<i>Project Property</i>	<i>Boundary to 0.30km</i>	<i>Total</i>
AAGR	Abandoned Aggregate Inventory	Y	0	0	0
AGR	Aggregate Inventory	Y	0	0	0
AMIS	Abandoned Mine Information System	Y	0	0	0
ANDR	Anderson's Waste Disposal Sites	Y	0	0	0
AST	Aboveground Storage Tanks	Y	0	0	0
AUWR	Automobile Wrecking & Supplies	Y	0	0	0
BORE	Borehole	Y	13	4	17
CA	Certificates of Approval	Y	0	15	15
CDRY	Dry Cleaning Facilities	Y	0	0	0
CFOT	Commercial Fuel Oil Tanks	Y	0	1	1
CHEM	Chemical Manufacturers and Distributors	Y	0	0	0
CHM	Chemical Register	Y	0	0	0
CNG	Compressed Natural Gas Stations	Y	0	0	0
COAL	Inventory of Coal Gasification Plants and Coal Tar Sites	Y	0	0	0
CONV	Compliance and Convictions	Y	0	0	0
CPU	Certificates of Property Use	Y	0	0	0
DRL	Drill Hole Database	Y	0	0	0
DTNK	Delisted Fuel Tanks	Y	0	6	6
EASR	Environmental Activity and Sector Registry	Y	3	3	6
EBR	Environmental Registry	Y	1	1	2
ECA	Environmental Compliance Approval	Y	4	13	17
EEM	Environmental Effects Monitoring	Y	0	0	0
EHS	ERIS Historical Searches	Y	6	48	54
EIIS	Environmental Issues Inventory System	Y	0	0	0
EMHE	Emergency Management Historical Event	Y	0	0	0
EPAR	Environmental Penalty Annual Report	Y	0	0	0
EXP	List of Expired Fuels Safety Facilities	Y	0	0	0
FCON	Federal Convictions	Y	0	0	0
FCS	Contaminated Sites on Federal Land	Y	1	0	1
FOFT	Fisheries & Oceans Fuel Tanks	Y	0	0	0
FRST	Federal Identification Registry for Storage Tank Systems (FIRSTS)	Y	3	0	3
FST	Fuel Storage Tank	Y	0	3	3
FSTH	Fuel Storage Tank - Historic	Y	0	2	2
GEN	Ontario Regulation 347 Waste Generators Summary	Y	87	89	176
GHG	Greenhouse Gas Emissions from Large Facilities	Y	1	0	1
HINC	TSSA Historic Incidents	Y	0	4	4

Database	Name	Searched	Project Property	Boundary to 0.30km	Total
IAFT	Indian & Northern Affairs Fuel Tanks	Y	0	0	0
INC	Fuel Oil Spills and Leaks	Y	0	1	1
LIMO	Landfill Inventory Management Ontario	Y	0	0	0
MINE	Canadian Mine Locations	Y	0	0	0
MNR	Mineral Occurrences	Y	0	0	0
NATE	National Analysis of Trends in Emergencies System (NATES)	Y	0	0	0
NCPL	Non-Compliance Reports	Y	0	0	0
NDFT	National Defense & Canadian Forces Fuel Tanks	Y	0	0	0
NDSP	National Defense & Canadian Forces Spills	Y	0	0	0
NDWD	National Defence & Canadian Forces Waste Disposal Sites	Y	0	0	0
NEBI	National Energy Board Pipeline Incidents	Y	0	0	0
NEBP	National Energy Board Wells	Y	0	0	0
NEES	National Environmental Emergencies System (NEES)	Y	0	0	0
NPCB	National PCB Inventory	Y	0	0	0
NPRI	National Pollutant Release Inventory	Y	12	0	12
OGWE	Oil and Gas Wells	Y	0	0	0
OOGW	Ontario Oil and Gas Wells	Y	0	0	0
OPCB	Inventory of PCB Storage Sites	Y	0	0	0
ORD	Orders	Y	0	0	0
PAP	Canadian Pulp and Paper	Y	0	0	0
PCFT	Parks Canada Fuel Storage Tanks	Y	0	0	0
PES	Pesticide Register	Y	0	3	3
PINC	Pipeline Incidents	Y	0	15	15
PRT	Private and Retail Fuel Storage Tanks	Y	0	1	1
PTTW	Permit to Take Water	Y	0	3	3
REC	Ontario Regulation 347 Waste Receivers Summary	Y	0	0	0
RSC	Record of Site Condition	Y	0	1	1
RST	Retail Fuel Storage Tanks	Y	0	2	2
SCT	Scott's Manufacturing Directory	Y	1	18	19
SPL	Ontario Spills	Y	37	48	85
SRDS	Wastewater Discharger Registration Database	Y	0	0	0
TANK	Anderson's Storage Tanks	Y	0	0	0
TCFT	Transport Canada Fuel Storage Tanks	Y	0	0	0
VAR	Variances for Abandonment of Underground Storage Tanks	Y	0	0	0
WDS	Waste Disposal Sites - MOE CA Inventory	Y	0	0	0
WDSH	Waste Disposal Sites - MOE 1991 Historical Approval Inventory	Y	0	0	0
WWIS	Water Well Information System	Y	9	27	36
Total:			178	308	486

Executive Summary: Site Report Summary - Project Property

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev diff (m)</i>	<i>Page Number</i>
<u>1</u>	GEN	HEALTH AND WELFARE CANADA	BANTING RESEARCH CENTRE STORES 1 ROSS AVE., TUNNEYS PASTURE OTTAWA ON K1A 0L2	N/0.0	0.00	<u>101</u>
<u>1</u>	GEN	GVT. OF CAN. - HEALTH AND WELFARE 18-094	BANTING RESEARCH CENTRE STORES 1 ROSS AVE., TUNNEY PASTURE OTTAWA ON K1A 0L2	N/0.0	0.00	<u>101</u>
<u>1</u>	GEN	HEALTH AND WELFARE CANADA	BANTING RESEARCH CENTRE STORES 1 ROSS AVENUE, TUNNEYS PASTURE OTTAWA ON K1A 0L2	N/0.0	0.00	<u>102</u>
<u>1</u>	GEN	HEALTH AND WELFARE CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON K1A 0L2	N/0.0	0.00	<u>103</u>
<u>1</u>	GEN	HEALTH AND WELFARE CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON	N/0.0	0.00	<u>104</u>
<u>1</u>	GEN	HEALTH AND WELFARE CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON	N/0.0	0.00	<u>105</u>
<u>1</u>	GEN	HEALTH AND WELFARE CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON	N/0.0	0.00	<u>106</u>
<u>1</u>	GEN	HEALTH AND WELFARE CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON K1A 0M3	N/0.0	0.00	<u>107</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev diff (m)</i>	<i>Page Number</i>
<u>1</u>	GEN	HEALTH AND WELFARE CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON	N/0.0	0.00	<u>108</u>
<u>1</u>	GEN	HEALTH AND WELFARE CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON K1A 0L2	N/0.0	0.00	<u>109</u>
<u>1</u>	GEN	HEALTH AND WELFARE CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON K1A 0L2	N/0.0	0.00	<u>110</u>
<u>1</u>	GEN	HEALTH AND WELFARE CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON K1A 0L2	N/0.0	0.00	<u>111</u>
<u>1</u>	GEN	HEALTH AND WELFARE CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON K1A 0L2	N/0.0	0.00	<u>112</u>
<u>1</u>	GEN	HEALTH AND WELFARE CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON K1A 0L2	N/0.0	0.00	<u>113</u>
<u>1</u>	GEN	HEALTH CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON K1A 0L2	N/0.0	0.00	<u>115</u>
<u>2</u>	EHS		Tunney's Pasture Ottawa ON	NW/0.0	-0.84	<u>117</u>
<u>3</u>	WWIS		100 CHARDON DRIVEWAY Ottawa ON <i>Well ID:</i> 7315150	NW/0.0	-1.15	<u>117</u>
<u>4</u>	WWIS		100 CHARDON DRIVEWAY Ottawa ON	NW/0.0	-1.15	<u>119</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
			Well ID: 7315151			
5	NPRI	PUBLIC WORKS AND GOVERNEMENT SERVICES CANADA	50 CHARDON DRIVE CORNER OF SOREL/DU CHARDON OTTAWA ON K1A0M3	SSE/0.0	-0.15	122
5	NPRI	PUBLIC WORKS AND GOVERNMENT SERVICES CANADA	50 CHARDON DRIVE CORNER OF SOREL/DU CHARDON OTTAWA ON K1A0M3	SSE/0.0	-0.15	123
5	NPRI	PUBLIC WORKS AND GOVERNMENT SERVICES CANADA	50 CHARDON DRIVE CORNER OF SOREL/DU CHARDON OTTAWA ON K1A0M3	SSE/0.0	-0.15	124
5	NPRI	PUBLIC WORKS AND GOVERNMENT SERVICES CANADA	50 CHARDON DRIVE CORNER OF SOREL/DU CHARDON OTTAWA ON K1A0M3	SSE/0.0	-0.15	126
5	NPRI	PUBLIC WORKS AND GOVERNMENT SERVICES CANADA	50 CHARDON DRIVE CORNER OF SOREL/DU CHARDON OTTAWA ON K1A0M3	SSE/0.0	-0.15	127
5	NPRI	PUBLIC WORKS AND GOVERNMENT SERVICES CANADA	50 CHARDON DRIVE CORNER OF SOREL/DU CHARDON OTTAWA ON K1A0M3	SSE/0.0	-0.15	128
5	SPL	The Department of Public Works<UNOFFICIAL>	50 Chardon Driveway Ottawa ON	SSE/0.0	-0.15	129
5	NPRI	PUBLIC WORKS AND GOVERNMENT SERVICES CANADA	50 CHARDON DRIVE CORNER OF SOREL/DU CHARDON OTTAWA ON K1A0M3	SSE/0.0	-0.15	130
5	SPL		50 Chardon St Ottawa ON	SSE/0.0	-0.15	131

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
<u>5</u>	SPL		50 Chardon Driveway<UNOFFICIAL> Ottawa ON	SSE/0.0	-0.15	<u>131</u>
<u>5</u>	NPRI	PUBLIC WORKS AND GOVERNMENT SERVICES CANADA	50 CHARDON DRIVE NOT AVAILABLE OTTAWA ON K1A0M3	SSE/0.0	-0.15	<u>132</u>
<u>5</u>	NPRI	PUBLIC WORKS AND GOVERNMENT SERVICES CANADA	50 Entrain Chardon Ottawa ON K1A0M3	SSE/0.0	-0.15	<u>133</u>
<u>5</u>	SPL	Public Works and Government Service Canada (PWGSC)	50 Chardon Driveway Ottawa ON	SSE/0.0	-0.15	<u>134</u>
<u>5</u>	NPRI	PUBLIC WORKS AND GOVERNMENT SERVICES CANADA	50 CHARDON DRIVE NOT AVAILABLE OTTAWA ON K1A0M3	SSE/0.0	-0.15	<u>134</u>
<u>5</u>	SPL	Public Works Government Services Canada	50 Chardon Drive Ottawa ON	SSE/0.0	-0.15	<u>135</u>
<u>5</u>	SPL		50 Chardon Drive Ottawa ON	SSE/0.0	-0.15	<u>135</u>
<u>5</u>	SPL	Her Majesty the Queen in Right of Canada as Represented by the Minister of	Public Works and Government Services Canada 50 Chardon Driveway Ottawa ON	SSE/0.0	-0.15	<u>136</u>
<u>5</u>	NPRI	PUBLIC WORKS AND GOVERNMENT SERVICES CANADA	50 CHARDON DRIVE NOT AVAILABLE OTTAWA ON K1A0M3	SSE/0.0	-0.15	<u>136</u>
<u>5</u>	GHG	Tunney's Pasture Central Heating and Cooling Plant	50 Chardon Drive Ottawa ON K1A 0M3	SSE/0.0	-0.15	<u>137</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
<u>5</u>	GEN	Public Services & Procurement Canada ESD/AFD	50 Chardon OTTAWA ON K1A0S5	SSE/0.0	-0.15	<u>139</u>
<u>5</u>	FRST	Public Service and Procurement Canada (Corporate)	50 Chardon Driveway Ottawa ON k1y 1g9	SSE/0.0	-0.15	<u>140</u>
<u>5</u>	GEN	Public Services & Procurement Canada ESD/AFD	50 Chardon OTTAWA ON K1A0S5	SSE/0.0	-0.15	<u>142</u>
<u>5</u>	EBR	ENGIE Services Inc.	50 Chardon Driveway Ottawa , ON Canada ON	SSE/0.0	-0.15	<u>143</u>
<u>5</u>	ECA	ENGIE Services Inc.	50 Chardon Driveway Ottawa ON H3A 3C8	SSE/0.0	-0.15	<u>143</u>
<u>5</u>	GEN	Public Services & Procurement Canada ESD/AFD	50 Chardon OTTAWA ON K1A0S5	SSE/0.0	-0.15	<u>144</u>
<u>6</u>	EHS		Parkdale Ave Ottawa ON	SSW/0.0	-0.18	<u>144</u>
<u>7</u>	SPL		151 Tunney's Pasture Driveway Ottawa ON	E/0.0	-0.09	<u>144</u>
<u>8</u>	GEN	GVT. OF CAN. - PUBLIC WORKS CANADA	TUNNEY'S PASTURE HEATING PLANT BLDG. 13 TUNNEY'S PASTURE, SORRELL & DUCHARDON OTTAWA ON K1A 0M3	S/0.0	0.31	<u>145</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
8	GEN	GVT. OF CAN. - PUBLIC WORKS CANADA18-209	TUNNEY'S PASTURE HEATING PLANT BLDG. 13 TUNNEY'S PASTURE, SORRELL & DUCHARDON OTTAWA ON K1A 0M3	S/0.0	0.31	145
8	SPL	Public Works and Government Services Canada	Sorrel and Chardon Road, Ottawa BUILDING 13, TUNNEY'S PASTURE CENTRAL HEATING PLANT<UNOFFICIAL> Ottawa ON	S/0.0	0.31	146
9	SPL		East side of Tunney's Pasture, north of Scott Street Ottawa ON	SW/0.0	0.54	146
10	SPL	Plomberie Solutions<UNOFFICIAL>	Ottawa ON	WSW/0.0	-0.17	147
11	EASR	PCL CONSTRUCTORS CANADA INC	ON	E/0.0	-1.15	147
12	BORE		ON	WNW/0.0	-1.15	147
13	GEN	Demo Plus	100 Chardon Drive Ottawa ON K1Y 2Z0	NNW/0.0	-1.15	148
14	SPL	Raymond Roofing<UNOFFICIAL>	100 Eglantine Driveway Ottawa ON	N/0.0	-1.46	149
14	SPL	Raymond & Associates Roofing Inc<UNOFFICIAL>	100 Eglantine Driveway Ottawa ON	N/0.0	-1.46	149

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
14	GEN	Royal Canadian Mounted Police Tunney's Laboratory	100 Eglantine Driveway Ottawa ON K1A 0K9	N/0.0	-1.46	150
14	GEN	Royal Canadian Mounted Police Tunney's Laboratory	100 Eglantine Driveway Ottawa ON K1A 0K9	N/0.0	-1.46	150
15	BORE		ON	WSW/0.0	-0.15	151
16	EHS		101 Tunney's Pasture Ottawa ON K1Y	SE/0.0	-0.15	152
17	WWIS		OTTAWA RIVER PARKWAY OTTAWA ON <i>Well ID: 7050791</i>	WNW/0.0	-1.15	152
18	GEN	Public Works and Government Services Canada	101 Tunneys Pasture Driveway Ottawa ON K1A 0T6	ESE/0.0	-0.22	155
19	EHS		130 Goldenrod Driveway Ottawa ON K1Y4P7	S/0.0	0.85	156
20	BORE		ON	NNW/0.0	-1.46	156
21	WWIS		1065 WELLINGTON ST OTTAWA ON <i>Well ID: 7044700</i>	S/0.0	0.85	157

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
<u>22</u>	SPL	UNKNOWN	ENVIRONMENTAL HEALTH CENTRE TUNNEY'S PASTURE OTTAWA CITY ON	W/0.0	-1.15	<u>16</u>
<u>22</u>	SPL	PUBLIC WORKS CANADA	ENVIRONMENTAL HEALTH BUILDING TUNNEY'S PASTURE HEALTH PROTECTION BUILDING (NRC) TUNNEY'S PASTURE, OTTAWA OTTAWA CITY ON	W/0.0	-1.15	<u>16</u>
<u>22</u>	SPL	UNKNOWN	BUILDING #8, TUNNEY'S PASTURE ENVIRONMENTAL HEALTH SERVICES. OTTAWA CITY ON	W/0.0	-1.15	<u>16</u>
<u>23</u>	SPL	PUC	SOREL ST. AND HOLLAND AVE. OTTAWA CITY ON	E/0.0	-1.15	<u>16</u>
<u>24</u>	BORE		ON	S/0.0	0.85	<u>162</u>
<u>25</u>	SPL	Department of National Defence	Department of National Defence Ottawa ON	SE/0.0	-0.87	<u>163</u>
<u>26</u>	GEN	GVT. OF CAN-NATIONAL RESEARCH CNCL	HEALTH PROTECTION BUILDING 7 TUNNEY'S PASTURE OTTAWA ON K1A 0R6	ESE/0.0	-1.15	<u>164</u>
<u>26</u>	GEN	GVT. OF CAN-NATIONAL RESEARCH CNCL18-245	HEALTH PROTECTION BUILDING 7 TUNNEY'S PASTURE OTTAWA ON K1A 0R6	ESE/0.0	-1.15	<u>164</u>
<u>26</u>	ECA	Public Works Government Services Canada	19 Tunney's Pasture Dr Ottawa ON K1A 0S5	ESE/0.0	-1.15	<u>165</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
<u>27</u>	SPL	EllisDon Corporation	129 Yarrow Driveway Ottawa ON	SE/0.0	-0.14	<u>165</u>
<u>27</u>	SPL		129 Yarrow Dr Ottawa ON	SE/0.0	-0.14	<u>165</u>
<u>28</u>	EASR	AECON CONSTRUCTION ONTARIO EAST LIMITED	ON	SW/0.0	0.70	<u>166</u>
<u>29</u>	SPL	GAL Power Systems Limited	101 Goldenrod Driveway, Tunney's Pasture Ottawa ON	SSW/0.0	1.16	<u>166</u>
<u>29</u>	SPL	Public Work Government Service Canada	101 Goldenrod Driveway Ottawa ON	SSW/0.0	1.16	<u>167</u>
<u>29</u>	SPL		101 Goldenrod Driveway Ottawa ON	SSW/0.0	1.16	<u>167</u>
<u>29</u>	GEN	Brookfield Global Integrated Solutions	101 Goldenrod Drive Ottawa ON K1A 0T6	SSW/0.0	1.16	<u>168</u>
<u>29</u>	GEN	Brookfield Global Integrated Solutions	101 Goldenrod Drive Ottawa ON K1A 0T6	SSW/0.0	1.16	<u>168</u>
<u>29</u>	GEN	BGIS BGIS	101 Goldenrod Drive Ottawa ON K1A 0T6	SSW/0.0	1.16	<u>169</u>
<u>29</u>	GEN	BGIS BGIS	101 Goldenrod Drive Ottawa ON K1A 0T6	SSW/0.0	1.16	<u>169</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev diff (m)</i>	<i>Page Number</i>
29	GEN	BGIS BGIS	101 Goldenrod Drive Ottawa ON K1A 0T6	SSW/0.0	1.16	170
30	BORE		ON	SSW/0.0	1.16	170
31	SPL		Tunney's Pasture and Yarrow Driveway Ottawa ON	ESE/0.0	-1.15	171
32	SPL		170 Tunney's Pasture Lane STATISTICS CANADA LOADING DOCK<UNOFFICIAL> Ottawa ON	ENE/0.0	-2.15	171
32	SPL		170 Tunneys Pasture Driveway Ottawa ON	ENE/0.0	-2.15	172
32	SPL		170 Tunney's Pasture Drive Ottawa ON	ENE/0.0	-2.15	172
32	SPL		170 Tunneys Pasture Ottawa ON	ENE/0.0	-2.15	173
32	SPL	Waste Connections of Canada Inc.	170 Tunney's Pasture Dr Ottawa ON	ENE/0.0	-2.15	173
33	GEN	NATIONAL RESEARCH COUNCIL	HEALTH PROTECTION BUILDING 7 HOLLAND AVENUE, TUNNEY'S PASTURE OTTAWA ON K1A 0R6	NE/0.0	-2.15	174

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
<u>33</u>	GEN	GVT. OF CAN. - ATOMIC ENERGY CONT.	L B, TUNNEY'S PASTURE (HPB BUILDING) C/O P O BOX 1046 OTTAWA ON K1P 5S9	NE/0.0	-2.15	<u>174</u>
<u>33</u>	GEN	ATOMIC ENERGY CONTROL BOARD	HPB BUILDING (HOLLAND & COLOMBINE) TUNNEY'S PASTURE, ROOM 253 OTTAWA ON K1P 5S9	NE/0.0	-2.15	<u>175</u>
<u>33</u>	GEN	GVT. OF CAN. - ATOMIC ENERGY CONT.18-029	L B, TUNNEY'S PASTURE (HPB BUILDING) C/O P O BOX 1046 OTTAWA ON K1P 5S9	NE/0.0	-2.15	<u>175</u>
<u>33</u>	GEN	ATOMIC ENERGY CONTROL BOARD	HPB BUILDING 7 (HOLLAND & COLOMBINE) TUNNEY'S PASTURE, ROOM 253 OTTAWA ON K1A 0L2	NE/0.0	-2.15	<u>176</u>
<u>33</u>	GEN	CANADIAN NUCLEAR SAFETY COMMISSION	HPB BUILDING 7 (HOLLAND & COLOMBINE) TUNNEY'S PASTURE, ROOM 253 OTTAWA ON K1A 0L2	NE/0.0	-2.15	<u>176</u>
<u>33</u>	GEN	CANADIAN NUCLEAR SAFETY COMMISSION	HPB BUILDING 7 (HOLLAND & COLOMBINE) TUNNEY'S PASTURE, ROOM 253 OTTAWA ON	NE/0.0	-2.15	<u>176</u>
<u>33</u>	GEN	CANADIAN NUCLEAR SAFETY COMMISSION	HPB BUILDING 7 (HOLLAND & COLOMBINE) TUNNEY'S PASTURE, ROOM 253 OTTAWA ON	NE/0.0	-2.15	<u>177</u>
<u>33</u>	EHS		200 Tunneys Pasture Driveway Ottawa ON K1Y4G8	NE/0.0	-2.15	<u>177</u>
<u>34</u>	GEN	GVT. OF CAN-STATISTICS CANADA	1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON K1A 0T6	E/0.0	-1.35	<u>178</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
<u>34</u>	GEN	NATIONAL ARCHIVES OF CANADA	STATISTICS MAIN BUILDING, ROOM 1306 HOLLAND AVENUE OTTAWA ON K1A 0T6	E/0.0	-1.35	<u>178</u>
<u>34</u>	GEN	GVT. OF CAN. - NATIONAL ARCHIVES CANADA	STATISTICS MAIN BUILDING, ROOM 1306 HOLLAND AVENUE OTTAWA ON K1A 0T6	E/0.0	-1.35	<u>179</u>
<u>34</u>	GEN	NATIONAL ARCHIVES CANADA	STATISTICS MAIN BUILDING, ROOM 1306 HOLLAND AVENUE OTTAWA ON K1A 0T6	E/0.0	-1.35	<u>179</u>
<u>34</u>	GEN	GVT. OF CAN-STATISTICS CANADA	1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON	E/0.0	-1.35	<u>179</u>
<u>34</u>	GEN	GVT. OF CAN-STATISTICS CANADA	1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON	E/0.0	-1.35	<u>180</u>
<u>34</u>	GEN	Lexus Mechanical	150 Tunney's Pasture Ottawa ON	E/0.0	-1.35	<u>180</u>
<u>34</u>	GEN	GVT. OF CAN-STATISTICS CANADA	1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON	E/0.0	-1.35	<u>180</u>
<u>34</u>	GEN	GVT. OF CAN-STATISTICS CANADA	1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON K1A 0T6	E/0.0	-1.35	<u>181</u>
<u>34</u>	GEN	Statistics Canada	150Tunney's Pasture Driveway Main Bldg, SC0005 Ottawa ON	E/0.0	-1.35	<u>182</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
<u>34</u>	GEN	Health Canada	150 Tunney's Pasture Drwy Ottawa ON	E/0.0	-1.35	<u>182</u>
<u>34</u>	GEN	GVT. OF CAN-STATISTICS CANADA	1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON	E/0.0	-1.35	<u>182</u>
<u>34</u>	GEN	GVT. OF CAN-STATISTICS CANADA	1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON K1A 0T6	E/0.0	-1.35	<u>183</u>
<u>34</u>	GEN	GVT. OF CAN-STATISTICS CANADA	1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON K1A 0T6	E/0.0	-1.35	<u>183</u>
<u>34</u>	GEN	GVT. OF CAN-STATISTICS CANADA	1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON K1A 0T6	E/0.0	-1.35	<u>184</u>
<u>34</u>	GEN	Statistics Canada	150Tunney's Pasture Driveway Main Bldg, SC0005 Ottawa ON K1A0T6	E/0.0	-1.35	<u>185</u>
<u>34</u>	GEN	GVT. OF CAN-STATISTICS CANADA Administrative Support Services Division	1405 Main Statistics Canada Building TUNNEYS PASTURE OTTAWA ON K1A 0T6	E/0.0	-1.35	<u>185</u>
<u>34</u>	SPL		150 Tunneys Pasture Driveway Ottawa ON	E/0.0	-1.35	<u>186</u>
<u>34</u>	GEN	GVT. OF CAN-STATISTICS CANADA Administrative Support Services Division	1405 Main Statistics Canada Building TUNNEYS PASTURE OTTAWA ON K1A 0T6	E/0.0	-1.35	<u>186</u>
<u>34</u>	GEN	GVT. OF CAN-STATISTICS CANADA Administrative Support Services Division	1405 Main Statistics Canada Building TUNNEYS PASTURE OTTAWA ON K1A 0T6	E/0.0	-1.35	<u>187</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev diff (m)</i>	<i>Page Number</i>
<u>34</u>	GEN	GVT. OF CAN-STATISTICS CANADA Administrative Support Services Division	1405 Main Statistics Canada Building TUNNEYS PASTURE OTTAWA ON K1A 0T6	E/0.0	-1.35	<u>188</u>
<u>35</u>	SPL	Cascades Recovery Inc.	100 Tunney's Pasture Lane Ottawa ON	ESE/0.0	-1.15	<u>189</u>
<u>35</u>	SPL		100 Tunney's Pasture Driveway Ottawa ON	ESE/0.0	-1.15	<u>189</u>
<u>36</u>	ECA	SNC-Lavalin Constructors (Pacific) Inc.; Dragados Canada, Inc. and EllisDon	Corporation operating as OLRT Constructors 1611 Scott St Ottawa ON K1Z 1G3	SE/0.0	-1.15	<u>190</u>
<u>36</u>	EASR	SNC Lavalin Constructors (Pacific) Inc.; Dragados-Canada, Inc.; EllisDon	Corporation 1611 Scott ST Ottawa ON K1Y 4W2	SE/0.0	-1.15	<u>190</u>
<u>36</u>	ECA	City of Ottawa	1611 Scott St Ottawa ON K2G 6J8	SE/0.0	-1.15	<u>190</u>
<u>37</u>	BORE		ON	ESE/0.0	-1.15	<u>190</u>
<u>38</u>	BORE		ON	N/0.0	-3.15	<u>192</u>
<u>39</u>	EHS		Parkdale Ave Ottawa ON	E/0.0	-1.15	<u>193</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
<u>40</u>	BORE		ON	NNW/0.0	-3.15	<u>193</u>
<u>41</u>	GEN	Environmental Health Science and Research Bureau	50 Colombine Driveway Ottawa ON K1A 0K9	N/0.0	-3.15	<u>194</u>
<u>42</u>	BORE		ON	E/0.0	-1.15	<u>194</u>
<u>43</u>	GEN	Statistics Canada HSD	251 Sir Frederick Banting Driveway Ottawa ON K1Y 0M1	W/0.0	-1.15	<u>196</u>
<u>43</u>	FRST	Health Canada	251, Sir Frederick Banting Driveway Ottawa ON	W/0.0	-1.15	<u>196</u>
<u>43</u>	FRST	Health Canada	251, Sir Frederick Banting Driveway Ottawa ON	W/0.0	-1.15	<u>198</u>
<u>43</u>	GEN	Statistics Canada CPHD	251 Sir Frederick Banting Ottawa ON K1Y0M1	W/0.0	-1.15	<u>201</u>
<u>44</u>	GEN	CAMECO-CANADIAN MINING & ENERGY CORP	BUILDING #21, TUNNEY'S PASTURE CORNER OF ROSS & DE LA COLOMBINE OTTAWA ON	W/0.0	-1.15	<u>201</u>
<u>45</u>	BORE		ON	ENE/0.0	-2.15	<u>202</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
<u>46</u>	BORE		ON	NNE/0.0	-2.46	<u>203</u>
<u>47</u>	SPL		70 Colombine Driveway Ottawa ON	NNE/0.0	-2.39	<u>204</u>
<u>47</u>	SPL		70 Colombine Driveway Ottawa ON K1A 0K9	NNE/0.0	-2.39	<u>205</u>
<u>47</u>	GEN	BROOKFIELD GLOBAL INTEGRATED SOLUTIONS	70 COLOMBINE DRIVWAY TUNNEY'S PASTURE OTTAWA ON K1A 0K9	NNE/0.0	-2.39	<u>205</u>
<u>48</u>	SPL	BROOKFIELD LEPAGE JOHNSON CONT	PROPERTY MANAGEMENT CO. 120 PARKDALE AVE, SUITE 1401, OTTAWA OTTAWA CITY ON K1A 0K9	ENE/0.0	-2.15	<u>205</u>
<u>48</u>	SPL	STATISTICS CANADA BUILDING	120 PARKDALE AVE 120 PARDALE AVENUE, OTTAWA OTTAWA CITY ON K1A 0K9	ENE/0.0	-2.15	<u>206</u>
<u>48</u>	GEN	GVT. OF CAN.-PUBLIC WORKS OF CAN.	REALTY BRANCH TUNNEY'S PASTURE ASS.BLDG C/O TUNNEY'S PASTURE DBS BLDG RM 1005 OTTAWA-CARLETON ON K1A 0M3	ENE/0.0	-2.15	<u>206</u>
<u>48</u>	GEN	PUBLIC WORKS & GOVERNMENT SERVS. CANADA	ASSORTED BUILDINGS TUNNEY'S PASTURE (FEDERAL COMPLEX) OTTAWA ON K1A 0M3	ENE/0.0	-2.15	<u>207</u>
<u>48</u>	GEN	GVT. OF CAN.-PUBLIC WORKS OF CAN. 18-337	REALTY BRANCH TUNNEY'S PASTURE ASS.BLDG OTTAWA,C/O 1000-38 ANTARES DRIVE NEPEAN ON K1A 0M3	ENE/0.0	-2.15	<u>208</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
<u>48</u>	GEN	PUBLIC WORKS & GOVERNMENT SERVICES CAN.	ASSORTED BUILDING TUNNEY'S PASTURE (FEDERAL COMPLEX) OTTAWA ON K1A 0M3	ENE/0.0	-2.15	<u>208</u>
<u>48</u>	GEN	PUBLIC WORKS CANADA	TUNNEY'S PASTURE - FEDERAL COMPLEX ASSORTED BUILDINGS OTTAWA ON	ENE/0.0	-2.15	<u>209</u>
<u>48</u>	GEN	BROOKFIELD LEPAGE JOHNSON CONTROLS	TUNNEY'S PASTURE FEDERAL COMPLEX ASSORTED BUILDINGS OTTAWA ON	ENE/0.0	-2.15	<u>210</u>
<u>48</u>	SCT	Statistics Canada	120 Parkdale Ave Ottawa ON K1A 0K9	ENE/0.0	-2.15	<u>211</u>
<u>48</u>	GEN	Public Works and Government Services Canada	120 Parkdale, Tunneys Pasture, Various Buildings Ottawa ON K1A 1B4	ENE/0.0	-2.15	<u>211</u>
<u>48</u>	GEN	Public Works and Government Services	120 Parkdale Ottawa ON K1A 1B4	ENE/0.0	-2.15	<u>212</u>
<u>48</u>	SPL		120 Parkdale Avenue Ottawa ON K1A 1K6	ENE/0.0	-2.15	<u>213</u>
<u>48</u>	GEN	Public Works and Government Services Canada	120 Parkdale, Tunneys Pasture, Various Buildings Ottawa ON K1A 1K6	ENE/0.0	-2.15	<u>213</u>
<u>48</u>	GEN	Public Works and Government Services	120 Parkdale Ottawa ON K1A 1B4	ENE/0.0	-2.15	<u>214</u>
<u>48</u>	GEN	Public Works and Government Services Canada	120 Parkdale, Tunneys Pasture, Various Buildings Ottawa ON K1A 1K6	ENE/0.0	-2.15	<u>215</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
<u>48</u>	GEN	Public Works and Government Services Canada	120 Parkdale, Tunneys Pasture, Various Buildings Ottawa ON K1A 1K6	ENE/0.0	-2.15	<u>216</u>
<u>48</u>	GEN	SNC LAVALIN O & M	120 PARKDALE AVENUE VARIOUS BUILDINGS OTTAWA ON	ENE/0.0	-2.15	<u>217</u>
<u>48</u>	GEN	Public Works and Government Services Canada	120 Parkdale, Tunneys Pasture, Various Buildings Ottawa ON K1A 1K6	ENE/0.0	-2.15	<u>217</u>
<u>48</u>	NPRI	SNC-LAVALIN PROFAC	120 Parkdale Avenue Ottawa ON K1A6T6	ENE/0.0	-2.15	<u>218</u>
<u>48</u>	GEN	SNC LAVALIN O & M	120 PARKDALE AVENUE VARIOUS BUILDINGS OTTAWA ON	ENE/0.0	-2.15	<u>219</u>
<u>48</u>	GEN	Public Works and Government Services Canada	120 Parkdale, Tunneys Pasture, Various Buildings Ottawa ON	ENE/0.0	-2.15	<u>220</u>
<u>48</u>	GEN	Public Works and Government Services Canada	120 Parkdale, Tunneys Pasture, Various Buildings Ottawa ON K1A 0K9	ENE/0.0	-2.15	<u>221</u>
<u>48</u>	GEN	Public Works and Government Services Canada	120 Parkdale, Tunneys Pasture, Various Buildings Ottawa ON K1A 0K9	ENE/0.0	-2.15	<u>222</u>
<u>48</u>	GEN	Public Works and Government Services Canada	120 Parkdale, Tunneys Pasture, Various Buildings Ottawa ON K1A 0K9	ENE/0.0	-2.15	<u>223</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
<u>48</u>	GEN	Public Services & Procurement Canada ESD/AFD	120 Parkdale, Ottawa ON K1A 0K9	ENE/0.0	-2.15	<u>224</u>
<u>48</u>	GEN	Public Services & Procurement Canada ESD/AFD	120 Parkdale, Ottawa ON K1A 0K9	ENE/0.0	-2.15	<u>226</u>
<u>48</u>	GEN	Public Services & Procurement Canada ESD/AFD	120 Parkdale, Ottawa ON K1A 0K9	ENE/0.0	-2.15	<u>227</u>
<u>48</u>	GEN	Public Services & Procurement Canada ESD/AFD	120 Parkdale, Ottawa ON K1A 0K9	ENE/0.0	-2.15	<u>229</u>
<u>49</u>	BORE		ON	NE/0.0	-3.15	<u>230</u>
<u>50</u>	WWIS		50 COLOMBINE DRIVEWAY Ottawa ON <i>Well ID:</i> 7240370	NE/0.0	-3.15	<u>232</u>
<u>51</u>	FCS	Environmental Health Centre	Ottawa ON	NE/0.0	-3.15	<u>235</u>
<u>52</u>	WWIS		50 COLOMBINE DRIVEWAY Ottawa ON <i>Well ID:</i> 7240369	NE/0.0	-3.15	<u>239</u>
<u>53</u>	WWIS		50 COLOMBINE DRIVEWAY Ottawa ON <i>Well ID:</i> 7240372	NNE/0.0	-3.15	<u>242</u>
<u>54</u>	WWIS		50 COLOMBINE DRIVEWAY Ottawa ON	NE/0.0	-3.15	<u>245</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
			Well ID: 7240371			
55	WWIS		50 COLOMBINE DRIVEWAY Ottawa ON	NE/0.0	-3.15	247
			Well ID: 7240373			
56	BORE		ON	NNE/0.0	-3.15	250

Executive Summary: Site Report Summary - Surrounding Properties

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
57	SPL	OC Transit (City of Ottawa) <UNOFFICIAL>	1611 Scott St.<UNOFFICIAL> Ottawa ON	ESE/5.0	-1.15	252
57	CA	City of Ottawa	1611 Scott Street Ottawa ON	ESE/5.0	-1.15	252
57	GEN	OLRT Constructors/Dragados/EllisDon Corp	1611 Scott Street - Tunney's Pasture Station Ottawa ON K1Y 2N5	ESE/5.0	-1.15	252
57	GEN	OC Transpo	1611 Scott Street Ottawa ON K1Y 4W2	ESE/5.0	-1.15	253
57	GEN	OLRT Constructors/Dragados/EllisDon Corp	1611 Scott Street - Tunney's Pasture Station Ottawa ON K1Y 2N5	ESE/5.0	-1.15	253
57	SPL		1611 Scott St Ottawa ON	ESE/5.0	-1.15	253
58	ECA	City of Ottawa	1565 Scott St Ottawa ON K2G 6J8	S/6.9	1.85	254
59	WWIS		SCOTT ST Ottawa ON Well ID: 7119009	ESE/7.9	-1.15	254
60	CA	City of Ottawa	Emmerson Avenue and Parkdale Avenue Ottawa ON	NE/9.3	-3.46	257
60	ECA	City of Ottawa	Emmerson Avenue and Parkdale Ave Ottawa ON K1S 5K2	NE/9.3	-3.46	257
60	ECA	City of Ottawa	Emmerson Avenue and Parkdale Ave Ottawa ON K1S 5K2	NE/9.3	-3.46	257
61	BORE		ON	E/13.4	-1.15	258

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
62	EHS		131 PARKDALE AVENUE OTTAWA ON K1Y 1E7	ENE/18.4	-2.15	259
63	SPL		Scott Street and Parkdale Avenue Ottawa ON	E/20.5	-1.15	259
64	EHS		99 Parkdale Avenue Ottawa ON K1Y 1E6	NE/20.8	-2.72	259
65	WWIS		SCOTTS & CAROLINE AVENUE Ottawa ON <i>Well ID:</i> 7253089	SSE/21.5	0.85	259
66	EHS		101 Parkdale Avenue Ottawa ON K1Y 1E6	NE/22.3	-2.12	261
67	ECA	8609454 Canada Inc.	121 Parkdale Ave Ottawa ON K1J 7S6	ENE/22.6	-2.15	262
67	EHS		121 Parkdale Ave Ottawa ON K1Y2M3	ENE/22.6	-2.15	262
67	SPL	Enbridge Gas Distribution Inc.	121 Parkdale Ave Ottawa ON	ENE/22.6	-2.15	262
67	PINC	ENBRIDGE GAS INC	121 PARKDALE AVE,,OTTAWA,ON,K1Y 1E6,CA ON	ENE/22.6	-2.15	263
67	EHS		121 Parkdale Avenue Ottawa ON K1Y 1E6	ENE/22.6	-2.15	263
68	SPL		1565 Scott Street Ottawa ON	ESE/23.4	-1.15	263
69	PTTW	Les Constructions Brigil Inc.	99 Parkdale Avenue Ottawa, ON K1Y1E6 Canada ON	NE/24.3	-2.12	264

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
70	BORE		ON	SSW/25.6	1.85	264
71	SPL	OC TRANSP	OC TRANSIT WAY, AT SCOTT & HOLLAND STREETS, TUNNEY'S PASTURE MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON	ESE/26.4	-1.15	267
72	SPL	R.W. Tomlinson Limited	Scott St. at Holland Ave Ottawa ON	ESE/26.4	-1.15	267
73	SPL		Ottawa ON	ESE/26.7	-1.15	268
74	EHS		1560 Scott Street Ottawa ON K1Y 2N5	ESE/26.8	-1.15	268
75	PTTW	Richcraft (Parkdale) Ltd.	159, 163 and 167 Parkdale Avenue Ottawa, ON Canada ON	ENE/27.5	-2.15	268
76	SPL		Ottawa ON	ESE/27.5	-1.15	269
77	EHS		139 Parkdale Avenue Ottawa ON K1Y 1E7	ENE/28.0	-2.15	269
78	ECA	Richcraft (Parkdale) Ltd.	ON	ENE/28.9	-2.15	269
79	EHS		159 - 167 Parkdale Avenue Ottawa ON K1Y 1E7	ENE/30.5	-2.15	270
80	PINC	PIPELINE HIT 1/2"	203 NORTHWESTERN AVE.,OTTAWA, ON,K1Y 0M1,CA ON	WSW/31.5	-0.69	270
80	EHS		203 Northwestern Ave Ottawa ON K1Y0M1	WSW/31.5	-0.69	270

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>81</u>	EHS		203 Northwestern Ave Ottawa ON K1Y0M1	WSW/31.6	-0.69	<u>271</u>
<u>82</u>	EHS		131 Parkdale Ave Ottawa ON K1Y1E7	ENE/33.5	-2.15	<u>271</u>
<u>83</u>	PINC	PIPELINE HIT 1/2"	155 NORTHWESTERN AVE,,OTTAWA, ON,K1Y 0M1,CA ON	W/34.1	-2.15	<u>271</u>
<u>83</u>	PINC	PIPELINE HIT - 1/2"	155 NORTHWESTERN AVE,,OTTAWA, ON,K1Y 0M1,CA ON	W/34.1	-2.15	<u>271</u>
<u>84</u>	EASR	RICHCRAFT (PARKDALE) LTD.	163 Parkdale Avenue Ottawa ON K1Y 1E7	ENE/34.1	-2.15	<u>272</u>
<u>85</u>	BORE		ON	SW/34.8	0.85	<u>272</u>
<u>86</u>	EHS		Ottawa Ottawa ON	NE/37.5	-2.15	<u>273</u>
<u>87</u>	SPL	Enbridge Energy Distribution Inc.	153 Northwestern Avenue Ottawa ON	W/40.1	-2.15	<u>274</u>
<u>87</u>	PINC	ENBRIDGE GAS INC	153 NORTHWESTERN AVE,,OTTAWA, ON,K1Y 0M1,CA ON	W/40.1	-2.15	<u>274</u>
<u>88</u>	EHS		2 Holland Ave Ottawa ON K1Y0X4	SE/41.8	-1.15	<u>275</u>
<u>89</u>	WWIS		111 PARKDALE AVENUE 121 Ottawa ON Well ID: 7205866	ENE/43.1	-2.15	<u>275</u>
<u>90</u>	EHS		99-107 Parkdale Avenue (odd numbers only) Ottawa ON	NE/44.4	-2.13	<u>278</u>
<u>91</u>	EHS		1546 Scott Street Ottawa ON K1Y 4S8	ESE/52.4	-1.15	<u>278</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
91	EHS		1546 Scott Street Ottawa ON K1Y 4S8	ESE/52.4	-1.15	278
91	EHS		1546 Scott Street Ottawa ON K1Y 4S8	ESE/52.4	-1.15	278
91	EHS		1546 Scott Street Ottawa ON K1Y 4S8	ESE/52.4	-1.15	279
92	SCT	Westrade Construction Ltd.	4 Holland Ave Unit 1B Ottawa ON K1Y 0X4	SE/53.4	-1.15	279
93	WWIS		ON Well ID: 7358345	ESE/54.7	-1.15	279
94	EASR	KIEWIT/EUROVIA/VINCI OTTAWA PARTNERSHIP	ON	S/54.8	1.85	280
95	GEN	The Ottawa Muslim Association	251 NorthWestern Avenue Ottawa ON K1Y0M1	SW/57.2	0.88	280
96	EHS		255 Parkdale Avenue Ottawa ON K1Y 1G1	E/57.3	-1.15	281
97	PES	OTTAWA & DIST ASSOC FOR THE MENTALLYRETARDED	55 PARKDALE AVENUE NORTH OTTAWA ON K2H 8H8	NE/62.9	-4.81	281
98	GEN	CAPITAL CITY RUSTPROOFING LIMITED	1536 SCOTT STREET OTTAWA ON K1Y 2N5	ESE/68.6	-1.15	281
98	GEN	CAPITAL CITY (OUT OF BUSINESS) 08-793	1536 SCOTT STREET OTTAWA ON K1Y 2N5	ESE/68.6	-1.15	282
99	GEN	FRANK & SONS PAINTING & DECORATING LTD.	184 FORWARD AVENUE OTTAWA ON K1Y 1L2	E/68.7	-2.15	282
99	GEN	FRANK & SONS PAINTING & DECORATING LTD.	184 FORWARD AVENUE OTTAWA ON K1Y 1L2	E/68.7	-2.15	282

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
99	GEN	FRANK & SONS PAINTING & DECORATING LTD.	184 FORWARD AVENUE OTTAWA ON K1Y 1L2	E/68.7	-2.15	282
100	EHS		192 Forward Ave Ottawa ON K1Y1E8	E/69.3	-2.15	283
101	GEN	CCC384	44 EMMERSON AVE OTTAWA ON K1Y 2L8	NE/74.5	-3.18	283
102	SPL	PRIVATE OWNER	259 PARKDALE AVE. STORAGE TANK/BARREL OTTAWA CITY ON K1Y 1G1	E/75.2	-1.15	283
103	WWIS		ON Well ID: 7358344	ESE/78.2	-1.15	284
104	SPL		1748 Scott St Ottawa ON	SSW/79.5	1.85	284
104	PINC	ENBRIDGE GAS INC	1748 SCOTT ST,,OTTAWA,ON,K1Y 2N6, CA ON	SSW/79.5	1.85	285
105	SPL	OLRT Constructors	1446 Scott Street Ottawa ON	E/85.1	-1.84	285
105	GEN	Royal LePage	1446 Scott Street Ottawa ON K1Y 1L7	E/85.1	-1.84	286
106	SPL		Sir John A Mcdonald Pkwy W and Parkdale Ottawa ON	NNE/89.1	-6.88	286
107	ECA	City of Ottawa	Forward Avenue, Lyndale Avenue and Hinchey Avenue Ottawa ON K1N 5A1	E/90.2	-2.15	287
108	CA	OTTAWA CITY	PINEHURST AVE./SCOTT ST. OTTAWA ON	E/90.7	-1.84	287

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>109</u>	SPL		234 Northwestern Ave Ottawa ON K1Y 0M3	SW/95.5	-0.07	<u>287</u>
<u>110</u>	EHS		11 & 25 Holland Avenue and 1600 & 1620 Scott Street Ottawa ON	ESE/99.3	-1.15	<u>288</u>
<u>111</u>	EHS		187 Forward Avenue Ottawa ON K1Y 1L2	E/99.3	-2.15	<u>288</u>
<u>112</u>	HINC		18 PONTIAC STREET OTTAWA ON K1Y 2J9	W/99.4	-3.21	<u>288</u>
<u>113</u>	EHS		268-272 Parkdale Avenue Ottawa, ON ON K1Y 1E9	ESE/101.7	-1.15	<u>289</u>
<u>114</u>	SCT	iStudio Ottawa	11 Holland Ave Suite 715 Ottawa ON K1Y 4S1	ESE/102.4	-1.15	<u>289</u>
<u>114</u>	GEN	COLONNADE DEVELOPMENTS INC.	11 HOLLAND AVENUE Ottawa ON K1Y 4S1	ESE/102.4	-1.15	<u>289</u>
<u>114</u>	GEN	Hetz Medicine Professional Corporation	11 Holland Ave Suite 400 Ottawa ON K1Y 4S1	ESE/102.4	-1.15	<u>289</u>
<u>114</u>	GEN	Hetz Medicine Professional Corporation	11 Holland Ave Suite 400 Ottawa ON K1Y 4S1	ESE/102.4	-1.15	<u>290</u>
<u>114</u>	GEN	ITF CJPT Real Estate No. 1 Trust	11 Holland Ave. Ottawa ON K1Y 4S1	ESE/102.4	-1.15	<u>290</u>
<u>114</u>	GEN	Hetz Medicine Professional Corporation	11 Holland Ave Suite 400 Ottawa ON K1Y 4S1	ESE/102.4	-1.15	<u>290</u>
<u>115</u>	EHS		159 Forward Avenue Ottawa ON K1Y 1K9	ENE/104.1	-2.15	<u>290</u>
<u>116</u>	WWIS		ON Well ID: 1508589	SW/105.1	-0.21	<u>291</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>117</u>	GEN	ARISTOTEC GENERATOR SERVICES INC	13A BULLMAN ST. OTTAWA ON K1Y 2S2	ESE/106.0	-1.15	<u>293</u>
<u>117</u>	GEN	ARISTOTEC (OUT OF BUSINESS)	13A BULLMAN ST. OTTAWA ON K1Y 2S2	ESE/106.0	-1.15	<u>293</u>
<u>117</u>	GEN	ARISTOTEC (OUT OF BUSINESS) 03-269	13A BULLMAN ST. OTTAWA ON K1Y 2S2	ESE/106.0	-1.15	<u>293</u>
<u>117</u>	GEN	CARRIAGE HOUSE RESTORATION & ANTIQUES	13A BULLMAN OTTAWA ON K1Y 2S2	ESE/106.0	-1.15	<u>294</u>
<u>117</u>	GEN	2021694	13 bullman street ottawa ON K1Y 2S2	ESE/106.0	-1.15	<u>294</u>
<u>117</u>	GEN	2021694	13 bullman street ottawa ON K1Y 2S2	ESE/106.0	-1.15	<u>294</u>
<u>118</u>	EHS		133 Forward Avenue Ottawa ON K1Y 1K8	ENE/108.2	-1.15	<u>294</u>
<u>119</u>	SPL	Petro-Canada Fuels Inc.	36 Ross Street Ottawa ON K1Y 0N3	SSW/108.9	2.85	<u>295</u>
<u>119</u>	HINC		36 ROSS AVENUE OTTAWA ON K1Y 0N3	SSW/108.9	2.85	<u>295</u>
<u>120</u>	ECA	City of Ottawa	Forward Avenue, Lyndale Avenue and Hinchey Avenue Ottawa ON K1N 5A1	ENE/110.5	-1.15	<u>296</u>
<u>121</u>	BORE		ON	NNE/110.8	-6.76	<u>296</u>
<u>122</u>	GEN	Golder Associates Ltd.	159 Forward Ave. Ottawa ON K1Y 1K9	ENE/114.3	-2.15	<u>297</u>
<u>123</u>	EHS		61 Pinehurst Avenue Ottawa ON K1Y 1K5	E/121.6	-1.46	<u>297</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>124</u>	WWIS		_59 Forward Ave Ottawa ON Well ID: 7342420	ENE/122.4	-1.46	<u>297</u>
<u>125</u>	GEN	PHARMA PLUS DRUGS LTD	1620 SCOTT STREET UNIT 29 OTTAWA ON K1Y 4S7	ESE/123.7	-0.58	<u>301</u>
<u>125</u>	GEN	PHARMA PLUS DRUGS LTD. 31-660	1620 SCOTT STREET, UNIT 29, OTTAWA C/O 5935 AIRPORT ROAD STE. 500 MISSISSAUGA ON K1Y 4S7	ESE/123.7	-0.58	<u>301</u>
<u>125</u>	GEN	PHARMA PLUS DRUGS LTD.	1620 SCOTT STREET UNIT 29 OTTAWA ON K1Y 4S7	ESE/123.7	-0.58	<u>301</u>
<u>125</u>	GEN	PHARMA PLUS DRUGS LTD.	1620 SCOTT STREET, UNIT 29 OTTAWA ON K1Y 4S7	ESE/123.7	-0.58	<u>301</u>
<u>125</u>	EHS		1620 Scott Street Ottawa ON K1Y 4S7	ESE/123.7	-0.58	<u>302</u>
<u>125</u>	GEN	Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	ESE/123.7	-0.58	<u>302</u>
<u>125</u>	GEN	Rexall Pharmacy Group Ltd.	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	ESE/123.7	-0.58	<u>302</u>
<u>125</u>	GEN	Pharma Plus Drugmarts Ltd	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	ESE/123.7	-0.58	<u>303</u>
<u>125</u>	GEN	Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	ESE/123.7	-0.58	<u>303</u>
<u>125</u>	GEN	Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	ESE/123.7	-0.58	<u>303</u>
<u>125</u>	GEN	Pharma Plus Drugmarts Ltd	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	ESE/123.7	-0.58	<u>303</u>
<u>125</u>	GEN	Rexall Pharmacy Group Ltd.	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	ESE/123.7	-0.58	<u>304</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>125</u>	GEN	Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	ESE/123.7	-0.58	<u>304</u>
<u>125</u>	GEN	Rexall Pharmacy Group Ltd.	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	ESE/123.7	-0.58	<u>304</u>
<u>125</u>	GEN	Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	ESE/123.7	-0.58	<u>305</u>
<u>125</u>	GEN	Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	ESE/123.7	-0.58	<u>305</u>
<u>125</u>	GEN	Rexall Pharmacy Group Ltd.	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	ESE/123.7	-0.58	<u>305</u>
<u>125</u>	GEN	Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	ESE/123.7	-0.58	<u>306</u>
<u>125</u>	GEN	Rexall Pharmacy Group Ltd.	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	ESE/123.7	-0.58	<u>306</u>
<u>126</u>	SCT	Domtar Inc.	1600 Scott St Ottawa ON K1Y 4N7	ESE/125.4	-0.15	<u>306</u>
<u>126</u>	SCT	E.B. EDDY FOREST PRODUCTS LTD.	1600 SCOTT ST FLOOR 7 OTTAWA ON K1Y 4N7	ESE/125.4	-0.15	<u>306</u>
<u>126</u>	GEN	Colonnade Development Inc.	1600 Scott St Ottawa ON	ESE/125.4	-0.15	<u>307</u>
<u>127</u>	SPL		23 Clearview Avenue Ottawa ON	WSW/134.0	-3.15	<u>307</u>
<u>128</u>	CA	City of Ottawa	Hamilton Avenue and Bullman Street Ottawa ON	ESE/134.6	-0.15	<u>308</u>
<u>128</u>	ECA	City of Ottawa	Hamilton Avenue and Bullman Street Ottawa ON K2G 6J8	ESE/134.6	-0.15	<u>308</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>129</u>	SPL	Enbridge Energy Distribution Inc.	123 Carleton Ave Ottawa ON	W/135.2	-3.46	<u>308</u>
<u>129</u>	PINC	ENBRIDGE GAS INC	123 CARLETON AVE,,OTTAWA,ON,K1Y 0J2,CA ON	W/135.2	-3.46	<u>309</u>
<u>130</u>	SPL		50 Burnside Ave Ottawa ON	ENE/136.7	-1.15	<u>309</u>
<u>131</u>	SPL	PRIVATE RESIDENCE	RESIDENCE AT 50 PINEHURST OWNED BY MR. MCCARTHY (722-7298) FURNACE OIL TANK OTTAWA CITY ON K1Y 1K4	ESE/140.0	-1.15	<u>310</u>
<u>132</u>	EHS		PE4962: 30, 34 and 40 Holland Ave, Ottawa ON Ottawa ON K1Y 0X4	SE/141.2	-0.15	<u>310</u>
<u>133</u>	PRT	LEONES SERVICE CENTRE LTD	1480 SCOTT ST OTTAWA ON K1Y2N4	E/141.5	-2.15	<u>310</u>
<u>133</u>	FSTH	LEONES SERVICE CENTRE LTD	1480 SCOTT ST OTTAWA ON K1Y 2N4	E/141.5	-2.15	<u>311</u>
<u>133</u>	RST	LEONE'S SERVICE CENTRE LTD	1480 SCOTT ST OTTAWA ON K1Y 2N4	E/141.5	-2.15	<u>311</u>
<u>133</u>	FSTH	LEONES SERVICE CENTRE LTD	1480 SCOTT ST OTTAWA ON K1Y 2N4	E/141.5	-2.15	<u>311</u>
<u>133</u>	DTNK	M & N AUTO CENTRE LTD	1484 SCOTT ST OTTAWA ON	E/141.5	-2.15	<u>312</u>
<u>133</u>	GEN	CAROLE RAYMOND	1484A SCOTT ST., OTTAWA ON K1Y 2N4	E/141.5	-2.15	<u>312</u>
<u>133</u>	GEN	Leone's Service Centre Ltd.	1480 Scott St, ottawa ON	E/141.5	-2.15	<u>313</u>
<u>133</u>	RST	LEONE'S SERVICE CENTRE LTD	1480 SCOTT ST OTTAWA ON K1Y2N4	E/141.5	-2.15	<u>313</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
133	GEN	Leone's Service Centre Ltd.	1480 Scott St, ottawa ON K1Y 2N4	E/141.5	-2.15	313
134	SPL	PRIVATE RESIDENCE	AT RESIDENCE AT 154 HINCHY AVE. FURNACE OIL TANK OTTAWA CITY ON	ENE/148.8	-2.15	313
135	CA	OTTAWA CITY	CARLETON AVE/PREMIER AVE. OTTAWA CITY ON	SW/151.8	0.65	314
135	CA	OTTAWA CITY	CARLETON AVE/PREMIER AVE. OTTAWA CITY ON	SW/151.8	0.65	314
136	EASR	Pomerleau Inc	105 Sir John A MacDonald PKY OTTAWA ON K1A 0M8	NE/152.4	-8.33	314
136	GEN	Pomerleau Inc.	105 Sir John A. Macdonald Parkway Ottawa ON K1A 0N4	NE/152.4	-8.33	315
136	GEN	Pomerleau Inc.	105 Sir John A. Macdonald Parkway Ottawa ON K1A 0N4	NE/152.4	-8.33	315
137	DTNK	LEONES SERVICE CENTRE LTD	1480 SCOTT ST OTTAWA K1Y 2N4 ON CA ON	E/152.7	-2.15	315
137	DTNK	LEONES SERVICE CENTRE LTD	1480 SCOTT ST OTTAWA K1Y 2N4 ON CA ON	E/152.7	-2.15	316
137	DTNK	LEONES SERVICE CENTRE LTD	1480 SCOTT ST OTTAWA K1Y 2N4 ON CA ON	E/152.7	-2.15	316
137	FST	LEONES SERVICE CENTRE LTD	1480 SCOTT ST OTTAWA K1Y 2N4 ON CA ON	E/152.7	-2.15	317
137	FST	LEONES SERVICE CENTRE LTD	1480 SCOTT ST OTTAWA K1Y 2N4 ON CA ON	E/152.7	-2.15	318

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>137</u>	FST	LEONES SERVICE CENTRE LTD	1480 SCOTT ST OTTAWA K1Y 2N4 ON CA ON	E/152.7	-2.15	<u>318</u>
<u>138</u>	EHS		1 Hamilton Avenue North ottawa ON K1Y 1B5	ESE/154.6	-0.15	<u>319</u>
<u>138</u>	GEN	ONTARIO PETROLEUM PUMP	1 HAMILTON AVE N OTTAWA ON K1Y 1B5	ESE/154.6	-0.15	<u>319</u>
<u>139</u>	PES	DANIEL C BAKER	921-100 HINCHEY AVENUE OTTAWA ON K1Y 4L9	ENE/154.7	-1.15	<u>319</u>
<u>139</u>	PES	DANIEL BAKER	100 HINCHEY AVE; #921 OTTAWA ON K1Y4L9	ENE/154.7	-1.15	<u>319</u>
<u>140</u>	PINC	PIPELINE HIT 0.5"	164 CARLETON AVE,,OTTAWA,ON,K1Y 0J3,CA ON	WSW/165.8	-3.14	<u>320</u>
<u>141</u>	CA	OTTAWA CITY	HINCHEY AVE./SCOTT ST. OTTAWA CITY ON	E/167.0	-2.15	<u>320</u>
<u>141</u>	CA	R.M. OF OTTAWA-CARLETON	HINCHEY AVE./SCOTT ST. OTTAWA CITY ON	E/167.0	-2.15	<u>321</u>
<u>141</u>	SPL	City of Ottawa	NW corner of Scott Street and Hinchey Ave Ottawa ON	E/167.0	-2.15	<u>321</u>
<u>142</u>	CA	OTTAWA CITY - PARKDALE AVENUE	BULLMAN ST./PINEHURST ST. OTTAWA CITY ON	ESE/168.3	-1.15	<u>321</u>
<u>142</u>	CA	OTTAWA CITY - HINCHEY STREET	BULLMAN ST./PINEHURST ST. OTTAWA CITY ON	ESE/168.3	-1.15	<u>322</u>
<u>143</u>	CA	OTTAWA CITY	BURNSIDE AVE./HINCHEY AVE. OTTAWA CITY ON	ENE/170.3	-1.15	<u>322</u>
<u>144</u>	SPL	PRIVATE RESIDENCE	252 HENCHEY FURNACE OIL TANK OTTAWA CITY ON	E/172.2	-2.23	<u>322</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
144	EHS		250-252 Hinchey Avenue Ottawa ON K1Y 1L8	E/172.2	-2.23	323
145	SPL	PRIVATE OWNER	AT RESIDENCE AT 184 CARLETON AVE. STORAGE TANK/BARREL OTTAWA CITY ON K1Y 0J3	WSW/178.3	-3.13	323
146	PINC	JEANNINE T KNIGHTON	47 GILCHRIST AVE.,OTTAWA,ON,K1Y 0M7,CA ON	SSW/183.4	3.85	323
146	SPL	Enbridge Gas Distribution Inc.	47 Gilchrest Avenue Ottawa ON	SSW/183.4	3.85	324
147	SCT	M O M PRINTING	300 PARKDALE AVE OTTAWA ON K1Y 1G2	ESE/183.9	-0.15	324
147	SCT	ST-JOSEPH M.O.M. PRINTING	300 Parkdale Ave Ottawa ON K1Y 1G2	ESE/183.9	-0.15	325
147	GEN	M.O.M. PRINTING	300 PARKDALE AVENUE OTTAWA ON K1Y 1G2	ESE/183.9	-0.15	325
147	GEN	M.O.M. PRINTING	300 PARKDALE AVENUE OTTAWA ON K1Y 1G2	ESE/183.9	-0.15	325
147	GEN	M.O.M. PRINTING 25-205	300 PARKDALE AVENUE OTTAWA ON K1Y 1G2	ESE/183.9	-0.15	326
147	GEN	M.O.M. PRINTING	300 Parkdale Ave Ottawa ON K1Y 1G2	ESE/183.9	-0.15	326
147	GEN	Scintrex Trace Crop.	300 Parkdale Ave. Ottawa ON K1Y 1G2	ESE/183.9	-0.15	327
147	SCT	Scintrex Trace Corp.	300 Parkdale Ave Ottawa ON K1Y 1G2	ESE/183.9	-0.15	327

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>147</u>	EHS		300 Parkdale Avenue Ottawa ON K1Y 1G2	ESE/183.9	-0.15	<u>327</u>
<u>147</u>	GEN	Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	ESE/183.9	-0.15	<u>327</u>
<u>147</u>	GEN	Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	ESE/183.9	-0.15	<u>328</u>
<u>147</u>	GEN	Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	ESE/183.9	-0.15	<u>328</u>
<u>147</u>	GEN	Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	ESE/183.9	-0.15	<u>329</u>
<u>147</u>	GEN	Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	ESE/183.9	-0.15	<u>329</u>
<u>147</u>	GEN	Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	ESE/183.9	-0.15	<u>330</u>
<u>147</u>	GEN	Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	ESE/183.9	-0.15	<u>330</u>
<u>147</u>	GEN	Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	ESE/183.9	-0.15	<u>331</u>
<u>147</u>	GEN	Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	ESE/183.9	-0.15	<u>332</u>
<u>147</u>	SPL	Waste Connections of Canada Inc. as general partner for and on behalf of Ridge	(Chatham) Holdings L.P. 300 Parkdale Ave Ottawa ON	ESE/183.9	-0.15	<u>332</u>
<u>147</u>	GEN	Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	ESE/183.9	-0.15	<u>333</u>
<u>148</u>	EHS		161 Hinchey Ave Ottawa ON K1Y 1L5	ENE/185.8	-2.15	<u>333</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>149</u>	EHS		161 Hinchey Ave Ottawa Ontario Ottawa ON K1Y 1L5	ENE/185.9	-2.15	<u>334</u>
<u>150</u>	SPL	PRIVATE RESIDENCE	185 HINCHEY AVE. FURNACE OIL TANK OTTAWA CITY ON K1Y 1L6	E/188.8	-2.47	<u>334</u>
<u>150</u>	SPL	PRIVATE RESIDENCE	185 HINCHEY FURNACE OIL TANK OTTAWA CITY ON K1Y 1L6	E/188.8	-2.47	<u>334</u>
<u>151</u>	DTNK	KEVIN WEIR	7728 36/37 CLEARVIEW TOWNSHIP NOTTAWA L0M 1P0 ON CA ON	WSW/189.7	-4.20	<u>335</u>
<u>152</u>	PINC	GUANGZHOU TRISTATE INDUSTRIAL CO LTD	64 SMIRLE AVE,,OTTAWA,ON,K1Y 0S1, CA ON	S/192.9	2.85	<u>335</u>
<u>152</u>	SPL		64 Smirle Ave Ottawa ON	S/192.9	2.85	<u>336</u>
<u>153</u>	EHS		140 Carleton Avenue Ottawa ON K1Y	W/196.8	-4.10	<u>336</u>
<u>154</u>	ECA	Ali Tohidi and Farzin Fararooni	40 Sunnymede Ave Ottawa ON K2J 4N4	SW/199.1	-1.14	<u>337</u>
<u>155</u>	WWIS		ON Well ID: 7357175	E/200.9	-2.15	<u>337</u>
<u>156</u>	PTTW	Canada Lands Company CLC Limited	Lot: 21-25, Concession: 1 on Ottawa River, Geographic Township: GLOUCESTER, Ottawa, City CITY OF OTTAWA ON	NE/202.8	-8.88	<u>338</u>
<u>157</u>	GEN	quality building services	213 cowley ave ottawa ON K1Y 0G8	WSW/202.9	-2.12	<u>338</u>
<u>158</u>	WWIS		172 CARRUTHERS ST. ON Well ID: 7145161	E/203.1	-2.15	<u>338</u>
<u>159</u>	GEN	Hydro One Networks Inc.	Hinchey TS 172 Carruthers Avenue Ottawa ON	E/206.7	-2.15	<u>341</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
159	GEN	Hydro One Networks Inc.	Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON	E/206.7	-2.15	342
159	GEN	Hydro One Networks Inc.	Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON	E/206.7	-2.15	342
159	GEN	Hydro One Networks Inc.	Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON	E/206.7	-2.15	343
159	GEN	Hydro One Networks Inc.	Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON	E/206.7	-2.15	343
159	GEN	Hydro One Networks Inc.	Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON	E/206.7	-2.15	344
159	EBR	Hydro One Networks Inc.	172 Carruthers Street Ottawa K1Y 1N7 CITY OF OTTAWA ON	E/206.7	-2.15	344
159	ECA	Hydro One Networks Inc.	172 Carruthers St Ottawa ON K1Y1N7	E/206.7	-2.15	344
159	ECA	Hydro One Networks Inc.	172 Carruthers St Ottawa ON M5G 2P5	E/206.7	-2.15	345
159	GEN	Hydro One Networks Inc.	Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON K1Y 1N7	E/206.7	-2.15	345
159	GEN	Hydro One Networks Inc.	Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON K1Y 1N7	E/206.7	-2.15	345
159	GEN	Hydro One Networks Inc.	Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON K1Y 1N7	E/206.7	-2.15	346
159	GEN	Hydro One Networks Inc.	Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON K1Y 1N7	E/206.7	-2.15	346

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
159	GEN	Hydro One Networks Inc.	Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON K1Y 1N7	E/206.7	-2.15	347
159	GEN	Hydro One Networks Inc.	Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON K1Y 1N7	E/206.7	-2.15	347
160	WWIS		ON Well ID: 7122598	ESE/208.9	-0.15	348
161	PINC	ENBRIDGE GAS INC	1786 SCOTT ST,,OTTAWA,ON,K1Y 2N7, CA ON	SW/213.2	1.91	348
162	WWIS		ON Well ID: 7211100	E/214.9	-2.15	349
163	PINC		66 Ross Avenue, Ottawa ON	S/218.3	3.85	350
164	SPL	S. 21(1)(f)	58 Carruthers Avenue Ottawa ON K1Y 1N2	ENE/218.4	-2.15	350
164	HINC		58 CARRUTHERS AVENUE OTTAWA ON K1Y 1N2	ENE/218.4	-2.15	351
165	PINC	RUFUS O RAMBHARACK	67 SMIRLE AVE,,OTTAWA,ON,K1Y 0S2, CA ON	SSE/219.9	1.79	351
165	SPL		67 Smirle Ave Ottawa ON	SSE/219.9	1.79	352
166	WWIS		52 CARRUTHERS AVE Ottawa ON Well ID: 7201623	ENE/221.2	-2.15	352
167	SPL		56 Carruthers Avenue Ottawa ON K1Y 1N2	ENE/222.4	-2.15	355

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>167</u>	HINC		56 CARRUTHERS AVENUE OTTAWA ON K1Y 1N2	ENE/222.4	-2.15	<u>356</u>
<u>168</u>	SPL	PRIVATE RESIDENCE	20 PINEHURST AVE. FURNACE OIL TANK OTTAWA CITY ON K1Y 1K3	ESE/223.7	-1.08	<u>356</u>
<u>169</u>	PINC	OTTAWA GREENBELT CONSTRUCTION LTD	74 CAROLINE AVE.,OTTAWA,ON,K1Y 0S7,CA ON	SSE/224.9	1.84	<u>356</u>
<u>169</u>	SPL	Enbridge Gas Distribution Inc.	74 Caroline Ave. Ottawa ON	SSE/224.9	1.84	<u>357</u>
<u>170</u>	GEN	JOHANNES POTHUMA	80 CARRUTHERS AVE. OTTAWA ON K1Y 1N2	ENE/224.9	-3.15	<u>357</u>
<u>170</u>	GEN	JOHANNES POTHUMA 22-285	80 CARRUTHERS AVE. OTTAWA ON K1Y 1N2	ENE/224.9	-3.15	<u>358</u>
<u>171</u>	EHS		Spencer St between Holland Ave and Western Rd Ottawa ON	S/225.3	2.85	<u>358</u>
<u>172</u>	SPL	PRIVATE OWNER	1790 SCOTT ST. MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON K1Y 2N7	SW/227.0	1.54	<u>358</u>
<u>173</u>	WWIS		ON Well ID: 7242495	E/227.4	-2.15	<u>359</u>
<u>174</u>	WWIS		52 CARRUTHERS AVENUE Ottawa ON Well ID: 7207343	ENE/227.6	-2.15	<u>359</u>
<u>175</u>	EHS		178 Carruthers Ave Ottawa ON K1Y1N7	E/229.7	-2.15	<u>362</u>
<u>176</u>	EHS		312 Parkdale Avenue Ottawa ON K1Y 4X9	ESE/231.0	-0.15	<u>363</u>
<u>177</u>	EHS		142 Carruthers Ave Ottawa ON K1Y1N5	E/232.8	-3.15	<u>363</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
178	CA	OTTAWA CITY - CARLETON AVE.	SUNNYMEDE AVE./COWLEY AVE. OTTAWA CITY ON	WSW/233.3	-1.82	363
179	SCT	ENTRO BUILDING SYSTEMS INC.	286 HINCHEY AVE OTTAWA ON K1Y 1M2	ESE/233.7	-1.15	363
180	EHS		312 Parkdale Avenue Ottawa ON K1Y 4X9	ESE/234.1	-0.15	364
181	ECA	Patrick John Mills	284 Hinchey Ave 286 Hinchey Avenue Ottawa ON K1Y 1M2	ESE/235.6	-1.15	364
182	CA	OTTAWA CITY	COWLEY AVE./PONTIAC ST. OTTAWA CITY ON	W/235.8	-5.89	364
182	CA	R.M. OF OTTAWA-CARLETON	PONTIAC ST./COWLEY ST. OTTAWA CITY ON	W/235.8	-5.89	365
183	EHS		261A Hinchey Avenue Ottawa ON K1Y 1L9	E/236.2	-1.84	365
184	SPL	PRIVATE OWNER	188 CARRUTHERS STREET STORAGE TANK/BARREL OTTAWA CITY ON K1Y 1N7	E/236.7	-2.15	365
185	GEN	CCC476	45 Holland Ave. Ottawa ON K1Y 4S3	SE/240.0	0.85	366
186	SPL	PRIVATE RESIDENCE	64 GRANGE AVE., RONALD MOLSON FURNACE OIL TANK OTTAWA CITY ON K1Y 0N9	S/240.9	3.85	366
187	SPL	Barbara Connor<UNOFFICIAL>	72 Smirle Avenue Ottawa ON K1Y 0S3	SSE/242.7	2.85	367
188	ECA	The Corporation of the City of Ottawa	Carruthers Ave., Hinchey Ave. & Lyndale Ave. Ottawa ON K1N 5A1	ENE/243.5	-3.15	367

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
189	WWIS		ON Well ID: 7198961	E/246.2	-2.15	367
190	GEN	Ottawa Greenbelt Construction Ltd	85 Spencer Street Ottawa ON K1Y 2P7	SE/246.5	0.93	368
191	EHS		Huron Ave N and Caroline Ave Ottawa ON K1Y	SSE/248.2	0.85	368
192	SPL	PRIVATE RESIDENCE	129 CARRUTHER ST. STORAGE TANK/BARREL OTTAWA CITY ON K1Y 1N4	E/251.6	-3.15	369
193	SPL	PRIVATE RESIDENCE	63 CARRUTHURS AVENUE FURNACE OIL TANK OTTAWA CITY ON	ENE/253.1	-3.15	369
194	EHS		No municipal address - see attached map Ottawa ON	NW/253.1	-0.15	370
195	SPL		18 Burnside Ave. OTTAWA HOUSING GARAGE<UNOFFICIAL> Ottawa ON K1Y 4V7	ENE/256.0	-3.15	370
195	GEN	OTTAWA COMMUNITY HOUSING CORP.	18 BURNSIDE AVE., OTTAWA ON K1Y 4V7	ENE/256.0	-3.15	370
196	EHS		Burnside Avenue Ottawa ON K1Y	ENE/257.8	-2.94	371
197	SPL		In front of 55 Carruthers Street<UNOFFICIAL> Ottawa ON K1Y 1N3	ENE/259.5	-3.15	371
197	SPL	Unknown<UNOFFICIAL>	55 Carruthers Ave. Ottawa Ottawa ON	ENE/259.5	-3.15	371
198	RSC	JOHN HOWARD SOCIETY OF OTTAWA	59 CARRUTHERS AVENUE, OTTAWA, ON K1Y 1N3 Ottawa ON	ENE/259.9	-3.15	372
199	SPL		175 Carruthers Ave, Ottawa Ottawa ON	E/263.2	-2.84	373

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
199	GEN	Morley Hoppner Inc.	175 Carruthers Ottawa ON K1Y 1P8	E/263.2	-2.84	373
200	CFOT	JAMES BLANEY	53 GOULD ST OTTAWA K1Y 2P3 ON CA ON	SW/266.2	1.88	374
200	DTNK	JAMES BLANEY	53 GOULD ST OTTAWA K1Y 2P3 ON CA ON	SW/266.2	1.88	374
201	WWIS		55 CARRUTHERS AVENUE OTTAWA ON <i>Well ID: 7264754</i>	ENE/268.2	-3.15	375
202	EHS		71 Carruthers Ave Ottawa ON K1Y1N3	ENE/268.6	-3.15	377
203	EHS		323 Parkdall Ave Ottawa ON	ESE/270.2	-0.15	378
204	SCT	GRAPHIC DISPLAY CANADA	45 SPENCER ST OTTAWA ON K1Y 2P5	ESE/270.3	-0.15	378
204	SCT	FUJI GRAPHIC SYSTEMS CANADA	45 SPENCER ST OTTAWA ON K1Y 2P5	ESE/270.3	-0.15	378
204	SCT	THE ENVELOPE HOUSE	45 SPENCER ST OTTAWA ON K1Y 2P5	ESE/270.3	-0.15	378
204	SCT	GRAPHIC DISPLAY CANADA	45 SPENCER ST OTTAWA ON K1Y 2P5	ESE/270.3	-0.15	379
204	SCT	Graphic Display Canada - A St- Joseph Corporation Company	45 Spencer St Ottawa ON K1Y 2P5	ESE/270.3	-0.15	379
204	GEN	GRAPHIC DISPLAY CANADA	DIVISION OF M.O.M. PRINTING LTD. 45 SPENCER STREET OTTAWA ON K1Y 2P5	ESE/270.3	-0.15	379
204	GEN	GRAPHIC DISPLAY CANADA 18-125	DIVISION OF M.O.M. PRINTING LTD. 45 SPENCER STREET	ESE/270.3	-0.15	379

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			OTTAWA ON K1Y 2P5			
204	GEN	GRAPHIC DISPLAY CANADA	M.O.M. PRINTING LIMITED, A DIVISION OF 45 SPENCER STREET OTTAWA ON K1Y 2P5	ESE/270.3	-0.15	380
205	EHS		12 Stirling Ottawa ON	E/272.5	-2.95	380
206	EHS		212, 214 and 216 Carruthers Ave Ottawa ON K1Y 1N7	E/273.9	-2.15	380
207	SPL	CONTRACTOR	AT RESIDENCE AT 87 GRANGE ST. (OWNER MRS. PENNY BRADY 613-729-1064) (N.O.S.) OTTAWA CITY ON K1Y 0P1	S/277.8	3.05	380
208	WWIS		ON Well ID: 7219176	ENE/282.0	-3.15	381
209	SCT	Canadian Criminal Justice Assn	320 Parkdale Ave Suite 101 Ottawa ON K1Y 4X9	ESE/282.1	-0.15	382
209	SPL		320 Parkdale Ave Ottawa ON	ESE/282.1	-0.15	382
209	INC		320 PARKDALE AVE, OTTAWA ON	ESE/282.1	-0.15	382
210	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7041972	ESE/287.3	-0.15	383
211	CA	R.M. OF OTTAWA-CARLETON	HAMILTON ST./SPENCER ST. OTTAWA ON	ESE/290.8	0.54	386
212	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7041971	ESE/291.8	-0.15	386
213	WWIS		3 HAMILTON AVE NORTH ON	ESE/292.4	-0.15	388

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			Well ID: 7041967			
214	WWIS		3 HAMILTON AVE NORTH ON	ESE/293.2	-0.15	391
			Well ID: 7041975			
215	WWIS		3 HAMILTON AVE NORTH ON	ESE/294.3	-0.15	393
			Well ID: 7041977			
216	WWIS		3 HAMILTON AVE NORTH ON	ESE/294.4	-0.15	396
			Well ID: 7041968			
217	SPL	OTTAWA HYDRO	4 HAMILTON ST. MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON	ESE/295.2	0.85	398
217	SCT	Artech Studios	6 Hamilton Ave N Suite 250 Ottawa ON K1Y 4R1	ESE/295.2	0.85	399
218	WWIS		3 HAMILTON AVE NORTH ON	ESE/295.6	-0.15	399
			Well ID: 7041970			
219	SCT	VOGUE BRASSIERE INC.	7 HINTON AVE N OTTAWA ON K1Y 4P1	ESE/296.0	0.85	401
219	SCT	CANADIAN ARCTIC RESOURCES COMM	7 Hinton Ave N Suite 200 Ottawa ON K1Y 4P1	ESE/296.0	0.85	402
219	SCT	Canadian Arctic Resources Committee Inc.	7 Hinton Ave N Suite 200 Ottawa ON K1Y 4P1	ESE/296.0	0.85	402
219	GEN	Metcalfe Realty Company Limited	7 Hinton Avenue Ottawa ON	ESE/296.0	0.85	402
219	EHS		7 Hinton Ave N. Ottawa ON K1Y 4P1	ESE/296.0	0.85	403
219	GEN	METCALFE REALTY LIMITED	7 HINTIN AVE., NORTH OTTAWA ON	ESE/296.0	0.85	403
219	GEN	Metcalfe Realty Company Limited	7 Hinton Avenue Ottawa ON	ESE/296.0	0.85	403

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
219	GEN	Metcalfe Realty Company Limited	7 Hinton Avenue Ottawa ON	ESE/296.0	0.85	403
220	WWIS		3 HAMILTON AVE NORTH ON <i>Well ID:</i> 7041966	ESE/296.7	-0.15	404
221	WWIS		3 HAMILTON AVE NORTH ON <i>Well ID:</i> 7041969	ESE/296.8	-0.15	406
222	PINC	ENBRIDGE GAS INC	301 HINCHEY AVE,,OTTAWA,ON,K1Y 1M1,CA ON	ESE/297.5	-1.15	409
223	SPL	PRIVATE RESIDENCE	215 CARRUTHERS AVE FURNACE OIL TANK OTTAWA CITY ON K1Y 1N6	E/297.9	-2.15	409
224	WWIS		7 HINTON AVE. Ottawa ON <i>Well ID:</i> 7119461	ESE/298.4	0.85	410
225	EHS		12 Stirling Ave Ottawa ON K1Y 1P8	E/300.2	-3.15	417

Executive Summary: Summary By Data Source

BORE - Borehole

A search of the BORE database, dated 1875-Jul 2018 has found that there are 17 BORE site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	0.0	<u>12</u>
	ON	0.0	<u>15</u>
	ON	0.0	<u>20</u>
	ON	0.0	<u>24</u>
	ON	0.0	<u>30</u>
	ON	0.0	<u>37</u>
	ON	0.0	<u>38</u>
	ON	0.0	<u>40</u>
	ON	0.0	<u>42</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	0.0	<u>45</u>
	ON	0.0	<u>46</u>
	ON	0.0	<u>49</u>
	ON	0.0	<u>56</u>
	ON	13.4	<u>61</u>
	ON	25.6	<u>70</u>
	ON	34.8	<u>85</u>
	ON	110.8	<u>121</u>

CA - Certificates of Approval

A search of the CA database, dated 1985-Oct 30, 2011* has found that there are 15 CA site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
City of Ottawa	1611 Scott Street Ottawa ON	5.0	<u>57</u>
City of Ottawa	Emmerson Avenue and Parkdale Avenue Ottawa ON	9.3	<u>60</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
OTTAWA CITY	PINEHURST AVE./SCOTT ST. OTTAWA ON	90.7	<u>108</u>
City of Ottawa	Hamilton Avenue and Bullman Street Ottawa ON	134.6	<u>128</u>
OTTAWA CITY	CARLETON AVE./PREMIER AVE. OTTAWA CITY ON	151.8	<u>135</u>
OTTAWA CITY	CARLETON AVE./PREMIER AVE. OTTAWA CITY ON	151.8	<u>135</u>
OTTAWA CITY	HINCHEY AVE./SCOTT ST. OTTAWA CITY ON	167.0	<u>141</u>
R.M. OF OTTAWA-CARLETON	HINCHEY AVE./SCOTT ST. OTTAWA CITY ON	167.0	<u>141</u>
OTTAWA CITY - PARKDALE AVENUE	BULLMAN ST./PINEHURST ST. OTTAWA CITY ON	168.3	<u>142</u>
OTTAWA CITY - HINCHEY STREET	BULLMAN ST./PINEHURST ST. OTTAWA CITY ON	168.3	<u>142</u>
OTTAWA CITY	BURNSIDE AVE./HINCHEY AVE. OTTAWA CITY ON	170.3	<u>143</u>
OTTAWA CITY - CARLETON AVE.	SUNNYMEDE AVE./COWLEY AVE. OTTAWA CITY ON	233.3	<u>178</u>
OTTAWA CITY	COWLEY AVE./PONTIAC ST. OTTAWA CITY ON	235.8	<u>182</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
R.M. OF OTTAWA-CARLETON	PONTIAC ST./COWLEY ST. OTTAWA CITY ON	235.8	182
R.M. OF OTTAWA-CARLETON	HAMILTON ST./SPENCER ST. OTTAWA ON	290.8	211

CFOT - Commercial Fuel Oil Tanks

A search of the CFOT database, dated Feb 28, 2022 has found that there are 1 CFOT site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
JAMES BLANEY	53 GOULD ST OTTAWA K1Y 2P3 ON CA ON	266.2	200

DTNK - Delisted Fuel Tanks

A search of the DTNK database, dated Feb 28, 2022 has found that there are 6 DTNK site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
M & N AUTO CENTRE LTD	1484 SCOTT ST OTTAWA ON	141.5	133
LEONES SERVICE CENTRE LTD	1480 SCOTT ST OTTAWA K1Y 2N4 ON CA ON	152.7	137
LEONES SERVICE CENTRE LTD	1480 SCOTT ST OTTAWA K1Y 2N4 ON CA ON	152.7	137
LEONES SERVICE CENTRE LTD	1480 SCOTT ST OTTAWA K1Y 2N4 ON CA ON	152.7	137
KEVIN WEIR	7728 36/37 CLEARVIEW TOWNSHIP NOTTAWA L0M 1P0 ON CA ON	189.7	151

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
JAMES BLANEY	53 GOULD ST OTTAWA K1Y 2P3 ON CA ON	266.2	200

EASR - Environmental Activity and Sector Registry

A search of the EASR database, dated Oct 2011- Apr 30, 2022 has found that there are 6 EASR site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
PCL CONSTRUCTORS CANADA INC	ON	0.0	11
AECON CONSTRUCTION ONTARIO EAST LIMITED	ON	0.0	28
SNC Lavalin Constructors (Pacific) Inc.; Dragados-Canada, Inc.; EllisDon	Corporation 1611 Scott ST Ottawa ON K1Y 4W2	0.0	36
RICHCRAFT (PARKDALE) LTD.	163 Parkdale Avenue Ottawa ON K1Y 1E7	34.1	84
KIEWIT/EUROVIA/VINCI OTTAWA PARTNERSHIP	ON	54.8	94
Pomerleau Inc	105 Sir John A MacDonald PKY OTTAWA ON K1A 0M8	152.4	136

EBR - Environmental Registry

A search of the EBR database, dated 1994 - May 31, 2022 has found that there are 2 EBR site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
ENGIE Services Inc.	50 Chardon Driveway Ottawa , ON Canada ON	0.0	5

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Hydro One Networks Inc.	172 Carruthers Street Ottawa K1Y 1N7 CITY OF OTTAWA ON	206.7	<u>159</u>

ECA - Environmental Compliance Approval

A search of the ECA database, dated Oct 2011- Apr 30, 2022 has found that there are 17 ECA site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
ENGIE Services Inc.	50 Chardon Driveway Ottawa ON H3A 3C8	0.0	<u>5</u>
Public Works Government Services Canada	19 Tunney's Pasture Dr Ottawa ON K1A 0S5	0.0	<u>26</u>
City of Ottawa	1611 Scott St Ottawa ON K2G 6J8	0.0	<u>36</u>
SNC-Lavalin Constructors (Pacific) Inc., Dragados Canada, Inc. and EllisDon	Corporation operating as OLRT Constructors 1611 Scott St Ottawa ON K1Z 1G3	0.0	<u>36</u>
City of Ottawa	1565 Scott St Ottawa ON K2G 6J8	6.9	<u>58</u>
City of Ottawa	Emmerson Avenue and Parkdale Ave Ottawa ON K1S 5K2	9.3	<u>60</u>
City of Ottawa	Emmerson Avenue and Parkdale Ave Ottawa ON K1S 5K2	9.3	<u>60</u>
8609454 Canada Inc.	121 Parkdale Ave Ottawa ON K1J 7S6	22.6	<u>67</u>
Richcraft (Parkdale) Ltd.	ON	28.9	<u>78</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
City of Ottawa	Forward Avenue, Lyndale Avenue and Hinchey Avenue Ottawa ON K1N 5A1	90.2	<u>107</u>
City of Ottawa	Forward Avenue, Lyndale Avenue and Hinchey Avenue Ottawa ON K1N 5A1	110.5	<u>120</u>
City of Ottawa	Hamilton Avenue and Bullman Street Ottawa ON K2G 6J8	134.6	<u>128</u>
Ali Tohidi and Farzin Fararooni	40 Sunnymede Ave Ottawa ON K2J 4N4	199.1	<u>154</u>
Hydro One Networks Inc.	172 Carruthers St Ottawa ON K1Y1N7	206.7	<u>159</u>
Hydro One Networks Inc.	172 Carruthers St Ottawa ON M5G 2P5	206.7	<u>159</u>
Patrick John Mills	284 Hinchey Ave 286 Hinchey Avenue Ottawa ON K1Y 1M2	235.6	<u>181</u>
The Corporation of the City of Ottawa	Carruthers Ave., Hinchey Ave. & Lyndale Ave. Ottawa ON K1N 5A1	243.5	<u>188</u>

EHS - ERIS Historical Searches

A search of the EHS database, dated 1999-Mar 31, 2022 has found that there are 55 EHS site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Tunney's Pasture Ottawa ON	0.0	<u>2</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Parkdale Ave Ottawa ON	0.0	<u>6</u>
	101 Tunney's Pasture Ottawa ON K1Y	0.0	<u>16</u>
	130 Goldenrod Driveway Ottawa ON K1Y4P7	0.0	<u>19</u>
	200 Tunneys Pasture Driveway Ottawa ON K1Y4G8	0.0	<u>33</u>
	Parkdale Ave Ottawa ON	0.0	<u>39</u>
	131 PARKDALE AVENUE OTTAWA ON K1Y 1E7	18.4	<u>62</u>
	99 Parkdale Avenue Ottawa ON K1Y 1E6	20.8	<u>64</u>
	101 Parkdale Avenue Ottawa ON K1Y 1E6	22.3	<u>66</u>
	121 Parkdale Ave Ottawa ON K1Y2M3	22.6	<u>67</u>
	121 Parkdale Avenue Ottawa ON K1Y 1E6	22.6	<u>67</u>
	1560 Scott Street Ottawa ON K1Y 2N5	26.8	<u>74</u>
	139 Parkdale Avenue Ottawa ON K1Y 1E7	28.0	<u>77</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	159 - 167 Parkdale Avenue Ottawa ON K1Y 1E7	30.5	<u>79</u>
	203 Northwestern Ave Ottawa ON K1Y0M1	31.5	<u>80</u>
	203 Northwestern Ave Ottawa ON K1Y0M1	31.6	<u>81</u>
	131 Parkdale Ave Ottawa ON K1Y1E7	33.5	<u>82</u>
	Ottawa Ottawa ON	37.5	<u>86</u>
	2 Holland Ave Ottawa ON K1Y0X4	41.8	<u>88</u>
	99-107 Parkdale Avenue (odd numbers only) Ottawa ON	44.4	<u>90</u>
	1546 Scott Street Ottawa ON K1Y 4S8	52.4	<u>91</u>
	1546 Scott Street Ottawa ON K1Y 4S8	52.4	<u>91</u>
	1546 Scott Street Ottawa ON K1Y 4S8	52.4	<u>91</u>
	1546 Scott Street Ottawa ON K1Y 4S8	52.4	<u>91</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	255 Parkdale Avenue Ottawa ON K1Y 1G1	57.3	<u>96</u>
	192 Forward Ave Ottawa ON K1Y1E8	69.3	<u>100</u>
	11 & 25 Holland Avenue and 1600 & 1620 Scott Street Ottawa ON	99.3	<u>110</u>
	187 Forward Avenue Ottawa ON K1Y 1L2	99.3	<u>111</u>
	268-272 Parkdale Avenue Ottawa, ON ON K1Y 1E9	101.7	<u>113</u>
	159 Forward Avenue Ottawa ON K1Y 1K9	104.1	<u>115</u>
	133 Forward Avenue Ottawa ON K1Y 1K8	108.2	<u>118</u>
	61 Pinehurst Avenue Ottawa ON K1Y 1K5	121.6	<u>123</u>
	1620 Scott Street Ottawa ON K1Y 4S7	123.7	<u>125</u>
	PE4962: 30, 34 and 40 Holland Ave, Ottawa ON Ottawa ON K1Y 0X4	141.2	<u>132</u>
	1 Hamilton Avenue North ottawa ON K1Y 1B5	154.6	<u>138</u>
	250-252 Hinchey Avenue Ottawa ON K1Y 1L8	172.2	<u>144</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	300 Parkdale Avenue Ottawa ON K1Y 1G2	183.9	<u>147</u>
	161 Hinchey Ave Ottawa ON K1Y 1L5	185.8	<u>148</u>
	161 Hinchey Ave Ottawa Ontario Ottawa ON K1Y 1L5	185.9	<u>149</u>
	140 Carleton Avenue Ottawa ON K1Y	196.8	<u>153</u>
	Spencer St between Holland Ave and Western Rd Ottawa ON	225.3	<u>171</u>
	178 Carruthers Ave Ottawa ON K1Y1N7	229.7	<u>175</u>
	312 Parkdale Avenue Ottawa ON K1Y 4X9	231.0	<u>176</u>
	142 Carruthers Ave Ottawa ON K1Y1N5	232.8	<u>177</u>
	312 Parkdale Avenue Ottawa ON K1Y 4X9	234.1	<u>180</u>
	261A Hinchey Avenue Ottawa ON K1Y 1L9	236.2	<u>183</u>
	Huron Ave N and Caroline Ave Ottawa ON K1Y	248.2	<u>191</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	No municipal address - see attached map Ottawa ON	253.1	<u>194</u>
	Burnside Avenue Ottawa ON K1Y	257.8	<u>196</u>
	71 Carruthers Ave Ottawa ON K1Y1N3	268.6	<u>202</u>
	323 Parkdall Ave Ottawa ON	270.2	<u>203</u>
	12 Stirling Ottawa ON	272.5	<u>205</u>
	212, 214 and 216 Carruthers Ave Ottawa ON K1Y 1N7	273.9	<u>206</u>
	7 Hinton Ave N. Ottawa ON K1Y 4P1	296.0	<u>219</u>
	12 Stirling Ave Ottawa ON K1Y 1P8	300.2	<u>225</u>

FCS - Contaminated Sites on Federal Land

A search of the FCS database, dated Jun 2000-Apr 2022 has found that there are 1 FCS site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Environmental Health Centre	Ottawa ON	0.0	<u>51</u>

FRST - Federal Identification Registry for Storage Tank Systems (FIRSTS)

A search of the FRST database, dated May 31, 2018 has found that there are 3 FRST site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Public Service and Procurement Canada (Corporate)	50 Chardon Driveway Ottawa ON k1y 1g9	0.0	<u>5</u>
Health Canada	251, Sir Frederick Banting Driveway Ottawa ON	0.0	<u>43</u>
Health Canada	251, Sir Frederick Banting Driveway Ottawa ON	0.0	<u>43</u>

FST - Fuel Storage Tank

A search of the FST database, dated Feb 28, 2022 has found that there are 3 FST site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
LEONES SERVICE CENTRE LTD	1480 SCOTT ST OTTAWA K1Y 2N4 ON CA ON	152.7	<u>137</u>
LEONES SERVICE CENTRE LTD	1480 SCOTT ST OTTAWA K1Y 2N4 ON CA ON	152.7	<u>137</u>
LEONES SERVICE CENTRE LTD	1480 SCOTT ST OTTAWA K1Y 2N4 ON CA ON	152.7	<u>137</u>

FSTH - Fuel Storage Tank - Historic

A search of the FSTH database, dated Pre-Jan 2010* has found that there are 2 FSTH site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
LEONES SERVICE CENTRE LTD	1480 SCOTT ST OTTAWA ON K1Y 2N4	141.5	<u>133</u>
LEONES SERVICE CENTRE LTD	1480 SCOTT ST OTTAWA ON K1Y 2N4	141.5	<u>133</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>

GEN - Ontario Regulation 347 Waste Generators Summary

A search of the GEN database, dated 1986-Feb 28, 2022 has found that there are 176 GEN site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
HEALTH AND WELFARE CANADA	BANTING RESEARCH CENTRE STORES 1 ROSS AVE., TUNNEYS PASTURE OTTAWA ON K1A 0L2	0.0	<u>1</u>
GVT. OF CAN. - HEALTH AND WELFARE 18-094	BANTING RESEARCH CENTRE STORES 1 ROSS AVE., TUNNEY PASTURE OTTAWA ON K1A 0L2	0.0	<u>1</u>
HEALTH AND WELFARE CANADA	BANTING RESEARCH CENTRE STORES 1 ROSS AVENUE, TUNNEYS PASTURE OTTAWA ON K1A 0L2	0.0	<u>1</u>
HEALTH AND WELFARE CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON K1A 0L2	0.0	<u>1</u>
HEALTH AND WELFARE CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON	0.0	<u>1</u>
HEALTH AND WELFARE CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON	0.0	<u>1</u>
HEALTH AND WELFARE CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON	0.0	<u>1</u>
HEALTH AND WELFARE CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON K1A 0M3	0.0	<u>1</u>
HEALTH AND WELFARE CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON	0.0	<u>1</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
HEALTH AND WELFARE CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON K1A 0L2	0.0	<u>1</u>
HEALTH AND WELFARE CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON K1A 0L2	0.0	<u>1</u>
HEALTH AND WELFARE CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON K1A 0L2	0.0	<u>1</u>
HEALTH AND WELFARE CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON K1A 0L2	0.0	<u>1</u>
HEALTH AND WELFARE CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON K1A 0L2	0.0	<u>1</u>
HEALTH CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON K1A 0L2	0.0	<u>1</u>
Public Services & Procurement Canada ESD/AFD	50 Chardon OTTAWA ON K1A0S5	0.0	<u>5</u>
Public Services & Procurement Canada ESD/AFD	50 Chardon OTTAWA ON K1A0S5	0.0	<u>5</u>
Public Services & Procurement Canada ESD/AFD	50 Chardon OTTAWA ON K1A0S5	0.0	<u>5</u>
GVT. OF CAN. - PUBLIC WORKS CANADA	TUNNEY'S PASTURE HEATING PLANT BLDG. 13 TUNNEY'S PASTURE, SORRELL & DUCHARDON OTTAWA ON K1A 0M3	0.0	<u>8</u>
GVT. OF CAN. - PUBLIC WORKS CANADA18-209	TUNNEY'S PASTURE HEATING PLANT BLDG. 13 TUNNEY'S PASTURE, SORRELL & DUCHARDON OTTAWA ON K1A 0M3	0.0	<u>8</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Demo Plus	100 Chardon Drive Ottawa ON K1Y 2Z0	0.0	<u>13</u>
Royal Canadian Mounted Police Tunney's Laboratory	100 Eglantine Driveway Ottawa ON K1A 0K9	0.0	<u>14</u>
Royal Canadian Mounted Police Tunney's Laboratory	100 Eglantine Driveway Ottawa ON K1A 0K9	0.0	<u>14</u>
Public Works and Government Services Canada	101 Tunneys Pasture Driveway Ottawa ON K1A 0T6	0.0	<u>18</u>
GVT. OF CAN-NATIONAL RESEARCH CNCL	HEALTH PROTECTION BUILDING 7 TUNNEY'S PASTURE OTTAWA ON K1A 0R6	0.0	<u>26</u>
GVT. OF CAN-NATIONAL RESEARCH CNCL18-245	HEALTH PROTECTION BUILDING 7 TUNNEY'S PASTURE OTTAWA ON K1A 0R6	0.0	<u>26</u>
Brookfield Global Integrated Solutions	101 Goldenrod Drive Ottawa ON K1A 0T6	0.0	<u>29</u>
Brookfield Global Integrated Solutions	101 Goldenrod Drive Ottawa ON K1A 0T6	0.0	<u>29</u>
BGIS BGIS	101 Goldenrod Drive Ottawa ON K1A 0T6	0.0	<u>29</u>
BGIS BGIS	101 Goldenrod Drive Ottawa ON K1A 0T6	0.0	<u>29</u>
BGIS BGIS	101 Goldenrod Drive Ottawa ON K1A 0T6	0.0	<u>29</u>
NATIONAL RESEARCH COUNCIL	HEALTH PROTECTION BUILDING 7 HOLLAND AVENUE, TUNNEY'S PASTURE OTTAWA ON K1A 0R6	0.0	<u>33</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
GVT. OF CAN. - ATOMIC ENERGY CONT.	L B, TUNNEY'S PASTURE (HPB BUILDING) C/O P O BOX 1046 OTTAWA ON K1P 5S9	0.0	<u>33</u>
ATOMIC ENERGY CONTROL BOARD	HPB BUILDING (HOLLAND & COLOMBINE) TUNNEY'S PASTURE, ROOM 253 OTTAWA ON K1P 5S9	0.0	<u>33</u>
GVT. OF CAN. - ATOMIC ENERGY CONT.18-029	L B, TUNNEY'S PASTURE (HPB BUILDING) C/O P O BOX 1046 OTTAWA ON K1P 5S9	0.0	<u>33</u>
ATOMIC ENERGY CONTROL BOARD	HPB BUILDING 7 (HOLLAND & COLOMBINE) TUNNEY'S PASTURE, ROOM 253 OTTAWA ON K1A 0L2	0.0	<u>33</u>
CANADIAN NUCLEAR SAFETY COMMISSION	HPB BUILDING 7 (HOLLAND & COLOMBINE) TUNNEY'S PASTURE, ROOM 253 OTTAWA ON K1A 0L2	0.0	<u>33</u>
CANADIAN NUCLEAR SAFETY COMMISSION	HPB BUILDING 7 (HOLLAND & COLOMBINE) TUNNEY'S PASTURE, ROOM 253 OTTAWA ON	0.0	<u>33</u>
CANADIAN NUCLEAR SAFETY COMMISSION	HPB BUILDING 7 (HOLLAND & COLOMBINE) TUNNEY'S PASTURE, ROOM 253 OTTAWA ON	0.0	<u>33</u>
GVT. OF CAN-STATISTICS CANADA	1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON K1A 0T6	0.0	<u>34</u>
NATIONAL ARCHIVES OF CANADA	STATISTICS MAIN BUILDING, ROOM 1306 HOLLAND AVENUE OTTAWA ON K1A 0T6	0.0	<u>34</u>
GVT. OF CAN. - NATIONAL ARCHIVES CANADA	STATISTICS MAIN BUILDING, ROOM 1306 HOLLAND AVENUE OTTAWA ON K1A 0T6	0.0	<u>34</u>
NATIONAL ARCHIVES CANADA	STATISTICS MAIN BUILDING, ROOM 1306 HOLLAND AVENUE	0.0	<u>34</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	OTTAWA ON K1A 0T6		
GVT. OF CAN-STATISTICS CANADA	1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON	0.0	<u>34</u>
GVT. OF CAN-STATISTICS CANADA	1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON	0.0	<u>34</u>
Lexus Mechanical	150 Tunney's Pasture Ottawa ON	0.0	<u>34</u>
GVT. OF CAN-STATISTICS CANADA	1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON	0.0	<u>34</u>
GVT. OF CAN-STATISTICS CANADA	1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON K1A 0T6	0.0	<u>34</u>
Statistics Canada	150Tunney's Pasture Driveway Main Bldg, SC0005 Ottawa ON	0.0	<u>34</u>
Health Canada	150 Tunney's Pasture Drwy Ottawa ON	0.0	<u>34</u>
GVT. OF CAN-STATISTICS CANADA	1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON	0.0	<u>34</u>
GVT. OF CAN-STATISTICS CANADA	1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON K1A 0T6	0.0	<u>34</u>
GVT. OF CAN-STATISTICS CANADA	1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON K1A 0T6	0.0	<u>34</u>
GVT. OF CAN-STATISTICS CANADA	1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON K1A 0T6	0.0	<u>34</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Statistics Canada	150Tunney's Pasture Driveway Main Bldg, SC0005 Ottawa ON K1A0T6	0.0	<u>34</u>
GVT. OF CAN-STATISTICS CANADA Administrative Support Services Division	1405 Main Statistics Canada Building TUNNEYS PASTURE OTTAWA ON K1A 0T6	0.0	<u>34</u>
GVT. OF CAN-STATISTICS CANADA Administrative Support Services Division	1405 Main Statistics Canada Building TUNNEYS PASTURE OTTAWA ON K1A 0T6	0.0	<u>34</u>
GVT. OF CAN-STATISTICS CANADA Administrative Support Services Division	1405 Main Statistics Canada Building TUNNEYS PASTURE OTTAWA ON K1A 0T6	0.0	<u>34</u>
GVT. OF CAN-STATISTICS CANADA Administrative Support Services Division	1405 Main Statistics Canada Building TUNNEYS PASTURE OTTAWA ON K1A 0T6	0.0	<u>34</u>
Environmental Health Science and Research Bureau	50 Colombine Driveway Ottawa ON K1A 0K9	0.0	<u>41</u>
Statistics Canada HSD	251 Sir Frederick Banting Driveway Ottawa ON K1Y 0M1	0.0	<u>43</u>
Statistics Canada CPHD	251 Sir Frederick Banting Ottawa ON K1Y0M1	0.0	<u>43</u>
CAMECO-CANADIAN MINING & ENERGY CORP	BUILDING #21, TUNNEY'S PASTURE CORNER OF ROSS & DE LA COLOMBINE OTTAWA ON	0.0	<u>44</u>
BROOKFIELD GLOBAL INTEGRATED SOLUTIONS	70 COLOMBINE DRIVWAY TUNNEY'S PASTURE OTTAWA ON K1A 0K9	0.0	<u>47</u>
GVT. OF CAN.-PUBLIC WORKS OF CAN.	REALTY BRANCH TUNNEY'S PASTURE ASS.BLDG C/O TUNNEY'S PASTURE DBS BLDG RM 1005	0.0	<u>48</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	OTTAWA-CARLETON ON K1A 0M3		
PUBLIC WORKS & GOVERNMENT SERVS. CANADA	ASSORTED BUILDINGS TUNNEY'S PASTURE (FEDERAL COMPLEX) OTTAWA ON K1A 0M3	0.0	<u>48</u>
GVT. OF CAN.-PUBLIC WORKS OF CAN. 18-337	REALTY BRANCH TUNNEY'S PASTURE ASS.BLDG OTTAWA,C/O 1000-38 ANTARES DRIVE NEPEAN ON K1A 0M3	0.0	<u>48</u>
PUBLIC WORKS & GOVERNMENT SERVICES CAN.	ASSORTED BUILDING TUNNEY'S PASTURE (FEDERAL COMPLEX) OTTAWA ON K1A 0M3	0.0	<u>48</u>
PUBLIC WORKS CANADA	TUNNEY'S PASTURE - FEDERAL COMPLEX ASSORTED BUILDINGS OTTAWA ON	0.0	<u>48</u>
BROOKFIELD LEPAGE JOHNSON CONTROLS	TUNNEY'S PASTURE FEDERAL COMPLEX ASSORTED BUILDINGS OTTAWA ON	0.0	<u>48</u>
Public Works and Government Services Canada	120 Parkdale, Tunneys Pasture, Various Buildings Ottawa ON K1A 1B4	0.0	<u>48</u>
Public Works and Government Services	120 Parkdale Ottawa ON K1A 1B4	0.0	<u>48</u>
Public Works and Government Services Canada	120 Parkdale, Tunneys Pasture, Various Buildings Ottawa ON K1A 1K6	0.0	<u>48</u>
Public Works and Government Services	120 Parkdale Ottawa ON K1A 1B4	0.0	<u>48</u>
Public Works and Government Services Canada	120 Parkdale, Tunneys Pasture, Various Buildings Ottawa ON K1A 1K6	0.0	<u>48</u>
Public Works and Government Services Canada	120 Parkdale, Tunneys Pasture, Various Buildings Ottawa ON K1A 1K6	0.0	<u>48</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
SNC LAVALIN O & M	120 PARKDALE AVENUE VARIOUS BUILDINGS OTTAWA ON	0.0	<u>48</u>
Public Works and Government Services Canada	120 Parkdale, Tunneys Pasture, Various Buildings Ottawa ON K1A 1K6	0.0	<u>48</u>
SNC LAVALIN O & M	120 PARKDALE AVENUE VARIOUS BUILDINGS OTTAWA ON	0.0	<u>48</u>
Public Works and Government Services Canada	120 Parkdale, Tunneys Pasture, Various Buildings Ottawa ON	0.0	<u>48</u>
Public Works and Government Services Canada	120 Parkdale, Tunneys Pasture, Various Buildings Ottawa ON K1A 0K9	0.0	<u>48</u>
Public Works and Government Services Canada	120 Parkdale, Tunneys Pasture, Various Buildings Ottawa ON K1A 0K9	0.0	<u>48</u>
Public Works and Government Services Canada	120 Parkdale, Tunneys Pasture, Various Buildings Ottawa ON K1A 0K9	0.0	<u>48</u>
Public Services & Procurement Canada ESD/AFD	120 Parkdale, Ottawa ON K1A 0K9	0.0	<u>48</u>
Public Services & Procurement Canada ESD/AFD	120 Parkdale, Ottawa ON K1A 0K9	0.0	<u>48</u>
Public Services & Procurement Canada ESD/AFD	120 Parkdale, Ottawa ON K1A 0K9	0.0	<u>48</u>
Public Services & Procurement Canada ESD/AFD	120 Parkdale, Ottawa ON K1A 0K9	0.0	<u>48</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
OLRT Constructors/Dragados/EllisDon Corp	1611 Scott Street - Tunney's Pasture Station Ottawa ON K1Y 2N5	5.0	<u>57</u>
OC Transpo	1611 Scott Street Ottawa ON K1Y 4W2	5.0	<u>57</u>
OLRT Constructors/Dragados/EllisDon Corp	1611 Scott Street - Tunney's Pasture Station Ottawa ON K1Y 2N5	5.0	<u>57</u>
The Ottawa Muslim Association	251 NorthWestern Avenue Ottawa ON K1Y0M1	57.2	<u>95</u>
CAPITAL CITY RUSTPROOFING LIMITED	1536 SCOTT STREET OTTAWA ON K1Y 2N5	68.6	<u>98</u>
CAPITAL CITY (OUT OF BUSINESS) 08-793	1536 SCOTT STREET OTTAWA ON K1Y 2N5	68.6	<u>98</u>
FRANK & SONS PAINTING & DECORATING LTD.	184 FORWARD AVENUE OTTAWA ON K1Y 1L2	68.7	<u>99</u>
FRANK & SONS PAINTING & DECORATING LTD.	184 FORWARD AVENUE OTTAWA ON K1Y 1L2	68.7	<u>99</u>
FRANK & SONS PAINTING & DECORATING LTD.	184 FORWARD AVENUE OTTAWA ON K1Y 1L2	68.7	<u>99</u>
CCC384	44 EMMERSON AVE OTTAWA ON K1Y 2L8	74.5	<u>101</u>
Royal Lepage	1446 Scott Street Ottawa ON K1Y 1L7	85.1	<u>105</u>
COLONNADE DEVELOPMENTS INC.	11 HOLLAND AVENUE Ottawa ON K1Y 4S1	102.4	<u>114</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Hetz Medicine Professional Corporation	11 Holland Ave Suite 400 Ottawa ON K1Y 4S1	102.4	<u>114</u>
Hetz Medicine Professional Corporation	11 Holland Ave Suite 400 Ottawa ON K1Y 4S1	102.4	<u>114</u>
ITF CJPT Real Estate No. 1 Trust	11 Holland Ave. Ottawa ON K1Y 4S1	102.4	<u>114</u>
Hetz Medicine Professional Corporation	11 Holland Ave Suite 400 Ottawa ON K1Y 4S1	102.4	<u>114</u>
ARISTOTEC GENERATOR SERVICES INC	13A BULLMAN ST. OTTAWA ON K1Y 2S2	106.0	<u>117</u>
ARISTOTEC (OUT OF BUSINESS)	13A BULLMAN ST. OTTAWA ON K1Y 2S2	106.0	<u>117</u>
ARISTOTEC (OUT OF BUSINESS) 03- 269	13A BULLMAN ST. OTTAWA ON K1Y 2S2	106.0	<u>117</u>
CARRIAGE HOUSE RESTORATION & ANTIQUES	13A BULLMAN OTTAWA ON K1Y 2S2	106.0	<u>117</u>
2021694	13 bullman street ottawa ON K1Y 2S2	106.0	<u>117</u>
2021694	13 bullman street ottawa ON K1Y 2S2	106.0	<u>117</u>
Golder Associates Ltd.	159 Forward Ave. Ottawa ON K1Y 1K9	114.3	<u>122</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
PHARMA PLUS DRUGS LTD	1620 SCOTT STREET UNIT 29 OTTAWA ON K1Y 4S7	123.7	<u>125</u>
PHARMA PLUS DRUGS LTD. 31-660	1620 SCOTT STREET, UNIT 29, OTTAWA C/O 5935 AIRPORT ROAD STE. 500 MISSISSAUGA ON K1Y 4S7	123.7	<u>125</u>
PHARMA PLUS DRUGS LTD.	1620 SCOTT STREET UNIT 29 OTTAWA ON K1Y 4S7	123.7	<u>125</u>
PHARMA PLUS DRUGS LTD.	1620 SCOTT STREET, UNIT 29 OTTAWA ON K1Y 4S7	123.7	<u>125</u>
Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	123.7	<u>125</u>
Rexall Pharmacy Group Ltd.	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	123.7	<u>125</u>
Pharma Plus Drugmarts Ltd	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	123.7	<u>125</u>
Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	123.7	<u>125</u>
Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	123.7	<u>125</u>
Pharma Plus Drugmarts Ltd	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	123.7	<u>125</u>
Rexall Pharmacy Group Ltd.	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	123.7	<u>125</u>
Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	123.7	<u>125</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Rexall Pharmacy Group Ltd.	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	123.7	<u>125</u>
Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	123.7	<u>125</u>
Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	123.7	<u>125</u>
Rexall Pharmacy Group Ltd.	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	123.7	<u>125</u>
Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	123.7	<u>125</u>
Rexall Pharmacy Group Ltd.	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	123.7	<u>125</u>
Colonnade Development Inc.	1600 Scott St Ottawa ON	125.4	<u>126</u>
CAROLE RAYMOND	1484A SCOTT ST., OTTAWA ON K1Y 2N4	141.5	<u>133</u>
Leone's Service Centre Ltd.	1480 Scott St, ottawa ON	141.5	<u>133</u>
Leone's Service Centre Ltd.	1480 Scott St, ottawa ON K1Y 2N4	141.5	<u>133</u>
Pomerleau Inc.	105 Sir John A. Macdonald Parkway Ottawa ON K1A 0N4	152.4	<u>136</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Pomerleau Inc.	105 Sir John A. Macdonald Parkway Ottawa ON K1A 0N4	152.4	<u>136</u>
ONTARIO PETROLEUM PUMP	1 HAMILTON AVE N OTTAWA ON K1Y 1B5	154.6	<u>138</u>
M.O.M. PRINTING	300 PARKDALE AVENUE OTTAWA ON K1Y 1G2	183.9	<u>147</u>
M.O.M. PRINTING	300 PARKDALE AVENUE OTTAWA ON K1Y 1G2	183.9	<u>147</u>
M.O.M. PRINTING 25-205	300 PARKDALE AVENUE OTTAWA ON K1Y 1G2	183.9	<u>147</u>
M.O.M. PRINTING	300 Parkdale Ave Ottawa ON K1Y 1G2	183.9	<u>147</u>
Scintrex Trace Crop.	300 Parkdale Ave. Ottawa ON K1Y 1G2	183.9	<u>147</u>
Scintrex Trace Crop.	300 Parkdale Ave. Ottawa ON K1Y 1G2	183.9	<u>147</u>
Scintrex Trace Crop.	300 Parkdale Ave. Ottawa ON K1Y 1G2	183.9	<u>147</u>
Scintrex Trace Crop.	300 Parkdale Ave. Ottawa ON K1Y 1G2	183.9	<u>147</u>
Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	183.9	<u>147</u>
Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	183.9	<u>147</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	183.9	<u>147</u>
Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	183.9	<u>147</u>
Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	183.9	<u>147</u>
Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	183.9	<u>147</u>
Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	183.9	<u>147</u>
quality building services	213 cowley ave ottawa ON K1Y 0G8	202.9	<u>157</u>
Hydro One Networks Inc.	Hinchey TS 172 Carruthers Avenue Ottawa ON	206.7	<u>159</u>
Hydro One Networks Inc.	Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON	206.7	<u>159</u>
Hydro One Networks Inc.	Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON	206.7	<u>159</u>
Hydro One Networks Inc.	Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON	206.7	<u>159</u>
Hydro One Networks Inc.	Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON	206.7	<u>159</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Hydro One Networks Inc.	Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON	206.7	<u>159</u>
Hydro One Networks Inc.	Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON K1Y 1N7	206.7	<u>159</u>
Hydro One Networks Inc.	Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON K1Y 1N7	206.7	<u>159</u>
Hydro One Networks Inc.	Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON K1Y 1N7	206.7	<u>159</u>
Hydro One Networks Inc.	Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON K1Y 1N7	206.7	<u>159</u>
Hydro One Networks Inc.	Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON K1Y 1N7	206.7	<u>159</u>
Hydro One Networks Inc.	Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON K1Y 1N7	206.7	<u>159</u>
JOHANNES POTHUMA	80 CARRUTHERS AVE. OTTAWA ON K1Y 1N2	224.9	<u>170</u>
JOHANNES POTHUMA 22-285	80 CARRUTHERS AVE. OTTAWA ON K1Y 1N2	224.9	<u>170</u>
CCC476	45 Holland Ave. Ottawa ON K1Y 4S3	240.0	<u>185</u>
Ottawa Greenbelt Construction Ltd	85 Spencer Street Ottawa ON K1Y 2P7	246.5	<u>190</u>
OTTAWA COMMUNITY HOUSING CORP.	18 BURNSIDE AVE., OTTAWA ON K1Y 4V7	256.0	<u>195</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Morley Hoppner Inc.	175 Carruthers Ottawa ON K1Y 1P8	263.2	<u>199</u>
GRAPHIC DISPLAY CANADA	DIVISION OF M.O.M. PRINTING LTD. 45 SPENCER STREET OTTAWA ON K1Y 2P5	270.3	<u>204</u>
GRAPHIC DISPLAY CANADA 18-125	DIVISION OF M.O.M. PRINTING LTD. 45 SPENCER STREET OTTAWA ON K1Y 2P5	270.3	<u>204</u>
GRAPHIC DISPLAY CANADA	M.O.M. PRINTING LIMITED, A DIVISION OF 45 SPENCER STREET OTTAWA ON K1Y 2P5	270.3	<u>204</u>
METCALFE REALTY LIMITED	7 HINTIN AVE., NORTH OTTAWA ON	296.0	<u>219</u>
Metcalfe Realty Company Limited	7 Hinton Avenue Ottawa ON	296.0	<u>219</u>
Metcalfe Realty Company Limited	7 Hinton Avenue Ottawa ON	296.0	<u>219</u>
Metcalfe Realty Company Limited	7 Hinton Avenue Ottawa ON	296.0	<u>219</u>

GHG - Greenhouse Gas Emissions from Large Facilities

A search of the GHG database, dated 2013-Dec 2019 has found that there are 1 GHG site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Tunney's Pasture Central Heating and Cooling Plant	50 Chardon Drive Ottawa ON K1A 0M3	0.0	<u>5</u>

HINC - TSSA Historic Incidents

A search of the HINC database, dated 2006-June 2009* has found that there are 4 HINC site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	18 PONTIAC STREET OTTAWA ON K1Y 2J9	99.4	<u>112</u>
	36 ROSS AVENUE OTTAWA ON K1Y 0N3	108.9	<u>119</u>
	58 CARRUTHERS AVENUE OTTAWA ON K1Y 1N2	218.4	<u>164</u>
	56 CARRUTHERS AVENUE OTTAWA ON K1Y 1N2	222.4	<u>167</u>

INC - Fuel Oil Spills and Leaks

A search of the INC database, dated Feb 28, 2022 has found that there are 1 INC site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	320 PARKDALE AVE, OTTAWA ON	282.1	<u>209</u>

NPRI - National Pollutant Release Inventory

A search of the NPRI database, dated 1993-May 2017 has found that there are 12 NPRI site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
PUBLIC WORKS AND GOVERNEMENT SERVICES CANADA	50 CHARDON DRIVE CORNER OF SOREL/DU CHARDON OTTAWA ON K1A0M3	0.0	<u>5</u>
PUBLIC WORKS AND GOVERNMENT SERVICES CANADA	50 CHARDON DRIVE CORNER OF SOREL/DU CHARDON OTTAWA ON K1A0M3	0.0	<u>5</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
PUBLIC WORKS AND GOVERNMENT SERVICES CANADA	50 CHARDON DRIVE CORNER OF SOREL/DU CHARDON OTTAWA ON K1A0M3	0.0	<u>5</u>
PUBLIC WORKS AND GOVERNMENT SERVICES CANADA	50 CHARDON DRIVE CORNER OF SOREL/DU CHARDON OTTAWA ON K1A0M3	0.0	<u>5</u>
PUBLIC WORKS AND GOVERNMENT SERVICES CANADA	50 CHARDON DRIVE CORNER OF SOREL/DU CHARDON OTTAWA ON K1A0M3	0.0	<u>5</u>
PUBLIC WORKS AND GOVERNMENT SERVICES CANADA	50 CHARDON DRIVE CORNER OF SOREL/DU CHARDON OTTAWA ON K1A0M3	0.0	<u>5</u>
PUBLIC WORKS AND GOVERNMENT SERVICES CANADA	50 CHARDON DRIVE NOT AVAILABLE OTTAWA ON K1A0M3	0.0	<u>5</u>
PUBLIC WORKS AND GOVERNMENT SERVICES CANADA	50 Entrain Chardon Ottawa ON K1A0M3	0.0	<u>5</u>
PUBLIC WORKS AND GOVERNMENT SERVICES CANADA	50 CHARDON DRIVE NOT AVAILABLE OTTAWA ON K1A0M3	0.0	<u>5</u>
PUBLIC WORKS AND GOVERNMENT SERVICES CANADA	50 CHARDON DRIVE NOT AVAILABLE OTTAWA ON K1A0M3	0.0	<u>5</u>
PUBLIC WORKS AND GOVERNMENT SERVICES CANADA	50 CHARDON DRIVE CORNER OF SOREL/DU CHARDON OTTAWA ON K1A0M3	0.0	<u>5</u>
SNC-LAVALIN PROFAC	120 Parkdale Avenue Ottawa ON K1A6T6	0.0	<u>48</u>

PES - Pesticide Register

A search of the PES database, dated Oct 2011- Apr 30, 2022 has found that there are 3 PES site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
OTTAWA & DIST ASSOC FOR THE MENTALLY RETARDED	55 PARKDALE AVENUE NORTH OTTAWA ON K2H 8H8	62.9	<u>97</u>
DANIEL BAKER	100 HINCHEY AVE; #921 OTTAWA ON K1Y4L9	154.7	<u>139</u>
DANIEL C BAKER	921-100 HINCHEY AVENUE OTTAWA ON K1Y 4L9	154.7	<u>139</u>

PINC - Pipeline Incidents

A search of the PINC database, dated Feb 28, 2021 has found that there are 15 PINC site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
ENBRIDGE GAS INC	121 PARKDALE AVE,,OTTAWA,ON,K1Y 1E6,CA ON	22.6	<u>67</u>
PIPELINE HIT 1/2"	203 NORTHWESTERN AVE,,OTTAWA,ON, K1Y 0M1,CA ON	31.5	<u>80</u>
PIPELINE HIT - 1/2"	155 NORTHWESTERN AVE,,OTTAWA,ON, K1Y 0M1,CA ON	34.1	<u>83</u>
PIPELINE HIT 1/2"	155 NORTHWESTERN AVE,,OTTAWA,ON, K1Y 0M1,CA ON	34.1	<u>83</u>
ENBRIDGE GAS INC	153 NORTHWESTERN AVE,,OTTAWA,ON, K1Y 0M1,CA ON	40.1	<u>87</u>
ENBRIDGE GAS INC	1748 SCOTT ST,,OTTAWA,ON,K1Y 2N6,CA ON	79.5	<u>104</u>
ENBRIDGE GAS INC	123 CARLETON AVE,,OTTAWA,ON,K1Y 0J2,CA ON	135.2	<u>129</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
PIPELINE HIT 0.5"	164 CARLETON AVE,,OTTAWA,ON,K1Y 0J3,CA ON	165.8	140
JEANNINE T KNIGHTON	47 GILCHRIST AVE,,OTTAWA,ON,K1Y 0M7, CA ON	183.4	146
GUANGZHOU TRISTATE INDUSTRIAL CO LTD	64 SMIRLE AVE,,OTTAWA,ON,K1Y 0S1,CA ON	192.9	152
ENBRIDGE GAS INC	1786 SCOTT ST,,OTTAWA,ON,K1Y 2N7,CA ON	213.2	161
	66 Ross Avenue, Ottawa ON	218.3	163
RUFUS O RAMBHARACK	67 SMIRLE AVE,,OTTAWA,ON,K1Y 0S2,CA ON	219.9	165
OTTAWA GREENBELT CONSTRUCTION LTD	74 CAROLINE AVE,,OTTAWA,ON,K1Y 0S7, CA ON	224.9	169
ENBRIDGE GAS INC	301 HINCHEY AVE,,OTTAWA,ON,K1Y 1M1, CA ON	297.5	222

PRT - Private and Retail Fuel Storage Tanks

A search of the PRT database, dated 1989-1996* has found that there are 1 PRT site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
LEONES SERVICE CENTRE LTD	1480 SCOTT ST OTTAWA ON K1Y2N4	141.5	133

PTTW - Permit to Take Water

A search of the PTTW database, dated 1994 - May 31, 2022 has found that there are 3 PTTW site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Les Constructions Brigil Inc.	99 Parkdale Avenue Ottawa, ON K1Y1E6 Canada ON	24.3	<u>69</u>
Richcraft (Parkdale) Ltd.	159, 163 and 167 Parkdale Avenue Ottawa, ON Canada ON	27.5	<u>75</u>
Canada Lands Company CLC Limited	Lot: 21-25, Concession: 1 on Ottawa River, Geographic Township: GLOUCESTER, Ottawa, City CITY OF OTTAWA ON	202.8	<u>156</u>

RSC - Record of Site Condition

A search of the RSC database, dated 1997-Sept 2001, Oct 2004-May 2022 has found that there are 1 RSC site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
JOHN HOWARD SOCIETY OF OTTAWA	59 CARRUTHERS AVENUE, OTTAWA, ON K1Y 1N3 Ottawa ON	259.9	<u>198</u>

RST - Retail Fuel Storage Tanks

A search of the RST database, dated 1999-Sep 30, 2021 has found that there are 2 RST site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
LEONE'S SERVICE CENTRE LTD	1480 SCOTT ST OTTAWA ON K1Y2N4	141.5	<u>133</u>
LEONE'S SERVICE CENTRE LTD	1480 SCOTT ST OTTAWA ON K1Y 2N4	141.5	<u>133</u>

SCT - Scott's Manufacturing Directory

A search of the SCT database, dated 1992-Mar 2011* has found that there are 19 SCT site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Statistics Canada	120 Parkdale Ave Ottawa ON K1A 0K9	0.0	<u>48</u>
Westrade Construction Ltd.	4 Holland Ave Unit 1B Ottawa ON K1Y 0X4	53.4	<u>92</u>
iStudio Ottawa	11 Holland Ave Suite 715 Ottawa ON K1Y 4S1	102.4	<u>114</u>
E.B. EDDY FOREST PRODUCTS LTD.	1600 SCOTT ST FLOOR 7 OTTAWA ON K1Y 4N7	125.4	<u>126</u>
Domtar Inc.	1600 Scott St Ottawa ON K1Y 4N7	125.4	<u>126</u>
ST-JOSEPH M.O.M. PRINTING	300 Parkdale Ave Ottawa ON K1Y 1G2	183.9	<u>147</u>
Scintrex Trace Corp.	300 Parkdale Ave Ottawa ON K1Y 1G2	183.9	<u>147</u>
M O M PRINTING	300 PARKDALE AVE OTTAWA ON K1Y 1G2	183.9	<u>147</u>
ENTRO BUILDING SYSTEMS INC.	286 HINCHEY AVE OTTAWA ON K1Y 1M2	233.7	<u>179</u>
GRAPHIC DISPLAY CANADA	45 SPENCER ST OTTAWA ON K1Y 2P5	270.3	<u>204</u>
FUJI GRAPHIC SYSTEMS CANADA	45 SPENCER ST OTTAWA ON K1Y 2P5	270.3	<u>204</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
THE ENVELOPE HOUSE	45 SPENCER ST OTTAWA ON K1Y 2P5	270.3	<u>204</u>
GRAPHIC DISPLAY CANADA	45 SPENCER ST OTTAWA ON K1Y 2P5	270.3	<u>204</u>
Graphic Display Canada - A St-Joseph Corporation Company	45 Spencer St Ottawa ON K1Y 2P5	270.3	<u>204</u>
Canadian Criminal Justice Assn	320 Parkdale Ave Suite 101 Ottawa ON K1Y 4X9	282.1	<u>209</u>
Artech Studios	6 Hamilton Ave N Suite 250 Ottawa ON K1Y 4R1	295.2	<u>217</u>
VOGUE BRASSIERE INC.	7 HINTON AVE N OTTAWA ON K1Y 4P1	296.0	<u>219</u>
CANADIAN ARCTIC RESOURCES COMM	7 Hinton Ave N Suite 200 Ottawa ON K1Y 4P1	296.0	<u>219</u>
Canadian Arctic Resources Committee Inc.	7 Hinton Ave N Suite 200 Ottawa ON K1Y 4P1	296.0	<u>219</u>

SPL - Ontario Spills

A search of the SPL database, dated 1988-Sep 2020; Dec 2020-Mar 2021 has found that there are 85 SPL site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
The Department of Public Works<UNOFFICIAL>	50 Chardon Driveway Ottawa ON	0.0	<u>5</u>
	50 Chardon St Ottawa ON	0.0	<u>5</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	50 Chardon Driveway<UNOFFICIAL> Ottawa ON	0.0	<u>5</u>
Public Works and Government Service Canada (PWGSC)	50 Chardon Driveway Ottawa ON	0.0	<u>5</u>
Public Works Government Services Canada	50 Chardon Drive Ottawa ON	0.0	<u>5</u>
	50 Chardon Drive Ottawa ON	0.0	<u>5</u>
Her Majesty the Queen in Right of Canada as Represented by the Minister of	Public Works and Government Services Canada 50 Chardon Driveway Ottawa ON	0.0	<u>5</u>
	151 Tunney's Pasture Driveway Ottawa ON	0.0	<u>7</u>
Public Works and Government Services Canada	Sorrel and Chardon Road, Ottawa BUILDING 13, TUNNEY'S PASTURE CENTRAL HEATING PLANT<UNOFFICIAL> Ottawa ON	0.0	<u>8</u>
	East side of Tunney's Pasture, north of Scott Street Ottawa ON	0.0	<u>9</u>
Plomberie Solutions<UNOFFICIAL>	Ottawa ON	0.0	<u>10</u>
Raymond Roofing<UNOFFICIAL>	100 Eglantine Driveway Ottawa ON	0.0	<u>14</u>
Raymond & Associates Roofing Inc<UNOFFICIAL>	100 Eglantine Driveway Ottawa ON	0.0	<u>14</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
UNKNOWN	ENVIRONMENTAL HEALTH CENTRE TUNNEY'S PASTURE OTTAWA CITY ON	0.0	<u>22</u>
PUBLIC WORKS CANADA	ENVIRONMENTAL HEALTH BUILDING TUNNEY'S PASTURE HEALTH PROTECTION BUILDING (NRC) TUNNEY'S PASTURE, OTTAWA OTTAWA CITY ON	0.0	<u>22</u>
UNKNOWN	BUILDING #8, TUNNEY'S PASTURE ENVIRONMENTAL HEALTH SERVICES. OTTAWA CITY ON	0.0	<u>22</u>
PUC	SOREL ST. AND HOLLAND AVE. OTTAWA CITY ON	0.0	<u>23</u>
Department of National Defence	Department of National Defence Ottawa ON	0.0	<u>25</u>
EllisDon Corporation	129 Yarrow Driveway Ottawa ON	0.0	<u>27</u>
	129 Yarrow Dr Ottawa ON	0.0	<u>27</u>
GAL Power Systems Limited	101 Goldenrod Driveway, Tunney's Pasture Ottawa ON	0.0	<u>29</u>
Public Work Government Service Canada	101 Goldenrod Driveway Ottawa ON	0.0	<u>29</u>
	101 Goldenrod Driveway Ottawa ON	0.0	<u>29</u>
	Tunney's Pasture and Yarrow Driveway Ottawa ON	0.0	<u>31</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	170 Tunney's Pasture Lane STATISTICS CANADA LOADING DOCK<UNOFFICIAL> Ottawa ON	0.0	<u>32</u>
	170 Tunneys Pasture Driveway Ottawa ON	0.0	<u>32</u>
	170 Tunney's Pasture Drive Ottawa ON	0.0	<u>32</u>
	170 Tunneys Pasture Ottawa ON	0.0	<u>32</u>
Waste Connections of Canada Inc.	170 Tunney's Pasture Dr Ottawa ON	0.0	<u>32</u>
	150 Tunneys Pasture Driveway Ottawa ON	0.0	<u>34</u>
Cascades Recovery Inc.	100 Tunney's Pasture Lane Ottawa ON	0.0	<u>35</u>
	100 Tunney's Pasture Driveway Ottawa ON	0.0	<u>35</u>
	70 Colombine Driveway Ottawa ON	0.0	<u>47</u>
	70 Colombine Driveway Ottawa ON K1A 0K9	0.0	<u>47</u>
BROOKFIELD LEPAGE JOHNSON CONT	PROPERTY MANAGEMENT CO. 120 PARKDALE AVE, SUITE 1401, OTTAWA OTTAWA CITY ON K1A 0K9	0.0	<u>48</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
STATISTICS CANADA BUILDING	120 PARKDALE AVE 120 PARDALE AVENUE, OTTAWA OTTAWA CITY ON K1A 0K9	0.0	<u>48</u>
	120 Parkdale Avenue Ottawa ON K1A 1K6	0.0	<u>48</u>
OC Transit (City of Ottawa) <UNOFFICIAL>	1611 Scott St.<UNOFFICIAL> Ottawa ON	5.0	<u>57</u>
	1611 Scott St Ottawa ON	5.0	<u>57</u>
	Scott Street and Parkdale Avenue Ottawa ON	20.5	<u>63</u>
Enbridge Gas Distribution Inc.	121 Parkdale Ave Ottawa ON	22.6	<u>67</u>
	1565 Scott Street Ottawa ON	23.4	<u>68</u>
OC TRANSPO	OC TRANSIT WAY, AT SCOTT & HOLLAND STREETS, TUNNEY'S PASTURE MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON	26.4	<u>71</u>
R.W. Tomlinson Limited	Scott St. at Holland Ave Ottawa ON	26.4	<u>72</u>
	Ottawa ON	26.7	<u>73</u>
	Ottawa ON	27.5	<u>76</u>
Enbridge Energy Distribution Inc.	153 Northwestern Avenue Ottawa ON	40.1	<u>87</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
PRIVATE OWNER	259 PARKDALE AVE. STORAGE TANK/BARREL OTTAWA CITY ON K1Y 1G1	75.2	<u>102</u>
	1748 Scott St Ottawa ON	79.5	<u>104</u>
OLRT Constructors	1446 Scott Street Ottawa ON	85.1	<u>105</u>
	Sir John A Mcdonald Pkwy W and Parkdale Ottawa ON	89.1	<u>106</u>
	234 Northwestern Ave Ottawa ON K1Y 0M3	95.5	<u>109</u>
Petro-Canada Fuels Inc.	36 Ross Street Ottawa ON K1Y 0N3	108.9	<u>119</u>
	23 Clearview Avenue Ottawa ON	134.0	<u>127</u>
Enbridge Energy Distribution Inc.	123 Carleton Ave Ottawa ON	135.2	<u>129</u>
	50 Burnside Ave Ottawa ON	136.7	<u>130</u>
PRIVATE RESIDENCE	RESIDENCE AT 50 PINEHURST OWNED BY MR. MCCARTHY (722-7298) FURNACE OIL TANK OTTAWA CITY ON K1Y 1K4	140.0	<u>131</u>
PRIVATE RESIDENCE	AT RESIDENCE AT 154 HINCHY AVE. FURNACE OIL TANK OTTAWA CITY ON	148.8	<u>134</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
City of Ottawa	NW corner of Scott Street and Hinchey Ave Ottawa ON	167.0	<u>141</u>
PRIVATE RESIDENCE	252 HENCHEY FURNACE OIL TANK OTTAWA CITY ON	172.2	<u>144</u>
PRIVATE OWNER	AT RESIDENCE AT 184 CARLETON AVE. STORAGE TANK/BARREL OTTAWA CITY ON K1Y 0J3	178.3	<u>145</u>
Enbridge Gas Distribution Inc.	47 Gilcrest Avenue Ottawa ON	183.4	<u>146</u>
Waste Connections of Canada Inc. as general partner for and on behalf of Ridge	(Chatham) Holdings L.P. 300 Parkdale Ave Ottawa ON	183.9	<u>147</u>
PRIVATE RESIDENCE	185 HINCHEY AVE. FURNACE OIL TANK OTTAWA CITY ON K1Y 1L6	188.8	<u>150</u>
PRIVATE RESIDENCE	185 HINCHEY FURNACE OIL TANK OTTAWA CITY ON K1Y 1L6	188.8	<u>150</u>
	64 Smirle Ave Ottawa ON	192.9	<u>152</u>
S. 21(1)(f)	58 Carruthers Avenue Ottawa ON K1Y 1N2	218.4	<u>164</u>
	67 Smirle Ave Ottawa ON	219.9	<u>165</u>
	56 Carruthers Avenue Ottawa ON K1Y 1N2	222.4	<u>167</u>
PRIVATE RESIDENCE	20 PINEHURST AVE. FURNACE OIL TANK OTTAWA CITY ON K1Y 1K3	223.7	<u>168</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Enbridge Gas Distribution Inc.	74 Caroline Ave. Ottawa ON	224.9	<u>169</u>
PRIVATE OWNER	1790 SCOTT ST. MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON K1Y 2N7	227.0	<u>172</u>
PRIVATE OWNER	188 CARRUTHERS STREET STORAGE TANK/BARREL OTTAWA CITY ON K1Y 1N7	236.7	<u>184</u>
PRIVATE RESIDENCE	64 GRANGE AVE., RONALD MOLSON FURNACE OIL TANK OTTAWA CITY ON K1Y 0N9	240.9	<u>186</u>
Barbara Connor<UNOFFICIAL>	72 Smirle Avenue Ottawa ON K1Y 0S3	242.7	<u>187</u>
PRIVATE RESIDENCE	129 CARRUTHER ST. STORAGE TANK/BARREL OTTAWA CITY ON K1Y 1N4	251.6	<u>192</u>
PRIVATE RESIDENCE	63 CARRUTHURS AVENUE FURNACE OIL TANK OTTAWA CITY ON	253.1	<u>193</u>
	18 Burnside Ave. OTTAWA HOUSING GARAGE<UNOFFICIAL> Ottawa ON K1Y 4V7	256.0	<u>195</u>
	In front of 55 Carruthers Street<UNOFFICIAL> Ottawa ON K1Y 1N3	259.5	<u>197</u>
Unknown<UNOFFICIAL>	55 Carruthers Ave. Ottawa Ottawa ON	259.5	<u>197</u>
	175 Carruthers Ave, Ottawa Ottawa ON	263.2	<u>199</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
CONTRACTOR	AT RESIDENCE AT 87 GRANGE ST. (OWNER MRS. PENNY BRADY 613-729-1064) (N.O.S.) OTTAWA CITY ON K1Y 0P1	277.8	<u>207</u>
	320 Parkdale Ave Ottawa ON	282.1	<u>209</u>
OTTAWA HYDRO	4 HAMILTON ST. MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON	295.2	<u>217</u>
PRIVATE RESIDENCE	215 CARRUTHERS AVE FURNACE OIL TANK OTTAWA CITY ON K1Y 1N6	297.9	<u>223</u>

WWIS - Water Well Information System


A search of the WWIS database, dated Sep 30, 2021 has found that there are 36 WWIS site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	100 CHARDON DRIVEWAY Ottawa ON	0.0	<u>3</u>
	Well ID: 7315150		
	100 CHARDON DRIVEWAY Ottawa ON	0.0	<u>4</u>
	Well ID: 7315151		
	OTTAWA RIVER PARKWAY OTTAWA ON	0.0	<u>17</u>
	Well ID: 7050791		
	1065 WELLINGTON ST OTTAWA ON	0.0	<u>21</u>
	Well ID: 7044700		
	50 COLOMBINE DRIVEWAY Ottawa ON	0.0	<u>50</u>
	Well ID: 7240370		
	50 COLOMBINE DRIVEWAY Ottawa ON	0.0	<u>52</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	<i>Well ID:</i> 7240369		
	50 COLOMBINE DRIVEWAY Ottawa ON	0.0	<u>53</u>
	<i>Well ID:</i> 7240372		
	50 COLOMBINE DRIVEWAY Ottawa ON	0.0	<u>54</u>
	<i>Well ID:</i> 7240371		
	50 COLOMBINE DRIVEWAY Ottawa ON	0.0	<u>55</u>
	<i>Well ID:</i> 7240373		
	SCOTT ST Ottawa ON	7.9	<u>59</u>
	<i>Well ID:</i> 7119009		
	SCOTTS & CAROLINE AVENUE Ottawa ON	21.5	<u>65</u>
	<i>Well ID:</i> 7253089		
	111 PARKDALE AVENUE 121 Ottawa ON	43.1	<u>89</u>
	<i>Well ID:</i> 7205866		
	ON	54.7	<u>93</u>
	<i>Well ID:</i> 7358345		
	ON	78.2	<u>103</u>
	<i>Well ID:</i> 7358344		
	ON	105.1	<u>116</u>
	<i>Well ID:</i> 1508589		
	_59 Forward Ave Ottawa ON	122.4	<u>124</u>
	<i>Well ID:</i> 7342420		
	ON	200.9	<u>155</u>
	<i>Well ID:</i> 7357175		

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	172 CARRUTHERS ST. ON <i>Well ID:</i> 7145161	203.1	<u>158</u>
	ON <i>Well ID:</i> 7122598	208.9	<u>160</u>
	ON <i>Well ID:</i> 7211100	214.9	<u>162</u>
	52 CARRUTHERS AVE Ottawa ON <i>Well ID:</i> 7201623	221.2	<u>166</u>
	ON <i>Well ID:</i> 7242495	227.4	<u>173</u>
	52 CARRUTHERS AVENUE Ottawa ON <i>Well ID:</i> 7207343	227.6	<u>174</u>
	ON <i>Well ID:</i> 7198961	246.2	<u>189</u>
	55 CARRUTHERS AVENUE OTTAWA ON <i>Well ID:</i> 7264754	268.2	<u>201</u>
	ON <i>Well ID:</i> 7219176	282.0	<u>208</u>
	3 HAMILTON AVE NORTH ON <i>Well ID:</i> 7041972	287.3	<u>210</u>
	3 HAMILTON AVE NORTH ON <i>Well ID:</i> 7041971	291.8	<u>212</u>
	3 HAMILTON AVE NORTH ON	292.4	<u>213</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	<i>Well ID:</i> 7041967		
	3 HAMILTON AVE NORTH ON	293.2	<u>214</u>
	<i>Well ID:</i> 7041975		
	3 HAMILTON AVE NORTH ON	294.3	<u>215</u>
	<i>Well ID:</i> 7041977		
	3 HAMILTON AVE NORTH ON	294.4	<u>216</u>
	<i>Well ID:</i> 7041968		
	3 HAMILTON AVE NORTH ON	295.6	<u>218</u>
	<i>Well ID:</i> 7041970		
	3 HAMILTON AVE NORTH ON	296.7	<u>220</u>
	<i>Well ID:</i> 7041966		
	3 HAMILTON AVE NORTH ON	296.8	<u>221</u>
	<i>Well ID:</i> 7041969		
	7 HINTON AVE. Ottawa ON	298.4	<u>224</u>
	<i>Well ID:</i> 7119461		

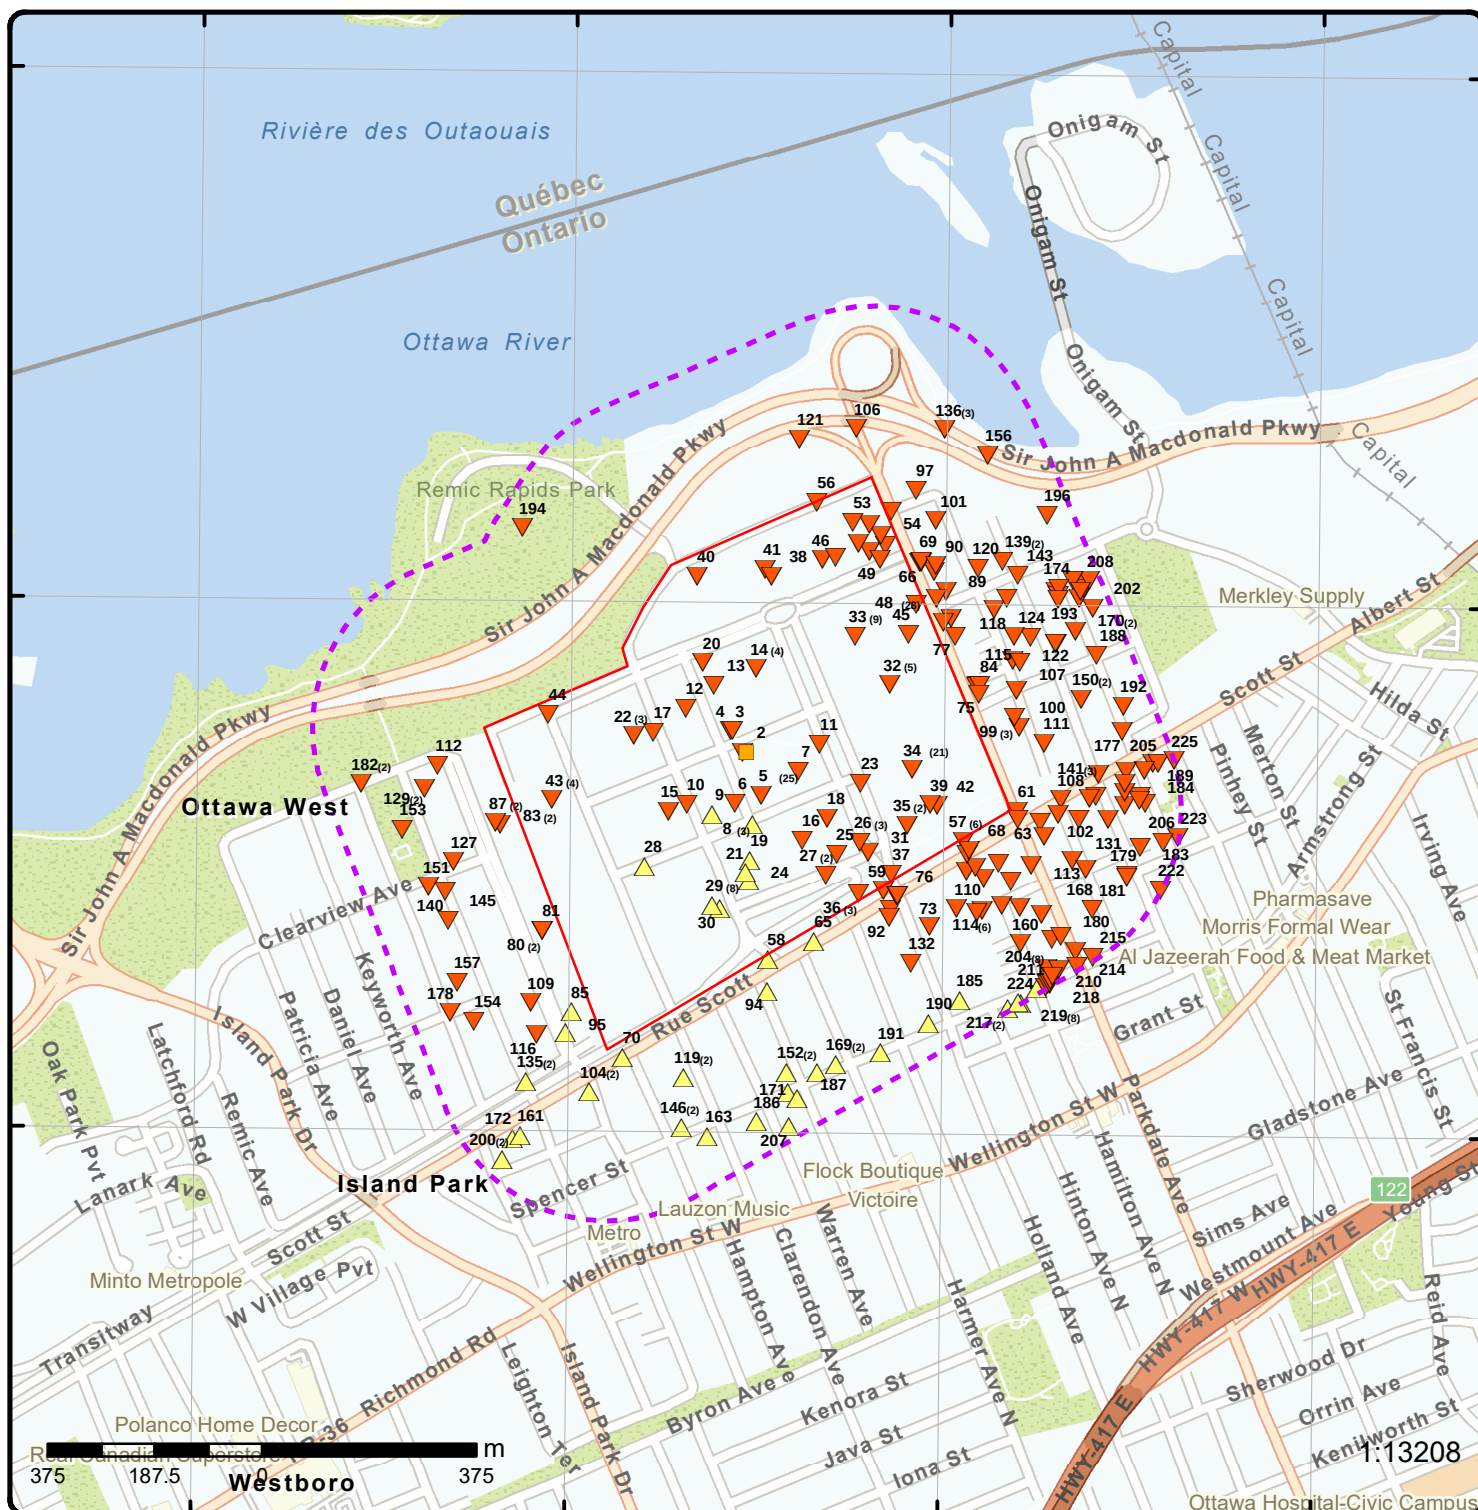

Map: 0.3 Kilometer Radius

Order Number: 22062900235

Address: Tunney's Pasture, Ottawa, ON



Project Property	Freeways; Highways	Beach	Shopping & Sports Area
Buffer Outline	Traffic Circle; Ramp	Airport	University/College
Eris Sites with Higher Elevation	Major Arterial; Minor Arterial	Industrial Area	Cemetery; Golf Course
Eris Sites with Same Elevation	Local Road	Military Base	Parkt (National)
Eris Sites with Lower Elevation	Service Road; Traffic Circle; Ramp	Aircraft Roads	Park (City/County)
Eris Sites with Unknown Elevation	Rail	Native Reservation	
		Hospital	

75°45'W

45°24'N

45°24'N



Aerial

Year: 2021

Order Number: 22062900235

Address: Tunney's Pasture, Ottawa, ON



Source: ESRI World Imagery

© ERIS Information Limited Partnership

75°45'W

75°43'30"W

45°25'30"N

45°25'30"N

45°24'N

45°24'N



Topographic Map

Address: Tunney's Pasture, ON

Source: ESRI World Topographic Map

Order Number: 22062900235



© ERIS Information Limited Partnership

Detail Report

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
1	1 of 15	N/0.0	63.0 / 0.00	HEALTH AND WELFARE CANADA BANTING RESEARCH CENTRE STORES 1 ROSS AVE., TUNNEYS PASTURE OTTAWA ON K1A 0L2	GEN
Generator No:		ON0095600		Status:	
SIC Code:		8693		Co Admin:	
SIC Description:		HEALTH CARE RESEARCH		Choice of Contact:	
Approval Years:		92,93,97		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		148			
Waste Class Desc:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		211			
Waste Class Desc:		AROMATIC SOLVENTS			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		241			
Waste Class Desc:		HALOGENATED SOLVENTS			
Waste Class:		242			
Waste Class Desc:		HALOGENATED PESTICIDES			
Waste Class:		243			
Waste Class Desc:		PCB'S			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		261			
Waste Class Desc:		PHARMACEUTICALS			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		264			
Waste Class Desc:		PHOTOPROCESSING WASTES			
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
Waste Class:		331			
Waste Class Desc:		WASTE COMPRESSED GASES			
1	2 of 15	N/0.0	63.0 / 0.00	GVT. OF CAN. - HEALTH AND WELFARE 18-094 BANTING RESEARCH CENTRE STORES 1 ROSS AVE., TUNNEY PASTURE OTTAWA ON K1A 0L2	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON0095600 SIC Code: 8693 SIC Description: HEALTH CARE RESEARCH Approval Years: 94,95,96 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		148			
Waste Class Desc:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		211			
Waste Class Desc:		AROMATIC SOLVENTS			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		241			
Waste Class Desc:		HALOGENATED SOLVENTS			
Waste Class:		242			
Waste Class Desc:		HALOGENATED PESTICIDES			
Waste Class:		243			
Waste Class Desc:		PCB'S			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		261			
Waste Class Desc:		PHARMACEUTICALS			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		264			
Waste Class Desc:		PHOTOPROCESSING WASTES			
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
Waste Class:		331			
Waste Class Desc:		WASTE COMPRESSED GASES			

[1](#)

3 of 15

N/0.0

63.0 / 0.00

HEALTH AND WELFARE CANADA
BANTING RESEARCH CENTRE STORES 1 ROSS
AVENUE, TUNNEYS PASTURE
OTTAWA ON K1A 0L2

GEN

Generator No: ON0095600
SIC Code: 8693
SIC Description: HEALTH CARE RESEARCH
Approval Years: 98
PO Box No:
Country:

Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Detail(s)

Waste Class: 148
Waste Class Desc: INORGANIC LABORATORY CHEMICALS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		211			
Waste Class Desc:		AROMATIC SOLVENTS			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		241			
Waste Class Desc:		HALOGENATED SOLVENTS			
Waste Class:		242			
Waste Class Desc:		HALOGENATED PESTICIDES			
Waste Class:		243			
Waste Class Desc:		PCB'S			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		261			
Waste Class Desc:		PHARMACEUTICALS			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		264			
Waste Class Desc:		PHOTOPROCESSING WASTES			
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
Waste Class:		331			
Waste Class Desc:		WASTE COMPRESSED GASES			

[1](#)

4 of 15

N/0.0

63.0 / 0.00

HEALTH AND WELFARE CANADA
TUNNEY'S PASTURE 1 ROSS AVENUE
OTTAWA ON K1A 0L2

GEN

Generator No: ON0095600
SIC Code:
SIC Description:
Approval Years: 02,03,04,05,06,07,08
PO Box No:
Country:

Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Detail(s)

Waste Class: 121
Waste Class Desc: ALKALINE WASTES - HEAVY METALS

Waste Class: 112
Waste Class Desc: ACID WASTE - HEAVY METALS

Waste Class: 262
Waste Class Desc: DETERGENTS/SOAPS

Waste Class: 122
Waste Class Desc: ALKALINE WASTES - OTHER METALS

Waste Class: 243
Waste Class Desc: PCB'S

Waste Class: 261
Waste Class Desc: PHARMACEUTICALS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		264			
Waste Class Desc:		PHOTOPROCESSING WASTES			
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
Waste Class:		331			
Waste Class Desc:		WASTE COMPRESSED GASES			
Waste Class:		148			
Waste Class Desc:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		211			
Waste Class Desc:		AROMATIC SOLVENTS			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		241			
Waste Class Desc:		HALOGENATED SOLVENTS			
Waste Class:		242			
Waste Class Desc:		HALOGENATED PESTICIDES			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			

[1](#)

5 of 15

N/0.0

63.0 / 0.00

HEALTH AND WELFARE CANADA
TUNNEY'S PASTURE 1 ROSS AVENUE
OTTAWA ON

GEN

Generator No: ON0095600
SIC Code: 541990
SIC Description: All Other Professional Scientific and Technical Services
Approval Years: 2009
PO Box No:
Country:

Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Detail(s)

Waste Class: 112
Waste Class Desc: ACID WASTE - HEAVY METALS

Waste Class: 121
Waste Class Desc: ALKALINE WASTES - HEAVY METALS

Waste Class: 148
Waste Class Desc: INORGANIC LABORATORY CHEMICALS

Waste Class: 211
Waste Class Desc: AROMATIC SOLVENTS

Waste Class: 212
Waste Class Desc: ALIPHATIC SOLVENTS

Waste Class: 241
Waste Class Desc: HALOGENATED SOLVENTS

Waste Class: 242
Waste Class Desc: HALOGENATED PESTICIDES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		243			
Waste Class Desc:		PCBS			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		261			
Waste Class Desc:		PHARMACEUTICALS			
Waste Class:		262			
Waste Class Desc:		DETERGENTS/SOAPS			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		264			
Waste Class Desc:		PHOTOPROCESSING WASTES			
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
Waste Class:		331			
Waste Class Desc:		WASTE COMPRESSED GASES			

1	6 of 15	N/0.0	63.0 / 0.00	HEALTH AND WELFARE CANADA TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON	GEN
Generator No:	ON0095600			Status:	
SIC Code:	541990			Co Admin:	
SIC Description:	All Other Professional Scientific and Technical Services			Choice of Contact:	
Approval Years:	2010			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	

Detail(s)

Waste Class:	241
Waste Class Desc:	HALOGENATED SOLVENTS
Waste Class:	264
Waste Class Desc:	PHOTOPROCESSING WASTES
Waste Class:	312
Waste Class Desc:	PATHOLOGICAL WASTES
Waste Class:	243
Waste Class Desc:	PCBS
Waste Class:	148
Waste Class Desc:	INORGANIC LABORATORY CHEMICALS
Waste Class:	262
Waste Class Desc:	DETERGENTS/SOAPS
Waste Class:	252
Waste Class Desc:	WASTE OILS & LUBRICANTS
Waste Class:	261
Waste Class Desc:	PHARMACEUTICALS
Waste Class:	331

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Desc:		WASTE COMPRESSED GASES			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		211			
Waste Class Desc:		AROMATIC SOLVENTS			
Waste Class:		112			
Waste Class Desc:		ACID WASTE - HEAVY METALS			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		121			
Waste Class Desc:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		242			
Waste Class Desc:		HALOGENATED PESTICIDES			

1	7 of 15	N/0.0	63.0 / 0.00	HEALTH AND WELFARE CANADA TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON	GEN
Generator No:	ON0095600			Status:	
SIC Code:	541990			Co Admin:	
SIC Description:	All Other Professional Scientific and Technical Services			Choice of Contact:	
Approval Years:	2011			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:	211				
Waste Class Desc:	AROMATIC SOLVENTS				
Waste Class:	252				
Waste Class Desc:	WASTE OILS & LUBRICANTS				
Waste Class:	148				
Waste Class Desc:	INORGANIC LABORATORY CHEMICALS				
Waste Class:	112				
Waste Class Desc:	ACID WASTE - HEAVY METALS				
Waste Class:	243				
Waste Class Desc:	PCBS				
Waste Class:	212				
Waste Class Desc:	ALIPHATIC SOLVENTS				
Waste Class:	241				
Waste Class Desc:	HALOGENATED SOLVENTS				
Waste Class:	331				
Waste Class Desc:	WASTE COMPRESSED GASES				
Waste Class:	264				
Waste Class Desc:	PHOTOPROCESSING WASTES				
Waste Class:	262				
Waste Class Desc:	DETERGENTS/SOAPS				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Desc:		242 HALOGENATED PESTICIDES			
Waste Class: Waste Class Desc:		312 PATHOLOGICAL WASTES			
Waste Class: Waste Class Desc:		263 ORGANIC LABORATORY CHEMICALS			
Waste Class: Waste Class Desc:		121 ALKALINE WASTES - HEAVY METALS			
Waste Class: Waste Class Desc:		261 PHARMACEUTICALS			

<u>1</u>	8 of 15	N/0.0	63.0 / 0.00	HEALTH AND WELFARE CANADA TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON K1A 0M3	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:	ON0095600 541990 All Other Professional Scientific and Technical Services 2012			Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	241 HALOGENATED SOLVENTS				
Waste Class: Waste Class Desc:	112 ACID WASTE - HEAVY METALS				
Waste Class: Waste Class Desc:	211 AROMATIC SOLVENTS				
Waste Class: Waste Class Desc:	121 ALKALINE WASTES - HEAVY METALS				
Waste Class: Waste Class Desc:	261 PHARMACEUTICALS				
Waste Class: Waste Class Desc:	263 ORGANIC LABORATORY CHEMICALS				
Waste Class: Waste Class Desc:	148 INORGANIC LABORATORY CHEMICALS				
Waste Class: Waste Class Desc:	331 WASTE COMPRESSED GASES				
Waste Class: Waste Class Desc:	243 PCBS				
Waste Class: Waste Class Desc:	212 ALIPHATIC SOLVENTS				
Waste Class: Waste Class Desc:	264 PHOTOPROCESSING WASTES				
Waste Class: Waste Class Desc:	252 WASTE OILS & LUBRICANTS				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
Waste Class:		262			
Waste Class Desc:		DETERGENTS/SOAPS			
Waste Class:		242			
Waste Class Desc:		HALOGENATED PESTICIDES			
1	9 of 15	N/0.0	63.0 / 0.00	HEALTH AND WELFARE CANADA TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON	GEN
Generator No:	ON0095600			Status:	
SIC Code:	541990			Co Admin:	
SIC Description:	ALL OTHER PROFESSIONAL, SCIENTIFIC AND TECHNICAL SERVICES			Choice of Contact:	
Approval Years:	2013			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		261			
Waste Class Desc:		PHARMACEUTICALS			
Waste Class:		241			
Waste Class Desc:		HALOGENATED SOLVENTS			
Waste Class:		211			
Waste Class Desc:		AROMATIC SOLVENTS			
Waste Class:		264			
Waste Class Desc:		PHOTOPROCESSING WASTES			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
Waste Class:		242			
Waste Class Desc:		HALOGENATED PESTICIDES			
Waste Class:		243			
Waste Class Desc:		PCBS			
Waste Class:		112			
Waste Class Desc:		ACID WASTE - HEAVY METALS			
Waste Class:		331			
Waste Class Desc:		WASTE COMPRESSED GASES			
Waste Class:		148			
Waste Class Desc:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		122			
Waste Class Desc:		ALKALINE WASTES - OTHER METALS			
Waste Class:		263			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		121			
Waste Class Desc:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		262			
Waste Class Desc:		DETERGENTS/SOAPS			
<u>1</u>	10 of 15	N/0.0	63.0 / 0.00	HEALTH AND WELFARE CANADA TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON K1A 0L2	GEN
Generator No:		ON0095600		Status:	
SIC Code:		541990		Co Admin: Maria Gerdes	
SIC Description:		ALL OTHER PROFESSIONAL, SCIENTIFIC AND TECHNICAL SERVICES		Choice of Contact: CO_ADMIN	
Approval Years:		2016		Phone No Admin: 613617-8706 Ext.	
PO Box No:				Contam. Facility: No	
Country:		Canada		MHSW Facility: No	
<u>Detail(s)</u>					
Waste Class:		122			
Waste Class Desc:		ALKALINE WASTES - OTHER METALS			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
Waste Class:		112			
Waste Class Desc:		ACID WASTE - HEAVY METALS			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
Waste Class:		148			
Waste Class Desc:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		242			
Waste Class Desc:		HALOGENATED PESTICIDES			
Waste Class:		211			
Waste Class Desc:		AROMATIC SOLVENTS			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		145			
Waste Class Desc:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		261			
Waste Class Desc:		PHARMACEUTICALS			
Waste Class:		262			
Waste Class Desc:		DETERGENTS/SOAPS			
Waste Class:		331			
Waste Class Desc:		WASTE COMPRESSED GASES			
Waste Class:		241			
Waste Class Desc:		HALOGENATED SOLVENTS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		264			
Waste Class Desc:		PHOTOPROCESSING WASTES			
Waste Class:		243			
Waste Class Desc:		PCBS			
Waste Class:		121			
Waste Class Desc:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			

1

11 of 15

N/0.0

63.0 / 0.00

HEALTH AND WELFARE CANADA
TUNNEY'S PASTURE 1 ROSS AVENUE
OTTAWA ON K1A 0L2

GEN

Generator No:	ON0095600	Status:	
SIC Code:	541990	Co Admin:	Maria Gerdes
SIC Description:	ALL OTHER PROFESSIONAL, SCIENTIFIC AND TECHNICAL SERVICES	Choice of Contact:	CO_OFFICIAL
Approval Years:	2015	Phone No Admin:	613617-8706 Ext.
PO Box No:		Contam. Facility:	No
Country:	Canada	MHSW Facility:	No

Detail(s)

Waste Class:	264
Waste Class Desc:	PHOTOPROCESSING WASTES
Waste Class:	331
Waste Class Desc:	WASTE COMPRESSED GASES
Waste Class:	251
Waste Class Desc:	OIL SKIMMINGS & SLUDGES
Waste Class:	312
Waste Class Desc:	PATHOLOGICAL WASTES
Waste Class:	243
Waste Class Desc:	PCBS
Waste Class:	148
Waste Class Desc:	INORGANIC LABORATORY CHEMICALS
Waste Class:	212
Waste Class Desc:	ALIPHATIC SOLVENTS
Waste Class:	263
Waste Class Desc:	ORGANIC LABORATORY CHEMICALS
Waste Class:	242
Waste Class Desc:	HALOGENATED PESTICIDES
Waste Class:	262
Waste Class Desc:	DETERGENTS/SOAPS
Waste Class:	122
Waste Class Desc:	ALKALINE WASTES - OTHER METALS
Waste Class:	121
Waste Class Desc:	ALKALINE WASTES - HEAVY METALS
Waste Class:	252
Waste Class Desc:	WASTE OILS & LUBRICANTS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		261			
Waste Class Desc:		PHARMACEUTICALS			
Waste Class:		112			
Waste Class Desc:		ACID WASTE - HEAVY METALS			
Waste Class:		241			
Waste Class Desc:		HALOGENATED SOLVENTS			
Waste Class:		211			
Waste Class Desc:		AROMATIC SOLVENTS			
Waste Class:		145			
Waste Class Desc:		PAINT/PIGMENT/COATING RESIDUES			

<u>1</u>	12 of 15	N/0.0	63.0 / 0.00	HEALTH AND WELFARE CANADA TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON K1A 0L2	GEN
Generator No:	ON0095600			Status:	
SIC Code:	541990			Co Admin:	Joanne M. Lahey
SIC Description:	ALL OTHER PROFESSIONAL, SCIENTIFIC AND TECHNICAL SERVICES			Choice of Contact:	CO_ADMIN
Approval Years:	2014			Phone No Admin:	613-957-1760 Ext.
PO Box No:				Contam. Facility:	No
Country:	Canada			MHSW Facility:	No

Detail(s)

Waste Class:	112
Waste Class Desc:	ACID WASTE - HEAVY METALS
Waste Class:	262
Waste Class Desc:	DETERGENTS/SOAPS
Waste Class:	261
Waste Class Desc:	PHARMACEUTICALS
Waste Class:	241
Waste Class Desc:	HALOGENATED SOLVENTS
Waste Class:	211
Waste Class Desc:	AROMATIC SOLVENTS
Waste Class:	122
Waste Class Desc:	ALKALINE WASTES - OTHER METALS
Waste Class:	145
Waste Class Desc:	PAINT/PIGMENT/COATING RESIDUES
Waste Class:	243
Waste Class Desc:	PCBS
Waste Class:	121
Waste Class Desc:	ALKALINE WASTES - HEAVY METALS
Waste Class:	148
Waste Class Desc:	INORGANIC LABORATORY CHEMICALS
Waste Class:	331
Waste Class Desc:	WASTE COMPRESSED GASES
Waste Class:	264

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Desc:		PHOTOPROCESSING WASTES			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		242			
Waste Class Desc:		HALOGENATED PESTICIDES			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			

<u>1</u>	13 of 15	N/0.0	63.0 / 0.00	HEALTH AND WELFARE CANADA TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON K1A 0L2	GEN
Generator No:	ON0095600			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Dec 2018			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	

Detail(s)

Waste Class:	112 C
Waste Class Desc:	Acid solutions - containing heavy metals
Waste Class:	121 C
Waste Class Desc:	Alkaline slutions - containing heavy metals
Waste Class:	122 C
Waste Class Desc:	Alkaline slutions - containing other metals and non-metals (not cyanide)
Waste Class:	145 I
Waste Class Desc:	Wastes from the use of pigments, coatings and paints
Waste Class:	145 T
Waste Class Desc:	Wastes from the use of pigments, coatings and paints
Waste Class:	146 T
Waste Class Desc:	Other specified inorganic sludges, slurries or solids
Waste Class:	148 A
Waste Class Desc:	Misc. wastes and inorganic chemicals
Waste Class:	148 C
Waste Class Desc:	Misc. wastes and inorganic chemicals
Waste Class:	148 I
Waste Class Desc:	Misc. wastes and inorganic chemicals
Waste Class:	148 R
Waste Class Desc:	Misc. wastes and inorganic chemicals
Waste Class:	211 H

<i>Map Key</i>	<i>Number of Records</i>	<i>Direction/ Distance (m)</i>	<i>Elev/Diff (m)</i>	<i>Site</i>	<i>DB</i>
Waste Class Desc:		Aromatic solvents and residues			
Waste Class:		212 H			
Waste Class Desc:		Aliphatic solvents and residues			
Waste Class:		212 L			
Waste Class Desc:		Aliphatic solvents and residues			
Waste Class:		241 H			
Waste Class Desc:		Halogenated solvents and residues			
Waste Class:		242 B			
Waste Class Desc:		Halogenated pesticides and herbicides			
Waste Class:		243 D			
Waste Class Desc:		PCB			
Waste Class:		251 L			
Waste Class Desc:		Waste oils/sludges (petroleum based)			
Waste Class:		252 L			
Waste Class Desc:		Waste crankcase oils and lubricants			
Waste Class:		261 A			
Waste Class Desc:		Pharmaceuticals			
Waste Class:		262 L			
Waste Class Desc:		Detergents and soaps			
Waste Class:		263 A			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		263 B			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		263 I			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		263 L			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		263 R			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		264 C			
Waste Class Desc:		Photoprocessing wastes			
Waste Class:		264 T			
Waste Class Desc:		Photoprocessing wastes			
Waste Class:		312 P			
Waste Class Desc:		Pathological wastes			
Waste Class:		331 I			
Waste Class Desc:		Waste compressed gases including cylinders			
<u>1</u>	14 of 15	N/0.0	63.0 / 0.00	HEALTH AND WELFARE CANADA TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON K1A 0L2	GEN
Generator No:	ON0095600			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Jul 2020			Phone No Admin:	
PO Box No:				Contam. Facility:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Country:		Canada		MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		148 R			
Waste Class Desc:		Misc. wastes and inorganic chemicals			
Waste Class:		212 L			
Waste Class Desc:		Aliphatic solvents and residues			
Waste Class:		252 L			
Waste Class Desc:		Waste crankcase oils and lubricants			
Waste Class:		121 C			
Waste Class Desc:		Alkaline slutions - containing heavy metals			
Waste Class:		146 T			
Waste Class Desc:		Other specified inorganic sludges, slurries or solids			
Waste Class:		212 H			
Waste Class Desc:		Aliphatic solvents and residues			
Waste Class:		264 C			
Waste Class Desc:		Photoprocessing wastes			
Waste Class:		148 C			
Waste Class Desc:		Misc. wastes and inorganic chemicals			
Waste Class:		263 B			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		263 R			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		312 P			
Waste Class Desc:		Pathological wastes			
Waste Class:		251 L			
Waste Class Desc:		Waste oils/sludges (petroleum based)			
Waste Class:		145 T			
Waste Class Desc:		Wastes from the use of pigments, coatings and paints			
Waste Class:		145 I			
Waste Class Desc:		Wastes from the use of pigments, coatings and paints			
Waste Class:		263 L			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		331 I			
Waste Class Desc:		Waste compressed gases including cylinders			
Waste Class:		122 C			
Waste Class Desc:		Alkaline slutions - containing other metals and non-metals (not cyanide)			
Waste Class:		264 T			
Waste Class Desc:		Photoprocessing wastes			
Waste Class:		241 H			
Waste Class Desc:		Halogenated solvents and residues			
Waste Class:		211 H			
Waste Class Desc:		Aromatic solvents and residues			
Waste Class:		148 A			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Desc:		Misc. wastes and inorganic chemicals			
Waste Class:		262 L			
Waste Class Desc:		Detergents and soaps			
Waste Class:		148 I			
Waste Class Desc:		Misc. wastes and inorganic chemicals			
Waste Class:		112 C			
Waste Class Desc:		Acid solutions - containing heavy metals			
Waste Class:		263 I			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		263 A			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		261 A			
Waste Class Desc:		Pharmaceuticals			
Waste Class:		242 B			
Waste Class Desc:		Halogenated pesticides and herbicides			
Waste Class:		243 D			
Waste Class Desc:		PCB			

1

15 of 15

N/0.0

63.0 / 0.00

HEALTH CANADA
TUNNEY'S PASTURE 1 ROSS AVENUE
OTTAWA ON K1A 0L2

GEN

Generator No:	ON0095600	Status:	Registered
SIC Code:		Co Admin:	
SIC Description:		Choice of Contact:	
Approval Years:	As of Nov 2021	Phone No Admin:	
PO Box No:		Contam. Facility:	
Country:	Canada	MHSW Facility:	

Detail(s)

Waste Class:	112 C
Waste Class Desc:	Acid solutions - containing heavy metals
Waste Class:	251 L
Waste Class Desc:	Waste oils/sludges (petroleum based)
Waste Class:	148 C
Waste Class Desc:	Misc. wastes and inorganic chemicals
Waste Class:	264 C
Waste Class Desc:	Photoprocessing wastes
Waste Class:	262 L
Waste Class Desc:	Detergents and soaps
Waste Class:	242 B
Waste Class Desc:	Halogenated pesticides and herbicides
Waste Class:	148 I
Waste Class Desc:	Misc. wastes and inorganic chemicals
Waste Class:	264 T
Waste Class Desc:	Photoprocessing wastes
Waste Class:	312 P

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Desc:		Pathological wastes			
Waste Class:		263 B			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		145 T			
Waste Class Desc:		Wastes from the use of pigments, coatings and paints			
Waste Class:		122 C			
Waste Class Desc:		Alkaline slutions - containing other metals and non-metals (not cyanide)			
Waste Class:		241 H			
Waste Class Desc:		Halogenated solvents and residues			
Waste Class:		252 T			
Waste Class Desc:		Waste crankcase oils and lubricants			
Waste Class:		121 C			
Waste Class Desc:		Alkaline slutions - containing heavy metals			
Waste Class:		331 I			
Waste Class Desc:		Waste compressed gases including cylinders			
Waste Class:		148 A			
Waste Class Desc:		Misc. wastes and inorganic chemicals			
Waste Class:		263 I			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		263 L			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		212 L			
Waste Class Desc:		Aliphatic solvents and residues			
Waste Class:		243 D			
Waste Class Desc:		PCB			
Waste Class:		263 R			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		148 R			
Waste Class Desc:		Misc. wastes and inorganic chemicals			
Waste Class:		146 T			
Waste Class Desc:		Other specified inorganic sludges, slurries or solids			
Waste Class:		148 L			
Waste Class Desc:		Misc. wastes and inorganic chemicals			
Waste Class:		261 A			
Waste Class Desc:		Pharmaceuticals			
Waste Class:		252 L			
Waste Class Desc:		Waste crankcase oils and lubricants			
Waste Class:		211 H			
Waste Class Desc:		Aromatic solvents and residues			
Waste Class:		145 I			
Waste Class Desc:		Wastes from the use of pigments, coatings and paints			
Waste Class:		212 H			
Waste Class Desc:		Aliphatic solvents and residues			
Waste Class:		148 B			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Desc:		Misc. wastes and inorganic chemicals			
Waste Class:		263 A			
Waste Class Desc:		Misc. waste organic chemicals			
2	1 of 1	NW/0.0	62.2 / -0.84	Tunney's Pasture Ottawa ON	EHS
Order No:		20190814111		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Custom Report		Client Prov/State: ON	
Report Date:		21-AUG-19		Search Radius (km): .25	
Date Received:		14-AUG-19		X: -75.737827	
Previous Site Name:				Y: 45.40597	
Lot/Building Size:					
Additional Info Ordered:		Title Searches; City Directory			
3	1 of 1	NW/0.0	61.9 / -1.15	100 CHARDON DRIVEWAY Ottawa ON	WWIS
Well ID:		7315150		Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:		Not Used		Date Received: 7/20/2018	
Sec. Water Use:				Selected Flag: TRUE	
Final Well Status:		Abandoned-Other		Abandonment Rec: Yes	
Water Type:				Contractor: 7417	
Casing Material:				Form Version: 7	
Audit No:		Z284964		Owner:	
Tag:				Street Name: 100 CHARDON DRIVEWAY	
Construction Method:				County: OTTAWA	
Elevation (m):				Municipality: OTTAWA CITY	
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/731\7315150.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2018/06/06			
Year Completed:		2018			
Depth (m):					
Latitude:		45.4063117088895			
Longitude:		-75.7380497808984			
Path:		731\7315150.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1007214719		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone: 18	
Code OB:				East83: 442243.00	
Code OB Desc:				North83: 5028353.00	
Open Hole:				Org CS: UTM83	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Cluster Kind:			UTMRC:	4	
Date Completed:	06-Jun-2018 00:00:00		UTMRC Desc:	margin of error : 30 m - 100 m	
Remarks:			Location Method:	wwr	
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID: 1007410001					
Layer:					
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM: ft					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID: 1007410008					
Layer: 1					
Plug From:					
Plug To:					
Plug Depth UOM: ft					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID: 1007410009					
Layer: 1					
Plug From: 0.0					
Plug To: 2.4000000953674316					
Plug Depth UOM: ft					
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID: 1007410007					
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID: 1007410000					
Casing No: 0					
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing ID:		1007410004			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:					
Casing Diameter:		3.809999942779541			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1007410005			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
 <u>Water Details</u>					
Water ID:		1007410003			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
 <u>Hole Diameter</u>					
Hole ID:		1007410002			
Diameter:		3.809999942779541			
Depth From:		0.0			
Depth To:		2.4000000953674316			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>4</u>	1 of 1	NW/0.0	61.9 / -1.15	100 CHARDON DRIVEWAY Ottawa ON	WWIS
Well ID:	7315151			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:	Not Used			Date Received:	7/20/2018
Sec. Water Use:	Monitoring			Selected Flag:	TRUE
Final Well Status:	Abandoned-Other			Abandonment Rec:	Yes
Water Type:				Contractor:	7417
Casing Material:				Form Version:	7
Audit No:	Z284965			Owner:	
Tag:				Street Name:	100 CHARDON DRIVEWAY
Construction				County:	OTTAWA
Method:				Municipality:	OTTAWA CITY
Elevation (m):				Site Info:	
Elevation Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Flowing (Y/N):			Zone:		
Flow Rate:			UTM Reliability:		
Clear/Cloudy:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2018/06/06			
Year Completed:		2018			
Depth (m):					
Latitude:		45.4063113786161			
Longitude:		-75.7381008907681			
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:		1007214722		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		06-Jun-2018 00:00:00		UTMRC Desc:	
Remarks:				Location Method:	
Elevrc Desc:				margin of error : 30 m - 100 m	
Location Source Date:				wwr	
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007410017			
Layer:					
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007410025			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1007410026			
Layer:		1			
Plug From:		0.0			
Plug To:		6.0			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007410024			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007410016			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007410020			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:					
Casing Diameter:		3.809999942779541			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007410021			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1007410019			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007410018			
Diameter:		3.809999942779541			
Depth From:		0.0			
Depth To:		6.0			
Hole Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole Diameter UOM:		cm			
5	1 of 25	SSE/0.0	62.9 / -0.15	PUBLIC WORKS AND GOVERNEMENT SERVICES CANADA 50 CHARDON DRIVE CORNER OF SOREL/DU CHARDON OTTAWA ON K1A0M3	NPRI
NPRI ID: 10177		Org ID: 63269			
Other ID: *		Submit Date: 5/28/2004			
No Other ID:		Last Modified: 5/29/2015 3:28:24 PM			
Track ID: 75260		Contact ID: 226165			
Report ID: 155667		Cont Type: MED			
Report Type: NPRI		Contact Title:			
Rpt Type ID: 1		Cont First Name: WENDELL			
Report Year: 2003		Cont Last Name: WILSON			
Not-Current Rpt?: No		Contact Position: MANAGER OF UTILITES MANAGEMENT SERVICES			
Yr of Last Filed Rpt: 2012		Contact Fax: 8197754911			
Fac ID: 150118		Contact Ph.: 8197754141			
Fac Name: TUNNEY'S PASTURE CENTRAL HEATING AND COOLING PLANT		Cont Area Code: 819			
Fac Address1: 50 CHARDON DRIVE		Contact Tel.: 97754141			
Fac Address2: CORNER OF SOREL/DU CHARDON		Contact Ext.:			
Fac Postal Zip: K1A0M3		Cont Fax Area Cde: 819			
Facility Lat: 45.4053		Contact Fax: 97754911			
Facility Long: -75.7374		Contact Email: WENDELL.WILSON@PWGSC.GC.CA			
DLS (Last Filed Rpt):		Latitude: 45.4053			
Facility DLS:		Longitude: -75.7374			
Datum: 1983		UTM Zone:			
Facility Cmnts: Fals		UTM Northing:			
URL:		UTM Easting:			
No of Empl.: 12		Waste Streams: True			
Parent Co.: *		No Streams:			
No Parent Co.: 1		Waste Off Sites: False			
Pollut Prev Cmnts: Fals		No Off Sites:			
Stacks: True		Shutdown: True			
No of Stacks:		No of Shutdown:			
Canadian SIC Code (2 digit):					
Canadian SIC Code:					
SIC Code Description:					
American SIC Code:					
NAICS Code (2 digit): 91					
NAICS 2 Description: Public administration					
NAICS Code (4 digit): 9119					
NAICS 4 Description: Other federal government public administration					
NAICS Code (6 digit): 911910					
NAICS 6 Description: Other federal government public administration					
<u>Substance Release Report</u>					
Category Type ID: 1					
Category Type Desc: Stack / Point					
Category Type Desc (fr): Rejets de cheminée ou ponctuels					
Grouping: Total Air					
Trans Code: ASa					
Chem: Nitrogen oxides (expressed as NO2)					
Chem (fr): Oxydes d'azote (exprimés en NO2)					
Quantity: 25.719					
Unit: tonnes					
Basis of Estimate Cd: E2					
Basis of Estimate Desc: E2- Published Emission Factors - In use from 2003 and onward					
Category Type ID: 1					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Category Type Desc:		Stack / Point			
Category Type Desc (fr):		Rejets de cheminée ou ponctuels			
Grouping:		Total Air			
Trans Code:		ASta			
Chem:		PM2.5 - Particulate Matter <= 2.5 Microns			
Chem (fr):		PM2,5 - Matière particulaire <= 2,5 microns			
Quantity:		1.649			
Unit:		tonnes			
Basis of Estimate Cd:		E2			
Basis of Estimate Desc:		E2- Published Emission Factors - In use from 2003 and onward			
Category Type ID:		1			
Category Type Desc:		Stack / Point			
Category Type Desc (fr):		Rejets de cheminée ou ponctuels			
Grouping:		Total Air			
Trans Code:		ASta			
Chem:		PM10 - Particulate Matter <= 10 Microns			
Chem (fr):		PM10 - Matière particulaire <= 10 microns			
Quantity:		2.947			
Unit:		tonnes			
Basis of Estimate Cd:		E2			
Basis of Estimate Desc:		E2- Published Emission Factors - In use from 2003 and onward			
Category Type ID:		1			
Category Type Desc:		Stack / Point			
Category Type Desc (fr):		Rejets de cheminée ou ponctuels			
Grouping:		Total Air			
Trans Code:		ASta			
Chem:		Sulphur dioxide			
Chem (fr):		Dioxyde de soufre			
Quantity:		30.977			
Unit:		tonnes			
Basis of Estimate Cd:		E2			
Basis of Estimate Desc:		E2- Published Emission Factors - In use from 2003 and onward			
5	2 of 25	SSE/0.0	62.9 / -0.15	PUBLIC WORKS AND GOVERNMENT SERVICES CANADA 50 CHARDON DRIVE CORNER OF SOREL/DU CHARDON OTTAWA ON K1A0M3	NPRI
NPRI ID:	10177			Org ID:	102764
Other ID:	*			Submit Date:	7/4/2005
No Other ID:				Last Modified:	5/29/2015 3:28:24 PM
Track ID:	32149			Contact ID:	226165
Report ID:	92187			Cont Type:	MED
Report Type:	NPRI			Contact Title:	
Rpt Type ID:	1			Cont First Name:	WENDELL
Report Year:	2004			Cont Last Name:	WILSON
Not-Current Rpt?:	No			Contact Position:	MANAGER OF UTILITES MANAGEMENT SERVICES
Yr of Last Filed Rpt:	2012			Contact Fax:	8197754911
Fac ID:	150118			Contact Ph.:	8197754141
Fac Name:	TUNNEY'S PASTURE CENTRAL HEATING AND COOLING PLANT			Cont Area Code:	819
Fac Address1:	50 CHARDON DRIVE			Contact Tel.:	97754141
Fac Address2:	CORNER OF SOREL/DU CHARDON			Contact Ext.:	
Fac Postal Zip:	K1A0M3			Cont Fax Area Cde:	819
Facility Lat:	45.4053			Contact Fax:	97754911
Facility Long:	-75.7374			Contact Email:	WENDELL.WILSON@PWGSC.GC.CA
DLS (Last Filed Rpt):				Latitude:	45.4053
Facility DLS:				Longitude:	-75.7374
Datum:	1983			UTM Zone:	
Facility Cmnts:	True			UTM Northing:	
URL:				UTM Easting:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
No of Empl.: 16 Parent Co.: N No Parent Co.: Pollut Prev Cmnts: True Stacks: No No of Stacks: Canadian SIC Code (2 digit): Canadian SIC Code: SIC Code Description: American SIC Code: NAICS Code (2 digit): 91 NAICS 2 Description: Public administration NAICS Code (4 digit): 9119 NAICS 4 Description: Other federal government public administration NAICS Code (6 digit): 911910 NAICS 6 Description: Other federal government public administration Waste Streams: False No Streams: Waste Off Sites: False No Off Sites: Shutdown: No of Shutdown:					
<u>Substance Release Report</u>					
Category Type ID: 1 Category Type Desc: Stack / Point Category Type Desc (fr): Rejets de cheminée ou ponctuels Grouping: Total Air Trans Code: ASta Chem: Sulphur dioxide Chem (fr): Dioxyde de soufre Quantity: 22.649 Unit: tonnes Basis of Estimate Cd: E2 Basis of Estimate Desc: E2- Published Emission Factors - In use from 2003 and onward					
Category Type ID: 1 Category Type Desc: Stack / Point Category Type Desc (fr): Rejets de cheminée ou ponctuels Grouping: Total Air Trans Code: ASta Chem: PM10 - Particulate Matter <= 10 Microns Chem (fr): PM10 - Matière particulaire <= 10 microns Quantity: 2.136 Unit: tonnes Basis of Estimate Cd: E2 Basis of Estimate Desc: E2- Published Emission Factors - In use from 2003 and onward					
Category Type ID: 1 Category Type Desc: Stack / Point Category Type Desc (fr): Rejets de cheminée ou ponctuels Grouping: Total Air Trans Code: ASta Chem: PM2.5 - Particulate Matter <= 2.5 Microns Chem (fr): PM2,5 - Matière particulaire <= 2,5 microns Quantity: 1.201 Unit: tonnes Basis of Estimate Cd: E2 Basis of Estimate Desc: E2- Published Emission Factors - In use from 2003 and onward					
5	3 of 25	SSE/0.0	62.9 / -0.15	PUBLIC WORKS AND GOVERNMENT SERVICES CANADA 50 CHARDON DRIVE CORNER OF SOREL/DU CHARDON OTTAWA ON K1A0M3	NPRI
NPRI ID: 10177 Other ID: * No Other ID: Org ID: 102764 Submit Date: 5/31/2006 Last Modified: 5/29/2015 3:28:24 PM					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Track ID:	39760			Contact ID:	226163
Report ID:	100447			Cont Type:	MED
Report Type:	NPRI			Contact Title:	
Rpt Type ID:	1			Cont First Name:	WENDELL
Report Year:	2005			Cont Last Name:	WILSON
Not-Current Rpt?:	No			Contact Position:	MANAGER OF UTILITES MANAGEMENT SERVICES
Yr of Last Filed Rpt:	2012			Contact Fax:	6137754911
Fac ID:	150118			Contact Ph.:	6137754141
Fac Name:	TUNNEY'S PASTURE CENTRAL HEATING AND COOLING PLANT			Cont Area Code:	613
Fac Address1:	50 CHARDON DRIVE			Contact Tel.:	37754141
Fac Address2:	CORNER OF SOREL/DU CHARDON			Contact Ext.:	
Fac Postal Zip:	K1A0M3			Cont Fax Area Cde:	613
Facility Lat:	45.4053			Contact Fax:	37754911
Facility Long:	-75.7374			Contact Email:	WENDELL.WILSON@PWGSC.GC.CA
DLS (Last Filed Rpt):				Latitude:	45.4053
Facility DLS:				Longitude:	-75.7374
Datum:	1983			UTM Zone:	
Facility Cmnts:	False			UTM Northing:	
URL:				UTM Easting:	
No of Empl.:	14			Waste Streams:	False
Parent Co.:	N			No Streams:	
No Parent Co.:				Waste Off Sites:	False
Pollut Prev Cmnts:	False			No Off Sites:	
Stacks:	False			Shutdown:	
No of Stacks:				No of Shutdown:	
Canadian SIC Code (2 digit):					
Canadian SIC Code:					
SIC Code Description:					
American SIC Code:					
NAICS Code (2 digit):	91				
NAICS 2 Description:	Public administration				
NAICS Code (4 digit):	9119				
NAICS 4 Description:	Other federal government public administration				
NAICS Code (6 digit):	911910				
NAICS 6 Description:	Other federal government public administration				

Substance Release Report

Category Type ID: 1
Category Type Desc: Stack / Point
Category Type Desc (fr): Rejets de cheminée ou ponctuels
Grouping: Total Air
Trans Code: ASta
Chem: PM10 - Particulate Matter <= 10 Microns
Chem (fr): PM10 - Matière particulaire <= 10 microns
Quantity: 2.043
Unit: tonnes
Basis of Estimate Cd: E2
Basis of Estimate Desc: E2- Published Emission Factors - In use from 2003 and onward

Category Type ID: 1
Category Type Desc: Stack / Point
Category Type Desc (fr): Rejets de cheminée ou ponctuels
Grouping: Total Air
Trans Code: ASta
Chem: PM2.5 - Particulate Matter <= 2.5 Microns
Chem (fr): PM2,5 - Matière particulaire <= 2,5 microns
Quantity: 1.017
Unit: tonnes
Basis of Estimate Cd: E2
Basis of Estimate Desc: E2- Published Emission Factors - In use from 2003 and onward

Category Type ID: 1

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Category Type Desc:		Stack / Point			
Category Type Desc (fr):		Rejets de cheminée ou ponctuels			
Grouping:		Total Air			
Trans Code:		ASta			
Chem:		Nitrogen oxides (expressed as NO2)			
Chem (fr):		Oxydes d'azote (exprimés en NO2)			
Quantity:		22.727			
Unit:		tonnes			
Basis of Estimate Cd:		E2			
Basis of Estimate Desc:		E2- Published Emission Factors - In use from 2003 and onward			

5	4 of 25	SSE/0.0	62.9 / -0.15	PUBLIC WORKS AND GOVERNMENT SERVICES CANADA 50 CHARDON DRIVE CORNER OF SOREL/DU CHARDON OTTAWA ON K1A0M3	NPRI
NPRI ID:		10177	Org ID:		
Other ID:		*	Submit Date:		
No Other ID:			Last Modified:		
Track ID:		50044	Contact ID:		
Report ID:		110326	Cont Type:		
Report Type:		NPRI	Contact Title:		
Rpt Type ID:		1	Cont First Name:		
Report Year:		2006	Cont Last Name:		
Not-Current Rpt?:		No	Contact Position:		
Yr of Last Filed Rpt:		2012	Contact Fax:		
Fac ID:		150118	Contact Ph.:		
Fac Name:		TUNNEY'S PASTURE CENTRAL HEATING AND COOLING PLANT	Cont Area Code:		
Fac Address1:		50 CHARDON DRIVE	Contact Tel.:		
Fac Address2:		CORNER OF SOREL/DU CHARDON	Contact Ext.:		
Fac Postal Zip:		K1A0M3	Cont Fax Area Cde:		
Facility Lat:		45.4053	Contact Fax:		
Facility Long:		-75.7374	Contact Email:		
DLS (Last Filed Rpt):			Latitude:		
Facility DLS:			Longitude:		
Datum:		1983	UTM Zone:		
Facility Cmnts:		False	UTM Northing:		
URL:			UTM Easting:		
No of Empl.:		14	Waste Streams:		
Parent Co.:		N	No Streams:		
No Parent Co.:			Waste Off Sites:		
Pollut Prev Cmnts:		False	No Off Sites:		
Stacks:		True	Shutdown:		
No of Stacks:			No of Shutdown:		
Canadian SIC Code (2 digit):					
Canadian SIC Code:					
SIC Code Description:					
American SIC Code:					
NAICS Code (2 digit):		91			
NAICS 2 Description:		Public administration			
NAICS Code (4 digit):		9119			
NAICS 4 Description:		Other federal government public administration			
NAICS Code (6 digit):		911910			
NAICS 6 Description:		Other federal government public administration			

Substance Release Report

Category Type ID:	1
Category Type Desc:	Stack / Point
Category Type Desc (fr):	Rejets de cheminée ou ponctuels
Grouping:	Total Air

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Trans Code:		ASta			
Chem:		PM10 - Particulate Matter <= 10 Microns			
Chem (fr):		PM10 - Matière particulaire <= 10 microns			
Quantity:		1.053			
Unit:		tonnes			
Basis of Estimate Cd:		E2			
Basis of Estimate Desc:		E2- Published Emission Factors - In use from 2003 and onward			
Category Type ID:		13			
Category Type Desc:		All Media			
Category Type Desc (fr):		Rejets à tous les médias			
Grouping:		Total All Media<1t			
Trans Code:					
Chem:		PM2.5 - Particulate Matter <= 2.5 Microns			
Chem (fr):		PM2,5 - Matière particulaire <= 2,5 microns			
Quantity:		.381			
Unit:		tonnes			
Basis of Estimate Cd:					
Basis of Estimate Desc:					
Category Type ID:		1			
Category Type Desc:		Stack / Point			
Category Type Desc (fr):		Rejets de cheminée ou ponctuels			
Grouping:		Total Air			
Trans Code:		ASta			
Chem:		Nitrogen oxides (expressed as NO2)			
Chem (fr):		Oxydes d'azote (exprimés en NO2)			
Quantity:		17.258			
Unit:		tonnes			
Basis of Estimate Cd:		E2			
Basis of Estimate Desc:		E2- Published Emission Factors - In use from 2003 and onward			
<u>5</u>	5 of 25	SSE/0.0	62.9 / -0.15	PUBLIC WORKS AND GOVERNMENT SERVICES CANADA 50 CHARDON DRIVE CORNER OF SOREL/DU CHARDON OTTAWA ON K1A0M3	NPRI
NPRI ID:	10177			Org ID:	102764
Other ID:	*			Submit Date:	5/27/2008
No Other ID:				Last Modified:	5/29/2015 3:28:24 PM
Track ID:	54114			Contact ID:	141102
Report ID:	117432			Cont Type:	MED
Report Type:	NPRI			Contact Title:	
Rpt Type ID:	1			Cont First Name:	DENIS
Report Year:	2007			Cont Last Name:	GOUR
Not-Current Rpt?:	No			Contact Position:	MANAGER OF UTILITES MANAGEMENT SERVICES
Yr of Last Filed Rpt:	2012			Contact Fax:	6137754911
Fac ID:	150118			Contact Ph.:	6137754141
Fac Name:	TUNNEY'S PASTURE CENTRAL HEATING AND COOLING PLANT			Cont Area Code:	613
Fac Address1:	50 CHARDON DRIVE			Contact Tel.:	37754141
Fac Address2:	CORNER OF SOREL/DU CHARDON			Contact Ext.:	
Fac Postal Zip:	K1A0M3			Cont Fax Area Cde:	613
Facility Lat:	45.4053			Contact Fax:	37754911
Facility Long:	-75.7374			Contact Email:	DENIS.GOUR@PWGSC.GC.CA
DLS (Last Filed Rpt):				Latitude:	45.4053
Facility DLS:				Longitude:	-75.7374
Datum:	1983			UTM Zone:	
Facility Cmnts:	False			UTM Northing:	
URL:				UTM Easting:	
No of Empl.:	14			Waste Streams:	True¿
Parent Co.:	N			No Streams:	
No Parent Co.:				Waste Off Sites:	True¿

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pollut Prev Cmnts: False Stacks: True No of Stacks: Canadian SIC Code (2 digit): Canadian SIC Code: SIC Code Description: American SIC Code: NAICS Code (2 digit): 91 NAICS 2 Description: Public administration NAICS Code (4 digit): 9119 NAICS 4 Description: Other federal government public administration NAICS Code (6 digit): 911910 NAICS 6 Description: Other federal government public administration					
No Off Sites: Shutdown: No of Shutdown:					
<u>Substance Release Report</u>					
Category Type ID: 1 Category Type Desc: Stack / Point Category Type Desc (fr): Rejets de cheminée ou ponctuels Grouping: Total Air Trans Code: ASta Chem: PM10 - Particulate Matter <= 10 Microns Chem (fr): PM10 - Matière particulaire <= 10 microns Quantity: 1.03 Unit: tonnes Basis of Estimate Cd: E2 Basis of Estimate Desc: E2- Published Emission Factors - In use from 2003 and onward					
Category Type ID: 1 Category Type Desc: Stack / Point Category Type Desc (fr): Rejets de cheminée ou ponctuels Grouping: Total Air Trans Code: ASta Chem: Nitrogen oxides (expressed as NO2) Chem (fr): Oxydes d'azote (exprimés en NO2) Quantity: 18.252 Unit: tonnes Basis of Estimate Cd: E2 Basis of Estimate Desc: E2- Published Emission Factors - In use from 2003 and onward					
Category Type ID: 13 Category Type Desc: All Media Category Type Desc (fr): Rejets à tous les médias Grouping: Total All Media<1t Trans Code: Chem: PM2.5 - Particulate Matter <= 2.5 Microns Chem (fr): PM2,5 - Matière particulaire <= 2,5 microns Quantity: .337 Unit: tonnes Basis of Estimate Cd: Basis of Estimate Desc:					
5	6 of 25	SSE/0.0	62.9 / -0.15	PUBLIC WORKS AND GOVERNMENT SERVICES CANADA 50 CHARDON DRIVE CORNER OF SOREL/DU CHARDON OTTAWA ON K1A0M3	NPRI
NPRI ID: 10177 Other ID: * No Other ID: Track ID: 67524 Report ID: 124159 Report Type: NPRI					
Org ID: 102764 Submit Date: 5/29/2009 Last Modified: 5/29/2015 3:28:24 PM Contact ID: 201066 Cont Type: MED Contact Title:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Rpt Type ID:	1			Cont First Name:	RALPH
Report Year:	2008			Cont Last Name:	GREENOUGH
Not-Current Rpt?:	No			Contact Position:	A/MANAGER OF UTILITES MANAGEMENT SERVICES
Yr of Last Filed Rpt:	2012			Contact Fax:	6137754911
Fac ID:	150118			Contact Ph.:	6137754141
Fac Name:	TUNNEY'S PASTURE CENTRAL HEATING AND COOLING PLANT			Cont Area Code:	613
Fac Address1:	50 CHARDON DRIVE			Contact Tel.:	37754141
Fac Address2:	CORNER OF SOREL/DU CHARDON			Contact Ext.:	
Fac Postal Zip:	K1A0M3			Cont Fax Area Cde:	613
Facility Lat:	45.4053			Contact Fax:	37754911
Facility Long:	-75.7374			Contact Email:	RALPH.GREENOUGH@PWGSC.GC.CA
DLS (Last Filed Rpt):				Latitude:	45.4053
Facility DLS:				Longitude:	-75.7374
Datum:	1983			UTM Zone:	
Facility Cmnts:	No			UTM Northing:	
URL:				UTM Easting:	
No of Empl.:	14			Waste Streams:	No
Parent Co.:	N			No Streams:	
No Parent Co.:				Waste Off Sites:	No
Pollut Prev Cmnts:	No			No Off Sites:	
Stacks:	No			Shutdown:	No
No of Stacks:				No of Shutdown:	
Canadian SIC Code (2 digit):					
Canadian SIC Code:					
SIC Code Description:					
American SIC Code:					
NAICS Code (2 digit):	91				
NAICS 2 Description:	Public administration				
NAICS Code (4 digit):	9119				
NAICS 4 Description:	Other federal government public administration				
NAICS Code (6 digit):	911910				
NAICS 6 Description:	Other federal government public administration				
 <u>Substance Release Report</u>					
Category Type ID:	13				
Category Type Desc:	All Media				
Category Type Desc (fr):	Rejets à tous les médias				
Grouping:	Total All Media<1t				
Trans Code:					
Chem:	PM2.5 - Particulate Matter <= 2.5 Microns				
Chem (fr):	PM2,5 - Matière particulaire <= 2,5 microns				
Quantity:	.307				
Unit:	tonnes				
Basis of Estimate Cd:					
Basis of Estimate Desc:					
Category Type ID:	13				
Category Type Desc:	All Media				
Category Type Desc (fr):	Rejets à tous les médias				
Grouping:	Total All Media<1t				
Trans Code:					
Chem:	PM10 - Particulate Matter <= 10 Microns				
Chem (fr):	PM10 - Matière particulaire <= 10 microns				
Quantity:	.932				
Unit:	tonnes				
Basis of Estimate Cd:					
Basis of Estimate Desc:					
5	7 of 25	SSE/0.0	62.9 / -0.15	The Department of Public Works<UNOFFICIAL> 50 Chardon Driveway Ottawa ON	SPL

5	8 of 25	SSE/0.0	62.9 / -0.15	PUBLIC WORKS AND GOVERNMENT SERVICES CANADA 50 CHARDON DRIVE CORNER OF SOREL/DU CHARDON OTTAWA ON K1A0M3	NPRI
NPRI ID:	10177			Org ID:	102764
Other ID:	*			Submit Date:	5/28/2010
No Other ID:				Last Modified:	5/29/2015 3:28:24 PM
Track ID:	83846			Contact ID:	201066
Report ID:	137709			Cont Type:	MED
Report Type:	NPRI			Contact Title:	
Rpt Type ID:	1			Cont First Name:	RALPH
Report Year:	2009			Cont Last Name:	GREENOUGH
Not-Current Rpt?:	No			Contact Position:	A/MANAGER OF UTILITES MANAGEMENT SERVICES
Yr of Last Filed Rpt:	2012			Contact Fax:	6137754911
Fac ID:	150118			Contact Ph.:	6137754141
Fac Name:	TUNNEY'S PASTURE CENTRAL HEATING AND COOLING PLANT			Cont Area Code:	613
Fac Address1:	50 CHARDON DRIVE			Contact Tel.:	37754141
Fac Address2:	CORNER OF SOREL/DU CHARDON			Contact Ext.:	
Fac Postal Zip:	K1A0M3			Cont Fax Area Cde:	613
Facility Lat:	45.4053			Contact Fax:	37754911
Facility Long:	-75.7374			Contact Email:	RALPH.GREENOUGH@PWGSC.GC.CA
DLS (Last Filed Rpt):				Latitude:	45.4053
Facility DLS:				Longitude:	-75.7374
Datum:	1983			UTM Zone:	
Facility Cmnts:	No			UTM Northing:	
URL:				UTM Easting:	
No of Empl.:	14			Waste Streams:	No
Parent Co.:	N			No Streams:	
No Parent Co.:				Waste Off Sites:	No
Pollut Prev Cmnts:	No			No Off Sites:	
Stacks:	No			Shutdown:	No
No of Stacks:				No of Shutdown:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Canadian SIC Code (2 digit): Canadian SIC Code: SIC Code Description: American SIC Code: NAICS Code (2 digit): 91 NAICS 2 Description: Public administration NAICS Code (4 digit): 9119 NAICS 4 Description: Other federal government public administration NAICS Code (6 digit): 911910 NAICS 6 Description: Other federal government public administration					
<u>Substance Release Report</u>					
Category Type ID: 13 Category Type Desc: All Media Category Type Desc (fr): Rejets à tous les médias Grouping: Total All Media<1t Trans Code: Chem: PM10 - Particulate Matter <= 10 Microns Chem (fr): PM10 - Matière particulaire <= 10 microns Quantity: .869 Unit: tonnes Basis of Estimate Cd: Basis of Estimate Desc:					
<u>5</u>	9 of 25	SSE/0.0	62.9 / -0.15	50 Chardon St Ottawa ON	SPL
Ref No: 5180-8BRPHB Site No: Incident Dt: Year: Incident Cause: Discharge or Emission to Air Incident Event: Contaminant Code: 38 Contaminant Name: REFRIGERANT GAS, N.O.S. Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Air Pollution Receiving Medium: Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 12/2/2010 Dt Document Closed: Incident Reason: Spill Site Name: Penny's Pasture Central Heating Plant<UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: small freon leak, repairs ongoing. Contaminant Qty: 0 other - see incident description					
Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Other Agency Involved: Nearest Watercourse: Site Address: 50 Chardon St Site District Office: Site Postal Code: Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Air Spills - Gases and Vapours Source Type:					
<u>5</u>	10 of 25	SSE/0.0	62.9 / -0.15	50 Chardon Driveway<UNOFFICIAL> Ottawa ON	SPL
Ref No: 4087-8LUKZN Site No: Incident Dt: 9/19/2011 Year:					
Discharger Report: Material Group: Health/Env Conseq: Client Type:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Incident Cause:	Cooling System Leak			Sector Type:	Other
Incident Event:				Agency Involved:	
Contaminant Code:	38			Nearest Watercourse:	
Contaminant Name:	REFRIGERANT GAS, N.O.S.			Site Address:	
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:	Not Anticipated			Site Municipality:	Ottawa
Nature of Impact:	Air Pollution			Site Lot:	
Receiving Medium:				Site Conc:	
Receiving Env:				Northing:	
MOE Response:	No Field Response			Easting:	
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:	9/19/2011			Site Map Datum:	
Dt Document Closed:	12/3/2011			SAC Action Class:	Air Spills - Gases and Vapours
Incident Reason:	Equipment Failure - Malfunction of system components			Source Type:	
Site Name:	50 Chardon Driveway<UNOFFICIAL>				
Site County/District:					
Site Geo Ref Meth:					
Incident Summary:	50 Chardon Driveway: 134A refrigerant to atm				
Contaminant Qty:	100 kg				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
NAICS Code (4 digit): 9119 NAICS 4 Description: Other federal government public administration NAICS Code (6 digit): 911910 NAICS 6 Description: Other federal government public administration					
<u>Substance Release Report</u>					
Category Type ID: 13 Category Type Desc: All Media Category Type Desc (fr): Rejets à tous les médias Grouping: Total All Media<1t Trans Code: Chem: PM10 - Particulate Matter <= 10 Microns Chem (fr): PM10 - Matière particulaire <= 10 microns Quantity: .863 Unit: tonnes Basis of Estimate Cd: Basis of Estimate Desc:					
5	12 of 25	SSE/0.0	62.9 / -0.15	PUBLIC WORKS AND GOVERNMENT SERVICES CANADA 50 Entrain Chardon Ottawa ON K1A0M3	NPRI
NPRI ID: 0000010177 Other ID: No Other ID: Track ID: Report ID: 4785 Report Type: Rpt Type ID: Report Year: 2011 Not-Current Rpt?: Yr of Last Filed Rpt: Fac ID: Fac Name: TUNNEY'S PASTURE CENTRAL HEATING AND COOLING PLANT Fac Address1: Fac Address2: Fac Postal Zip: Facility Lat: Facility Long: DLS (Last Filed Rpt): Facility DLS: Datum: 1983 Facility Cmnts: URL: No of Empl.: 13 Parent Co.: No Parent Co.: Pollut Prev Cmnts: Stacks: No of Stacks: Canadian SIC Code (2 digit): Canadian SIC Code: SIC Code Description: American SIC Code: NAICS Code (2 digit): 91 NAICS 2 Description: Public Administration NAICS Code (4 digit): 9119 NAICS 4 Description: Other Federal Government Public Administration NAICS Code (6 digit): 911910 NAICS 6 Description: Other Federal Government Public Administration					
Org ID: Submit Date: Last Modified: Contact ID: Cont Type: MED Contact Title: Cont First Name: Cont Last Name: Contact Position: Contact Fax: Contact Ph.: Cont Area Code: Contact Tel.: Contact Ext.: Cont Fax Area Cde: Contact Fax: Contact Email: Latitude: 45.4053 Longitude: -75.7374 UTM Zone: UTM Northing: UTM Easting: Waste Streams: No Streams: Waste Off Sites: No Off Sites: Shutdown: No of Shutdown:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Substance Release Report</u>					
CAS No:	NA - M10				
Report ID:	4785				
Rpt Period:	2011				
Subst Released:	PM2.5 - Particulate Matter <= 2.5 Microns				
Air:	.3				
Water:					
Land:					
Total Releases:	.3				
Units:	tonnes				
5	13 of 25	SSE/0.0	62.9 / -0.15	Public Works and Government Service Canada (PWGSC) 50 Chardon Driveway Ottawa ON	SPL
Ref No:	4561-95DN3S			Discharger Report:	
Site No:				Material Group:	
Incident Dt:	01-MAR-13			Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:	Leak/Break			Sector Type:	Structure
Incident Event:				Agency Involved:	
Contaminant Code:	38			Nearest Watercourse:	
Contaminant Name:	REFRIGERANT GAS, N.O.S.			Site Address:	50 Chardon Driveway
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No				Site Region:	
1:				Site Municipality:	Ottawa
Environment Impact:	Not Anticipated			Site Lot:	
Nature of Impact:	Air Pollution			Site Conc:	
Receiving Medium:				Northing:	
Receiving Env:				Easting:	
MOE Response:	Referral to others			Site Geo Ref Accu:	
Dt MOE Arvl on Scn:				Site Map Datum:	
MOE Reported Dt:	01-MAR-13			SAC Action Class:	Air Spills - Gases and Vapours
Dt Document Closed:				Source Type:	
Incident Reason:	Equipment Failure				
Site Name:	Tunney's Pasture Central Heating Plant<UNOFFICIAL>				
Site County/District:					
Site Geo Ref Meth:					
Incident Summary:	PWGSC: >100kg of R134A to atm				
Contaminant Qty:	1 other - see incident description				
5	14 of 25	SSE/0.0	62.9 / -0.15	PUBLIC WORKS AND GOVERNMENT SERVICES CANADA 50 CHARDON DRIVE NOT AVAILABLE OTTAWA ON K1A0M3	NPRI
NPRI ID:	10177			Org ID:	102764
Other ID:				Submit Date:	5/31/2013
No Other ID:				Last Modified:	5/29/2015 3:28:24 PM
Track ID:	109091			Contact ID:	
Report ID:	18323			Cont Type:	
Report Type:	DNMC			Contact Title:	
Rpt Type ID:	2			Cont First Name:	
Report Year:	2012			Cont Last Name:	
Not-Current Rpt?:	No			Contact Position:	
Yr of Last Filed Rpt:	2012			Contact Fax:	
Fac ID:	150111			Contact Ph.:	
Fac Name:	TUNNEY'S PASTURE CENTRAL HEATING AND COOLING PLANT			Cont Area Code:	

135 erisinfo.com | Environmental Risk Information Services Order No: 22062900235

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Incident Dt: Year: Incident Cause: Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Incident Reason: Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: Contaminant Qty:	2016/03/31 Leak/Break 38 HALON (CFC) Air No 2016/04/04 Unknown / N/A Brookfield GIS<UNOFFICIAL> 1376 lbs Halocarbon to atmosphere 1376 lb			Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:	Unknown / N/A 50 Chardon Drive Ottawa Air Spills - Gases and Vapours
<u>5</u>	17 of 25	SSE/0.0	62.9 / -0.15	Her Majesty the Queen in Right of Canada as Represented by the Minister of Public Works and Government Services Canada 50 Chardon Driveway Ottawa ON	SPL
Ref No: Site No: Incident Dt: Year: Incident Cause: Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Incident Reason: Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: Contaminant Qty:	3773-AKJKX8 3/16/2017 Start up/Shut down 38 FREON R-22 (CFC) 1018 Air 3/17/2017 Other Tunney's Pasture Central Heating and Cooling Plant<UNOFFICIAL> EC: Tunney's Pasture Central Heating & Cooling Plant, poss R22 release 900 kg			Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:	2 - Minor Environment Federal Government Unknown / N/A 50 Chardon Driveway Ottawa Eastern Ottawa Other
<u>5</u>	18 of 25	SSE/0.0	62.9 / -0.15	PUBLIC WORKS AND GOVERNMENT SERVICES CANADA 50 CHARDON DRIVE NOT AVAILABLE OTTAWA ON K1A0M3	NPRI

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
NPRI ID: 10177 Other ID: No Other ID: Track ID: 100639 Report ID: 4785 Report Type: NPRI Rpt Type ID: 1 Report Year: 2011 Not-Current Rpt?: No Yr of Last Filed Rpt: 2012 Fac ID: 150111 Fac Name: TUNNEY'S PASTURE CENTRAL HEATING AND COOLING PLANT Fac Address1: 50 CHARDON DRIVE Fac Address2: NOT AVAILABLE Fac Postal Zip: K1A0M3 Facility Lat: 45.4053 Facility Long: -75.7374 DLS (Last Filed Rpt): Facility DLS: Datum: 1983 Facility Cmnts: URL: No of Empl.: 13 Parent Co.: No Parent Co.: Pollut Prev Cmnts: Stacks: No of Stacks: Canadian SIC Code (2 digit): Canadian SIC Code: SIC Code Description: American SIC Code: NAICS Code (2 digit): 91 NAICS 2 Description: Public administration NAICS Code (4 digit): 9119 NAICS 4 Description: Other federal government public administration NAICS Code (6 digit): 911910 NAICS 6 Description: Other federal government public administration Org ID: 102764 Submit Date: 6/22/2012 Last Modified: 5/29/2015 3:28:24 PM Contact ID: Cont Type: Contact Title: Cont First Name: Cont Last Name: Contact Position: Contact Fax: Contact Ph.: Cont Area Code: Contact Tel.: Contact Ext.: Cont Fax Area Cde: Contact Fax: Contact Email: Latitude: 45.4053 Longitude: -75.7374 UTM Zone: UTM Northing: UTM Easting: Waste Streams: No Streams: Waste Off Sites: No Off Sites: Shutdown: No of Shutdown:					
<u>Substance Release Report</u>					
Category Type ID: 1 Category Type Desc: Stack / Point Category Type Desc (fr): Rejets de cheminée ou ponctuels Grouping: Total Air Trans Code: ASta Chem: PM2.5 - Particulate Matter <= 2.5 Microns Chem (fr): PM2,5 - Matière particulaire <= 2,5 microns Quantity: .3 Unit: tonnes Basis of Estimate Cd: E2 Basis of Estimate Desc: E2- Published Emission Factors - In use from 2003 and onward					
5	19 of 25	SSE/0.0	62.9 / -0.15	Tunney's Pasture Central Heating and Cooling Plant 50 Chardon Drive Ottawa ON K1A 0M3	GHG
GHG ID No: G11087 Facility NPRI ID: 10177 DUNS No: 0 Year: 2019 Public Contact: Pub Cont Phone: Pub Cont Ext: Pub Cont Email:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Rprt Comp Legal Nm:	Public Works and Government Services Canada			Pub Cont Mail Addr:	
Rprt Comp Trade Nm:				Pub Cont City:	
Rprt Comp Bus No:	111111111			Pub Cont Prov:	
Emission Factors:				Pub Cont Postal Cd:	
Engineer Estimates:				Latitude:	45.4053
Mass Balance:				Longitude:	-75.7374
Facility Name:	Tunney's Pasture Central Heating and Cooling Plant				
Company Name:	Public Works and Government Services Canada				
City:	Ottawa				
Address:	50 Chardon Drive				
Postal Code:	K1A 0M3				
Province:	Ontario				
Latitude:	45.4053				
Longitude:	-75.7374				
Total Emissions:	13.87				
Units:	kilotonnes of carbon dioxide equivalents (kt CO2 eq)				
Report Year:	2019				
Industry Classification:	Other federal government public administration				
North American Industry Class:	911910				
National Pollutant Release In:	10177				
GHG Emissions (kt):					
Total Emissions (tonnes CO2e):	13865.55				
Monitoring or Direct Measure:					
Facility GHG Data Link:	https://climate-change.canada.ca/facility-emissions/GHGRP-G11087-2019.html				
Public Contact Position:					
NAICS Code:	911910				
NAICS Code Desc (English):	Other federal government public administration				
NAICS Code Desc (French):	Autres services de l'administration publique fédérale				
NAICS Data Link:	http://www23.statcan.gc.ca/imdb/p3VD.pl?Function=getVD&TVD=307532&CVD=307548&CST=01012017&CLV=5&MLV=5&CPV=911910				
Facility Detail:					

GHG Emission Details

CO2 tonnes:	14014.34	HFC-143 t CO2e:	0
CO2 tonnes CO2e:	14014.34	HFC-227ea tonnes:	
CH4 tonnes:	0.28	HFC-227ea t CO2e:	0
CH4 tonnes CO2e:	7	HFC-236fa tonnes:	
N2O tonnes:	0.25	HFC-236fa t CO2e:	0
N2O tonnes CO2e:	74.5	HFC-245ca tonnes:	
HFC-23 tonnes:		HFC-245ca t CO2e:	0
HFC-23 tonnes CO2e:	0	HFC Total t Co2e:	0
HFC-32 tonnes:		CF4 tonnes:	
HFC-32 tonnes CO2e:	0	CF4 tonnes CO2e:	0
HFC-125 tonnes:		C2F6 tonnes:	
HFC-125 t CO2e:	0	C2F6 tonnes CO2e:	0
HFC-134a tonnes:		C3F8 tonnes:	
HFC-134a t CO2e:	0	C3F8 tonnes CO2e:	0
HFC-143a tonnes:		C4F10 tonnes:	
HFC-143a ton CO2e:	0	C4F10 tonnes CO2e:	0
HFC-152a tonnes:		C4F8 tonnes:	
HFC-152a ton CO2e:	0	C4F8 tonnes CO2e:	0
HFC-41 tonnes:		C5F12 tonnes:	
HFC-41 tonnes CO2e:	0	C5F12 tonnes CO2e:	0
HFC-43 10mee t:		C6F14 tonnes:	
HFC-43 10mee t CO2:	0	C6F14 tonnes CO2e:	0
HFC-134 tonnes:		PFC Total t CO2e:	0
HFC-134 t CO2e:	0	SF6 tonnes:	
HFC-143 tonnes:		SF6 tonnes CO2e:	0

GHG Emission Details

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
CO2 tonnes:	13122			HFC-143 t CO2e:	0
CO2 tonnes CO2e:	13122			HFC-227ea tonnes:	0
CH4 tonnes:	0.257			HFC-227ea t CO2e:	0
CH4 tonnes CO2e:	6.425			HFC-236fa tonnes:	0
N2O tonnes:	0.243			HFC-236fa t CO2e:	0
N2O tonnes CO2e:	72.414			HFC-245ca tonnes:	0
HFC-23 tonnes:	0			HFC-245ca t CO2e:	0
HFC-23 tonnes CO2e:	0			HFC Total t Co2e:	0
HFC-32 tonnes:	0			CF4 tonnes:	0
HFC-32 tonnes CO2e:	0			CF4 tonnes CO2e:	0
HFC-125 tonnes:	0			C2F6 tonnes:	0
HFC-125 t CO2e:	0			C2F6 tonnes CO2e:	0
HFC-134a tonnes:	0			C3F8 tonnes:	0
HFC-134a t CO2e:	0			C3F8 tonnes CO2e:	0
HFC-143a tonnes:	0			C4F10 tonnes:	0
HFC-143a ton CO2e:	0			C4F10 tonnes CO2e:	0
HFC-152a tonnes:	0			C4F8 tonnes:	0
HFC-152a ton CO2e:	0			C4F8 tonnes CO2e:	0
HFC-41 tonnes:	0			C5F12 tonnes:	0
HFC-41 tonnes CO2e:	0			C5F12 tonnes CO2e:	0
HFC-43 10mee t:	0			C6F14 tonnes:	0
HFC-43 10mee t CO2:	0			C6F14 tonnes CO2e:	0
HFC-134 tonnes:	0			PFC Total t CO2e:	0
HFC-134 t CO2e:	0			SF6 tonnes:	
HFC-143 tonnes:	0			SF6 tonnes CO2e:	

GHG Emission Details

CO2 tonnes:	13784.55	HFC-143 t CO2e:	0
CO2 tonnes CO2e:	13784.55	HFC-227ea tonnes:	0
CH4 tonnes:	0.26	HFC-227ea t CO2e:	0
CH4 tonnes CO2e:	6.5	HFC-236fa tonnes:	0
N2O tonnes:	0.25	HFC-236fa t CO2e:	0
N2O tonnes CO2e:	74.5	HFC-245ca tonnes:	0
HFC-23 tonnes:	0	HFC-245ca t CO2e:	0
HFC-23 tonnes CO2e:	0	HFC Total t Co2e:	0
HFC-32 tonnes:	0	CF4 tonnes:	0
HFC-32 tonnes CO2e:	0	CF4 tonnes CO2e:	0
HFC-125 tonnes:	0	C2F6 tonnes:	0
HFC-125 t CO2e:	0	C2F6 tonnes CO2e:	0
HFC-134a tonnes:	0	C3F8 tonnes:	0
HFC-134a t CO2e:	0	C3F8 tonnes CO2e:	0
HFC-143a tonnes:	0	C4F10 tonnes:	0
HFC-143a ton CO2e:	0	C4F10 tonnes CO2e:	0
HFC-152a tonnes:	0	C4F8 tonnes:	0
HFC-152a ton CO2e:	0	C4F8 tonnes CO2e:	0
HFC-41 tonnes:	0	C5F12 tonnes:	0
HFC-41 tonnes CO2e:	0	C5F12 tonnes CO2e:	0
HFC-43 10mee t:	0	C6F14 tonnes:	0
HFC-43 10mee t CO2:	0	C6F14 tonnes CO2e:	0
HFC-134 tonnes:	0	PFC Total t CO2e:	0
HFC-134 t CO2e:	0	SF6 tonnes:	
HFC-143 tonnes:	0	SF6 tonnes CO2e:	

5

20 of 25

SSE/0.0

62.9 / -0.15

Public Services & Procurement Canada
ESD/AFD
50 Chardon
OTTAWA ON K1A0S5

GEN

Generator No: ON0144719
SIC Code:
SIC Description:
Approval Years: As of Jul 2020
PO Box No:

Status: Registered
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Country:	Canada			MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		113 C			
Waste Class Desc:		Acid solutions - containing other metals and non-metals			
Waste Class:		122 C			
Waste Class Desc:		Alkaline slutions - containing other metals and non-metals (not cyanide)			
Waste Class:		251 L			
Waste Class Desc:		Waste oils/sludges (petroleum based)			
Waste Class:		331 I			
Waste Class Desc:		Waste compressed gases including cylinders			
Waste Class:		252 L			
Waste Class Desc:		Waste crankcase oils and lubricants			
Waste Class:		222 L			
Waste Class Desc:		Heavy fuels			
Waste Class:		213 I			
Waste Class Desc:		Petroleum distillates			
<u>5</u>	21 of 25	SSE/0.0	62.9 / -0.15	Public Service and Procurement Canada (Corporate) 50 Chardon Driveway Ottawa ON k1y 1g9	FRST
Tank System ID:	45658			Tank Sys Prov F:	Ontario
EC No:	00045656			Tank Sys PO BOX:	
Internal No:				Tank Sys Postal Cd:	k1y 1g9
Is Perm Withdrwl:	False			Sys Record City:	
Removed Date:				Sys Record Prov E:	
Withdrawn Date:				Sys Record Prov F:	
Temp Withdrawn Dt:				Sys Record PO BOX:	
Tank Use E:				Sys Rec Postal Cd:	
Tank Use F:				System Rec Same as:	True
Year of Manufact:				Location Latitude:	
Emerg Plan Same as:	True			Location Longitude:	
Operator Contact:	Brent Mainville			Creation Date:	43019
Owner Contact:	Brian Armsden			Creation By:	Anne Hofmann
Tank System City:	Ottawa			Modified Date:	43019
Tank Sys Prov E:	Ontario			Modified By:	marie-michelle modery
Tank Use:					
Tank Manufacturer:					
Tank System Address:	50 Chardon Driveway				
Sys Record Address:					
System Descr:	Auxillary power (Backup Generator) for 340 Albert Street, Ottawa ON				
Certification System Installer:					
Certification System Remover:					
Group Name:	Public Service and Procurement Canada (Corporate)				
Master Group Name:	Public Service and Procurement Canada (Corporate)				
Owner Email:	brian.armsden@tpsgc-pwgsc.gc.ca				
Operator Email:	brent.mainville@bgis.com				
Land Owner E:					
Land Owner F:					
<u>Service Months</u>					
Service Months E:	March				
Service Months F:	Mars				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Service Months E: Service Months F:		October Octobre			
Service Months E: Service Months F:		August Août			
Service Months E: Service Months F:		December Décembre			
Service Months E: Service Months F:		January Janvier			
Service Months E: Service Months F:		February Février			
Service Months E: Service Months F:		July Juillet			
Service Months E: Service Months F:		June Juin			
Service Months E: Service Months F:		November Novembre			
Service Months E: Service Months F:		May Mai			
Service Months E: Service Months F:		September Septembre			
Service Months E: Service Months F:		April Avril			

Tanks Details

Tank ID:	76938	Dt Withdrwn Piping:	
Tank Capacity:	9092	Date Remvd Piping:	
Tank Type E:	Aboveground	Tk Type of Pump E:	No oil-water separator
Tank Type F:	Hors sol	Tk Type of Pump F:	Aucun Séparateur huile-eau
Date of Install:	2017	Piping Type E:	Aboveground
Date Withdrawn Tk:		Piping Type F:	Hors sol
Date Removed Tank:		Piping Diam Unit:	mm
Tank Desc:	Backup Generator		
Tank Std No E:	ULC-S601		
Tank Std No F:	ULC-S601		
Tank Std No Other:			
Tank Constr Material E:	Steel		
Tank Constr Material F:	Acier		
Tank Constr Material Other:			
Internal No:			
Tank Content E:	Diesel		
Tank Content F:	Diesel		
Tank Content Other:			
Piping Diameter:	25;50		
Spill Containment E:	Devices for Aboveground Tanks (ORD-C142.19)		
Spill Containment F:	Réservoir hors sol (ORD-C142.19)		
Spill Containment Other:			
Product Transfer Area:	The PTA risk assessment has been completed. Based on the RA, a risk management plan and refueling SOPs have been developed. Every time fuel is delivered, spill kis and drain covers are deployed.		
Date Withdrwn Other Component:			
Date Removed Other Component:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Piping Construction Materials</u>					
Component E:		Steel			
Component F:		Acier			
<u>Piping Secondary Containment</u>					
Tank ID:		76938			
Component E:		None			
Component F:		Aucun			
<u>Tank Corrosion Protection</u>					
Component E:		Painted			
Component F:		Peinturé			
<u>Piping Corrosion Protection</u>					
Component E:		Painted			
Component F:		Peinturé			
<u>Tank Leak Detection</u>					
Component E:		Interstitial monitoring - double walled tank			
Component F:		Surveillance interstitielle- réservoir à double paroi			
<u>Piping Leak Detection</u>					
Component E:		Visual inspection			
Component F:		Inspection visuelle			
<u>Sump Leak Detection</u>					
Component E:		No sump for storage tank system			
Component F:		Aucun puisard pour le système de stockage			
<u>Tank Secondary Containment</u>					
Component E:		Double Walled			
Component F:		Double paroi			
<u>5</u>	22 of 25	SSE/0.0	62.9 / -0.15	Public Services & Procurement Canada ESD/AFD 50 Chardon OTTAWA ON K1A0S5	GEN
Generator No:	ON0144719			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Nov 2021			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:	222 L				
Waste Class Desc:	Heavy fuels				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		213 I			
Waste Class Desc:		Petroleum distillates			
Waste Class:		251 L			
Waste Class Desc:		Waste oils/sludges (petroleum based)			
Waste Class:		252 L			
Waste Class Desc:		Waste crankcase oils and lubricants			
Waste Class:		113 C			
Waste Class Desc:		Acid solutions - containing other metals and non-metals			
Waste Class:		331 I			
Waste Class Desc:		Waste compressed gases including cylinders			
Waste Class:		122 C			
Waste Class Desc:		Alkaline slutions - containing other metals and non-metals (not cyanide)			

5	23 of 25	SSE/0.0	62.9 / -0.15	ENGIE Services Inc. 50 Chardon Driveway Ottawa , ON Canada ON	EBR
EBR Registry No:	019-4006			Decision Posted:	September 21, 2021
Ministry Ref No:	8390-BZ8SVE			Exception Posted:	
Notice Type:	Instrument			Section:	Part II.1 (20.3 or 20.5)
Notice Stage:	Decision			Act 1:	Environmental Protection Act, R.S.O. 1990
Notice Date:				Act 2:	Environmental Protection Act
Proposal Date:	July 14, 2021			Site Location Map:	45.405367,-75.737392
Year:	2021				
Instrument Type:	Environmental Compliance Approval (sewage)				
Off Instrument Name:	Environmental Compliance Approval (sewage) (OWRA s.53)				
Posted By:	Ministry of the Environment, Conservation and Parks				
Company Name:					
Site Address:	50 Chardon Driveway Ottawa , ON Canada				
Location Other:					
Proponent Name:	ENGIE Services Inc.				
Proponent Address:	ENGIE Services Inc. 1001 de Maisonneuve Boulevard West Suite 1000 Montreal, QC H3A 3C8 Canada				
Comment Period:	July 14, 2021 - August 28, 2021 (45 days) Closed				
URL:	https://ero.ontario.ca/notice/019-4006				
Site Location Details:					
Tunney's Pasture Heating and Cooling Plant					

5	24 of 25	SSE/0.0	62.9 / -0.15	ENGIE Services Inc. 50 Chardon Driveway Ottawa ON H3A 3C8	ECA
Approval No:	9741-C5ARW9			MOE District:	
Approval Date:	2021-09-20			City:	
Status:	Approved			Longitude:	
Record Type:	ECA			Latitude:	
Link Source:	IDS			Geometry X:	-8431104.4617999997
SWP Area Name:				Geometry Y:	5685583.6581000024
Approval Type:	ECA-INDUSTRIAL SEWAGE WORKS				
Project Type:	INDUSTRIAL SEWAGE WORKS				
Business Name:	ENGIE Services Inc.				
Address:	50 Chardon Driveway				
Full Address:					
Full PDF Link:	https://www.accessenvironment.ene.gov.on.ca/instruments/8390-BZ8SVE-14.pdf				
PDF Site Location:	Tunney's Pasture Central Heating and Cooling Plant				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
		50 Chardon Driveway City of Ottawa, Ontario K1A 0K9			
5	25 of 25	SSE/0.0	62.9 / -0.15	Public Services & Procurement Canada ESD/AFD 50 Chardon OTTAWA ON K1A0S5	GEN
Generator No:		ON0144719		Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:		As of Feb 2022		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:		Canada		MHSW Facility:	
Detail(s)					
Waste Class:		213 I			
Waste Class Desc:		Petroleum distillates			
Waste Class:		113 C			
Waste Class Desc:		Acid solutions - containing other metals and non-metals			
Waste Class:		331 I			
Waste Class Desc:		Waste compressed gases including cylinders			
Waste Class:		222 L			
Waste Class Desc:		Heavy fuels			
Waste Class:		251 L			
Waste Class Desc:		Waste oils/sludges (petroleum based)			
Waste Class:		122 C			
Waste Class Desc:		Alkaline slutions - containing other metals and non-metals (not cyanide)			
Waste Class:		252 L			
Waste Class Desc:		Waste crankcase oils and lubricants			
6	1 of 1	SSW/0.0	62.8 / -0.18	Parkdale Ave Ottawa ON	EHS
Order No:		20120710007		Nearest Intersection:	
Status:		C		Municipality:	Ottawa-Carleton
Report Type:		Custom Report		Client Prov/State:	ON
Report Date:		06-SEP-12		Search Radius (km):	.25
Date Received:		10-JUL-12		X:	-75.737981
Previous Site Name:		various		Y:	45.40517
Lot/Building Size:		approximately 130 acres			
Additional Info Ordered:					
7	1 of 1	E/0.0	62.9 / -0.09	151 Tunney's Pasture Driveway Ottawa ON	SPL
Ref No:		3835-7LJS4P		Discharger Report:	
Site No:				Material Group:	
Incident Dt:				Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:		Other Discharges		Sector Type:	Other
Incident Event:				Agency Involved:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Code: 24 Contaminant Name: ETHYLENE GLYCOL (ANTIFREEZE) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Not Anticipated Nature of Impact: Receiving Medium: Receiving Env: MOE Response: No Field Response Dt MOE Arvl on Scn: MOE Reported Dt: 11/19/2008 Dt Document Closed: 11/26/2008 Incident Reason: Other - Reason not otherwise defined Site Name: SNC Lavalin<UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: SNC Lav.- Standards Laboratory: 4 L Glycol spill. Contaminant Qty: 4 L Nearest Watercourse: Site Address: Site District Office: Ottawa Site Postal Code: Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Land Spills Source Type:					
8	1 of 3	S/0.0	63.3 / 0.31	GVT. OF CAN. - PUBLIC WORKS CANADA TUNNEY'S PASTURE HEATING PLANT BLDG. 13 TUNNEY'S PASTURE, SORRELL & DUCHARDON OTTAWA ON K1A 0M3	GEN
Generator No: ON0144719 SIC Code: 4999 SIC Description: OTHER UTILITY IND. Approval Years: 86,87,88,89,90 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility: <u>Detail(s)</u> Waste Class: 146 Waste Class Desc: OTHER SPECIFIED INORGANICS Waste Class: 222 Waste Class Desc: HEAVY FUELS					
8	2 of 3	S/0.0	63.3 / 0.31	GVT. OF CAN. - PUBLIC WORKS CANADA18-209 TUNNEY'S PASTURE HEATING PLANT BLDG. 13 TUNNEY'S PASTURE, SORRELL & DUCHARDON OTTAWA ON K1A 0M3	GEN
Generator No: ON0144719 SIC Code: 4999 SIC Description: OTHER UTILITY IND. Approval Years: 94 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility: <u>Detail(s)</u> Waste Class: 146 Waste Class Desc: OTHER SPECIFIED INORGANICS Waste Class: 222 Waste Class Desc: HEAVY FUELS					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
8	3 of 3	S/0.0	63.3 / 0.31	Public Works and Government Services Canada Sorrel and Chardon Road, Ottawa BUILDING 13, TUNNEY'S PASTURE CENTRAL HEATING PLANT<UNOFFICIAL> Ottawa ON	SPL
Ref No: 8331-6SRNXX Site No: Incident Dt: 8/17/2006 Year: Incident Cause: Discharge or Emission to Air Incident Event: Contaminant Code: 38 Contaminant Name: REFRIGERANT GAS, N.O.S. R134 A Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Possible Nature of Impact: Air Pollution Receiving Medium: Air Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 8/17/2006 Dt Document Closed: Incident Reason: Site Name: SORREL AND CHARDON ROAD, OTTAWA Site County/District: Site Geo Ref Meth: Incident Summary: Tunney's Pasture: 200-1000 lbs R134 A to atmosphere Contaminant Qty: 1000 lb		Discharger Report: Material Group: Gases/Particulates Health/Env Conseq: Client Type: Sector Type: Other Agency Involved: Nearest Watercourse: Site Address: SORREL AND CHARDON ROAD, OTTAWA Site District Office: Ottawa Site Postal Code: Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:			
9	1 of 1	SW/0.0	63.6 / 0.54	East side of Tunney's Pasture, north of Scott Street Ottawa ON	SPL
Ref No: 7824-ADYPU8 Site No: NA Incident Dt: 9/13/2016 Year: Incident Cause: Incident Event: Unknown / N/A Contaminant Code: 15 Contaminant Name: HYDRAULIC OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: Land MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 9/20/2016 Dt Document Closed: Incident Reason: Unknown / N/A Site Name: Concrete Pad <UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: OLRT: 3 L hydraulic oil to concrete pad; contd & clnd		Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Miscellaneous Industrial Agency Involved: Nearest Watercourse: Site Address: East side of Tunney's Pasture, north of Scott Street Site District Office: Site Postal Code: Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Northing: 5028206 Easting: 442207 Site Geo Ref Accu: Site Map Datum: SAC Action Class: Land Spills Source Type:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Qty:		3 L			
10	1 of 1	WSW/0.0	62.9 / -0.17	Plomberie Solutions<UNOFFICIAL> Ottawa ON	SPL
Ref No:		3846-B7FLLM		Discharger Report:	
Site No:		NA		Material Group:	
Incident Dt:		2018/12/13		Health/Env Conseq:	2 - Minor Environment
Year:				Client Type:	
Incident Cause:				Sector Type:	Miscellaneous Industrial
Incident Event:		Leak/Break		Agency Involved:	
Contaminant Code:		15		Nearest Watercourse:	
Contaminant Name:		MOTOR OIL		Site Address:	
Contaminant Limit 1:				Site District Office:	Ottawa
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:		1993		Site Region:	Eastern
Environment Impact:				Site Municipality:	Ottawa
Nature of Impact:				Site Lot:	
Receiving Medium:				Site Conc:	
Receiving Env:		Land; Surface Water		Northing:	5028224.78
MOE Response:		No		Easting:	442163.01
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:		2018/12/14		Site Map Datum:	
Dt Document Closed:		2018/12/28		SAC Action Class:	Land Spills
Incident Reason:		Material Failure - Poor Design/Substandard Material		Source Type:	Motor Vehicle
Site Name:		161 Goldenrod Driveway<UNOFFICIAL>			
Site County/District:					
Site Geo Ref Meth:					
Incident Summary:		Plomberie Solutions: 5L motor oil to ground			
Contaminant Qty:		5 L			
11	1 of 1	E/0.0	61.9 / -1.15	PCL CONSTRUCTORS CANADA INC ON	EASR
Approval No:		R-009-3112932269		MOE District:	Ottawa
Status:		REGISTERED		Municipality:	
Date:		2021-02-17		Latitude:	45.40611111
Record Type:		EASR		Longitude:	-75.73611111
Link Source:		MOFA		Geometry X:	
Project Type:		Water Taking - Construction Dewatering		Geometry Y:	
Full Address:					
Approval Type:		EASR-Water Taking - Construction Dewatering			
SWP Area Name:		Rideau Valley			
PDF URL:					
PDF Site Location:					
12	1 of 1	WNW/0.0	61.9 / -1.15	ON	BORE
Borehole ID:		613154		Inclin FLG:	No
OGF ID:		215514458		SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:		Borehole		Piezometer:	No
Use:				Primary Name:	
Completion Date:		APR-1967		Municipality:	
Static Water Level:				Lot:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Primary Water Use: Sec. Water Use: Total Depth m: -999 Depth Ref: Ground Surface Depth Elev: Drill Method: Orig Ground Elev m: 63.2 Elev Reliabil Note: DEM Ground Elev m: 63.1 Concession: Location D: Survey D: Comments: Township: Latitude DD: 45.406658 Longitude DD: -75.739106 UTM Zone: 18 Easting: 442161 Northing: 5028392 Location Accuracy: Accuracy: Not Applicable					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218393936 Top Depth: 0 Bottom Depth: 1.1 Material Color: Material 1: Clay Material 2: Sand Material 3: Material 4: Gsc Material Description: Stratum Description: CLAY. Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Geology Stratum ID: 218393937 Top Depth: 1.1 Bottom Depth: Material Color: Material 1: Bedrock Material 2: Limestone Material 3: Material 4: Gsc Material Description: Stratum Description: BEDROCK. AL. ORGANIC. FIBROUS. ORGANIC. UNSPECIFIED. DENSE. UNSPECIFIED. DENSE. UNSPE Mat Consistency: Dense Material Moisture: Material Texture: Fibrous Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: organic **Note: Many records provided by the department have a truncated [Stratum Description] field.					
<u>Source</u>					
Source Type: Data Survey Source Orig: Geological Survey of Canada Source Date: 1956-1972 Confidence: H Observatio: Source Name: Urban Geology Automated Information System (UGAIS) Source Details: File: OTTAWA2.txt RecordID: 056620 NTS_Sheet: 31G05G Confiden 1: Logged by professional. Exact and complete description of material and properties. Source Appl: Spatial/Tabular Source Iden: 1 Scale or Res: Varies Horizontal: NAD27 Verticalda: Mean Average Sea Level					
<u>Source List</u>					
Source Identifier: 1 Source Type: Data Survey Source Date: 1956-1972 Scale or Resolution: Varies Source Name: Urban Geology Automated Information System (UGAIS) Source Originators: Geological Survey of Canada Horizontal Datum: NAD27 Vertical Datum: Mean Average Sea Level Projection Name: Universal Transverse Mercator					
13	1 of 1	NNW/0.0	61.9 / -1.15	Demo Plus 100 Chardon Drive Ottawa ON K1Y 2Z0	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON3686373 SIC Code: SIC Description: Approval Years: As of Dec 2018 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
Detail(s)					
Waste Class: 212 L Waste Class Desc: Aliphatic solvents and residues Waste Class: 221 I Waste Class Desc: Light fuels Waste Class: 243 D Waste Class Desc: PCB Waste Class: 252 L Waste Class Desc: Waste crankcase oils and lubricants					
14	1 of 4	N/O.0	61.6 / -1.46	Raymond Roofing<UNOFFICIAL> 100 Eglantine Driveway Ottawa ON	SPL
Ref No: 3280-966NV5 Site No: Incident Dt: 25-MAR-13 Year: Incident Cause: Leak/Break Incident Event: Contaminant Code: 15 Contaminant Name: HYDRAULIC OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Not Anticipated Nature of Impact: Soil Contamination Receiving Medium: Receiving Env: MOE Response: Referral to others Dt MOE Arvl on Scn: MOE Reported Dt: 26-MAR-13 Dt Document Closed: Incident Reason: Operator/Human Error Site Name: 100 Eglantine Driveway<UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: Health Canada: 5 L Hydraulic to sidewalk, soil Contaminant Qty: 5 L Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Other Agency Involved: Nearest Watercourse: Site Address: 100 Eglantine Driveway Site District Office: Site Postal Code: Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Land Spills Source Type:					
14	2 of 4	N/O.0	61.6 / -1.46	Raymond & Associates Roofing Inc<UNOFFICIAL> 100 Eglantine Driveway Ottawa ON	SPL
Ref No: 6111-96DR7W Site No: Incident Dt: 26-MAR-13 Year: Discharger Report: Material Group: Health/Env Conseq: Client Type:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Incident Cause: Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Incident Reason: Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: Contaminant Qty:	Leak/Break 15 HYDRAULIC OIL Not Anticipated Soil Contamination No Field Response 02-APR-13 Equipment Failure Raymond & Associates Roofing Inc<UNOFFICIAL> Raymond &Asc Roofing: hyd oil to grd, cntd 10L 10 L	Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:	Motor Vehicle 100 Eglantine Driveway Ottawa Land Spills		

14	3 of 4	N/0.0	61.6 / -1.46	Royal Canadian Mounted Police Tunney's Laboratory 100 Eglantine Driveway Ottawa ON K1A 0K9	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:	ON7182906 As of Jul 2020 Canada	Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	Registered		
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	212 I Aliphatic solvents and residues				
Waste Class: Waste Class Desc:	148 C Misc. wastes and inorganic chemicals				
Waste Class: Waste Class Desc:	331 I Waste compressed gases including cylinders				
Waste Class: Waste Class Desc:	252 L Waste crankcase oils and lubricants				
Waste Class: Waste Class Desc:	263 I Misc. waste organic chemicals				
Waste Class: Waste Class Desc:	312 P Pathological wastes				

14	4 of 4	N/0.0	61.6 / -1.46	Royal Canadian Mounted Police Tunney's Laboratory 100 Eglantine Driveway Ottawa ON K1A 0K9	GEN
Generator No: SIC Code:	ON7182906	Status: Co Admin:	Registered		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description:				Choice of Contact:	
Approval Years:	As of Nov 2021			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:	331 I				
Waste Class Desc:	Waste compressed gases including cylinders				
Waste Class:	148 C				
Waste Class Desc:	Misc. wastes and inorganic chemicals				
Waste Class:	212 I				
Waste Class Desc:	Aliphatic solvents and residues				
Waste Class:	252 L				
Waste Class Desc:	Waste crankcase oils and lubricants				
Waste Class:	263 I				
Waste Class Desc:	Misc. waste organic chemicals				
Waste Class:	312 P				
Waste Class Desc:	Pathological wastes				
15	1 of 1	WSW/0.0	62.9 / -0.15	ON	BORE
Borehole ID:	613135			Inclin FLG:	No
OGF ID:	215514439			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:				Primary Name:	
Completion Date:	DEC-1962			Municipality:	
Static Water Level:	3.8			Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	45.405035
Total Depth m:	-999			Longitude DD:	-75.739469
Depth Ref:	Ground Surface			UTM Zone:	18
Depth Elev:				Easting:	442131
Drill Method:				Northing:	5028212
Orig Ground Elev m:	62			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	62.9				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218393849			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.5			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SILT.				
Geology Stratum ID:	218393850			Mat Consistency:	Dense

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy:			Easting NAD83: Northing NAD83: Zone: UTM Reliability:		
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/705\7050791.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2007/08/01			
Year Completed:		2007			
Depth (m):		45.7			
Latitude:		45.406282217414			
Longitude:		-75.739825613361			
Path:		705\7050791.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		23050791		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				18	
Code OB Desc:				East83:	
Open Hole:				442104.00	
Cluster Kind:				North83:	
Date Completed:		01-Aug-2007 00:00:00		5028351.00	
Remarks:				Org CS:	
Elevrc Desc:				UTM83	
Location Source Date:				UTMRC:	
Improvement Location Source:				3	
Improvement Location Method:				UTMRC Desc:	
Source Revision Comment:				margin of error : 10 - 30 m	
Supplier Comment:				Location Method:	
				wwr	
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1000013590			
Layer:		1			
Color:					
General Color:					
Mat1:		28			
Most Common Material:		SAND			
Mat2:		01			
Mat2 Desc:		FILL			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		4.599999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1000013591			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		4.599999904632568			
Formation End Depth:		45.70000076293945			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1000013593			
Layer:		1			
Plug From:		45.70000076293945			
Plug To:		41.20000076293945			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1000013594			
Layer:		2			
Plug From:		41.20000076293945			
Plug To:		34.0			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1000013595			
Layer:		3			
Plug From:		34.0			
Plug To:		29.8700008392334			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1000013596			
Layer:		4			
Plug From:		29.8700008392334			
Plug To:		22.100000381469727			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1000013600			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1000013588			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing ID:		1000013597			
Layer:					
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:					
Casing Diameter:		0.15000000596046448			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1000013598			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:					
Screen Diameter UOM:					
Screen Diameter:					
 <u>Results of Well Yield Testing</u>					
Pump Test ID:		1000013589			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:		0			
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
 <u>Hole Diameter</u>					
Hole ID:		1000013592			
Diameter:		15.0			
Depth From:					
Depth To:		45.70000076293945			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
18	1 of 1	ESE/0.0	62.8 / -0.22	Public Works and Government Services Canada 101 Tunneys Pasture Driveway Ottawa ON K1A 0T6	GEN
Generator No:	ON6288522			Status:	
SIC Code:	910911			Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	2010			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		146			
Waste Class Desc:		OTHER SPECIFIED INORGANICS			
Waste Class:		243			
Waste Class Desc:		PCBS			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
19	1 of 1	S/0.0	63.9 / 0.85	130 Goldenrod Driveway Ottawa ON K1Y4P7	EHS
Order No:	20170203170			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	ON
Report Date:	10-FEB-17			Search Radius (km):	.25
Date Received:	03-FEB-17			X:	-75.737635
Previous Site Name:				Y:	45.404281
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans; Aerial Photos				
20	1 of 1	NNW/0.0	61.6 / -1.46	ON	BORE
Borehole ID:	613166			Inclin FLG:	No
OGF ID:	215514469			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:				Primary Name:	
Completion Date:	OCT-1961			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	45.40738
Total Depth m:	-999			Longitude DD:	-75.738732
Depth Ref:	Ground Surface			UTM Zone:	18
Depth Elev:				Easting:	442191
Drill Method:				Northing:	5028472
Orig Ground Elev m:	62.8			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	62.3				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218393977			Mat Consistency:	
Top Depth:	1.2			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Gravel			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	GRAVEL.				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID:	218393978			Mat Consistency:	
Top Depth:	1.2			Material Moisture:	
Bottom Depth:	1.6			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SAND.				
Geology Stratum ID:	218393976			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL.				
Geology Stratum ID:	218393979			Mat Consistency:	Hard
Top Depth:	1.6			Material Moisture:	
Bottom Depth:				Material Texture:	Fine
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Bedrock			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	BEDROCK. ,HARD. CLAY. GREY,VERY SOFT. FF. SILT. SOFT. CLAY. GREY,STIFF. SAND-FINE.				
 <u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	H			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: OTTAWA2.txt RecordID: 056740 NTS_Sheet: 31G05G				
Confiden 1:	Logged by professional. Exact and complete description of material and properties.				
 <u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
21	1 of 1	S/O.0	63.9 / 0.85	1065 WELLINGTON ST OTTAWA ON	WWIS
Well ID:	7044700			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:	Not Used			Date Received:	6/14/2007
Sec. Water Use:				Selected Flag:	TRUE
Final Well Status:	Observation Wells			Abandonment Rec:	
Water Type:				Contractor:	7241

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Material:			Form Version:	3	
Audit No:	Z66220		Owner:		
Tag:	A056022		Street Name:	1065 WELLINGTON ST	
Construction Method:			County:	OTTAWA	
Elevation (m):			Municipality:	OTTAWA CITY	
Elevation Reliability:			Site Info:		
Depth to Bedrock:			Lot:		
Well Depth:			Concession:		
Overburden/Bedrock:			Concession Name:		
Pump Rate:			Easting NAD83:		
Static Water Level:			Northing NAD83:		
Flowing (Y/N):			Zone:		
Flow Rate:			UTM Reliability:		
Clear/Cloudy:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7044700.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2007/05/04				
Year Completed:	2007				
Depth (m):	4				
Latitude:	45.4040813914809				
Longitude:	-75.7377396205987				
Path:	704\7044700.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	11767186			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442265.00
Code OB Desc:				North83:	5028105.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	04-May-2007 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	933103708				
Layer:	2				
Color:	6				
General Color:	BROWN				
Mat1:	06				
Most Common Material:	SILT				
Mat2:					
Mat2 Desc:					
Mat3:	66				
Mat3 Desc:	DENSE				
Formation Top Depth:	0.6000000238418579				
Formation End Depth:	4.0				
Formation End Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933103707			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.6000000238418579			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933320657			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933320658			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		1.7999999523162842			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933320659			
Layer:		3			
Plug From:		1.7999999523162842			
Plug To:		4.0			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		967044700			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11774876			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing ID:		930900572			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		2.4000000953674316			
Casing Diameter:		3.799999952316284			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		933424856			
Layer:		1			
Slot:		10			
Screen Top Depth:		2.4000000953674316			
Screen End Depth:		4.0			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.300000190734863			
 <u>Hole Diameter</u>					
Hole ID:		11853804			
Diameter:		10.0			
Depth From:		0.0			
Depth To:		4.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
22	1 of 3	W/0.0	61.9 / -1.15	UNKNOWN ENVIRONMENTAL HEALTH CENTRE TUNNEY'S PASTURE OTTAWA CITY ON	SPL
Ref No:	16038			Discharger Report:	
Site No:				Material Group:	
Incident Dt:	3/19/1989			Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:	OTHER CAUSE (N.O.S.)			Sector Type:	
Incident Event:				Agency Involved:	
Contaminant Code:				Nearest Watercourse:	
Contaminant Name:				Site Address:	
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:				Site Municipality:	20101
Nature of Impact:				Site Lot:	
Receiving Medium:	LAND			Site Conc:	
Receiving Env:				Northing:	
MOE Response:				Easting:	WORKS DEPT
Dt MOE Arvi on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:	3/19/1989			Site Map Datum:	
Dt Document Closed:				SAC Action Class:	
Incident Reason:	UNKNOWN			Source Type:	
Site Name:					
Site County/District:					
Site Geo Ref Meth:					
Incident Summary:		OILY WATER ENCOUNTERED WHILE EXCAVATING AT ENV. HEALTH CENTRE.			
Contaminant Qty:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
22	2 of 3	W/0.0	61.9 / -1.15	PUBLIC WORKS CANADA ENVIRONMENTAL HEALTH BUILDING TUNNEY'S PASTURE HEALTH PROTECTION BUILDING (NRC) TUNNEY'S PASTURE, OTTAWA OTTAWA CITY ON	SPL
Ref No:	48488			Discharger Report:	
Site No:				Material Group:	
Incident Dt:	4/2/1991			Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:	UNDERGROUND TANK LEAK			Sector Type:	
Incident Event:				Agency Involved:	
Contaminant Code:				Nearest Watercourse:	
Contaminant Name:				Site Address:	
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:	CONFIRMED			Site Municipality:	20101
Nature of Impact:	Soil contamination			Site Lot:	
Receiving Medium:	LAND			Site Conc:	
Receiving Env:				Northing:	
MOE Response:				Easting:	ENVIRONMENT CANADA
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:	4/2/1991			Site Map Datum:	
Dt Document Closed:				SAC Action Class:	
Incident Reason:	CORROSION			Source Type:	
Site Name:					
Site County/District:					
Site Geo Ref Meth:					
Incident Summary:	PUBLIC WORKS CANADA: DIESEL LEAK FROM STORAGE TANK				
Contaminant Qty:					
22	3 of 3	W/0.0	61.9 / -1.15	UNKNOWN BUILDING #8, TUNNEY'S PASTURE ENVIRONMENTAL HEALTH SERVICES. OTTAWA CITY ON	SPL
Ref No:	67120			Discharger Report:	
Site No:				Material Group:	
Incident Dt:	2/16/1992			Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:	WASTEWATER DISCHARGE TO WATERCOURSE			Sector Type:	
Incident Event:				Agency Involved:	
Contaminant Code:				Nearest Watercourse:	
Contaminant Name:				Site Address:	
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:	CONFIRMED			Site Municipality:	20101
Nature of Impact:	Surface Water Pollution			Site Lot:	
Receiving Medium:	WATER			Site Conc:	
Receiving Env:				Northing:	
MOE Response:				Easting:	FIRE, POLICE, WORKS
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:	2/16/1992			Site Map Datum:	
Dt Document Closed:				SAC Action Class:	
Incident Reason:	UNKNOWN			Source Type:	
Site Name:					
Site County/District:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Geo Ref Meth: Incident Summary: FEDERAL GOV'T BULIDING: 50L WASTE OIL IN OTTAWA RIVER, Contaminant Qty:					
23	1 of 1	E/0.0	61.9 / -1.15	PUC SOREL ST. AND HOLLAND AVE. OTTAWA CITY ON	SPL
Ref No: 41942 Site No: Incident Dt: 10/10/1990 Year: Incident Cause: PIPE/HOSE LEAK Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: NOT ANTICIPATED Nature of Impact: Receiving Medium: LAND Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 10/10/1990 Dt Document Closed: Incident Reason: EQUIPMENT FAILURE Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: OTTAWA HYDRO -INSULATOR OIL TO MANHOLE, CONTAINED Contaminant Qty:					
Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: 20101 Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:					
24	1 of 1	S/0.0	63.9 / 0.85	ON	BORE
Borehole ID: 613120 OGF ID: 215514424 Status: Type: Borehole Use: Completion Date: OCT-1961 Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: -999 Depth Ref: Ground Surface Depth Elev: Drill Method: Orig Ground Elev m: 62.7 Elev Reliabil Note: DEM Ground Elev m: 62.1 Concession: Location D: Survey D: Comments:					
Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 45.403967 Longitude DD: -75.737666 UTM Zone: 18 Easting: 442271 Northing: 5028092 Location Accuracy: Accuracy: Not Applicable					
Borehole Geology Stratum					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218393790 0 .8 Fill Bedrock			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	fill Compact Fibrous
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218393791 .8 Bedrock			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Compact Fibrous
BEDROCK. AL. BEDROCK. FEET.SAND. GRAVEL. COMPACT. GRAVEL. COMPACT. FIBROUS **Note: Many records provided by the department have a truncated [Stratum Description] field.					
Source					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
Urban Geology Automated Information System (UGAIS) File: OTTAWA2.txt RecordID: 056280 NTS_Sheet: 31G05G					
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
25	1 of 1	SE/0.0	62.2 / -0.87	Department of National Defence Department of National Defence Ottawa ON	SPL
Ref No: Site No: Incident Dt: Year: Incident Cause: Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env:	2717-B4VHNV NA 2018/09/23 Leak/Break 13 DIESEL FUEL 1202 Land			Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: Site Lot: Site Conc: Northing:	2 - Minor Environment Municipal Government Miscellaneous Industrial Department of National Defence Ottawa Eastern Ottawa 5028136.68

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Incident Reason: Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: Contaminant Qty:	No 2018/09/23 2018/09/25 Equipment Failure 101 Goldenrod Drive<UNOFFICIAL> DND 5 L of diesel to grnd 5 L			Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type: Land Spills Container/Drum/Tote	

26	1 of 3	ESE/0.0	61.9 / -1.15	GVT. OF CAN-NATIONAL RESEARCH CNCL HEALTH PROTECTION BUILDING 7 TUNNEY'S PASTURE OTTAWA ON K1A 0R6	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:	ON0195805 8176 RESEARCH ADMIN. 86,87,88,89,90			Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	148 INORGANIC LABORATORY CHEMICALS				
Waste Class: Waste Class Desc:	211 AROMATIC SOLVENTS				
Waste Class: Waste Class Desc:	212 ALIPHATIC SOLVENTS				
Waste Class: Waste Class Desc:	241 HALOGENATED SOLVENTS				
Waste Class: Waste Class Desc:	263 ORGANIC LABORATORY CHEMICALS				

26	2 of 3	ESE/0.0	61.9 / -1.15	GVT. OF CAN-NATIONAL RESEARCH CNCL18- 245 HEALTH PROTECTION BUILDING 7 TUNNEY'S PASTURE OTTAWA ON K1A 0R6	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:	ON0195805 8176 RESEARCH ADMIN. 92,93,94,95,96,97			Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	148 INORGANIC LABORATORY CHEMICALS				
Waste Class: Waste Class Desc:	211 AROMATIC SOLVENTS				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		241			
Waste Class Desc:		HALOGENATED SOLVENTS			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
26	3 of 3	ESE/0.0	61.9 / -1.15	Public Works Government Services Canada 19 Tunney's Pasture Dr Ottawa ON K1A 0S5	ECA
Approval No:		2549-6MGQ3H		MOE District:	
Approval Date:		2006-03-27		City:	
Status:		Approved		Longitude:	
Record Type:		ECA		Latitude:	
Link Source:		IDS		Geometry X:	
SWP Area Name:				Geometry Y:	
Approval Type:		ECA-AIR			
Project Type:		AIR			
Business Name:		Public Works Government Services Canada			
Address:		19 Tunney's Pasture Dr			
Full Address:					
Full PDF Link:		https://www.accessenvironment.ene.gov.on.ca/instruments/4124-6KVMGU-14.pdf			
PDF Site Location:					
27	1 of 2	SE/0.0	62.9 / -0.14	EllisDon Corporation 129 Yarrow Driveway Ottawa ON	SPL
Ref No:		3660-AJFLAE		Discharger Report:	
Site No:		NA		Material Group:	
Incident Dt:		2/9/2017		Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:				Sector Type:	Other
Incident Event:		Leak/Break		Agency Involved:	
Contaminant Code:		15		Nearest Watercourse:	
Contaminant Name:		HYDRAULIC OIL		Site Address:	129 Yarrow Driveway
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:				Site Municipality:	Ottawa
Nature of Impact:				Site Lot:	
Receiving Medium:				Site Conc:	
Receiving Env:		Land		Northing:	
MOE Response:		No		Easting:	
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:		2/10/2017		Site Map Datum:	
Dt Document Closed:				SAC Action Class:	Land Spills
Incident Reason:		Unknown / N/A		Source Type:	
Site Name:		Ottawa LRT-Construction Site<UNOFFICIAL>			
Site County/District:					
Site Geo Ref Meth:					
Incident Summary:		Ottawa LRT/Bellai Bros: 1 L hydraulic oil to ground, cleaned.			
Contaminant Qty:		0 other - see incident description			
27	2 of 2	SE/0.0	62.9 / -0.14	129 Yarrow Dr Ottawa ON	SPL

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Ref No: Site No: Incident Dt: Year: Incident Cause: Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Incident Reason: Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: Contaminant Qty:	1480-APSP8W NA 7/29/2017 Leak/Break 15 HYDRAULIC OIL n/a n/a Land No 7/31/2017 Equipment Failure site<UNOFFICIAL> OLRT: ~ 3 L hydraulic oil to gravel, clnd 3 L	Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:	 2 - Minor Environment Miscellaneous Industrial 129 Yarrow Dr Ottawa Eastern Ottawa Land Spills Unknown / N/A		
28	1 of 1	SW/0.0	63.7 / 0.70	AECON CONSTRUCTION ONTARIO EAST LIMITED ON	EASR
Approval No: Status: Date: Record Type: Link Source: Project Type: Full Address: Approval Type: SWP Area Name: PDF URL: PDF Site Location:	R-009-1112419397 REGISTERED 2020-07-21 EASR MOFA Water Taking - Construction Dewatering EASR-Water Taking - Construction Dewatering Rideau Valley	MOE District: Municipality: Latitude: Longitude: Geometry X: Geometry Y:	Ottawa 45.40416667 -75.74 		
29	1 of 8	SSW/0.0	64.2 / 1.16	GAL Power Systems Limited 101 Goldenrod Driveway, Tunney's Pasture Ottawa ON	SPL
Ref No: Site No: Incident Dt: Year: Incident Cause: Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact:	4733-87EP95 Other Discharges 13 DIESEL FUEL Not Anticipated	Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: Site Lot:	 Other 		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Receiving Medium: Receiving Env: MOE Response: Referral to others Dt MOE Arvl on Scn: MOE Reported Dt: 7/16/2010 Dt Document Closed: 7/23/2010 Incident Reason: Spill Site Name: GAL Power<UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: Gal Power: 5 L coloured dsl to pvd surface. Clnd Contaminant Qty: 5 L Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Land Spills Source Type:					
29	2 of 8	SSW/0.0	64.2 / 1.16	Public Work Government Service Canada 101 Goldenrod Driveway Ottawa ON	SPL
Ref No: 0416-94LPNH Site No: Incident Dt: 01-FEB-13 Year: Incident Cause: Unknown / N/A Incident Event: Contaminant Code: 24 Contaminant Name: GLYCOL/WATER SOLUTION Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Not Anticipated Nature of Impact: Surface Water Pollution Receiving Medium: Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 04-FEB-13 Dt Document Closed: Incident Reason: Unknown / N/A Site Name: Tunney's Pasture<UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: Public Works of Canada: 2L Glycol cln Contaminant Qty: 2 L Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Unknown / N/A Agency Involved: Nearest Watercourse: Site Address: 101 Goldenrod Driveway Site District Office: Site Postal Code: Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Land Spills Source Type:					
29	3 of 8	SSW/0.0	64.2 / 1.16	101 Goldenrod Driveway Ottawa ON	SPL
Ref No: 4801-AE4JSQ Site No: NA Incident Dt: 9/24/2016 Year: Incident Cause: Incident Event: Leak/Break Contaminant Code: 13 Contaminant Name: DIESEL FUEL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Unknown / N/A Agency Involved: Nearest Watercourse: Site Address: 101 Goldenrod Driveway Site District Office: Site Postal Code: Site Region: Site Municipality: Ottawa Site Lot: Site Conc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Incident Reason: Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: Contaminant Qty:	Land 9/24/2016 Unknown / N/A Brookfield GIS<UNOFFICIAL> Brookfield GIS: 3L diesel to asphalt, cleaned 3 L			Nothing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:	Land Spills

29	4 of 8	SSW/0.0	64.2 / 1.16	Brookfield Global Integrated Solutions 101 Goldenrod Drive Ottawa ON K1A 0T6	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:	ON6748119 531310 REAL ESTATE PROPERTY MANAGERS 2016 Canada			Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	 CO_OFFICIAL No No
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	331 WASTE COMPRESSED GASES				
Waste Class: Waste Class Desc:	263 ORGANIC LABORATORY CHEMICALS				
Waste Class: Waste Class Desc:	262 DETERGENTS/SOAPS				
Waste Class: Waste Class Desc:	252 WASTE OILS & LUBRICANTS				
Waste Class: Waste Class Desc:	145 PAINT/PIGMENT/COATING RESIDUES				

29	5 of 8	SSW/0.0	64.2 / 1.16	Brookfield Global Integrated Solutions 101 Goldenrod Drive Ottawa ON K1A 0T6	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:	ON6748119 531310 REAL ESTATE PROPERTY MANAGERS 2015 Canada			Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	 CO_OFFICIAL No No
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	262 DETERGENTS/SOAPS				
Waste Class: Waste Class Desc:	252 WASTE OILS & LUBRICANTS				
Waste Class: Waste Class Desc:	145 PAINT/PIGMENT/COATING RESIDUES				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		331			
Waste Class Desc:		WASTE COMPRESSED GASES			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
29	6 of 8	SSW/0.0	64.2 / 1.16	BGIS BGIS 101 Goldenrod Drive Ottawa ON K1A 0T6	GEN
Generator No:		ON6748119		Status:	Registered
SIC Code:		Co Admin:			
SIC Description:		Choice of Contact:			
Approval Years:		As of Dec 2018		Phone No Admin:	
PO Box No:		Contam. Facility:			
Country:		Canada		MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		145 I			
Waste Class Desc:		Wastes from the use of pigments, coatings and paints			
Waste Class:		252 L			
Waste Class Desc:		Waste crankcase oils and lubricants			
Waste Class:		262 L			
Waste Class Desc:		Detergents and soaps			
Waste Class:		263 I			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		331 I			
Waste Class Desc:		Waste compressed gases including cylinders			
29	7 of 8	SSW/0.0	64.2 / 1.16	BGIS BGIS 101 Goldenrod Drive Ottawa ON K1A 0T6	GEN
Generator No:		ON6748119		Status:	Registered
SIC Code:		Co Admin:			
SIC Description:		Choice of Contact:			
Approval Years:		As of Jul 2020		Phone No Admin:	
PO Box No:		Contam. Facility:			
Country:		Canada		MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		263 I			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		262 L			
Waste Class Desc:		Detergents and soaps			
Waste Class:		145 I			
Waste Class Desc:		Wastes from the use of pigments, coatings and paints			
Waste Class:		331 I			
Waste Class Desc:		Waste compressed gases including cylinders			
Waste Class:		252 L			
Waste Class Desc:		Waste crankcase oils and lubricants			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
29	8 of 8	SSW/0.0	64.2 / 1.16	BGIS BGIS 101 Goldenrod Drive Ottawa ON K1A 0T6	GEN
Generator No:	ON6748119			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Jan 2021			Phone No Admin:	
PO Box No:	BGIS			Contam. Facility:	
Country:	Canada			MHSW Facility:	
Detail(s)					
Waste Class:	262 L				
Waste Class Desc:	Detergents and soaps				
Waste Class:	252 L				
Waste Class Desc:	Waste crankcase oils and lubricants				
Waste Class:	331 I				
Waste Class Desc:	Waste compressed gases including cylinders				
Waste Class:	145 I				
Waste Class Desc:	Wastes from the use of pigments, coatings and paints				
Waste Class:	263 I				
Waste Class Desc:	Misc. waste organic chemicals				
30	1 of 1	SSW/0.0	64.2 / 1.16	ON	BORE
Borehole ID:	613117			Inclin FLG:	No
OGF ID:	215514421			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:				Primary Name:	
Completion Date:	MAY-1961			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	45.403512
Total Depth m:	-999			Longitude DD:	-75.738299
Depth Ref:	Ground Surface			UTM Zone:	18
Depth Elev:				Easting:	442221
Drill Method:				Northing:	5028042
Orig Ground Elev m:	61.2			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	62.1				
Concession:					
Location D:					
Survey D:					
Comments:					
Borehole Geology Stratum					
Geology Stratum ID:	218393783			Mat Consistency:	Compact
Top Depth:	0			Material Moisture:	
Bottom Depth:				Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Bedrock			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 4: Gsc Material Description: Stratum Description:			Depositional Gen: BEDROCK. PEBBLES. CLAY. BEDROCK. FEET.SAND. GRAVEL. COMPACT. GRAVEL. COMPACT.		
Source					
Source Type:		Data Survey	Source Appl:		Spatial/Tabular
Source Orig:		Geological Survey of Canada	Source Iden:		1
Source Date:		1956-1972	Scale or Res:		Varies
Confidence:			Horizontal:		NAD27
Observatio:			Verticalda:		Mean Average Sea Level
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Details:		File: OTTAWA2.txt RecordID: 056250 NTS_Sheet: 31G05G			
Confiden 1:					
Source List					
Source Identifier:		1	Horizontal Datum:		NAD27
Source Type:		Data Survey	Vertical Datum:		Mean Average Sea Level
Source Date:		1956-1972	Projection Name:		Universal Transverse Mercator
Scale or Resolution:		Varies			
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Originators:		Geological Survey of Canada			
31	1 of 1	ESE/0.0	61.9 / -1.15	Tunney's Pasture and Yarrow Driveway Ottawa ON	SPL
Ref No:		3044-A8BSWH	Discharger Report:		
Site No:		NA	Material Group:		
Incident Dt:		2016/03/23	Health/Env Conseq:		
Year:			Client Type:		
Incident Cause:			Sector Type:		Miscellaneous Industrial
Incident Event:		Leak/Break	Agency Involved:		
Contaminant Code:		13	Nearest Watercourse:		
Contaminant Name:		DIESEL FUEL	Site Address:		Tunney's Pasture and Yarrow Driveway
Contaminant Limit 1:			Site District Office:		
Contam Limit Freq 1:			Site Postal Code:		
Contaminant UN No 1:			Site Region:		
Environment Impact:			Site Municipality:		Ottawa
Nature of Impact:			Site Lot:		
Receiving Medium:			Site Conc:		
Receiving Env:		Land	Northing:		
MOE Response:		No	Easting:		
Dt MOE Arvl on Scn:			Site Geo Ref Accu:		
MOE Reported Dt:		2016/03/23	Site Map Datum:		
Dt Document Closed:			SAC Action Class:		Land Spills
Incident Reason:		Equipment Failure	Source Type:		
Site Name:		Construction Site<UNOFFICIAL>			
Site County/District:					
Site Geo Ref Meth:					
Incident Summary:		RW Tomlinson- 50L Diesel Fuel to Ground			
Contaminant Qty:		50 L			
32	1 of 5	ENE/0.0	60.9 / -2.15	170 Tunney's Pasture Lane STATISTICS CANADA LOADING DOCK<UNOFFICIAL> Ottawa ON	SPL
Ref No:		2378-6V5PU8	Discharger Report:		
Site No:			Material Group:		Chemicals
Incident Dt:		11/1/2006	Health/Env Conseq:		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Year: Incident Cause: Other Discharges Incident Event: Contaminant Code: 21 Contaminant Name: BATTERY ACID (SULFURIC ACID) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Not Anticipated Nature of Impact: Surface Water Pollution Receiving Medium: Water Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 11/1/2006 Dt Document Closed: Incident Reason: Error- Operator error Site Name: 170 TUNNEY'S PASTURE LANE Site County/District: Site Geo Ref Meth: Incident Summary: Statistics Canada: 1 gal battery acid to storm, Cln Contaminant Qty: 5 L Client Type: Sector Type: Other Agency Involved: Nearest Watercourse: Site Address: 170 TUNNEY'S PASTURE LANE Site District Office: Ottawa Site Postal Code: Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:					
32	2 of 5	ENE/0.0	60.9 / -2.15	170 Tunneys Pasture Driveway Ottawa ON	SPL
Ref No: 4258-A6SKWM Site No: NA Incident Dt: 2016/02/02 Year: Incident Cause: Incident Event: Leak/Break Contaminant Code: 15 Contaminant Name: MACHINE OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: Land; Source Water Zone MOE Response: No Dt MOE Arvl on Scn: MOE Reported Dt: 2016/02/03 Dt Document Closed: Incident Reason: Equipment Failure Site Name: John Talon Building<UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: Brookfield GIS, 1-2L machine oil spill, cleaned. Contaminant Qty: 2 other - see incident description Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Unknown / N/A Agency Involved: Nearest Watercourse: Site Address: 170 Tunneys Pasture Driveway Site District Office: Site Postal Code: Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Land Spills Source Type:					
32	3 of 5	ENE/0.0	60.9 / -2.15	170 Tunney's Pasture Drive Ottawa ON	SPL
Ref No: 4614-AKUHST Site No: Incident Dt: 3/27/2017 Year: Incident Cause: Discharger Report: Material Group: Health/Env Conseq: 2 - Minor Environment Client Type: Sector Type: Unknown / N/A					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Incident Event: Leak/Break Contaminant Code: 24 Contaminant Name: PROPYLENE GLYCOL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: 1142 Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: Land MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 3/27/2017 Dt Document Closed: Incident Reason: Operator/Human Error Site Name: 170 Tunney's Pasture Drive Ottawa<UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: 10-15L Glycol Spill; CB, Cntd, Ottawa Contaminant Qty: 15 L Agency Involved: Nearest Watercourse: Site Address: 170 Tunney's Pasture Drive Site District Office: Ottawa Site Postal Code: Site Region: Eastern Site Municipality: Ottawa Site Lot: Site Conc: Northing: 5028388 Easting: 442444 Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type: Valve/Fitting/Piping					
32	4 of 5	ENE/0.0	60.9 / -2.15	170 Tunneys Pasture Ottawa ON	SPL
Ref No: 1251-AKUJZP Site No: Incident Dt: 3/27/2017 Year: Incident Cause: Incident Event: Collision/Accident Contaminant Code: 24 Contaminant Name: PROPYLENE GLYCOL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: 1142 Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: Land; Source Water Zone MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 3/27/2017 Dt Document Closed: Incident Reason: Unknown / N/A Site Name: Approx. 2 L propylene glycol to CB.<UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: City of Ottawa: up to 2L of propylene glycol from truck to CB. Contaminant Qty: 15 L Discharger Report: Material Group: Health/Env Conseq: 2 - Minor Environment Client Type: Sector Type: Miscellaneous Communal Agency Involved: Nearest Watercourse: Site Address: 170 Tunneys Pasture Site District Office: Ottawa Site Postal Code: Site Region: Eastern Site Municipality: Ottawa Site Lot: Site Conc: Northing: 5028327 Easting: 442355 Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type: Motor Vehicle					
32	5 of 5	ENE/0.0	60.9 / -2.15	Waste Connections of Canada Inc. 170 Tunney's Pasture Dr Ottawa ON	SPL
Ref No: 6415-BEUQ8F Site No: NA Incident Dt: 8/8/2019 Year: Incident Cause: Incident Event: Leak/Break Discharger Report: Material Group: Health/Env Conseq: 2 - Minor Environment Client Type: Corporation Sector Type: Miscellaneous Communal Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Code: 46 Contaminant Name: COOKING GREASE Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: n/a Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: Land MOE Response: No Dt MOE Arvl on Scn: MOE Reported Dt: 8/8/2019 Dt Document Closed: 9/11/2019 Incident Reason: Unknown / N/A Site Name: Statistics Canada<UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: Waste Connections: 10L cooking oil spill Contaminant Qty: 10 L Nearest Watercourse: Site Address: 170 Tunney's Pasture Dr Site District Office: Ottawa Site Postal Code: Site Region: Eastern Site Municipality: Ottawa Site Lot: Site Conc: Northing: 5028324.09 Easting: 442350.03 Site Geo Ref Accu: Site Map Datum: SAC Action Class: Land Spills Source Type: Container/Drum/Tote					
33	1 of 9	NE/0.0	60.9 / -2.15	NATIONAL RESEARCH COUNCIL HEALTH PROTECTION BUILDING 7 HOLLAND AVENUE, TUNNEY'S PASTURE OTTAWA ON K1A 0R6	GEN
Generator No: ON0195805 SIC Code: 8176 SIC Description: RESEARCH ADMIN. Approval Years: 98 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
Detail(s)					
Waste Class: 241 Waste Class Desc: HALOGENATED SOLVENTS Waste Class: 148 Waste Class Desc: INORGANIC LABORATORY CHEMICALS Waste Class: 211 Waste Class Desc: AROMATIC SOLVENTS Waste Class: 212 Waste Class Desc: ALIPHATIC SOLVENTS Waste Class: 263 Waste Class Desc: ORGANIC LABORATORY CHEMICALS					
33	2 of 9	NE/0.0	60.9 / -2.15	GVT. OF CAN. - ATOMIC ENERGY CONT. L B, TUNNEY'S PASTURE (HPB BUILDING) C/O P O BOX 1046 OTTAWA ON K1P 5S9	GEN
Generator No: ON0269000 SIC Code: 8125 SIC Description: REGULATORY SERV. Approval Years: 86,87,88,89,90 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		112			
Waste Class Desc:		ACID WASTE - HEAVY METALS			
Waste Class:		211			
Waste Class Desc:		AROMATIC SOLVENTS			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
33	3 of 9	NE/0.0	60.9 / -2.15	ATOMIC ENERGY CONTROL BOARD HPB BUILDING (HOLLAND & COLOMBINE) TUNNEY'S PASTURE, ROOM 253 OTTAWA ON K1P 5S9	GEN
Generator No:	ON0269000			Status:	
SIC Code:	8125			Co Admin:	
SIC Description:	REGULATORY SERV.			Choice of Contact:	
Approval Years:	92,93,97			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
Waste Class:		112			
Waste Class Desc:		ACID WASTE - HEAVY METALS			
Waste Class:		211			
Waste Class Desc:		AROMATIC SOLVENTS			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
33	4 of 9	NE/0.0	60.9 / -2.15	GVT. OF CAN. - ATOMIC ENERGY CONT.18-029 L B, TUNNEY'S PASTURE (HPB BUILDING) C/O P O BOX 1046 OTTAWA ON K1P 5S9	GEN
Generator No:	ON0269000			Status:	
SIC Code:	8125			Co Admin:	
SIC Description:	REGULATORY SERV.			Choice of Contact:	
Approval Years:	94,95,96			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		112			
Waste Class Desc:		ACID WASTE - HEAVY METALS			
Waste Class:		211			
Waste Class Desc:		AROMATIC SOLVENTS			
Waste Class:		212			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
33	5 of 9	NE/0.0	60.9 / -2.15	ATOMIC ENERGY CONTROL BOARD HPB BUILDING 7 (HOLLAND & COLOMBINE) TUNNEY'S PASTURE, ROOM 253 OTTAWA ON K1A 0L2	GEN
Generator No:		ON0269000		Status:	
SIC Code:		8125		Co Admin:	
SIC Description:		REGULATORY SERV.		Choice of Contact:	
Approval Years:		98,99,00,01		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		112			
Waste Class Desc:		ACID WASTE - HEAVY METALS			
Waste Class:		211			
Waste Class Desc:		AROMATIC SOLVENTS			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
33	6 of 9	NE/0.0	60.9 / -2.15	CANADIAN NUCLEAR SAFETY COMMISSION HPB BUILDING 7 (HOLLAND & COLOMBINE) TUNNEY'S PASTURE, ROOM 253 OTTAWA ON K1A 0L2	GEN
Generator No:		ON0269000		Status:	
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:		02,03,04,05,06,07,08		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		211			
Waste Class Desc:		AROMATIC SOLVENTS			
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
Waste Class:		112			
Waste Class Desc:		ACID WASTE - HEAVY METALS			
Waste Class:		114			
Waste Class Desc:		OTHER INORGANIC ACID WASTES			
33	7 of 9	NE/0.0	60.9 / -2.15	CANADIAN NUCLEAR SAFETY COMMISSION	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
				HPB BUILDING 7 (HOLLAND & COLOMBINE) TUNNEY'S PASTURE, ROOM 253 OTTAWA ON	
Generator No:	ON0269000			Status:	
SIC Code:	911240			Co Admin:	
SIC Description:	Federal Regulatory Services			Choice of Contact:	
Approval Years:	2009			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:	221				
Waste Class Desc:	LIGHT FUELS				
Waste Class:	112				
Waste Class Desc:	ACID WASTE - HEAVY METALS				
Waste Class:	114				
Waste Class Desc:	OTHER INORGANIC ACID WASTES				
Waste Class:	211				
Waste Class Desc:	AROMATIC SOLVENTS				
33	8 of 9	NE/0.0	60.9 / -2.15	CANADIAN NUCLEAR SAFETY COMMISSION HPB BUILDING 7 (HOLLAND & COLOMBINE) TUNNEY'S PASTURE, ROOM 253 OTTAWA ON	GEN
Generator No:	ON0269000			Status:	
SIC Code:	911240			Co Admin:	
SIC Description:	Federal Regulatory Services			Choice of Contact:	
Approval Years:	2010			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:	113				
Waste Class Desc:	ACID WASTE - OTHER METALS				
Waste Class:	263				
Waste Class Desc:	ORGANIC LABORATORY CHEMICALS				
Waste Class:	221				
Waste Class Desc:	LIGHT FUELS				
Waste Class:	211				
Waste Class Desc:	AROMATIC SOLVENTS				
Waste Class:	112				
Waste Class Desc:	ACID WASTE - HEAVY METALS				
Waste Class:	114				
Waste Class Desc:	OTHER INORGANIC ACID WASTES				
33	9 of 9	NE/0.0	60.9 / -2.15	200 Tunneys Pasture Driveway Ottawa ON K1Y4G8	EHS
Order No:	20170605059			Nearest Intersection:	
Status:	C			Municipality:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Report Type:		Custom Report		Client Prov/State:	ON
Report Date:		09-JUN-17		Search Radius (km):	.1
Date Received:		05-JUN-17		X:	-75.735326
Previous Site Name:				Y:	45.407822
Lot/Building Size:					
Additional Info Ordered:					

34

1 of 21

E/0.0

61.7 / -1.35

GVT. OF CAN-STATISTICS CANADA

1405 Main Statistics Canada Building TUNNEY'S PASTURE

OTTAWA ON K1A 0T6

GEN

Generator No:

ON0684800

Status:

Co Admin:

Choice of Contact:

Phone No Admin:

Contam. Facility:

MHSW Facility:

SIC Code:

SIC Description:

Approval Years:

PO Box No:

Country:

02,03,04,05,06,07,08

Detail(s)

Waste Class:

Waste Class Desc:

213

PETROLEUM DISTILLATES

Waste Class:

Waste Class Desc:

264

PHOTOPROCESSING WASTES

Waste Class:

Waste Class Desc:

263

ORGANIC LABORATORY CHEMICALS

Waste Class:

Waste Class Desc:

312

PATHOLOGICAL WASTES

Waste Class:

Waste Class Desc:

121

ALKALINE WASTES - HEAVY METALS

34	2 of 21	E/0.0	61.7 / -1.35	NATIONAL ARCHIVES OF CANADA STATISTICS MAIN BUILDING, ROOM 1306 HOLLAND AVENUE OTTAWA ON K1A 0T6	GEN
Generator No:		ON0757002		Status:	
SIC Code:		8551		Co Admin:	
SIC Description:		MUSEUMS/ARCHIVES		Choice of Contact:	
Approval Years:		93,97,98		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		241			
Waste Class Desc:		HALOGENATED SOLVENTS			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		264			
Waste Class Desc:		PHOTOPROCESSING WASTES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
34	3 of 21	E/0.0	61.7 / -1.35	GVT. OF CAN. - NATIONAL ARCHIVES CANADA STATISTICS MAIN BUILDING, ROOM 1306 HOLLAND AVENUE OTTAWA ON K1A 0T6	GEN
Generator No: ON0757002		Status:			
SIC Code: 8551		Co Admin:			
SIC Description: MUSEUMS/ARCHIVES		Choice of Contact:			
Approval Years: 94		Phone No Admin:			
PO Box No:		Contam. Facility:			
Country:		MHSW Facility:			
<u>Detail(s)</u>					
Waste Class:		241			
Waste Class Desc:		HALOGENATED SOLVENTS			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
34	4 of 21	E/0.0	61.7 / -1.35	NATIONAL ARCHIVES CANADA STATISTICS MAIN BUILDING, ROOM 1306 HOLLAND AVENUE OTTAWA ON K1A 0T6	GEN
Generator No: ON0757002		Status:			
SIC Code: 8551		Co Admin:			
SIC Description: MUSEUMS/ARCHIVES		Choice of Contact:			
Approval Years: 95,96		Phone No Admin:			
PO Box No:		Contam. Facility:			
Country:		MHSW Facility:			
<u>Detail(s)</u>					
Waste Class:		241			
Waste Class Desc:		HALOGENATED SOLVENTS			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		264			
Waste Class Desc:		PHOTOPROCESSING WASTES			
34	5 of 21	E/0.0	61.7 / -1.35	GVT. OF CAN-STATISTICS CANADA 1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON	GEN
Generator No: ON0684800		Status:			
SIC Code: 911910		Co Admin:			
SIC Description: Other Federal Government Public Administration		Choice of Contact:			
Approval Years: 2009		Phone No Admin:			
PO Box No:		Contam. Facility:			
Country:		MHSW Facility:			
<u>Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Desc: 263 ORGANIC LABORATORY CHEMICALS Waste Class: Waste Class Desc: 264 PHOTOPROCESSING WASTES Waste Class: Waste Class Desc: 312 PATHOLOGICAL WASTES Waste Class: Waste Class Desc: 121 ALKALINE WASTES - HEAVY METALS Waste Class: Waste Class Desc: 213 PETROLEUM DISTILLATES					
34	6 of 21	E/0.0	61.7 / -1.35	GVT. OF CAN-STATISTICS CANADA 1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: ON0684800 911910 Other Federal Government Public Administration 2010 Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: Waste Class Desc: 148 INORGANIC LABORATORY CHEMICALS Waste Class: Waste Class Desc: 213 PETROLEUM DISTILLATES Waste Class: Waste Class Desc: 263 ORGANIC LABORATORY CHEMICALS Waste Class: Waste Class Desc: 264 PHOTOPROCESSING WASTES Waste Class: Waste Class Desc: 312 PATHOLOGICAL WASTES Waste Class: Waste Class Desc: 121 ALKALINE WASTES - HEAVY METALS					
34	7 of 21	E/0.0	61.7 / -1.35	Lexus Mechanical 150 Tunney's Pasture Ottawa ON	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: ON7437788 238220 2011 Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
34	8 of 21	E/0.0	61.7 / -1.35	GVT. OF CAN-STATISTICS CANADA 1405 Main Statistics Canada Building TUNNEY'S	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
				PASTURE OTTAWA ON	
Generator No:	ON0684800			Status:	
SIC Code:	911910			Co Admin:	
SIC Description:	Other Federal Government Public Administration			Choice of Contact:	
Approval Years:	2011			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
 <u>Detail(s)</u>					
Waste Class:	312				
Waste Class Desc:	PATHOLOGICAL WASTES				
Waste Class:	263				
Waste Class Desc:	ORGANIC LABORATORY CHEMICALS				
Waste Class:	121				
Waste Class Desc:	ALKALINE WASTES - HEAVY METALS				
Waste Class:	213				
Waste Class Desc:	PETROLEUM DISTILLATES				
Waste Class:	264				
Waste Class Desc:	PHOTOPROCESSING WASTES				
Waste Class:	148				
Waste Class Desc:	INORGANIC LABORATORY CHEMICALS				
34	9 of 21	E/0.0	61.7 / -1.35	GVT. OF CAN-STATISTICS CANADA 1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON K1A 0T6	GEN
Generator No:	ON0684800			Status:	
SIC Code:	911910			Co Admin:	
SIC Description:	Other Federal Government Public Administration			Choice of Contact:	
Approval Years:	2012			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
 <u>Detail(s)</u>					
Waste Class:	148				
Waste Class Desc:	INORGANIC LABORATORY CHEMICALS				
Waste Class:	263				
Waste Class Desc:	ORGANIC LABORATORY CHEMICALS				
Waste Class:	264				
Waste Class Desc:	PHOTOPROCESSING WASTES				
Waste Class:	121				
Waste Class Desc:	ALKALINE WASTES - HEAVY METALS				
Waste Class:	312				
Waste Class Desc:	PATHOLOGICAL WASTES				
Waste Class:	213				
Waste Class Desc:	PETROLEUM DISTILLATES				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
34	10 of 21	E/0.0	61.7 / -1.35	Statistics Canada 150Tunney's Pasture Drivway Main Bldg, SC0005 Ottawa ON	GEN
Generator No: ON5658190		Status:			
SIC Code: 911910		Co Admin:			
SIC Description:		Choice of Contact:			
Approval Years: 2013		Phone No Admin:			
PO Box No:		Contam. Facility:			
Country:		MHSW Facility:			
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
Waste Class:		262			
Waste Class Desc:		DETERGENTS/SOAPS			
34	11 of 21	E/0.0	61.7 / -1.35	Health Canada 150 Tunney's Pasture Drwy Ottawa ON	GEN
Generator No: ON6792658		Status:			
SIC Code: 911240		Co Admin:			
SIC Description:		Choice of Contact:			
Approval Years: 2013		Phone No Admin:			
PO Box No:		Contam. Facility:			
Country:		MHSW Facility:			
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
Waste Class:		261			
Waste Class Desc:		PHARMACEUTICALS			
34	12 of 21	E/0.0	61.7 / -1.35	GVT. OF CAN-STATISTICS CANADA 1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON	GEN
Generator No: ON0684800		Status:			
SIC Code: 911910		Co Admin:			
SIC Description:		Choice of Contact:			
Approval Years: 2013		Phone No Admin:			
PO Box No:		Contam. Facility:			
Country:		MHSW Facility:			
<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		121			
Waste Class Desc:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		264			
Waste Class Desc:		PHOTOPROCESSING WASTES			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		148			
Waste Class Desc:		INORGANIC LABORATORY CHEMICALS			

<u>34</u>	13 of 21	E/0.0	61.7 / -1.35	GVT. OF CAN-STATISTICS CANADA 1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON K1A 0T6	GEN
Generator No:	ON0684800			Status:	
SIC Code:	911910			Co Admin:	
SIC Description:	911910			Choice of Contact:	CO_OFFICIAL
Approval Years:	2015			Phone No Admin:	
PO Box No:				Contam. Facility:	No
Country:	Canada			MHSW Facility:	No

Detail(s)

Waste Class:	264
Waste Class Desc:	PHOTOPROCESSING WASTES
Waste Class:	145
Waste Class Desc:	PAINT/PIGMENT/COATING RESIDUES
Waste Class:	212
Waste Class Desc:	ALIPHATIC SOLVENTS
Waste Class:	312
Waste Class Desc:	PATHOLOGICAL WASTES
Waste Class:	263
Waste Class Desc:	ORGANIC LABORATORY CHEMICALS
Waste Class:	121
Waste Class Desc:	ALKALINE WASTES - HEAVY METALS
Waste Class:	213
Waste Class Desc:	PETROLEUM DISTILLATES
Waste Class:	148
Waste Class Desc:	INORGANIC LABORATORY CHEMICALS

<u>34</u>	14 of 21	E/0.0	61.7 / -1.35	GVT. OF CAN-STATISTICS CANADA 1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON K1A 0T6	GEN
Generator No:	ON0684800			Status:	
SIC Code:	911910			Co Admin:	
SIC Description:	911910			Choice of Contact:	CO_OFFICIAL
Approval Years:	2016			Phone No Admin:	
PO Box No:				Contam. Facility:	No
Country:	Canada			MHSW Facility:	No

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		121			
Waste Class Desc:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		264			
Waste Class Desc:		PHOTOPROCESSING WASTES			
Waste Class:		148			
Waste Class Desc:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		331			
Waste Class Desc:		WASTE COMPRESSED GASES			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		145			
Waste Class Desc:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			

34	15 of 21	E/0.0	61.7 / -1.35	GVT. OF CAN-STATISTICS CANADA 1405 Main Statistics Canada Building TUNNEY'S PASTURE OTTAWA ON K1A 0T6	GEN
Generator No:	ON0684800			Status:	
SIC Code:	911910			Co Admin:	
SIC Description:	911910			Choice of Contact:	CO_OFFICIAL
Approval Years:	2014			Phone No Admin:	
PO Box No:				Contam. Facility:	No
Country:	Canada			MHSW Facility:	No

<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
Waste Class:		121			
Waste Class Desc:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		148			
Waste Class Desc:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		264			
Waste Class Desc:		PHOTOPROCESSING WASTES			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
34	16 of 21	E/0.0	61.7 / -1.35	Statistics Canada 150Tunney's Pasture Driveway Main Bldg, SC0005 Ottawa ON K1A0T6	GEN
Generator No:	ON5658190			Status:	
SIC Code:	911910			Co Admin:	Joanne Boisjoli
SIC Description:	911910			Choice of Contact:	CO_OFFICIAL
Approval Years:	2014			Phone No Admin:	613-951-4447 Ext.
PO Box No:				Contam. Facility:	No
Country:	Canada			MHSW Facility:	No
<u>Detail(s)</u>					
Waste Class:	312				
Waste Class Desc:	PATHOLOGICAL WASTES				
Waste Class:	262				
Waste Class Desc:	DETERGENTS/SOAPS				
34	17 of 21	E/0.0	61.7 / -1.35	GVT. OF CAN-STATISTICS CANADA Administrative Support Services Division 1405 Main Statistics Canada Building TUNNEYS PASTURE OTTAWA ON K1A 0T6	GEN
Generator No:	ON0684800			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Dec 2018			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:	121 C				
Waste Class Desc:	Alkaline slutions - containing heavy metals				
Waste Class:	145 L				
Waste Class Desc:	Wastes from the use of pigments, coatings and paints				
Waste Class:	148 I				
Waste Class Desc:	Misc. wastes and inorganic chemicals				
Waste Class:	148 L				
Waste Class Desc:	Misc. wastes and inorganic chemicals				
Waste Class:	212 I				
Waste Class Desc:	Aliphatic solvents and residues				
Waste Class:	213 I				
Waste Class Desc:	Petroleum distillates				
Waste Class:	263 L				
Waste Class Desc:	Misc. waste organic chemicals				
Waste Class:	264 C				
Waste Class Desc:	Photoprocessing wastes				
Waste Class:	264 L				
Waste Class Desc:	Photoprocessing wastes				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		312 P			
Waste Class Desc:		Pathological wastes			
Waste Class:		331 I			
Waste Class Desc:		Waste compressed gases including cylinders			
Waste Class:		331 R			
Waste Class Desc:		Waste compressed gases including cylinders			
34	18 of 21	E/0.0	61.7 / -1.35	150 Tunneys Pasture Driveway Ottawa ON	SPL
Ref No:	2886-ANBPAS			Discharger Report:	
Site No:				Material Group:	
Incident Dt:	6/6/2017			Health/Env Conseq:	2 - Minor Environment
Year:				Client Type:	
Incident Cause:				Sector Type:	Miscellaneous Industrial
Incident Event:	Dumping			Agency Involved:	
Contaminant Code:	24			Nearest Watercourse:	
Contaminant Name:	GLYCOL/WATER SOLUTION			Site Address:	150 Tunneys Pasture Driveway
Contaminant Limit 1:				Site District Office:	Ottawa
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:	n/a			Site Region:	Eastern
Environment Impact:				Site Municipality:	Ottawa
Nature of Impact:				Site Lot:	
Receiving Medium:				Site Conc:	
Receiving Env:	Land			Northing:	
MOE Response:				Easting:	
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:	6/14/2017			Site Map Datum:	
Dt Document Closed:				SAC Action Class:	
Incident Reason:	Operator/Human Error			Source Type:	Structure
Site Name:	BGIS<UNOFFICIAL>				
Site County/District:					
Site Geo Ref Meth:					
Incident Summary:	BGIS - 3L of Glycol to ground and cb - Ottawa				
Contaminant Qty:	3 L				
34	19 of 21	E/0.0	61.7 / -1.35	GVT. OF CAN-STATISTICS CANADA Administrative Support Services Division 1405 Main Statistics Canada Building TUNNEYS PASTURE OTTAWA ON K1A 0T6	GEN
Generator No:	ON0684800			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Jul 2020			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		263 L			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		331 R			
Waste Class Desc:		Waste compressed gases including cylinders			
Waste Class:		312 P			
Waste Class Desc:		Pathological wastes			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Desc:		264 C Photoprocessing wastes			
Waste Class: Waste Class Desc:		145 L Wastes from the use of pigments, coatings and paints			
Waste Class: Waste Class Desc:		212 I Aliphatic solvents and residues			
Waste Class: Waste Class Desc:		331 I Waste compressed gases including cylinders			
Waste Class: Waste Class Desc:		148 L Misc. wastes and inorganic chemicals			
Waste Class: Waste Class Desc:		264 L Photoprocessing wastes			
Waste Class: Waste Class Desc:		121 C Alkaline slutions - containing heavy metals			
Waste Class: Waste Class Desc:		148 I Misc. wastes and inorganic chemicals			
Waste Class: Waste Class Desc:		213 I Petroleum distillates			

[34](#)

20 of 21

E/0.0

61.7 / -1.35

GVT. OF CAN-STATISTICS CANADA
Administrative Support Services Division
1405 Main Statistics Canada Building TUNNEYS
PASTURE
OTTAWA ON K1A 0T6

GEN

Generator No:	ON0684800	Status:	Registered
SIC Code:		Co Admin:	
SIC Description:		Choice of Contact:	
Approval Years:	As of Nov 2021	Phone No Admin:	
PO Box No:		Contam. Facility:	
Country:	Canada	MHSW Facility:	

Detail(s)

Waste Class: Waste Class Desc:	121 C Alkaline slutions - containing heavy metals
Waste Class: Waste Class Desc:	148 I Misc. wastes and inorganic chemicals
Waste Class: Waste Class Desc:	312 P Pathological wastes
Waste Class: Waste Class Desc:	264 L Photoprocessing wastes
Waste Class: Waste Class Desc:	145 L Wastes from the use of pigments, coatings and paints
Waste Class: Waste Class Desc:	213 I Petroleum distillates
Waste Class: Waste Class Desc:	148 L Misc. wastes and inorganic chemicals

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		212 I			
Waste Class Desc:		Aliphatic solvents and residues			
Waste Class:		263 L			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		264 C			
Waste Class Desc:		Photoprocessing wastes			
Waste Class:		331 I			
Waste Class Desc:		Waste compressed gases including cylinders			
Waste Class:		331 R			
Waste Class Desc:		Waste compressed gases including cylinders			

34	21 of 21	E/0.0	61.7 / -1.35	GVT. OF CAN-STATISTICS CANADA Administrative Support Services Division 1405 Main Statistics Canada Building TUNNEYS PASTURE OTTAWA ON K1A 0T6	GEN
Generator No:	ON0684800			Status: Registered	
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Feb 2022			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	

Detail(s)

Waste Class:	263 L
Waste Class Desc:	Misc. waste organic chemicals
Waste Class:	264 L
Waste Class Desc:	Photoprocessing wastes
Waste Class:	213 I
Waste Class Desc:	Petroleum distillates
Waste Class:	312 P
Waste Class Desc:	Pathological wastes
Waste Class:	212 I
Waste Class Desc:	Aliphatic solvents and residues
Waste Class:	331 I
Waste Class Desc:	Waste compressed gases including cylinders
Waste Class:	121 C
Waste Class Desc:	Alkaline slutions - containing heavy metals
Waste Class:	331 R
Waste Class Desc:	Waste compressed gases including cylinders
Waste Class:	264 C
Waste Class Desc:	Photoprocessing wastes
Waste Class:	145 L
Waste Class Desc:	Wastes from the use of pigments, coatings and paints
Waste Class:	148 I
Waste Class Desc:	Misc. wastes and inorganic chemicals
Waste Class:	148 L

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Desc:		Misc. wastes and inorganic chemicals			
35	1 of 2	ESE/0.0	61.9 / -1.15	Cascades Recovery Inc. 100 Tunney's Pasture Lane Ottawa ON	SPL
Ref No: 6172-8LPPQW Site No: Incident Dt: 9/14/2011 Year: Incident Cause: Pipe Or Hose Leak Incident Event: Contaminant Code: 15 Contaminant Name: HYDRAULIC OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Not Anticipated Nature of Impact: Surface Water Pollution Receiving Medium: Receiving Env: MOE Response: No Field Response Dt MOE Arvl on Scn: MOE Reported Dt: 9/14/2011 Dt Document Closed: 11/22/2011 Incident Reason: Unknown - Reason not determined Site Name: loading dock: Tunney's Pasture<UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: 100 Tunney's Pasture: hyd oil; ~ 30 L; cntnd & clng Contaminant Qty: 30 L		Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Motor Vehicle Agency Involved: Nearest Watercourse: Site Address: 100 Tunney's Pasture Lane Site District Office: Site Postal Code: Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Land Spills Source Type:			
35	2 of 2	ESE/0.0	61.9 / -1.15	100 Tunney's Pasture Driveway Ottawa ON	SPL
Ref No: 0875-AW9LUK Site No: NA Incident Dt: 2018/02/22 Year: Incident Cause: Incident Event: Leak/Break Contaminant Code: 15 Contaminant Name: HYDRAULIC OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: n/a Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: Land MOE Response: No Dt MOE Arvl on Scn: MOE Reported Dt: 2018/02/23 Dt Document Closed: Incident Reason: Equipment Failure Site Name: Statistics Canada, R.H. Coats Building<UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: Environmental Management Ltd: 3 L hydraulic oil to cb, cleaning Contaminant Qty: 3 L		Discharger Report: Material Group: Health/Env Conseq: 2 - Minor Environment Client Type: Sector Type: Miscellaneous Industrial Agency Involved: Nearest Watercourse: Site Address: 100 Tunney's Pasture Driveway Site District Office: Ottawa Site Postal Code: Site Region: Eastern Site Municipality: Ottawa Site Lot: Site Conc: Northing: 5028176.76 Easting: 442533.49 Site Geo Ref Accu: Site Map Datum: SAC Action Class: Land Spills Source Type: Valve/Fitting/Piping			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
36	1 of 3	SE/0.0	61.9 / -1.15	SNC-Lavalin Constructors (Pacific) Inc., Dragados Canada, Inc. and EllisDon Corporation operating as OLRT Constructors 1611 Scott St Ottawa ON K1Z 1G3	ECA
Approval No: 4624-A4ZRG9 Approval Date: 2015-12-16 Status: Revoked and/or Replaced Record Type: ECA Link Source: IDS SWP Area Name: Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS Business Name: SNC-Lavalin Constructors (Pacific) Inc., Dragados Canada, Inc. and EllisDon Corporation operating as OLRT Constructors Address: 1611 Scott St Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/0686-A4FK66-14.pdf PDF Site Location:		MOE District: City: Longitude: Latitude: Geometry X: Geometry Y:			
36	2 of 3	SE/0.0	61.9 / -1.15	SNC Lavalin Constructors (Pacific) Inc.; Dragados-Canada, Inc.; EllisDon Corporation 1611 Scott ST Ottawa ON K1Y 4W2	EASR
Approval No: R-002-9680536386 Status: REMOVED Date: 2016-11-25 Record Type: EASR Link Source: MOFA Project Type: Standby Power System Full Address: Approval Type: EASR-Standby Power System SWP Area Name: Rideau Valley PDF URL: PDF Site Location:		MOE District: Ottawa Municipality: Ottawa Latitude: 45.40361111 Longitude: -75.73555556 Geometry X: Geometry Y:			
36	3 of 3	SE/0.0	61.9 / -1.15	City of Ottawa 1611 Scott St Ottawa ON K2G 6J8	ECA
Approval No: 1007-6PGK6M Approval Date: 2006-05-11 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Approval Type: ECA-AIR Project Type: AIR Business Name: City of Ottawa Address: 1611 Scott St Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/2094-6MUS7R-14.pdf PDF Site Location:		MOE District: City: Longitude: Latitude: Geometry X: Geometry Y:			
37	1 of 1	ESE/0.0	61.9 / -1.15	ON	BORE

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Borehole ID:	613122			Inclin FLG:	No
OGF ID:	215514426			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:				Primary Name:	
Completion Date:				Municipality:	
Static Water Level:	8.9			Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	45.404077
Total Depth m:	-999			Longitude DD:	-75.734473
Depth Ref:	Ground Surface			UTM Zone:	18
Depth Elev:				Easting:	442521
Drill Method:				Northing:	5028102
Orig Ground Elev m:	67.1			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	59				
Concession:					
Location D:					
Survey D:					
Comments:					
 <u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218393796			Mat Consistency:	Compact
Top Depth:	5.5			Material Moisture:	
Bottom Depth:				Material Texture:	Fibrous
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Bedrock			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	BEDROCK. . GRAVEL. COMPACT. GRAVEL. COMPACT. FIBROUS. SAND. GREY,COMPACT. SAND. BR				
	**Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	218393793			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	1.7			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL.				
Geology Stratum ID:	218393794			Mat Consistency:	Compact
Top Depth:	1.7			Material Moisture:	
Bottom Depth:	2.4			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SAND. GREY,COMPACT.				
Geology Stratum ID:	218393795			Mat Consistency:	
Top Depth:	2.4			Material Moisture:	
Bottom Depth:	5.5			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Boulders			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	

192 erisinfo.com | Environmental Risk Information Services Order No: 22062900235

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:				Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: OTTAWA2.txt RecordID: 057000 NTS_Sheet: 31G05G				
Confiden 1:					
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
39	1 of 1	E/0.0	61.9 / -1.15	Parkdale Ave Ottawa ON	EHS
Order No:	20120917022			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	ON
Report Date:	26-SEP-12			Search Radius (km):	.25
Date Received:	17-SEP-12			X:	-75.733626
Previous Site Name:				Y:	45.40517
Lot/Building Size:					
Additional Info Ordered:					
40	1 of 1	NNW/0.0	59.9 / -3.15	ON	BORE
Borehole ID:	613194			Inclin FLG:	No
OGF ID:	215514497			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:				Primary Name:	
Completion Date:	DEC-1963			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	45.408729
Total Depth m:	-999			Longitude DD:	-75.738878
Depth Ref:	Ground Surface			UTM Zone:	18
Depth Elev:				Easting:	442181
Drill Method:				Northing:	5028622
Orig Ground Elev m:	61.8			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	60.8				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218394091			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	2.9			Material Texture:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material Color: Material 1: Sand Material 2: Boulders Material 3: Material 4: Gsc Material Description: Stratum Description: SAND. Geology Stratum ID: 218394092 Top Depth: 2.9 Bottom Depth: Material Color: Blue Material 1: Bedrock Material 2: Limestone Material 3: Material 4: Gsc Material Description: Stratum Description: BEDROCK. FIRM. CLAY. BLUE, FIRM. CLAY. SOFT. CLAY. VERY SOFT. SAND. FIRM. CK, LIMESTON Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: Mat Consistency: Firm Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: **Note: Many records provided by the department have a truncated [Stratum Description] field.					
Source Source Type: Data Survey Source Orig: Geological Survey of Canada Source Date: 1956-1972 Confidence: H Observation: Source Name: Urban Geology Automated Information System (UGAIS) Source Details: File: OTTAWA2.txt RecordID: 057020 NTS_Sheet: 31G05G Confiden 1: Logged by professional. Exact and complete description of material and properties. Source Appl: Spatial/Tabular Source Idem: 1 Scale or Res: Varies Horizontal: NAD27 Verticalda: Mean Average Sea Level					
Source List Source Identifier: 1 Source Type: Data Survey Source Date: 1956-1972 Scale or Resolution: Varies Source Name: Urban Geology Automated Information System (UGAIS) Source Originators: Geological Survey of Canada Horizontal Datum: NAD27 Vertical Datum: Mean Average Sea Level Projection Name: Universal Transverse Mercator					
41	1 of 1	N/0.0	59.9 / -3.15	Environmental Health Science and Research Bureau 50 Colombine Driveway Ottawa ON K1A 0K9	GEN
Generator No: ON3829135 SIC Code: SIC Description: Approval Years: As of Jan 2021 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
Detail(s) Waste Class: 212 L Waste Class Desc: Aliphatic solvents and residues					
42	1 of 1	E/0.0	61.9 / -1.15	ON	BORE
Borehole ID: 613138 Inclin FLG: No					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
OGF ID:	215514442			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:				Primary Name:	
Completion Date:	APR-1968			Municipality:	
Static Water Level:	4.4			Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	45.405164
Total Depth m:	-999			Longitude DD:	-75.733464
Depth Ref:	Ground Surface			UTM Zone:	18
Depth Elev:				Easting:	442601
Drill Method:				Northing:	5028222
Orig Ground Elev m:	62.5			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	61.8				
Concession:					
Location D:					
Survey D:					
Comments:					

Borehole Geology Stratum

Geology Stratum ID:	218393852			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.9			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Soil			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SOIL.				
Geology Stratum ID:	218393853			Mat Consistency:	
Top Depth:	.9			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SAND.				
Geology Stratum ID:	218393854			Mat Consistency:	Dense
Top Depth:	1.2			Material Moisture:	
Bottom Depth:				Material Texture:	
Material Color:	Black			Non Geo Mat Type:	
Material 1:	Bedrock			Geologic Formation:	
Material 2:	Limestone			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	BEDROCK. SE. SILT. DENSE. UNSPECIFIED. DENSE. BEDROCK. . BEDROCK. BLACK. 005 **Note: Many records provided by the department have a truncated [Stratum Description] field.				

Source

Source Type:	Data Survey	Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada	Source Iden:	1
Source Date:	1956-1972	Scale or Res:	Varies
Confidence:	H	Horizontal:	NAD27
Observatio:		Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Details:		File: OTTAWA2.txt RecordID: 056460 NTS_Sheet: 31G05G			
Confiden 1:		Logged by professional. Exact and complete description of material and properties.			
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
43	1 of 4	W/0.0	61.9 / -1.15	Statistics Canada HSD 251 Sir Frederick Banting Driveway Ottawa ON K1Y 0M1	GEN
Generator No:	ON4676523			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Jun 2018			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	
Detail(s)					
Waste Class:	312 P				
Waste Class Desc:	Pathological wastes				
43	2 of 4	W/0.0	61.9 / -1.15	Health Canada 251, Sir Frederick Banting Driveway Ottawa ON	FRST
Tank System ID:	39696			Tank Sys Prov F:	Ontario
EC No:	00039061			Tank Sys PO BOX:	
Internal No:				Tank Sys Postal Cd:	
Is Perm Withdrwl:	False			Sys Record City:	
Removed Date:				Sys Record Prov E:	
Withdrawn Date:				Sys Record Prov F:	
Temp Withdrawn Dt:				Sys Record PO BOX:	
Tank Use E:	Power Generation			Sys Rec Postal Cd:	
Tank Use F:	Production d'énergie			System Rec Same as:	True
Year of Manufact:	42005			Location Latitude:	
Emerg Plan Same as:	True			Location Longitude:	
Operator Contact:	George C. Zigoumis			Creation Date:	42384
Owner Contact:	Muhammad Nuraddeen			Creation By:	Nathalie Plante
Tank System City:	Ottawa			Modified Date:	42447
Tank Sys Prov E:	Ontario			Modified By:	Nathalie Plante
Tank Use:					
Tank Manufacturer:	Vibra-Sil, 2020 de la metropole, Longueuil, QC J4G 1T3				
Tank System Address:	251, Sir Frederick Banting Driveway				
Sys Record Address:					
System Descr:	ON-NCR-Sir Frederick Banting - Genset emergency generator with integrated 8000 L belly tank (S716087) for diesel fuel storage located behind the Sir Frederick Banting building near the loading dock.				
Certification System Installer:	Leo Snair PM3 #000229071 (Gal Power)				
Certification System Remover:					
Group Name:	Health Canada				
Master Group Name:	Health Canada				
Owner Email:	muhammad.nuraddeen@hc-sc.gc.ca				
Operator Email:	george.c.zigoumis@hc-sc.gc.ca				
Land Owner E:	Federal entity under Financial Administration Act				
Land Owner F:	Entité fédérale sous la loi sur la gestion des finances publiques				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Service Months</u>					
Service Months E:		April			
Service Months F:		Avril			
Service Months E:		February			
Service Months F:		Février			
Service Months E:		October			
Service Months F:		Octobre			
Service Months E:		August			
Service Months F:		Août			
Service Months E:		January			
Service Months F:		Janvier			
Service Months E:		June			
Service Months F:		Juin			
Service Months E:		September			
Service Months F:		Septembre			
Service Months E:		July			
Service Months F:		Juillet			
Service Months E:		May			
Service Months F:		Mai			
Service Months E:		March			
Service Months F:		Mars			
Service Months E:		December			
Service Months F:		Décembre			
Service Months E:		November			
Service Months F:		Novembre			
<u>Tanks Details</u>					
Tank ID:	66768			Dt Withdrwn Piping:	
Tank Capacity:	8000			Date Remvd Piping:	
Tank Type E:	Aboveground			Tk Type of Pump E:	No oil-water separator
Tank Type F:	Hors sol			Tk Type of Pump F:	Aucun Séparateur huile-eau
Date of Install:	2015			Piping Type E:	Aboveground
Date Withdrawn Tk:				Piping Type F:	Hors sol
Date Removed Tank:				Piping Diam Unit:	mm
Tank Desc:	Double walled belly tank with capacity of 8000 L for diesel fuel storage.				
Tank Std No E:	ULC-S601				
Tank Std No F:	ULC-S601				
Tank Std No Other:					
Tank Constr Material E:	Steel				
Tank Constr Material F:	Acier				
Tank Constr Material Other:					
Internal No:	Secondary Containment Generator Base Tank S716087				
Tank Content E:	Diesel				
Tank Content F:	Diesel				
Tank Content Other:					
Piping Diameter:	25;50				
Spill Containment E:	Aboveground tank ULC-S663 (superses ORD-C142.19)				
Spill Containment F:	Réservoir hors sol ULC S663 (remplace ORD-C142.19)				
Spill Containment Other:					
Product Transfer Area:	PWGSC environmental services email dated 2016-Feb-05 mentions: "with respect to the location of the two (2) gensets, the product transfer area would consist of the loading dock and a landscaped area" Graded and Paved".				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Date Withdrwn Other Component: Date Removed Other Component:					
<u>Piping Construction Materials</u>					
Component E:		Black Iron			
Component F:		Fer noir			
<u>Piping Secondary Containment</u>					
Tank ID:		66768			
Component E:		None			
Component F:		Aucun			
<u>Tank Corrosion Protection</u>					
Component E:		Painted			
Component F:		Peinturé			
<u>Piping Corrosion Protection</u>					
Component E:		Painted			
Component F:		Peinturé			
<u>Tank Leak Detection</u>					
Component E:		Continuous leak detection			
Component F:		Essai d'étanchéité interne en continu			
<u>Tank Leak Detection</u>					
Component E:		Interstitial monitoring - double walled tank			
Component F:		Surveillance interstitielle- réservoir à double paroi			
<u>Piping Leak Detection</u>					
Component E:		Visual inspection			
Component F:		Inspection visuelle			
<u>Sump Leak Detection</u>					
Component E:		No sump for storage tank system			
Component F:		Aucun puisard pour le système de stockage			
<u>Tank Secondary Containment</u>					
Component E:		Double Walled			
Component F:		Double paroi			
43	3 of 4	W/0.0	61.9 / -1.15	Health Canada 251, Sir Frederick Banting Driveway Ottawa ON	FRST
Tank System ID:		39697		Tank Sys Prov F: Ontario	
EC No:		00038860		Tank Sys PO BOX:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Internal No:				Tank Sys Postal Cd:	
Is Perm Withdrwl:	False			Sys Record City:	
Removed Date:				Sys Record Prov E:	
Withdrawn Date:				Sys Record Prov F:	
Temp Withdrawn Dt:				Sys Record PO BOX:	
Tank Use E:	Power Generation			Sys Rec Postal Cd:	
Tank Use F:	Production d'énergie			System Rec Same as:	True
Year of Manufact:	42005			Location Latitude:	
Emerg Plan Same as:	True			Location Longitude:	
Operator Contact:	George C. Zigoumis			Creation Date:	42354
Owner Contact:	Muhammad Nuraddeen			Creation By:	Nathalie Plante
Tank System City:	Ottawa			Modified Date:	42447
Tank Sys Prov E:	Ontario			Modified By:	Nathalie Plante
Tank Use:					
Tank Manufacturer:	Vibra-Sil, 2020 de la metropole, Longueuil, QC J4G 1T3				
Tank System Address:	251, Sir Frederick Banting Driveway				
Sys Record Address:					
System Descr:	ON-NCR-Sir Frederick Banting - Genset emergency generator with integrated 8000 L belly tank (S716086) for diesel fuel storage located behind the Sir Frederic Banting building near the loading dock area.				
Certification System Installer:	Leo Snair PM3 #000229071 (Gal Power)				
Certification System Remover:	n/a				
Group Name:	Health Canada				
Master Group Name:	Health Canada				
Owner Email:	muhammad.nuraddeen@hc-sc.gc.ca				
Operator Email:	george.c.zigoumis@hc-sc.gc.ca				
Land Owner E:	Federal entity under Financial Administration Act				
Land Owner F:	Entité fédérale sous la loi sur la gestion des finances publiques				
 <u>Service Months</u>					
Service Months E:	June				
Service Months F:	Juin				
Service Months E:	December				
Service Months F:	Décembre				
Service Months E:	February				
Service Months F:	Février				
Service Months E:	May				
Service Months F:	Mai				
Service Months E:	November				
Service Months F:	Novembre				
Service Months E:	October				
Service Months F:	Octobre				
Service Months E:	March				
Service Months F:	Mars				
Service Months E:	January				
Service Months F:	Janvier				
Service Months E:	August				
Service Months F:	Août				
Service Months E:	July				
Service Months F:	Juillet				
Service Months E:	September				
Service Months F:	Septembre				
Service Months E:	April				
Service Months F:	Avril				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Tanks Details</u>					
Tank ID:	66769			<i>Dt Withdrwn Piping:</i>	
Tank Capacity:	8000			<i>Date Remvd Piping:</i>	
Tank Type E:	Aboveground			<i>Tk Type of Pump E:</i>	No oil-water separator
Tank Type F:	Hors sol			<i>Tk Type of Pump F:</i>	Aucun Séparateur huile-eau
Date of Install:	2015			<i>Piping Type E:</i>	Aboveground
Date Withdrawn Tk:				<i>Piping Type F:</i>	Hors sol
Date Removed Tank:				<i>Piping Diam Unit:</i>	mm
Tank Desc:	Double walled belly tank with capacity of 8000 L for diesel fuel storage.				
Tank Stdd No E:	ULC-S601				
Tank Std No F:	ULC-S601				
Tank Std No Other:					
Tank Constr Material E:	Steel				
Tank Constr Material F:	Acier				
Tank Constr Material Other:					
Internal No:	Secondary Containment Generator Base Tank S716086				
Tank Content E:	Diesel				
Tank Content F:	Diesel				
Tank Content Other:					
Piping Diameter:	25;50				
Spill Containment E:	Aboveground tank ULC-S663 (supersedes ORD-C142.19)				
Spill Containment F:	Réservoir hors sol ULC S663 (remplace ORD-C142.19)				
Spill Containment Other:					
Product Transfer Area:	PWGSC environmental services email dated 2016-Feb-05 mentions: "with respect to the location of the two (2) gensets, the product transfer area would consist of the loading dock and a landscaped area: Graded and Paved".				
Date Withdrwn Other Component:					
Date Removed Other Component:					
<u>Piping Construction Materials</u>					
Component E:	Black Iron				
Component F:	Fer noir				
<u>Piping Secondary Containment</u>					
Tank ID:	66769				
Component E:	None				
Component F:	Aucun				
<u>Tank Corrosion Protection</u>					
Component E:	Painted				
Component F:	Peinturé				
<u>Piping Corrosion Protection</u>					
Component E:	Painted				
Component F:	Peinturé				
<u>Tank Leak Detection</u>					
Component E:	Interstitial monitoring - double walled tank				
Component F:	Surveillance interstitielle- réservoir à double paroi				
<u>Tank Leak Detection</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Component E: Component F:		Continuous leak detection Essai d'étanchéité interne en continu			
<u>Piping Leak Detection</u>					
Component E: Component F:		Visual inspection Inspection visuelle			
<u>Sump Leak Detection</u>					
Component E: Component F:		No sump for storage tank system Aucun puisard pour le système de stockage			
<u>Tank Secondary Containment</u>					
Component E: Component F:		Double Walled Double paroi			
43	4 of 4	W/0.0	61.9 / -1.15	Statistics Canada CPHD 251 Sir Frederick Banting Ottawa ON K1Y0M1	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:		ON8115344 As of Nov 2021 Canada		Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:		312 P Pathological wastes			
44	1 of 1	W/0.0	61.9 / -1.15	CAMECO-CANADIAN MINING & ENERGY CORP BUILDING #21, TUNNEY'S PASTURE CORNER OF ROSS & DE LA COLOMBINE OTTAWA ON	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:		ON0008201 2959 OTHER SMELTING, ETC. 98		Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:		241 HALOGENATED SOLVENTS			
Waste Class: Waste Class Desc:		148 INORGANIC LABORATORY CHEMICALS			
Waste Class: Waste Class Desc:		211 AROMATIC SOLVENTS			
Waste Class: Waste Class Desc:		212 ALIPHATIC SOLVENTS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
45	1 of 1	ENE/0.0	60.9 / -2.15	ON	BORE
Borehole ID:	613172			Inclin FLG:	No
OGF ID:	215514475			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:				Primary Name:	
Completion Date:	JUN-1966			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	45.40786
Total Depth m:	4.8			Longitude DD:	-75.734138
Depth Ref:	Ground Surface			UTM Zone:	18
Depth Elev:				Easting:	442551
Drill Method:				Northing:	5028522
Orig Ground Elev m:	60.8			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	61.1				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218394002			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.8			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:				Geologic Formation:	
Material 2:	Fill			Geologic Group:	
Material 3:	Gravel			Geologic Period:	
Material 4:	Sand			Depositional Gen:	
Gsc Material Description:					
Stratum Description:	ARTIFICIAL.				
Geology Stratum ID:	218394005			Mat Consistency:	Dense
Top Depth:	3.3			Material Moisture:	
Bottom Depth:	4.8			Material Texture:	Fine
Material Color:				Non Geo Mat Type:	
Material 1:	Bedrock			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	BEDROCK. 00025 008 00060 020 00025042000600860060003NE. DENSE. SAND-FINE. VERY **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	218394004			Mat Consistency:	
Top Depth:	1.8			Material Moisture:	
Bottom Depth:	3.3			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Bedrock			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	BEDROCK.				
Geology Stratum ID:	218394003			Mat Consistency:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description: .8 1.8 Brown Fill Clay Bedrock ARTIFICIAL. BROWN,GREY. Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Source Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1: Data Survey Geological Survey of Canada 1956-1972 H Urban Geology Automated Information System (UGAIS) File: OTTAWA2.txt RecordID: 056800 NTS_Sheet: 31G05G Logged by professional. Exact and complete description of material and properties. Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda: Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level					
Source List Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators: 1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada Horizontal Datum: Vertical Datum: Projection Name: NAD27 Mean Average Sea Level Universal Transverse Mercator					
46	1 of 1	NNE/0.0	60.6 / -2.46	ON	BORE
Borehole ID: OGF ID: Status: Type: Use: Completion Date: Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: Depth Ref: Depth Elev: Drill Method: Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D: Survey D: Comments: 613202 215514505 Borehole NOV-1962 3.0 -999 Ground Surface 60.7 59.9 Inclin FLG: SP Status: Surv Elev: Piezometer: Primary Name: Municipality: Lot: Township: Latitude DD: Longitude DD: UTM Zone: Easting: Northing: Location Accuracy: Accuracy: No Initial Entry No No 45.409017 -75.73607 18 442401 5028652 Not Applicable					
Borehole Geology Stratum Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: 218394119 0 3.5 Sand Gravel Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Firm					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3: Material 4: Gsc Material Description: Stratum Description:	Boulders			Geologic Period: Depositional Gen:	
Geology Stratum ID: Top Depth: Bottom Depth: Material Color:	218394120 3.5	SAND. FIRM.		Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type:	Compact
Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	Grey Bedrock Limestone Shale			Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
		BEDROCK. WATER STABLE AT 189.0 FEET.GREY,STIFF. 00000005 SAND. LOOSE TO COMPACT. UNSPECI			
		**Note: Many records provided by the department have a truncated [Stratum Description] field.			

Source

Source Type:	Data Survey	Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada	Source Iden:	1
Source Date:	1956-1972	Scale or Res:	Varies
Confidence:		Horizontal:	NAD27
Observatio:		Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)		
Source Details:	File: OTTAWA2.txt RecordID: 057100 NTS_Sheet: 31G05G		
Confiden 1:			

Source List

Source Identifier:	1	Horizontal Datum:	NAD27
Source Type:	Data Survey	Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972	Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies		
Source Name:	Urban Geology Automated Information System (UGAIS)		
Source Originators:	Geological Survey of Canada		

47	1 of 3	NNE/0.0	60.6 / -2.39	70 Colombine Driveway Ottawa ON	SPL
Ref No:	8571-A4ER4Y	Discharger Report:			
Site No:	NA	Material Group:			
Incident Dt:	11/19/2015	Health/Env Conseq:			
Year:		Client Type:			
Incident Cause:		Sector Type:	Miscellaneous Industrial		
Incident Event:		Agency Involved:			
Contaminant Code:	24	Nearest Watercourse:			
Contaminant Name:	GLYCOL/WATER SOLUTION	Site Address:	70 Colombine Driveway		
Contaminant Limit 1:		Site District Office:			
Contam Limit Freq 1:		Site Postal Code:			
Contaminant UN No 1:		Site Region:			
Environment Impact:		Site Municipality:	Ottawa		
Nature of Impact:		Site Lot:			
Receiving Medium:		Site Conc:			
Receiving Env:		Northing:	5028625		
MOE Response:	No	Easting:	442300		
Dt MOE Arvl on Scn:		Site Geo Ref Accu:			
MOE Reported Dt:	11/19/2015	Site Map Datum:			
Dt Document Closed:	11/23/2015	SAC Action Class:	Watercourse Spills		
Incident Reason:	Equipment Failure	Source Type:			
Site Name:	70 Colombine Driveway<UNOFFICIAL>				
Site County/District:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Geo Ref Meth: Incident Summary: Brookfield GIS: 3L of glycol/water solution to drain Contaminant Qty: 3 L					
47	2 of 3	NNE/0.0	60.6 / -2.39	70 Colombine Driveway Ottawa ON K1A 0K9	SPL
Ref No: 5723-A8ZP4K Site No: NA Incident Dt: 2016/04/14 Year: Incident Cause: Incident Event: Leak/Break Contaminant Code: 15 Contaminant Name: HYDRAULIC OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: Land MOE Response: No Dt MOE Arvl on Scn: MOE Reported Dt: 2016/04/14 Dt Document Closed: Incident Reason: Equipment Failure Site Name: Office Building - Loading Dock <UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: Brookfield: 1 L hydraulic fluid to concrete, cntd & clng Contaminant Qty: 1 L					
Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Miscellaneous Industrial Agency Involved: Nearest Watercourse: Site Address: 70 Colombine Driveway Site District Office: Site Postal Code: K1A 0K9 Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Land Spills Source Type:					
47	3 of 3	NNE/0.0	60.6 / -2.39	BROOKFIELD GLOBAL INTEGRATED SOLUTIONS 70 COLOMBINE DRIVEWAY TUNNEY'S PASTURE OTTAWA ON K1A 0K9	GEN
Generator No: ON2863521 SIC Code: 531310 SIC Description: REAL ESTATE PROPERTY MANAGERS Approval Years: 2016 PO Box No: Country: Canada					
Status: Co Admin: Choice of Contact: CO_OFFICIAL Phone No Admin: Contam. Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 212 Waste Class Desc: ALIPHATIC SOLVENTS					
48	1 of 28	ENE/0.0	60.9 / -2.15	BROOKFIELD LEPAGE JOHNSON CONT PROPERTY MANAGEMENT CO. 120 PARKDALE AVE, SUITE 1401, OTTAWA OTTAWA CITY ON K1A 0K9	SPL
Ref No: 194974 Site No: Incident Dt: 2/13/2001 Year:					
Discharger Report: Material Group: Health/Env Conseq: Client Type:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Incident Cause: Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Incident Reason: Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: Contaminant Qty: OTHER TRANSPORTATION ACCIDENT Possible Water course or lake Land, Water 2/14/2001 ERROR BLJ CONTROLS GLYCOL SPILL TO GROUND CATCH BASIN Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type: 20107					
48	2 of 28	ENE/0.0	60.9 / -2.15	STATISTICS CANADA BUILDING 120 PARKDALE AVE 120 PARDALE AVENUE, OTTAWA OTTAWA CITY ON K1A 0K9	SPL
Ref No: Site No: Incident Dt: Year: Incident Cause: Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Incident Reason: Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: Contaminant Qty: 200676 5/15/2001 OTHER CAUSE (N.O.S.) Possible Air Pollution Air 5/15/2001 EQUIPMENT FAILURE STATS CANADA BUILDING: 470 LBS. HALON 1301 TO AIR. FAULTY HEAT DETECTOR Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type: 20107					
48	3 of 28	ENE/0.0	60.9 / -2.15	GVT. OF CAN.-PUBLIC WORKS OF CAN. REALTY BRANCH TUNNEY'S PASTURE ASS. BLDG C/O TUNNEY'S PASTURE DBS BLDG RM 1005 OTTAWA-CARLETON ON K1A 0M3	GEN
Generator No: ON0144745 Status:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Code: 8689 SIC Description: OTHER HEALTH LAB. Approval Years: 89,90 PO Box No: Country:				Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	
<u>Detail(s)</u>					
Waste Class: 113 Waste Class Desc: ACID WASTE - OTHER METALS					
Waste Class: 122 Waste Class Desc: ALKALINE WASTES - OTHER METALS					
48	4 of 28	ENE/0.0	60.9 / -2.15	PUBLIC WORKS & GOVERNMENT SERVS. CANADA ASSORTED BUILDINGS TUNNEY'S PASTURE (FEDERAL COMPLEX) OTTAWA ON K1A 0M3	GEN
Generator No: ON0144745 SIC Code: 8159 SIC Description: OTHER GEN. ADMIN. Approval Years: 92,93,97 PO Box No: Country:				Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	
<u>Detail(s)</u>					
Waste Class: 252 Waste Class Desc: WASTE OILS & LUBRICANTS					
Waste Class: 263 Waste Class Desc: ORGANIC LABORATORY CHEMICALS					
Waste Class: 331 Waste Class Desc: WASTE COMPRESSED GASES					
Waste Class: 113 Waste Class Desc: ACID WASTE - OTHER METALS					
Waste Class: 122 Waste Class Desc: ALKALINE WASTES - OTHER METALS					
Waste Class: 145 Waste Class Desc: PAINT/PIGMENT/COATING RESIDUES					
Waste Class: 146 Waste Class Desc: OTHER SPECIFIED INORGANICS					
Waste Class: 148 Waste Class Desc: INORGANIC LABORATORY CHEMICALS					
Waste Class: 212 Waste Class Desc: ALIPHATIC SOLVENTS					
Waste Class: 251 Waste Class Desc: OIL SKIMMINGS & SLUDGES					
Waste Class: 213 Waste Class Desc: PETROLEUM DISTILLATES					
Waste Class: 221					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Desc:		LIGHT FUELS			
Waste Class:		243			
Waste Class Desc:		PCB'S			
48	5 of 28	ENE/0.0	60.9 / -2.15	GVT. OF CAN.-PUBLIC WORKS OF CAN. 18-337 REALTY BRANCH TUNNEY'S PASTURE ASS. BLDG OTTAWA,C/O 1000-38 ANTARES DRIVE NEPEAN ON K1A 0M3	GEN
Generator No:		ON0144745		Status:	
SIC Code:		8159		Co Admin:	
SIC Description:		OTHER GEN. ADMIN.		Choice of Contact:	
Approval Years:		94,95		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		122			
Waste Class Desc:		ALKALINE WASTES - OTHER METALS			
Waste Class:		113			
Waste Class Desc:		ACID WASTE - OTHER METALS			
Waste Class:		145			
Waste Class Desc:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
Waste Class:		243			
Waste Class Desc:		PCB'S			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
48	6 of 28	ENE/0.0	60.9 / -2.15	PUBLIC WORKS & GOVERNMENT SERVICES CAN. ASSORTED BUILDING TUNNEY'S PASTURE (FEDERAL COMPLEX) OTTAWA ON K1A 0M3	GEN
Generator No:		ON0144745		Status:	
SIC Code:		8159		Co Admin:	
SIC Description:		OTHER GEN. ADMIN.		Choice of Contact:	
Approval Years:		96		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		113			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Desc:		ACID WASTE - OTHER METALS			
Waste Class:		122			
Waste Class Desc:		ALKALINE WASTES - OTHER METALS			
Waste Class:		145			
Waste Class Desc:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		146			
Waste Class Desc:		OTHER SPECIFIED INORGANICS			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
Waste Class:		243			
Waste Class Desc:		PCB'S			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			

[48](#)

7 of 28

ENE/0.0

60.9 / -2.15

PUBLIC WORKS CANADA
TUNNEY'S PASTURE - FEDERAL COMPLEX
ASSORTED BUILDINGS
OTTAWA ON

GEN

Generator No: ON0144745
SIC Code: 8159
SIC Description: OTHER GEN. ADMIN.
Approval Years: 98,99,00,01,02,03,04
PO Box No:
Country:

Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Detail(s)

Waste Class: 113
Waste Class Desc: ACID WASTE - OTHER METALS

Waste Class: 121
Waste Class Desc: ALKALINE WASTES - HEAVY METALS

Waste Class: 122
Waste Class Desc: ALKALINE WASTES - OTHER METALS

Waste Class: 145
Waste Class Desc: PAINT/PIGMENT/COATING RESIDUES

Waste Class: 146
Waste Class Desc: OTHER SPECIFIED INORGANICS

Waste Class: 148
Waste Class Desc: INORGANIC LABORATORY CHEMICALS

Waste Class: 212
Waste Class Desc: ALIPHATIC SOLVENTS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
Waste Class:		243			
Waste Class Desc:		PCB'S			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		331			
Waste Class Desc:		WASTE COMPRESSED GASES			
48	8 of 28	ENE/0.0	60.9 / -2.15	BROOKFIELD LEPAGE JOHNSON CONTROLS TUNNEY'S PASTURE FEDERAL COMPLEX ASSORTED BUILDINGS OTTAWA ON	GEN
Generator No:	ON0554820			Status:	
SIC Code:	7512			Co Admin:	
SIC Description:	NON-RES. BLDG. OPER.			Choice of Contact:	
Approval Years:	98,99,00,01,02,03,04			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		145			
Waste Class Desc:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		146			
Waste Class Desc:		OTHER SPECIFIED INORGANICS			
Waste Class:		148			
Waste Class Desc:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		331			
Waste Class Desc:		WASTE COMPRESSED GASES			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		121			
Waste Class Desc:		ALKALINE WASTES - HEAVY METALS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
48	9 of 28	ENE/0.0	60.9 / -2.15	Statistics Canada 120 Parkdale Ave Ottawa ON K1A 0K9	SCT
Established: Plant Size (ft²): Employment:					
--Details--					
Description:		Book Publishers			
SIC/NAICS Code:		511130			
Description:		Veterinary Services			
SIC/NAICS Code:		541940			
48	10 of 28	ENE/0.0	60.9 / -2.15	Public Works and Government Services Canada 120 Parkdale, Tunneys Pasture, Various Buildings Ottawa ON K1A 1B4	GEN
Generator No:		ON4690864		Status:	
SIC Code:		911910		Co Admin:	
SIC Description:		Other Federal Government Public Administration		Choice of Contact:	
Approval Years:		05,06,07,08		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
Detail(s)					
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		113			
Waste Class Desc:		ACID WASTE - OTHER METALS			
Waste Class:		114			
Waste Class Desc:		OTHER INORGANIC ACID WASTES			
Waste Class:		243			
Waste Class Desc:		PCB'S			
Waste Class:		331			
Waste Class Desc:		WASTE COMPRESSED GASES			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		264			
Waste Class Desc:		PHOTOPROCESSING WASTES			
Waste Class:		112			
Waste Class Desc:		ACID WASTE - HEAVY METALS			
Waste Class:		121			
Waste Class Desc:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		122			
Waste Class Desc:		ALKALINE WASTES - OTHER METALS			
Waste Class:		145			
Waste Class Desc:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		146			
Waste Class Desc:		OTHER SPECIFIED INORGANICS			
Waste Class:		148			
Waste Class Desc:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
48	11 of 28	ENE/0.0	60.9 / -2.15	Public Works and Government Services 120 Parkdale Ottawa ON K1A 1B4	GEN
Generator No:	ON9360293			Status:	
SIC Code:	911910			Co Admin:	
SIC Description:	Other Federal Government Public Administration			Choice of Contact:	
Approval Years:	05,06			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		112			
Waste Class Desc:		ACID WASTE - HEAVY METALS			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		331			
Waste Class Desc:		WASTE COMPRESSED GASES			
Waste Class:		122			
Waste Class Desc:		ALKALINE WASTES - OTHER METALS			
Waste Class:		146			
Waste Class Desc:		OTHER SPECIFIED INORGANICS			
Waste Class:		121			
Waste Class Desc:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		145			
Waste Class Desc:		PAINT/PIGMENT/COATING RESIDUES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: 148 Waste Class Desc: INORGANIC LABORATORY CHEMICALS Waste Class: 252 Waste Class Desc: WASTE OILS & LUBRICANTS					
48	12 of 28	ENE/0.0	60.9 / -2.15	120 Parkdale Avenue Ottawa ON K1A 1K6	SPL
Ref No: 2126-5MCP8H Site No: Incident Dt: 5/8/2003 Year: Incident Cause: Incident Event: Contaminant Code: 13 Contaminant Name: GAS OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Possible Nature of Impact: Receiving Medium: Land Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 5/8/2003 Dt Document Closed: Incident Reason: Site Name: NATIONAL DEFENCE CENTRE - PKG LOT, NORTH OF BLDG #16<UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: Unkwn amt oil/gas to fed. pkg lot. Contaminant Qty: Discharger Report: Material Group: Oil Health/Env Conseq: Client Type: Sector Type: Unknown Agency Involved: Nearest Watercourse: Site Address: Site District Office: Ottawa Site Postal Code: Site Region: Eastern Site Municipality: Ottawa Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Spills Source Type:					
48	13 of 28	ENE/0.0	60.9 / -2.15	Public Works and Government Services Canada 120 Parkdale, Tunneys Pasture, Various Buildings Ottawa ON K1A 1K6	GEN
Generator No: ON4690864 SIC Code: 911910 SIC Description: Other Federal Government Public Administration Approval Years: 2009 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 112 Waste Class Desc: ACID WASTE - HEAVY METALS Waste Class: 113 Waste Class Desc: ACID WASTE - OTHER METALS Waste Class: 114 Waste Class Desc: OTHER INORGANIC ACID WASTES Waste Class: 121					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Desc:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		122			
Waste Class Desc:		ALKALINE WASTES - OTHER METALS			
Waste Class:		145			
Waste Class Desc:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		146			
Waste Class Desc:		OTHER SPECIFIED INORGANICS			
Waste Class:		148			
Waste Class Desc:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
Waste Class:		243			
Waste Class Desc:		PCBS			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		264			
Waste Class Desc:		PHOTOPROCESSING WASTES			
Waste Class:		331			
Waste Class Desc:		WASTE COMPRESSED GASES			

[48](#)

14 of 28

ENE/0.0

60.9 / -2.15

Public Works and Government Services
120 Parkdale
Ottawa ON K1A 1B4

GEN

Generator No: ON9360293
SIC Code: 911910
SIC Description: Other Federal Government Public Administration
Approval Years: 2010
PO Box No:
Country:

Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Detail(s)

Waste Class: 331
Waste Class Desc: WASTE COMPRESSED GASES

Waste Class: 148
Waste Class Desc: INORGANIC LABORATORY CHEMICALS

Waste Class: 263
Waste Class Desc: ORGANIC LABORATORY CHEMICALS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Desc:		145 PAINT/PIGMENT/COATING RESIDUES			
Waste Class: Waste Class Desc:		252 WASTE OILS & LUBRICANTS			
Waste Class: Waste Class Desc:		121 ALKALINE WASTES - HEAVY METALS			
Waste Class: Waste Class Desc:		112 ACID WASTE - HEAVY METALS			
Waste Class: Waste Class Desc:		146 OTHER SPECIFIED INORGANICS			
Waste Class: Waste Class Desc:		212 ALIPHATIC SOLVENTS			
Waste Class: Waste Class Desc:		122 ALKALINE WASTES - OTHER METALS			

[48](#) 15 of 28 **ENE/0.0** **60.9 / -2.15** **Public Works and Government Services Canada
120 Parkdale, Tunneys Pasture, Various
Buildings
Ottawa ON K1A 1K6** **GEN**

Generator No:	ON4690864	Status:	
SIC Code:	911910	Co Admin:	
SIC Description:	Other Federal Government Public Administration	Choice of Contact:	
Approval Years:	2010	Phone No Admin:	
PO Box No:		Contam. Facility:	
Country:		MHSW Facility:	

Detail(s)

Waste Class: Waste Class Desc:	114 OTHER INORGANIC ACID WASTES
Waste Class: Waste Class Desc:	121 ALKALINE WASTES - HEAVY METALS
Waste Class: Waste Class Desc:	251 OIL SKIMMINGS & SLUDGES
Waste Class: Waste Class Desc:	148 INORGANIC LABORATORY CHEMICALS
Waste Class: Waste Class Desc:	213 PETROLEUM DISTILLATES
Waste Class: Waste Class Desc:	331 WASTE COMPRESSED GASES
Waste Class: Waste Class Desc:	112 ACID WASTE - HEAVY METALS
Waste Class: Waste Class Desc:	212 ALIPHATIC SOLVENTS
Waste Class: Waste Class Desc:	146 OTHER SPECIFIED INORGANICS
Waste Class:	113

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Desc:		ACID WASTE - OTHER METALS			
Waste Class:		264			
Waste Class Desc:		PHOTOPROCESSING WASTES			
Waste Class:		145			
Waste Class Desc:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
Waste Class:		122			
Waste Class Desc:		ALKALINE WASTES - OTHER METALS			
Waste Class:		243			
Waste Class Desc:		PCBS			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
48	16 of 28	ENE/0.0	60.9 / -2.15	Public Works and Government Services Canada 120 Parkdale, Tunneys Pasture, Various Buildings Ottawa ON K1A 1K6	GEN
Generator No:		ON4690864		Status:	
SIC Code:		911910		Co Admin:	
SIC Description:		Other Federal Government Public Administration		Choice of Contact:	
Approval Years:		2011		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		112			
Waste Class Desc:		ACID WASTE - HEAVY METALS			
Waste Class:		113			
Waste Class Desc:		ACID WASTE - OTHER METALS			
Waste Class:		146			
Waste Class Desc:		OTHER SPECIFIED INORGANICS			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
Waste Class:		121			
Waste Class Desc:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		331			
Waste Class Desc:		WASTE COMPRESSED GASES			
Waste Class:		264			
Waste Class Desc:		PHOTOPROCESSING WASTES			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		243			
Waste Class Desc:		PCBS			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		148			
Waste Class Desc:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		122			
Waste Class Desc:		ALKALINE WASTES - OTHER METALS			
Waste Class:		114			
Waste Class Desc:		OTHER INORGANIC ACID WASTES			
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
Waste Class:		145			
Waste Class Desc:		PAINT/PIGMENT/COATING RESIDUES			

48	17 of 28	ENE/0.0	60.9 / -2.15	SNC LAVALIN O & M 120 PARKDALE AVENUE VARIOUS BUILDINGS OTTAWA ON	GEN
Generator No:	ON8217071			Status:	
SIC Code:	911910			Co Admin:	
SIC Description:	Other Federal Government Public Administration			Choice of Contact:	
Approval Years:	2012			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	

48	18 of 28	ENE/0.0	60.9 / -2.15	Public Works and Government Services Canada 120 Parkdale, Tunneys Pasture, Various Buildings Ottawa ON K1A 1K6	GEN
Generator No:	ON4690864			Status:	
SIC Code:	911910			Co Admin:	
SIC Description:	Other Federal Government Public Administration			Choice of Contact:	
Approval Years:	2012			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	

Detail(s)

Waste Class:	212
Waste Class Desc:	ALIPHATIC SOLVENTS
Waste Class:	113
Waste Class Desc:	ACID WASTE - OTHER METALS
Waste Class:	252
Waste Class Desc:	WASTE OILS & LUBRICANTS
Waste Class:	263
Waste Class Desc:	ORGANIC LABORATORY CHEMICALS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		112			
Waste Class Desc:		ACID WASTE - HEAVY METALS			
Waste Class:		243			
Waste Class Desc:		PCBS			
Waste Class:		146			
Waste Class Desc:		OTHER SPECIFIED INORGANICS			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
Waste Class:		264			
Waste Class Desc:		PHOTOPROCESSING WASTES			
Waste Class:		121			
Waste Class Desc:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		145			
Waste Class Desc:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		148			
Waste Class Desc:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		114			
Waste Class Desc:		OTHER INORGANIC ACID WASTES			
Waste Class:		331			
Waste Class Desc:		WASTE COMPRESSED GASES			
Waste Class:		122			
Waste Class Desc:		ALKALINE WASTES - OTHER METALS			

48	19 of 28	ENE/0.0	60.9 / -2.15	SNC-LAVALIN PROFAC 120 Parkdale Avenue Ottawa ON K1A6T6	NPRI
NPRI ID:	8800001457			Org ID:	
Other ID:				Submit Date:	
No Other ID:				Last Modified:	
Track ID:				Contact ID:	
Report ID:				Cont Type:	MED
Report Type:				Contact Title:	
Rpt Type ID:				Cont First Name:	
Report Year:	2004			Cont Last Name:	
Not-Current Rpt?:				Contact Position:	
Yr of Last Filed Rpt:				Contact Fax:	
Fac ID:				Contact Ph.:	
Fac Name:	MAIN STATISTICS, JEAN TALON, R.H. COATS			Cont Area Code:	
Fac Address1:				Contact Tel.:	
Fac Address2:				Contact Ext.:	
Fac Postal Zip:				Cont Fax Area Cde:	
Facility Lat:				Contact Fax:	
Facility Long:				Contact Email:	
DLS (Last Filed Rpt):				Latitude:	
Facility DLS:				Longitude:	
Datum:				UTM Zone:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Facility Cmnts: URL: No of Empl.: 4000 Parent Co.: No Parent Co.: Pollut Prev Cmnts: Stacks: No of Stacks: Canadian SIC Code (2 digit): Canadian SIC Code: SIC Code Description: American SIC Code: NAICS Code (2 digit): 53 NAICS 2 Description: Real Estate and Rental and Leasing NAICS Code (4 digit): 5311 NAICS 4 Description: Lessors of Real Estate NAICS Code (6 digit): 531120 NAICS 6 Description: Lessors of Non-Residential Buildings (except Mini-Warehouses)				UTM Northing: UTM Easting: Waste Streams: No Streams: Waste Off Sites: No Off Sites: Shutdown: No of Shutdown:	
<u>Substance Release Report</u>					
CAS No:		11104-93-1			
Report ID:					
Rpt Period:		2004			
Subst Released:		Nitrogen oxides (expressed as NO2)			
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
CAS No:		7446-09-5			
Report ID:					
Rpt Period:		2004			
Subst Released:		Sulphur dioxide			
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
CAS No:		811-97-2			
Report ID:					
Rpt Period:		2004			
Subst Released:		HFC-134a Hydrofluorocarbon			
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
48	20 of 28	ENE/0.0	60.9 / -2.15	SNC LAVALIN O & M 120 PARKDALE AVENUE VARIOUS BUILDINGS OTTAWA ON	GEN
Generator No:		ON8217071		Status:	
SIC Code:		911910		Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:		2013		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	

Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		112			
Waste Class Desc:		ACID WASTE - HEAVY METALS			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		122			
Waste Class Desc:		ALKALINE WASTES - OTHER METALS			
Waste Class:		145			
Waste Class Desc:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		331			
Waste Class Desc:		WASTE COMPRESSED GASES			
Waste Class:		121			
Waste Class Desc:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			

[48](#)

21 of 28

ENE/0.0

60.9 / -2.15

Public Works and Government Services Canada
120 Parkdale, Tunneys Pasture, Various
Buildings
Ottawa ON

GEN

Generator No: ON4690864
SIC Code: 911910
SIC Description:
Approval Years: 2013
PO Box No:
Country:

Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Detail(s)

Waste Class: 331
Waste Class Desc: WASTE COMPRESSED GASES

Waste Class: 148
Waste Class Desc: INORGANIC LABORATORY CHEMICALS

Waste Class: 212
Waste Class Desc: ALIPHATIC SOLVENTS

Waste Class: 112
Waste Class Desc: ACID WASTE - HEAVY METALS

Waste Class: 251
Waste Class Desc: OIL SKIMMINGS & SLUDGES

Waste Class: 145
Waste Class Desc: PAINT/PIGMENT/COATING RESIDUES

Waste Class: 221

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Desc:		LIGHT FUELS			
Waste Class:		122			
Waste Class Desc:		ALKALINE WASTES - OTHER METALS			
Waste Class:		243			
Waste Class Desc:		PCBS			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		113			
Waste Class Desc:		ACID WASTE - OTHER METALS			
Waste Class:		121			
Waste Class Desc:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		114			
Waste Class Desc:		OTHER INORGANIC ACID WASTES			
Waste Class:		264			
Waste Class Desc:		PHOTOPROCESSING WASTES			
Waste Class:		146			
Waste Class Desc:		OTHER SPECIFIED INORGANICS			

[48](#)

22 of 28

ENE/0.0

60.9 / -2.15

Public Works and Government Services Canada
120 Parkdale, Tunneys Pasture, Various
Buildings
Ottawa ON K1A 0K9

GEN

Generator No: ON4690864
SIC Code: 911910
SIC Description: 911910
Approval Years: 2016
PO Box No:
Country: Canada

Status:
Co Admin:
Choice of Contact: CO_OFFICIAL
Phone No Admin:
Contam. Facility: No
MHSW Facility: No

Detail(s)

Waste Class: 264
Waste Class Desc: PHOTOPROCESSING WASTES

Waste Class: 145
Waste Class Desc: PAINT/PIGMENT/COATING RESIDUES

Waste Class: 252
Waste Class Desc: WASTE OILS & LUBRICANTS

Waste Class: 148
Waste Class Desc: INORGANIC LABORATORY CHEMICALS

Waste Class: 112
Waste Class Desc: ACID WASTE - HEAVY METALS

Waste Class: 221
Waste Class Desc: LIGHT FUELS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		121			
Waste Class Desc:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		243			
Waste Class Desc:		PCBS			
Waste Class:		122			
Waste Class Desc:		ALKALINE WASTES - OTHER METALS			
Waste Class:		331			
Waste Class Desc:		WASTE COMPRESSED GASES			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		114			
Waste Class Desc:		OTHER INORGANIC ACID WASTES			
Waste Class:		146			
Waste Class Desc:		OTHER SPECIFIED INORGANICS			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
Waste Class:		113			
Waste Class Desc:		ACID WASTE - OTHER METALS			

[48](#)

23 of 28

ENE/0.0

60.9 / -2.15

Public Works and Government Services Canada
120 Parkdale, Tunneys Pasture, Various
Buildings
Ottawa ON K1A 0K9

GEN

Generator No: ON4690864
SIC Code: 911910
SIC Description: 911910
Approval Years: 2015
PO Box No:
Country: Canada

Status:
Co Admin:
Choice of Contact: CO_OFFICIAL
Phone No Admin:
Contam. Facility: No
MHSW Facility: No

Detail(s)

Waste Class: 243
Waste Class Desc: PCBS

Waste Class: 252
Waste Class Desc: WASTE OILS & LUBRICANTS

Waste Class: 251
Waste Class Desc: OIL SKIMMINGS & SLUDGES

Waste Class: 113
Waste Class Desc: ACID WASTE - OTHER METALS

Waste Class: 213
Waste Class Desc: PETROLEUM DISTILLATES

Waste Class: 263
Waste Class Desc: ORGANIC LABORATORY CHEMICALS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		114			
Waste Class Desc:		OTHER INORGANIC ACID WASTES			
Waste Class:		264			
Waste Class Desc:		PHOTOPROCESSING WASTES			
Waste Class:		122			
Waste Class Desc:		ALKALINE WASTES - OTHER METALS			
Waste Class:		145			
Waste Class Desc:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		121			
Waste Class Desc:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		331			
Waste Class Desc:		WASTE COMPRESSED GASES			
Waste Class:		146			
Waste Class Desc:		OTHER SPECIFIED INORGANICS			
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
Waste Class:		112			
Waste Class Desc:		ACID WASTE - HEAVY METALS			
Waste Class:		148			
Waste Class Desc:		INORGANIC LABORATORY CHEMICALS			

48	24 of 28	ENE/0.0	60.9 / -2.15	Public Works and Government Services Canada 120 Parkdale, Tunneys Pasture, Various Buildings Ottawa ON K1A 0K9	GEN
Generator No:	ON4690864			Status:	
SIC Code:	911910			Co Admin:	Anna Lacelle
SIC Description:	911910			Choice of Contact:	CO_OFFICIAL
Approval Years:	2014			Phone No Admin:	613-993-5639 Ext.
PO Box No:				Contam. Facility:	No
Country:	Canada			MHSW Facility:	No

Detail(s)

Waste Class:	112
Waste Class Desc:	ACID WASTE - HEAVY METALS
Waste Class:	146
Waste Class Desc:	OTHER SPECIFIED INORGANICS
Waste Class:	148
Waste Class Desc:	INORGANIC LABORATORY CHEMICALS
Waste Class:	212
Waste Class Desc:	ALIPHATIC SOLVENTS
Waste Class:	331
Waste Class Desc:	WASTE COMPRESSED GASES
Waste Class:	113

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Desc:		ACID WASTE - OTHER METALS			
Waste Class:		145			
Waste Class Desc:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		121			
Waste Class Desc:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		264			
Waste Class Desc:		PHOTOPROCESSING WASTES			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
Waste Class:		243			
Waste Class Desc:		PCBS			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		122			
Waste Class Desc:		ALKALINE WASTES - OTHER METALS			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		114			
Waste Class Desc:		OTHER INORGANIC ACID WASTES			
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
48	25 of 28	ENE/0.0	60.9 / -2.15	Public Services & Procurement Canada ESD/AFD 120 Parkdale, Ottawa ON K1A 0K9	GEN
Generator No:		ON4690864		Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:		As of Dec 2018		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:		Canada		MHSW Facility:	
Detail(s)					
Waste Class:		112 C			
Waste Class Desc:		Acid solutions - containing heavy metals			
Waste Class:		113 C			
Waste Class Desc:		Acid solutions - containing other metals and non-metals			
Waste Class:		114 C			
Waste Class Desc:		Other inorganic acid wastes			
Waste Class:		121 C			
Waste Class Desc:		Alkaline slutions - containing heavy metals			
Waste Class:		122 C			
Waste Class Desc:		Alkaline slutions - containing other metals and non-metals (not cyanide)			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Desc:		145 I Wastes from the use of pigments, coatings and paints			
Waste Class: Waste Class Desc:		145 L Wastes from the use of pigments, coatings and paints			
Waste Class: Waste Class Desc:		146 L Other specified inorganic sludges, slurries or solids			
Waste Class: Waste Class Desc:		146 R Other specified inorganic sludges, slurries or solids			
Waste Class: Waste Class Desc:		146 T Other specified inorganic sludges, slurries or solids			
Waste Class: Waste Class Desc:		148 B Misc. wastes and inorganic chemicals			
Waste Class: Waste Class Desc:		148 C Misc. wastes and inorganic chemicals			
Waste Class: Waste Class Desc:		148 L Misc. wastes and inorganic chemicals			
Waste Class: Waste Class Desc:		212 B Aliphatic solvents and residues			
Waste Class: Waste Class Desc:		212 L Aliphatic solvents and residues			
Waste Class: Waste Class Desc:		213 B Petroleum distillates			
Waste Class: Waste Class Desc:		213 I Petroleum distillates			
Waste Class: Waste Class Desc:		221 I Light fuels			
Waste Class: Waste Class Desc:		221 L Light fuels			
Waste Class: Waste Class Desc:		243 D PCB			
Waste Class: Waste Class Desc:		251 L Waste oils/sludges (petroleum based)			
Waste Class: Waste Class Desc:		252 L Waste crankcase oils and lubricants			
Waste Class: Waste Class Desc:		263 B Misc. waste organic chemicals			
Waste Class: Waste Class Desc:		263 C Misc. waste organic chemicals			
Waste Class: Waste Class Desc:		263 I Misc. waste organic chemicals			
Waste Class: Waste Class Desc:		264 C Photoprocessing wastes			
Waste Class: Waste Class Desc:		264 L Photoprocessing wastes			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		264 T			
Waste Class Desc:		Photoprocessing wastes			
Waste Class:		331 I			
Waste Class Desc:		Waste compressed gases including cylinders			

48	26 of 28	ENE/0.0	60.9 / -2.15	Public Services & Procurement Canada ESD/AFD 120 Parkdale, Ottawa ON K1A 0K9	GEN
Generator No:	ON4690864			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Jul 2020			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	

Detail(s)

Waste Class:	146 T
Waste Class Desc:	Other specified inorganic sludges, slurries or solids
Waste Class:	212 L
Waste Class Desc:	Aliphatic solvents and residues
Waste Class:	221 L
Waste Class Desc:	Light fuels
Waste Class:	213 I
Waste Class Desc:	Petroleum distillates
Waste Class:	148 L
Waste Class Desc:	Misc. wastes and inorganic chemicals
Waste Class:	112 C
Waste Class Desc:	Acid solutions - containing heavy metals
Waste Class:	264 L
Waste Class Desc:	Photoprocessing wastes
Waste Class:	264 C
Waste Class Desc:	Photoprocessing wastes
Waste Class:	145 L
Waste Class Desc:	Wastes from the use of pigments, coatings and paints
Waste Class:	114 C
Waste Class Desc:	Other inorganic acid wastes
Waste Class:	121 C
Waste Class Desc:	Alkaline slutions - containing heavy metals
Waste Class:	145 I
Waste Class Desc:	Wastes from the use of pigments, coatings and paints
Waste Class:	212 B
Waste Class Desc:	Aliphatic solvents and residues
Waste Class:	221 I
Waste Class Desc:	Light fuels
Waste Class:	252 L
Waste Class Desc:	Waste crankcase oils and lubricants

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		113 C			
Waste Class Desc:		Acid solutions - containing other metals and non-metals			
Waste Class:		146 R			
Waste Class Desc:		Other specified inorganic sludges, slurries or solids			
Waste Class:		148 B			
Waste Class Desc:		Misc. wastes and inorganic chemicals			
Waste Class:		331 I			
Waste Class Desc:		Waste compressed gases including cylinders			
Waste Class:		263 C			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		251 L			
Waste Class Desc:		Waste oils/sludges (petroleum based)			
Waste Class:		263 I			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		263 B			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		243 D			
Waste Class Desc:		PCB			
Waste Class:		122 C			
Waste Class Desc:		Alkaline slutions - containing other metals and non-metals (not cyanide)			
Waste Class:		213 B			
Waste Class Desc:		Petroleum distillates			
Waste Class:		264 T			
Waste Class Desc:		Photoprocessing wastes			
Waste Class:		148 C			
Waste Class Desc:		Misc. wastes and inorganic chemicals			
Waste Class:		146 L			
Waste Class Desc:		Other specified inorganic sludges, slurries or solids			
48	27 of 28	ENE/0.0	60.9 / -2.15	Public Services & Procurement Canada ESD/AFD 120 Parkdale, Ottawa ON K1A 0K9	GEN
Generator No:	ON4690864			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Nov 2021			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		251 L			
Waste Class Desc:		Waste oils/sludges (petroleum based)			
Waste Class:		221 L			
Waste Class Desc:		Light fuels			
Waste Class:		148 L			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Desc:				Misc. wastes and inorganic chemicals	
Waste Class:			252 T		
Waste Class Desc:				Waste crankcase oils and lubricants	
Waste Class:			331 I		
Waste Class Desc:				Waste compressed gases including cylinders	
Waste Class:			148 B		
Waste Class Desc:				Misc. wastes and inorganic chemicals	
Waste Class:			146 L		
Waste Class Desc:				Other specified inorganic sludges, slurries or solids	
Waste Class:			213 I		
Waste Class Desc:				Petroleum distillates	
Waste Class:			213 B		
Waste Class Desc:				Petroleum distillates	
Waste Class:			145 I		
Waste Class Desc:				Wastes from the use of pigments, coatings and paints	
Waste Class:			146 R		
Waste Class Desc:				Other specified inorganic sludges, slurries or solids	
Waste Class:			263 C		
Waste Class Desc:				Misc. waste organic chemicals	
Waste Class:			122 C		
Waste Class Desc:				Alkaline slutions - containing other metals and non-metals (not cyanide)	
Waste Class:			148 C		
Waste Class Desc:				Misc. wastes and inorganic chemicals	
Waste Class:			331 R		
Waste Class Desc:				Waste compressed gases including cylinders	
Waste Class:			145 L		
Waste Class Desc:				Wastes from the use of pigments, coatings and paints	
Waste Class:			264 T		
Waste Class Desc:				Photoprocessing wastes	
Waste Class:			113 C		
Waste Class Desc:				Acid solutions - containing other metals and non-metals	
Waste Class:			243 D		
Waste Class Desc:				PCB	
Waste Class:			264 C		
Waste Class Desc:				Photoprocessing wastes	
Waste Class:			221 I		
Waste Class Desc:				Light fuels	
Waste Class:			264 L		
Waste Class Desc:				Photoprocessing wastes	
Waste Class:			112 C		
Waste Class Desc:				Acid solutions - containing heavy metals	
Waste Class:			252 L		
Waste Class Desc:				Waste crankcase oils and lubricants	
Waste Class:			114 C		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Desc:		Other inorganic acid wastes			
Waste Class:		212 L			
Waste Class Desc:		Aliphatic solvents and residues			
Waste Class:		121 C			
Waste Class Desc:		Alkaline slutions - containing heavy metals			
Waste Class:		146 T			
Waste Class Desc:		Other specified inorganic sludges, slurries or solids			
Waste Class:		263 I			
Waste Class Desc:		Misc. waste organic chemicals			
Waste Class:		212 B			
Waste Class Desc:		Aliphatic solvents and residues			
Waste Class:		263 B			
Waste Class Desc:		Misc. waste organic chemicals			

48	28 of 28	ENE/0.0	60.9 / -2.15	Public Services & Procurement Canada ESD/AFD 120 Parkdale, Ottawa ON K1A 0K9	GEN
Generator No:	ON4690864			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Feb 2022			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	

Detail(s)

Waste Class:	148 L
Waste Class Desc:	Misc. wastes and inorganic chemicals
Waste Class:	264 C
Waste Class Desc:	Photoprocessing wastes
Waste Class:	148 C
Waste Class Desc:	Misc. wastes and inorganic chemicals
Waste Class:	263 I
Waste Class Desc:	Misc. waste organic chemicals
Waste Class:	331 R
Waste Class Desc:	Waste compressed gases including cylinders
Waste Class:	263 C
Waste Class Desc:	Misc. waste organic chemicals
Waste Class:	122 C
Waste Class Desc:	Alkaline slutions - containing other metals and non-metals (not cyanide)
Waste Class:	113 C
Waste Class Desc:	Acid solutions - containing other metals and non-metals
Waste Class:	145 I
Waste Class Desc:	Wastes from the use of pigments, coatings and paints
Waste Class:	212 L
Waste Class Desc:	Aliphatic solvents and residues

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Desc:		145 L Wastes from the use of pigments, coatings and paints			
Waste Class: Waste Class Desc:		146 L Other specified inorganic sludges, slurries or solids			
Waste Class: Waste Class Desc:		263 B Misc. waste organic chemicals			
Waste Class: Waste Class Desc:		264 L Photoprocessing wastes			
Waste Class: Waste Class Desc:		112 C Acid solutions - containing heavy metals			
Waste Class: Waste Class Desc:		264 T Photoprocessing wastes			
Waste Class: Waste Class Desc:		146 R Other specified inorganic sludges, slurries or solids			
Waste Class: Waste Class Desc:		114 C Other inorganic acid wastes			
Waste Class: Waste Class Desc:		221 L Light fuels			
Waste Class: Waste Class Desc:		252 L Waste crankcase oils and lubricants			
Waste Class: Waste Class Desc:		212 B Aliphatic solvents and residues			
Waste Class: Waste Class Desc:		213 I Petroleum distillates			
Waste Class: Waste Class Desc:		121 C Alkaline slutions - containing heavy metals			
Waste Class: Waste Class Desc:		213 B Petroleum distillates			
Waste Class: Waste Class Desc:		146 T Other specified inorganic sludges, slurries or solids			
Waste Class: Waste Class Desc:		221 I Light fuels			
Waste Class: Waste Class Desc:		252 T Waste crankcase oils and lubricants			
Waste Class: Waste Class Desc:		148 B Misc. wastes and inorganic chemicals			
Waste Class: Waste Class Desc:		331 I Waste compressed gases including cylinders			
Waste Class: Waste Class Desc:		243 D PCB			
Waste Class: Waste Class Desc:		251 L Waste oils/sludges (petroleum based)			
49	1 of 1	NE/0.0	59.9 / -3.15	ON	BORE

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Borehole ID:	613201			Inclin FLG:	No
OGF ID:	215514504			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:				Primary Name:	
Completion Date:	NOV-1962			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	45.409026
Total Depth m:	-999			Longitude DD:	-75.734792
Depth Ref:	Ground Surface			UTM Zone:	18
Depth Elev:				Easting:	442501
Drill Method:				Northing:	5028652
Orig Ground Elev m:	60.9			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	59.7				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218394118			Mat Consistency:	Compact
Top Depth:	2.6			Material Moisture:	
Bottom Depth:				Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Bedrock			Geologic Formation:	
Material 2:	Limestone			Geologic Group:	
Material 3:	Shale			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	BEDROCK. ED. CLAY. GREY,STIFF. 00000005 SAND. LOOSE TO COMPACT. UNSPECIFIED. DENSE.				
Geology Stratum ID:	218394116			Mat Consistency:	Loose
Top Depth:	0			Material Moisture:	
Bottom Depth:	1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SAND. LOOSE.				
Geology Stratum ID:	218394117			Mat Consistency:	Firm
Top Depth:	1			Material Moisture:	
Bottom Depth:	2.6			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Gravel			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SAND. FIRM.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:				Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Details:		File: OTTAWA2.txt RecordID: 057090 NTS_Sheet: 31G05G			
Confiden 1:					
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Originators:		Geological Survey of Canada			

50	1 of 1	NE/0.0	59.9 / -3.15	50 COLOMBINE DRIVEWAY Ottawa ON	WWIS
Well ID:	7240370			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:	Monitoring and Test Hole			Date Received:	4/22/2015
Sec. Water Use:	0			Selected Flag:	TRUE
Final Well Status:	Test Hole			Abandonment Rec:	
Water Type:				Contractor:	7241
Casing Material:				Form Version:	7
Audit No:	Z207414			Owner:	
Tag:	A178457			Street Name:	50 COLOMBINE DRIVEWAY
Construction Method:				County:	OTTAWA
Elevation (m):				Municipality:	OTTAWA CITY
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					
PDF URL (Map):					

Additional Detail(s) (Map)

Well Completed Date: 2015/03/30
Year Completed: 2015
Depth (m): 5.79
Latitude: 45.409148570193
Longitude: -75.7350325031145
Path:

Bore Hole Information

Bore Hole ID:	1005327885	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	442482.00
Code OB Desc:		North83:	5028666.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	30-Mar-2015 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005599023			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		0.9100000262260437			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005599024			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:		71			
Mat3 Desc:		FRACTURED			
Formation Top Depth:		0.9100000262260437			
Formation End Depth:		5.789999961853027			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005599035			
Layer:		3			
Plug From:		1.2200000286102295			
Plug To:		5.789999961853027			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005599033			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005599034			
Layer:		2			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		0.3100000023841858			
Plug To:		1.2200000286102295			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005599032			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005599022			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005599028			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.5			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005599029			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.5			
Screen End Depth:		5.789999961853027			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1005599027			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005599026			
Diameter:		7.619999885559082			
Depth From:		1.5			
Depth To:		5.789999961853027			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1005599025			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		1.5			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
51	1 of 1	NE/0.0	59.9 / -3.15	Environmental Health Centre Ottawa ON	FCS
SGC:		3506008			
Site ID:		50064001			
Departmental ID:		LAB-OT-05			
Depart Code:		SHC			
Class Type:		3			
Class:		Low Priority for Action			
Site Name:		Environmental Health Centre			
Site Name (FR):		Centre de santé environnementale			
Site Status:		Closed			
Site Status Desc:		Confirmatory sampling completed. No further action required.			
Site Status (FR):		Fermé			
Description (FR):		Échantillonnage de confirmation terminé. Aucune autre mesure nécessaire.			
Involv Code:					
Census Division:		Ottawa			
Municipality:		Ottawa			
Census Sub Class:		1			
Latitude:		45.409269			
Longitude:		-75.735275			
Location:					
Protected Data:		0			
FED:		075			
Fed Electoral District:		Ottawa Centre			
Fed Electoral District (FR):		Ottawa-Centre			
Metro:					
Nearest Pop. Area:					
Highest Step Cmpltd:		9			
Site Deleted Flag:					
Created:		2005-07-28T11:44:00			
Modified:		2013-07-19T15:54:50.177			
Property No.:		08752			
Est m³ Contmnted:		44			
Est Ha Contmnted:					
Est Tons Contamin:					
Est Population at 1 Km:		6,760			
Est Population at 5 Km:		210,436			
Est Population at 10 Km:		649,599			
Est Population at 25 Km:		1,226,766			
Est Population at 50 Km:		1,442,120			
Reporting Org:		Health Canada			
Reporting Org (FR):		Santé Canada			
Reason for Involv:		Federal Real Property			
Reason for Involv (FR):		Biens immobiliers fédéraux			
Liabile Third Party:					
Class (FR):		Priorité d'intervention faible			
Action Plan:		Based upon the results of an assessment completed in 2009-10, it has been determined that natural attenuation of contamination is occurring at the site. An ongoing monitoring program is in place to ensure risks to human health and the environment remain neutralized.			
Action Plan (FR):		Sur la base des résultats d'une évaluation effectuée en 2009-10, il a été déterminé que l'atténuation naturelle de la contamination se produit sur le site. Un programme de surveillance continue est en place pour s'assurer que les risques pour la santé humaine et l'environnement restent neutralisés.			
Site Mgmnt Strategy:		Other			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Minimap URL:		http://www.tbs-sct.gc.ca/fcsi-rscf/minimap.aspx?fsi=50064001			
Additional Info:					
Additional Info (FR):					
<u>Management</u>					
Management Code:		9			
Management Type (EN):		Other			
Management Type (FR):		Autre type de gestion			
<u>Contamination</u>					
Contaminant:		PHCs (petroleum hydrocarbons)			
Contamination (FR):		HCP (hydrocarbures pétroliers)			
Medium Code:		2			
Medium:		Groundwater			
Medium (FR):		Eau souterraine			
Contaminant:		PHCs (petroleum hydrocarbons)			
Contamination (FR):		HCP (hydrocarbures pétroliers)			
Medium Code:		5			
Medium:		Soil			
Medium (FR):		Sol			
<u>Annual Data</u>					
Fiscal Year:		2007-2008			
Reporting Organization:		SHC			
Reporting Organization (EN):		Health Canada			
Reporting Organization (FR):		Santé Canada			
Class Type:					
Class (EN):					
Class (FR):					
CCME Flag:					
CCME NCS Year:					
Step Name (EN):					
Step Name (FR):					
Highest Step Completed:		07			
Highest Step Completed Desc:					
Planned Compl Date Step7:					
Planned Compl Date Step8:					
Planned Compl Date Step9:					
Created:					
Modified:					
NCSCS Year:					
Closed:		No			
Actual Cubic Metres Rem:		0			
Actual Hectares Rem:		0			
Actual Tons Remediated:		0			
Total Asmt Expenditure:		\$0.00			
Total Remediation Expenditure:		\$0.00			
Total Care/Maint Expenditur:		\$0.00			
Total Mntring Expenditure:		\$0.00			
Ttl Expenditure Reduc Liabil:					
FCSAP Asmt Expenditure:		\$0.00			
FCSAP Remed Expenditure:		\$0.00			
FCSAP Care/Maint Expenditur:		\$0.00			
FCSAP Mntring Expenditure:		\$0.00			
<u>Annual Data</u>					
Fiscal Year:		2006-2007			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Reporting Organization:		SHC			
Reporting Organization (EN):		Health Canada			
Reporting Organization (FR):		Santé Canada			
Class Type:					
Class (EN):					
Class (FR):					
CCME Flag:					
CCME NCS Year:					
Step Name (EN):					
Step Name (FR):					
Highest Step Completed:	07				
Highest Step Completed Desc:					
Planned Compl Date Step7:					
Planned Compl Date Step8:					
Planned Compl Date Step9:					
Created:					
Modified:					
NCSCS Year:					
Closed:	No				
Actual Cubic Metres Rem:	0				
Actual Hectares Rem:	0				
Actual Tons Remediated:	0				
Total Asmt Expenditure:	\$0.00				
Total Remediation Expenditure:	\$0.00				
Total Care/Maint Expenditur:	\$0.00				
Total Mntring Expenditure:	\$0.00				
Ttl Expenditure Reduc Liabil:					
FCSAP Asmt Expenditure:	\$0.00				
FCSAP Remed Expenditure:	\$0.00				
FCSAP Care/Maint Expenditur:	\$0.00				
FCSAP Mntring Expenditure:	\$0.00				
 <u>Annual Data</u>					
Fiscal Year:		2005-2006			
Reporting Organization:		SHC			
Reporting Organization (EN):		Health Canada			
Reporting Organization (FR):		Santé Canada			
Class Type:					
Class (EN):					
Class (FR):					
CCME Flag:					
CCME NCS Year:					
Step Name (EN):					
Step Name (FR):					
Highest Step Completed:	07				
Highest Step Completed Desc:					
Planned Compl Date Step7:					
Planned Compl Date Step8:					
Planned Compl Date Step9:					
Created:					
Modified:					
NCSCS Year:					
Closed:	No				
Actual Cubic Metres Rem:	0				
Actual Hectares Rem:	0				
Actual Tons Remediated:	0				
Total Asmt Expenditure:	\$11,000.00				
Total Remediation Expenditure:	\$11,000.00				
Total Care/Maint Expenditur:	\$0.00				
Total Mntring Expenditure:	\$0.00				
Ttl Expenditure Reduc Liabil:					
FCSAP Asmt Expenditure:	\$0.00				
FCSAP Remed Expenditure:	\$0.00				
FCSAP Care/Maint Expenditur:	\$0.00				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
FCSAP Mntring Expenditure:		\$0.00			
<u>Annual Data</u>					
Fiscal Year:		2008-2009			
Reporting Organization:		SHC			
Reporting Organization (EN):		Health Canada			
Reporting Organization (FR):		Santé Canada			
Class Type:					
Class (EN):					
Class (FR):					
CCME Flag:					
CCME NCS Year:					
Step Name (EN):					
Step Name (FR):					
Highest Step Completed:		08			
Highest Step Completed Desc:					
Planned Compl Date Step7:					
Planned Compl Date Step8:					
Planned Compl Date Step9:					
Created:					
Modified:					
NCSCS Year:					
Closed:		No			
Actual Cubic Metres Rem:		0			
Actual Hectares Rem:		0			
Actual Tons Remediated:		0			
Total Asmt Expenditure:		\$0.00			
Total Remediation Expenditure:		\$0.00			
Total Care/Maint Expenditur:		\$0.00			
Total Mntring Expenditure:		\$0.00			
Ttl Expenditure Reduc Liabil:					
FCSAP Asmt Expenditure:		\$0.00			
FCSAP Remed Expenditure:		\$0.00			
FCSAP Care/Maint Expenditur:		\$0.00			
FCSAP Mntring Expenditure:		\$0.00			
<u>Annual Data</u>					
Fiscal Year:		2009-2010			
Reporting Organization:		SHC			
Reporting Organization (EN):		Health Canada			
Reporting Organization (FR):		Santé Canada			
Class Type:					
Class (EN):					
Class (FR):					
CCME Flag:					
CCME NCS Year:					
Step Name (EN):					
Step Name (FR):					
Highest Step Completed:		09			
Highest Step Completed Desc:					
Planned Compl Date Step7:					
Planned Compl Date Step8:					
Planned Compl Date Step9:					
Created:					
Modified:					
NCSCS Year:					
Closed:		Yes			
Actual Cubic Metres Rem:		45			
Actual Hectares Rem:		0			
Actual Tons Remediated:		0			
Total Asmt Expenditure:		\$0.00			
Total Remediation Expenditure:		\$0.00			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Total Care/Maint Expenditur:		\$0.00			
Total Mntring Expenditure:		\$0.00			
Ttl Expenditure Reduc Liabil:					
FCSAP Asmt Expenditure:		\$0.00			
FCSAP Remed Expenditure:		\$0.00			
FCSAP Care/Maint Expenditur:		\$0.00			
FCSAP Mntring Expenditure:		\$0.00			

[52](#) 1 of 1 NE/0.0 59.9 / -3.15 50 COLOMBINE DRIVEWAY Ottawa ON [WWIS](#)

Well ID:	7240369	Data Entry Status:	
Construction Date:		Data Src:	
Primary Water Use:	Monitoring and Test Hole	Date Received:	4/22/2015
Sec. Water Use:	0	Selected Flag:	TRUE
Final Well Status:	Test Hole	Abandonment Rec:	
Water Type:		Contractor:	7241
Casing Material:		Form Version:	7
Audit No:	Z207413	Owner:	
Tag:	A178458	Street Name:	50 COLOMBINE DRIVEWAY
Construction Method:		County:	OTTAWA
Elevation (m):		Municipality:	OTTAWA CITY
Elevation Reliability:		Site Info:	
Depth to Bedrock:		Lot:	
Well Depth:		Concession:	
Overburden/Bedrock:		Concession Name:	
Pump Rate:		Easting NAD83:	
Static Water Level:		Northing NAD83:	
Flowing (Y/N):		Zone:	
Flow Rate:		UTM Reliability:	
Clear/Cloudy:			

PDF URL (Map):

Additional Detail(s) (Map)

Well Completed Date: 2015/03/30
Year Completed: 2015
Depth (m): 6.1
Latitude: 45.4092588785856
Longitude: -75.7346761161145
Path:

Bore Hole Information

Bore Hole ID:	1005327882	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	442510.00
Code OB Desc:		North83:	5028678.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	30-Mar-2015 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	www
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005598990			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:		71			
Mat3 Desc:		FRACTURED			
Formation Top Depth:		1.2200000286102295			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005598989			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		1.2200000286102295			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005599000			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.5			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005599001			
Layer:		3			
Plug From:		1.5			
Plug To:		6.099999904632568			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005598999			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Use</u>					
Method Construction ID:		1005598998			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005598988			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005598994			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.5			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005598995			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.5			
Screen End Depth:		6.099999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1005598993			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005598991			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		1.5			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1005598992			
Diameter:		7.619999885559082			
Depth From:		1.5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

[53](#) 1 of 1 NNE/0.0 59.9 / -3.15 50 COLOMBINE DRIVEWAY Ottawa ON [WWIS](#)

Well ID:	7240372	Data Entry Status:	
Construction Date:		Data Src:	
Primary Water Use:	Monitoring and Test Hole	Date Received:	4/22/2015
Sec. Water Use:	0	Selected Flag:	TRUE
Final Well Status:	Test Hole	Abandonment Rec:	
Water Type:		Contractor:	7241
Casing Material:		Form Version:	7
Audit No:	Z207412	Owner:	
Tag:	A178463	Street Name:	50 COLOMBINE DRIVEWAY
Construction Method:		County:	OTTAWA
Elevation (m):		Municipality:	OTTAWA CITY
Elevation Reliability:		Site Info:	
Depth to Bedrock:		Lot:	
Well Depth:		Concession:	
Overburden/Bedrock:		Concession Name:	
Pump Rate:		Easting NAD83:	
Static Water Level:		Northing NAD83:	
Flowing (Y/N):		Zone:	
Flow Rate:		UTM Reliability:	
Clear/Cloudy:			

PDF URL (Map):

Additional Detail(s) (Map)

Well Completed Date: 2015/03/30
Year Completed: 2015
Depth (m): 4.57
Latitude: 45.4096142127611
Longitude: -75.7354091423331
Path:

Bore Hole Information

Bore Hole ID:	1005327891	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	442453.00
Code OB Desc:		North83:	5028718.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	30-Mar-2015 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID: 1005599081

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:		71			
Mat3 Desc:		FRACTURED			
Formation Top Depth:		1.2200000286102295			
Formation End Depth:		4.570000171661377			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005599080			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		1.2200000286102295			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1005599091			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.5			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1005599092			
Layer:		3			
Plug From:		1.5			
Plug To:		4.570000171661377			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1005599090			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1005599089			
Method Construction Code:		D			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005599079			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005599085			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.5			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005599086			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.5			
Screen End Depth:		4.570000171661377			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1005599084			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005599082			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		1.8300000429153442			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1005599083			
Diameter:		7.619999885559082			
Depth From:		1.8300000429153442			
Depth To:		4.570000171661377			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
54	1 of 1	NE/0.0	59.9 / -3.15	50 COLOMBINE DRIVEWAY Ottawa ON	WWIS
Well ID: 7240371 Construction Date: Primary Water Use: Monitoring and Test Hole Sec. Water Use: 0 Final Well Status: Test Hole Water Type: Casing Material: Audit No: Z207415 Tag: A178460 Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy: Data Entry Status: Data Src: Date Received: 4/22/2015 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: Street Name: 50 COLOMBINE DRIVEWAY County: OTTAWA Municipality: OTTAWA CITY Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability: PDF URL (Map): Additional Detail(s) (Map) Well Completed Date: 2015/03/30 Year Completed: 2015 Depth (m): 4.51 Latitude: 45.4094022296067 Longitude: -75.7347802085374 Path: Bore Hole Information Bore Hole ID: 1005327888 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 30-Mar-2015 00:00:00 Remarks: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 18 East83: 442502.00 North83: 5028694.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr Overburden and Bedrock Materials Interval Formation ID: 1005599049 Layer: 2 Color: 2 General Color: GREY Mat1: 15					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:		71			
Mat3 Desc:		FRACTURED			
Formation Top Depth:		1.2200000286102295			
Formation End Depth:		4.510000228881836			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005599048			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		1.2200000286102295			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005599059			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.5			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005599060			
Layer:		3			
Plug From:		1.5			
Plug To:					
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005599058			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005599057			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		1005599047			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005599053			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.5			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005599054			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.5			
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1005599052			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005599050			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		2.5			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1005599051			
Diameter:		7.619999885559082			
Depth From:		2.5			
Depth To:					
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>55</u>	1 of 1	NE/0.0	59.9 / -3.15	50 COLOMBINE DRIVEWAY Ottawa ON	WWIS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well ID:	7240373			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:	Monitoring and Test Hole			Date Received:	4/22/2015
Sec. Water Use:	0			Selected Flag:	TRUE
Final Well Status:	Test Hole			Abandonment Rec:	
Water Type:				Contractor:	7241
Casing Material:				Form Version:	7
Audit No:	Z207416			Owner:	
Tag:	A178459			Street Name:	50 COLOMBINE DRIVEWAY
Construction Method:				County:	OTTAWA
Elevation (m):				Municipality:	OTTAWA CITY
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					
 PDF URL (Map):					
 <u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2015/03/30				
Year Completed:	2015				
Depth (m):	6.1				
Latitude:	45.409571595443				
Longitude:	-75.7350379901984				
Path:					
 <u>Bore Hole Information</u>					
Bore Hole ID:	1005327894			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442482.00
Code OB Desc:				North83:	5028713.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	30-Mar-2015 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1005599130				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	11				
Most Common Material:	GRAVEL				
Mat2:	28				
Mat2 Desc:	SAND				
Mat3:	85				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		0.9100000262260437			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005599131			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:		71			
Mat3 Desc:		FRACTURED			
Formation Top Depth:		0.9100000262260437			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005599142			
Layer:		3			
Plug From:		1.2200000286102295			
Plug To:		6.099999904632568			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005599140			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005599141			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.2200000286102295			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1005599139			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1005599129			
Casing No:		0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Comment: Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005599135			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.5			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005599136			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.5			
Screen End Depth:		6.099999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1005599134			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005599132			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		1.5			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1005599133			
Diameter:		7.619999885559082			
Depth From:		1.5			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

56	1 of 1	NNE/0.0	59.9 / -3.15	ON	BORE
Borehole ID:	613208			Inclin FLG:	No
OGF ID:	215514511			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Use: Completion Date: Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: -999 Depth Ref: Ground Surface Depth Elev: Drill Method: Orig Ground Elev m: 58.7 Elev Reliabil Note: DEM Ground Elev m: 58.7 Concession: Location D: Survey D: Comments: Primary Name: Municipality: Lot: Township: Latitude DD: 45.409917 Longitude DD: -75.736209 UTM Zone: 18 Easting: 442391 Northing: 5028752 Location Accuracy: Accuracy: Not Applicable					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218394140 Top Depth: 2.4 Bottom Depth: Material Color: Grey Material 1: Bedrock Material 2: Limestone Material 3: Shale Material 4: Gsc Material Description: Stratum Description: BEDROCK. 0075 068 0000003300075001 00150 067 0000000800050005GREY,STIFF,FISSURE **Note: Many records provided by the department have a truncated [Stratum Description] field. Mat Consistency: Stiff Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Geology Stratum ID: 218394138 Top Depth: 0 Bottom Depth: 1.1 Material Color: Material 1: Sand Material 2: Silt Material 3: Gravel Material 4: Gsc Material Description: Stratum Description: SAND. FIRM. Mat Consistency: Firm Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Geology Stratum ID: 218394139 Top Depth: 1.1 Bottom Depth: 2.4 Material Color: Material 1: Limestone Material 2: Sand Material 3: Silt Material 4: Gsc Material Description: Stratum Description: LIMESTONE. COMPACT,BROKEN. Mat Consistency: Compact Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
<u>Source</u>					
Source Type: Data Survey Source Orig: Geological Survey of Canada Source Date: 1956-1972 Confidence: Observatio: Source Name: Urban Geology Automated Information System (UGAIS) Source Details: File: OTTAWA2.txt RecordID: 057160 NTS_Sheet: 31G05G Confiden 1: Source Appl: Spatial/Tabular Source Iden: 1 Scale or Res: Varies Horizontal: NAD27 Verticalda: Mean Average Sea Level					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
57	1 of 6	ESE/5.0	61.9 / -1.15	OC Transit (City of Ottawa)<UNOFFICIAL> 1611 Scott St.<UNOFFICIAL> Ottawa ON	SPL
Ref No:	6624-6G2SSX			Discharger Report:	0
Site No:				Material Group:	Oil
Incident Dt:	9/8/2005			Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:				Sector Type:	Other Motor Vehicle
Incident Event:				Agency Involved:	
Contaminant Code:				Nearest Watercourse:	
Contaminant Name:	TRANSMISSION OIL			Site Address:	
Contaminant Limit 1:				Site District Office:	Ottawa
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:	Not Anticipated			Site Municipality:	Ottawa
Nature of Impact:				Site Lot:	
Receiving Medium:	Land & Water			Site Conc:	
Receiving Env:				Northing:	
MOE Response:				Easting:	
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:	9/8/2005			Site Map Datum:	
Dt Document Closed:				SAC Action Class:	Spills to Land
Incident Reason:				Source Type:	
Site Name:	1611 Scott St.<UNOFFICIAL>				
Site County/District:					
Site Geo Ref Meth:					
Incident Summary:	OC Transit: 100L trans. fluid to rd/cb				
Contaminant Qty:	100 L				
57	2 of 6	ESE/5.0	61.9 / -1.15	City of Ottawa 1611 Scott Street Ottawa ON	CA
Certificate #:	1007-6PGK6M				
Application Year:	2006				
Issue Date:	5/11/2006				
Approval Type:	Air				
Status:	Approved				
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					
57	3 of 6	ESE/5.0	61.9 / -1.15	OLRT Constructors/Dragados/EllisDon Corp 1611 Scott Street - Tunney's Pasture Station Ottawa ON K1Y 2N5	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:	ON7974088 493190 OTHER WAREHOUSING AND STORAGE 2016 Canada			Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	Eric Kelly CO_OFFICIAL 6134078153 Ext. No No
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	252 WASTE OILS & LUBRICANTS				
Waste Class: Waste Class Desc:	251 OIL SKIMMINGS & SLUDGES				
<u>57</u>	4 of 6	ESE/5.0	61.9 / -1.15	OC Transpo 1611 Scott Street Ottawa ON K1Y 4W2	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:	ON3712243 485110 485110 2016 Canada			Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	Brandon A McGee CO_OFFICIAL 6137491449 Ext.245 No No
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	251 OIL SKIMMINGS & SLUDGES				
Waste Class: Waste Class Desc:	252 WASTE OILS & LUBRICANTS				
<u>57</u>	5 of 6	ESE/5.0	61.9 / -1.15	OLRT Constructors/Dragados/EllisDon Corp 1611 Scott Street - Tunney's Pasture Station Ottawa ON K1Y 2N5	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:	ON7974088 As of Dec 2017 Canada			Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	Registered
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	221 L Light fuels				
Waste Class: Waste Class Desc:	252 L Waste crankcase oils and lubricants				
Waste Class: Waste Class Desc:	251 L Waste oils/sludges (petroleum based)				
<u>57</u>	6 of 6	ESE/5.0	61.9 / -1.15	1611 Scott St Ottawa ON	SPL
Ref No: Site No:	2062-AMVHRN			Discharger Report: Material Group:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Incident Dt: Year: Incident Cause: Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Incident Reason: Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: Contaminant Qty:	5/31/2017 Unknown / N/A 27 CONCRETE n/a Land 5/31/2017 Unknown / N/A OLRT<UNOFFICIAL> OLRT: 10L of concrete slurry to soil - cleaning 10 L	Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:	2 - Minor Environment Unknown / N/A 1611 Scott St Ottawa Eastern Ottawa 5028073.75 442533.12 Unknown / N/A		
58	1 of 1	S/6.9	64.9 / 1.85	City of Ottawa 1565 Scott St Ottawa ON K2G 6J8	ECA
Approval No: Approval Date: Status: Record Type: Link Source: SWP Area Name: Approval Type: Project Type: Business Name: Address: Full Address: Full PDF Link: PDF Site Location:	8273-A7FHPE 2016-02-28 Approved ECA IDS ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS MUNICIPAL AND PRIVATE SEWAGE WORKS City of Ottawa 1565 Scott St https://www.accessenvironment.ene.gov.on.ca/instruments/1209-A6XSK3-14.pdf	MOE District: City: Longitude: Latitude: Geometry X: Geometry Y:			
59	1 of 1	ESE/7.9	61.9 / -1.15	SCOTT ST Ottawa ON	WWIS
Well ID: Construction Date: Primary Water Use: Sec. Water Use: Final Well Status: Water Type: Casing Material: Audit No: Tag: Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level:	7119009 Monitoring Observation Wells Z63806 A074606 A074606	Data Entry Status: Data Src: Date Received: Selected Flag: Abandonment Rec: Contractor: Form Version: Owner: Street Name: County: Municipality: Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83:	2/9/2009 TRUE 1844 4 SCOTT ST OTTAWA OTTAWA CITY		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Flowing (Y/N):			Zone:		
Flow Rate:			UTM Reliability:		
Clear/Cloudy:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/711\7119009.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2008/12/04			
Year Completed:		2008			
Depth (m):		6.9			
Latitude:		45.4038133038382			
Longitude:		-75.7346438600904			
Path:		711\7119009.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1002009852		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		04-Dec-2008 00:00:00		UTMRC Desc:	
Remarks:				Location Method:	
Elevrc Desc:				18	
Location Source Date:				442507.00	
Improvement Location Source:				5028073.00	
Improvement Location Method:				UTM83	
Source Revision Comment:				4	
Supplier Comment:				margin of error : 30 m - 100 m	
				wwr	
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1002597969			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:		71			
Mat3 Desc:		FRACTURED			
Formation Top Depth:		0.800000011920929			
Formation End Depth:		6.900000095367432			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1002597968			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:		02			
Most Common Material:		TOPSOIL			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.800000011920929			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002597971			
Layer:		1			
Plug From:		0.0			
Plug To:		3.5			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1002597976			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:		HSA			
<u>Pipe Information</u>					
Pipe ID:		1002597967			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002597973			
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		3.9000000953674316			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1002597974			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:					
Screen Diameter UOM:					
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1002597972			
Layer:		1			
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1002597970			
Diameter:		20.0			
Depth From:					
Depth To:		6.900000095367432			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
60	1 of 3	NE/9.3	59.6 / -3.46	City of Ottawa Emmerson Avenue and Parkdale Avenue Ottawa ON	CA
Certificate #:		1966-5LGHCQ			
Application Year:		2003			
Issue Date:		4/10/2003			
Approval Type:		Municipal and Private Sewage Works			
Status:		Approved			
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					
60	2 of 3	NE/9.3	59.6 / -3.46	City of Ottawa Emmerson Avenue and Parkdale Ave Ottawa ON K1S 5K2	ECA
Approval No:		1966-5LGHCQ		MOE District:	
Approval Date:		2003-04-10		City:	
Status:		Approved		Longitude:	
Record Type:		ECA		Latitude:	
Link Source:		IDS		Geometry X:	
SWP Area Name:				Geometry Y:	
Approval Type:		ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS			
Project Type:		MUNICIPAL AND PRIVATE SEWAGE WORKS			
Business Name:		City of Ottawa			
Address:		Emmerson Avenue and Parkdale Ave			
Full Address:					
Full PDF Link:		https://www.accessenvironment.ene.gov.on.ca/instruments/5211-5KXLKQ-14.pdf			
PDF Site Location:					
60	3 of 3	NE/9.3	59.6 / -3.46	City of Ottawa Emmerson Avenue and Parkdale Ave Ottawa ON K1S 5K2	ECA
Approval No:		9595-5LGHK5		MOE District:	
Approval Date:		2003-04-10		City:	
Status:		Approved		Longitude:	
Record Type:		ECA		Latitude:	
Link Source:		IDS		Geometry X:	
SWP Area Name:				Geometry Y:	
Approval Type:		ECA-Municipal and Private Water Works			
Project Type:		Municipal and Private Water Works			
Business Name:		City of Ottawa			
Address:		Emmerson Avenue and Parkdale Ave			
Full Address:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Full PDF Link: PDF Site Location:					
61	1 of 1	E/13.4	61.9 / -1.15	ON	BORE
Borehole ID:		613136	Inclin FLG:		No
OGF ID:		215514440	SP Status:		Initial Entry
Status:			Surv Elev:		No
Type:		Borehole	Piezometer:		No
Use:			Primary Name:		
Completion Date:			Municipality:		
Static Water Level:		11.9	Lot:		
Primary Water Use:			Township:		
Sec. Water Use:			Latitude DD:		45.405085
Total Depth m:		-999	Longitude DD:		-75.731674
Depth Ref:		Ground Surface	UTM Zone:		18
Depth Elev:			Easting:		442741
Drill Method:			Northing:		5028212
Orig Ground Elev m:		70	Location Accuracy:		
Elev Reliabil Note:			Accuracy:		Not Applicable
DEM Ground Elev m:		59.3			
Concession:					
Location D:					
Survey D:					
Comments:					
Borehole Geology Stratum					
Geology Stratum ID:		218393851	Mat Consistency:		Dense
Top Depth:		0	Material Moisture:		
Bottom Depth:			Material Texture:		
Material Color:		Brown	Non Geo Mat Type:		
Material 1:		Till	Geologic Formation:		
Material 2:			Geologic Group:		
Material 3:			Geologic Period:		
Material 4:			Depositional Gen:		
Gsc Material Description:					
Stratum Description:		TILL. BROWN. . ENSE. SILT. DENSE. UNSPECIFIED. DENSE. BEDROCK. . BEDROCK.			
Source					
Source Type:		Data Survey	Source Appl:		Spatial/Tabular
Source Orig:		Geological Survey of Canada	Source Iden:		1
Source Date:		1956-1972	Scale or Res:		Varies
Confidence:		H	Horizontal:		NAD27
Observatio:			Verticalda:		Mean Average Sea Level
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Details:		File: OTTAWA2.txt RecordID: 056440 NTS_Sheet: 31G05G			
Confiden 1:		Logged by professional. Exact and complete description of material and properties.			
Source List					
Source Identifier:		1	Horizontal Datum:		NAD27
Source Type:		Data Survey	Vertical Datum:		Mean Average Sea Level
Source Date:		1956-1972	Projection Name:		Universal Transverse Mercator
Scale or Resolution:		Varies			
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Originators:		Geological Survey of Canada			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
62	1 of 1	ENE/18.4	60.9 / -2.15	131 PARKDALE AVENUE OTTAWA ON K1Y 1E7	EHS
Order No: 20070322027		Nearest Intersection:			
Status: C		Municipality:			
Report Type: CAN - Custom Report		Client Prov/State:			
Report Date: 4/2/2007		Search Radius (km): 0.25			
Date Received: 3/22/2007		X: -75.733357			
Previous Site Name:		Y: 45.40804			
Lot/Building Size:					
Additional Info Ordered: Fire Insur. Maps And /or Site Plans					
63	1 of 1	E/20.5	61.9 / -1.15	Scott Street and Parkdale Avenue Ottawa ON	SPL
Ref No: 2274-AE2Q55		Discharger Report:			
Site No: NA		Material Group:			
Incident Dt: 9/22/2016		Health/Env Conseq:			
Year:		Client Type:			
Incident Cause:		Sector Type: Miscellaneous Industrial			
Incident Event: Leak/Break		Agency Involved:			
Contaminant Code: 15		Nearest Watercourse:			
Contaminant Name: HYDRAULIC OIL		Site Address: Scott Street and Parkdale Avenue			
Contaminant Limit 1:		Site District Office:			
Contam Limit Freq 1:		Site Postal Code:			
Contaminant UN No 1:		Site Region:			
Environment Impact:		Site Municipality: Ottawa			
Nature of Impact:		Site Lot:			
Receiving Medium:		Site Conc:			
Receiving Env: Land		Northing:			
MOE Response:		Easting:			
Dt MOE Arvl on Scn:		Site Geo Ref Accu:			
MOE Reported Dt: 9/22/2016		Site Map Datum:			
Dt Document Closed:		SAC Action Class: Land Spills			
Incident Reason: Equipment Failure		Source Type:			
Site Name: NE of Intersection<UNOFFICIAL>					
Site County/District:					
Site Geo Ref Meth:					
Incident Summary: Thomas Cabanagh Construction: 1 L hydraulic oil to standing water, clnd					
Contaminant Qty: 1 L					
64	1 of 1	NE/20.8	60.3 / -2.72	99 Parkdale Avenue Ottawa ON K1Y 1E6	EHS
Order No: 20191002099		Nearest Intersection:			
Status: C		Municipality:			
Report Type: Standard Report		Client Prov/State: ON			
Report Date: 07-OCT-19		Search Radius (km): .25			
Date Received: 02-OCT-19		X: -75.733899			
Previous Site Name:		Y: 45.408985			
Lot/Building Size:					
Additional Info Ordered:					
65	1 of 1	SSE/21.5	63.9 / 0.85	SCOTTS & CAROLINE AVENUE Ottawa ON	WWIS
Well ID: 7253089		Data Entry Status:			
Construction Date:		Data Src:			
Primary Water Use:		Date Received: 11/27/2015			
Sec. Water Use:		Selected Flag: TRUE			
Final Well Status: Abandoned-Other		Abandonment Rec: Yes			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Type: Casing Material: Audit No: Z126056 Tag: Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy:			Contractor: 6894 Form Version: 7 Owner: Street Name: SCOTTS & CAROLINE AVENUE County: OTTAWA Municipality: NEPEAN TOWNSHIP Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:		
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/725\7253089.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2015/09/16			
Year Completed:		2015			
Depth (m):					
Latitude:		45.4030112192222			
Longitude:		-75.736192355401			
Path:		725\7253089.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1005820241		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone: 18	
Code OB:				East83: 442385.00	
Code OB Desc:				North83: 5027985.00	
Open Hole:				Org CS: UTM83	
Cluster Kind:				UTMRC: 4	
Date Completed:		16-Sep-2015 00:00:00		UTMRC Desc: margin of error : 30 m - 100 m	
Remarks:				Location Method: wwr	
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005842996			
Layer:		1			
Plug From:		0.0			
Plug To:		2.0899999141693115			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005842997			
Layer:		2			
Plug From:		0.0			
Plug To:		7.0			
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Method of Construction & Well Use</u>					
Method Construction ID:	1005842995				
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:	1005842989				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1005842993				
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:	inch				
Casing Depth UOM:	ft				
<u>Construction Record - Screen</u>					
Screen ID:	1005842994				
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:	ft				
Screen Diameter UOM:	inch				
Screen Diameter:					
<u>Water Details</u>					
Water ID:	1005842992				
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:	ft				
<u>Hole Diameter</u>					
Hole ID:	1005842991				
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM:	ft				
Hole Diameter UOM:	inch				
66	1 of 1	NE/22.3	60.9 / -2.12	101 Parkdale Avenue Ottawa ON K1Y 1E6	EHS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Order No: 20101223007 Status: C Report Type: Standard Report Report Date: 12/30/2010 Date Received: 12/23/2010 10:53:30 AM Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -75.733877 Y: 45.408983					
67	1 of 5	ENE/22.6	60.9 / -2.15	8609454 Canada Inc. 121 Parkdale Ave Ottawa ON K1J 7S6	ECA
Approval No: 0456-ATJM6R Approval Date: 2017-11-30 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS Business Name: 8609454 Canada Inc. Address: 121 Parkdale Ave Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/7476-ATET63-14.pdf PDF Site Location:					
MOE District: City: Longitude: Latitude: Geometry X: Geometry Y:					
67	2 of 5	ENE/22.6	60.9 / -2.15	121 Parkdale Ave Ottawa ON K1Y2M3	EHS
Order No: 20180406111 Status: C Report Type: Site Report Report Date: 09-APR-18 Date Received: 06-APR-18 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .001 X: -75.73346 Y: 45.408451					
67	3 of 5	ENE/22.6	60.9 / -2.15	Enbridge Gas Distribution Inc. 121 Parkdale Ave Ottawa ON	SPL
Ref No: 4742-B8USMA Site No: NA Incident Dt: 2019/01/28 Year: Incident Cause: Incident Event: Leak/Break Contaminant Code: 35 Contaminant Name: NATURAL GAS (METHANE) Contaminant Limit 1: Contam Limit Freq 1: n/a Contaminant UN No 1: 1075 Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: Air MOE Response: No Dt MOE Arvl on Scn:					
Discharger Report: Material Group: Health/Env Conseq: 2 - Minor Environment Client Type: Corporation Sector Type: Miscellaneous Communal Agency Involved: Nearest Watercourse: Site Address: 121 Parkdale Ave Site District Office: Ottawa Site Postal Code: Site Region: Eastern Site Municipality: Ottawa Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MOE Reported Dt: 2019/01/28 Dt Document Closed: 2019/03/08 Incident Reason: Operator/Human Error Site Name: commercial<UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: TSSA FSB: 4 inch plastic gas main IP dmge, ongoing Contaminant Qty: 0 n/a Site Map Datum: SAC Action Class: TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill Source Type: Pipeline/Components					
67	4 of 5	ENE/22.6	60.9 / -2.15	ENBRIDGE GAS INC 121 PARKDALE AVE,,OTTAWA,ON,K1Y 1E6,CA ON	PINC
Incident Id: Incident No: 2492780 Incident Reported Dt: 1/29/2019 Type: FS-Pipeline Incident Status Code: Tank Status: Pipeline Damage Reason Est Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Depth: Customer Acct Name: ENBRIDGE GAS INC Incident Address: 121 PARKDALE AVE,,OTTAWA,ON,K1Y 1E6,CA Operation Type: Pipeline Type: Regulator Type: Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes: Pipe Material: Fuel Category: Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category: Regulator Location: Method Details:					
67	5 of 5	ENE/22.6	60.9 / -2.15	121 Parkdale Avenue Ottawa ON K1Y 1E6	EHS
Order No: 20321800156 Status: C Report Type: Standard Report Report Date: 23-DEC-20 Date Received: 18-DEC-20 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory; Aerial Photos Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.733527 Y: 45.4084156					
68	1 of 1	ESE/23.4	61.9 / -1.15	1565 Scott Street Ottawa ON	SPL
Ref No: 7863-AWMQ4K Site No: NA Incident Dt: 2018/03/07 Year: Incident Cause: Incident Event: Leak/Break Discharger Report: Material Group: Health/Env Conseq: 2 - Minor Environment Client Type: Sector Type: Miscellaneous Industrial Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Code: 13 Contaminant Name: DIESEL FUEL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: 1202 Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: Land MOE Response: No Dt MOE Arvl on Scn: MOE Reported Dt: 2018/03/07 Dt Document Closed: Incident Reason: Operator/Human Error Site Name: OLRT Tunney's Pasture Station<UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: OLRT Constructors: 5 L diesel to ground, cleaning 5 L Contaminant Qty: Nearest Watercourse: Site Address: 1565 Scott Street Site District Office: Ottawa Site Postal Code: Site Region: Eastern Site Municipality: Ottawa Site Lot: Site Conc: Northing: 5028193.14 Easting: 442734.6 Site Geo Ref Accu: Site Map Datum: SAC Action Class: Land Spills Source Type: Motor Vehicle					
69	1 of 1	NE/24.3	60.9 / -2.12	Les Constructions Brigil Inc. 99 Parkdale Avenue Ottawa, ON K1Y1E6 Canada ON	PTTW
EBR Registry No: 019-1562 Ministry Ref No: 4262-BM5RYU Notice Type: Instrument Notice Stage: Proposal\sUpdated Notice Date: Proposal Date: April\s6,\s2020 Year: 2020 Instrument Type: Permit\sto\stake\swater Off Instrument Name: Permit\sto\stake\swater\s(OWRA\ss.\s34) Posted By: Ministry\sof\sthe\sEnvironment,\sConservation\sand\sParks Company Name: Site Address: 99\sParkdale\sAvenue\sOttawa,\sON\sK1Y1E6\sCanada Location Other: Proponent Name: Les\sConstructions\sBrigil\sInc. Proponent Address: Les\sConstructions\sBrigil\sInc.\s98\sLois\sStreet\sGatineau,\sQC\sJ8Y\s3R7\sCanada Comment Period: April\s6,\s2020\s-\sMay\s6,\s2020\s(30\sdays)\sClosed URL: https://ero.ontario.ca/notice/019-1562 Site Location Details: Decision Posted: Exception Posted: Section: Section\s34 Act 1: Ontario\sWater\sResources\sAct,\sR.S.O.\s1990 Act 2: Ontario\sWater\sResources\sAct Site Location Map: 45.40898,-75.73398					
70	1 of 1	SSW/25.6	64.9 / 1.85	ON	BORE
Borehole ID: 613096 OGF ID: 215514400 Status: Type: Borehole Use: Completion Date: JUL-1972 Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: 15.3 Depth Ref: Ground Surface Depth Elev: Drill Method: Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 45.401158 Longitude DD: -75.74044 UTM Zone: 18 Easting: 442051 Northing: 5027782					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D: Survey D: Comments:	73.4 60.9			Location Accuracy: Accuracy:	Not Applicable
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218393695 4.6 5 Sand Gravel SAND. DENSE.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Dense
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218393699 12.3 15.3 Bedrock Limestone BEDROCK. 00000 012 00025 011 00075 008 00100 012 00150 012 00165 010 00250 **Note: Many records provided by the department have a truncated [Stratum Description] field.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218393692 .8 2.3 Sand Silt Gravel SAND. DENSE.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Dense
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218393694 3 4.6 Sand Silt Gravel SAND. DENSE.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Dense
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218393697 7.6 10.7 Sand Silt Gravel SAND. DENSE.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Dense

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218393693 2.3 3 Sand Silt Gravel SAND. VERY DENSE.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Dense
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218393698 10.7 12.3 Bedrock Limestone BEDROCK.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218393696 5 7.6 Sand Gravel Silt SAND. VERY DENSE.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Dense
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218393691 0 .8 Sand Silt SAND. VERY LOOSE.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Loose
<u>Source</u>					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 H Urban Geology Automated Information System (UGAIS) File: OTTAWA2.txt RecordID: 056040 NTS_Sheet: 31G05G Logged by professional. Exact and complete description of material and properties.			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
<u>Source List</u>					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
71	1 of 1	ESE/26.4	61.9 / -1.15	OC TRANSP OC TRANSIT WAY, AT SCOTT & HOLLAND STREETS, TUNNEY'S PASTURE MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON	SPL
Ref No: 224577 Site No: Incident Dt: 5/2/2002 Year: Incident Cause: OTHER CONTAINER LEAK Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: POSSIBLE Nature of Impact: Water course or lake Receiving Medium: LAND / WATER Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 5/2/2002 Dt Document Closed: Incident Reason: UNKNOWN Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: OC TRANSP: UNK SMALL QTYDIESEL TO ROAD,C-BASIN. TO PUMP OUT. Contaminant Qty: Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: 20107 Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:					
72	1 of 1	ESE/26.4	61.9 / -1.15	R.W. Tomlinson Limited Scott St. at Holland Ave Ottawa ON	SPL
Ref No: 2052-A9VK8Z Site No: NA Incident Dt: 2016/05/12 Year: Incident Cause: Incident Event: Leak/Break Contaminant Code: 15 Contaminant Name: HYDRAULIC OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: Land MOE Response: No Dt MOE Arvl on Scn: MOE Reported Dt: 2016/05/12 Dt Document Closed: Incident Reason: Equipment Failure Site Name: Tunny's Pasture<UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: R.W. Tomlinson: 5L hydraulic oil to ground - Cleaning Contaminant Qty: 5 L Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Miscellaneous Industrial Agency Involved: Nearest Watercourse: Site Address: Scott St. at Holland Ave Site District Office: Site Postal Code: Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Northing: 5028206 Easting: 442207 Site Geo Ref Accu: Map Site Map Datum: SAC Action Class: Land Spills Source Type:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
73	1 of 1	ESE/26.7	61.9 / -1.15	Ottawa ON	SPL
Ref No:	3433-B64Q6K			Discharger Report:	
Site No:	NA			Material Group:	
Incident Dt:	2018/11/01			Health/Env Conseq:	2 - Minor Environment
Year:				Client Type:	
Incident Cause:				Sector Type:	Unknown / N/A
Incident Event:	Collision/Accident			Agency Involved:	
Contaminant Code:	27			Nearest Watercourse:	
Contaminant Name:	COOLANT N.O.S.			Site Address:	
Contaminant Limit 1:				Site District Office:	Ottawa
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:	n/a			Site Region:	Eastern
Environment Impact:				Site Municipality:	Ottawa
Nature of Impact:				Site Lot:	
Receiving Medium:				Site Conc:	
Receiving Env:	Land; Surface Water			Northing:	5028064.71
MOE Response:	No			Easting:	442529.82
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:	2018/11/01			Site Map Datum:	
Dt Document Closed:	2018/12/28			SAC Action Class:	Primary Assessment of Spills
Incident Reason:	Unknown / N/A			Source Type:	Motor Vehicle
Site Name:	Scott and Holland<UNOFFICIAL>				
Site County/District:					
Site Geo Ref Meth:					
Incident Summary:	City of Ottawa: MVA at Scott and Holland, CB impacted				
Contaminant Qty:	0 other - see incident description				
74	1 of 1	ESE/26.8	61.9 / -1.15	1560 Scott Street Ottawa ON K1Y 2N5	EHS
Order No:	20200318178			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	23-MAR-20			Search Radius (km):	.25
Date Received:	18-MAR-20			X:	-75.732785
Previous Site Name:				Y:	45.404407
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans				
75	1 of 1	ENE/27.5	60.9 / -2.15	Richcraft (Parkdale) Ltd. 159, 163 and 167 Parkdale Avenue Ottawa, ON Canada ON	PTTW
EBR Registry No:	019-3909			Decision Posted:	September\29,\2021
Ministry Ref No:	8615-C3ZPT8			Exception Posted:	
Notice Type:	Instrument			Section:	Section\34
Notice Stage:	Decision			Act 1:	Ontario\Water\Resources\Act,\sR.S.O.\s1990
Notice Date:				Act 2:	Ontario\Water\Resources\Act
Proposal Date:	June\24,\2021			Site Location Map:	45.407192,-75.732729
Year:	2021				
Instrument Type:	Permit\sto\stake\water				
Off Instrument Name:	Permit\sto\stake\Water\s(OWRA\ss.\s34)				
Posted By:	Ministry\sof\sthe\Environment,\sConservation\sand\sParks				
Company Name:					
Site Address:	159,\s163\sand\s167\sParkdale\sAvenue\sOttawa,\sON\sCanada				
Location Other:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Proponent Name: Proponent Address: Comment Period: URL:		Richcraft\ (Parkdale)\ Ltd. Richcraft\ (Parkdale)\ Ltd.\ s2280\ sSt.\ sLaurent\ sBoulevard\ sSuite\ s201\ sOttawa,\ sON\ sK1G\ s4K1\ sCanada June\ s24,\ s2021\ s- \ sJuly\ s24,\ s2021\ s(30\ sdays)\ sClosed https://ero.ontario.ca/notice/019-3909			
Site Location Details:					
76	1 of 1	ESE/27.5	61.9 / -1.15	Ottawa ON	SPL
Ref No: Site No: Incident Dt: Year: Incident Cause: Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Incident Reason: Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: Contaminant Qty:		Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:			
6168-AV8ME3 NA 2018/01/19 Leak/Break 15 HYDRAULIC OIL n/a Land No 2018/01/21 Equipment Failure Holland Avenue and Scott Street<UNOFFICIAL> OLRT: 15 L hydraulic oil to snow, cleaned, Late Reporting 15 L		2 - Minor Environment Miscellaneous Industrial Ottawa Eastern Ottawa 5028064.62 442531.24 Land Spills Valve/Fitting/Piping			
77	1 of 1	ENE/28.0	60.9 / -2.15	139 Parkdale Avenue Ottawa ON K1Y 1E7	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:			
21032600420 C Standard Report 31-MAR-21 26-MAR-21 		ON .25 -75.733102 45.4078387			
78	1 of 1	ENE/28.9	60.9 / -2.15	Richcraft (Parkdale) Ltd. ON	ECA
Approval No: Approval Date: Status: Record Type: Link Source: SWP Area Name: Approval Type:		MOE District: City: Longitude: Latitude: Geometry X: Geometry Y:			
0515-C73RPU 2021-09-28 Issued PTTW IDS Rideau Valley PTTW		Ottawa 45.40703988 -75.73260276 -8430514.7752999999 5685830.8299999982			

270 erisinfo.com | Environmental Risk Information Services Order No: 22062900235

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Additional Info Ordered:		Title Searches; Aerial Photos			
81	1 of 1	WSW/31.6	62.3 / -0.69	203 Northwestern Ave Ottawa ON K1Y0M1	EHS
Order No: 20151110075 Status: C Report Type: Standard Report Report Date: 17-NOV-15 Date Received: 10-NOV-15 Previous Site Name: Lot/Building Size: 0.16 acres Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.742263 Y: 45.40314			
82	1 of 1	ENE/33.5	60.9 / -2.15	131 Parkdale Ave Ottawa ON K1Y1E7	EHS
Order No: 20150130072 Status: C Report Type: Custom Report Report Date: 05-FEB-15 Date Received: 30-JAN-15 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.733185 Y: 45.408101			
83	1 of 2	W/34.1	60.9 / -2.15	PIPELINE HIT 1/2" 155 NORTHWESTERN AVE,,OTTAWA,ON,K1Y 0M1,CA ON	PINC
Incident Id: Incident No: 1302900 Incident Reported Dt: 12/18/2013 Type: FS-Pipeline Incident Status Code: Tank Status: Non Mandated Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Depth: Customer Acct Name: Incident Address: Operation Type: Pipeline Type: Regulator Type: Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes:		Pipe Material: Fuel Category: Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category: Regulator Location: Method Details:			
83	2 of 2	W/34.1	60.9 / -2.15	PIPELINE HIT - 1/2" 155 NORTHWESTERN AVE,,OTTAWA,ON,K1Y 0M1,CA	PINC

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
ON					
Incident Id: Incident No: 1408704 Incident Reported Dt: 6/3/2014 Type: FS-Pipeline Incident Status Code: Tank Status: Non Mandated Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Depth: Customer Acct Name: PIPELINE HIT - 1/2" Incident Address: 155 NORTHWESTERN AVE., OTTAWA, ON, K1Y 0M1, CA Operation Type: Pipeline Type: Regulator Type: Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes:			Pipe Material: Fuel Category: Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category: Regulator Location: Method Details:		
84	1 of 1	ENE/34.1	60.9 / -2.15	RICHCRAFT (PARKDALE) LTD. 163 Parkdale Avenue Ottawa ON K1Y 1E7	EASR
Approval No: R-009-1113288182 Status: REGISTERED Date: 2021-06-24 Record Type: EASR Link Source: MOFA Project Type: Water Taking - Construction Dewatering Full Address: Approval Type: EASR-Water Taking - Construction Dewatering SWP Area Name: Rideau Valley PDF URL: PDF Site Location:			MOE District: Ottawa Municipality: Ottawa Latitude: 45.40694444 Longitude: -75.73277778 Geometry X: -8430534.2586 Geometry Y: 5685815.698399996		
85	1 of 1	SW/34.8	63.9 / 0.85	ON	BORE
Borehole ID: 613100 OGF ID: 215514404 Status: Type: Borehole Use: Completion Date: JAN-1964 Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: 3.8 Depth Ref: Ground Surface Depth Elev: Drill Method: Orig Ground Elev m: 63.5 Elev Reliabil Note: DEM Ground Elev m: 63.1			Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 45.401871 Longitude DD: -75.7416 UTM Zone: 18 Easting: 441961 Northing: 5027862 Location Accuracy: Accuracy: Not Applicable		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Concession: Location D: Survey D: Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218393714 Top Depth: 0 Bottom Depth: 1.3 Material Color: Material 1: Material 2: Bedrock Material 3: Clay Material 4: Silt Gsc Material Description: Stratum Description: ARTIFICIAL.					
Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Geology Stratum ID: 218393715 Top Depth: 1.3 Bottom Depth: 2.3 Material Color: Material 1: Bedrock Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description: BEDROCK.					
Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Geology Stratum ID: 218393716 Top Depth: 2.3 Bottom Depth: 3.8 Material Color: Material 1: Bedrock Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description: BEDROCK. K. ENSE. SAND-FINE. LOOSE. UNSPECIFIED. LOOSE. UNSPECIFIED. DENSE. 000250 **Note: Many records provided by the department have a truncated [Stratum Description] field.					
Mat Consistency: Dense Material Moisture: Material Texture: Fine Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
<u>Source</u>					
Source Type: Data Survey Source Orig: Geological Survey of Canada Source Date: 1956-1972 Confidence: H Observatio: Source Name: Urban Geology Automated Information System (UGAIS) Source Details: File: OTTAWA2.txt RecordID: 056080 NTS_Sheet: 31G05G Confiden 1: Logged by professional. Exact and complete description of material and properties.					
Source Appl: Spatial/Tabular Source Iden: 1 Scale or Res: Varies Horizontal: NAD27 Verticalda: Mean Average Sea Level					
<u>Source List</u>					
Source Identifier: 1 Source Type: Data Survey Source Date: 1956-1972 Scale or Resolution: Varies Source Name: Urban Geology Automated Information System (UGAIS) Source Originators: Geological Survey of Canada					
Horizontal Datum: NAD27 Vertical Datum: Mean Average Sea Level Projection Name: Universal Transverse Mercator					
86	1 of 1	NE/37.5	60.9 / -2.15	Ottawa	EHS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Ottawa ON					
Order No:	20191015030			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	17-OCT-19			Search Radius (km):	.25
Date Received:	15-OCT-19			X:	-75.733586
Previous Site Name:				Y:	45.408852
Lot/Building Size:					
Additional Info Ordered:					
87	1 of 2	W/40.1	60.9 / -2.15	Enbridge Energy Distribution Inc. 153 Northwestern Avenue Ottawa ON	SPL
Ref No:	4407-BHTNCL			Discharger Report:	
Site No:	NA			Material Group:	
Incident Dt:	11/11/2019			Health/Env Conseq:	4 - Medium Environment
Year:				Client Type:	Corporation
Incident Cause:				Sector Type:	Miscellaneous Industrial
Incident Event:	Operator/Human error			Agency Involved:	
Contaminant Code:	35			Nearest Watercourse:	
Contaminant Name:	NATURAL GAS (METHANE)			Site Address:	153 Northwestern Avenue
Contaminant Limit 1:				Site District Office:	Ottawa
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:	1075			Site Region:	Eastern
Environment Impact:				Site Municipality:	Ottawa
Nature of Impact:				Site Lot:	
Receiving Medium:				Site Conc:	
Receiving Env:	Air			Northing:	
MOE Response:	No			Easting:	
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:	11/11/2019			Site Map Datum:	
Dt Document Closed:				SAC Action Class:	Air Spills - Gases and Vapours
Incident Reason:	Operator/Human Error			Source Type:	Pipeline/Components
Site Name:	1/2" plastic IP residential service line damaged<UNOFFICIAL>				
Site County/District:					
Site Geo Ref Meth:					
Incident Summary:	TSSAfsb: Enbridge - 1/2" plstc IP res srvc line dmgd. Northwestern Ave.				
Contaminant Qty:	1 n/a				
87	2 of 2	W/40.1	60.9 / -2.15	ENBRIDGE GAS INC 153 NORTHWESTERN AVE.,OTTAWA,ON,K1Y 0M1,CA ON	PINC
Incident Id:				Pipe Material:	
Incident No:	2717504			Fuel Category:	
Incident Reported Dt:	11/11/2019			Health Impact:	
Type:	FS-Pipeline Incident			Environment Impact:	
Status Code:				Property Damage:	
Tank Status:	Pipeline Damage Reason Est			Service Interrupt:	
Task No:				Enforce Policy:	
Spills Action Centre:				Public Relation:	
Fuel Type:				Pipeline System:	
Fuel Occurrence Tp:				PSIG:	
Date of Occurrence:				Attribute Category:	
Occurrence Start Dt:				Regulator Location:	
Depth:				Method Details:	
Customer Acct Name:	ENBRIDGE GAS INC				
Incident Address:	153 NORTHWESTERN AVE.,OTTAWA,ON,K1Y 0M1,CA				
Operation Type:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pipeline Type: Regulator Type: Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes:					
88	1 of 1	SE/41.8	61.9 / -1.15	2 Holland Ave Ottawa ON K1Y0X4	EHS
Order No: 20170601051 Status: C Report Type: Standard Report Report Date: 06-JUN-17 Date Received: 01-JUN-17 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.734482 Y: 45.403526					
89	1 of 1	ENE/43.1	60.9 / -2.15	111 PARKDALE AVENUE 121 Ottawa ON	WWIS
Well ID: 7205866 Construction Date: Primary Water Use: Monitoring Sec. Water Use: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z171309 Tag: A147953 Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy:					
Data Entry Status: Data Src: Date Received: 8/6/2013 Selected Flag: TRUE Abandonment Rec: Contractor: 7328 Form Version: 7 Owner: Street Name: 111 PARKDALE AVENUE 121 County: OTTAWA Municipality: OTTAWA CITY Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/720\7205866.pdf					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 2012/03/12 Year Completed: 2012 Depth (m): 18.44 Latitude: 45.4085295385347 Longitude: -75.7333120821073 Path: 720\7205866.pdf					
<u>Bore Hole Information</u>					
Bore Hole ID: 1004490019 DP2BR: Spatial Status:					
Elevation: Elevrc: Zone: 18					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB:				East83:	442616.00
Code OB Desc:				North83:	5028596.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	12-Mar-2012 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004918951			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		05			
Mat3 Desc:		CLAY			
Formation Top Depth:		0.6000000238418579			
Formation End Depth:		1.190000057220459			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004918952			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		26			
Most Common Material:		ROCK			
Mat2:		15			
Mat2 Desc:		LIMESTONE			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		1.190000057220459			
Formation End Depth:		18.440000534057617			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004918950			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		84			
Mat3 Desc:		SILTY			
Formation Top Depth:		0.0			
Formation End Depth:		0.6000000238418579			
Formation End Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004918960			
Layer:		1			
Plug From:		0.4000000059604645			
Plug To:		14.899999618530273			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004918959			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		HSA, DIAMOND			
<u>Pipe Information</u>					
Pipe ID:		1004918949			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004918956			
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1004918957			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1004918955			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole ID: 1004918954 Diameter: 7.619999885559082 Depth From: 1.190000057220459 Depth To: 18.440000534057617 Hole Depth UOM: m Hole Diameter UOM: cm					
<u>Hole Diameter</u>					
Hole ID: 1004918953 Diameter: 20.2999999237060547 Depth From: 0.0 Depth To: 1.190000057220459 Hole Depth UOM: m Hole Diameter UOM: cm					
90	1 of 1	NE/44.4	60.9 / -2.13	99-107 Parkdale Avenue (odd numbers only) Ottawa ON	EHS
Order No: 20111121018 Status: C Report Type: Custom Report Report Date: 11/28/2011 Date Received: 11/21/2011 12:28:47 PM Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -75.733773 Y: 45.40888					
91	1 of 4	ESE/52.4	61.9 / -1.15	1546 Scott Street Ottawa ON K1Y 4S8	EHS
Order No: 20191101089 Status: C Report Type: Standard Express Report Report Date: 01-NOV-19 Date Received: 01-NOV-19 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.7327909 Y: 45.4041345					
91	2 of 4	ESE/52.4	61.9 / -1.15	1546 Scott Street Ottawa ON K1Y 4S8	EHS
Order No: 20191206004 Status: C Report Type: Standard Report Report Date: 13-DEC-19 Date Received: 06-DEC-19 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.7327909 Y: 45.4041345					
91	3 of 4	ESE/52.4	61.9 / -1.15	1546 Scott Street Ottawa ON K1Y 4S8	EHS
Order No: 20200814071 Status: C Report Type: Standard Report Report Date: 19-AUG-20					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Date Received: 14-AUG-20 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
X: -75.7327909 Y: 45.4041345					
91	4 of 4	ESE/52.4	61.9 / -1.15	1546 Scott Street Ottawa ON K1Y 4S8	EHS
Order No: 21090100054 Status: C Report Type: Standard Report Report Date: 07-SEP-21 Date Received: 01-SEP-21 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory; Aerial Photos					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.7327909 Y: 45.4041345					
92	1 of 1	SE/53.4	61.9 / -1.15	Westrade Construction Ltd. 4 Holland Ave Unit 1B Ottawa ON K1Y 0X4	SCT
Established: 01-AUG-85 Plant Size (ft²): Employment:					
--Details--					
Description: Industrial Building and Structure Construction SIC/NAICS Code: 236210					
Description: Residential Building Construction SIC/NAICS Code: 236110					
Description: Site Preparation Contractors SIC/NAICS Code: 238910					
Description: Other Millwork SIC/NAICS Code: 321919					
Description: Commercial and Institutional Building Construction SIC/NAICS Code: 236220					
Description: Engineering Services SIC/NAICS Code: 541330					
93	1 of 1	ESE/54.7	61.9 / -1.15	ON	WWIS
Well ID: 7358345 Construction Date: Primary Water Use: Sec. Water Use: Final Well Status: Water Type: Casing Material: Audit No: Z333452 Tag: A282466 Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock:					
Data Entry Status: Yes Data Src: Date Received: 5/20/2020 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: Street Name: County: OTTAWA Municipality: NEPEAN TOWNSHIP Site Info: Lot:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy:			Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:		
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:		2020/02/24			
Year Completed:		2020			
Depth (m):					
Latitude:		45.4041955390329			
Longitude:		-75.7325915459949			
Path:					
Bore Hole Information					
Bore Hole ID:		1008282672		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		24-Feb-2020 00:00:00		UTMRC Desc:	
Remarks:				Location Method:	
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
94	1 of 1	S/54.8	64.9 / 1.85	KIEWIT/EUROVIA/VINCI OTTAWA PARTNERSHIP ON	EASR
Approval No:		R-009-1112397253		MOE District:	
Status:		REGISTERED		Municipality:	
Date:		2020-07-10		Latitude:	
Record Type:		EASR		Longitude:	
Link Source:		MOFA		Geometry X:	
Project Type:		Water Taking - Construction Dewatering		Geometry Y:	
Full Address:					
Approval Type:		EASR-Water Taking - Construction Dewatering			
SWP Area Name:		Rideau Valley			
PDF URL:					
PDF Site Location:					
95	1 of 1	SW/57.2	63.9 / 0.88	The Ottawa Muslim Association 251 NorthWestern Avenue Ottawa ON K1Y0M1	GEN
Generator No:		ON8195884		Status:	
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:		As of Feb 2022		Phone No Admin:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No: Country:		Canada		Contam. Facility: MHSW Facility:	
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:		312 P Pathological wastes			
96	1 of 1	E/57.3	61.9 / -1.15	255 Parkdale Avenue Ottawa ON K1Y 1G1	EHS
Order No:		21031100125		Nearest Intersection:	
Status:		C		Municipality:	Ottawa
Report Type:		Standard Select Report		Client Prov/State:	ON
Report Date:		16-MAR-21		Search Radius (km):	.25
Date Received:		11-MAR-21		X:	-75.731157
Previous Site Name:				Y:	45.4049117
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans; Title Searches; Topographic Maps; City Directory			
97	1 of 1	NE/62.9	58.2 / -4.81	OTTAWA & DIST ASSOC FOR THE MENTALLY RETARDED 55 PARKDALE AVENUE NORTH OTTAWA ON K2H 8H8	PES
Detail Licence No:				Operator Box:	
Licence No:				Operator Class:	
Status:				Operator No:	
Approval Date:				Operator Type:	
Report Source:				Oper Area Code:	
Licence Type:		Operator		Oper Phone No:	
Licence Type Code:				Operator Ext:	
Licence Class:				Operator Lot:	
Licence Control:				Oper Concession:	
Latitude:				Operator Region:	
Longitude:				Operator District:	
Lot:				Operator County:	
Concession:				Op Municipality:	
Region:				Post Office Box:	
District:				MOE District:	
County:				SWP Area Name:	
Trade Name:					
PDF URL:					
PDF Site Location:					
98	1 of 2	ESE/68.6	61.9 / -1.15	CAPITAL CITY RUSTPROOFING LIMITED 1536 SCOTT STREET OTTAWA ON K1Y 2N5	GEN
Generator No:		ON1364300		Status:	
SIC Code:		6359		Co Admin:	
SIC Description:		OTHER VEH. REPAIR		Choice of Contact:	
Approval Years:		90		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
98	2 of 2	ESE/68.6	61.9 / -1.15	CAPITAL CITY (OUT OF BUSINESS) 08-793 1536 SCOTT STREET OTTAWA ON K1Y 2N5	GEN
Generator No: ON1364300				Status:	
SIC Code: 6359				Co Admin:	
SIC Description: OTHER VEH. REPAIR				Choice of Contact:	
Approval Years: 92,93,94,95,96,97,98				Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
99	1 of 3	E/68.7	60.9 / -2.15	FRANK & SONS PAINTING & DECORATING LTD. 184 FORWARD AVENUE OTTAWA ON K1Y 1L2	GEN
Generator No: ON2361400				Status:	
SIC Code: 4275				Co Admin:	
SIC Description: PAINT. & DECOR. WORK				Choice of Contact:	
Approval Years: 98,99,00,01,02,03,04,06,07,08				Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		211			
Waste Class Desc:		AROMATIC SOLVENTS			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
99	2 of 3	E/68.7	60.9 / -2.15	FRANK & SONS PAINTING & DECORATING LTD. 184 FORWARD AVENUE OTTAWA ON K1Y 1L2	GEN
Generator No: ON2361400				Status:	
SIC Code: 238320				Co Admin:	
SIC Description: Painting and Wall Covering Contractors				Choice of Contact:	
Approval Years: 2009				Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
99	3 of 3	E/68.7	60.9 / -2.15	FRANK & SONS PAINTING & DECORATING LTD. 184 FORWARD AVENUE OTTAWA ON K1Y 1L2	GEN
Generator No: ON2361400				Status:	
SIC Code: 238320				Co Admin:	
SIC Description: Painting and Wall Covering Contractors				Choice of Contact:	
Approval Years: 2010				Phone No Admin:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No: Country:			Contam. Facility: MHSW Facility:		
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
100	1 of 1	E/69.3	60.9 / -2.15	192 Forward Ave Ottawa ON K1Y1E8	EHS
Order No:		20141021028		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State: ON	
Report Date:		27-OCT-14		Search Radius (km): .25	
Date Received:		21-OCT-14		X: -75.731656	
Previous Site Name:				Y: 45.406406	
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans			
101	1 of 1	NE/74.5	59.8 / -3.18	CCC384 44 EMMERSON AVE OTTAWA ON K1Y 2L8	GEN
Generator No:		ON9041525		Status:	
SIC Code:		531310		Co Admin:	
SIC Description:		Real Estate Property Managers		Choice of Contact:	
Approval Years:		05		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
102	1 of 1	E/75.2	61.9 / -1.15	PRIVATE OWNER 259 PARKDALE AVE. STORAGE TANK/BARREL OTTAWA CITY ON K1Y 1G1	SPL
Ref No:		137918		Discharger Report:	
Site No:				Material Group:	
Incident Dt:		//		Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:		UNKNOWN		Sector Type:	
Incident Event:				Agency Involved:	
Contaminant Code:				Nearest Watercourse:	
Contaminant Name:				Site Address:	
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:		POSSIBLE		Site Municipality: 20101	
Nature of Impact:		Soil contamination		Site Lot:	
Receiving Medium:		LAND		Site Conc:	
Receiving Env:				Northing:	
MOE Response:				Easting:	
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:		3/4/1997		Site Map Datum:	
Dt Document Closed:				SAC Action Class:	
Incident Reason:		UNKNOWN		Source Type:	
Site Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site County/District: Site Geo Ref Meth: Incident Summary: PRIVATE OWNER-9 L FURNACE OIL TO ASPHALT AT RENTED HOUSE, OWNER WILL CLEAN. Contaminant Qty:					
103	1 of 1	ESE/78.2	61.9 / -1.15	ON	WWIS
Well ID: 7358344 Construction Date: Primary Water Use: Sec. Water Use: Final Well Status: Water Type: Casing Material: Audit No: Z333453 Tag: A282467 Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy: Data Entry Status: Yes Data Src: Date Received: 5/20/2020 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: Street Name: County: OTTAWA Municipality: NEPEAN TOWNSHIP Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 2020/02/24 Year Completed: 2020 Depth (m): Latitude: 45.4040256757546 Longitude: -75.7324104580424 Path:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1008282669 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 24-Feb-2020 00:00:00 Remarks: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Elevation: Elevrc: Zone: 18 East83: 442682.00 North83: 5028095.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
104	1 of 2	SSW/79.5	64.9 / 1.85	1748 Scott St Ottawa ON	SPL
Ref No: 4285-BH8JUR Discharger Report:					

285 erisinfo.com | Environmental Risk Information Services Order No: 22062900235

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Year: Incident Cause: Incident Event: Contaminant Code: 27 Contaminant Name: CONCRETE Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: MOE Response: No Dt MOE Arvl on Scn: MOE Reported Dt: 11/9/2015 Dt Document Closed: Incident Reason: Deliberate Act Site Name: Construction Site <UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: OLRT: 2 L concrete washout to soil; cleaned Contaminant Qty: 2 L Client Type: Sector Type: Unknown / N/A Agency Involved: Nearest Watercourse: Site Address: 1446 Scott Street Site District Office: Site Postal Code: Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Northing: 5028214 Easting: 442796 Site Geo Ref Accu: Site Map Datum: SAC Action Class: Land Spills Source Type:					
105	2 of 2	E/85.1	61.2 / -1.84	Royal LePage 1446 Scott Street Ottawa ON K1Y 1L7	GEN
Generator No: ON9767871 SIC Code: SIC Description: Approval Years: As of Feb 2022 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 251 L Waste Class Desc: Waste oils/sludges (petroleum based)					
106	1 of 1	NNE/89.1	56.2 / -6.88	Sir John A Mcdonald Pkwy W and Parkdale Ottawa ON	SPL
Ref No: 3436-BDBMUW Site No: NA Incident Dt: 6/20/2019 Year: Incident Cause: Incident Event: Collision/Accident Contaminant Code: 15 Contaminant Name: OIL/GREASE Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: n/a Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: Land MOE Response: No Dt MOE Arvl on Scn: MOE Reported Dt: 6/20/2019 Dt Document Closed: Incident Reason: Operator/Human Error Discharger Report: Material Group: Health/Env Conseq: 2 - Minor Environment Client Type: Sector Type: Miscellaneous Communal Agency Involved: Nearest Watercourse: Site Address: Sir John A Mcdonald Pkwy W and Parkdale Site District Office: Ottawa Site Postal Code: Site Region: Eastern Site Municipality: Ottawa Site Lot: Site Conc: Northing: 5028881 Easting: 442460 Site Geo Ref Accu: Site Map Datum: SAC Action Class: Highway Spills (usually highway accidents) Source Type: Motor Vehicle					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: Contaminant Qty:		Spill/ accident site <UNOFFICIAL> NCC: Motor vehicle accident; 10L rad fluid to grnd,c nted 10 L			
107	1 of 1	E/90.2	60.9 / -2.15	City of Ottawa Forward Avenue, Lyndale Avenue and Hinchey Avenue Ottawa ON K1N 5A1	ECA
Approval No: Approval Date: Status: Record Type: Link Source: SWP Area Name: Approval Type: Project Type: Business Name: Address: Full Address: Full PDF Link: PDF Site Location:		8746-4WDR47 2001-05-04 Approved ECA IDS Rideau Valley ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS MUNICIPAL AND PRIVATE SEWAGE WORKS City of Ottawa Forward Avenue, Lyndale Avenue and Hinchey Avenue https://www.accessenvironment.ene.gov.on.ca/instruments/7782-4WBQ6E-14.pdf			
MOE District: City: Longitude: Latitude: Geometry X: Geometry Y:		Ottawa Ottawa -75.7326 45.4089 			
108	1 of 1	E/90.7	61.2 / -1.84	OTTAWA CITY PINEHURST AVE./SCOTT ST. OTTAWA ON	CA
Certificate #: Application Year: Issue Date: Approval Type: Status: Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:		3-0654-98- 98 5/29/1998 Municipal sewage Approved 			
109	1 of 1	SW/95.5	63.0 / -0.07	234 Northwestern Ave Ottawa ON K1Y 0M3	SPL
Ref No: Site No: Incident Dt: Year: Incident Cause: Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium:		8587-5KAN28 3/2/2003 Pipe Or Hose Leak 13 FURNACE OIL Possible Soil Contamination Land			
Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: Site Lot: Site Conc:		Oil Ottawa Eastern Ottawa 			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 3/3/2003 Dt Document Closed: Incident Reason: Unknown - Reason not determined Site Name: PRIVATE RESIDENCE - FURNACE OIL TANK LINE<UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: 750 L furnace oil to gnd under basement Contaminant Qty: 750 L Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:					
110	1 of 1	ESE/99.3	61.9 / -1.15	11 & 25 Holland Avenue and 1600 & 1620 Scott Street Ottawa ON	EHS
Order No: 20071004025 Status: C Report Type: CAN - Complete Report Report Date: 10/16/2007 Date Received: 10/4/2007 Previous Site Name: Lot/Building Size: Additional Info Ordered: Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): 0.25 X: -75.733008 Y: 45.403549					
111	1 of 1	E/99.3	60.9 / -2.15	187 Forward Avenue Ottawa ON K1Y 1L2	EHS
Order No: 20120416045 Status: C Report Type: Standard Report Report Date: 4/25/2012 4:24:17 PM Date Received: 4/16/2012 4:22:57 PM Previous Site Name: Lot/Building Size: 3,780sm Additional Info Ordered: Nearest Intersection: Municipality: Ottawa Client Prov/State: ON Search Radius (km): 0.25 X: -75.731084 Y: 45.406153					
112	1 of 1	W/99.4	59.8 / -3.21	18 PONTIAC STREET OTTAWA ON K1Y 2J9	HINC
External File Num: FS INC 0710-05609 Fuel Occurrence Type: Pipeline Strike Date of Occurrence: 9/27/2007 Fuel Type Involved: Natural Gas Status Desc: Completed - Causal Analysis(End) Job Type Desc: Incident/Near-Miss Occurrence (FS) Oper. Type Involved: Private Dwelling Service Interruptions: Yes Property Damage: No Fuel Life Cycle Stage: Utilization Root Cause: Root Cause: Equipment/Material/Component:No Procedures:No Maintenance:No Design:Yes Training:No Management:No Human Factors:Yes Reported Details: Fuel Category: Gaseous Fuel Occurrence Type: Incident Affiliation: Industry Stakeholder (Licensee/Registration/Certificate Holder, Facility Owner, etc.) County Name: Ottawa Approx. Quant. Rel: Nearby body of water: Enter Drainage Syst.:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approx. Quant. Unit: Environmental Impact:					
113	1 of 1	ESE/101.7	61.9 / -1.15	268-272 Parkdale Avenue Ottawa, ON ON K1Y 1E9	EHS
Order No:		20100610027		Nearest Intersection: Scott St. and Parkdale Ave.	
Status:		C		Municipality:	
Report Type:		Standard Select Report		Client Prov/State: ON	
Report Date:		6/14/2010		Search Radius (km): 0.25	
Date Received:		6/10/2010		X: -75.731356	
Previous Site Name:				Y: 45.404227	
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans			
114	1 of 6	ESE/102.4	61.9 / -1.15	iStudio Ottawa 11 Holland Ave Suite 715 Ottawa ON K1Y 4S1	SCT
Established:					
Plant Size (ft²):					
Employment:		14			
--Details--					
Description:		Software Publishers			
SIC/NAICS Code:		511210			
Description:		Computer Systems Design and Related Services			
SIC/NAICS Code:		541510			
114	2 of 6	ESE/102.4	61.9 / -1.15	COLONNADE DEVELOPMENTS INC. 11 HOLLAND AVENUE Ottawa ON K1Y 4S1	GEN
Generator No:		ON6555319		Status:	
SIC Code:		531310		Co Admin:	
SIC Description:		Real Estate Property Managers		Choice of Contact:	
Approval Years:		07,08		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
Detail(s)					
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		145			
Waste Class Desc:		PAINT/PIGMENT/COATING RESIDUES			
114	3 of 6	ESE/102.4	61.9 / -1.15	Hetz Medicine Professional Corporation 11 Holland Ave Suite 400 Ottawa ON K1Y 4S1	GEN
Generator No:		ON8143346		Status: Registered	
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:		As of Dec 2018		Phone No Admin:	
PO Box No:				Contam. Facility:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Country:		Canada		MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Desc:		Pathological wastes			
114	4 of 6	ESE/102.4	61.9 / -1.15	Hetz Medicine Professional Corporation 11 Holland Ave Suite 400 Ottawa ON K1Y 4S1	GEN
Generator No:		ON8143346		Status: Registered	
SIC Code:		Co Admin:			
SIC Description:		Choice of Contact:			
Approval Years:		As of Jul 2020		Phone No Admin:	
PO Box No:		Contam. Facility:			
Country:		Canada		MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Desc:		Pathological wastes			
114	5 of 6	ESE/102.4	61.9 / -1.15	ITF CJPT Real Estate No. 1 Trust 11 Holland Ave. Ottawa ON K1Y 4S1	GEN
Generator No:		ON6891340		Status: Registered	
SIC Code:		Co Admin:			
SIC Description:		Choice of Contact:			
Approval Years:		As of Oct 2019		Phone No Admin:	
PO Box No:		Contam. Facility:			
Country:		Canada		MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		145 I			
Waste Class Desc:		Wastes from the use of pigments, coatings and paints			
114	6 of 6	ESE/102.4	61.9 / -1.15	Hetz Medicine Professional Corporation 11 Holland Ave Suite 400 Ottawa ON K1Y 4S1	GEN
Generator No:		ON8143346		Status: Registered	
SIC Code:		Co Admin:			
SIC Description:		Choice of Contact:			
Approval Years:		As of Nov 2021		Phone No Admin:	
PO Box No:		Contam. Facility:			
Country:		Canada		MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Desc:		Pathological wastes			
115	1 of 1	ENE/104.1	60.9 / -2.15	159 Forward Avenue Ottawa ON K1Y 1K9	EHS
Order No:		20190321139		Nearest Intersection:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	26-MAR-19			Search Radius (km):	.25
Date Received:	21-MAR-19			X:	-75.731807
Previous Site Name:				Y:	45.407451
Lot/Building Size:					
Additional Info Ordered:	City Directory				

116	1 of 1	SW/105.1	62.8 / -0.21	ON	WWIS

Well ID:	1508589	Data Entry Status:	
Construction Date:		Data Src:	1
Primary Water Use:	Domestic	Date Received:	11/29/1949
Sec. Water Use:	0	Selected Flag:	TRUE
Final Well Status:	Water Supply	Abandonment Rec:	
Water Type:		Contractor:	4216
Casing Material:		Form Version:	1
Audit No:		Owner:	
Tag:		Street Name:	
Construction Method:		County:	OTTAWA
Elevation (m):		Municipality:	OTTAWA CITY
Elevation Reliability:		Site Info:	
Depth to Bedrock:		Lot:	
Well Depth:		Concession:	
Overburden/Bedrock:		Concession Name:	
Pump Rate:		Easting NAD83:	
Static Water Level:		Northing NAD83:	
Flowing (Y/N):		Zone:	
Flow Rate:		UTM Reliability:	
Clear/Cloudy:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1508589.pdf

Additional Detail(s) (Map)

Well Completed Date:	1949/09/30
Year Completed:	1949
Depth (m):	15.24
Latitude:	45.401504081052
Longitude:	-75.7423609038914
Path:	150\1508589.pdf

Bore Hole Information

Bore Hole ID:	10030623	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	441900.70
Code OB Desc:		North83:	5027822.00
Open Hole:		Org CS:	
Cluster Kind:		UTMRC:	9
Date Completed:	30-Sep-1949 00:00:00	UTMRC Desc:	unknown UTM
Remarks:		Location Method:	p9
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931010064			
Layer:		1			
Color:					
General Color:					
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		50.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		961508589			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10579193			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930053880			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		50.0			
Casing Diameter:		5.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930053879			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		8.0			
Casing Diameter:		5.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pump Test ID:		991508589			
Pump Set At:					
Static Level:		13.0			
Final Level After Pumping:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Recommended Pump Depth: Pumping Rate: Flowing Rate: Recommended Pump Rate: Levels UOM: ft Rate UOM: GPM Water State After Test Code: Water State After Test: Pumping Test Method: Pumping Duration HR: Pumping Duration MIN: Flowing: No					
<u>Water Details</u>					
Water ID: 933463158 Layer: 1 Kind Code: 5 Kind: Not stated Water Found Depth: 48.0 Water Found Depth UOM: ft					
117	1 of 6	ESE/106.0	61.9 / -1.15	ARISTOTEC GENERATOR SERVICES INC 13A BULLMAN ST. OTTAWA ON K1Y 2S2	GEN
Generator No: ON0869200 SIC Code: 9949 SIC Description: OTHER REPAIR SERV. Approval Years: 86,87 PO Box No: Country:					
Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 252 Waste Class Desc: WASTE OILS & LUBRICANTS					
117	2 of 6	ESE/106.0	61.9 / -1.15	ARISTOTEC (OUT OF BUSINESS) 13A BULLMAN ST. OTTAWA ON K1Y 2S2	GEN
Generator No: ON0869200 SIC Code: 9949 SIC Description: OTHER REPAIR SERV. Approval Years: 88,89,90 PO Box No: Country:					
Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 252 Waste Class Desc: WASTE OILS & LUBRICANTS					
117	3 of 6	ESE/106.0	61.9 / -1.15	ARISTOTEC (OUT OF BUSINESS) 03-269 13A BULLMAN ST. OTTAWA ON K1Y 2S2	GEN
Generator No: ON0869200 SIC Code: 9949 SIC Description: OTHER REPAIR SERV.					
Status: Co Admin: Choice of Contact:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Years: 92,93,94,95,96,97,98				Phone No Admin: Contam. Facility: MHSW Facility:	
PO Box No:					
Country:					
117	4 of 6	ESE/106.0	61.9 / -1.15	CARRIAGE HOUSE RESTORATION & ANTIQUES 13A BULLMAN OTTAWA ON K1Y 2S2	GEN
Generator No: ON2664200				Status:	
SIC Code: 2619				Co Admin:	
SIC Description: OTHER HOUSEHOLD FURN.				Choice of Contact:	
Approval Years: 01,02,03,04				Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class: 145					
Waste Class Desc: PAINT/PIGMENT/COATING RESIDUES					
117	5 of 6	ESE/106.0	61.9 / -1.15	2021694 13 bullman street ottawa ON K1Y 2S2	GEN
Generator No: ON9259687				Status:	
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years: 06				Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class: 145					
Waste Class Desc: PAINT/PIGMENT/COATING RESIDUES					
117	6 of 6	ESE/106.0	61.9 / -1.15	2021694 13 bullman street ottawa ON K1Y 2S2	GEN
Generator No: ON9259687				Status:	
SIC Code: 100000				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years: 2009				Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class: 145					
Waste Class Desc: PAINT/PIGMENT/COATING RESIDUES					
Waste Class: 213					
Waste Class Desc: PETROLEUM DISTILLATES					
118	1 of 1	ENE/108.2	61.9 / -1.15	133 Forward Avenue Ottawa ON K1Y 1K8	EHS
Order No: 21061700055				Nearest Intersection:	
Status: C				Municipality: Ottawa	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Report Type: Standard Report Report Date: 22-JUN-21 Date Received: 17-JUN-21 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory; Aerial Photos					
Client Prov/State: ON Search Radius (km): .25 X: -75.7322392 Y: 45.4082538					
119	1 of 2	SSW/108.9	65.9 / 2.85	Petro-Canada Fuels Inc. 36 Ross Street Ottawa ON K1Y 0N3	SPL
Ref No: 1807-7J7GW7 Site No: Incident Dt: Year: Incident Cause: Other Discharges Incident Event: Contaminant Code: 13 Contaminant Name: FURNACE OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Confirmed Nature of Impact: Other Impact(s) Receiving Medium: Receiving Env: MOE Response: No Field Response Dt MOE Arvl on Scn: MOE Reported Dt: 9/5/2008 Dt Document Closed: 9/9/2008 Incident Reason: Equipment Failure Site Name: Residence<UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: Petro Can Fuels, 2L Furnace oil,cln Contaminant Qty: 2 L					
Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Other Agency Involved: Nearest Watercourse: Site Address: Site District Office: Ottawa Site Postal Code: Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: TSSA - Fuel Safety Branch Source Type:					
119	2 of 2	SSW/108.9	65.9 / 2.85	36 ROSS AVENUE OTTAWA ON K1Y 0N3	HINC
External File Num: FS INC 0809-04962 Fuel Occurrence Type: Leak Date of Occurrence: 8/30/2008 Fuel Type Involved: Fuel Oil Status Desc: Completed - Causal Analysis(End) Job Type Desc: Incident/Near-Miss Occurrence (FS) Oper. Type Involved: Private Dwelling Service Interruptions: Yes Property Damage: No Fuel Life Cycle Stage: Utilization Root Cause: Root Cause: Equipment/Material/Component:Yes Procedures:No Maintenance:No Design:Yes Training:No Management:No Human Factors:No Reported Details: Fuel Category: Liquid Fuel Occurrence Type: Incident Affiliation: Industry Stakeholder (Licensee/Registration/Certificate Holder, Facility Owner, etc.) County Name: Ottawa Approx. Quant. Rel: Nearby body of water: Enter Drainage Syst.: Approx. Quant. Unit: Environmental Impact:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
120	1 of 1	ENE/110.5	61.9 / -1.15	City of Ottawa Forward Avenue, Lyndale Avenue and Hinchey Avenue Ottawa ON K1N 5A1	ECA
Approval No:		8821-4WDQDT	MOE District:		Ottawa
Approval Date:		2001-05-04	City:		
Status:		Approved	Longitude:		-75.7326
Record Type:		ECA	Latitude:		45.4089
Link Source:		IDS	Geometry X:		
SWP Area Name:		Rideau Valley	Geometry Y:		
Approval Type:		ECA-Municipal and Private Water Works			
Project Type:		Municipal and Private Water Works			
Business Name:		City of Ottawa			
Address:		Forward Avenue, Lyndale Avenue and Hinchey Avenue			
Full Address:					
Full PDF Link:					
PDF Site Location:					
121	1 of 1	NNE/110.8	56.3 / -6.76	ON	BORE
Borehole ID:		613218	Inclin FLG:		No
OGF ID:		215514521	SP Status:		Initial Entry
Status:			Surv Elev:		No
Type:		Borehole	Piezometer:		No
Use:			Primary Name:		
Completion Date:		DEC-1962	Municipality:		
Static Water Level:		3.3	Lot:		
Primary Water Use:			Township:		
Sec. Water Use:			Latitude DD:		45.410904
Total Depth m:		-999	Longitude DD:		-75.736606
Depth Ref:		Ground Surface	UTM Zone:		18
Depth Elev:			Easting:		442361
Drill Method:			Northing:		5028862
Orig Ground Elev m:		56.4	Location Accuracy:		
Elev Reliabil Note:			Accuracy:		Not Applicable
DEM Ground Elev m:		58.5			
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:		218394179	Mat Consistency:		Loose
Top Depth:		.5	Material Moisture:		
Bottom Depth:			Material Texture:		
Material Color:		Brown	Non Geo Mat Type:		
Material 1:		Bedrock	Geologic Formation:		
Material 2:		Limestone	Geologic Group:		
Material 3:		Shale	Geologic Period:		
Material 4:			Depositional Gen:		
Gsc Material Description:					
Stratum Description:		BEDROCK. STABLE AT 174.1 FEET.M. SAND. LOOSE. BEDROCK. . CLAY. BROWN,GREY,VERY SO **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:		218394178	Mat Consistency:		Loose
Top Depth:		0	Material Moisture:		
Bottom Depth:		.5	Material Texture:		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material Color: Material 1: Sand Material 2: Gravel Material 3: Material 4: Gsc Material Description: Stratum Description: SAND. LOOSE. Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Source Source Type: Data Survey Source Orig: Geological Survey of Canada Source Date: 1956-1972 Confidence: Observatio: Source Name: Urban Geology Automated Information System (UGAIS) Source Details: File: OTTAWA2.txt RecordID: 057260 NTS_Sheet: 31G05G Confiden 1: Source Appl: Spatial/Tabular Source Iden: 1 Scale or Res: Varies Horizontal: NAD27 Verticalda: Mean Average Sea Level					
Source List Source Identifier: 1 Source Type: Data Survey Source Date: 1956-1972 Scale or Resolution: Varies Source Name: Urban Geology Automated Information System (UGAIS) Source Originators: Geological Survey of Canada Horizontal Datum: NAD27 Vertical Datum: Mean Average Sea Level Projection Name: Universal Transverse Mercator					
122	1 of 1	ENE/114.3	60.9 / -2.15	Golder Associates Ltd. 159 Forward Ave. Ottawa ON K1Y 1K9	GEN
Generator No: ON8253910 SIC Code: SIC Description: Approval Years: As of Oct 2019 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
Detail(s) Waste Class: 146 T Waste Class Desc: Other specified inorganic sludges, slurries or solids					
123	1 of 1	E/121.6	61.6 / -1.46	61 Pinehurst Avenue Ottawa ON K1Y 1K5	EHS
Order No: 21022600026 Status: C Report Type: Standard Report Report Date: 03-MAR-21 Date Received: 26-FEB-21 Previous Site Name: Lot/Building Size: Additional Info Ordered: Nearest Intersection: Municipality: Ottawa Client Prov/State: ON Search Radius (km): .25 X: -75.7302995 Y: 45.4049713					
124	1 of 1	ENE/122.4	61.6 / -1.46	_59 Forward Ave Ottawa ON	WWIS
Well ID: 7342420 Data Entry Status:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Construction Date:				Data Src:	
Primary Water Use:	Monitoring and Test Hole			Date Received:	9/6/2019
Sec. Water Use:				Selected Flag:	TRUE
Final Well Status:	Monitoring and Test Hole			Abandonment Rec:	
Water Type:				Contractor:	7241
Casing Material:				Form Version:	7
Audit No:	Z317319			Owner:	
Tag:	A268943			Street Name:	_59 Forward Ave
Construction Method:				County:	OTTAWA
Elevation (m):				Municipality:	NEPEAN TOWNSHIP
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2019/08/08				
Year Completed:	2019				
Depth (m):	3.35				
Latitude:	45.4078282479044				
Longitude:	-75.7317823201228				
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1007675292			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442735.00
Code OB Desc:				North83:	5028517.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	08-Aug-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1007964072				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:					
Mat2 Desc:					
Mat3:	71				
Mat3 Desc:	FRACTURED				
Formation Top Depth:	0.6100000143051147				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:		3.3499999046325684			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007964071			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		01			
Mat2 Desc:		FILL			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.6100000143051147			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007964763			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.5			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007964762			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007964764			
Layer:		3			
Plug From:		1.5			
Plug To:		3.3499999046325684			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007965431			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007962360			
Casing No:		0			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1007966444			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.8300000429153442			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007966577			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.8300000429153442			
Screen End Depth:		3.3499999046325684			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
<u>Results of Well Yield Testing</u>					
Pump Test ID:		1007967535			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007965401			
Diameter:		7.619999885559082			
Depth From:		1.2200000286102295			
Depth To:		3.3499999046325684			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1007965400			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		1.2200000286102295			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
125	1 of 19	ESE/123.7	62.4 / -0.58	PHARMA PLUS DRUGS LTD 1620 SCOTT STREET UNIT 29 OTTAWA ON K1Y 4S7	GEN
Generator No: ON1553307		Status:			
SIC Code: 6031		Co Admin:			
SIC Description: PHARMACIES		Choice of Contact:			
Approval Years: 92,93,97		Phone No Admin:			
PO Box No:		Contam. Facility:			
Country:		MHSW Facility:			
<u>Detail(s)</u>					
Waste Class: 261					
Waste Class Desc: PHARMACEUTICALS					
Waste Class: 312					
Waste Class Desc: PATHOLOGICAL WASTES					
125	2 of 19	ESE/123.7	62.4 / -0.58	PHARMA PLUS DRUGS LTD. 31-660 1620 SCOTT STREET, UNIT 29, OTTAWA C/O 5935 AIRPORT ROAD STE. 500 MISSISSAUGA ON K1Y 4S7	GEN
Generator No: ON1553307		Status:			
SIC Code: 6031		Co Admin:			
SIC Description: PHARMACIES		Choice of Contact:			
Approval Years: 94,95,96		Phone No Admin:			
PO Box No:		Contam. Facility:			
Country:		MHSW Facility:			
<u>Detail(s)</u>					
Waste Class: 261					
Waste Class Desc: PHARMACEUTICALS					
Waste Class: 312					
Waste Class Desc: PATHOLOGICAL WASTES					
125	3 of 19	ESE/123.7	62.4 / -0.58	PHARMA PLUS DRUGS LTD. 1620 SCOTT STREET UNIT 29 OTTAWA ON K1Y 4S7	GEN
Generator No: ON1553307		Status:			
SIC Code: 6031		Co Admin:			
SIC Description: PHARMACIES		Choice of Contact:			
Approval Years: 98		Phone No Admin:			
PO Box No:		Contam. Facility:			
Country:		MHSW Facility:			
<u>Detail(s)</u>					
Waste Class: 261					
Waste Class Desc: PHARMACEUTICALS					
Waste Class: 312					
Waste Class Desc: PATHOLOGICAL WASTES					
125	4 of 19	ESE/123.7	62.4 / -0.58	PHARMA PLUS DRUGS LTD. 1620 SCOTT STREET, UNIT 29	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
OTTAWA ON K1Y 4S7					
Generator No:	ON1553307			Status:	
SIC Code:	6031			Co Admin:	
SIC Description:	PHARMACIES			Choice of Contact:	
Approval Years:	99,00,01			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
 <u>Detail(s)</u>					
Waste Class:	261				
Waste Class Desc:	PHARMACEUTICALS				
Waste Class:	312				
Waste Class Desc:	PATHOLOGICAL WASTES				
125	5 of 19	ESE/123.7	62.4 / -0.58	1620 Scott Street Ottawa ON K1Y 4S7	EHS
Order No:	20041013015			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Complete Report			Client Prov/State:	ON
Report Date:	10/15/04			Search Radius (km):	0.25
Date Received:	10/13/04			X:	-75.733579
Previous Site Name:				Y:	45.403594
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans				
125	6 of 19	ESE/123.7	62.4 / -0.58	Holland Cross Dental Centre 20-1620 Scott Street Ottawa ON K1Y4S7	GEN
Generator No:	ON2588173			Status:	
SIC Code:	621210, 621210			Co Admin:	
SIC Description:	OFFICES OF DENTISTS, OFFICES OF DENTISTS			Choice of Contact:	CO_OFFICIAL
Approval Years:	2016			Phone No Admin:	
PO Box No:				Contam. Facility:	No
Country:	Canada			MHSW Facility:	No
 <u>Detail(s)</u>					
Waste Class:	312				
Waste Class Desc:	PATHOLOGICAL WASTES				
125	7 of 19	ESE/123.7	62.4 / -0.58	Rexall Pharmacy Group Ltd. 1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	GEN
Generator No:	ON9502205			Status:	
SIC Code:	446110			Co Admin:	Erik Botines
SIC Description:	446110			Choice of Contact:	CO_ADMIN
Approval Years:	2016			Phone No Admin:	905-502-5965 Ext.
PO Box No:				Contam. Facility:	No
Country:	Canada			MHSW Facility:	No
 <u>Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
Waste Class:		261			
Waste Class Desc:		PHARMACEUTICALS			
125	8 of 19	ESE/123.7	62.4 / -0.58	Pharma Plus Drugmarts Ltd 1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	GEN
Generator No:		ON9502205		Status:	
SIC Code:		446110		Co Admin:	Erik Botines
SIC Description:		446110		Choice of Contact:	CO_ADMIN
Approval Years:		2015		Phone No Admin:	905-502-5965 Ext.
PO Box No:				Contam. Facility:	No
Country:		Canada		MHSW Facility:	No
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
125	9 of 19	ESE/123.7	62.4 / -0.58	Holland Cross Dental Centre 20-1620 Scott Street Ottawa ON K1Y4S7	GEN
Generator No:		ON2588173		Status:	
SIC Code:		621210, 621210		Co Admin:	
SIC Description:		OFFICES OF DENTISTS, OFFICES OF DENTISTS		Choice of Contact:	CO_OFFICIAL
Approval Years:		2015		Phone No Admin:	
PO Box No:				Contam. Facility:	No
Country:		Canada		MHSW Facility:	No
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
125	10 of 19	ESE/123.7	62.4 / -0.58	Holland Cross Dental Centre 20-1620 Scott Street Ottawa ON K1Y4S7	GEN
Generator No:		ON2588173		Status:	
SIC Code:		621210, 621210		Co Admin:	
SIC Description:		OFFICES OF DENTISTS, OFFICES OF DENTISTS		Choice of Contact:	CO_OFFICIAL
Approval Years:		2014		Phone No Admin:	
PO Box No:				Contam. Facility:	No
Country:		Canada		MHSW Facility:	No
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Desc:		PATHOLOGICAL WASTES			
125	11 of 19	ESE/123.7	62.4 / -0.58	Pharma Plus Drugmarts Ltd 1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON9502205 SIC Code: 446110 SIC Description: 446110 Approval Years: 2014 PO Box No: Country: Canada					
Status: Co Admin: Aaron Schrama Choice of Contact: CO_ADMIN Phone No Admin: 905-502-5965 Ext. Contam. Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 312 Waste Class Desc: PATHOLOGICAL WASTES					
125	12 of 19	ESE/123.7	62.4 / -0.58	Rexall Pharmacy Group Ltd. 1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	GEN
Generator No: ON9502205 SIC Code: SIC Description: Approval Years: As of Dec 2018 PO Box No: Country: Canada					
Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 261 A Waste Class Desc: Pharmaceuticals					
Waste Class: 312 P Waste Class Desc: Pathological wastes					
125	13 of 19	ESE/123.7	62.4 / -0.58	Holland Cross Dental Centre 20-1620 Scott Street Ottawa ON K1Y4S7	GEN
Generator No: ON2588173 SIC Code: SIC Description: Approval Years: As of Dec 2018 PO Box No: Country: Canada					
Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 312 P Waste Class Desc: Pathological wastes					
125	14 of 19	ESE/123.7	62.4 / -0.58	Rexall Pharmacy Group Ltd. 1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	GEN
Generator No: ON9502205 SIC Code: SIC Description: Approval Years: As of Jul 2020 PO Box No: Country: Canada					
Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		312 P			
Waste Class Desc:		Pathological wastes			
Waste Class:		261 A			
Waste Class Desc:		Pharmaceuticals			
125	15 of 19	ESE/123.7	62.4 / -0.58	Holland Cross Dental Centre 20-1620 Scott Street Ottawa ON K1Y4S7	GEN
Generator No:		ON2588173		Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:		As of Oct 2019		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:		Canada		MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		148 B			
Waste Class Desc:		Misc. wastes and inorganic chemicals			
Waste Class:		312 P			
Waste Class Desc:		Pathological wastes			
Waste Class:		146 T			
Waste Class Desc:		Other specified inorganic sludges, slurries or solids			
125	16 of 19	ESE/123.7	62.4 / -0.58	Holland Cross Dental Centre 20-1620 Scott Street Ottawa ON K1Y4S7	GEN
Generator No:		ON2588173		Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:		As of Nov 2021		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:		Canada		MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Desc:		Pathological wastes			
125	17 of 19	ESE/123.7	62.4 / -0.58	Rexall Pharmacy Group Ltd. 1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	GEN
Generator No:		ON9502205		Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:		As of Nov 2021		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:		Canada		MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Desc:		Pathological wastes			
Waste Class:		261 A			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Desc:		Pharmaceuticals			
125	18 of 19	ESE/123.7	62.4 / -0.58	Holland Cross Dental Centre 20-1620 Scott Street Ottawa ON K1Y4S7	GEN
Generator No:		ON2588173	Status:		Registered
SIC Code:			Co Admin:		
SIC Description:			Choice of Contact:		
Approval Years:		As of Feb 2022	Phone No Admin:		
PO Box No:			Contam. Facility:		
Country:		Canada	MHSW Facility:		
Detail(s)					
Waste Class:		312 P			
Waste Class Desc:		Pathological wastes			
125	19 of 19	ESE/123.7	62.4 / -0.58	Rexall Pharmacy Group Ltd. 1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	GEN
Generator No:		ON9502205	Status:		Registered
SIC Code:			Co Admin:		
SIC Description:			Choice of Contact:		
Approval Years:		As of Feb 2022	Phone No Admin:		
PO Box No:			Contam. Facility:		
Country:		Canada	MHSW Facility:		
Detail(s)					
Waste Class:		261 A			
Waste Class Desc:		Pharmaceuticals			
Waste Class:		312 P			
Waste Class Desc:		Pathological wastes			
126	1 of 3	ESE/125.4	62.9 / -0.15	Domtar Inc. 1600 Scott St Ottawa ON K1Y 4N7	SCT
Established:		1851			
Plant Size (ft²):					
Employment:		30			
--Details--					
Description:		Stationery and Office Supplies Wholesaler-Distributors			
SIC/NAICS Code:		418210			
Description:		Other Paper and Disposable Plastic Product Wholesaler-Distributors			
SIC/NAICS Code:		418220			
126	2 of 3	ESE/125.4	62.9 / -0.15	E.B. EDDY FOREST PRODUCTS LTD. 1600 SCOTT ST FLOOR 7 OTTAWA ON K1Y 4N7	SCT
Established:		0000			
Plant Size (ft²):		0			
Employment:		85			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
--Details--					
Description:		Lumber, Plywood and Millwork Wholesaler-Distributors			
SIC/NAICS Code:		416320			
Description:		Stationery and Office Supplies Wholesaler-Distributors			
SIC/NAICS Code:		418210			
Description:		Other Paper and Disposable Plastic Product Wholesaler-Distributors			
SIC/NAICS Code:		418220			
Description:		Log and Wood Chip Wholesaler-Distributors			
SIC/NAICS Code:		418910			
Description:		HARDWOOD DIMENSION AND FLOORING MILLS			
SIC/NAICS Code:		2426			
Description:		PULP MILLS			
SIC/NAICS Code:		2611			
Description:		PAPER MILLS			
SIC/NAICS Code:		2621			
Description:		COATED AND LAMINATED PAPER, NOT ELSEWHERE CLASSIFIED			
SIC/NAICS Code:		2672			
Description:		CONVERTED PAPER AND PAPERBOARD PRODUCTS, NOT ELSEWHERE CLASSIFIED			
SIC/NAICS Code:		2679			
126	3 of 3	ESE/125.4	62.9 / -0.15	Colonnade Development Inc. 1600 Scott St Ottawa ON	GEN
Generator No:	ON3845096			Status:	
SIC Code:	531310			Co Admin:	
SIC Description:	Real Estate Property Managers			Choice of Contact:	
Approval Years:	2012			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
127	1 of 1	WSW/134.0	59.9 / -3.15	23 Clearview Avenue Ottawa ON	SPL
Ref No:	0368-B52NYV			Discharger Report:	
Site No:	NA			Material Group:	
Incident Dt:	2018/09/28			Health/Env Conseq:	0 - No Impact
Year:				Client Type:	
Incident Cause:				Sector Type:	Miscellaneous Communal
Incident Event:	Dumping			Agency Involved:	
Contaminant Code:				Nearest Watercourse:	
Contaminant Name:				Site Address:	23 Clearview Avenue
Contaminant Limit 1:				Site District Office:	Ottawa
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	Eastern
Environment Impact:				Site Municipality:	Ottawa
Nature of Impact:				Site Lot:	
Receiving Medium:				Site Conc:	
Receiving Env:	Land			Northing:	5028125
MOE Response:	No			Easting:	441775
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:	2018/09/28			Site Map Datum:	
Dt Document Closed:				SAC Action Class:	Land Spills

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Incident Reason: Deliberate Act Site Name: Residential House <UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: Household cleaning product dumped to cb (~10L)- Ottawa Contaminant Qty:					
128	1 of 2	ESE/134.6	62.9 / -0.15	City of Ottawa Hamilton Avenue and Bullman Street Ottawa ON	CA
Certificate #: 3200-6AKNDM Application Year: 2005 Issue Date: 3/21/2005 Approval Type: Municipal and Private Sewage Works Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
128	2 of 2	ESE/134.6	62.9 / -0.15	City of Ottawa Hamilton Avenue and Bullman Street Ottawa ON K2G 6J8	ECA
Approval No: 3200-6AKNDM Approval Date: 2005-03-21 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Rideau Valley Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS Business Name: City of Ottawa Address: Hamilton Avenue and Bullman Street Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/8688-6AGSJ2-14.pdf PDF Site Location:					
MOE District: Ottawa City: Longitude: -75.7298 Latitude: 45.3968 Geometry X: Geometry Y:					
129	1 of 2	W/135.2	59.6 / -3.46	Enbridge Energy Distribution Inc. 123 Carleton Ave Ottawa ON	SPL
Ref No: 1852-B9SLLB Site No: NA Incident Dt: 2/27/2019 Year: Incident Cause: Incident Event: Leak/Break Contaminant Code: 35 Contaminant Name: NATURAL GAS (METHANE) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: 1075 Environment Impact: Nature of Impact:					
Discharger Report: Material Group: Health/Env Conseq: 2 - Minor Environment Client Type: Corporation Sector Type: Miscellaneous Communal Agency Involved: Nearest Watercourse: Site Address: 123 Carleton Ave Site District Office: Ottawa Site Postal Code: Site Region: Eastern Site Municipality: Ottawa Site Lot:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Receiving Medium: Receiving Env: Air MOE Response: No Dt MOE Arvl on Scn: MOE Reported Dt: 2/27/2019 Dt Document Closed: 5/8/2019				Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill Pipeline/Components	
Incident Reason: Operator/Human Error Site Name: Residential<UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: TSSA FSB 1.25" plastic gas main linestrike, made safe Contaminant Qty: 0 L				Source Type:	

129	2 of 2	W/135.2	59.6 / -3.46	ENBRIDGE GAS INC 123 CARLETON AVE,,OTTAWA,ON,K1Y 0J2,CA ON	PINC
Incident Id: Incident No: 2519348 Incident Reported Dt: 2/28/2019 Type: FS-Pipeline Incident Status Code: Tank Status: Non Mandated Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Depth: Customer Acct Name: ENBRIDGE GAS INC Incident Address: 123 CARLETON AVE,,OTTAWA,ON,K1Y 0J2,CA Operation Type: Pipeline Type: Regulator Type: Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes:				Pipe Material: Fuel Category: Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category: Regulator Location: Method Details:	

130	1 of 1	ENE/136.7	61.9 / -1.15	50 Burnside Ave Ottawa ON	SPL
Ref No: 1051-A7UU8M Site No: NA Incident Dt: 2016/03/08 Year: Incident Cause: Incident Event: Leak/Break Contaminant Code: 13 Contaminant Name: FUEL (N.O.S.) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: Surface Water MOE Response: No				Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Miscellaneous Communal Agency Involved: Nearest Watercourse: Site Address: 50 Burnside Ave Site District Office: Site Postal Code: Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Northing: Easting:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Dt MOE Arvl on Scn: MOE Reported Dt: 2016/03/08 Dt Document Closed: Incident Reason: Operator/Human Error Site Name: spill<UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: Ottawa small fuel spill from a car Contaminant Qty: 1 L					
Site Geo Ref Accu: Site Map Datum: SAC Action Class: Land Spills Source Type:					
131	1 of 1	ESE/140.0	61.9 / -1.15	PRIVATE RESIDENCE RESIDENCE AT 50 PINEHURST OWNED BY MR. MCCARTHY (722-7298) FURNACE OIL TANK OTTAWA CITY ON K1Y 1K4	SPL
Ref No: 87812 Site No: Incident Dt: 7/1/1993 Year: Incident Cause: ABOVE-GROUND TANK LEAK Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: NOT ANTICIPATED Nature of Impact: Other Receiving Medium: LAND Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 7/1/1993 Dt Document Closed: Incident Reason: CORROSION Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: PRIVATE RESIDENCE - 25 L OF FURNACE OIL TO EARTHENFLOOR IN BASEMENT. Contaminant Qty:					
Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: 20101 Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:					
132	1 of 1	SE/141.2	62.9 / -0.15	PE4962: 30, 34 and 40 Holland Ave, Ottawa ON Ottawa ON K1Y 0X4	EHS
Order No: 21030800008 Status: C Report Type: Standard Report Report Date: 11-MAR-21 Date Received: 08-MAR-21 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Ottawa Client Prov/State: ON Search Radius (km): .25 X: -75.734012 Y: 45.4026805					
133	1 of 9	E/141.5	60.9 / -2.15	LEONES SERVICE CENTRE LTD 1480 SCOTT ST OTTAWA ON K1Y2N4	PRT
Location ID: 11084 Type: retail Expiry Date: 1996-03-31					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Capacity (L): Licence #:		0 0049665001			
133	2 of 9	E/141.5	60.9 / -2.15	LEONES SERVICE CENTRE LTD 1480 SCOTT ST OTTAWA ON K1Y 2N4	FSTH
License Issue Date:		3/1/2002			
Tank Status:		Licensed			
Tank Status As Of:		August 2007			
Operation Type:		Retail Fuel Outlet			
Facility Type:		Gasoline Station - Full Serve			
--Details--					
Status:		Active			
Year of Installation:		1990			
Corrosion Protection:					
Capacity:		18100			
Tank Fuel Type:		Liquid Fuel Single Wall UST - Gasoline			
Status:		Active			
Year of Installation:		1990			
Corrosion Protection:					
Capacity:		18100			
Tank Fuel Type:		Liquid Fuel Single Wall UST - Diesel			
Status:		Active			
Year of Installation:		1990			
Corrosion Protection:					
Capacity:		18100			
Tank Fuel Type:		Liquid Fuel Single Wall UST - Gasoline			
133	3 of 9	E/141.5	60.9 / -2.15	LEONE'S SERVICE CENTRE LTD 1480 SCOTT ST OTTAWA ON K1Y 2N4	RST
Headcode:		01186800			
Headcode Desc:		SERVICE STATIONS-GASOLINE, OIL & NATURAL GAS			
Phone:					
List Name:					
Description:					
133	4 of 9	E/141.5	60.9 / -2.15	LEONES SERVICE CENTRE LTD 1480 SCOTT ST OTTAWA ON K1Y 2N4	FSTH
License Issue Date:		3/1/2002			
Tank Status:		Licensed			
Tank Status As Of:		December 2008			
Operation Type:		Retail Fuel Outlet			
Facility Type:		Gasoline Station - Full Serve			
--Details--					
Status:		Active			
Year of Installation:		1990			
Corrosion Protection:					
Capacity:		18100			
Tank Fuel Type:		Liquid Fuel Single Wall UST - Gasoline			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status:		Active			
Year of Installation:		1990			
Corrosion Protection:					
Capacity:		18100			
Tank Fuel Type:		Liquid Fuel Single Wall UST - Gasoline			
Status:		Active			
Year of Installation:		1990			
Corrosion Protection:					
Capacity:		18100			
Tank Fuel Type:		Liquid Fuel Single Wall UST - Diesel			

133	5 of 9	E/141.5	60.9 / -2.15	M & N AUTO CENTRE LTD 1484 SCOTT ST OTTAWA ON	DTNK

Delisted Expired Fuel Safety Facilities

Instance No:	10206095	Expired Date:
Status:	EXPIRED	Max Hazard Rank:
Instance ID:	13846	Facility Location:
Instance Type:	FS Facility	Facility Type:
Instance Creation Dt:		Fuel Type 2:
Instance Install Dt:		Fuel Type 3:
Item Description:		Panam Related:
Manufacturer:		Panam Venue Nm:
Model:		External Identifier:
Serial No:		Item:
ULC Standard:		Piping Steel:
Quantity:		Piping Galvanized:
Unit of Measure:		Tank Single Wall St:
Overfill Prot Type:		Piping Underground:
Creation Date:		Tank Underground:
Next Periodic Str DT:		Source:
TSSA Base Sched Cycle 2:		
TSSAMax Hazard Rank 1:		
TSSA Risk Based Periodic Yn:		
TSSA Volume of Directives:		
TSSA Periodic Exempt:		
TSSA Statutory Interval:		
TSSA Recd Insp Interva:		
TSSA Recd Tolerance:		
TSSA Program Area:		
TSSA Program Area 2:		
Description:	FS Propane Vehicle Conv Centre	
Original Source:	EXP	
Record Date:	Up to Mar 2012	

133	6 of 9	E/141.5	60.9 / -2.15	CAROLE RAYMOND 1484A SCOTT ST., OTTAWA ON K1Y 2N4	GEN

Generator No:	ON4292232	Status:
SIC Code:	811111	Co Admin:
SIC Description:	General Automotive Repair	Choice of Contact:
Approval Years:	2010	Phone No Admin:
PO Box No:		Contam. Facility:
Country:		MHSW Facility:

Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Desc:		252 WASTE OILS & LUBRICANTS			
133	7 of 9	E/141.5	60.9 / -2.15	Leone's Service Centre Ltd. 1480 Scott St, ottawa ON	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:		ON8286000 447190 2013 		Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:		221 LIGHT FUELS			
133	8 of 9	E/141.5	60.9 / -2.15	LEONE'S SERVICE CENTRE LTD 1480 SCOTT ST OTTAWA ON K1Y2N4	RST
Headcode: Headcode Desc: Phone: List Name: Description:		01186800 SERVICE STATIONS GASOLINE OIL & NATURAL 6137287088 			
133	9 of 9	E/141.5	60.9 / -2.15	Leone's Service Centre Ltd. 1480 Scott St, ottawa ON K1Y 2N4	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:		ON8286000 447190 447190 2014 Canada		Status: Co Admin: Terry Barnaby Choice of Contact: CO_OFFICIAL Phone No Admin: 613-822-0624 Ext. Contam. Facility: No MHSW Facility: No	
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:		221 LIGHT FUELS			
134	1 of 1	ENE/148.8	60.9 / -2.15	PRIVATE RESIDENCE AT RESIDENCE AT 154 HINCHY AVE. FURNACE OIL TANK OTTAWA CITY ON	SPL
Ref No: Site No: Incident Dt: Year: Incident Cause: Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1:		174104 // ABOVE-GROUND TANK LEAK 		Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: CONFIRMED Nature of Impact: Soil contamination Receiving Medium: LAND Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 10/23/1999 Dt Document Closed: Incident Reason: CORROSION Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: RESIDENCE - FURNACE OIL TO EARTHEN BASEMENT IN HOME FROM STORAGE TANK. Contaminant Qty:					
Site Postal Code: Site Region: Site Municipality: 20101 Site Lot: Site Conc: Northing: Easting: REPORT FAXED TO TSSA Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:					
135	1 of 2	SW/151.8	63.7 / 0.65	OTTAWA CITY CARLETON AVE/PREMIER AVE. OTTAWA CITY ON	CA
Certificate #: 3-1257-95- Application Year: 95 Issue Date: 9/8/1995 Approval Type: Municipal sewage Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
135	2 of 2	SW/151.8	63.7 / 0.65	OTTAWA CITY CARLETON AVE/PREMIER AVE. OTTAWA CITY ON	CA
Certificate #: 7-0898-95- Application Year: 95 Issue Date: 9/8/1995 Approval Type: Municipal water Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
136	1 of 3	NE/152.4	54.7 / -8.33	Pomerleau Inc 105 Sir John A MacDonald PKY OTTAWA ON K1A 0M8	EASR
Approval No: R-009-2111688920 Status: REGISTERED Date: 2019-10-31 MOE District: Ottawa Municipality: OTTAWA Latitude: 45.37333333					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Record Type: EASR Link Source: MOFA Project Type: Water Taking - Construction Dewatering Full Address: Approval Type: EASR-Water Taking - Construction Dewatering SWP Area Name: Rideau Valley PDF URL: PDF Site Location:					
136	2 of 3	NE/152.4	54.7 / -8.33	Pomerleau Inc. 105 Sir John A. Macdonald Parkway Ottawa ON K1A 0N4	GEN
Generator No: ON4153609 SIC Code: SIC Description: Approval Years: As of Jul 2020 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
Detail(s)					
Waste Class: 221 I Waste Class Desc: Light fuels					
136	3 of 3	NE/152.4	54.7 / -8.33	Pomerleau Inc. 105 Sir John A. Macdonald Parkway Ottawa ON K1A 0N4	GEN
Generator No: ON4153609 SIC Code: SIC Description: Approval Years: As of Jan 2021 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
Detail(s)					
Waste Class: 221 I Waste Class Desc: Light fuels					
137	1 of 6	E/152.7	60.9 / -2.15	LEONES SERVICE CENTRE LTD 1480 SCOTT ST OTTAWA K1Y 2N4 ON CA ON	DTNK
Delisted Expired Fuel Safety Facilities					
Instance No: 10906665 Status: EXPIRED Instance ID: Instance Type: Instance Creation Dt: 7/19/2000 8:15:15 PM Instance Install Dt: 5/14/2009 Item Description: FS Liquid Fuel Tank Manufacturer: NULL Model: NULL Serial No: NULL ULC Standard: NULL Expired Date: Max Hazard Rank: NULL Facility Location: 1480 SCOTT ST OTTAWA K1Y 2N4 ON CA Facility Type: FS LIQUID FUEL TANK Fuel Type 2: NULL Fuel Type 3: NULL Panam Related: NULL Panam Venue Nm: NULL External Identifier: NULL Item: Piping Steel:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Quantity:	1			Piping Galvanized:	
Unit of Measure:	EA			Tank Single Wall St:	
Overfill Prot Type:	NULL			Piping Underground:	
Creation Date:	7/5/2009 1:22:07 AM			Tank Underground:	
Next Periodic Str DT:	NULL			Source:	FS Liquid Fuel Tank
TSSA Base Sched Cycle 2:	NULL				
TSSAMax Hazard Rank 1:	NULL				
TSSA Risk Based Periodic Yn:	NULL				
TSSA Volume of Directives:	NULL				
TSSA Periodic Exempt:	NULL				
TSSA Statutory Interval:	NULL				
TSSA Recd Insp Interva:	NULL				
TSSA Recd Tolerance:	NULL				
TSSA Program Area:	NULL				
TSSA Program Area 2:	NULL				
Description:	2009VBS				
Original Source:	EXP				
Record Date:	31-JUL-2020				

[137](#) 2 of 6 E/152.7 60.9 / -2.15 LEONES SERVICE CENTRE LTD 1480 SCOTT ST OTTAWA K1Y 2N4 ON CA ON DTNK

Delisted Expired Fuel Safety Facilities

Instance No:	11349414	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	NULL
Instance ID:		Facility Location:	1480 SCOTT ST OTTAWA K1Y 2N4 ON CA
Instance Type:		Facility Type:	FS LIQUID FUEL TANK
Instance Creation Dt:	7/19/2000 8:15:15 PM	Fuel Type 2:	NULL
Instance Install Dt:	5/14/2009	Fuel Type 3:	NULL
Item Description:	FS Liquid Fuel Tank	Panam Related:	NULL
Manufacturer:	NULL	Panam Venue Nm:	NULL
Model:	NULL	External Identifier:	NULL
Serial No:	NULL	Item:	
ULC Standard:	NULL	Piping Steel:	
Quantity:	1	Piping Galvanized:	
Unit of Measure:	EA	Tank Single Wall St:	
Overfill Prot Type:	NULL	Piping Underground:	
Creation Date:	7/5/2009 1:24:54 AM	Tank Underground:	
Next Periodic Str DT:	NULL	Source:	FS Liquid Fuel Tank
TSSA Base Sched Cycle 2:	NULL		
TSSAMax Hazard Rank 1:	NULL		
TSSA Risk Based Periodic Yn:	NULL		
TSSA Volume of Directives:	NULL		
TSSA Periodic Exempt:	NULL		
TSSA Statutory Interval:	NULL		
TSSA Recd Insp Interva:	NULL		
TSSA Recd Tolerance:	NULL		
TSSA Program Area:	NULL		
TSSA Program Area 2:	NULL		
Description:	2009VBS		
Original Source:	EXP		
Record Date:	31-JUL-2020		

[137](#) 3 of 6 E/152.7 60.9 / -2.15 LEONES SERVICE CENTRE LTD 1480 SCOTT ST OTTAWA K1Y 2N4 ON CA ON DTNK

Delisted Expired Fuel Safety

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Facilities</u>					
Instance No:	11349455			Expired Date:	
Status:	EXPIRED			Max Hazard Rank:	NULL
Instance ID:				Facility Location:	1480 SCOTT ST OTTAWA K1Y 2N4 ON CA
Instance Type:				Facility Type:	FS LIQUID FUEL TANK
Instance Creation Dt:	7/19/2000 8:15:15 PM			Fuel Type 2:	NULL
Instance Install Dt:	5/14/2009			Fuel Type 3:	NULL
Item Description:	FS Liquid Fuel Tank			Panam Related:	NULL
Manufacturer:	NULL			Panam Venue Nm:	NULL
Model:	NULL			External Identifier:	NULL
Serial No:	NULL			Item:	
ULC Standard:	NULL			Piping Steel:	
Quantity:	1			Piping Galvanized:	
Unit of Measure:	EA			Tank Single Wall St:	
Overfill Prot Type:	NULL			Piping Underground:	
Creation Date:	7/5/2009 1:24:54 AM			Tank Underground:	
Next Periodic Str DT:	NULL			Source:	FS Liquid Fuel Tank
TSSA Base Sched Cycle 2:	NULL				
TSSAMax Hazard Rank 1:	NULL				
TSSA Risk Based Periodic Yn:	NULL				
TSSA Volume of Directives:	NULL				
TSSA Periodic Exempt:	NULL				
TSSA Statutory Interval:	NULL				
TSSA Recd Insp Interva:	NULL				
TSSA Recd Tolerance:	NULL				
TSSA Program Area:	NULL				
TSSA Program Area 2:	NULL				
Description:	2009VBS				
Original Source:	EXP				
Record Date:	31-JUL-2020				
<u>137</u>	4 of 6	E/152.7	60.9 / -2.15	LEONES SERVICE CENTRE LTD 1480 SCOTT ST OTTAWA K1Y 2N4 ON CA ON	FST
Instance No:	11349455			Manufacturer:	
Status:				Serial No:	
Cont Name:				Ulc Standard:	
Instance Type:				Quantity:	
Item:				Unit of Measure:	
Item Description:	FS Liquid Fuel Tank			Fuel Type:	Diesel
Tank Type:	Liquid Fuel Single Wall UST			Fuel Type2:	NULL
Install Date:	5/14/2009			Fuel Type3:	NULL
Install Year:	1990			Piping Steel:	
Years in Service:				Piping Galvanized:	
Model:	NULL			Tanks Single Wall St:	
Description:				Piping Underground:	
Capacity:	18100			No Underground:	
Tank Material:	Steel			Panam Related:	
Corrosion Protect:	Sacrificial anode			Panam Venue:	
Overfill Protect:					
Facility Type:	FS Liquid Fuel Tank				
Parent Facility Type:					
Facility Location:					
Device Installed Location:	1480 SCOTT ST OTTAWA K1Y 2N4 ON CA				
<u>Liquid Fuel Tank Details</u>					
Overfill Protection:					
Owner Account Name:	LEONES SERVICE CENTRE LTD				
Item:	FS LIQUID FUEL TANK				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
137	5 of 6	E/152.7	60.9 / -2.15	LEONES SERVICE CENTRE LTD 1480 SCOTT ST OTTAWA K1Y 2N4 ON CA ON	FST
Instance No: 11349414 Status: Cont Name: Instance Type: Item: Item Description: FS Liquid Fuel Tank Tank Type: Liquid Fuel Single Wall UST Install Date: 5/14/2009 Install Year: 1990 Years in Service: Model: NULL Description: Capacity: 18100 Tank Material: Steel Corrosion Protect: Sacrificial anode Overfill Protect: Facility Type: FS Liquid Fuel Tank Parent Facility Type: Facility Location: Device Installed Location: 1480 SCOTT ST OTTAWA K1Y 2N4 ON CA Manufacturer: Serial No: Ulc Standard: Quantity: Unit of Measure: Fuel Type: Gasoline Fuel Type2: NULL Fuel Type3: NULL Piping Steel: Piping Galvanized: Tanks Single Wall St: Piping Underground: No Underground: Panam Related: Panam Venue:					
<u>Liquid Fuel Tank Details</u>					
Overfill Protection: Owner Account Name: LEONES SERVICE CENTRE LTD Item: FS LIQUID FUEL TANK					
137	6 of 6	E/152.7	60.9 / -2.15	LEONES SERVICE CENTRE LTD 1480 SCOTT ST OTTAWA K1Y 2N4 ON CA ON	FST
Instance No: 10906665 Status: Cont Name: Instance Type: Item: Item Description: FS Liquid Fuel Tank Tank Type: Liquid Fuel Single Wall UST Install Date: 5/14/2009 Install Year: 1990 Years in Service: Model: NULL Description: Capacity: 18100 Tank Material: Steel Corrosion Protect: Sacrificial anode Overfill Protect: Facility Type: FS Liquid Fuel Tank Parent Facility Type: Facility Location: Device Installed Location: 1480 SCOTT ST OTTAWA K1Y 2N4 ON CA Manufacturer: Serial No: Ulc Standard: Quantity: Unit of Measure: Fuel Type: Gasoline Fuel Type2: NULL Fuel Type3: NULL Piping Steel: Piping Galvanized: Tanks Single Wall St: Piping Underground: No Underground: Panam Related: Panam Venue:					
<u>Liquid Fuel Tank Details</u>					
Overfill Protection: Owner Account Name: LEONES SERVICE CENTRE LTD Item: FS LIQUID FUEL TANK					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
138	1 of 2	ESE/154.6	62.9 / -0.15	1 Hamilton Avenue North ottawa ON K1Y 1B5	EHS
Order No: 20050527006				Nearest Intersection:	
Status: C				Municipality:	
Report Type:				Client Prov/State:	ON
Report Date: 6/6/2005				Search Radius (km):	0.25
Date Received: 5/27/2005				X:	-75.731696
Previous Site Name:				Y:	45.403636
Lot/Building Size:					
Additional Info Ordered:					
138	2 of 2	ESE/154.6	62.9 / -0.15	ONTARIO PETROLEUM PUMP 1 HAMILTON AVE N OTTAWA ON K1Y 1B5	GEN
Generator No: ON8207850				Status:	
SIC Code: 541620				Co Admin:	
SIC Description: Environmental Consulting Services				Choice of Contact:	
Approval Years: 05				Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class: 221					
Waste Class Desc: LIGHT FUELS					
139	1 of 2	ENE/154.7	61.9 / -1.15	DANIEL C BAKER 921-100 HINCHEY AVENUE OTTAWA ON K1Y 4L9	PES
Detail Licence No:				Operator Box:	
Licence No:				Operator Class:	
Status:				Operator No:	
Approval Date:				Operator Type:	
Report Source:				Oper Area Code:	
Licence Type: Operator				Oper Phone No:	
Licence Type Code:				Operator Ext:	
Licence Class:				Operator Lot:	
Licence Control:				Oper Concession:	
Latitude:				Operator Region:	
Longitude:				Operator District:	
Lot:				Operator County:	
Concession:				Op Municipality:	
Region:				Post Office Box:	
District:				MOE District:	
County:				SWP Area Name:	
Trade Name:					
PDF URL:					
PDF Site Location:					
139	2 of 2	ENE/154.7	61.9 / -1.15	DANIEL BAKER 100 HINCHEY AVE; #921 OTTAWA ON K1Y4L9	PES
Detail Licence No:				Operator Box:	
Licence No:				Operator Class:	
Status:				Operator No:	
Approval Date:				Operator Type:	
Report Source:				Oper Area Code:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Licence Type: Licence Type Code: Licence Class: Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL: PDF Site Location: Operator Oper Phone No: Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:					
140	1 of 1	WSW/165.8	59.9 / -3.14	PIPELINE HIT 0.5" 164 CARLETON AVE,,OTTAWA,ON,K1Y 0J3,CA ON	PINC
Incident Id: Incident No: Incident Reported Dt: Type: Status Code: Tank Status: Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Depth: Customer Acct Name: Incident Address: Operation Type: Pipeline Type: Regulator Type: Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes: 1100260 5/15/2013 FS-Pipeline Incident Pipeline Damage Reason Est PIPELINE HIT 0.5" 164 CARLETON AVE,,OTTAWA,ON,K1Y 0J3,CA Pipe Material: Fuel Category: Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category: Regulator Location: Method Details:					
141	1 of 3	E/167.0	60.9 / -2.15	OTTAWA CITY HINCHEY AVE./SCOTT ST. OTTAWA CITY ON	CA
Certificate #: Application Year: Issue Date: Approval Type: Status: Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control: 3-1276-93- 93 11/9/1993 Municipal sewage Approved 					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
141	2 of 3	E/167.0	60.9 / -2.15	R.M. OF OTTAWA-CARLETON HINCHEY AVE./SCOTT ST. OTTAWA CITY ON	CA
Certificate #: Application Year: Issue Date: Approval Type: Status: Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:		7-0988-93-93 11/9/1993 Municipal water Approved			
141	3 of 3	E/167.0	60.9 / -2.15	City of Ottawa NW corner of Scott Street and Hinchey Ave Ottawa ON	SPL
Ref No: Site No: Incident Dt: Year: Incident Cause: Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Incident Reason: Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: Contaminant Qty:		6283-AYMDVH NA 2018/05/07 Leak/Break 15 HYDRAULIC OIL n/a Land No 2018/05/10 2018/05/10 Equipment Failure OLRT Construction<UNOFFICIAL> ORLT: 0.5L hydraulic oil to ground 0.5 L			
		Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:			
		2 - Minor Environment Municipal Government Miscellaneous Industrial NW corner of Scott Street and Hinchey Ave Ottawa Eastern Ottawa Land Spills Motor Vehicle			
142	1 of 2	ESE/168.3	61.9 / -1.15	OTTAWA CITY - PARKDALE AVENUE BULLMAN ST./PINEHURST ST. OTTAWA CITY ON	CA
Certificate #: Application Year: Issue Date: Approval Type: Status: Application Type: Client Name: Client Address:		3-0870-91-91 6/21/1991 Municipal sewage Approved			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
142	2 of 2	ESE/168.3	61.9 / -1.15	OTTAWA CITY - HINCHEY STREET BULLMAN ST./PINEHURST ST. OTTAWA CITY ON	CA
Certificate #: Application Year: Issue Date: Approval Type: Status: Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:		7-0698-91-91 6/21/1991 Municipal water Approved			
143	1 of 1	ENE/170.3	61.9 / -1.15	OTTAWA CITY BURNSIDE AVE./HINCHEY AVE. OTTAWA CITY ON	CA
Certificate #: Application Year: Issue Date: Approval Type: Status: Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:		3-0468-99-99 5/17/1999 Municipal sewage Approved			
144	1 of 2	E/172.2	60.8 / -2.23	PRIVATE RESIDENCE 252 HENCHEY FURNACE OIL TANK OTTAWA CITY ON	SPL
Ref No: Site No: Incident Dt: Year: Incident Cause: Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium:		32909 4/5/1990 OTHER CONTAINER LEAK POSSIBLE Water course or lake WATER			
		Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: Site Lot: Site Conc:			
		20101			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 4/5/1990 Dt Document Closed: Incident Reason: EQUIPMENT FAILURE Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: FURNACE OIL TANK-SMALL QUANTITY FURNACE OIL TO FLOOR DRAIN. Contaminant Qty:					
Northing: Easting: WORKS Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:					
144	2 of 2	E/172.2	60.8 / -2.23	250-252 Hinchey Avenue Ottawa ON K1Y 1L8	EHS
Order No: 20200115227 Status: C Report Type: Standard Report Report Date: 20-JAN-20 Date Received: 15-JAN-20 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.7296516 Y: 45.4049639					
145	1 of 1	WSW/178.3	59.9 / -3.13	PRIVATE OWNER AT RESIDENCE AT 184 CARLETON AVE. STORAGE TANK/BARREL OTTAWA CITY ON K1Y 0J3	SPL
Ref No: 113849 Site No: Incident Dt: // Year: Incident Cause: ABOVE-GROUND TANK LEAK Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: CONFIRMED Nature of Impact: Soil contamination Receiving Medium: LAND Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 5/31/1995 Dt Document Closed: Incident Reason: WELD/SEAM FAILURE Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: RESIDENCE - SMALL AMOUNT OF OIL TO GROUND FROM LEAKY OUTSIDE TANK. Contaminant Qty:					
Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: 20101 Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:					
146	1 of 2	SSW/183.4	66.9 / 3.85	JEANNINE T KNIGHTON 47 GILCHRIST AVE,,OTTAWA,ON,K1Y 0M7,CA ON	PINC
Incident Id:					
Pipe Material:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Incident No: 1932032 Incident Reported Dt: 8/30/2016 Type: FS-Pipeline Incident Status Code: Tank Status: Pipeline Damage Reason Est Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Depth: Customer Acct Name: JEANNINE T KNIGHTON Incident Address: 47 GILCHRIST AVE., OTTAWA, ON, K1Y 0M7, CA Operation Type: Pipeline Type: Regulator Type: Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes: Fuel Category: Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category: Regulator Location: Method Details:					
146	2 of 2	SSW/183.4	66.9 / 3.85	Enbridge Gas Distribution Inc. 47 Gilcrest Avenue Ottawa ON	SPL
Ref No: 5406-ADAQKC Site No: NA Incident Dt: 8/29/2016 Year: Incident Cause: Incident Event: Leak/Break Contaminant Code: 35 Contaminant Name: NATURAL GAS (METHANE) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: Air MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 8/29/2016 Dt Document Closed: Incident Reason: Operator/Human Error Site Name: PL Strike Site<UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: TSSA FSB: 1/2" PL Strike, made safe. Contaminant Qty: 0 L Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Miscellaneous Industrial Agency Involved: Nearest Watercourse: Site Address: 47 Gilcrest Avenue Site District Office: Site Postal Code: Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill Source Type:					
147	1 of 20	ESE/183.9	62.9 / -0.15	M O M PRINTING 300 PARKDALE AVE OTTAWA ON K1Y 1G2	SCT
Established: 1963 Plant Size (ft²): 0 Employment: 132					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
--Details--					
Description:		COMMERCIAL PRINTING, LITHOGRAPHIC			
SIC/NAICS Code:		2752			
Description:		COMMERCIAL PRINTING, NOT ELSEWHERE CLASSIFIED			
SIC/NAICS Code:		2759			
147	2 of 20	ESE/183.9	62.9 / -0.15	ST-JOSEPH M.O.M. PRINTING 300 Parkdale Ave Ottawa ON K1Y 1G2	SCT
Established:		1963			
Plant Size (ft²):		58000			
Employment:		150			
--Details--					
Description:		Quick Printing			
SIC/NAICS Code:		323114			
Description:		Digital Printing			
SIC/NAICS Code:		323115			
Description:		Other Printing			
SIC/NAICS Code:		323119			
147	3 of 20	ESE/183.9	62.9 / -0.15	M.O.M. PRINTING 300 PARKDALE AVENUE OTTAWA ON K1Y 1G2	GEN
Generator No:	ON0272300			Status:	
SIC Code:	2819			Co Admin:	
SIC Description:	OTHER COMM. PRINTING			Choice of Contact:	
Approval Years:	86,87,88,89			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:	213				
Waste Class Desc:	PETROLEUM DISTILLATES				
Waste Class:	264				
Waste Class Desc:	PHOTOPROCESSING WASTES				
147	4 of 20	ESE/183.9	62.9 / -0.15	M.O.M. PRINTING 300 PARKDALE AVENUE OTTAWA ON K1Y 1G2	GEN
Generator No:	ON0272300			Status:	
SIC Code:	2819			Co Admin:	
SIC Description:	OTHER COMM. PRINTING			Choice of Contact:	
Approval Years:	90,97,98,99,00,01			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Desc: 213 PETROLEUM DISTILLATES Waste Class: Waste Class Desc: 145 PAINT/PIGMENT/COATING RESIDUES Waste Class: Waste Class Desc: 252 WASTE OILS & LUBRICANTS Waste Class: Waste Class Desc: 264 PHOTOPROCESSING WASTES					
147	5 of 20	ESE/183.9	62.9 / -0.15	M.O.M. PRINTING 25-205 300 PARKDALE AVENUE OTTAWA ON K1Y 1G2	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: ON0272300 2819 OTHER COMM. PRINTING 92,93,94,95,96 Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: Waste Class Desc: 145 PAINT/PIGMENT/COATING RESIDUES Waste Class: Waste Class Desc: 213 PETROLEUM DISTILLATES Waste Class: Waste Class Desc: 252 WASTE OILS & LUBRICANTS Waste Class: Waste Class Desc: 264 PHOTOPROCESSING WASTES					
147	6 of 20	ESE/183.9	62.9 / -0.15	M.O.M. PRINTING 300 Parkdale Ave Ottawa ON K1Y 1G2	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: ON0272300 02,03,04 Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: Waste Class Desc: 145 PAINT/PIGMENT/COATING RESIDUES Waste Class: Waste Class Desc: 213 PETROLEUM DISTILLATES Waste Class: Waste Class Desc: 252 WASTE OILS & LUBRICANTS Waste Class: Waste Class Desc: 264 PHOTOPROCESSING WASTES					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
147	7 of 20	ESE/183.9	62.9 / -0.15	Scintrex Trace Crop. 300 Parkdale Ave. Ottawa ON K1Y 1G2	GEN
Generator No:		ON9092863		Status:	
SIC Code:		811210		Co Admin:	
SIC Description:		Electronic & Precision Equipment R&M		Choice of Contact:	
Approval Years:		03,04,05,06,07,08		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		113			
Waste Class Desc:		ACID WASTE - OTHER METALS			
Waste Class:		121			
Waste Class Desc:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
Waste Class:		112			
Waste Class Desc:		ACID WASTE - HEAVY METALS			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
147	8 of 20	ESE/183.9	62.9 / -0.15	Scintrex Trace Corp. 300 Parkdale Ave Ottawa ON K1Y 1G2	SCT
Established:		01-AUG-01			
Plant Size (ft²):					
Employment:					
<u>--Details--</u>					
Description:		Measuring, Medical and Controlling Devices Manufacturing			
SIC/NAICS Code:		334512			
Description:		Measuring, Medical and Controlling Devices Manufacturing			
SIC/NAICS Code:		334512			
147	9 of 20	ESE/183.9	62.9 / -0.15	300 Parkdale Avenue Ottawa ON K1Y 1G2	EHS
Order No:		20061030008		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Custom Report		Client Prov/State:	ON
Report Date:		11/7/2006		Search Radius (km):	0.35
Date Received:		10/30/2006		X:	-75.730856
Previous Site Name:				Y:	45.403412
Lot/Building Size:					
Additional Info Ordered:		Title Search			
147	10 of 20	ESE/183.9	62.9 / -0.15	Scintrex Trace Crop. 300 Parkdale Ave. Ottawa ON K1Y 1G2	GEN
Generator No:		ON9092863		Status:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Code: SIC Description: Approval Years: PO Box No: Country:	811210 Electronic and Precision Equipment Repair and Maintenance 2009			Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	112 ACID WASTE - HEAVY METALS				
Waste Class: Waste Class Desc:	113 ACID WASTE - OTHER METALS				
Waste Class: Waste Class Desc:	121 ALKALINE WASTES - HEAVY METALS				
Waste Class: Waste Class Desc:	212 ALIPHATIC SOLVENTS				
147	11 of 20	ESE/183.9	62.9 / -0.15	Scintrex Trace Crop. 300 Parkdale Ave. Ottawa ON K1Y 1G2	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:	ON9092863 811210 Electronic and Precision Equipment Repair and Maintenance 2010			Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	212 ALIPHATIC SOLVENTS				
Waste Class: Waste Class Desc:	121 ALKALINE WASTES - HEAVY METALS				
Waste Class: Waste Class Desc:	113 ACID WASTE - OTHER METALS				
Waste Class: Waste Class Desc:	112 ACID WASTE - HEAVY METALS				
147	12 of 20	ESE/183.9	62.9 / -0.15	Scintrex Trace Crop. 300 Parkdale Ave. Ottawa ON K1Y 1G2	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:	ON9092863 811210 Electronic and Precision Equipment Repair and Maintenance 2011			Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:	113				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Desc:		ACID WASTE - OTHER METALS			
Waste Class:		121			
Waste Class Desc:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			
Waste Class:		112			
Waste Class Desc:		ACID WASTE - HEAVY METALS			

147

13 of 20

ESE/183.9

62.9 / -0.15

Scintrex Trace Corp.

300 Parkdale Ave.

Ottawa ON K1Y 1G2

GEN

Generator No:

ON9092863

SIC Code:

811210

SIC Description:

ELECTRONIC AND PRECISION EQUIPMENT
REPAIR AND MAINTENANCE

Approval Years:

2016

PO Box No:

Country:

Canada

Status:

Co Admin:

Lorie Mills

Choice of Contact:

CO_ADMIN

Phone No Admin:

2241061 Ext.229

Contam. Facility:

No

MHSW Facility:

No

Detail(s)

Waste Class:

212

Waste Class Desc:

ALIPHATIC SOLVENTS

Waste Class:

112

Waste Class Desc:

ACID WASTE - HEAVY METALS

Waste Class:

121

Waste Class Desc:

ALKALINE WASTES - HEAVY METALS

Waste Class:

148

Waste Class Desc:

INORGANIC LABORATORY CHEMICALS

Waste Class:

263

Waste Class Desc:

ORGANIC LABORATORY CHEMICALS

Waste Class:

331

Waste Class Desc:

WASTE COMPRESSED GASES

Waste Class:

113

Waste Class Desc:

ACID WASTE - OTHER METALS

147	14 of 20	ESE/183.9	62.9 / -0.15	Scintrex Trace Corp. 300 Parkdale Ave. Ottawa ON K1Y 1G2	GEN
Generator No:		ON9092863		Status:	
SIC Code:		811210		Co Admin: Lorie Mills	
SIC Description:		ELECTRONIC AND PRECISION EQUIPMENT REPAIR AND MAINTENANCE		Choice of Contact: CO_ADMIN	
Approval Years:		2015		Phone No Admin: 2241061 Ext.229	
PO Box No:				Contam. Facility: No	
Country:		Canada		MHSW Facility: No	
<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Desc:		ALIPHATIC SOLVENTS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		121			
Waste Class Desc:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		112			
Waste Class Desc:		ACID WASTE - HEAVY METALS			
Waste Class:		113			
Waste Class Desc:		ACID WASTE - OTHER METALS			

[147](#) 15 of 20 ESE/183.9 62.9 / -0.15 Scintrex Trace Corp.
300 Parkdale Ave.
Ottawa ON K1Y 1G2 GEN

Generator No: ON9092863
SIC Code: 811210
SIC Description: ELECTRONIC AND PRECISION EQUIPMENT REPAIR AND MAINTENANCE
Approval Years: 2014
PO Box No:
Country: Canada
Status:
Co Admin: Lorie Mills
Choice of Contact: CO_ADMIN
Phone No Admin: 2241061 Ext.229
Contam. Facility: No
MHSW Facility: No

Detail(s)

Waste Class: 112
Waste Class Desc: ACID WASTE - HEAVY METALS
Waste Class: 113
Waste Class Desc: ACID WASTE - OTHER METALS
Waste Class: 263
Waste Class Desc: ORGANIC LABORATORY CHEMICALS
Waste Class: 212
Waste Class Desc: ALIPHATIC SOLVENTS
Waste Class: 121
Waste Class Desc: ALKALINE WASTES - HEAVY METALS

[147](#) 16 of 20 ESE/183.9 62.9 / -0.15 Scintrex Trace Corp.
300 Parkdale Ave.
Ottawa ON K1Y 1G2 GEN

Generator No: ON9092863
SIC Code:
SIC Description:
Approval Years: As of Dec 2018
PO Box No:
Country: Canada
Status: Registered
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Detail(s)

Waste Class: 112 C
Waste Class Desc: Acid solutions - containing heavy metals
Waste Class: 113 C
Waste Class Desc: Acid solutions - containing other metals and non-metals
Waste Class: 121 C
Waste Class Desc: Alkaline slutions - containing heavy metals

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Desc:		148 I Misc. wastes and inorganic chemicals			
Waste Class: Waste Class Desc:		212 B Aliphatic solvents and residues			
Waste Class: Waste Class Desc:		263 A Misc. waste organic chemicals			
Waste Class: Waste Class Desc:		263 B Misc. waste organic chemicals			
Waste Class: Waste Class Desc:		263 C Misc. waste organic chemicals			
Waste Class: Waste Class Desc:		263 I Misc. waste organic chemicals			
Waste Class: Waste Class Desc:		331 I Waste compressed gases including cylinders			

[147](#) 17 of 20 **ESE/183.9** **62.9 / -0.15** **Scintrex Trace Corp.**
300 Parkdale Ave.
Ottawa ON K1Y 1G2 **GEN**

Generator No:	ON9092863	Status:	Registered
SIC Code:		Co Admin:	
SIC Description:		Choice of Contact:	
Approval Years:	As of Jul 2020	Phone No Admin:	
PO Box No:		Contam. Facility:	
Country:	Canada	MHSW Facility:	

Detail(s)

Waste Class: Waste Class Desc:	331 I Waste compressed gases including cylinders
Waste Class: Waste Class Desc:	112 C Acid solutions - containing heavy metals
Waste Class: Waste Class Desc:	263 B Misc. waste organic chemicals
Waste Class: Waste Class Desc:	263 A Misc. waste organic chemicals
Waste Class: Waste Class Desc:	148 I Misc. wastes and inorganic chemicals
Waste Class: Waste Class Desc:	121 C Alkaline slutions - containing heavy metals
Waste Class: Waste Class Desc:	113 C Acid solutions - containing other metals and non-metals
Waste Class: Waste Class Desc:	263 I Misc. waste organic chemicals
Waste Class: Waste Class Desc:	212 B Aliphatic solvents and residues
Waste Class: Waste Class Desc:	263 C Misc. waste organic chemicals

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
147	18 of 20	ESE/183.9	62.9 / -0.15	Scintrex Trace Corp. 300 Parkdale Ave. Ottawa ON K1Y 1G2	GEN
Generator No:	ON9092863			Status:	Registered
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	
Approval Years:	As of Nov 2021			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:	Canada			MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:	113 C				
Waste Class Desc:	Acid solutions - containing other metals and non-metals				
Waste Class:	212 B				
Waste Class Desc:	Aliphatic solvents and residues				
Waste Class:	331 I				
Waste Class Desc:	Waste compressed gases including cylinders				
Waste Class:	263 B				
Waste Class Desc:	Misc. waste organic chemicals				
Waste Class:	263 A				
Waste Class Desc:	Misc. waste organic chemicals				
Waste Class:	121 C				
Waste Class Desc:	Alkaline slutions - containing heavy metals				
Waste Class:	263 I				
Waste Class Desc:	Misc. waste organic chemicals				
Waste Class:	112 C				
Waste Class Desc:	Acid solutions - containing heavy metals				
Waste Class:	263 C				
Waste Class Desc:	Misc. waste organic chemicals				
Waste Class:	148 I				
Waste Class Desc:	Misc. wastes and inorganic chemicals				
147	19 of 20	ESE/183.9	62.9 / -0.15	Waste Connections of Canada Inc. as general partner for and on behalf of Ridge (Chatham) Holdings L.P. 300 Parkdale Ave Ottawa ON	SPL
Ref No:	6468-BNBSEE			Discharger Report:	
Site No:	NA			Material Group:	
Incident Dt:	2020/04/03			Health/Env Conseq:	3 - Minor Health
Year:				Client Type:	Corporation
Incident Cause:				Sector Type:	Unknown / N/A
Incident Event:	Leak/Break			Agency Involved:	
Contaminant Code:	15			Nearest Watercourse:	
Contaminant Name:	HYDRAULIC OIL			Site Address:	300 Parkdale Ave
Contaminant Limit 1:				Site District Office:	Ottawa
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:	n/a			Site Region:	Eastern
Environment Impact:				Site Municipality:	Ottawa
Nature of Impact:				Site Lot:	
Receiving Medium:				Site Conc:	
Receiving Env:	Land			Northing:	5028074.22

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Incident Reason: Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: Contaminant Qty:	No 2020/04/03 2020/07/17 Equipment Failure Asphalt lot<UNOFFICIAL> 10 -100 metres eg. Topographic Map Waste Connections: 40L hydraulic oil to asphalt, cleaned 40 L			Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:	442786.3 Map Land Spills Motor Vehicle

147	20 of 20	ESE/183.9	62.9 / -0.15	Scintrex Trace Corp. 300 Parkdale Ave. Ottawa ON K1Y 1G2	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:	ON9092863 As of Feb 2022 Canada			Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	Registered
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	212 B Aliphatic solvents and residues				
Waste Class: Waste Class Desc:	263 A Misc. waste organic chemicals				
Waste Class: Waste Class Desc:	148 I Misc. wastes and inorganic chemicals				
Waste Class: Waste Class Desc:	263 B Misc. waste organic chemicals				
Waste Class: Waste Class Desc:	331 I Waste compressed gases including cylinders				
Waste Class: Waste Class Desc:	113 C Acid solutions - containing other metals and non-metals				
Waste Class: Waste Class Desc:	121 C Alkaline slutions - containing heavy metals				
Waste Class: Waste Class Desc:	263 C Misc. waste organic chemicals				
Waste Class: Waste Class Desc:	112 C Acid solutions - containing heavy metals				
Waste Class: Waste Class Desc:	263 I Misc. waste organic chemicals				

148	1 of 1	ENE/185.8	60.9 / -2.15	161 Hinchey Ave Ottawa ON K1Y 1L5	EHS
Order No: Status: Report Type: Report Date: Date Received:	20200618031 C RSC Report (Urban) 29-JUN-20 18-JUN-20			Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X:	ON .3 -75.7308465

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Previous Site Name: Lot/Building Size: Additional Info Ordered:				Y: 45.4077394	
149	1 of 1	ENE/185.9	60.9 / -2.15	161 Hinchey Ave Ottawa Ontario Ottawa ON K1Y 1L5	EHS
Order No: 20191017137 Status: C Report Type: Standard Report Report Date: 22-OCT-19 Date Received: 17-OCT-19 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.730846 Y: 45.407739			
150	1 of 2	E/188.8	60.6 / -2.47	PRIVATE RESIDENCE 185 HINCHEY AVE. FURNACE OIL TANK OTTAWA CITY ON K1Y 1L6	SPL
Ref No: 171547 Site No: Incident Dt: 8/10/1999 Year: Incident Cause: ABOVE-GROUND TANK LEAK Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: POSSIBLE Nature of Impact: Soil contamination Receiving Medium: LAND Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 8/16/1999 Dt Document Closed: Incident Reason: UNKNOWN Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: PRIVATE RESIDENCE-UNKNW AMOUNT FURNACE OIL TO GRDBASEMENT. TANK LEAK. Contaminant Qty:		Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: 20101 Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:			
150	2 of 2	E/188.8	60.6 / -2.47	PRIVATE RESIDENCE 185 HINCHEY FURNACE OIL TANK OTTAWA CITY ON K1Y 1L6	SPL
Ref No: 171722 Site No: Incident Dt: 8/20/1999 Year: Incident Cause: UNKNOWN Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1:		Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant UN No 1: Environment Impact: NOT ANTICIPATED Nature of Impact: Receiving Medium: WATER Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 8/20/1999 Dt Document Closed: Incident Reason: UNKNOWN Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: PRIVATE RESIDENCE: UNK AMT OF FUEL OIL TO SANI, PUMPED BY SEWERMATIC. Contaminant Qty:					
Site Region: Site Municipality: 20101 Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:					
151	1 of 1	WSW/189.7	58.8 / -4.20	KEVIN WEIR 7728 36/37 CLEARVIEW TOWNSHIP NOTTAWA L0M 1P0 ON CA ON	DTNK
<u>Delisted Fuel Storage Tank</u>					
Instance No: 61523087 Status: Active Instance Type: Fuel Type: Cont Name: Capacity: 2250 Tank Material: Steel Corrosion Prot: NULL Tank Type: Single Wall UST Install Year: 1990 Facility Type: FS FUEL OIL TANK Device Installed Loc: Fuel Type 2: Fuel Type 3: Item: Item Description: Fuel Oil Tank Model: NULL Description: NULL Instance Creation Dt: 2/19/2009 Instance Install Dt: 2/19/2009 Manufacturer: NULL Serial No: NULL ULC Standard: NULL Quantity: 1 Unit of Measure: EA Parent Fac Type: TSSA Base Sched Cycle 1: NULL TSSA Base Sched Cycle 2: NULL Original Source: FST Record Date: 31-MAY-2021					
Creation Date: 7/5/2009 3:15:01 AM Overfill Prot Type: Facility Location: 7728 36/37 CLEARVIEW TOWNSHIP NOTTAWA L0M 1P0 ON CA Piping SW Steel: Piping SW Galvan: Tanks SW Steel: Piping Underground: No Underground: Max Hazard Rank: NULL Max Hazard Rank 1: NULL Nxt Period Start Dt: NULL Program Area 1: NULL Program Area 2: NULL Nxt Period Strt Dt 2: NULL Risk Based Periodic: NULL Vol of Directives: NULL Years in Service: 2.1 Created Date: 19-FEB-09 Federal Device: NULL Periodic Exempt: NULL Statutory Interval: NULL Rcomnd Insp Interval: NULL Recommended Toler: NULL Panam Venue Name: NULL External Identifier: NULL					
152	1 of 2	S/192.9	65.9 / 2.85	GUANGZHOU TRISTATE INDUSTRIAL CO LTD 64 SMIRLE AVE,,OTTAWA,ON,K1Y 0S1,CA ON	PINC
Incident Id: Incident No: 2031196 Pipe Material: Fuel Category:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Incident Reported Dt: 2/27/2017 Type: FS-Pipeline Incident Status Code: Tank Status: Pipeline Damage Reason Est Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Depth: Customer Acct Name: GUANGZHOU TRISTATE INDUSTRIAL CO LTD Incident Address: 64 SMIRLE AVE,,OTTAWA,ON,K1Y 0S1,CA Operation Type: Pipeline Type: Regulator Type: Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes: Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category: Regulator Location: Method Details:					
152	2 of 2	S/192.9	65.9 / 2.85	64 Smirle Ave Ottawa ON	SPL
Ref No: 5502-AJYNU2 Site No: NA Incident Dt: 2/27/2017 Year: Incident Cause: Incident Event: Leak/Break Contaminant Code: 35 Contaminant Name: NATURAL GAS (METHANE) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: Air MOE Response: No Dt MOE Arvl on Scn: MOE Reported Dt: 2/27/2017 Dt Document Closed: 3/1/2017 Incident Reason: Operator/Human Error Site Name: residential site<UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: TSSA - Enbridge, ½ " plastic service line damaged, made safe Contaminant Qty: 0 other - see incident description Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Miscellaneous Industrial Agency Involved: Nearest Watercourse: Site Address: 64 Smirle Ave Site District Office: Site Postal Code: Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill Source Type:					
153	1 of 1	W/196.8	58.9 / -4.10	140 Carleton Avenue Ottawa ON K1Y	EHS
Order No: 20190405156 Status: C Report Type: RSC Report (Urban) Report Date: 12-APR-19 Date Received: 05-APR-19 Previous Site Name: Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .3 X: -75.745406 Y: 45.404711					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Lot/Building Size: Additional Info Ordered:					
154	1 of 1	SW/199.1	61.9 / -1.14	Ali Tohidi and Farzin Fararooni 40 Sunnymede Ave Ottawa ON K2J 4N4	ECA
Approval No:		2003-A3ANQ6	MOE District:		
Approval Date:		2015-10-15	City:		
Status:		Approved	Longitude:		
Record Type:		ECA	Latitude:		
Link Source:		IDS	Geometry X:		
SWP Area Name:			Geometry Y:		
Approval Type:		ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS			
Project Type:		MUNICIPAL AND PRIVATE SEWAGE WORKS			
Business Name:		Ali Tohidi and Farzin Fararooni			
Address:		40 Sunnymede Ave			
Full Address:					
Full PDF Link:		https://www.accessenvironment.ene.gov.on.ca/instruments/3557-A32P9B-14.pdf			
PDF Site Location:					
155	1 of 1	E/200.9	60.9 / -2.15	ON	WWIS
Well ID:		7357175	Data Entry Status: Yes		
Construction Date:			Data Src:		
Primary Water Use:			Date Received: 4/23/2020		
Sec. Water Use:			Selected Flag: TRUE		
Final Well Status:			Abandonment Rec:		
Water Type:			Contractor: 7328		
Casing Material:			Form Version: 8		
Audit No:		C47018	Owner:		
Tag:		A215123	Street Name:		
Construction Method:			County: OTTAWA		
Elevation (m):			Municipality: NEPEAN TOWNSHIP		
Elevation Reliability:			Site Info:		
Depth to Bedrock:			Lot:		
Well Depth:			Concession:		
Overburden/Bedrock:			Concession Name:		
Pump Rate:			Easting NAD83:		
Static Water Level:			Northing NAD83:		
Flowing (Y/N):			Zone:		
Flow Rate:			UTM Reliability:		
Clear/Cloudy:					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:		2020/03/02			
Year Completed:		2020			
Depth (m):					
Latitude:		45.4051888583067			
Longitude:		-75.7292820303433			
Path:					
Bore Hole Information					
Bore Hole ID:		1008257674	Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone: 18		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 02-Mar-2020 00:00:00 Remarks: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
East83: 442928.00 North83: 5028222.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
156	1 of 1	NE/202.8	54.1 / -8.88	Canada Lands Company CLC Limited Lot: 21-25, Concession: 1 on Ottawa River, Geographic Township: GLOUCESTER, Ottawa, City CITY OF OTTAWA ON	PTTW
EBR Registry No: 012-4134 Ministry Ref No: 7044-9W9JMA Notice Type: Instrument\Decision Notice Stage: Notice Date: July\13,\2016 Proposal Date: May\12,\2015 Year: 2015 Instrument Type: (OWRA\ss.\s34)\s-\sPermit\sto\sTake\sWater Off Instrument Name: Posted By: Company Name: Canada\sLands\sCompany\sCLC\sLimited Site Address: Location Other: Proponent Name: Proponent Address: 30\sMetcalf\sStreet,\sSuite\s601,\sOttawa\sOntario,\sCanada\sK1P\s5L4 Comment Period: URL: Site Location Details: Lot: 21-25, Concession: 1 on Ottawa River, Geographic Township: GLOUCESTER, Ottawa, City CITY OF OTTAWA					
Decision Posted: Exception Posted: Section: Act 1: Act 2: Site Location Map:					
157	1 of 1	WSW/202.9	60.9 / -2.12	quality building services 213 cowley ave ottawa ON K1Y 0G8	GEN
Generator No: ON2283445 SIC Code: 814110 SIC Description: Private Households Approval Years: 05 PO Box No: Country:					
Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
Detail(s)					
Waste Class: 221 Waste Class Desc: LIGHT FUELS					
158	1 of 1	E/203.1	60.9 / -2.15	172 CARRUTHERS ST. ON	WWIS
Well ID: 7145161 Data Entry Status:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Construction Date: Primary Water Use: Monitoring Sec. Water Use: Final Well Status: 0 Water Type: Casing Material: Audit No: Z84151 Tag: A093256 Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy:			Data Src: Date Received: 5/21/2010 Selected Flag: TRUE Abandonment Rec: Contractor: 7201 Form Version: 7 Owner: Street Name: 172 CARRUTHERS ST. County: OTTAWA Municipality: OTTAWA CITY Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:		
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/714\7145161.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: Year Completed: Depth (m): Latitude: Longitude: Path:		2010/04/16 2010 6.096 45.4053868705221 -75.7292845783061 714\7145161.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID: DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:		1002984209 16-Apr-2010 00:00:00 			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:		3.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003177295			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:		26			
Mat3 Desc:		ROCK			
Formation Top Depth:		3.0			
Formation End Depth:		20.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003177299			
Layer:		3			
Plug From:		10.0			
Plug To:		13.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003177297			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003177298			
Layer:		2			
Plug From:		1.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003177300			
Layer:		4			
Plug From:		13.0			
Plug To:		20.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1003177305			
Method Construction Code:		7			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction:		Diamond			
Other Method Construction:					
Pipe Information					
Pipe ID:		1003177293			
Casing No:		0			
Comment:					
Alt Name:					
Construction Record - Casing					
Casing ID:		1003177302			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		10.0			
Casing Diameter:		3.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
Construction Record - Screen					
Screen ID:		1003177303			
Layer:		1			
Slot:		.01			
Screen Top Depth:		10.0			
Screen End Depth:		20.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		3.5			
Water Details					
Water ID:		1003177301			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
Hole Diameter					
Hole ID:		1003177296			
Diameter:		5.5			
Depth From:		0.0			
Depth To:		20.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
159	1 of 15	E/206.7	60.9 / -2.15	Hydro One Networks Inc. Hinchey TS 172 Carruthers Avenue Ottawa ON	GEN
Generator No:		ON7103137		Status:	
SIC Code:		221121		Co Admin:	
SIC Description:		Electric Bulk Power Transmission & Control		Choice of Contact:	
Approval Years:		03,04,05,06,07,08		Phone No Admin:	
PO Box No:				Contam. Facility:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
Waste Class:		243			
Waste Class Desc:		PCB'S			
Waste Class:		243			
Waste Class Desc:		PCB'S			
Waste Class:		146			
Waste Class Desc:		OTHER SPECIFIED INORGANICS			
Waste Class:		150			
Waste Class Desc:		INERT INORGANIC WASTES			
159	2 of 15	E/206.7	60.9 / -2.15	Hydro One Networks Inc. Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON	GEN
Generator No:	ON7103137			Status:	
SIC Code:	221122			Co Admin:	
SIC Description:	Electric Power Distribution			Choice of Contact:	
Approval Years:	2009			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		146			
Waste Class Desc:		OTHER SPECIFIED INORGANICS			
Waste Class:		150			
Waste Class Desc:		INERT INORGANIC WASTES			
Waste Class:		243			
Waste Class Desc:		PCBS			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
159	3 of 15	E/206.7	60.9 / -2.15	Hydro One Networks Inc. Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON	GEN
Generator No:	ON7103137			Status:	
SIC Code:	221122			Co Admin:	
SIC Description:	Electric Power Distribution			Choice of Contact:	
Approval Years:	2010			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Desc: 150 INERT INORGANIC WASTES Waste Class: Waste Class Desc: 243 PCBS Waste Class: Waste Class Desc: 146 OTHER SPECIFIED INORGANICS					
159	4 of 15	E/206.7	60.9 / -2.15	Hydro One Networks Inc. Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: ON7103137 221122 Electric Power Distribution 2011 Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: Waste Class Desc: 251 OIL SKIMMINGS & SLUDGES Waste Class: Waste Class Desc: 243 PCBS Waste Class: Waste Class Desc: 146 OTHER SPECIFIED INORGANICS Waste Class: Waste Class Desc: 150 INERT INORGANIC WASTES					
159	5 of 15	E/206.7	60.9 / -2.15	Hydro One Networks Inc. Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: ON7103137 221122 Electric Power Distribution 2012 Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: Waste Class Desc: 243 PCBS Waste Class: Waste Class Desc: 150 INERT INORGANIC WASTES Waste Class: Waste Class Desc: 146 OTHER SPECIFIED INORGANICS Waste Class: Waste Class Desc: 251 OIL SKIMMINGS & SLUDGES					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
159	6 of 15	E/206.7	60.9 / -2.15	Hydro One Networks Inc. Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON	GEN
Generator No: ON7103137				Status:	
SIC Code: 221122				Co Admin:	
SIC Description: ELECTRIC POWER DISTRIBUTION				Choice of Contact:	
Approval Years: 2013				Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
Detail(s)					
Waste Class:		150			
Waste Class Desc:		INERT INORGANIC WASTES			
Waste Class:		146			
Waste Class Desc:		OTHER SPECIFIED INORGANICS			
Waste Class:		243			
Waste Class Desc:		PCBS			
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
159	7 of 15	E/206.7	60.9 / -2.15	Hydro One Networks Inc. 172 Carruthers Street Ottawa K1Y 1N7 CITY OF OTTAWA ON	EBR
EBR Registry No: 012-2783				Decision Posted:	
Ministry Ref No: 0750-9P3L3V				Exception Posted:	
Notice Type: Instrument Decision				Section:	
Notice Stage:				Act 1:	
Notice Date: February 09, 2015				Act 2:	
Proposal Date: October 09, 2014				Site Location Map:	
Year: 2014					
Instrument Type:		(EPA Part II.1-air) - Environmental Compliance Approval (project type: air)			
Off Instrument Name:					
Posted By:					
Company Name:		Hydro One Networks Inc.			
Site Address:					
Location Other:					
Proponent Name:					
Proponent Address:		483 Bay Street , TCT 06 S, Toronto Ontario, Canada M5G 2P5			
Comment Period:					
URL:					
Site Location Details:					
172 Carruthers Street Ottawa K1Y 1N7 CITY OF OTTAWA					
159	8 of 15	E/206.7	60.9 / -2.15	Hydro One Networks Inc. 172 Carruthers St Ottawa ON K1Y1N7	ECA
Approval No: 4496-9SHHEY				MOE District:	
Approval Date: 1/27/15				City:	Ottawa
Status: Approved				Longitude:	-75.72861111111111068794343736954033374 786376953125
Record Type:				Latitude:	45.4052777777777629353295196779072284

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Link Source: SWP Area Name: Approval Type: Project Type: Business Name: Address: Full Address: Full PDF Link: PDF Site Location:					698486328125
Geometry X: Geometry Y:					
Air/Noise Hydro One Networks Inc. Hinchey Transformer Station 172 Carruthers St Ottawa City, K1Y1N7					
159	9 of 15	E/206.7	60.9 / -2.15	Hydro One Networks Inc. 172 Carruthers St Ottawa ON M5G 2P5	ECA
Approval No: Approval Date: Status: Record Type: Link Source: SWP Area Name: Approval Type: Project Type: Business Name: Address: Full Address: Full PDF Link: PDF Site Location:					4496-9SHHEY 2015-01-27 Approved ECA IDS Rideau Valley ECA-AIR AIR Hydro One Networks Inc. 172 Carruthers St https://www.accessenvironment.ene.gov.on.ca/instruments/0750-9P3L3V-14.pdf
MOE District: City: Longitude: Latitude: Geometry X: Geometry Y:					Ottawa -75.72865 45.40521
159	10 of 15	E/206.7	60.9 / -2.15	Hydro One Networks Inc. Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON K1Y 1N7	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:					ON7103137 221122 ELECTRIC POWER DISTRIBUTION 2016 Canada
Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					Mike Harvey CO_ADMIN 866-782-4489 Ext. No No
Detail(s)					
Waste Class: Waste Class Desc:					243 PCBS
Waste Class: Waste Class Desc:					146 OTHER SPECIFIED INORGANICS
Waste Class: Waste Class Desc:					150 INERT INORGANIC WASTES
Waste Class: Waste Class Desc:					251 OIL SKIMMINGS & SLUDGES
159	11 of 15	E/206.7	60.9 / -2.15	Hydro One Networks Inc. Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON K1Y 1N7	GEN
Generator No:					ON7103137
Status:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Code: SIC Description: Approval Years: PO Box No: Country:	221122 ELECTRIC POWER DISTRIBUTION 2015 Canada			Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	Mike Harvey CO_ADMIN 866-782-4489 Ext. No No
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	251 OIL SKIMMINGS & SLUDGES				
Waste Class: Waste Class Desc:	150 INERT INORGANIC WASTES				
Waste Class: Waste Class Desc:	243 PCBS				
Waste Class: Waste Class Desc:	146 OTHER SPECIFIED INORGANICS				
<u>159</u>	12 of 15	E/206.7	60.9 / -2.15	Hydro One Networks Inc. Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON K1Y 1N7	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:	ON7103137 221122 ELECTRIC POWER DISTRIBUTION 2014 Canada			Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	Mike Harvey CO_ADMIN 866-782-4489 Ext. No No
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	251 OIL SKIMMINGS & SLUDGES				
Waste Class: Waste Class Desc:	146 OTHER SPECIFIED INORGANICS				
Waste Class: Waste Class Desc:	150 INERT INORGANIC WASTES				
Waste Class: Waste Class Desc:	243 PCBS				
<u>159</u>	13 of 15	E/206.7	60.9 / -2.15	Hydro One Networks Inc. Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON K1Y 1N7	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country:	ON7103137 As of Dec 2018 Canada			Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:	Registered Registered
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	146 L Other specified inorganic sludges, slurries or solids				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Desc: 243 D PCB Waste Class: Waste Class Desc: 251 L Waste oils/sludges (petroleum based) Waste Class: Waste Class Desc: 251 T Waste oils/sludges (petroleum based)					
159	14 of 15	E/206.7	60.9 / -2.15	Hydro One Networks Inc. Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON K1Y 1N7	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: ON7103137 As of Jul 2020 Canada Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility: Registered					
<u>Detail(s)</u>					
Waste Class: Waste Class Desc: 251 L Waste oils/sludges (petroleum based) Waste Class: Waste Class Desc: 243 D PCB Waste Class: Waste Class Desc: 251 T Waste oils/sludges (petroleum based) Waste Class: Waste Class Desc: 146 L Other specified inorganic sludges, slurries or solids					
159	15 of 15	E/206.7	60.9 / -2.15	Hydro One Networks Inc. Hinchey Transformer Station 172 Carruthers Avenue Ottawa ON K1Y 1N7	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: ON7103137 As of Nov 2021 Canada Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility: Registered					
<u>Detail(s)</u>					
Waste Class: Waste Class Desc: 146 L Other specified inorganic sludges, slurries or solids Waste Class: Waste Class Desc: 243 D PCB Waste Class: Waste Class Desc: 251 L Waste oils/sludges (petroleum based) Waste Class: Waste Class Desc: 251 T Waste oils/sludges (petroleum based)					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
160	1 of 1	ESE/208.9	62.9 / -0.15	ON	WWIS
Well ID: 7122598 Construction Date: Primary Water Use: Sec. Water Use: Final Well Status: 0 Water Type: Casing Material: Audit No: Tag: A076171 Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy: Data Entry Status: Data Src: Date Received: 3/11/2009 Selected Flag: TRUE Abandonment Rec: Contractor: 6894 Form Version: 5 Owner: Street Name: County: OTTAWA Municipality: OTTAWA CITY Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 2008/12/21 Year Completed: 2008 Depth (m): Latitude: 45.4030048533515 Longitude: -75.7315794880039 Path:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1002420138 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 21-Dec-2008 00:00:00 Remarks: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 18 East83: 442746.00 North83: 5027981.00 Org CS: G83 UTMRC: 3 UTMRC Desc: margin of error : 10 - 30 m Location Method: wwr					
<u>Method of Construction & Well Use</u>					
Method Construction ID: 1002758163 Method Construction Code: Method Construction: Other Method Construction:					
161	1 of 1	SW/213.2	64.9 / 1.91	ENBRIDGE GAS INC	PINC

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
				1786 SCOTT ST,,OTTAWA,ON,K1Y 2N7,CA ON	
Incident Id: Incident No: 2957442 Incident Reported Dt: 11/9/2020 Type: FS-Pipeline Incident Status Code: Tank Status: Pipeline Damage Reason Est Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Depth: Customer Acct Name: ENBRIDGE GAS INC Incident Address: 1786 SCOTT ST,,OTTAWA,ON,K1Y 2N7,CA Operation Type: Pipeline Type: Regulator Type: Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes:		Pipe Material: Fuel Category: Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category: Regulator Location: Method Details:			

162

1 of 1

E/214.9

60.9 / -2.15

ON

WWIS

Well ID:

7211100

Construction Date:

Primary Water Use:

Sec. Water Use:

Final Well Status:

Water Type:

Casing Material:

Audit No:

C21776

Tag:

A093256

Construction Method:

Elevation (m):

Elevation Reliability:

Depth to Bedrock:

Well Depth:

Overburden/Bedrock:

Pump Rate:

Static Water Level:

Flowing (Y/N):

Flow Rate:

Clear/Cloudy:

Data Entry Status:

Yes

Data Src:

Date Received:

11/12/2013

Selected Flag:

TRUE

Abandonment Rec:

Contractor:

7303

Form Version:

8

Owner:

Street Name:

County:

OTTAWA

Municipality:

NEPEAN TOWNSHIP

Site Info:

Lot:

Concession:

Concession Name:

Easting NAD83:

Northing NAD83:

Zone:

UTM Reliability:

PDF URL (Map):

Additional Detail(s) (Map)

Well Completed Date:

2013/10/02

Year Completed:

2013

Depth (m):

Latitude:

45.4057291363524

Longitude:

-75.7292506473113

Path:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1004631196			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442931.00
Code OB Desc:				North83:	5028282.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	02-Oct-2013 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
163	1 of 1	S/218.3	66.9 / 3.85	66 Ross Avenue, Ottawa ON	PINC
Incident Id:	2652760			Pipe Material:	Plastic
Incident No:	496448			Fuel Category:	Natural Gas
Incident Reported Dt:				Health Impact:	No
Type:	FS-Pipeline Incident			Environment Impact:	No
Status Code:	Pipeline Damage Reason Est			Property Damage:	Yes
Tank Status:	RC Established			Service Interrupt:	Yes
Task No:	3156922			Enforce Policy:	Yes
Spills Action Centre:				Public Relation:	No
Fuel Type:	Natural Gas			Pipeline System:	
Fuel Occurrence Tp:	Pipeline Strike			PSIG:	53
Date of Occurrence:	9/3/2010 0:00			Attribute Category:	FS-Perform P-line Inc Invest
Occurrence Start Dt:	2011/05/16			Regulator Location:	Outside
Depth:	25			Method Details:	E-mail
Customer Acct Name:					
Incident Address:					
Operation Type:	Construction Site (pipeline strike)				
Pipeline Type:	Service / Riser Distribution Pipeline				
Regulator Type:	Service Regulator (up to 60 psi intake)				
Summary:	66 Ross Avenue, Ottawa - 1/2" Pipeline Hit				
Reported By:	Alan Armstrong - Enbridge				
Affiliation:	Industry Stakeholder (Licensee/Registration/Certificate Holder, Facility Owner, etc.)				
Occurrence Desc:	linestrike no locates				
Damage Reason:	No notification made to the one call center				
Notes:	no locate				
164	1 of 2	ENE/218.4	60.9 / -2.15	S. 21(1)(f) 58 Carruthers Avenue Ottawa ON K1Y 1N2	SPL
Ref No:	7536-7A9Q2M			Discharger Report:	
Site No:				Material Group:	Oil
Incident Dt:				Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:	Tank (Above Ground) Leak			Sector Type:	Other Storage Facility
Incident Event:				Agency Involved:	
Contaminant Code:	13			Nearest Watercourse:	
Contaminant Name:	FURNACE OIL			Site Address:	
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:	Confirmed			Site Municipality:	Ottawa

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Nature of Impact: soil contamination Receiving Medium: Land Receiving Env: MOE Response: No Field Response Dt MOE Arvl on Scn: MOE Reported Dt: 12/26/2007 Dt Document Closed: 1/4/2008 Incident Reason: Corrosion - All forms of internal/external corrosion Site Name: Basement<UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: 38 Carruthers Ave - spill to bsmt Contaminant Qty: 4.5 L Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:					
164	2 of 2	ENE/218.4	60.9 / -2.15	58 CARRUTHERS AVENUE OTTAWA ON K1Y 1N2	HINC
External File Num: FS INC 0712-07805 Fuel Occurrence Type: Leak Date of Occurrence: 12/12/2007 Fuel Type Involved: Fuel Oil Status Desc: Completed - No Action Required Job Type Desc: Incident/Near-Miss Occurrence (FS) Oper. Type Involved: Private Dwelling Service Interruptions: No Property Damage: No Fuel Life Cycle Stage: Utilization Root Cause: Reported Details: Fuel Category: Liquid Fuel Occurrence Type: Incident Affiliation: Member of the General Public County Name: Ottawa Approx. Quant. Rel: Nearby body of water: Enter Drainage Syst.: Approx. Quant. Unit: Environmental Impact:					
165	1 of 2	SSE/219.9	64.8 / 1.79	RUFUS O RAMBHARACK 67 SMIRLE AVE,,OTTAWA,ON,K1Y 0S2,CA ON	PINC
Incident Id: Incident No: 1927924 Incident Reported Dt: 8/23/2016 Type: FS-Pipeline Incident Status Code: Tank Status: Pipeline Damage Reason Est Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Depth: Customer Acct Name: RUFUS O RAMBHARACK Incident Address: 67 SMIRLE AVE,,OTTAWA,ON,K1Y 0S2,CA Operation Type: Pipeline Type: Regulator Type: Pipe Material: Fuel Category: Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category: Regulator Location: Method Details:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes:					
165	2 of 2	SSE/219.9	64.8 / 1.79	67 Smirle Ave Ottawa ON	SPL
Ref No: 1282-AD3KS5 Site No: NA Incident Dt: 8/22/2016 Year: Incident Cause: Incident Event: Leak/Break Contaminant Code: 35 Contaminant Name: METHANE GAS Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: Air MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 8/22/2016 Dt Document Closed: Incident Reason: Operator/Human Error Site Name: tssa<UNOFFICIAL> Site County/District: Site Geo Ref Meth: Incident Summary: TSSA 67 Smirle Ave, Ottawa line strike made safe Contaminant Qty: 1 number (count)					
Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Miscellaneous Communal Agency Involved: Nearest Watercourse: Site Address: 67 Smirle Ave Site District Office: Site Postal Code: Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill Source Type:					
166	1 of 1	ENE/221.2	60.9 / -2.15	52 CARRUTHERS AVE Ottawa ON	WWIS
Well ID: 7201623 Construction Date: Primary Water Use: Monitoring and Test Hole Sec. Water Use: Final Well Status: Test Hole Water Type: Casing Material: Audit No: Z151017 Tag: A145384 Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy:					
Data Entry Status: Data Src: Date Received: 5/15/2013 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: Street Name: 52 CARRUTHERS AVE County: OTTAWA Municipality: OTTAWA CITY Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/720\7201623.pdf					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2013/04/05			
Year Completed:		2013			
Depth (m):		4.88			
Latitude:		45.4085453453672			
Longitude:		-75.7308459307206			
Path:		720\7201623.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1004301252			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442809.00
Code OB Desc:				North83:	5028596.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	05-Apr-2013 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1004835351				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	11				
Most Common Material:	GRAVEL				
Mat2:	02				
Mat2 Desc:	TOPSOIL				
Mat3:	85				
Mat3 Desc:	SOFT				
Formation Top Depth:	0.0				
Formation End Depth:	0.6100000143051147				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1004835352				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:					
Mat2 Desc:					
Mat3:	71				
Mat3 Desc:	FRACTURED				
Formation Top Depth:	0.6100000143051147				
Formation End Depth:	4.880000114440918				
Formation End Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004835363			
Layer:		3			
Plug From:		1.5199999809265137			
Plug To:		4.880000114440918			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004835362			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.5199999809265137			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004835361			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004835360			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004835350			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004835356			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.8300000429153442			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1004835357			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.8300000429153442			
Screen End Depth:		4.880000114440918			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Material:	5				
Screen Depth UOM:	m				
Screen Diameter UOM:	cm				
Screen Diameter:	6.03000020980835				
<u>Water Details</u>					
Water ID:	1004835355				
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:	m				
<u>Hole Diameter</u>					
Hole ID:	1004835353				
Diameter:	11.430000305175781				
Depth From:	0.0				
Depth To:	1.2200000286102295				
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
<u>Hole Diameter</u>					
Hole ID:	1004835354				
Diameter:	7.619999885559082				
Depth From:	1.2200000286102295				
Depth To:	4.880000114440918				
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
167	1 of 2	ENE/222.4	60.9 / -2.15	56 Carruthers Avenue Ottawa ON K1Y 1N2	SPL
Ref No:	3252-79V3XQ			Discharger Report:	
Site No:				Material Group:	Oil
Incident Dt:				Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:				Sector Type:	private residence
Incident Event:				Agency Involved:	
Contaminant Code:	13			Nearest Watercourse:	
Contaminant Name:	FURNACE OIL			Site Address:	
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:	Not Anticipated			Site Municipality:	Ottawa
Nature of Impact:	soil contamination			Site Lot:	
Receiving Medium:	land			Site Conc:	
Receiving Env:				Northing:	5028636
MOE Response:	Referral to others			Easting:	442827
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:	12/13/2007			Site Map Datum:	
Dt Document Closed:				SAC Action Class:	
Incident Reason:				Source Type:	
Site Name:	56 Carruthers Avenue<UNOFFICIAL>				
Site County/District:					
Site Geo Ref Meth:					
Incident Summary:	Private Residence-Ukn Qty Furnace Oil to Ground,Tank Leak.				
Contaminant Qty:	5 l				

356 erisinfo.com | Environmental Risk Information Services Order No: 22062900235

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Type: Status Code: Tank Status: Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Depth: Customer Acct Name: Incident Address: Operation Type: Pipeline Type: Regulator Type: Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes:	FS-Pipeline Incident Pipeline Damage Reason Est			Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category: Regulator Location: Method Details: OTTAWA GREENBELT CONSTRUCTION LTD 74 CAROLINE AVE.,OTTAWA,ON,K1Y 0S7,CA	
169	2 of 2	SSE/224.9	64.9 / 1.84	Enbridge Gas Distribution Inc. 74 Caroline Ave. Ottawa ON	SPL
Ref No: Site No: Incident Dt: Year: Incident Cause: Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Incident Reason: Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: Contaminant Qty:	3234-ACYH55 NA 8/19/2016 Leak/Break 35 NATURAL GAS (METHANE) Air 8/19/2016 Operator/Human Error 74 Caroline Ave.<UNOFFICIAL> TSSA FSB: 1/2" plastic linestrike 0 other - see incident description			Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:	Miscellaneous Industrial 74 Caroline Ave. Ottawa TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill
170	1 of 2	ENE/224.9	59.9 / -3.15	JOHANNES POTHUMA 80 CARRUTHERS AVE. OTTAWA ON K1Y 1N2	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No:	ON1024000 6542 BICYCLE SHOPS 88,89,90			Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
170	2 of 2	ENE/224.9	59.9 / -3.15	JOHANNES POTHUMA 22-285 80 CARRUTHERS AVE. OTTAWA ON K1Y 1N2	GEN
Generator No:	ON1024000			Status:	
SIC Code:	6542			Co Admin:	
SIC Description:	BICYCLE SHOPS			Choice of Contact:	
Approval Years:	92,93,94,95,96,97,98			Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Desc:		PETROLEUM DISTILLATES			
171	1 of 1	S/225.3	65.9 / 2.85	Spencer St between Holland Ave and Western Rd Ottawa ON	EHS
Order No:	20150304110			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	ON
Report Date:	28-MAY-15			Search Radius (km):	.15
Date Received:	04-MAR-15			X:	-75.736754
Previous Site Name:				Y:	45.400628
Lot/Building Size:					
Additional Info Ordered:					
172	1 of 1	SW/227.0	64.6 / 1.54	PRIVATE OWNER 1790 SCOTT ST. MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON K1Y 2N7	SPL
Ref No:	84197			Discharger Report:	
Site No:				Material Group:	
Incident Dt:	4/18/1993			Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:	OTHER CAUSE (N.O.S.)			Sector Type:	
Incident Event:				Agency Involved:	
Contaminant Code:				Nearest Watercourse:	
Contaminant Name:				Site Address:	
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:	POSSIBLE			Site Municipality:	20101
Nature of Impact:	Soil contamination			Site Lot:	
Receiving Medium:	LAND			Site Conc:	
Receiving Env:				Nothing:	
MOE Response:				Easting:	WORKS
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:	4/18/1993			Site Map Datum:	
Dt Document Closed:				SAC Action Class:	
Incident Reason:	INTENTIONAL/PLANNED			Source Type:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: PRIVATE OWNER-4L WASTE MOTOR OIL ONTO GROUND & COVERED,WORKS,CLEANED UP. Contaminant Qty:					
173	1 of 1	E/227.4	60.9 / -2.15	ON	WWIS
Well ID: 7242495 Construction Date: Primary Water Use: Sec. Water Use: Final Well Status: Water Type: Casing Material: Audit No: C22563 Tag: A142470 Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy: Data Entry Status: Yes Data Src: Date Received: 6/5/2015 Selected Flag: TRUE Abandonment Rec: Contractor: 1844 Form Version: 8 Owner: Street Name: County: OTTAWA Municipality: NEPEAN TOWNSHIP Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability: PDF URL (Map): Additional Detail(s) (Map) Well Completed Date: 2014/03/18 Year Completed: 2014 Depth (m): Latitude: 45.4052719839893 Longitude: -75.7289508639688 Path: Bore Hole Information Bore Hole ID: 1005398401 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 18-Mar-2014 00:00:00 Remarks: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 18 East83: 442954.00 North83: 5028231.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
174	1 of 1	ENE/227.6	60.9 / -2.15	52 CARRUTHERS AVENUE Ottawa ON	WWIS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well ID:	7207343			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:				Date Received:	9/4/2013
Sec. Water Use:				Selected Flag:	TRUE
Final Well Status:	0			Abandonment Rec:	
Water Type:				Contractor:	6964
Casing Material:				Form Version:	7
Audit No:	Z170501			Owner:	
Tag:	A137249			Street Name:	52 CARRUTHERS AVENUE
Construction Method:				County:	
Elevation (m):				Municipality:	
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					

Bore Hole Information

Bore Hole ID:	1004558658	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	
Code OB:		East83:	
Code OB Desc:		North83:	
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	9
Date Completed:	12-Mar-2013 00:00:00	UTMRC Desc:	unknown UTM
Remarks:		Location Method:	wwr
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID:	1004587099
Layer:	3
Color:	
General Color:	
Mat1:	15
Most Common Material:	LIMESTONE
Mat2:	26
Mat2 Desc:	ROCK
Mat3:	
Mat3 Desc:	
Formation Top Depth:	0.6100000143051147
Formation End Depth:	4.199999809265137
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1004587098
Layer:	2
Color:	
General Color:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat1:		01			
Most Common Material:		FILL			
Mat2:		81			
Mat2 Desc:		SANDY			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.05000000074505806			
Formation End Depth:		0.6100000143051147			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004587097			
Layer:		1			
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.05000000074505806			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004587106			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004587107			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		1.5			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004587108			
Layer:		3			
Plug From:		1.5			
Plug To:		4.199999809265137			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004587105			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		1004587096			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004587103			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.149999976158142			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1004587104			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.149999976158142			
Screen End Depth:		4.199999809265137			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.0			
<u>Water Details</u>					
Water ID:		1004587102			
Layer:		1			
Kind Code:					
Kind:					
Water Found Depth:		2.809999942779541			
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1004587100			
Diameter:		11.199999809265137			
Depth From:		0.0			
Depth To:		0.800000011920929			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1004587101			
Diameter:		9.5			
Depth From:		0.800000011920929			
Depth To:		4.199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
175	1 of 1	E/229.7	60.9 / -2.15	178 Carruthers Ave Ottawa ON K1Y1N7	EHS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Order No: 20140304049 Status: C Report Type: Standard Select Report Report Date: 13-MAR-14 Date Received: 04-MAR-14 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; Title Searches; City Directory					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.728932 Y: 45.405344					
176	1 of 1	ESE/231.0	62.9 / -0.15	312 Parkdale Avenue Ottawa ON K1Y 4X9	EHS
Order No: 20190121144 Status: C Report Type: Standard Report Report Date: 28-JAN-19 Date Received: 21-JAN-19 Previous Site Name: Unknown Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory; Aerial Photos					
Nearest Intersection: Municipality: Ottawa Client Prov/State: ON Search Radius (km): .25 X: -75.731046 Y: 45.402961					
177	1 of 1	E/232.8	59.9 / -3.15	142 Carruthers Ave Ottawa ON K1Y1N5	EHS
Order No: 20151130023 Status: C Report Type: Custom Report Report Date: 03-DEC-15 Date Received: 30-NOV-15 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.729355 Y: 45.406361					
178	1 of 1	WSW/233.3	61.2 / -1.82	OTTAWA CITY - CARLETON AVE. SUNNYMEDE AVE./COWLEY AVE. OTTAWA CITY ON	CA
Certificate #: 3-1002-92- Application Year: 92 Issue Date: 8/11/1992 Approval Type: Municipal sewage Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
179	1 of 1	ESE/233.7	61.9 / -1.15	ENTRO BUILDING SYSTEMS INC. 286 HINCHEY AVE OTTAWA ON K1Y 1M2	SC7
Established: 1988 Plant Size (ft²): 2300 Employment: 5					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
--Details--					
Description:		MILLWORK			
SIC/NAICS Code:		2431			
Description:		GLASS PRODUCTS, MADE OF PURCHASED GLASS			
SIC/NAICS Code:		3231			
Description:		HARDWARE, NOT ELSEWHERE CLASSIFIED			
SIC/NAICS Code:		3429			
Description:		METAL DOORS, SASH, FRAMES, MOLDING, AND TRIM			
SIC/NAICS Code:		3442			
Description:		Wood Window and Door Manufacturing			
SIC/NAICS Code:		321911			
Description:		Glass Product Manufacturing from Purchased Glass			
SIC/NAICS Code:		327215			
Description:		Metal Window and Door Manufacturing			
SIC/NAICS Code:		332321			
Description:		Hardware Manufacturing			
SIC/NAICS Code:		332510			
180	1 of 1	ESE/234.1	62.9 / -0.15	312 Parkdale Avenue Ottawa ON K1Y 4X9	EHS
Order No:	20200806163			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	11-AUG-20			Search Radius (km):	.25
Date Received:	06-AUG-20			X:	-75.7306797
Previous Site Name:				Y:	45.4031231
Lot/Building Size:					
Additional Info Ordered:					
181	1 of 1	ESE/235.6	61.9 / -1.15	Patrick John Mills 284 Hinchey Ave 286 Hinchey Avenue Ottawa ON K1Y 1M2	ECA
Approval No:	9227-A5WQHU			MOE District:	
Approval Date:	2016-01-25			City:	
Status:	Approved			Longitude:	
Record Type:	ECA			Latitude:	
Link Source:	IDS			Geometry X:	
SWP Area Name:				Geometry Y:	
Approval Type:	ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS				
Project Type:	MUNICIPAL AND PRIVATE SEWAGE WORKS				
Business Name:	Patrick John Mills				
Address:	284 Hinchey Ave 286 Hinchey Avenue				
Full Address:					
Full PDF Link:	https://www.accessenvironment.ene.gov.on.ca/instruments/9841-A58KDF-14.pdf				
PDF Site Location:					
182	1 of 2	W/235.8	57.1 / -5.89	OTTAWA CITY COWLEY AVE./PONTIAC ST. OTTAWA CITY ON	CA

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Certificate #: 3-0063-99- Application Year: 99 Issue Date: 2/11/1999 Approval Type: Municipal sewage Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
182	2 of 2	W/235.8	57.1 / -5.89	R.M. OF OTTAWA-CARLETON PONTIAC ST./COWLEY ST. OTTAWA CITY ON	CA
Certificate #: 7-0031-99- Application Year: 99 Issue Date: 2/11/1999 Approval Type: Municipal water Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
183	1 of 1	E/236.2	61.2 / -1.84	261A Hinchey Avenue Ottawa ON K1Y 1L9	EHS
Order No: 20190320134 Status: C Report Type: Standard Report Report Date: 25-MAR-19 Date Received: 20-MAR-19 Previous Site Name: Lot/Building Size: Additional Info Ordered: City Directory Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.72893 Y: 45.404537					
184	1 of 1	E/236.7	60.9 / -2.15	PRIVATE OWNER 188 CARRUTHERS STREET STORAGE TANK/BARREL OTTAWA CITY ON K1Y 1N7	SPL
Ref No: 40360 Site No: Incident Dt: 8/26/1990 Year: Incident Cause: ABOVE-GROUND TANK LEAK Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Environment Impact: CONFIRMED Nature of Impact: Soil contamination Receiving Medium: LAND Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 9/5/1990 Dt Document Closed: Incident Reason: CORROSION Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: 850 L FURNACE OIL TO GROUND FROM LEAKY TANK Contaminant Qty:					
Site Municipality: 20101 Site Lot: Site Conc: Northing: Easting: CITY,MOE, INSURANCE Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:					
185	1 of 1	SE/240.0	63.9 / 0.85	CCC476 45 Holland Ave. Ottawa ON K1Y 4S3	GEN
Generator No: ON5891121 SIC Code: 531120 SIC Description: Lessors of Non-Residential Buildings (except Mini-Warehouses) Approval Years: 07,08 PO Box No: Country:					
Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
Detail(s)					
Waste Class: 251 Waste Class Desc: OIL SKIMMINGS & SLUDGES					
186	1 of 1	S/240.9	66.9 / 3.85	PRIVATE RESIDENCE 64 GRANGE AVE., RONALD MOLSON FURNACE OIL TANK OTTAWA CITY ON K1Y 0N9	SPL
Ref No: 131089 Site No: Incident Dt: // Year: Incident Cause: ABOVE-GROUND TANK LEAK Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: POSSIBLE Nature of Impact: Multi Media Pollution Receiving Medium: LAND Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 8/28/1996 Dt Document Closed: Incident Reason: CORROSION Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: PRIV. RESID.- 135 L OF FURNACE OIL TO BASEMENT GRAVEL FLOOR & DRAIN Contaminant Qty:					
Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: 20101 Site Lot: Site Conc: Northing: Easting: MCCR Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
187	1 of 1	SSE/242.7	65.9 / 2.85	Barbara Connor<UNOFFICIAL> 72 Smirle Avenue Ottawa ON K1Y 0S3	SPL
Ref No: 3322-66URTG Site No: Incident Dt: 11/18/2004 Year: Incident Cause: Pipe Or Hose Leak Incident Event: Contaminant Code: 13 Contaminant Name: FURNACE OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Not Anticipated Nature of Impact: Other Impact(s); Soil Contamination Receiving Medium: Land Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 11/18/2004 Dt Document Closed: Incident Reason: Equipment Failure Site Name: S.21 Site County/District: Site Geo Ref Meth: Incident Summary: Priv.res., furnace oil to basement Contaminant Qty:		Discharger Report: Material Group: Oil Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Ottawa Site Postal Code: Site Region: Eastern Site Municipality: Ottawa Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: M.C.B.S. - Fuel Safety; Spills Source Type:			
188	1 of 1	ENE/243.5	59.9 / -3.15	The Corporation of the City of Ottawa Carruthers Ave., Hinchey Ave. & Lyndale Ave. Ottawa ON K1N 5A1	ECA
Approval No: 2010-4KNPH8 Approval Date: 2000-05-31 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Rideau Valley Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS Business Name: The Corporation of the City of Ottawa Address: Carruthers Ave., Hinchey Ave. & Lyndale Ave. Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/5380-4KEN3T-14.pdf PDF Site Location:		MOE District: Ottawa City: Longitude: -75.7249 Latitude: 45.3989 Geometry X: Geometry Y:			
189	1 of 1	E/246.2	60.9 / -2.15	ON	WWIS
Well ID: 7198961 Construction Date: Primary Water Use: Sec. Water Use: Final Well Status: Water Type: Casing Material: Audit No: C21234		Data Entry Status: Yes Data Src: Date Received: 3/20/2013 Selected Flag: TRUE Abandonment Rec: Contractor: 7328 Form Version: 8 Owner:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Tag: A140392 Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy: Street Name: County: OTTAWA Municipality: OTTAWA CITY Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/719\7198961.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2013/02/20			
Year Completed:		2013			
Depth (m):					
Latitude:		45.4057497473036			
Longitude:		-75.7288420032159			
Path:		719\7198961.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1004265630		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				18	
Code OB Desc:				442963.00	
Open Hole:				5028284.00	
Cluster Kind:				UTM83	
Date Completed:		20-Feb-2013 00:00:00		3	
Remarks:				margin of error : 10 - 30 m	
Elevrc Desc:				wwr	
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
190	1 of 1	SE/246.5	64.0 / 0.93	Ottawa Greenbelt Construction Ltd 85 Spencer Street Ottawa ON K1Y 2P7	GEN
Generator No:		ON5245307		Status:	
SIC Code:		238910		Co Admin:	
SIC Description:		SITE PREPARATION CONTRACTORS		Choice of Contact:	
Approval Years:		2016		CO_OFFICIAL	
PO Box No:				Phone No Admin:	
Country:		Canada		Contam. Facility:	
				MHSW Facility:	
				No	
				No	
<u>Detail(s)</u>					
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
191	1 of 1	SSE/248.2	63.9 / 0.85	Huron Ave N and Caroline Ave Ottawa ON K1Y	EHS
Order No:		21061500255		Nearest Intersection:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: C Report Type: Custom Report Report Date: 18-JUN-21 Date Received: 15-JUN-21 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory					
Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.73468696 Y: 45.40126826					
192	1 of 1	E/251.6	59.9 / -3.15	PRIVATE RESIDENCE 129 CARRUTHER ST. STORAGE TANK/BARREL OTTAWA CITY ON K1Y 1N4	SPL
Ref No: 5035 Site No: Incident Dt: 6/11/1988 Year: Incident Cause: ABOVE-GROUND TANK LEAK Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: LAND Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 6/11/1988 Dt Document Closed: Incident Reason: MATERIAL FAILURE Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: 200 LTR. FUEL OIL FROM RESIDENTIAL TANK TO SOIL. Contaminant Qty:					
Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: 20101 Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:					
193	1 of 1	ENE/253.1	59.9 / -3.15	PRIVATE RESIDENCE 63 CARRUTHURS AVENUE FURNACE OIL TANK OTTAWA CITY ON	SPL
Ref No: 132408 Site No: Incident Dt: 9/26/1996 Year: Incident Cause: ABOVE-GROUND TANK LEAK Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: CONFIRMED Nature of Impact: Soil contamination Receiving Medium: LAND Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 9/27/1996 Dt Document Closed: Incident Reason: CORROSION					
Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: 20101 Site Lot: Site Conc: Northing: Easting: WORKS, MCCR Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: PRIVATE RESIDENT'S FUEL OIL TANK LEAKS FUEL TO DIRT BASEMENT FLOOR Contaminant Qty:					
194	1 of 1	NW/253.1	62.9 / -0.15	No municipal address - see attached map Ottawa ON	EHS
Order No: 20051104023 Status: C Report Type: Complete Report Report Date: 11/10/2005 Date Received: 11/4/2005 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Goldenroad at Parkdale Municipality: Client Prov/State: ON Search Radius (km): 0.5 X: -75.74279 Y: 45.409478			
195	1 of 2	ENE/256.0	59.9 / -3.15	18 Burnside Ave. OTTAWA HOUSING GARAGE<UNOFFICIAL> Ottawa ON K1Y 4V7	SPL
Ref No: 5505-6NMPTR Site No: Incident Dt: 4/7/2006 Year: Incident Cause: Other Discharges Incident Event: Contaminant Code: 41 Contaminant Name: DIESEL FUEL AND WATER MIXTURE Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Possible Nature of Impact: Soil Contamination; Surface Water Pollution Receiving Medium: Land & Water Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 4/7/2006 Dt Document Closed: Incident Reason: Other - Reason not otherwise defined Site Name: 18 BURNSIDE AVE. Site County/District: Site Geo Ref Meth: Incident Summary: Ottawa Housing, 18 Burnside: diesel spill into sewer. Contaminant Qty: Not Specfic Unknown		Discharger Report: Material Group: Wastes Health/Env Conseq: Client Type: Sector Type: Other Agency Involved: Nearest Watercourse: Site Address: 18 BURNSIDE AVE. Site District Office: Ottawa Site Postal Code: Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:			
195	2 of 2	ENE/256.0	59.9 / -3.15	OTTAWA COMMUNITY HOUSING CORP. 18 BURNSIDE AVE., OTTAWA ON K1Y 4V7	GEN
Generator No: ON7534774 SIC Code: 531111 SIC Description: Lessors of Residential Buildings and Dwellings (ex Approval Years: 06 PO Box No: Country:		Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Detail(s)					
Waste Class:		221			
Waste Class Desc:		LIGHT FUELS			
196	1 of 1	ENE/257.8	60.1 / -2.94	Burnside Avenue Ottawa ON K1Y	EHS
Order No:	20190410145			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	RSC Report - Quote			Client Prov/State:	ON
Report Date:	17-APR-19			Search Radius (km):	.3
Date Received:	10-APR-19			X:	-75.731072
Previous Site Name:				Y:	45.409753
Lot/Building Size:					
Additional Info Ordered:					
197	1 of 2	ENE/259.5	59.9 / -3.15	In front of 55 Carruthers Street<UNOFFICIAL> Ottawa ON K1Y 1N3	SPL
Ref No:	2625-6HHURD			Discharger Report:	0
Site No:				Material Group:	Oil
Incident Dt:	10/25/2005			Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:	Overflow (Tanks Lagoons)			Sector Type:	Other Motor Vehicle
Incident Event:				Agency Involved:	
Contaminant Code:				Nearest Watercourse:	
Contaminant Name:	TRANSMISSION OIL			Site Address:	
Contaminant Limit 1:				Site District Office:	Ottawa
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:	Not Anticipated			Site Municipality:	Ottawa
Nature of Impact:				Site Lot:	
Receiving Medium:	Water			Site Conc:	
Receiving Env:				Northing:	
MOE Response:				Easting:	
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:	10/25/2005			Site Map Datum:	
Dt Document Closed:				SAC Action Class:	Land Spills
Incident Reason:	Equipment Failure			Source Type:	
Site Name:	In front of 55 Carruthers Street<UNOFFICIAL>				
Site County/District:					
Site Geo Ref Meth:					
Incident Summary:	Transmission fluid to c/b, cleaned, EGN				
Contaminant Qty:					
197	2 of 2	ENE/259.5	59.9 / -3.15	Unknown<UNOFFICIAL> 55 Carruthers Ave. Ottawa Ottawa ON	SPL
Ref No:	3467-AWPPHU			Discharger Report:	
Site No:	NA			Material Group:	
Incident Dt:	2018/03/09			Health/Env Conseq:	2 - Minor Environment
Year:				Client Type:	
Incident Cause:				Sector Type:	Unknown / N/A
Incident Event:	Dumping			Agency Involved:	
Contaminant Code:	27			Nearest Watercourse:	
Contaminant Name:	CONCRETE			Site Address:	55 Carruthers Ave. Ottawa
Contaminant Limit 1:				Site District Office:	Ottawa
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:	n/a			Site Region:	Eastern

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Environment Impact:				Site Municipality:	Ottawa
Nature of Impact:				Site Lot:	
Receiving Medium:				Site Conc:	
Receiving Env:	Land; Surface Water; Ground Water			Northing:	5028652.98
MOE Response:	No			Easting:	442823.4
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:	2018/03/09			Site Map Datum:	
Dt Document Closed:				SAC Action Class:	Watercourse Spills
Incident Reason:	Unknown / N/A			Source Type:	Unknown / N/A
Site Name:	55 Carruthers Ave<UNOFFICIAL>				
Site County/District:					
Site Geo Ref Meth:					
Incident Summary:	Ottawa: unknown amount of concrete to CB				
Contaminant Qty:	0 other - see incident description				

<u>198</u>	1 of 1	ENE/259.9	59.9 / -3.15	JOHN HOWARD SOCIETY OF OTTAWA 59 CARRUTHERS AVENUE, OTTAWA, ON K1Y 1N3 Ottawa ON	RSC
RSC ID:	223048			Cert Date:	
RA No:				Cert Prop Use No:	
RSC Type:	Phase 1 and 2 RSC			Intended Prop Use:	Residential
Curr Property Use:	Commercial			Qual Person Name:	ADRIAN MENYHART
Ministry District:	Ottawa District Office			Stratified (Y/N):	
Filing Date:	2017/03/14			Audit (Y/N):	
Date Ack:				Entire Leg Prop. (Y/N):	
Date Returned:				Accuracy Estimate:	
Restoration Type:				Telephone:	
Soil Type:				Fax:	
Criteria:				Email:	
CPU Issued Sect 1686:					
Asmt Roll No:					
Prop ID No (PIN):	04096-0254 (LT)				
Property Municipal Address:	59 CARRUTHERS AVENUE, OTTAWA, ON K1Y 1N3, 55 CARRUTHERS AVENUE, OTTAWA, ON K1Y 1N3				
Mailing Address:					
Latitude & Latitude:					
UTM Coordinates:					
Consultant:					
Legal Desc:					
Measurement Method:					
Applicable Standards:					
RSC PDF:	https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=75990&fileName=BROWNFIELDS-E.pdf				

Document(s) Detail

Document Heading:	Supporting Documents
Document Name:	APEC Table.pdf
Document Type:	Area(s) of Potential Environmental Concern
Document Link:	https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=75982&fileName=APEC+Table.pdf
Document Heading:	Supporting Documents
Document Name:	Transfer Complete.pdf
Document Type:	Copy of any deed(s), transfer(s) or other document(s)
Document Link:	https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=75991&fileName=Transfer+Complete.pdf
Document Heading:	Supporting Documents
Document Name:	Table of current and past uses.pdf
Document Type:	Table of Current and Past Property Use

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=75987&fileName=Table+of+current+and+past+uses.pdf			
Document Heading:		Supporting Documents			
Document Name:		PhaseTwo.pdf			
Document Type:		Phase 2 Conceptual Site Model			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=78082&fileName=PhaseTwo.pdf			
Document Heading:		Supporting Documents			
Document Name:		Lawyer Letter NOV 25 2016.pdf			
Document Type:		Lawyer's letter consisting of a legal description of the property			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=75986&fileName=Lawyer+Letter+NOV+25+2016.pdf			
Document Heading:		Supporting Documents			
Document Name:		Certificate Status jan 2017.pdf			
Document Type:		Certificate of Status			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=75988&fileName=Certificate+Status+jan+2017.pdf			
Document Heading:		Supporting Documents			
Document Name:		Plan of Survey - January 2017.pdf			
Document Type:		A Current plan of Survey			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=75981&fileName=Plan+of+Survey+-+January+2017.pdf			
199	1 of 2	E/263.2	60.2 / -2.84	175 Carruthers Ave, Ottawa Ottawa ON	SPL
Ref No:		4003-AYNM5D		Discharger Report:	
Site No:		NA		Material Group:	
Incident Dt:		2018/05/11		Health/Env Conseq: 2 - Minor Environment	
Year:				Client Type:	
Incident Cause:				Sector Type: Unknown / N/A	
Incident Event:		Operator/Human error		Agency Involved:	
Contaminant Code:		13		Nearest Watercourse:	
Contaminant Name:		DIESEL FUEL		Site Address: 175 Carruthers Ave, Ottawa	
Contaminant Limit 1:				Site District Office: Ottawa	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:		1202		Site Region: Eastern	
Environment Impact:				Site Municipality: Ottawa	
Nature of Impact:				Site Lot:	
Receiving Medium:				Site Conc:	
Receiving Env:		Land		Northing: 5028286.81	
MOE Response:		No		Easting: 442987.38	
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:		2018/05/11		Site Map Datum:	
Dt Document Closed:				SAC Action Class: Land Spills	
Incident Reason:		Operator/Human Error		Source Type: Motor Vehicle	
Site Name:		site of the hole<UNOFFICIAL>			
Site County/District:					
Site Geo Ref Meth:					
Incident Summary:		Tomlinson Env Services: 20 L diesel to ground			
Contaminant Qty:		20 L			
199	2 of 2	E/263.2	60.2 / -2.84	Morley Hoppner Inc. 175 Carruthers Ottawa ON K1Y 1P8	GEN
Generator No:		ON6969162		Status: Registered	
SIC Code:				Co Admin:	
SIC Description:				Choice of Contact:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Years: PO Box No: Country:	As of Jan 2021 Canada			Phone No Admin: Contam. Facility: MHSW Facility:	
<u>Detail(s)</u>					
Waste Class: Waste Class Desc:	251 L Waste oils/sludges (petroleum based)				
200	1 of 2	SW/266.2	64.9 / 1.88	JAMES BLANEY 53 GOULD ST OTTAWA K1Y 2P3 ON CA ON	CFOT
Licence No: Registration No: Posse File No: Posse Reg No: Status Name: Tank Type: Tank Size: Tank Material: Instance No: Inst Creation Date: Inst Install Date: Item: Tank Age (as of 05/1992): Device Installed Location: Description: Contact Name: Contact Address: Contact Address2: Contact Suite: Contact City: Contact Prov: Contact Postal:	Single Wall UST 1100 NULL 39037298 10/25/2005 10/25/2005 FS FUEL OIL TANK		Item Description: Instance Type: Facility Type: Fuel Type: Distributor: Letter Sent: Comments: Corrosion Protect: Province: Nbr: Context:	Fuel Oil Tank FS Fuel Oil Tank	
200	2 of 2	SW/266.2	64.9 / 1.88	JAMES BLANEY 53 GOULD ST OTTAWA K1Y 2P3 ON CA ON	DTNK
<u>Delisted Fuel Storage Tank</u>					
Instance No: Status: Instance Type: Fuel Type: Cont Name: Capacity: Tank Material: Corrosion Prot: Tank Type: Install Year: Facility Type: Device Installed Loc: Fuel Type 2: Fuel Type 3: Item: Item Description: Model: Description: Instance Creation Dt:	39037298 Active 1100 NULL NULL Single Wall UST 1975 FS FUEL OIL TANK		Creation Date: Overfill Prot Type: Facility Location: Piping SW Steel: Piping SW Galvan: Tanks SW Steel: Piping Underground: No Underground: Max Hazard Rank: Max Hazard Rank 1: Nxt Period Start Dt: Program Area 1: Program Area 2: Nxt Period Strt Dt 2: Risk Based Periodic: Vol of Directives: Years in Service: Created Date: Federal Device:	7/5/2009 2:56:58 AM 53 GOULD ST OTTAWA K1Y 2P3 ON CA NULL NULL NULL NULL NULL 5.4 25-OCT-05 NULL	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Instance Install Dt:	10/25/2005			Periodic Exempt:	NULL
Manufacturer:	NULL			Statutory Interval:	NULL
Serial No:	NULL			Rcomnd Insp Interval:	NULL
ULC Standard:	NULL			Recommended Toler:	NULL
Quantity:	1			Panam Venue Name:	NULL
Unit of Measure:	EA			External Identifier:	NULL
Parent Fac Type:					
TSSA Base Sched Cycle 1:	NULL				
TSSA Base Sched Cycle 2:	NULL				
Original Source:	FST				
Record Date:	31-MAY-2021				

201	1 of 1	ENE/268.2	59.9 / -3.15	55 CARRUTHERS AVENUE OTTAWA ON	WWIS
Well ID:	7264754			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:	Monitoring			Date Received:	6/15/2016
Sec. Water Use:				Selected Flag:	TRUE
Final Well Status:	Observation Wells			Abandonment Rec:	
Water Type:				Contractor:	7328
Casing Material:				Form Version:	7
Audit No:	Z227936			Owner:	
Tag:	A153920			Street Name:	55 CARRUTHERS AVENUE
Construction Method:				County:	OTTAWA
Elevation (m):				Municipality:	OTTAWA CITY
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/726\7264754.pdf

Additional Detail(s) (Map)

Well Completed Date: 2016/05/05
Year Completed: 2016
Depth (m): 9.15
Latitude: 45.4086122721697
Longitude: -75.7302333989173
Path: 726\7264754.pdf

Bore Hole Information

Bore Hole ID:	1006052743	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	442857.00
Code OB Desc:		North83:	5028603.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	05-May-2016 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	digit
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006105785			
Layer:		1			
Color:					
General Color:					
Mat1:		06			
Most Common Material:		SILT			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		1.5199999809265137			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006105786			
Layer:		2			
Color:					
General Color:					
Mat1:		26			
Most Common Material:		ROCK			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		1.5199999809265137			
Formation End Depth:		9.149999618530273			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006105794			
Layer:		1			
Plug From:		0.0			
Plug To:		5.179999828338623			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006105793			
Method Construction Code:		F			
Method Construction:		H.S.A.			
Other Method Construction:		DIAMOND			
<u>Pipe Information</u>					
Pipe ID:		1006105784			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing ID: 1006105790					
Layer: 1					
Material: 5					
Open Hole or Material: PLASTIC					
Depth From: 0.0					
Depth To: 6.099999904632568					
Casing Diameter: 3.180000066757202					
Casing Diameter UOM: cm					
Casing Depth UOM: m					
<u>Construction Record - Screen</u>					
Screen ID: 1006105791					
Layer: 1					
Slot: 10					
Screen Top Depth: 6.099999904632568					
Screen End Depth: 9.149999618530273					
Screen Material: 5					
Screen Depth UOM: m					
Screen Diameter UOM: cm					
Screen Diameter: 3.890000104904175					
<u>Water Details</u>					
Water ID: 1006105789					
Layer: 1					
Kind Code:					
Kind:					
Water Found Depth: 5.929999828338623					
Water Found Depth UOM: m					
<u>Hole Diameter</u>					
Hole ID: 1006105787					
Diameter: 20.299999237060547					
Depth From: 0.0					
Depth To: 1.5199999809265137					
Hole Depth UOM: m					
Hole Diameter UOM: cm					
<u>Hole Diameter</u>					
Hole ID: 1006105788					
Diameter: 7.619999885559082					
Depth From: 1.5199999809265137					
Depth To: 9.149999618530273					
Hole Depth UOM: m					
Hole Diameter UOM: cm					
202	1 of 1	ENE/268.6	59.9 / -3.15	71 Carruthers Ave Ottawa ON K1Y1N3	EHS
Order No: 20131210024					
Status: C					
Report Type: Standard Select Report					
Report Date: 12-DEC-13					
Date Received: 10-DEC-13					
Previous Site Name:					
Lot/Building Size:					
Additional Info Ordered: Fire Insur. Maps and/or Site Plans; Title Searches; Topographic Maps; City Directory					
Nearest Intersection:					
Municipality:					
Client Prov/State: ON					
Search Radius (km): .25					
X: -75.730032					
Y: 45.408291					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
203	1 of 1	ESE/270.2	62.9 / -0.15	323 Parkdall Ave Ottawa ON	EHS
Order No: 20180207177 Status: C Report Type: Standard Report Report Date: 14-FEB-18 Date Received: 08-FEB-18 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.73035 Y: 45.402884			
204	1 of 8	ESE/270.3	62.9 / -0.15	GRAPHIC DISPLAY CANADA 45 SPENCER ST OTTAWA ON K1Y 2P5	SCT
Established: 1979 Plant Size (ft²): 0 Employment: 9					
--Details--					
Description:		Other Printing			
SIC/NAICS Code:		323119			
Description:		Showcase, Partition, Shelving and Locker Manufacturing			
SIC/NAICS Code:		337215			
Description:		Sign Manufacturing			
SIC/NAICS Code:		339950			
204	2 of 8	ESE/270.3	62.9 / -0.15	FUJI GRAPHIC SYSTEMS CANADA 45 SPENCER ST OTTAWA ON K1Y 2P5	SCT
Established: 0000 Plant Size (ft²): 0 Employment: 2					
--Details--					
Description:		Industrial Machinery, Equipment and Supplies Wholesaler-Distributors			
SIC/NAICS Code:		417230			
Description:		Office and Store Machinery and Equipment Wholesaler-Distributors			
SIC/NAICS Code:		417910			
Description:		Stationery and Office Supplies Wholesaler-Distributors			
SIC/NAICS Code:		418210			
Description:		All Other Industrial Machinery Manufacturing			
SIC/NAICS Code:		333299			
204	3 of 8	ESE/270.3	62.9 / -0.15	THE ENVELOPE HOUSE 45 SPENCER ST OTTAWA ON K1Y 2P5	SCT
Established: 1979 Plant Size (ft²): 8000					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Employment:		5			
--Details--					
Description:		Stationery Product Manufacturing			
SIC/NAICS Code:		322230			
Description:		Other Printing			
SIC/NAICS Code:		323119			
Description:		ENVELOPES			
SIC/NAICS Code:		2677			
204	4 of 8	ESE/270.3	62.9 / -0.15	GRAPHIC DISPLAY CANADA 45 SPENCER ST OTTAWA ON K1Y 2P5	SCT
Established:		1979			
Plant Size (ft²):		0			
Employment:		9			
--Details--					
Description:		COMMERCIAL PRINTING, NOT ELSEWHERE CLASSIFIED			
SIC/NAICS Code:		2759			
Description:		SIGNS AND ADVERTISING SPECIALTIES			
SIC/NAICS Code:		3993			
204	5 of 8	ESE/270.3	62.9 / -0.15	Graphic Display Canada - A St-Joseph Corporation Company 45 Spencer St Ottawa ON K1Y 2P5	SCT
Established:		1979			
Plant Size (ft²):		10000			
Employment:		9			
204	6 of 8	ESE/270.3	62.9 / -0.15	GRAPHIC DISPLAY CANADA DIVISION OF M.O.M. PRINTING LTD. 45 SPENCER STREET OTTAWA ON K1Y 2P5	GEN
Generator No:		ON0272301		Status:	
SIC Code:		2819		Co Admin:	
SIC Description:		OTHER COMM. PRINTING		Choice of Contact:	
Approval Years:		86,87,88,89,90,92,93,97		Phone No Admin:	
PO Box No:				Contam. Facility:	
Country:				MHSW Facility:	
Detail(s)					
Waste Class:		264			
Waste Class Desc:		PHOTOPROCESSING WASTES			
204	7 of 8	ESE/270.3	62.9 / -0.15	GRAPHIC DISPLAY CANADA 18-125 DIVISION OF M.O.M. PRINTING LTD. 45 SPENCER STREET OTTAWA ON K1Y 2P5	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON0272301 SIC Code: 2819 SIC Description: OTHER COMM. PRINTING Approval Years: 94,95,96 PO Box No: Country:					
Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 264 Waste Class Desc: PHOTOPROCESSING WASTES					
204	8 of 8	ESE/270.3	62.9 / -0.15	GRAPHIC DISPLAY CANADA M.O.M. PRINTING LIMITED, A DIVISION OF 45 SPENCER STREET OTTAWA ON K1Y 2P5	GEN
Generator No: ON0272301 SIC Code: 2819 SIC Description: OTHER COMM. PRINTING Approval Years: 98,99,00,01 PO Box No: Country:					
Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 264 Waste Class Desc: PHOTOPROCESSING WASTES					
205	1 of 1	E/272.5	60.1 / -2.95	12 Stirling Ottawa ON	EHS
Order No: 20170301136 Status: C Report Type: Standard Report Report Date: 07-MAR-17 Date Received: 01-MAR-17 Previous Site Name: Lot/Building Size: Additional Info Ordered: Topographic Maps					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.728539 Y: 45.405863					
206	1 of 1	E/273.9	60.9 / -2.15	212, 214 and 216 Carruthers Ave Ottawa ON K1Y 1N7	EHS
Order No: 22030300355 Status: C Report Type: Standard Report Report Date: 08-MAR-22 Date Received: 03-MAR-22 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.7284085 Y: 45.4046218					
207	1 of 1	S/277.8	66.1 / 3.05	CONTRACTOR AT RESIDENCE AT 87 GRANGE ST. (OWNER MRS. PENNY BRADY 613-729-1064) (N.O.S.) OTTAWA CITY ON K1Y 0P1	SPL

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Ref No:	205201			Discharger Report:	
Site No:				Material Group:	
Incident Dt:	7/5/2001			Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:	CONTAINER OVERFLOW			Sector Type:	
Incident Event:				Agency Involved:	
Contaminant Code:				Nearest Watercourse:	
Contaminant Name:				Site Address:	
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:	Confirmed			Site Municipality:	20107
Nature of Impact:	Other			Site Lot:	
Receiving Medium:	Land			Site Conc:	
Receiving Env:				Northing:	
MOE Response:				Easting:	
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:	7/5/2001			Site Map Datum:	
Dt Document Closed:				SAC Action Class:	
Incident Reason:	ERROR			Source Type:	
Site Name:					
Site County/District:					
Site Geo Ref Meth:					
Incident Summary:	CONTRACTOR - 10 L OF FURNACE OIL TO PAVEMENT WHILE PUMPING OUT TANK.				
Contaminant Qty:					

PDF URL (Map):

Well Completed Date: 2013/10/28
Year Completed: 2013
Depth (m):
Latitude: 45.4087210956204
Longitude: -75.7301070103588
Path:

382 erisinfo.com | Environmental Risk Information Services Order No: 22062900235

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
ON					
Incident No:	1956922			Any Health Impact:	No
Incident ID:				Any Enviro Impact:	Yes
Instance No:				Service Interrupted:	Yes
Status Code:				Was Prop Damaged:	Yes
Attribute Category:	FS-Perform L1 Incident Insp			Reside App. Type:	
Context:				Commer App. Type:	
Date of Occurrence:	2016/10/11 00:00:00			Indus App. Type:	
Time of Occurrence:	13:18:00			Institut App. Type:	
Incident Created On:				Venting Type:	
Instance Creation Dt:				Vent Conn Mater:	
Instance Install Dt:				Vent Chimney Mater:	
Occur Insp Start Date:	2016/10/11 00:00:00			Pipeline Type:	
Approx Quant Rel:				Pipeline Involved:	
Tank Capacity:				Pipe Material:	
Fuels Occur Type:	Leak			Depth Ground Cover:	
Fuel Type Involved:	Fuel Oil			Regulator Location:	
Enforcement Policy:	NULL			Regulator Type:	
Prc Escalation Req:	NULL			Operation Pressure:	
Tank Material Type:				Liquid Prop Make:	
Tank Storage Type:				Liquid Prop Model:	
Tank Location Type:				Liquid Prop Serial No:	
Pump Flow Rate Cap:				Liquid Prop Notes:	
Task No:	6376731			Equipment Type:	
Notes:				Equipment Model:	
Drainage System:				Serial No:	
Sub Surface Contam.:				Cylinder Capacity:	
Aff Prop Use Water:				Cylinder Cap Units:	
Contam. Migrated:				Cylinder Mat Type:	
Contact Natural Env:				Near Body of Water:	
Incident Location:	320 PARKDALE AVE, OTTAWA - LEAK				
Occurrence Narrative:	Fuel oil leaking from piping at the fuel oil storage tank.				
Operation Type Involved:	Multi-unit Residential				
Item:					
Item Description:					
Device Installed Location:					

210	1 of 1	ESE/287.3	62.9 / -0.15	3 HAMILTON AVE NORTH ON	WWIS
Well ID:	7041972			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:				Date Received:	3/29/2007
Sec. Water Use:				Selected Flag:	TRUE
Final Well Status:	Dewatering			Abandonment Rec:	
Water Type:				Contractor:	3651
Casing Material:				Form Version:	3
Audit No:	Z64906			Owner:	
Tag:	A054052			Street Name:	3 HAMILTON AVE NORTH
Construction Method:				County:	OTTAWA
Elevation (m):				Municipality:	OTTAWA CITY
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041972.pdf

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2007/03/15			
Year Completed:		2007			
Depth (m):		6.1			
Latitude:		45.4024874017343			
Longitude:		-75.7308572591547			
Path:		704\7041972.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	11764475			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442802.00
Code OB Desc:				North83:	5027923.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	15-Mar-2007 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	www
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	933095686				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	1.2000000476837158				
Formation End Depth:	6.099999904632568				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	933095685				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	11				
Most Common Material:	GRAVEL				
Mat2:	28				
Mat2 Desc:	SAND				
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	1.2000000476837158				
Formation End Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933316039			
Layer:		1			
Plug From:		0.0			
Plug To:		2.0999999046325684			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		967041972			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11772195			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930897279			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		2.0999999046325684			
Casing Diameter:		15.899999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		930897280			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		2.0999999046325684			
Depth To:		6.099999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11850737			
Diameter:		15.199999809265137			
Depth From:		2.0999999046325684			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		11850738			
Diameter:		25.399999618530273			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From:		0.0			
Depth To:		2.0999999046325684			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
211	1 of 1	ESE/290.8	63.6 / 0.54	R.M. OF OTTAWA-CARLETON HAMILTON ST./SPENCER ST. OTTAWA ON	CA
Certificate #:		7-0914-98-			
Application Year:		98			
Issue Date:		9/14/1998			
Approval Type:		Municipal water			
Status:		Approved			
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					
212	1 of 1	ESE/291.8	62.9 / -0.15	3 HAMILTON AVE NORTH ON	WWIS
Well ID:		7041971		Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:				Date Received:	
Sec. Water Use:				3/29/2007	
Final Well Status:		Dewatering		Selected Flag:	
Water Type:				TRUE	
Casing Material:				Abandonment Rec:	
Audit No:		Z64905		Contractor:	
Tag:		A054051		3651	
Construction Method:				Form Version:	
Elevation (m):				3	
Elevation Reliability:				Owner:	
Depth to Bedrock:				Street Name:	
Well Depth:				3 HAMILTON AVE NORTH	
Overburden/Bedrock:				County:	
Pump Rate:				OTTAWA	
Static Water Level:				Municipality:	
Flowing (Y/N):				OTTAWA CITY	
Flow Rate:				Site Info:	
Clear/Cloudy:				Lot:	
				Concession:	
				Concession Name:	
				Easting NAD83:	
				Northing NAD83:	
				Zone:	
				UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041971.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2007/03/15			
Year Completed:		2007			
Depth (m):		6.1			
Latitude:		45.4024241525656			
Longitude:		-75.7308947766056			
Path:		704\7041971.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		11764474		Elevation:	
DP2BR:				Elevrc:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Spatial Status:				Zone:	18
Code OB:				East83:	442799.00
Code OB Desc:				North83:	5027916.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:		15-Mar-2007 00:00:00	UTMRC Desc:		margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		933095684			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		1.5			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		933095683			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		933316038			
Layer:		1			
Plug From:		0.0			
Plug To:		2.299999952316284			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		967041971			
Method Construction Code:		2			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11772194			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930897278			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		2.299999952316284			
Depth To:		6.099999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		930897277			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		2.299999952316284			
Casing Diameter:		15.8999999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11850735			
Diameter:		15.199999809265137			
Depth From:		2.299999952316284			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		11850736			
Diameter:		25.3999999618530273			
Depth From:		0.0			
Depth To:		2.299999952316284			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
213	1 of 1	ESE/292.4	62.9 / -0.15	3 HAMILTON AVE NORTH ON	WWIS
Well ID:	7041967			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:				Date Received:	3/29/2007
Sec. Water Use:				Selected Flag:	TRUE
Final Well Status:	Dewatering			Abandonment Rec:	
Water Type:				Contractor:	3651

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Material:				Form Version:	3
Audit No:	Z64901			Owner:	
Tag:	A054047			Street Name:	3 HAMILTON AVE NORTH
Construction Method:				County:	OTTAWA
Elevation (m):				Municipality:	OTTAWA CITY
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041967.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2007/03/15				
Year Completed:	2007				
Depth (m):	6.1				
Latitude:	45.402396823846				
Longitude:	-75.7309455348453				
Path:	704\7041967.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	11764470			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442795.00
Code OB Desc:				North83:	5027913.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	15-Mar-2007 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	933095676				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.6000000238418579				
Formation End Depth:	6.099999904632568				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:		933095675			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.6000000238418579			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933316034			
Layer:		1			
Plug From:		0.0			
Plug To:		1.7000000476837158			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		967041967			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11772190			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930897269			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		1.7000000476837158			
Casing Diameter:		15.899999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		930897270			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		1.7000000476837158			
Depth To:		6.099999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11850727			
Diameter:		25.399999618530273			
Depth From:		0.0			
Depth To:		1.7000000476837158			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		11850728			
Diameter:		15.199999809265137			
Depth From:		1.7000000476837158			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

214	1 of 1	ESE/293.2	62.9 / -0.15	3 HAMILTON AVE NORTH ON	WWIS
Well ID:	7041975			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:				Date Received:	3/29/2007
Sec. Water Use:				Selected Flag:	TRUE
Final Well Status:	Dewatering			Abandonment Rec:	
Water Type:				Contractor:	3651
Casing Material:				Form Version:	3
Audit No:	Z64909			Owner:	
Tag:	A054055			Street Name:	3 HAMILTON AVE NORTH
Construction Method:				County:	OTTAWA
Elevation (m):				Municipality:	OTTAWA CITY
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041975.pdf

Additional Detail(s) (Map)

Well Completed Date: 2007/03/16
Year Completed: 2007
Depth (m): 6.1
Latitude: 45.4026528442428
Longitude: -75.7303227282798
Path: 704\7041975.pdf

Bore Hole Information

Bore Hole ID:	11764478	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	442844.00
Code OB Desc:		North83:	5027941.00

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	16-Mar-2007 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		933095691			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		1.2000000476837158			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		933095692			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		1.2000000476837158			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		933316042			
Layer:		1			
Plug From:		0.0			
Plug To:		2.200000047683716			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		967041975			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		11772198			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930897285			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		2.200000047683716			
Casing Diameter:		15.899999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		930897286			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		2.200000047683716			
Depth To:		6.099999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11850743			
Diameter:		25.399999618530273			
Depth From:		0.0			
Depth To:		2.200000047683716			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		11850744			
Diameter:		15.199999809265137			
Depth From:		2.200000047683716			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
215	1 of 1	ESE/294.3	62.9 / -0.15	3 HAMILTON AVE NORTH ON	WWIS
Well ID:	7041977			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:				Date Received:	3/29/2007
Sec. Water Use:				Selected Flag:	TRUE
Final Well Status:	Dewatering			Abandonment Rec:	
Water Type:				Contractor:	3651
Casing Material:				Form Version:	3
Audit No:	Z64911			Owner:	
Tag:	A054057			Street Name:	3 HAMILTON AVE NORTH
Construction Method:				County:	OTTAWA

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy:			Municipality: OTTAWA CITY Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:		
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041977.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2007/03/16			
Year Completed:		2007			
Depth (m):		7.6			
Latitude:		45.4027992217539			
Longitude:		-75.7299540595762			
Path:		704\7041977.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		11764480		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone: 18	
Code OB:				East83: 442873.00	
Code OB Desc:				North83: 5027957.00	
Open Hole:				Org CS: UTM83	
Cluster Kind:				UTMRC: 3	
Date Completed:		16-Mar-2007 00:00:00		UTMRC Desc: margin of error : 10 - 30 m	
Remarks:				Location Method: wwr	
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933095695			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		1.2000000476837158			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933095696			
Laver:		2			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		1.2000000476837158			
Formation End Depth:		7.599999904632568			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		933316044			
Layer:		1			
Plug From:		0.0			
Plug To:		2.4000000953674316			
Plug Depth UOM:		m			
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		967041977			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		11772200			
Casing No:		1			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		930897289			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		2.4000000953674316			
Casing Diameter:		15.899999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Casing</u>					
Casing ID:		930897290			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		2.4000000953674316			
Depth To:		7.599999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Hole Diameter</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole ID:		11850747			
Diameter:		25.399999618530273			
Depth From:		0.0			
Depth To:		2.4000000953674316			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		11850748			
Diameter:		15.199999809265137			
Depth From:		2.4000000953674316			
Depth To:		7.599999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
216	1 of 1	ESE/294.4	62.9 / -0.15	3 HAMILTON AVE NORTH ON	WWIS
Well ID:	7041968			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:				Date Received:	3/29/2007
Sec. Water Use:				Selected Flag:	TRUE
Final Well Status:	Dewatering			Abandonment Rec:	
Water Type:				Contractor:	3651
Casing Material:				Form Version:	3
Audit No:	Z64902			Owner:	
Tag:	A054048			Street Name:	3 HAMILTON AVE NORTH
Construction Method:				County:	OTTAWA
Elevation (m):				Municipality:	OTTAWA CITY
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041968.pdf				
 <u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2007/03/15				
Year Completed:	2007				
Depth (m):	6.1				
Latitude:	45.4023697404105				
Longitude:	-75.7309579632385				
Path:	704\7041968.pdf				
 <u>Bore Hole Information</u>					
Bore Hole ID:	11764471			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442794.00
Code OB Desc:				North83:	5027910.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	15-Mar-2007 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Remarks:			Location Method: WWW		
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		933095677			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.8999999761581421			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		933095678			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.8999999761581421			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		933316035			
Layer:		1			
Plug From:		0.0			
Plug To:		1.7999999523162842			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		967041968			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11772191			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing No: Comment: Alt Name:		1			
<u>Construction Record - Casing</u>					
Casing ID:		930897271			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		1.7999999523162842			
Casing Diameter:		15.899999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		930897272			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		1.7999999523162842			
Depth To:		6.099999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11850730			
Diameter:		25.399999618530273			
Depth From:		0.0			
Depth To:		1.7999999523162842			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		11850729			
Diameter:		15.199999809265137			
Depth From:		1.7999999523162842			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>217</u>	1 of 2	ESE/295.2	63.9 / 0.85	OTTAWA HYDRO 4 HAMILTON ST. MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON	SPL
Ref No:	86490			Discharger Report:	
Site No:				Material Group:	
Incident Dt:	6/3/1993			Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:	PIPE/HOSE LEAK			Sector Type:	
Incident Event:				Agency Involved:	
Contaminant Code:				Nearest Watercourse:	
Contaminant Name:				Site Address:	
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Environment Impact: NOT ANTICIPATED Nature of Impact: Receiving Medium: LAND Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 6/4/1993 Dt Document Closed: Incident Reason: OVERSTRESS/OVERPRESSURE Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: OTTAWA HYDRO - 1 L OF HYDRAULIC OIL TO GROUND Contaminant Qty:					
Site Municipality: 20101 Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:					
217	2 of 2	ESE/295.2	63.9 / 0.85	Artech Studios 6 Hamilton Ave N Suite 250 Ottawa ON K1Y 4R1	SCT
Established: 01-DEC-82 Plant Size (ft²): Employment:					
--Details-- Description: Doll, Toy and Game Manufacturing SIC/NAICS Code: 339930					
218	1 of 1	ESE/295.6	62.9 / -0.15	3 HAMILTON AVE NORTH ON	WWIS
Well ID: 7041970 Construction Date: Primary Water Use: Sec. Water Use: Final Well Status: Dewatering Water Type: Casing Material: Audit No: Z64904 Tag: A054050 Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy:					
Data Entry Status: Data Src: Date Received: 3/29/2007 Selected Flag: TRUE Abandonment Rec: Contractor: 3651 Form Version: 3 Owner: Street Name: 3 HAMILTON AVE NORTH County: OTTAWA Municipality: OTTAWA CITY Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041970.pdf					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 2007/03/15 Year Completed: 2007 Depth (m): 6.1 Latitude: 45.4023790680224 Longitude: -75.7309069729037 Path: 704\7041970.pdf					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	11764473			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442798.00
Code OB Desc:				North83:	5027911.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	15-Mar-2007 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	933095681				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	11				
Most Common Material:	GRAVEL				
Mat2:	28				
Mat2 Desc:	SAND				
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	1.5				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	933095682				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	1.5				
Formation End Depth:	6.099999904632568				
Formation End Depth UOM:	m				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	933316037				
Layer:	1				
Plug From:	0.0				
Plug To:	2.299999952316284				
Plug Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Method of Construction & Well Use</u>					
Method Construction ID:		967041970			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11772193			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930897275			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		2.299999952316284			
Casing Diameter:		15.8999999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		930897276			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		2.299999952316284			
Depth To:		6.099999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11850734			
Diameter:		25.3999999618530273			
Depth From:		0.0			
Depth To:		2.299999952316284			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		11850733			
Diameter:		15.199999809265137			
Depth From:		2.299999952316284			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>219</u>	1 of 8	ESE/296.0	63.9 / 0.85	VOGUE BRASSIERE INC. 7 HINTON AVE N OTTAWA ON K1Y 4P1	SCT

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Established: 1953 Plant Size (ft²): 0 Employment: 110					
--Details-- Description: BRASSIERES, GIRDLES, AND ALLIED GARMENTS SIC/NAICS Code: 2342 Description: Cut and Sew Clothing Contracting SIC/NAICS Code: 315210 Description: Women's and Girls' Cut and Sew Lingerie, Loungewear and Nightwear Manufacturing SIC/NAICS Code: 315231					
219	2 of 8	ESE/296.0	63.9 / 0.85	CANADIAN ARCTIC RESOURCES COMM 7 Hinton Ave N Suite 200 Ottawa ON K1Y 4P1	SCT
Established: 1971 Plant Size (ft²): 0 Employment: 4					
--Details-- Description: Periodical Publishers SIC/NAICS Code: 511120 Description: Book Publishers SIC/NAICS Code: 511130 Description: Other Publishers SIC/NAICS Code: 511190					
219	3 of 8	ESE/296.0	63.9 / 0.85	Canadian Arctic Resources Committee Inc. 7 Hinton Ave N Suite 200 Ottawa ON K1Y 4P1	SCT
Established: 1971 Plant Size (ft²): Employment: 4					
219	4 of 8	ESE/296.0	63.9 / 0.85	Metcalfe Realty Company Limited 7 Hinton Avenue Ottawa ON	GEN
Generator No: ON5223737 SIC Code: 531310 SIC Description: Real Estate Property Managers Approval Years: 06 PO Box No: Country:					
Status: Co Admin: Choice of Contact: Phone No Admin: Contam. Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 252 Waste Class Desc: WASTE OILS & LUBRICANTS					
Waste Class: 263 Waste Class Desc: ORGANIC LABORATORY CHEMICALS					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
219	5 of 8	ESE/296.0	63.9 / 0.85	7 Hinton Ave N. Ottawa ON K1Y 4P1	EHS
Order No:		20090616008	Nearest Intersection:		Hinton Ave N. & Spencer St.
Status:		C	Municipality:		
Report Type:		Standard Report	Client Prov/State:		ON
Report Date:		6/24/2009	Search Radius (km):		0.25
Date Received:		6/16/2009	X:		-75.73185
Previous Site Name:			Y:		45.40174
Lot/Building Size:					
Additional Info Ordered:					
219	6 of 8	ESE/296.0	63.9 / 0.85	METCALFE REALTY LIMITED 7 HINTIN AVE., NORTH OTTAWA ON	GEN
Generator No:		ON4988188	Status:		
SIC Code:		315210	Co Admin:		
SIC Description:		Cut and Sew Clothing Contracting	Choice of Contact:		
Approval Years:		2009	Phone No Admin:		
PO Box No:			Contam. Facility:		
Country:			MHSW Facility:		
<u>Detail(s)</u>					
Waste Class:		251			
Waste Class Desc:		OIL SKIMMINGS & SLUDGES			
219	7 of 8	ESE/296.0	63.9 / 0.85	Metcalfe Realty Company Limited 7 Hinton Avenue Ottawa ON	GEN
Generator No:		ON5223737	Status:		
SIC Code:		531310	Co Admin:		
SIC Description:		Real Estate Property Managers	Choice of Contact:		
Approval Years:		2009	Phone No Admin:		
PO Box No:			Contam. Facility:		
Country:			MHSW Facility:		
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
219	8 of 8	ESE/296.0	63.9 / 0.85	Metcalfe Realty Company Limited 7 Hinton Avenue Ottawa ON	GEN
Generator No:		ON5223737	Status:		
SIC Code:		531310	Co Admin:		
SIC Description:		Real Estate Property Managers	Choice of Contact:		
Approval Years:		2012	Phone No Admin:		
PO Box No:			Contam. Facility:		
Country:			MHSW Facility:		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		263			
Waste Class Desc:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		252			
Waste Class Desc:		WASTE OILS & LUBRICANTS			
220	1 of 1	ESE/296.7	62.9 / -0.15	3 HAMILTON AVE NORTH ON	WWIS
Well ID:	7041966			Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:				Date Received:	3/29/2007
Sec. Water Use:				Selected Flag:	TRUE
Final Well Status:	Dewatering			Abandonment Rec:	
Water Type:				Contractor:	3651
Casing Material:				Form Version:	3
Audit No:	Z47380			Owner:	
Tag:	A054046			Street Name:	3 HAMILTON AVE NORTH
Construction Method:				County:	OTTAWA
Elevation (m):				Municipality:	OTTAWA CITY
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041966.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2007/03/15				
Year Completed:	2007				
Depth (m):	6.1				
Latitude:	45.4023244105501				
Longitude:	-75.7310084892421				
Path:	704\7041966.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	11764469			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442790.00
Code OB Desc:				North83:	5027905.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	15-Mar-2007 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:		933095674			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.8999999761581421			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		933095673			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.8999999761581421			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		933316033			
Layer:		1			
Plug From:		0.0			
Plug To:		1.899999976158142			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		967041966			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11772189			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930897268			
Layer:		2			
Material:		4			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Open Hole or Material:		OPEN HOLE			
Depth From:		1.899999976158142			
Depth To:		6.099999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		930897267			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		1.899999976158142			
Casing Diameter:		15.899999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11850726			
Diameter:		15.199999809265137			
Depth From:		1.899999976158142			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		11850725			
Diameter:		25.399999618530273			
Depth From:		0.0			
Depth To:		1.899999976158142			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
221	1 of 1	ESE/296.8	62.9 / -0.15	3 HAMILTON AVE NORTH ON	WWIS
Well ID:		7041969		Data Entry Status:	
Construction Date:				Data Src:	
Primary Water Use:				Date Received:	3/29/2007
Sec. Water Use:				Selected Flag:	TRUE
Final Well Status:		Dewatering		Abandonment Rec:	
Water Type:				Contractor:	3651
Casing Material:				Form Version:	3
Audit No:		Z64903		Owner:	
Tag:		A054049		Street Name:	3 HAMILTON AVE NORTH
Construction Method:				County:	OTTAWA
Elevation (m):				Municipality:	OTTAWA CITY
Elevation Reliability:				Site Info:	
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Flowing (Y/N):				Zone:	
Flow Rate:				UTM Reliability:	
Clear/Cloudy:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041969.pdf			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2007/03/16			
Year Completed:		2007			
Depth (m):		6.1			
Latitude:		45.4023609851476			
Longitude:		-75.7309195173761			
Path:		704\7041969.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	11764472			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442797.00
Code OB Desc:				North83:	5027909.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	16-Mar-2007 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		933095680			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		1.5			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		933095679			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933316036			
Layer:		1			
Plug From:		0.0			
Plug To:		2.299999952316284			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		967041969			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11772192			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930897273			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		2.299999952316284			
Casing Diameter:		15.899999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		930897274			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		2.299999952316284			
Depth To:		6.099999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11850731			
Diameter:		15.199999809265137			
Depth From:		2.299999952316284			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		11850732			
Diameter:		25.399999618530273			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From:		0.0			
Depth To:		2.299999952316284			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
222	1 of 1	ESE/297.5	61.9 / -1.15	ENBRIDGE GAS INC 301 HINCHEY AVE,,OTTAWA,ON,K1Y 1M1,CA ON	PINC
Incident Id:				Pipe Material:	
Incident No:		2916838		Fuel Category:	
Incident Reported Dt:		9/2/2020		Health Impact:	
Type:		FS-Pipeline Incident		Environment Impact:	
Status Code:				Property Damage:	
Tank Status:		Non Mandated		Service Interrupt:	
Task No:				Enforce Policy:	
Spills Action Centre:				Public Relation:	
Fuel Type:				Pipeline System:	
Fuel Occurrence Tp:				PSIG:	
Date of Occurrence:				Attribute Category:	
Occurrence Start Dt:				Regulator Location:	
Depth:				Method Details:	
Customer Acct Name:		ENBRIDGE GAS INC			
Incident Address:		301 HINCHEY AVE,,OTTAWA,ON,K1Y 1M1,CA			
Operation Type:					
Pipeline Type:					
Regulator Type:					
Summary:					
Reported By:					
Affiliation:					
Occurrence Desc:					
Damage Reason:					
Notes:					
223	1 of 1	E/297.9	60.9 / -2.15	PRIVATE RESIDENCE 215 CARRUTHERS AVE FURNACE OIL TANK OTTAWA CITY ON K1Y 1N6	SPL
Ref No:		119608		Discharger Report:	
Site No:				Material Group:	
Incident Dt:		9/28/1995		Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:		ABOVE-GROUND TANK LEAK		Sector Type:	
Incident Event:				Agency Involved:	
Contaminant Code:				Nearest Watercourse:	
Contaminant Name:				Site Address:	
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:		CONFIRMED		Site Municipality:	20101
Nature of Impact:		Soil contamination		Site Lot:	
Receiving Medium:		LAND		Site Conc:	
Receiving Env:				Northing:	
MOE Response:				Easting:	
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:		10/13/1995		Site Map Datum:	
Dt Document Closed:				SAC Action Class:	
Incident Reason:		CORROSION		Source Type:	
Site Name:					
Site County/District:					
Site Geo Ref Meth:					
Incident Summary:		PRIVATE FUEL OIL TANK-450L MAX TO GND,NO DRAINS. CORRODED TANK.CLEANING.			
Contaminant Qty:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
224	1 of 1	ESE/298.4	63.9 / 0.85	7 HINTON AVE. Ottawa ON	WWIS
Well ID: 7119461		Data Entry Status:			
Construction Date:		Data Src:			
Primary Water Use: Monitoring		Date Received: 2/23/2009		Selected Flag: TRUE	
Sec. Water Use:		Abandonment Rec:			
Final Well Status: Test Hole		Contractor: 7241		Form Version: 5	
Water Type:		Owner:			
Casing Material:		Street Name: 7 HINTON AVE.			
Audit No: M03849		County: OTTAWA			
Tag: A080380		Municipality: OTTAWA CITY			
Construction Method:		Site Info:			
Elevation (m):		Lot:			
Elevation Reliability:		Concession:			
Depth to Bedrock:		Concession Name:			
Well Depth:		Easting NAD83:			
Overburden/Bedrock:		Northing NAD83:			
Pump Rate:		Zone:			
Static Water Level:		UTM Reliability:			
Flowing (Y/N):					
Flow Rate:					
Clear/Cloudy:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/711\7119461.pdf			
Additional Detail(s) (Map)					
Well Completed Date: 2009/01/21					
Year Completed: 2009					
Depth (m):					
Latitude: 45.4019643065077					
Longitude: -75.7310166226552					
Path: 711\7119461.pdf					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/711\7119461.pdf			
Additional Detail(s) (Map)					
Well Completed Date: 2009/01/27					
Year Completed: 2009					
Depth (m): 10					
Latitude: 45.4019732252913					
Longitude: -75.7310295152432					
Path: 711\7119461.pdf					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/711\7119461.pdf			
Additional Detail(s) (Map)					
Well Completed Date: 2009/01/20					
Year Completed: 2009					
Depth (m):					
Latitude: 45.4020687956312					
Longitude: -75.7315674064251					
Path: 711\7119461.pdf					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/711\7119461.pdf			
Additional Detail(s) (Map)					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Completed Date:		2009/01/20			
Year Completed:		2009			
Depth (m):					
Latitude:		45.4020686319595			
Longitude:		-75.7315929594843			
Path:		711\7119461.pdf			
 <u>Bore Hole Information</u>					
Bore Hole ID:	1002743337			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442744.00
Code OB Desc:				North83:	5027877.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3
Date Completed:	20-Jan-2009 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	www
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1002743341				
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:	1002743340				
Method Construction Code:					
Method Construction:					
Other Method Construction:	AIR PERCUSSION				
 <u>Pipe Information</u>					
Pipe ID:	1002743342				
Casing No:	0				
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:	1002743344				
Layer:					
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:					
Depth To:	7.0				
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:	1002743343				
Layer:					
Slot:					
Screen Top Depth:	7.0				
Screen End Depth:	10.0				
Screen Material:					
Screen Depth UOM:	m				
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pump Test ID:	1002743345				
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:	1002743339				
Diameter:	5.0				
Depth From:					
Depth To:	10.0				
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
<u>Bore Hole Information</u>					
Bore Hole ID:	1002018852			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442788.00
Code OB Desc:				North83:	5027866.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	27-Jan-2009 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1002743357				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:		26			
Mat3 Desc:		ROCK			
Formation Top Depth:		2.0			
Formation End Depth:		10.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1002743356			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		25			
Mat3 Desc:		OVERBURDEN			
Formation Top Depth:		0.0			
Formation End Depth:		2.0			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1002743360			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1002743362			
Layer:		3			
Plug From:		5.5			
Plug To:		10.0			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1002743361			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		5.5			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1002743366			
Method Construction Code:		5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:	1002743355				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1002743363				
Layer:	1				
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:	0.0				
Depth To:	6.0				
Casing Diameter:	3.450000047683716				
Casing Diameter UOM:	cm				
Casing Depth UOM:	m				
<u>Construction Record - Screen</u>					
Screen ID:	1002743364				
Layer:	1				
Slot:	10				
Screen Top Depth:					
Screen End Depth:					
Screen Material:	5				
Screen Depth UOM:	m				
Screen Diameter UOM:	cm				
Screen Diameter:	4.210000038146973				
<u>Hole Diameter</u>					
Hole ID:	1002743358				
Diameter:	8.25				
Depth From:	0.0				
Depth To:	2.0				
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
<u>Hole Diameter</u>					
Hole ID:	1002743359				
Diameter:	5.0				
Depth From:	2.0				
Depth To:	10.0				
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
<u>Bore Hole Information</u>					
Bore Hole ID:	1002743328			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442789.00
Code OB Desc:				North83:	5027865.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Date Completed:	21-Jan-2009 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	www
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1002743332				
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:	1002743331				
Method Construction Code:					
Method Construction:					
Other Method Construction:	AIR PERCUSSION				
<u>Pipe Information</u>					
Pipe ID:	1002743333				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1002743335				
Layer:					
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:					
Depth To:	2.0				
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:	m				
<u>Construction Record - Screen</u>					
Screen ID:	1002743334				
Layer:					
Slot:					
Screen Top Depth:	2.0				
Screen End Depth:	4.5				
Screen Material:					
Screen Depth UOM:	m				
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pump Test ID:	1002743336				
Pump Set At:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Static Level: Final Level After Pumping: Recommended Pump Depth: Pumping Rate: Flowing Rate: Recommended Pump Rate: Levels UOM: Rate UOM: Water State After Test Code: Water State After Test: Pumping Test Method: Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1002743330			
Diameter:		5.0			
Depth From:					
Depth To:		4.800000190734863			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:	1002743346			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442746.00
Code OB Desc:				North83:	5027877.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3
Date Completed:	20-Jan-2009 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	www
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1002743350			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1002743349			
Method Construction Code:					
Method Construction:					
Other Method Construction:		AIR PERCUSSION			
<u>Pipe Information</u>					
Pipe ID:		1002743351			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1002743353			
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		3.0			
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1002743352			
Layer:					
Slot:					
Screen Top Depth:		3.0			
Screen End Depth:		10.0			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					
 <u>Results of Well Yield Testing</u>					
Pump Test ID:		1002743354			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
 <u>Hole Diameter</u>					
Hole ID:		1002743348			
Diameter:		5.0			
Depth From:					
Depth To:		6.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
225	1 of 1	E/300.2	59.9 / -3.15	12 Stirling Ave Ottawa ON K1Y 1P8	EHS
Order No:	20121015032			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	ON

<i>Map Key</i>	<i>Number of Records</i>	<i>Direction/ Distance (m)</i>	<i>Elev/Diff (m)</i>	<i>Site</i>	<i>DB</i>
<i>Report Date:</i>	22-OCT-12			<i>Search Radius (km):</i>	.25
<i>Date Received:</i>	15-OCT-12			<i>X:</i>	-75.728184
<i>Previous Site Name:</i>				<i>Y:</i>	45.405898
<i>Lot/Building Size:</i>					
<i>Additional Info Ordered:</i>					

Unplottable Summary

Total: **84** Unplottable sites

DB	Company Name/Site Name	Address	City	Postal
CA	Colonnade Development Incorporated		Ottawa ON	
CA	National Capital Commission	Ottawa River Parkway Detour Lane	Ottawa ON	
CA	City of Ottawa	Parkdale Avenue	Ottawa ON	
CA	R.W. Tomlinson Limited	Mobile Facility	Ottawa ON	
CA	Canada Lands Company CLC Limited		Ottawa ON	
CA	City of Ottawa	Hamilton Avenue	Ottawa ON	
CA	V. REV. D. SEVER	STONEHURST AVE.	OTTAWA CITY ON	
CA		Scott Street (Parkdale to Merton)	Ottawa ON	
CA		Scott Street	Ottawa ON	
CA		Carruthers Ave., Hinchey Ave. & Lyndale Ave.	Ottawa ON	
CA		Ross Avenue	Ottawa ON	
CA		Ross Avenue	Ottawa ON	
CA		Forward, Lyndale and Hinchey	Ottawa ON	
CA		Scott Street (Parkdale to Merton)	Ottawa ON	
CA		Forward, Lyndale and Hinchey	Ottawa ON	
CA		Carruthers Ave., Hinchey Ave. & Lyndale Ave.	Ottawa ON	
CA	R.M. OF OTTAWA-CARLETON	HINTO ST./SPENCER ST/OXFORD ST	OTTAWA CITY ON	
CA	OTTAWA CITY	SCOTT ST.	OTTAWA CITY ON	

CA	V. REV. D. SEVER	STONEHURST AVE.	OTTAWA CITY ON	
CA	Colonnade Development Incorporated		Ottawa ON	
CA	R.M. OF OTTAWA-CARLETON	SUNNYMEDE AVE.	OTTAWA CITY ON	
CONV	DOMTAR INC.		ON	
CONV	POMERLEAU LTD.		ON	
CONV	AECON CONSTRUCTION AND MATERIAL		ON	
CONV	R.W. TOMLINSON LIMITED		ON	
EBR	R.W. Tomlinson Limited	Mobile Facility Ottawa CITY OF OTTAWA	ON	
ECA	Canada Lands Company CLC Limited		Ottawa ON	K1P 5L4
ECA	City of Ottawa	Spencer St	Ottawa ON	K1P 1J1
ECA	Canada Lands Company CLC Limited		Ottawa ON	K1P 5L4
ECA	City of Ottawa	Huron Ave N	Ottawa ON	K2G 6J8
ECA	City of Ottawa	Scott St	Ottawa ON	K2G 6J8
ECA	City of Ottawa	Scott Street, Premier Ave., Champagne Ave.	Ottawa ON	K1P 1J1
ECA	R.W. Tomlinson Limited	Mobile Facility	Ottawa ON	K1G 3N4
ECA	The Regional Municipality of Ottawa-Carleton	Scott Street	Ottawa ON	K2P 2L7
ECA	City of Ottawa	Bullman Street (from Hamilton Avenue to Parkdale Avenue)	Ottawa ON	K2G 6J8
EHS		Hamilton Ave North	Ottawa ON	
GEN	GVT. OF CANADA-MEASUREMENT CANADA	HOLLAND AVENUE, STANDARDS BUILDING BUILDING 4, TUNNEY'S PASTURE	OTTAWA ON	
GEN	GVT. OF CANADA-MEASUREMENT CANADA	HOLLAND AVENUE STANDARDS BUILDING TUNNEY'S PASTURE	OTTAWA ON	K1A 0C9
GEN	GVT. OF CANADA-INDUSTRY CANADA	STANDARDS BUILDING TUNNEY'S PASTURE, HOLLAND AVE.	OTTAWA ON	
GEN	GVT. OF CAN-STATISTICS CANADA 18-155	FACILITIES MANAGEMENT R.H. COATS BUILDING, TUNNEY'S PASTURE	OTTAWA ON	K1A 0T6

GEN	GVT. OF CAN-STATISTICS CANADA	FACILITIES MANAGEMENT R.H. COATS BUILDING, TUNNEY'S PASTURE	OTTAWA ON	K1A 0T6
GEN	GVT. OF CAN.(OUT OF BUSINESS)	STATISTICS CANADA PRINTING PLANT STATISTICS CANADA BLDG,TUNNEYS PASTURE	OTTAWA ON	K1A 0S7
GEN	GVT. OF CAN.-SUPPLY AND SERVICES 18-207	STATISTICS CANADA PRINTING PLANT STATISTICS CANADA BLDG,TUNNEYS PASTURE	OTTAWA ON	K1A 0S7
GEN	GVT. OF CAN.(OUT OF BUSINESS)CES 18-207	STATISTICS CANADA PRINTING PLANT STATISTICS CANADA BLDG,TUNNEYS PASTURE	OTTAWA ON	K1A 0S7
GEN	GVT. OF CAN.-SUPPLY AND SERVICES	STATISTICS CANADA PRINTING PLANT STATISTICS CANADA BLDG,TUNNEYS PASTURE	OTTAWA ON	K1A 0M7
GEN	CONSUMER AND CORPORATE AFFAIRS 09-314	LEGAL METROLOGY BR., STANDARDS BLDG. TUNNEY'S PASTURE, HOLLAND AVE.	OTTAWA ON	K1A 0C9
GEN	CONSUMER (SEE & USE ON1993100) 09-314	LEGAL METROLOGY BR., STANDARDS BLDG. TUNNEY'S PASTURE, HOLLAND AVE.	OTTAWA ON	K1A 0C9
GEN	CONSUMER AND CORPORATE AFFAIRS	LEGAL METROLOGY BR., STANDARDS BLDG. TUNNEY'S PASTURE, HOLLAND AVE.	OTTAWA ON	K1A 0C9
GEN	CONSUMER & CORPORATE AFFAIRS CAN. 18-261	SCIENTIFIC LAB. STANDARDS BLDG TUNNEY'S PASTURE, HOLLAND AVE/140 PROMENADE DU	PORTAGE, PHASE IV, OTTAWA ON	K1A 0M3
GEN	CONSUMER & CORPORATE AFFAIRS	SCIENTIFIC LAB. STANDARDS BLDG TUNNEY'S PASTURE, HOLLAND AVE/140 PROMENADE DU	PORTAGE, PHASE IV, OTTAWA ON	K1A 0M3
GEN	GVT. OF CAN. PUBLIC WORKS 18-245	NATIONAL REASEARCH COUNCIL, BLDG. SRVCS HEALTH PROT. BLDG.7, TUNNEY'S PASTURE	OTTAWA ON	K1A 0R6
GEN	HEALTH AND WELFARE CANADA	SIR FREDERICK BANTING BLDG. HEALTH UNIT #34, ROOM 201	OTTAWA ON	K1A 0L3
GEN	HEALTH AND WELFARE CANADA	TUNNEY'S PASTURE	OTTAWA ON	K1A 0L2
GEN	GVT. OF CAN. - HEALTH AND WELFARE	TUNNEY'S PASTURE C/O 140 PROMENADE DU PORTAGE (P.WORKS)	OTTAWA ON	K1A 0M3
GEN	HEALTH CANADA	TUNNEY'S PASTURE 1 ROSS AVENUE	OTTAWA ON	K1A 0L2
GEN	Kiewit/EUROVIA/Vinci, Ottawa Partnership	Tunney's Pasture Train Station	Ottawa ON	K1Y 0W1
GEN	GVT. OF CANADA-MEASUREMENT CANADA	HOLLAND AVE., STANDARDS BLDG., (BLDG. #4), TUNNEY'S PASTURE	OTTAWA ON	
LIMO		Lot 37 Concession 1 ON OTTAWA RIVER NEPEAN Ottawa	ON	
LIMO		Lot 37 Concession A ON OTTAWA RIVER NEPEAN Ottawa	ON	

LIMO		Lot 37 Concession A ON OTTAWA RIVER NEPEAN Ottawa	ON	
NCPL	E.B. Eddy Forest Products Ltd.		Ottawa ON	
NCPL	E.B. Eddy Forest Products Limited		Ottawa ON	
NPCB	HEALTH & WELFARE CANADA	ROSS AVE. Sir Frederick Banting	Ottawa ON	
NPCB	ONTARIO HYDRO	R.M. OTTAWA-CARLETON/RP 88291 HINCHEY T.S.	OTTAWA ON	
NPCB	HEALTH AND WELFARE CANADA	LAB. CENTRE FOR DISEASE CONT.; HOLLAND AVE.	OTTAWA ON	K1A 0L2
NPCB	HEALTH & WELFARE CANADA	SIR FREDERICK BANTING BUILDING; ROSS AVE.	OTTAWA ON	K1A 0L2
NPCB	HEALTH AND WELFARE CANADA	SIR FREDERICK BANTING BUILDING; ROSS AVE.	OTTAWA ON	K1A 0L2
NPCB	ONTARIO HYDRO	HINCHEY T.S.; R.M. OTTAWA-CARLETON/RP 88291,	OTTAWA ON	
NPRI	R.W. TOMLINSON LIMITED		Ottawa ON	
PAP	Domtar Eddy Specialty Papers		Ottawa ON	K1Y 4L5
PTTW	R.W. Tomlinson Limited		ON	
SPL	OLRT Constructors		Ottawa ON	
SPL	OLRT Constructors		Ottawa ON	NA
SPL	OC TRANSP	MOTOR VEHICLE (OPERATING FLUID)	OTTAWA CITY ON	
SPL	City of Ottawa	Transitway	Ottawa ON	
SPL	BUS	OTTAWA RIVER PKWY & LINCOLN FIELDS MOTOR VEHICLE (OPERATING FLUID)	OTTAWA CITY ON	
SPL	R.W. Tomlinson Limited		Ottawa ON	
SPL	PCL Constructors Canada Inc.		Ottawa ON	
SPL	OLRT Constructors; City of Ottawa		Ottawa ON	
SPL	Public Work Government Service Canada	Building #13 Du Chardon and Sorrel	Ottawa ON	
SPL	National Capital Commission	Ottawa River Pkwy at the Parkdale Off Ramp West Bound	Ottawa ON	

SPL	OLRT Constructors	north of Scott St east of Holland Ave	Ottawa ON
SPL	Proshred Iron Mountain<UNOFFICIAL>	Holland Street just north of Scott Street, Ottawa<UNOFFICIAL>	Ottawa ON
WWIS		BULLMAN ST WEST OF PARKDALE	OTTAWA ON

Unplottable Report

Site: *Colonnade Development Incorporated*
Ottawa ON

Database:
CA

Certificate #: 1314-7Z8TPU
Application Year: 2010
Issue Date: 1/4/2010
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *National Capital Commission*
Ottawa River Parkway Detour Lane Ottawa ON

Database:
CA

Certificate #: 0973-5M4KXY
Application Year: 2003
Issue Date: 4/30/2003
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *City of Ottawa*
Parkdale Avenue Ottawa ON

Database:
CA

Certificate #: 1490-6ENNR6
Application Year: 2005
Issue Date: 7/27/2005
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *R.W. Tomlinson Limited*
Mobile Facility Ottawa ON

Database:
CA

Certificate #: 4667-7VVM63

Application Year: 2009
Issue Date: 10/30/2009
Approval Type: Air
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Canada Lands Company CLC Limited**
Ottawa ON

Database:
CA

Certificate #: 4783-5JNRC5
Application Year: 2003
Issue Date: 2/13/2003
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **City of Ottawa**
Hamilton Avenue Ottawa ON

Database:
CA

Certificate #: 7365-5NNLC2
Application Year: 2003
Issue Date: 6/24/2003
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **V. REV. D. SEVER**
STONEHURST AVE. OTTAWA CITY ON

Database:
CA

Certificate #: 7-0589-87-
Application Year: 87
Issue Date: 5/27/1987
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *Scott Street (Parkdale to Merton) Ottawa ON* **Database:** [CA](#)

Certificate #: 5431-4HMR4L
Application Year: 00
Issue Date: 3/22/00
Approval Type: Municipal & Private water
Status: Approved
Application Type: New Certificate of Approval
Client Name: Corporation of the Regional Municipality of Ottawa-Carleton
Client Address: 111 Lisgar Street
Client City: Ottawa
Client Postal Code: K2P 2L7
Project Description: Watermain and appurtenances to be constructed.
Contaminants:
Emission Control:

Site: *Scott Street Ottawa ON* **Database:** [CA](#)

Certificate #: 2262-4JHL7S
Application Year: 00
Issue Date: 4/26/00
Approval Type: Municipal & Private water
Status: Approved
Application Type: New Certificate of Approval
Client Name: Corporation of the Regional Municipality of Ottawa-Carleton
Client Address: 111 Lisgar Street
Client City: Ottawa
Client Postal Code: K2P 2L7
Project Description: Watermains and appurtenances to be constructed
Contaminants:
Emission Control:

Site: *Carruthers Ave., Hinchey Ave. & Lyndale Ave. Ottawa ON* **Database:** [CA](#)

Certificate #: 6262-4KNPVR
Application Year: 00
Issue Date: 5/31/00
Approval Type: Municipal & Private water
Status: Approved
Application Type: New Certificate of Approval
Client Name: Corporation of the Regional Municipality of Ottawa-Carleton
Client Address: 111 Lisgar Street
Client City: Ottawa
Client Postal Code: K2P 2L7
Project Description: Construction of Watermains on Carruthers Ave., Hinchey Ave. & Lyndale Ave., City of Ottawa
Contaminants:
Emission Control:

Site: *Ross Avenue Ottawa ON* **Database:** [CA](#)

Certificate #: 9764-59YJ8C
Application Year: 02
Issue Date: 5/9/02
Approval Type: Municipal & Private water
Status: Approved
Application Type: New Certificate of Approval
Client Name: City of Ottawa
Client Address: 1495 Heron Road, Building M

Client City: Ottawa
Client Postal Code: K1V 6A6
Project Description: Construction of Watermains
Contaminants:
Emission Control:

Site:
Ross Avenue Ottawa ON

Database:
CA

Certificate #: 6598-59YJCY
Application Year: 02
Issue Date: 5/14/02
Approval Type: Municipal & Private sewage
Status: Approved
Application Type: New Certificate of Approval
Client Name: City of Ottawa
Client Address: 1495 Heron Road, Building M
Client City: Ottawa
Client Postal Code: K1V 6A6
Project Description: Construction of a Storm Sewer
Contaminants:
Emission Control:

Site:
Forward, Lyndale and Hinchey Ottawa ON

Database:
CA

Certificate #: 8821-4WDQDT
Application Year: 01
Issue Date: 5/4/01
Approval Type: Municipal & Private water
Status: Approved
Application Type: New Certificate of Approval
Client Name: Corporation of the City of Ottawa
Client Address: 111 Sussex Drive, 7th Floor
Client City: Ottawa
Client Postal Code: K1N 5A1
Project Description: Installation of a Watermain
Contaminants:
Emission Control:

Site:
Scott Street (Parkdale to Merton) Ottawa ON

Database:
CA

Certificate #: 7515-4HMRDR
Application Year: 00
Issue Date: 3/22/00
Approval Type: Municipal & Private sewage
Status: Approved
Application Type: New Certificate of Approval
Client Name: Corporation of the City of Ottawa
Client Address: 111 Sussex Drive, 7th Floor
Client City: Ottawa
Client Postal Code: K1N 5A1
Project Description: Sanitary sewers to be constructed.
Contaminants:
Emission Control:

Site:
Forward, Lyndale and Hinchey Ottawa ON

Database:
CA

Certificate #: 8746-4WDR47
Application Year: 01

Issue Date: 5/4/01
Approval Type: Municipal & Private sewage
Status: Approved
Application Type: New Certificate of Approval
Client Name: Corporation of the City of Ottawa
Client Address: 111 Sussex Drive, 7th Floor
Client City: Ottawa
Client Postal Code: K1N 5A1
Project Description: Construction of storm and sanitary sewers
Contaminants:
Emission Control:

Site: Carruthers Ave., Hinchey Ave. & Lyndale Ave. Ottawa ON

Database:
CA

Certificate #: 2010-4KNPH8
Application Year: 00
Issue Date: 5/31/00
Approval Type: Municipal & Private sewage
Status: Approved
Application Type: New Certificate of Approval
Client Name: Corporation of the City of Ottawa
Client Address: 111 Sussex Drive, 7th Floor
Client City: Ottawa
Client Postal Code: K1N 5A1
Project Description: Construction of Storm & Sanitary Sewers on Carruthers Ave., Hinchey Ave. & Lyndale Ave., City of Ottawa
Contaminants:
Emission Control:

Site: R.M. OF OTTAWA-CARLETON
HINTO ST./SPENCER ST/OXFORD ST OTTAWA CITY ON

Database:
CA

Certificate #: 3-0929-96-
Application Year: 96
Issue Date: 10/8/1996
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: OTTAWA CITY
SCOTT ST. OTTAWA CITY ON

Database:
CA

Certificate #: 3-0662-90-
Application Year: 90
Issue Date: 4/30/1990
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: V. REV. D. SEVER
STONEHURST AVE. OTTAWA CITY ON

Database:
CA

Certificate #: 3-0702-87-
Application Year: 87
Issue Date: 5/27/1987
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Colonnade Development Incorporated
Ottawa ON

Database:
CA

Certificate #: 8748-7DGQCH
Application Year: 2008
Issue Date: 4/25/2008
Approval Type: Industrial Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: R.M. OF OTTAWA-CARLETON
SUNNYMEDE AVE. OTTAWA CITY ON

Database:
CA

Certificate #: 7-0990-89-
Application Year: 89
Issue Date: 6/23/1989
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: DOMTAR INC.
ON

Database:
CONV

File No:
Crown Brief No: 96-0211-0126
Court Location:
Publication City:
Publication Title:
Act:
Act(s):
First Matter:
Second Matter:

Location:
Region: EASTERN REGION
Ministry District: BELLEVILLE

Investigation 1:
Investigation 2:
Penalty Imposed:
Description:

VIOLATIONS INVOLVING THE EXCEEDANCE OF THE MONTHLY AVERAGE PROCESS EFFLUENT,
SAMPLES COLLECTED WERE NOT WITHIN RANGE AND FAILED TO REPORT

Background:
URL:

Additional Details

Publication Date:
Count: 1
Act: EPA
Regulation: 760/93
Section: 14(1)
Act/Regulation/Section: EPA-760/93-14(1)
Date of Offence:
Date of Conviction:
Date Charged: 9/11/98
Charge Disposition: SUSPENDED SENTENCE
Fine: \$5,000.00
Synopsis:

Additional Details

Publication Date:
Count: 1
Act: EPA
Regulation: 760/93
Section: 14(8)
Act/Regulation/Section: EPA-760/93-14(8)
Date of Offence:
Date of Conviction:
Date Charged: 9/11/98
Charge Disposition: SUSPENDED SENTENCE
Fine: \$5,000.00
Synopsis:

Additional Details

Publication Date:
Count: 1
Act: EPA
Regulation: 760/93
Section: 33(3)
Act/Regulation/Section: EPA-760/93-33(3)
Date of Offence:
Date of Conviction:
Date Charged: 9/11/98
Charge Disposition: SUSPENDED SENTENCE
Fine: \$2,000.00
Synopsis:

Site: POMERLEAU LTD.
ON

Database:
CONV

File No:
Crown Brief No: 99-0117-0120
Court Location:
Publication City:
Publication Title:
Act:
Act(s):
First Matter:
Second Matter:
Investigation 1:

Location:
Region: EASTERN REGION
Ministry District: OTTAWA

Investigation 2:
Penalty Imposed:
Description:

OPERATE A HEAVY DIESEL-FUELLED MOTOR VEHICLE THAT CONTRAVENES THE EMISSION STANDARDS.

Background:
URL:

Additional Details

Publication Date:
Count: 1
Act: EPA
Regulation: 361/98
Section: 12(5)
Act/Regulation/Section: EPA-361/98-12(5)
Date of Offence:
Date of Conviction:
Date Charged: 9/9/99
Charge Disposition: SUSPENDED SENTENCE
Fine: \$100.00
Synopsis:

Site: AECON CONSTRUCTION AND MATERIAL
ON

Database:
CONV

File No:
Crown Brief No: 98-0000-9004
Court Location:
Publication City:
Publication Title:
Act:
Act(s):
First Matter:
Second Matter:
Investigation 1:
Investigation 2:
Penalty Imposed:
Description: THIS IS THE EASTERN BRIEF FOR ALL P.O.A. TICKETS
Background:
URL:

Location:
Region: EASTERN REGION
Ministry District:

Additional Details

Publication Date:
Count: 1
Act: OWRA
Regulation:
Section: 34(8)
Act/Regulation/Section: OWRA- -34(8)
Date of Offence:
Date of Conviction:
Date Charged: 11/1/01
Charge Disposition: SUSPENDED SENTENCE
Fine: \$305.00
Synopsis:

Site: R.W. TOMLINSON LIMITED
ON

Database:
CONV

File No:
Crown Brief No: 01-0198-0415
Court Location:
Publication City:
Publication Title:
Act:
Act(s):

Location:
Region: EASTERN REGION
Ministry District: OTTAWA

First Matter:
Second Matter:
Investigation 1:
Investigation 2:
Penalty Imposed:
Description: FAIL TO COMPLY SAFETY TRAINING, FAIL TO SUBMIT REPORTS TO DIRECTOR, COMMIT OFFENCE OF TRANSFERRING WASTE OIL WITHOUT GEN. REG. DOCUMENT
Background:
URL:

Additional Details

Publication Date:
Count: 1
Act: EPA
Regulation: 347
Section: 18 (1)
Act/Regulation/Section: EPA 347 18 (1)
Date of Offence:
Date of Conviction:
Date Charged: 2/25/2003
Charge Disposition: FINED
Fine: \$3500
Synopsis:

Site: R.W. Tomlinson Limited
Mobile Facility Ottawa CITY OF OTTAWA ON

Database:
EBR

EBR Registry No: 010-4078
Ministry Ref No: 2891-7FVQ5M
Notice Type: Instrument Decision
Notice Stage:
Notice Date: November 06, 2009
Proposal Date: July 03, 2008
Year: 2008
Instrument Type: (EPA s. 9) - Approval for discharge into the natural environment other than water (i.e. Air)
Off Instrument Name:
Posted By:
Company Name: R.W. Tomlinson Limited
Site Address:
Location Other:
Proponent Name:
Proponent Address: 5597 Power Road, Ottawa Ontario, Canada K1G 3N4
Comment Period:
URL:

Decision Posted:
Exception Posted:
Section:
Act 1:
Act 2:
Site Location Map:

Site Location Details:

Mobile Facility Ottawa CITY OF OTTAWA

Site: Canada Lands Company CLC Limited
Ottawa ON K1P 5L4

Database:
ECA

Approval No: 0824-A8CR5H
Approval Date: 2016-04-12
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: Canada Lands Company CLC Limited
Address:
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/3815-A72KG2-14.pdf>

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: City of Ottawa
Spencer St Ottawa ON K1P 1J1

Database:
ECA

Approval No: 5318-A8TJM9
Approval Date: 2016-04-08
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: City of Ottawa
Address: Spencer St
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/5482-A8AQK-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: Canada Lands Company CLC Limited
Ottawa ON K1P 5L4

Database:
ECA

Approval No: 6929-A7MRBC
Approval Date: 2016-03-03
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: Canada Lands Company CLC Limited
Address:
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/3139-A7HSPY-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: City of Ottawa
Huron Ave N Ottawa ON K2G 6J8

Database:
ECA

Approval No: 7842-BQNMJ5
Approval Date: 2020-06-18
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: City of Ottawa
Address: Huron Ave N
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/0513-BPXPY-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: City of Ottawa
Scott St Ottawa ON K2G 6J8

Database:
ECA

Approval No: 5496-BPATN2
Approval Date: 2020-05-07
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: City of Ottawa
Address: Scott St
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/9806-BNXJXN-13.pdf>
PDF Site Location:

Site: **City of Ottawa**
Scott Street, Premier Ave., Champagne Ave. Ottawa ON K1P 1J1

Database:
ECA

Approval No: 0601-5L8KCA
Approval Date: 2003-04-03
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-Municipal and Private Water Works
Project Type: Municipal and Private Water Works
Business Name: City of Ottawa
Address: Scott Street, Premier Ave., Champagne Ave.
Full Address:
Full PDF Link:
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: **R.W. Tomlinson Limited**
Mobile Facility Ottawa ON K1G 3N4

Database:
ECA

Approval No: 4667-7VVM63
Approval Date: 2009-10-30
Status: Revoked and/or Replaced
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-AIR
Project Type: AIR
Business Name: R.W. Tomlinson Limited
Address: Mobile Facility
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/2891-7FVQ5M-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: **The Regional Municipality of Ottawa-Carleton**
Scott Street Ottawa ON K2P 2L7

Database:
ECA

Approval No: 2262-4JHL7S
Approval Date: 2000-04-26
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-Municipal and Private Water Works
Project Type: Municipal and Private Water Works
Business Name: The Regional Municipality of Ottawa-Carleton
Address: Scott Street
Full Address:
Full PDF Link:
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: **City of Ottawa**
Bullman Street (from Hamilton Avenue to Parkdale Avenue) Ottawa ON K2G 6J8

Database:
ECA

Approval No: 4470-6AKNRL
Approval Date: 2005-03-21
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-Municipal Drinking Water Systems
Project Type: Municipal Drinking Water Systems
Business Name: City of Ottawa
Address: Bullman Street (from Hamilton Avenue to Parkdale Avenue)
Full Address:
Full PDF Link:
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: **Hamilton Ave North Ottawa ON**

Database:
EHS

Order No: 20011212010
Status: C
Report Type: Custom Report
Report Date: 1/14/02
Date Received: 12/12/01
Previous Site Name:
Lot/Building Size:
Additional Info Ordered:

Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): 0.25
X: -75.72978
Y: 45.400477

Site: **GVT. OF CANADA-MEASUREMENT CANADA
HOLLAND AVENUE, STANDARDS BUILDING BUILDING 4, TUNNEY'S PASTURE OTTAWA ON**

Database:
GEN

Generator No: ON1993100
SIC Code: 8125
SIC Description: REGULATORY SERV.
Approval Years: 99,00,01
PO Box No:
Country:

Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Detail(s)

Waste Class: 121
Waste Class Desc: ALKALINE WASTES - HEAVY METALS

Waste Class: 145
Waste Class Desc: PAINT/PIGMENT/COATING RESIDUES

Waste Class: 263
Waste Class Desc: ORGANIC LABORATORY CHEMICALS

Waste Class: 241
Waste Class Desc: HALOGENATED SOLVENTS

Waste Class: 252
Waste Class Desc: WASTE OILS & LUBRICANTS

Waste Class: 253
Waste Class Desc: EMULSIFIED OILS

Waste Class: 331
Waste Class Desc: WASTE COMPRESSED GASES

Waste Class: 148
Waste Class Desc: INORGANIC LABORATORY CHEMICALS

Waste Class: 212
Waste Class Desc: ALIPHATIC SOLVENTS

Waste Class: 213
Waste Class Desc: PETROLEUM DISTILLATES

Waste Class: 221
Waste Class Desc: LIGHT FUELS

Site: GVT. OF CANADA-MEASUREMENT CANADA
HOLLAND AVENUE STANDARDS BUILDING TUNNEY'S PASTURE OTTAWA ON K1A 0C9

Database:
[GEN](#)

Generator No: ON1993100
SIC Code:
SIC Description:
Approval Years: 02,03,04
PO Box No:
Country:

Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Site: GVT. OF CANADA-INDUSTRY CANADA
STANDARDS BUILDING TUNNEY'S PASTURE, HOLLAND AVE. OTTAWA ON

Database:
[GEN](#)

Generator No: ON1993100
SIC Code: 8125
SIC Description: REGULATORY SERV.
Approval Years: 95,96
PO Box No:
Country:

Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Detail(s)

Waste Class: 148
Waste Class Desc: INORGANIC LABORATORY CHEMICALS

Waste Class: 213
Waste Class Desc: PETROLEUM DISTILLATES

Waste Class: 221
Waste Class Desc: LIGHT FUELS

Site: GVT. OF CAN-STATISTICS CANADA 18-155
FACILITIES MANAGEMENT R.H. COATS BUILDING, TUNNEY'S PASTURE OTTAWA ON K1A 0T6

Database:
[GEN](#)

Generator No: ON0684800
SIC Code: 8159
SIC Description: OTHER GEN. ADMIN.
Approval Years: 92,93,94,95,96
PO Box No:
Country:

Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Detail(s)

Waste Class: 121
Waste Class Desc: ALKALINE WASTES - HEAVY METALS

Waste Class: 213
Waste Class Desc: PETROLEUM DISTILLATES

Waste Class: 264
Waste Class Desc: PHOTOPROCESSING WASTES

Site: GVT. OF CAN-STATISTICS CANADA
FACILITIES MANAGEMENT R.H. COATS BUILDING, TUNNEY'S PASTURE OTTAWA ON K1A 0T6

Database:
[GEN](#)

Generator No: ON0684800
SIC Code: 8159
SIC Description: OTHER GEN. ADMIN.
Approval Years: 86,87,88,89,90,97,98,99,00,01

Status:
Co Admin:
Choice of Contact:
Phone No Admin:

PO Box No:
Country:

Contam. Facility:
MHSW Facility:

Detail(s)

Waste Class: 121
Waste Class Desc: ALKALINE WASTES - HEAVY METALS

Waste Class: 213
Waste Class Desc: PETROLEUM DISTILLATES

Waste Class: 264
Waste Class Desc: PHOTOPROCESSING WASTES

Site: GVT. OF CAN.(OUT OF BUSINESS)
STATISTICS CANADA PRINTING PLANT STATISTICS CANADA BLDG,TUNNEYS PASTURE OTTAWA ON K1A 0S7

Database:
[GEN](#)

Generator No: ON0249608
SIC Code: 2849
SIC Description: OTHER PRINTING IND.
Approval Years: 98
PO Box No:
Country:

Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Detail(s)

Waste Class: 213
Waste Class Desc: PETROLEUM DISTILLATES

Waste Class: 252
Waste Class Desc: WASTE OILS & LUBRICANTS

Waste Class: 264
Waste Class Desc: PHOTOPROCESSING WASTES

Site: GVT. OF CAN.-SUPPLY AND SERVICES 18-207
STATISTICS CANADA PRINTING PLANT STATISTICS CANADA BLDG,TUNNEYS PASTURE OTTAWA ON K1A 0S7

Database:
[GEN](#)

Generator No: ON0249608
SIC Code: 2849
SIC Description: OTHER PRINTING IND.
Approval Years: 94
PO Box No:
Country:

Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Detail(s)

Waste Class: 213
Waste Class Desc: PETROLEUM DISTILLATES

Waste Class: 252
Waste Class Desc: WASTE OILS & LUBRICANTS

Waste Class: 264
Waste Class Desc: PHOTOPROCESSING WASTES

Site: GVT. OF CAN.(OUT OF BUSINESS)CES 18-207
STATISTICS CANADA PRINTING PLANT STATISTICS CANADA BLDG,TUNNEYS PASTURE OTTAWA ON K1A 0S7

Database:
[GEN](#)

Generator No: ON0249608
SIC Code: 2849
SIC Description: OTHER PRINTING IND.
Approval Years: 92,93,95,96,97
PO Box No:

Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:

Country:

MHSW Facility:

Detail(s)

Waste Class: 213
Waste Class Desc: PETROLEUM DISTILLATES

Waste Class: 252
Waste Class Desc: WASTE OILS & LUBRICANTS

Waste Class: 264
Waste Class Desc: PHOTOPROCESSING WASTES

Site: GVT. OF CAN.-SUPPLY AND SERVICES
STATISTICS CANADA PRINTING PLANT STATISTICS CANADA BLDG,TUNNEYS PASTURE OTTAWA ON K1A 0M7

Database:
GEN

Generator No: ON0249608
SIC Code: 2849
SIC Description: OTHER PRINTING IND.
Approval Years: 86,87,88,89,90
PO Box No:
Country:

Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Detail(s)

Waste Class: 213
Waste Class Desc: PETROLEUM DISTILLATES

Waste Class: 264
Waste Class Desc: PHOTOPROCESSING WASTES

Site: CONSUMER AND CORPORATE AFFAIRS 09-314
LEGAL METROLOGY BR., STANDARDS BLDG. TUNNEY'S PASTURE, HOLLAND AVE. OTTAWA ON K1A 0C9

Database:
GEN

Generator No: ON0224703
SIC Code: 8125
SIC Description: REGULATORY SERV.
Approval Years: 94
PO Box No:
Country:

Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Detail(s)

Waste Class: 221
Waste Class Desc: LIGHT FUELS

Waste Class: 213
Waste Class Desc: PETROLEUM DISTILLATES

Site: CONSUMER (SEE & USE ON1993100) 09-314
LEGAL METROLOGY BR., STANDARDS BLDG. TUNNEY'S PASTURE, HOLLAND AVE. OTTAWA ON K1A 0C9

Database:
GEN

Generator No: ON0224703
SIC Code: 8125
SIC Description: REGULATORY SERV.
Approval Years: 92,93,95,96,97
PO Box No:
Country:

Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Detail(s)

Waste Class: 213
Waste Class Desc: PETROLEUM DISTILLATES

Waste Class: 221
Waste Class Desc: LIGHT FUELS

Site: CONSUMER AND CORPORATE AFFAIRS
LEGAL METROLOGY BR., STANDARDS BLDG. TUNNEY'S PASTURE, HOLLAND AVE. OTTAWA ON K1A 0C9

Database:
GEN

Generator No: ON0224703
SIC Code: 8125
SIC Description: REGULATORY SERV.
Approval Years: 89,90
PO Box No:
Country:
Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Detail(s)

Waste Class: 213
Waste Class Desc: PETROLEUM DISTILLATES

Waste Class: 221
Waste Class Desc: LIGHT FUELS

Site: CONSUMER & CORPORATE AFFAIRS CAN. 18-261
SCIENTIFIC LAB. STANDARDS BLDG TUNNEY'S PASTURE, HOLLAND AVE/140 PROMENADE DU PORTAGE,
PHASE IV, OTTAWA ON K1A 0M3

Database:
GEN

Generator No: ON0224702
SIC Code: 8129
SIC Description: OTHER PROTECT. SERV.
Approval Years: 92,93,94,95,96,97
PO Box No:
Country:
Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Detail(s)

Waste Class: 145
Waste Class Desc: PAINT/PIGMENT/COATING RESIDUES

Waste Class: 148
Waste Class Desc: INORGANIC LABORATORY CHEMICALS

Waste Class: 212
Waste Class Desc: ALIPHATIC SOLVENTS

Waste Class: 221
Waste Class Desc: LIGHT FUELS

Waste Class: 241
Waste Class Desc: HALOGENATED SOLVENTS

Waste Class: 263
Waste Class Desc: ORGANIC LABORATORY CHEMICALS

Site: CONSUMER & CORPORATE AFFAIRS
SCIENTIFIC LAB. STANDARDS BLDG TUNNEY'S PASTURE, HOLLAND AVE/140 PROMENADE DU PORTAGE,
PHASE IV, OTTAWA ON K1A 0M3

Database:
GEN

Generator No: ON0224702
SIC Code: 8129
SIC Description: OTHER PROTECT. SERV.
Approval Years: 88
PO Box No:
Country:
Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Detail(s)

Waste Class: 148
Waste Class Desc: INORGANIC LABORATORY CHEMICALS

Waste Class: 263
Waste Class Desc: ORGANIC LABORATORY CHEMICALS

Site: GVT. OF CAN. PUBLIC WORKS 18-245
NATIONAL RESEARCH COUNCIL, BLDG. SRVCS HEALTH PROT. BLDG.7, TUNNEY'S PASTURE OTTAWA ON K1A 0R6

Database:
GEN

Generator No: ON0175805
SIC Code: 0000
SIC Description: *** NOT DEFINED ***
Approval Years: 92,93,94
PO Box No:
Country:

Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Site: HEALTH AND WELFARE CANADA
SIR FREDERICK BANTING BLDG. HEALTH UNIT #34, ROOM 201 OTTAWA ON K1A 0L3

Database:
GEN

Generator No: ON0095621
SIC Code: 8635
SIC Description: PUB. HEALTH CLINICS
Approval Years: 98
PO Box No:
Country:

Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Detail(s)

Waste Class: 312
Waste Class Desc: PATHOLOGICAL WASTES

Site: HEALTH AND WELFARE CANADA
TUNNEY'S PASTURE OTTAWA ON K1A 0L2

Database:
GEN

Generator No: ON0095600
SIC Code: 8693
SIC Description: HEALTH CARE RESEARCH
Approval Years: 99,00,01
PO Box No:
Country:

Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Detail(s)

Waste Class: 148
Waste Class Desc: INORGANIC LABORATORY CHEMICALS

Waste Class: 211
Waste Class Desc: AROMATIC SOLVENTS

Waste Class: 212
Waste Class Desc: ALIPHATIC SOLVENTS

Waste Class: 241
Waste Class Desc: HALOGENATED SOLVENTS

Waste Class: 242
Waste Class Desc: HALOGENATED PESTICIDES

Waste Class: 243
Waste Class Desc: PCB'S

Waste Class: 252
Waste Class Desc: WASTE OILS & LUBRICANTS

Waste Class: 261
Waste Class Desc: PHARMACEUTICALS

Waste Class: 263
Waste Class Desc: ORGANIC LABORATORY CHEMICALS

Waste Class: 264
Waste Class Desc: PHOTOPROCESSING WASTES

Waste Class: 312
Waste Class Desc: PATHOLOGICAL WASTES

Waste Class: 331
Waste Class Desc: WASTE COMPRESSED GASES

Site: GVT. OF CAN. - HEALTH AND WELFARE
TUNNEY'S PASTURE C/O 140 PROMENADE DU PORTAGE (P.WORKS) OTTAWA ON K1A 0M3

Database:
GEN

Generator No: ON0095600
SIC Code: 8693
SIC Description: HEALTH CARE RESEARCH
Approval Years: 86,87,88,89
PO Box No:
Country:

Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Detail(s)

Waste Class: 148
Waste Class Desc: INORGANIC LABORATORY CHEMICALS

Waste Class: 211
Waste Class Desc: AROMATIC SOLVENTS

Waste Class: 212
Waste Class Desc: ALIPHATIC SOLVENTS

Waste Class: 331
Waste Class Desc: WASTE COMPRESSED GASES

Waste Class: 241
Waste Class Desc: HALOGENATED SOLVENTS

Waste Class: 242
Waste Class Desc: HALOGENATED PESTICIDES

Waste Class: 252
Waste Class Desc: WASTE OILS & LUBRICANTS

Waste Class: 263
Waste Class Desc: ORGANIC LABORATORY CHEMICALS

Waste Class: 264
Waste Class Desc: PHOTOPROCESSING WASTES

Waste Class: 312
Waste Class Desc: PATHOLOGICAL WASTES

Site: HEALTH CANADA
TUNNEY'S PASTURE 1 ROSS AVENUE OTTAWA ON K1A 0L2

Database:
GEN

Generator No: ON0095600
SIC Code:
SIC Description:
Approval Years: As of Feb 2022
PO Box No:
Country: Canada

Status: Registered
Co Admin:
Choice of Contact:
Phone No Admin:
Contam. Facility:
MHSW Facility:

Detail(s)

Waste Class:	242 B
Waste Class Desc:	Halogenated pesticides and herbicides
Waste Class:	148 I
Waste Class Desc:	Misc. wastes and inorganic chemicals
Waste Class:	145 I
Waste Class Desc:	Wastes from the use of pigments, coatings and paints
Waste Class:	252 L
Waste Class Desc:	Waste crankcase oils and lubricants
Waste Class:	263 I
Waste Class Desc:	Misc. waste organic chemicals
Waste Class:	148 B
Waste Class Desc:	Misc. wastes and inorganic chemicals
Waste Class:	148 R
Waste Class Desc:	Misc. wastes and inorganic chemicals
Waste Class:	263 R
Waste Class Desc:	Misc. waste organic chemicals
Waste Class:	264 T
Waste Class Desc:	Photoprocessing wastes
Waste Class:	331 I
Waste Class Desc:	Waste compressed gases including cylinders
Waste Class:	261 A
Waste Class Desc:	Pharmaceuticals
Waste Class:	148 C
Waste Class Desc:	Misc. wastes and inorganic chemicals
Waste Class:	145 T
Waste Class Desc:	Wastes from the use of pigments, coatings and paints
Waste Class:	251 L
Waste Class Desc:	Waste oils/sludges (petroleum based)
Waste Class:	148 A
Waste Class Desc:	Misc. wastes and inorganic chemicals
Waste Class:	262 L
Waste Class Desc:	Detergents and soaps
Waste Class:	263 L
Waste Class Desc:	Misc. waste organic chemicals
Waste Class:	241 H
Waste Class Desc:	Halogenated solvents and residues
Waste Class:	263 A
Waste Class Desc:	Misc. waste organic chemicals
Waste Class:	212 H
Waste Class Desc:	Aliphatic solvents and residues
Waste Class:	312 P
Waste Class Desc:	Pathological wastes
Waste Class:	243 D
Waste Class Desc:	PCB

Waste Class:	211 H
Waste Class Desc:	Aromatic solvents and residues
Waste Class:	122 C
Waste Class Desc:	Alkaline slutions - containing other metals and non-metals (not cyanide)
Waste Class:	148 L
Waste Class Desc:	Misc. wastes and inorganic chemicals
Waste Class:	112 C
Waste Class Desc:	Acid solutions - containing heavy metals
Waste Class:	252 T
Waste Class Desc:	Waste crankcase oils and lubricants
Waste Class:	212 L
Waste Class Desc:	Aliphatic solvents and residues
Waste Class:	146 T
Waste Class Desc:	Other specified inorganic sludges, slurries or solids
Waste Class:	264 C
Waste Class Desc:	Photoprocessing wastes
Waste Class:	263 B
Waste Class Desc:	Misc. waste organic chemicals
Waste Class:	121 C
Waste Class Desc:	Alkaline slutions - containing heavy metals

Site: Kiewit/EUROVIA/Vinci, Ottawa Partnership
Tunney's Pasture Train Station Ottawa ON K1Y 0W1

Database:
GEN

Generator No:	ON4606022	Status:	Registered
SIC Code:		Co Admin:	
SIC Description:		Choice of Contact:	
Approval Years:	As of Nov 2021	Phone No Admin:	
PO Box No:		Contam. Facility:	
Country:	Canada	MHSW Facility:	

Detail(s)

Waste Class:	252 L
Waste Class Desc:	Waste crankcase oils and lubricants
Waste Class:	146 C
Waste Class Desc:	Other specified inorganic sludges, slurries or solids
Waste Class:	221 L
Waste Class Desc:	Light fuels
Waste Class:	146 L
Waste Class Desc:	Other specified inorganic sludges, slurries or solids

Site: GVT. OF CANADA-MEASUREMENT CANADA
HOLLAND AVE., STANDARDS BLDG., (BLDG. #4), TUNNEY'S PASTURE OTTAWA ON

Database:
GEN

Generator No:	ON1993100	Status:	
SIC Code:	8125	Co Admin:	
SIC Description:	REGULATORY SERV.	Choice of Contact:	
Approval Years:	97,98	Phone No Admin:	
PO Box No:		Contam. Facility:	
Country:		MHSW Facility:	

Detail(s)

Waste Class:	121
Waste Class Desc:	ALKALINE WASTES - HEAVY METALS
Waste Class:	145
Waste Class Desc:	PAINT/PIGMENT/COATING RESIDUES
Waste Class:	252
Waste Class Desc:	WASTE OILS & LUBRICANTS
Waste Class:	253
Waste Class Desc:	EMULSIFIED OILS
Waste Class:	263
Waste Class Desc:	ORGANIC LABORATORY CHEMICALS
Waste Class:	331
Waste Class Desc:	WASTE COMPRESSED GASES
Waste Class:	148
Waste Class Desc:	INORGANIC LABORATORY CHEMICALS
Waste Class:	212
Waste Class Desc:	ALIPHATIC SOLVENTS
Waste Class:	213
Waste Class Desc:	PETROLEUM DISTILLATES
Waste Class:	221
Waste Class Desc:	LIGHT FUELS
Waste Class:	241
Waste Class Desc:	HALOGENATED SOLVENTS

Site:

Lot 37 Concession 1 ON OTTAWA RIVER NEPEAN Ottawa ON

Database:

LIMO

ECA/Instrument No:	X1111	Natural Attenuation:
Operation Status:	Historic	Liners:
C of A Issue Date:		Cover Material:
C of A Issued to:		Leachate Off-Site:
Lndfl Gas Mgmt (P):		Leachate On Site:
Lndfl Gas Mgmt (F):		Req Coll Lndfl Gas:
Lndfl Gas Mgmt (E):		Lndfl Gas Coll:
Lndfl Gas Mgmt Sys:		Total Waste Rec:
Landfill Gas Mntr:		TWR Methodology:
Leachate Coll Sys:		TWR Unit:
ERC Est Vol (m3):		Tot Aprv Cap Unit:
ERC Volume Unit:		Financial Assurance:
ERC Dt Last Det:		Last Report Year:
Landfill Type:		Region:
Source File Type:	Historic and Closed Landfills	District Office:
Fill Rate:		Site County:
Fill Rate Unit:		Lot:
Tot Fill Area (ha):		Concession:
Tot Site Area (ha):		Latitude:
Footprint:		Longitude:
Tot Aprv Cap (m3):		Easting:
Contam Atten Zone:		Northing:
Grndwtr Mntr:		UTM Zone:
Surf Wtr Mntr:		Data Source:
Air Emis Monitor:		
Approved Waste Type:		
Client Site Name:		
ERC Methodology:		
Site Name:		
Site Location Details:	Lot 37 Concession 1 ON OTTAWA RIVER NEPEAN	

Site:

Lot 37 Concession A ON OTTAWA RIVER NEPEAN Ottawa ON

Database:

LIMO

ECA/Instrument No:	X1020	Natural Attenuation:
Operation Status:	Historic	Liners:
C of A Issue Date:		Cover Material:
C of A Issued to:		Leachate Off-Site:
Lndfl Gas Mgmt (P):		Leachate On Site:
Lndfl Gas Mgmt (F):		Req Coll Lndfl Gas:
Lndfl Gas Mgmt (E):		Lndfl Gas Coll:
Lndfl Gas Mgmt Sys:		Total Waste Rec:
Landfill Gas Mntr:		TWR Methodology:
Leachate Coll Sys:		TWR Unit:
ERC Est Vol (m3):		Tot Aprv Cap Unit:
ERC Volume Unit:		Financial Assurance:
ERC Dt Last Det:		Last Report Year:
Landfill Type:		Region:
Source File Type:	Historic and Closed Landfills	District Office:
Fill Rate:		Site County:
Fill Rate Unit:		Lot:
Tot Fill Area (ha):		Concession:
Tot Site Area (ha):		Latitude:
Footprint:		Longitude:
Tot Aprv Cap (m3):		Easting:
Contam Atten Zone:		Northing:
Grndwtr Mntr:		UTM Zone:
Surf Wtr Mntr:		Data Source:
Air Emis Monitor:		
Approved Waste Type:		
Client Site Name:		
ERC Methodology:		
Site Name:		
Site Location Details:	Lot 37 Concession A ON OTTAWA RIVER NEPEAN	

Ottawa

Service Area:

Page URL:

Site:

Lot 37 Concession A ON OTTAWA RIVER NEPEAN Ottawa ON

Database:

LIMO

ECA/Instrument No:	X1021	Natural Attenuation:
Operation Status:	Historic	Liners:
C of A Issue Date:		Cover Material:
C of A Issued to:		Leachate Off-Site:
Lndfl Gas Mgmt (P):		Leachate On Site:
Lndfl Gas Mgmt (F):		Req Coll Lndfl Gas:
Lndfl Gas Mgmt (E):		Lndfl Gas Coll:
Lndfl Gas Mgmt Sys:		Total Waste Rec:
Landfill Gas Mntr:		TWR Methodology:
Leachate Coll Sys:		TWR Unit:
ERC Est Vol (m3):		Tot Aprv Cap Unit:
ERC Volume Unit:		Financial Assurance:
ERC Dt Last Det:		Last Report Year:
Landfill Type:		Region:
Source File Type:	Historic and Closed Landfills	District Office:
Fill Rate:		Site County:
Fill Rate Unit:		Lot:
Tot Fill Area (ha):		Concession:
Tot Site Area (ha):		Latitude:
Footprint:		Longitude:
Tot Aprv Cap (m3):		Easting:

Contam Atten Zone:
Grndwtr Mntr:
Surf Wtr Mntr:
Air Emis Monitor:
Approved Waste Type:
Client Site Name:
ERC Methodology:
Site Name:
Site Location Details: Lot 37 Concession A ON OTTAWA RIVER NEPEAN

Northing:
UTM Zone:
Data Source:

Service Area: Ottawa

Page URL:

Site: E.B. Eddy Forest Products Ltd.
Ottawa ON

Database:
NCPL

Year: 1995
Site Name:
Facility Owner:
Discharge Type: Wastewater
Sector: Pulp and Paper
District Area:
Type of Concern: Policy and Guidelines
Contaminant: see "Status Report"
Status Report: Exceeded the annual guideline for biochemical oxygen demand. The wastewater from this site is now piped to a new treatment facility in Hull, Quebec.

Site: E.B. Eddy Forest Products Limited
Ottawa ON

Database:
NCPL

Year: 1994
Site Name:
Facility Owner:
Discharge Type: Wastewater
Sector: Pulp and Paper
District Area:
Type of Concern: Policy and Guidelines
Contaminant: see "Status Report"
Status Report: Exceeded the annual objective for biochemical oxygen demand and the monthly objective for total phosphorus three times. The company is constructing wastewater treatment facilities in Hull, Quebec. The treatment plant now receives the process wastewater produced at the Ottawa mill.

Site: HEALTH & WELFARE CANADA
ROSS AVE. Sir Frederick Banting Ottawa ON

Database:
NPCB

Company Code: O3163
Industry: Public Works Canada
Site Status: Stored for Future Use
Transaction Date: 10/27/1989
Inspection Date: 8/9/1988

--Details--

Label:
Serial No.:
PCB Type/Code: Mineral Oil/Unknown
Location: ROOM C112
Item/State:
No. of Items:
Manufacturer:
Status: Stored for future use
Contents:

Label:
Serial No.:

PCB Type/Code: Askarel/Askarel
Location: 7 BALLAST IN STORAGE
Item/State:
No. of Items:
Manufacturer:
Status: Stored for disposal
Contents:

Site: **ONTARIO HYDRO**
R.M. OTTAWA-CARLETON/RP 88291 HINCHEY T.S. OTTAWA ON

Database:
NPCB

Company Code: O0885
Industry: UTILITY
Site Status:
Transaction Date: 5/31/1988
Inspection Date:

Site: **HEALTH AND WELFARE CANADA**
LAB. CENTRE FOR DISEASE CONT.; HOLLAND AVE. OTTAWA ON K1A 0L2

Database:
NPCB

Company Code: O3162
Industry: Public Works Canada
Site Status:
Transaction Date: 5/30/1990
Inspection Date:

Site: **HEALTH & WELFARE CANADA**
SIR FREDERICK BANTING BUILDING; ROSS AVE. OTTAWA ON K1A 0L2

Database:
NPCB

Company Code: O3163
Industry: Public Works Canada
Site Status:
Transaction Date: 10/7/1993
Inspection Date: 8/9/1988

Site: **HEALTH AND WELFARE CANADA**
SIR FREDERICK BANTING BUILDING; ROSS AVE. OTTAWA ON K1A 0L2

Database:
NPCB

Company Code: O3163
Industry: Public Works Canada
Site Status:
Transaction Date: 5/30/1990
Inspection Date: 8/9/1988

Site: **ONTARIO HYDRO**
HINCHEY T.S.; R.M. OTTAWA-CARLETON/RP 88291, OTTAWA ON

Database:
NPCB

Company Code: O0885
Industry: Utility
Site Status:
Transaction Date: 5/31/1988
Inspection Date:

Site: **R.W. TOMLINSON LIMITED**
Ottawa ON

Database:
NPRI

NPRI ID: 7200011897
Other ID:
No Other ID:

Org ID:
Submit Date:
Last Modified:

Track ID:		Contact ID:	
Report ID:	826	Cont Type:	MED
Report Type:		Contact Title:	
Rpt Type ID:		Cont First Name:	
Report Year:	2011	Cont Last Name:	
Not-Current Rpt?:		Contact Position:	
Yr of Last Filed Rpt:		Contact Fax:	
Fac ID:		Contact Ph.:	
Fac Name:	CRM CARP	Cont Area Code:	
Fac Address1:		Contact Tel.:	
Fac Address2:		Contact Ext.:	
Fac Postal Zip:		Cont Fax Area Cde:	
Facility Lat:		Contact Fax:	
Facility Long:		Contact Email:	
DLS (Last Filed Rpt):		Latitude:	
Facility DLS:		Longitude:	
Datum:		UTM Zone:	
Facility Cmnts:		UTM Northing:	
URL:		UTM Easting:	
No of Empl.:	8	Waste Streams:	
Parent Co.:		No Streams:	
No Parent Co.:		Waste Off Sites:	
Pollut Prev Cmnts:		No Off Sites:	
Stacks:		Shutdown:	
No of Stacks:		No of Shutdown:	
Canadian SIC Code (2 digit):			
Canadian SIC Code:			
SIC Code Description:			
American SIC Code:			
NAICS Code (2 digit):	32		
NAICS 2 Description:	Manufacturing		
NAICS Code (4 digit):	3273		
NAICS 4 Description:	Cement and Concrete Product Manufacturing		
NAICS Code (6 digit):	327320		
NAICS 6 Description:	Ready-Mix Concrete Manufacturing		

Site: Domtar Eddy Specialty Papers
Ottawa ON K1Y 4L5

Database:
PAP

Company ID:	2014	Year:	1999
Status:		Description:	Mills
Type:	Head Office	Website:	
Operation:	Wood		
Status Desc:			
Effluent Pollution Control:			
Company Name:			
Division:			
Company Mailing Address:			
Mailing Address:	P.O. Box 3521, Station C		
Mill Mailing Address:			
Mill Notes:			
History:			
Company History:			

Site: R.W. Tomlinson Limited
ON

Database:
PTTW

EBR Registry No:	010-5329	Decision Posted:	
Ministry Ref No:	3248-7LXR8J	Exception Posted:	
Notice Type:	Instrument\Decision	Section:	
Notice Stage:		Act 1:	
Notice Date:	April\14,\2009	Act 2:	
Proposal Date:	December\04,\2008	Site Location Map:	
Year:	2008		
Instrument Type:	(OWRA\ss.\s34)\s-\sPermit\sto\sTake\sWater		
Off Instrument Name:			
Posted By:			

Company Name: R.W.\sTomlinson\sLimited
Site Address:
Location Other:
Proponent Name:
Proponent Address: 5597\sPower\sRoad,\sOttawa\sOntario,\sCanada\sK1G\s3N4
Comment Period:
URL:

Site Location Details:

R.W. Tomlinson Limited Address: Lot: 20, Concession: 7, Ottawa, City District Office: Ottawa GeoReference: Map Datum: NAD83, Zone: 18, Accuracy Estimate: 10-30 metres eg. Medium Quality GPS, Method: Map, UTM Easting: 470954, UTM Northing: 5024837 CITY OF OTTAWA

Site: OLRT Constructors
Ottawa ON

Database:
SPL

Ref No:	5368-A5EMJN	Discharger Report:	
Site No:	NA	Material Group:	
Incident Dt:	12/21/2015	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:		Sector Type:	Miscellaneous Industrial
Incident Event:		Agency Involved:	
Contaminant Code:	28	Nearest Watercourse:	
Contaminant Name:	CONCRETE ADMIXTURE (DE-WATERING)	Site Address:	
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:		Site Municipality:	Ottawa
Nature of Impact:		Site Lot:	
Receiving Medium:		Site Conc:	
Receiving Env:		Northing:	
MOE Response:	No	Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	12/21/2015	Site Map Datum:	
Dt Document Closed:		SAC Action Class:	Land Spills
Incident Reason:	Operator/Human Error	Source Type:	
Site Name:	OLRT construction site - located by Belfast Rd. overpass<UNOFFICIAL>		
Site County/District:			
Site Geo Ref Meth:			
Incident Summary:	OLRT: 3 L of concrete washout to soil, cleaned		
Contaminant Qty:	3 L		

Site: OLRT Constructors
Ottawa ON NA

Database:
SPL

Ref No:	2136-A6TPRD	Discharger Report:	
Site No:	0500-9VRLCQ	Material Group:	
Incident Dt:	2016/02/04	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:		Sector Type:	Miscellaneous Industrial
Incident Event:	Leak/Break	Agency Involved:	
Contaminant Code:	13	Nearest Watercourse:	
Contaminant Name:	DIESEL FUEL	Site Address:	
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	NA
Contaminant UN No 1:		Site Region:	
Environment Impact:		Site Municipality:	Ottawa
Nature of Impact:		Site Lot:	
Receiving Medium:		Site Conc:	
Receiving Env:	Land	Northing:	5031025
MOE Response:	No	Easting:	452415
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	NA
MOE Reported Dt:	2016/02/04	Site Map Datum:	NA
Dt Document Closed:		SAC Action Class:	Land Spills
Incident Reason:	Unknown / N/A	Source Type:	

Site Name: OLRT Blair Station
Site County/District:
Site Geo Ref Meth: NA
Incident Summary: OLRT- 2L Diesel to Asphalt
Contaminant Qty: 2 L

Site: OC TRANSPO
MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON

Database:
SPL

Ref No:	241575	Discharger Report:	
Site No:		Material Group:	
Incident Dt:	10/6/2002	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:	OTHER TRANSPORTATION ACCIDENT	Sector Type:	
Incident Event:		Agency Involved:	
Contaminant Code:		Nearest Watercourse:	
Contaminant Name:		Site Address:	
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:	POSSIBLE	Site Municipality:	20107
Nature of Impact:	Water course or lake	Site Lot:	
Receiving Medium:	WATER, LAND	Site Conc:	
Receiving Env:		Northing:	
MOE Response:		Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	10/6/2002	Site Map Datum:	
Dt Document Closed:		SAC Action Class:	
Incident Reason:	UNKNOWN	Source Type:	
Site Name:			
Site County/District:			
Site Geo Ref Meth:			
Incident Summary:	OC TRANSPO: 10L ANTIFREEZE TO STORMS, ROAD. SEWERMATIC RESPONDING.		
Contaminant Qty:			

Site: City of Ottawa
Transitway Ottawa ON

Database:
SPL

Ref No:	7101-5LY5CZ	Discharger Report:	
Site No:		Material Group:	Chemical
Incident Dt:	4/25/2003	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:		Sector Type:	Other
Incident Event:		Agency Involved:	
Contaminant Code:	24	Nearest Watercourse:	
Contaminant Name:	ETHYLENE GLYCOL (ANTIFREEZE)	Site Address:	
Contaminant Limit 1:		Site District Office:	Ottawa
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	Eastern
Environment Impact:		Site Municipality:	Ottawa
Nature of Impact:		Site Lot:	
Receiving Medium:	Water	Site Conc:	
Receiving Env:		Northing:	
MOE Response:		Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	4/25/2003	Site Map Datum:	
Dt Document Closed:		SAC Action Class:	Spills
Incident Reason:		Source Type:	
Site Name:	TUNNEY'S PASTURE STATION<UNOFFICIAL>		
Site County/District:			
Site Geo Ref Meth:			
Incident Summary:	Transit Bus - 5 L antifreeze to san.sewer. cleaned		
Contaminant Qty:	5 L		

Site: BUS
OTTAWA RIVER PKWY & LINCOLN FIELDS MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON

Database:
SPL

Ref No:	58039	Discharger Report:	
Site No:		Material Group:	
Incident Dt:	10/1/1991	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:	OTHER TRANSPORTATION ACCIDENT	Sector Type:	
Incident Event:		Agency Involved:	
Contaminant Code:		Nearest Watercourse:	
Contaminant Name:		Site Address:	
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:	POSSIBLE	Site Municipality:	20101
Nature of Impact:	Soil Contamination	Site Lot:	
Receiving Medium:	LAND	Site Conc:	
Receiving Env:		Northing:	
MOE Response:		Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	10/1/1991	Site Map Datum:	
Dt Document Closed:		SAC Action Class:	
Incident Reason:	ERROR	Source Type:	
Site Name:			
Site County/District:			
Site Geo Ref Meth:			
Incident Summary:	OC TRANSPO BUS - 20-30 L DIESEL FUEL TO GRND WHEN 2 BUSES COLLIDED.		
Contaminant Qty:			

Site: R.W. Tomlinson Limited
Ottawa ON

Database:
SPL

Ref No:	5848-9W4RW6	Discharger Report:	
Site No:	NA	Material Group:	
Incident Dt:	5/1/2015	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:	Leak/Break	Sector Type:	
Incident Event:		Agency Involved:	
Contaminant Code:		Nearest Watercourse:	
Contaminant Name:		Site Address:	
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:		Site Municipality:	Ottawa
Nature of Impact:	Land	Site Lot:	
Receiving Medium:		Site Conc:	
Receiving Env:		Northing:	
MOE Response:	N	Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	5/1/2015	Site Map Datum:	
Dt Document Closed:		SAC Action Class:	Land Spills
Incident Reason:	Operator/Human Error	Source Type:	
Site Name:	Bearbrook bridge on Hwy 417 east bound<UNOFFICIAL>		
Site County/District:			
Site Geo Ref Meth:			
Incident Summary:	R.W. Tomlinson: Sediment release to Bearbrook tributary		
Contaminant Qty:			

Site: PCL Constructors Canada Inc.
Ottawa ON

Database:
SPL

Ref No:	7664-9W4K92	Discharger Report:	
Site No:	NA	Material Group:	
Incident Dt:	5/1/2015	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:	Vandalism	Sector Type:	

Incident Event:		Agency Involved:	
Contaminant Code:	99	Nearest Watercourse:	
Contaminant Name:	WATER	Site Address:	
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:		Site Municipality:	Ottawa
Nature of Impact:	Surface Water	Site Lot:	
Receiving Medium:		Site Conc:	
Receiving Env:		Northing:	
MOE Response:	N	Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	5/1/2015	Site Map Datum:	
Dt Document Closed:	5/28/2015	SAC Action Class:	Watercourse Spills
Incident Reason:	Operator/Human Error	Source Type:	
Site Name:	47 Ruskin Street<UNOFFICIAL>		
Site County/District:			
Site Geo Ref Meth:			
Incident Summary:	100L untreated groundwater to catchbasin		
Contaminant Qty:	100 L		

Site: OLRT Constructors; City of Ottawa
Ottawa ON

Database:
SPL

Ref No:	7521-9URNRM	Discharger Report:	
Site No:	NA	Material Group:	
Incident Dt:	3/4/2015	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:	Leak/Break	Sector Type:	
Incident Event:		Agency Involved:	
Contaminant Code:	13	Nearest Watercourse:	
Contaminant Name:	DIESEL FUEL	Site Address:	
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:		Site Municipality:	Ottawa
Nature of Impact:	Land	Site Lot:	
Receiving Medium:		Site Conc:	
Receiving Env:		Northing:	5029087
MOE Response:	N	Easting:	444249
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	3/19/2015	Site Map Datum:	
Dt Document Closed:	4/2/2015	SAC Action Class:	Land Spills
Incident Reason:	Equipment Failure	Source Type:	
Site Name:	grassy area between Albert Street and the pedestrian multi-use pathway, immediately east of Booth Street<UNOFFICIAL>		
Site County/District:			
Site Geo Ref Meth:	10 -100 metres eg. Topographic Map		
Incident Summary:	OLRT - 15L diesel to grass March 4th, cleaning		
Contaminant Qty:	15 L		

Site: Public Work Government Service Canada
Building #13 Du Chardon and Sorrel Ottawa ON

Database:
SPL

Ref No:	6556-8BWLK	Discharger Report:	
Site No:		Material Group:	
Incident Dt:		Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:	Other Discharges	Sector Type:	
Incident Event:		Agency Involved:	
Contaminant Code:	38	Nearest Watercourse:	
Contaminant Name:	REFRIGERANT GAS, N.O.S.	Site Address:	Building #13 Du Chardon and Sorrel
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:	Not Anticipated	Site Municipality:	Ottawa

Nature of Impact:	Air Pollution	Site Lot:	
Receiving Medium:		Site Conc:	
Receiving Env:		Northing:	
MOE Response:	No Field Response	Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	12/7/2010	Site Map Datum:	
Dt Document Closed:	12/14/2010	SAC Action Class:	Air Spills - Gases and Vapours
Incident Reason:		Source Type:	
Site Name:	Tunneys Pasture Central Heating and Cooling Plant<UNOFFICIAL>		
Site County/District:			
Site Geo Ref Meth:			
Incident Summary:	Canada Public Works: <100 kg R22 to Atm		
Contaminant Qty:	100 kg		

Site: **National Capital Commission**
Ottawa River Pkwy at the Parkdale Off Ramp West Bound Ottawa ON

Database:
SPL

Ref No:	3376-7TLV2S	Discharger Report:	
Site No:		Material Group:	
Incident Dt:		Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:	Other Transport Accident	Sector Type:	Motor Vehicle
Incident Event:		Agency Involved:	
Contaminant Code:		Nearest Watercourse:	
Contaminant Name:	OIL (PETROLEUM BASED, NOT SPECIFIED)	Site Address:	
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:	Not Anticipated	Site Municipality:	Ottawa
Nature of Impact:	Surface Water Pollution	Site Lot:	
Receiving Medium:		Site Conc:	
Receiving Env:		Northing:	
MOE Response:		Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	7/3/2009	Site Map Datum:	
Dt Document Closed:		SAC Action Class:	Land Spills
Incident Reason:	Spill	Source Type:	
Site Name:	Road way<UNOFFICIAL>		
Site County/District:			
Site Geo Ref Meth:			
Incident Summary:	MVA: 4 L Oil to Rd and CB		
Contaminant Qty:	4 L		

Site: **OLRT Constructors**
north of Scott St east of Holland Ave Ottawa ON

Database:
SPL

Ref No:	5274-A34GUE	Discharger Report:	
Site No:	NA	Material Group:	
Incident Dt:	10/7/2015	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:		Sector Type:	Miscellaneous Industrial
Incident Event:		Agency Involved:	
Contaminant Code:	27	Nearest Watercourse:	
Contaminant Name:	CONCRETE	Site Address:	north of Scott St east of Holland Ave
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:		Site Municipality:	Ottawa
Nature of Impact:		Site Lot:	
Receiving Medium:		Site Conc:	
Receiving Env:		Northing:	5028066
MOE Response:	No	Easting:	442532
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	10/8/2015	Site Map Datum:	
Dt Document Closed:		SAC Action Class:	Land Spills
Incident Reason:	Operator/Human Error	Source Type:	

Site Name: OLRT<UNOFFICIAL>
Site County/District:
Site Geo Ref Meth:
Incident Summary: OLRT: concrete wash out to soil, clnd 4L
Contaminant Qty: 4 L

Site: Proshred Iron Mountain<UNOFFICIAL> **Database:** SPL
Holland Street just north of Scott Street, Ottawa<UNOFFICIAL> Ottawa ON

Ref No:	5260-6B5Q5X	Discharger Report:	0
Site No:		Material Group:	Oil
Incident Dt:	4/4/2005	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:	Pipe Or Hose Leak	Sector Type:	Other Motor Vehicle
Incident Event:		Agency Involved:	
Contaminant Code:		Nearest Watercourse:	
Contaminant Name:	HYDRAULIC OIL	Site Address:	
Contaminant Limit 1:		Site District Office:	Ottawa
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:	Not Anticipated	Site Municipality:	Ottawa
Nature of Impact:	Surface Water Pollution	Site Lot:	
Receiving Medium:	Water	Site Conc:	
Receiving Env:		Northing:	
MOE Response:		Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	4/4/2005	Site Map Datum:	
Dt Document Closed:		SAC Action Class:	Spill to Land
Incident Reason:	Equipment Failure - Malfunction of system components	Source Type:	
Site Name:	Holland Street just north of Scott Street, Ottawa<UNOFFICIAL>		
Site County/District:			
Site Geo Ref Meth:			
Incident Summary:	Proshred: hydraulic oil to road/CB		
Contaminant Qty:			

Site: BULLMAN ST WEST OF PARKDALE OTTAWA ON **Database:** WWIS

Well ID:	1535116	Data Entry Status:	
Construction Date:		Data Src:	1
Primary Water Use:		Date Received:	10/28/2004
Sec. Water Use:		Selected Flag:	TRUE
Final Well Status:	Observation Wells	Abandonment Rec:	
Water Type:		Contractor:	1844
Casing Material:		Form Version:	3
Audit No:	Z19303	Owner:	
Tag:	A011934	Street Name:	BULLMAN ST WEST OF PARKDALE
Construction Method:		County:	OTTAWA
Elevation (m):		Municipality:	OTTAWA CITY
Elevation Reliability:		Site Info:	
Depth to Bedrock:		Lot:	
Well Depth:		Concession:	
Overburden/Bedrock:		Concession Name:	
Pump Rate:		Easting NAD83:	
Static Water Level:		Northing NAD83:	
Flowing (Y/N):		Zone:	
Flow Rate:		UTM Reliability:	
Clear/Cloudy:			

Bore Hole Information

Bore Hole ID:	11172868	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	

Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 06-Oct-2004 00:00:00
Remarks:
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

**Overburden and Bedrock
Materials Interval**

Formation ID: 932969009
Layer: 1
Color: 6
General Color: BROWN
Mat1: 11
Most Common Material: GRAVEL
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 0.699999988079071
Formation End Depth UOM: m

**Overburden and Bedrock
Materials Interval**

Formation ID: 932969010
Layer: 2
Color: 2
General Color: GREY
Mat1: 15
Most Common Material: LIMESTONE
Mat2:
Mat2 Desc:
Mat3:
Mat3 Desc:
Formation Top Depth: 0.699999988079071
Formation End Depth: 4.5
Formation End Depth UOM: m

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933253284
Layer: 1
Plug From: 1.2000000476837158
Plug To: 1.5
Plug Depth UOM: m

**Method of Construction & Well
Use**

Method Construction ID: 961535116
Method Construction Code: 7
Method Construction: Diamond
Other Method Construction:

Pipe Information

Pipe ID: 11181387
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930843185
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 2.5
Casing Diameter: 50.0
Casing Diameter UOM: cm
Casing Depth UOM: m

Construction Record - Screen

Screen ID: 933409114
Layer: 1
Slot: 10
Screen Top Depth: 1.5
Screen End Depth: 4.5
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 70.0

Hole Diameter

Hole ID: 11306039
Diameter: 10.0
Depth From: 0.0
Depth To: 4.5
Hole Depth UOM: m
Hole Diameter UOM: cm

Appendix: Database Descriptions

*Environmental Risk Information Services (ERIS) can search the following databases. The extent of historical information varies with each database and current information is determined by what is publicly available to ERIS at the time of update. **Note:** Databases denoted with " * " indicates that the database will no longer be updated. See the individual database description for more information.*

Abandoned Aggregate Inventory:

Provincial [AAGR](#)

The MAAP Program maintains a database of abandoned pits and quarries. Please note that the database is only referenced by lot and concession and city/town location. The database provides information regarding the location, type, size, land use, status and general comments.*

Government Publication Date: Sept 2002*

Aggregate Inventory:

Provincial [AGR](#)

The Ontario Ministry of Natural Resources maintains a database of all active pits and quarries. The database provides information regarding the registered owner/operator, location name, operation type, approval type, and maximum annual tonnage.

Government Publication Date: Up to Nov 2021

Abandoned Mine Information System:

Provincial [AMIS](#)

The Abandoned Mines Information System contains data on known abandoned and inactive mines located on both Crown and privately held lands. The information was provided by the Ministry of Northern Development and Mines (MNDM), with the following disclaimer: "the database provided has been compiled from various sources, and the Ministry of Northern Development and Mines makes no representation and takes no responsibility that such information is accurate, current or complete". Reported information includes official mine name, status, background information, mine start/end date, primary commodity, mine features, hazards and remediation.

Government Publication Date: 1800-Mar 2022

Anderson's Waste Disposal Sites:

Private [ANDR](#)

The information provided in this database was collected by examining various historical documents which aimed to characterize the likely position of former waste disposal sites from 1860 to present. The research initiative behind the creation of this database was to identify those sites that are missing from the Ontario MOE Waste Disposal Site Inventory, as well as to provide revisions and corrections to the positions and descriptions of sites currently listed in the MOE inventory. In addition to historic waste disposal facilities, the database also identifies certain auto wreckers and scrap yards that have been extrapolated from documentary sources. Please note that the data is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1860s-Present

Aboveground Storage Tanks:

Provincial [AST](#)

Historical listing of aboveground storage tanks made available by the Department of Natural Resources and Forestry. Includes tanks used to hold water or petroleum. This dataset has been retired as of September 25, 2014 and will no longer be updated.

Government Publication Date: May 31, 2014

Automobile Wrecking & Supplies:

Private [AUWR](#)

This database provides an inventory of known locations that are involved in the scrap metal, automobile wrecking/recycling, and automobile parts & supplies industry. Information is provided on the company name, location and business type.

Government Publication Date: 1999-Sep 30, 2021

Borehole:

Provincial [BORE](#)

A borehole is the generalized term for any narrow shaft drilled in the ground, either vertically or horizontally. The information here includes geotechnical investigations or environmental site assessments, mineral exploration, or as a pilot hole for installing piers or underground utilities. Information is from many sources such as the Ministry of Transportation (MTO) boreholes from engineering reports and projects from the 1950 to 1990's in Southern Ontario. Boreholes from the Ontario Geological Survey (OGS) including The Urban Geology Analysis Information System (UGAIS) and the York Peel Durham Toronto (YPDT) database of the Conservation Authority Moraine Coalition. This database will include fields such as location, stratigraphy, depth, elevation, year drilled, etc. For all water well data or oil and gas well data for Ontario please refer to WWIS and OOGW.

Government Publication Date: 1875-Jul 2018

Certificates of Approval:

Provincial CA

This database contains the following types of approvals: Air & Noise, Industrial Sewage, Municipal & Private Sewage, Waste Management Systems and Renewable Energy Approvals. The MOE in Ontario states that any facility that releases emissions to the atmosphere, discharges contaminants to ground or surface water, provides potable water supplies, or stores, transports or disposes of waste, must have a Certificate of Approval before it can operate lawfully. Fields include approval number, business name, address, approval date, approval type and status. This database will no longer be updated, as CofA's have been replaced by either Environmental Activity and Sector Registry (EASR) or Environmental Compliance Approval (ECA). Please refer to those individual databases for any information after Oct.31, 2011.

Government Publication Date: 1985-Oct 30, 2011*

Dry Cleaning Facilities:

Federal CDRY

List of dry cleaning facilities made available by Environment and Climate Change Canada. Environment and Climate Change Canada's Tetrachloroethylene (Use in Dry Cleaning and Reporting Requirements) Regulations (SOR/2003-79) are intended to reduce releases of tetrachloroethylene to the environment from dry cleaning facilities.

Government Publication Date: Jan 2004-Dec 2019

Commercial Fuel Oil Tanks:

Provincial CFOT

Locations of commercial underground fuel oil tanks. This is not a comprehensive or complete inventory of commercial fuel tanks in the province; this listing is a copy of records of registered commercial underground fuel oil tanks obtained under Access to Public Information.

Note that the following types of tanks do not require registration: waste oil tanks in apartments, office buildings, residences, etc.; aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Chemical Manufacturers and Distributors:

Private CHEM

This database includes information from both a one time study conducted in 1992 and private source and is a listing of facilities that manufacture or distribute chemicals. The production of these chemical substances may involve one or more chemical reactions and/or chemical separation processes (i.e. fractionation, solvent extraction, crystallization, etc.).

Government Publication Date: 1999-Jan 31, 2020

Chemical Register:

Private CHM

This database includes a listing of locations of facilities within the Province or Territory that either manufacture and/or distributes chemicals.

Government Publication Date: 1999-Sep 30, 2021

Compressed Natural Gas Stations:

Private CNG

Canada has a network of public access compressed natural gas (CNG) refuelling stations. These stations dispense natural gas in compressed form at 3,000 pounds per square inch (psi), the pressure which is allowed within the current Canadian codes and standards. The majority of natural gas refuelling is located at existing retail gasoline that have a separate refuelling island for natural gas. This list of stations is made available by the Canadian Natural Gas Vehicle Alliance.

Government Publication Date: Dec 2012 -Apr 2022

Inventory of Coal Gasification Plants and Coal Tar Sites:

Provincial COAL

This inventory includes both the "Inventory of Coal Gasification Plant Waste Sites in Ontario-April 1987" and the Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario-November 1988) collected by the MOE. It identifies industrial sites that produced and continue to produce or use coal tar and other related tars. Detailed information is available and includes: facility type, size, land use, information on adjoining properties, soil condition, site operators/occupants, site description, potential environmental impacts and historic maps available. This was a one-time inventory.*

Government Publication Date: Apr 1987 and Nov 1988*

Compliance and Convictions:

Provincial CONV

This database summarizes the fines and convictions handed down by the Ontario courts beginning in 1989. Companies and individuals named here have been found guilty of environmental offenses in Ontario courts of law.

Government Publication Date: 1989-Mar 2022

Certificates of Property Use:

Provincial CPU

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include all CPU's on the registry such as (EPA s. 168.6) - Certificate of Property Use.

Government Publication Date: 1994 - May 31, 2022

Drill Hole Database:

Provincial

[DRL](#)

The Ontario Drill Hole Database contains information on more than 113,000 percussion, overburden, sonic and diamond drill holes from assessment files on record with the department of Mines and Minerals. Please note that limited data is available for southern Ontario, as it was the last area to be completed. The database was created when surveys submitted to the Ministry were converted in the Assessment File Research Image Database (AFRI) project. However, the degree of accuracy (coordinates) as to the exact location of drill holes is dependent upon the source document submitted to the MNDM. Levels of accuracy used to locate holes are: centering on the mining claim; a sketch of the mining claim; a 1:50,000 map; a detailed company map; or from submitted a "Report of Work".

Government Publication Date: 1886 - Sep 2020

Delisted Fuel Tanks:

Provincial

[DTNK](#)

List of fuel storage tank sites that were once found in - and have since been removed from - the list of fuel storage tanks made available by the regulatory agency under Access to Public Information.

Government Publication Date: Feb 28, 2022

Environmental Activity and Sector Registry:

Provincial

[EASR](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. The EASR allows businesses to register certain activities with the ministry, rather than apply for an approval. The registry is available for common systems and processes, to which preset rules of operation can be applied. The EASR is currently available for: heating systems, standby power systems and automotive refinishing. Businesses whose activities aren't subject to the EASR may apply for an ECA (Environmental Compliance Approval). Please see our ECA database.

Government Publication Date: Oct 2011- Apr 30, 2022

Environmental Registry:

Provincial

[EBR](#)

The Environmental Registry lists proposals, decisions and exceptions regarding policies, Acts, instruments, or regulations that could significantly affect the environment. Through the Registry, thirteen provincial ministries notify the public of upcoming proposals and invite their comments. For example, if a local business is requesting a permit, license, or certificate of approval to release substances into the air or water; these are notified on the registry. Data includes: Approval for discharge into the natural environment other than water (i.e. Air) - EPA s. 9, Approval for sewage works - OWRA s. 53(1), and EPA s. 27 - Approval for a waste disposal site. For information regarding Permit to Take Water (PTTW), Certificate of Property Use (CPU) and (ORD) Orders please refer to those individual databases.

Government Publication Date: 1994 - May 31, 2022

Environmental Compliance Approval:

Provincial

[ECA](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. In the past, a business had to apply for multiple approvals (known as certificates of approval) for individual processes and pieces of equipment. Today, a business either registers itself, or applies for a single approval, depending on the types of activities it conducts. Businesses whose activities aren't subject to the EASR may apply for an ECA. A single ECA addresses all of a business's emissions, discharges and wastes. Separate approvals for air, noise and waste are no longer required. This database will also include Renewable Energy Approvals. For certificates of approval prior to Nov 1st, 2011, please refer to the CA database. For all Waste Disposal Sites please refer to the WDS database.

Government Publication Date: Oct 2011- Apr 30, 2022

Environmental Effects Monitoring:

Federal

[EEM](#)

The Environmental Effects Monitoring program assesses the effects of effluent from industrial or other sources on fish, fish habitat and human usage of fisheries resources. Since 1992, pulp and paper mills have been required to conduct EEM studies under the Pulp and Paper Effluent Regulations. This database provides information on the mill name, geographical location and sub-lethal toxicity data.

Government Publication Date: 1992-2007*

ERIS Historical Searches:

Private

[EHS](#)

ERIS has compiled a database of all environmental risk reports completed since March 1999. Available fields for this database include: site location, date of report, type of report, and search radius. As per all other databases, the ERIS database can be referenced on both the map and "Statistical Profile" page.

Government Publication Date: 1999-Mar 31, 2022

Environmental Issues Inventory System:

Federal

[EIIS](#)

The Environmental Issues Inventory System was developed through the implementation of the Environmental Issues and Remediation Plan. This plan was established to determine the location and severity of contaminated sites on inhabited First Nation reserves, and where necessary, to remediate those that posed a risk to health and safety; and to prevent future environmental problems. The EIIS provides information on the reserve under investigation, inventory number, name of site, environmental issue, site action (Remediation, Site Assessment), and date investigation completed.

Government Publication Date: 1992-2001*

Emergency Management Historical Event:

Provincial

EMHE

List of locations of historical occurrences of emergency events, including those assigned to the Ministry of Natural Resources by Order-In-Council (OIC) under the Emergency Management and Civil Protection Act, as well as events where MNR provided requested emergency response assistance. Many of these events will have involved community evacuations, significant structural loss, and/or involvement of MNR emergency response staff. These events fall into one of ten (10) type categories: Dam Failure; Drought / Low Water; Erosion; Flood; Forest Fire; Soil and Bedrock Instability; Petroleum Resource Center Event, EMO Requested Assistance, Continuity of Operations Event, Other Requested Assistance. EMHE record details are reproduced by ERIIS under License with the Ontario Ministry of Natural Resources © Queen's Printer for Ontario, 2017.

Government Publication Date: Dec 31, 2016

Environmental Penalty Annual Report:

Provincial

EPAR

This database contains data from Ontario's annual environmental penalty report published by the Ministry of the Environment and Climate Change. These reports provide information on environmental penalties for land or water violations issued to companies in one of the nine industrial sectors covered by the Municipal Industrial Strategy for Abatement (MISA) regulations.

Government Publication Date: Jan 1, 2011 - Dec 31, 2021

List of Expired Fuels Safety Facilities:

Provincial

EXP

List of facilities and tanks for which there was once a fuel registration. This is not a comprehensive or complete inventory of expired tanks/tank facilities in the province; this listing is a copy of previously registered tanks and facilities obtained under Access to Public Information. Includes private fuel outlets, bulk plants, fuel oil tanks, gasoline stations, marinas, propane filling stations, liquid fuel tanks, piping systems, etc; includes tanks which have been removed from the ground.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Federal Convictions:

Federal

FCON

Environment Canada maintains a database referred to as the "Environmental Registry" that details prosecutions under the Canadian Environmental Protection Act (CEPA) and the Fisheries Act (FA). Information is provided on the company name, location, charge date, offence and penalty.

Government Publication Date: 1988-Jun 2007*

Contaminated Sites on Federal Land:

Federal

FCS

The Federal Contaminated Sites Inventory includes information on known federal contaminated sites under the custodianship of departments, agencies and consolidated Crown corporations as well as those that are being or have been investigated to determine whether they have contamination arising from past use that could pose a risk to human health or the environment. The inventory also includes non-federal contaminated sites for which the Government of Canada has accepted some or all financial responsibility. It does not include sites where contamination has been caused by, and which are under the control of, enterprise Crown corporations, private individuals, firms or other levels of government. Includes fire training sites and sites at which Per- and Polyfluoroalkyl Substances (PFAS) are a concern.

Government Publication Date: Jun 2000-Apr 2022

Fisheries & Oceans Fuel Tanks:

Federal

FOFT

Fisheries & Oceans Canada maintains an inventory of aboveground & underground fuel storage tanks located on Fisheries & Oceans property or controlled by DFO. Our inventory provides information on the site name, location, tank owner, tank operator, facility type, storage tank location, tank contents & capacity, and date of tank installation.

Government Publication Date: 1964-Sep 2019

Federal Identification Registry for Storage Tank Systems (FIRSTS):

Federal

FRST

A list of federally regulated Storage tanks from the Federal Identification Registry for Storage Tank Systems (FIRSTS). FIRSTS is Environment and Climate Change Canada's database of storage tank systems subject to the Storage Tank for Petroleum Products and Allied Petroleum Products Regulations. The main objective of the Regulations is to prevent soil and groundwater contamination from storage tank systems located on federal and aboriginal lands. Storage tank systems that do not have a valid identification number displayed in a readily visible location on or near the storage tank system may be refused product delivery.

Government Publication Date: May 31, 2018

Fuel Storage Tank:

Provincial

FST

List of registered private and retail fuel storage tanks. This is not a comprehensive or complete inventory of private and retail fuel storage tanks in the province; this listing is a copy of registered private and retail fuel storage tanks, obtained under Access to Public Information.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Fuel Storage Tank - Historic:

Provincial

FSTH

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks. Public records of private fuel storage tanks are only available since the registration became effective in September 1989. This information is now collected by the Technical Standards and Safety Authority.

Government Publication Date: Pre-Jan 2010*

Ontario Regulation 347 Waste Generators Summary:

Provincial

GEN

Regulation 347 of the Ontario EPA defines a waste generation site as any site, equipment and/or operation involved in the production, collection, handling and/or storage of regulated wastes. A generator of regulated waste is required to register the waste generation site and each waste produced, collected, handled, or stored at the site. This database contains the registration number, company name and address of registered generators including the types of hazardous wastes generated. It includes data on waste generating facilities such as: drycleaners, waste treatment and disposal facilities, machine shops, electric power distribution etc. This information is a summary of all years from 1986 including the most currently available data. Some records may contain, within the company name, the phrase "See & Use..." followed by a series of letters and numbers. This occurs when one company is amalgamated with or taken over by another registered company. The number listed as "See & Use", refers to the new ownership and the other identification number refers to the original ownership. This phrase serves as a link between the 2 companies until operations have been fully transferred.

Government Publication Date: 1986-Feb 28, 2022

Greenhouse Gas Emissions from Large Facilities:

Federal

GHG

List of greenhouse gas emissions from large facilities made available by Environment Canada. Greenhouse gas emissions in kilotonnes of carbon dioxide equivalents (kt CO₂ eq).

Government Publication Date: 2013-Dec 2019

TSSA Historic Incidents:

Provincial

HINC

List of historic incidences of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen recorded by the TSSA in their previous incident tracking system. The TSSA's Fuels Safety Program administers the Technical Standards & Safety Act 2000, providing fuel-related safety services associated with the safe transportation, storage, handling and use of fuels such as gasoline, diesel, propane, natural gas and hydrogen. Under this Act, the TSSA regulates fuel suppliers, storage facilities, transport trucks, pipelines, contractors and equipment or appliances that use fuels. Records are not verified for accuracy or completeness. This is not a comprehensive or complete inventory of historical fuel spills and leaks in the province. This listing is a copy of the data captured at one moment in time and is hence limited by the record date provided here.

Government Publication Date: 2006-June 2009*

Indian & Northern Affairs Fuel Tanks:

Federal

IAFT

The Department of Indian & Northern Affairs Canada (INAC) maintains an inventory of aboveground & underground fuel storage tanks located on both federal and crown land. Our inventory provides information on the reserve name, location, facility type, site/facility name, tank type, material & ID number, tank contents & capacity, and date of tank installation.

Government Publication Date: 1950-Aug 2003*

Fuel Oil Spills and Leaks:

Provincial

INC

Listing of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen reported to the Spills Action Centre (SAC). This is not a comprehensive or complete inventory of fuel-related leaks, spills, and incidents in the province; this listing is a copy of incidents reported to the SAC, obtained under Access to Public Information. Includes incidents from fuel-related hazards such as spills, fires, and explosions. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Landfill Inventory Management Ontario:

Provincial

LIMO

The Landfill Inventory Management Ontario (LIMO) database is updated every year, as the Ministry of the Environment, Conservation and Parks compiles new and updated information. Includes small and large landfills currently operating as well as those which are closed and historic. Operators of larger landfills provide landfill information for the previous operating year to the ministry for LIMO including: estimated amount of total waste received, landfill capacity, estimated total remaining landfill capacity, fill rates, engineering designs, reporting and monitoring details, size of location, service area, approved waste types, leachate of site treatment, contaminant attenuation zone and more. The small landfills include information such as site owner, site location and certificate of approval # and status.

Government Publication Date: Mar 21, 2022

Canadian Mine Locations:

Private

MINE

This information is collected from the Canadian & American Mines Handbook. The Mines database is a national database that provides over 290 listings on mines (listed as public companies) dealing primarily with precious metals and hard rocks. Listed are mines that are currently in operation, closed, suspended, or are still being developed (advanced projects). Their locations are provided as geographic coordinates (x, y and/or longitude, latitude). As of 2002, data pertaining to Canadian smelters and refineries has been appended to this database.

Government Publication Date: 1998-2009*

Mineral Occurrences:

Provincial

MNR

In the early 70's, the Ministry of Northern Development and Mines created an inventory of approximately 19,000 mineral occurrences in Ontario, in regard to metallic and industrial minerals, as well as some information on building stones and aggregate deposits. Please note that the "Horizontal Positional Accuracy" is approximately +/- 200 m. Many reference elements for each record were derived from field sketches using pace or chain/tape measurements against claim posts or topographic features in the area. The primary limiting factor for the level of positional accuracy is the scale of the source material. The testing of horizontal accuracy of the source materials was accomplished by comparing the plan metric (X and Y) coordinates of that point with the coordinates of the same point as defined from a source of higher accuracy.

Government Publication Date: 1846-Feb 2022

National Analysis of Trends in Emergencies System (NATES):

Federal

NATE

In 1974 Environment Canada established the National Analysis of Trends in Emergencies System (NATES) database, for the voluntary reporting of significant spill incidents. The data was to be used to assist in directing the work of the emergencies program. NATES ran from 1974 to 1994. Extensive information is available within this database including company names, place where the spill occurred, date of spill, cause, reason and source of spill, damage incurred, and amount, concentration, and volume of materials released.

Government Publication Date: 1974-1994*

Non-Compliance Reports:

Provincial

NCPL

The Ministry of the Environment provides information about non-compliant discharges of contaminants to air and water that exceed legal allowable limits, from regulated industrial and municipal facilities. A reported non-compliance failure may be in regard to a Control Order, Certificate of Approval, Sectoral Regulation or specific regulation/act.

Government Publication Date: Dec 31, 2020

National Defense & Canadian Forces Fuel Tanks:

Federal

NDFT

The Department of National Defense and the Canadian Forces maintains an inventory of all aboveground & underground fuel storage tanks located on DND lands. Our inventory provides information on the base name, location, tank type & capacity, tank contents, tank class, date of tank installation, date tank last used, and status of tank as of May 2001. This database will no longer be updated due to the new National Security protocols which have prohibited any release of this database.

Government Publication Date: Up to May 2001*

National Defense & Canadian Forces Spills:

Federal

NDSP

The Department of National Defense and the Canadian Forces maintains an inventory of spills to land and water. All spill sites have been classified under the "Transportation of Dangerous Goods Act - 1992". Our inventory provides information on the facility name, location, spill ID #, spill date, type of spill, as well as the quantity of substance spilled & recovered.

Government Publication Date: Mar 1999-Apr 2018

National Defence & Canadian Forces Waste Disposal Sites:

Federal

NDWD

The Department of National Defence and the Canadian Forces maintains an inventory of waste disposal sites located on DND lands. Where available, our inventory provides information on the base name, location, type of waste received, area of site, depth of site, year site opened/closed and status.

Government Publication Date: 2001-Apr 2007*

National Energy Board Pipeline Incidents:

Federal

NEBI

Locations of pipeline incidents from 2008 to present, made available by the Canada Energy Regulator (CER) - previously the National Energy Board (NEB). Includes incidents reported under the Onshore Pipeline Regulations and the Processing Plant Regulations related to pipelines under federal jurisdiction, does not include incident data related to pipelines under provincial or territorial jurisdiction.

Government Publication Date: 2008-Jun 30, 2021

National Energy Board Wells:

Federal

NEBP

The NEBW database contains information on onshore & offshore oil and gas wells that are outside provincial jurisdiction(s) and are thereby regulated by the National Energy Board. Data is provided regarding the operator, well name, well ID No./UWI, status, classification, well depth, spud and release date.

Government Publication Date: 1920-Feb 2003*

National Environmental Emergencies System (NEES):

Federal

NEES

In 2000, the Emergencies program implemented NEES, a reporting system for spills of hazardous substances. For the most part, this system only captured data from the Atlantic Provinces, some from Quebec and Ontario and a portion from British Columbia. Data for Alberta, Saskatchewan, Manitoba and the Territories was not captured. However, NEES is also a repository for previous Environment Canada spill datasets. NEES is composed of the historic datasets ' or Trends ' which dates from approximately 1974 to present. NEES Trends is a compilation of historic databases, which were merged and includes data from NATES (National Analysis of Trends in Emergencies System), ARTS (Atlantic Regional Trends System), and NEES. In 2001, the Emergencies Program determined that variations in reporting regimes and requirements between federal and provincial agencies made national spill reporting and trend analysis difficult to achieve. As a consequence, the department has focused efforts on capturing data on spills of substances which fall under its legislative authority only (CEPA and FA). As such, the NEES database will be decommissioned in December 2004.

Government Publication Date: 1974-2003***National PCB Inventory:**

Federal

NPCB

Environment Canada's National PCB inventory includes information on in-use PCB containing equipment in Canada including federal, provincial and private facilities. Federal out-of-service PCB containing equipment and PCB waste owned by the federal government or by federally regulated industries such as airlines, railway companies, broadcasting companies, telephone and telecommunications companies, pipeline companies, etc. are also listed. Although it is not Environment Canada's mandate to collect data on non-federal PCB waste, the National PCB inventory includes some information on provincial and private PCB waste and storage sites. Some addresses provided may be Head Office addresses and are not necessarily the location of where the waste is being used or stored.

Government Publication Date: 1988-2008***National Pollutant Release Inventory:**

Federal

NPRI

Environment Canada has defined the National Pollutant Release Inventory ("NPRI") as a federal government initiative designed to collect comprehensive national data regarding releases to air, water, or land, and waste transfers for recycling for more than 300 listed substances.

Government Publication Date: 1993-May 2017**Oil and Gas Wells:**

Private

OGWE

The Nickle's Energy Group (publisher of the Daily Oil Bulletin) collects information on drilling activity including operator and well statistics. The well information database includes name, location, class, status and depth. The main Nickle's database is updated on a daily basis, however, this database is updated on a monthly basis. More information is available at www.nickles.com.

Government Publication Date: 1988-May 31, 2022**Ontario Oil and Gas Wells:**

Provincial

OOGW

In 1998, the MNR handed over to the Ontario Oil, Gas and Salt Resources Corporation, the responsibility of maintaining a database of oil and gas wells drilled in Ontario. The OGSR Library has over 20,000+ wells in their database. Information available for all wells in the ERIS database include well owner/operator, location, permit issue date, and well cap date, license No., status, depth and the primary target (rock unit) of the well being drilled. All geology/stratigraphy table information, plus all water table information is also provide for each well record.

Government Publication Date: 1800-Jan 2021**Inventory of PCB Storage Sites:**

Provincial

OPCB

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of PCB storage sites within the province. Ontario Regulation 11/82 (Waste Management - PCB) and Regulation 347 (Generator Waste Management) under the Ontario EPA requires the registration of inactive PCB storage equipment and/or disposal sites of PCB waste with the Ontario Ministry of Environment. This database contains information on: 1) waste quantities; 2) major and minor sites storing liquid or solid waste; and 3) a waste storage inventory.

Government Publication Date: 1987-Oct 2004; 2012-Dec 2013**Orders:**

Provincial

ORD

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include all Orders on the registry such as (EPA s. 17) - Order for remedial work, (EPA s. 18) - Order for preventative measures, (EPA s. 43) - Order for removal of waste and restoration of site, (EPA s. 44) - Order for conformity with Act for waste disposal sites, (EPA s. 136) - Order for performance of environmental measures.

Government Publication Date: 1994 - May 31, 2022**Canadian Pulp and Paper:**

Private

PAP

This information is part of the Pulp and Paper Canada Directory. The Directory provides a comprehensive listing of the locations of pulp and paper mills and the products that they produce.

Government Publication Date: 1999, 2002, 2004, 2005, 2009-2014**Parks Canada Fuel Storage Tanks:**

Federal

PCFT

Canadian Heritage maintains an inventory of known fuel storage tanks operated by Parks Canada, in both National Parks and at National Historic Sites. The database details information on site name, location, tank install/removal date, capacity, fuel type, facility type, tank design and owner/operator.

Government Publication Date: 1920-Jan 2005*

Pesticide Register:

Provincial PES

The Ontario Ministry of the Environment and Climate Change maintains a database of licensed operators and vendors of registered pesticides.

Government Publication Date: Oct 2011- Apr 30, 2022

Pipeline Incidents:

Provincial PINC

List of pipeline incidents (strikes, leaks, spills). This is not a comprehensive or complete inventory of pipeline incidents in the province; this listing is an historical copy of records previously obtained under Access to Public Information. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2021

Private and Retail Fuel Storage Tanks:

Provincial PRT

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks and licensed retail fuel outlets. This database includes an inventory of locations that have gasoline, oil, waste oil, natural gas and/or propane storage tanks on their property. The MCCR no longer collects this information. This information is now collected by the Technical Standards and Safety Authority (TSSA).

Government Publication Date: 1989-1996*

Permit to Take Water:

Provincial PTTW

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include all PTTW's on the registry such as OWRA s. 34 - Permit to take water.

Government Publication Date: 1994 - May 31, 2022

Ontario Regulation 347 Waste Receivers Summary:

Provincial REC

Part V of the Ontario Environmental Protection Act ("EPA") regulates the disposal of regulated waste through an operating waste management system or a waste disposal site operated or used pursuant to the terms and conditions of a Certificate of Approval or a Provisional Certificate of Approval. Regulation 347 of the Ontario EPA defines a waste receiving site as any site or facility to which waste is transferred by a waste carrier. A receiver of regulated waste is required to register the waste receiving facility. This database represents registered receivers of regulated wastes, identified by registration number, company name and address, and includes receivers of waste such as: landfills, incinerators, transfer stations, PCB storage sites, sludge farms and water pollution control plants. This information is a summary of all years from 1986 including the most currently available data.

Government Publication Date: 1986-1990, 1992-2019

Record of Site Condition:

Provincial RSC

The Record of Site Condition (RSC) is part of the Ministry of the Environment's Brownfields Environmental Site Registry. Protection from environmental cleanup orders for property owners is contingent upon documentation known as a record of site condition (RSC) being filed in the Environmental Site Registry. In order to file an RSC, the property must have been properly assessed and shown to meet the soil, sediment and groundwater standards appropriate for the use (such as residential) proposed to take place on the property. The Record of Site Condition Regulation (O. Reg. 153/04) details requirements related to site assessment and clean up.

RSCs filed after July 1, 2011 will also be included as part of the new (O.Reg. 511/09).

Government Publication Date: 1997-Sept 2001, Oct 2004-May 2022

Retail Fuel Storage Tanks:

Private RST

This database includes an inventory of retail fuel outlet locations (including marinas) that have on their property gasoline, oil, waste oil, natural gas and / or propane storage tanks.

Government Publication Date: 1999-Sep 30, 2021

Scott's Manufacturing Directory:

Private SCT

Scott's Directories is a data bank containing information on over 200,000 manufacturers across Canada. Even though Scott's listings are voluntary, it is the most comprehensive database of Canadian manufacturers available. Information concerning a company's address, plant size, and main products are included in this database.

Government Publication Date: 1992-Mar 2011*

Ontario Spills:

Provincial SPL

List of spills and incidents made available the Ministry of the Environment, Conservation and Parks. This database identifies information such as location (approximate), type and quantity of contaminant, date of spill, environmental impact, cause, nature of impact, etc. Information from 1988-2002 was part of the ORIS (Occurrence Reporting Information System). The SAC (Spills Action Centre) handles all spills reported in Ontario. Regulations for spills in Ontario are part of the MOE's Environmental Protection Act, Part X. The Ministry of the Environment, Conservation and Parks cites the coronavirus pandemic as an explanation for delays in releasing data pursuant to requests.

Government Publication Date: 1988-Sep 2020; Dec 2020-Mar 2021

Wastewater Discharger Registration Database:

Provincial

SRDS

Information under this heading is combination of the following 2 programs. The Municipal/Industrial Strategy for Abatement (MISA) division of the Ontario Ministry of Environment maintained a database of all direct dischargers of toxic pollutants within nine sectors including: Electric Power Generation; Mining; Petroleum Refining; Organic Chemicals; Inorganic Chemicals; Pulp & Paper; Metal Casting; Iron & Steel; and Quarries. All sampling information is now collected and stored within the Sample Result Data Store (SRDS).

Government Publication Date: 1990-Dec 31, 2020

Anderson's Storage Tanks:

Private

TANK

The information provided in this database was collected by examining various historical documents, which identified the location of former storage tanks, containing substances such as fuel, water, gas, oil, and other various types of miscellaneous products. Information is available in regard to business operating at tank site, tank location, permit year, permit & installation type, no. of tanks installed & configuration and tank capacity. Data contained within this database pertains only to the city of Toronto and is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1915-1953*

Transport Canada Fuel Storage Tanks:

Federal

TCFT

List of fuel storage tanks currently or previously owned or operated by Transport Canada. This inventory also includes tanks on The Pickering Lands, which refers to 7,530 hectares (18,600 acres) of land in Pickering, Markham, and Uxbridge owned by the Government of Canada since 1972; properties on this land has been leased by the government since 1975, and falls under the Site Management Policy of Transport Canada, but is administered by Public Works and Government Services Canada. This inventory provides information on the site name, location, tank age, capacity and fuel type.

Government Publication Date: 1970 - Dec 2020

Variances for Abandonment of Underground Storage Tanks:

Provincial

VAR

Listing of variances granted for storage tank abandonment. This is not a comprehensive or complete inventory of tank abandonment variances in the province; this listing is a copy of tank abandonment variance records previously obtained under Access to Public Information. In Ontario, registered underground storage tanks must be removed within two years of disuse; if removal of a tank is not feasible, an application may be sought for a variance from this code requirement.

Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Waste Disposal Sites - MOE CA Inventory:

Provincial

WDS

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of known open (active or inactive) and closed disposal sites in the Province of Ontario. Active sites maintain a Certificate of Approval, are approved to receive and are receiving waste. Inactive sites maintain Certificate(s) of Approval but are not receiving waste. Closed sites are not receiving waste. The data contained within this database was compiled from the MOE's Certificate of Approval database. Locations of these sites may be cross-referenced to the Anderson database described under ERIS's Private Source Database section, by the CA number. All new Environmental Compliance Approvals handed out after Oct 31, 2011 for Waste Disposal Sites will still be found in this database.

Government Publication Date: Oct 2011- Apr 30, 2022

Waste Disposal Sites - MOE 1991 Historical Approval Inventory:

Provincial

WDSH

In June 1991, the Ontario Ministry of Environment, Waste Management Branch, published the "June 1991 Waste Disposal Site Inventory", of all known active and closed waste disposal sites as of October 30th, 1990. For each "active" site as of October 31st 1990, information is provided on site location, site/CA number, waste type, site status and site classification. For each "closed" site as of October 31st 1990, information is provided on site location, site/CA number, closure date and site classification. Locations of these sites may be cross-referenced to the Anderson database described under ERIS's Private Source Database section, by the CA number.

Government Publication Date: Up to Oct 1990*

Water Well Information System:

Provincial

WWIS

This database describes locations and characteristics of water wells found within Ontario in accordance with Regulation 903. It includes such information as coordinates, construction date, well depth, primary and secondary use, pump rate, static water level, well status, etc. Also included are detailed stratigraphy information, approximate depth to bedrock and the approximate depth to the water table.

Government Publication Date: Sep 30, 2021

Definitions

Database Descriptions: This section provides a detailed explanation for each database including: source, information available, time coverage, and acronyms used. They are listed in alphabetic order.

Detail Report: This is the section of the report which provides the most detail for each individual record. Records are summarized by location, starting with the project property followed by records in closest proximity.

Distance: The distance value is the distance between plotted points, not necessarily the distance between the sites' boundaries. All values are an approximation.

Direction: The direction value is the compass direction of the site in respect to the project property and/or center point of the report.

Elevation: The elevation value is taken from the location at which the records for the site address have been plotted. All values are an approximation. Source: Google Elevation API.

Executive Summary: This portion of the report is divided into 3 sections:

'Report Summary'- Displays a chart indicating how many records fall on the project property and, within the report search radii.

'Site Report Summary'-Project Property'- This section lists all the records which fall on the project property. For more details, see the 'Detail Report' section.

'Site Report Summary-Surrounding Properties'- This section summarizes all records on adjacent properties, listing them in order of proximity from the project property. For more details, see the 'Detail Report' section.

Map Key: The map key number is assigned according to closest proximity from the project property. Map Key numbers always start at #1. The project property will always have a map key of '1' if records are available. If there is a number in brackets beside the main number, this will indicate the number of records on that specific property. If there is no number in brackets, there is only one record for that property.

The symbol and colour used indicates 'elevation': the red inverted triangle will dictate 'ERIS Sites with Lower Elevation', the yellow triangle will dictate 'ERIS Sites with Higher Elevation' and the orange square will dictate 'ERIS Sites with Same Elevation.'

Unplottables: These are records that could not be mapped due to various reasons, including limited geographic information. These records may or may not be in your study area, and are included as reference.

APPENDIX 3

QUALIFICATIONS OF ASSESSORS



PATERSON GROUP

solution oriented engineering



Jeremy Camposarcone, B.Eng. Junior Environmental Engineer

Jeremy joined Paterson Group in 2020 as part of the Environmental Group. Jeremy received his Bachelor of Engineering in Environmental Engineering from Carleton University in 2019. Jeremy completed his studies while researching water treatment processes for the wastewater effluent of a hydrothermal carbonization reactor. His responsibilities as a field engineer have brought him to various projects throughout the Ottawa-Valley. In his time with Paterson, Jeremy has been involved with residential and commercial development within Ottawa and the surrounding area. His scope of work consists of environmental investigation and reporting, field inspection, field testing, quality control and quality assurance.

EDUCATION

Bachelor of Engineering in Environmental Engineering, 2019
Carleton University
Ottawa, Ontario

LICENCE/PROFESSIONAL AFFILIATIONS

PEO Engineer in Training

YEARS OF EXPERIENCE

With Paterson: 2

OFFICE LOCATION

9 Auriga Drive, Ottawa, Ontario, K2E 7T9

SELECT LIST OF PROJECTS

- PSPC, Confederation Heights Redevelopment, Ottawa, ON - Phase I and II ESA program for site redevelopment.
- Travelodge Hotel, Carling Avenue, Ottawa, ON - Remediation Program, Phase I and II ESA, Underground Storage Tank Pull and Remediation (Site Remediation Coordinator & Supervisor)
- Caivan Residential Development, Navan, ON - Large-Scale Remediation, Groundwater Monitoring, Phase I and II ESA, Remedial Action Plan (Site Remediation Coordinator & Supervisor)
- Rideau Centre Expansion, Ottawa, ON - Phase I and II ESA, Soil Remediation Program
- Ottawa Trainyards, Ottawa, ON - Large-Scale Remediation, Phase I and II ESA (Site Remediation Coordinator & Supervisor)
- Major Building, Downtown Ottawa, ON - Phase I and II ESA

PROFESSIONAL EXPERIENCE

2020 to present, **Junior Environmental Engineer, Paterson Group, Ottawa, Ontario**

- Conduct Phase I and Phase II - Environmental Site Assessments in accordance with CSA standards and O.Reg. 153/04.
- Manage excavation contractors to ensure soil quality control; daily reporting to project manager
- Present analytical test results, interpretations, assessments, recommendation and/or conclusion in a final technical report
- Oversee geotechnical investigations for test pitting on numerous proposed utility installations, residential and commercial developments.
- Conduct laboratory testing program of soils and water for detail recommendations
- Problem solving to complete analysis required
- Adapt to unforeseen on-site challenges and provide first-hand insights to help collaborate toward a solution
- Coordinate large-scale remediation projects and monitor excavated material
- Monitor and sample multiple groundwater wells with a high degree of precision regarding the quality and parameters of the sample
- On-site settlement plate surveying of future residential developments



PATERSON GROUP

solution oriented engineering

Adrian Menyhart, P.Eng., ing., QP_{esa} **Senior Project Manager**

Adrian received his Bachelor of Engineering from Carleton University in 2011, with a specialization in environmental engineering, and joined Paterson Group shortly after graduation. Over the next seven years, Adrian gained significant experience in all aspects of environmental engineering, beginning with field work and later, with reporting and project management. In 2018, Adrian joined the National Research Council as an environmental officer, working in the field of polyfluoroalkyl substances (PFAS) at the National Fire Laboratory. Following the National Research Council, Adrian returned to consulting at WSP Canada Inc. At WSP, Adrian assisted the Ottawa environmental group as a project manager, managing large and small federal environmental projects such as the investigations for the proposed Alexandra interprovincial bridge. Finally, after two years away, Adrian returned to Paterson Group as a senior project manager within the environmental department.

Adrian has filed multiple Records of Site Condition with the Ontario Ministry of the Environment, Conservation and Parks and is knowledgeable with respect to Ontario's On-site and Excess Soil Regulation. Fluently bilingual, Adrian holds engineering licenses in both Ontario and Quebec, as well as being a Qualified Person in the Province of Ontario.

EDUCATION

B.Eng. 2011, Environmental Engineering,
Carleton University, Ottawa, ON

LICENCE/PROFESSIONAL AFFILIATIONS

Ordre des Ingénieurs du Québec
Professional Engineers of Ontario
Ottawa Geotechnical Group

YEARS OF EXPERIENCE

Paterson Group
2020-Present

WSP Canada Inc.
2019-2020

National Research Council
2018-2019

Paterson Group
2011 – 2018

OFFICE LOCATION

9 Auriga Drive, Ottawa, Ontario, K2E 7T9

SELECT LIST OF PROJECTS

- The Ottawa Hospital, Remediation of New Campus.
- PSPC, Alexandra Bridge Replacement, Phase II ESA, Ottawa/Gatineau – provided oversight of the Phase I and Phase II program for the bridge replacement program.
- PSPC/BGIS, Finance Building and Annex – Tunney's Pasture, Phase II ESA – Oversaw the planning, reporting and completion of a Phase II ESA within the project buildings.
- Canada Lands Corporation, 530 Tremblay Avenue, Oversaw the planning, reporting and completion of a Phase I ESA, and planning requirements of a Phase II ESA.
- National Fire Laboratory, PFAS investigation – Provided technical support for the National Research Council, with respect to the ongoing PFAS investigation.
- Ottawa Arts Gallery Expansion, Ottawa, ON – Provided guidance in the segregation of soils on the site, managing contaminated and clean materials, providing daily correspondence with the client. Successfully filed a Record of Site Condition for the property.

PROFESSIONAL EXPERIENCE

November 2020 to Present, **Environmental Engineer, Paterson Group Inc.**, Ottawa, Ontario

- Coordination, preparation and management of Phase I and Phase II Environmental Site Assessment.
- Coordination, preparation and managed Designated Substance Surveys and indoor air quality assessments.
- Preparation of soil and groundwater remediation plans.
- Filing records of site condition with the Ontario Ministry of the Environment, Conservation and Parks.
- Implementation of Excess Soil Regulations, Ontario.

March 2019 to 2020, **Environmental Engineer, WSP Canada Inc.**, Ottawa, Ontario

- Coordinated, prepared Phase I and Phase II Environmental Site Assessments for Federal and private clients.
- Coordinated, prepared and managed Designated Substance Surveys for various Federal and private clients, in both English and French.
- Managed all projects from preparation of proposals, to final invoicing.

September 2018 to 2019, **Environmental Officer, National Research Council**, Ottawa, Ontario

- Oversaw on-going PFAS investigation program at the National Fire Laboratory in Almonte, Ontario, being carried out by NRC consultants.
- Reviewed and commented on deliverables prepared by consultants, while coordinating with internal legal, communications, and presidential departments within the NRC.
- Corresponded with area residents surrounding the Laboratory.
- Coordinated potable water supply program.

September 2011 to 2018, **Environmental Engineer, Paterson Group Inc.**, Ottawa, Ontario

- Prepare, revise and submit all documentation and reports for the successful filing of Records of Site Condition with the Ministry of the Environment and Climate Change
- Provide on-site environmental expertise for remediation projects including Ottawa Arts Gallery, Rideau Centre Expansion and Tall Ships Landing, among various small scale remediation project within the greater Ottawa area.
- Coordinate field programs and prepare reports for Phase I and II projects across Ontario and Quebec.
- Oversee environmental investigations for drilling and test pitting on numerous proposed utility installations, residential and commercial developments.
- Conduct designated substance surveys in Ontario and Quebec.
- Coordinate air sampling programs for various environmental parameters, comparing results with regulatory standards and other guidelines.
- Problem solving to help advance or maintain project schedules.
- Complete environmental reports with recommendations for environmental concerns.
- Liaising with contractors, consultants and government officials.
- Provide cost estimates for environment field programs and construction costs.

June to September from 2009 to 2011, **Inspector, Canadian Food Inspection Agency**, Ottawa, Ontario

- Conducted the trapping program for the Emerald Ash Borer across Eastern Ontario.
- Assisted in the preparation and training of other inspectors for the trapping program.
- Conducted inspections for restricted wood products at various campgrounds.
- Assisted other inspectors in inspecting shipments of wood products from other countries, in certain cases, seizing and disposing of items.
- Compiling data and preparing reports.