Geotechnical Engineering

**Environmental Engineering** 

**Hydrogeology** 

Geological Engineering

**Materials Testing** 

**Building Science** 

Archaeological Services

## patersongroup

**Phase I-Environmental Site Assessment** 

4623 Spratt Road Ottawa, Ontario

**Prepared For** 

Claridge Homes (Spratt Road) Limited Partnership

#### **Paterson Group Inc.**

Consulting Engineers 154 Colonnade Road South Ottawa (Nepean), Ontario Canada K2E 7J5

Tel: (613) 226-7381 Fax: (613) 226-6344 www.patersongroup.ca January 21, 2019

Report: PE4509-1



#### **TABLE OF CONTENTS**

EXEC		E SUMMARY	
1.0	INTR	ODUCTION	1
2.0	PHAS	SE I PROPERTY INFORMATION	2
3.0	SCO	PE OF INVESTIGATION	3
4.0	REC	ORDS REVIEW	4
	4.1	General	4
	4.2	Environmental Source Information	5
	4.3	Physical Setting Sources	7
5.0	INTE	RVIEWS	9
6.0	SITE	RECONNAISSANCE	10
	6.1	General Requirements	10
	6.2	Specific Observations at Phase I Property	10
7.0		EW AND EVALUATION OF INFORMATION	
	7.1	Land Use History	12
	7.2	Conceptual Site Model	13
8.0	CON	CLUSIONS	15
9.0	STAT	FEMENT OF LIMITATIONS	17
10.0	REF	ERENCES	18

#### **List of Figures**

Figure 1 - Key Plan

Figure 2 - Topographic Map

Drawing PE4509-1 - Site Plan

Drawing PE4509-2 - Surrounding Land Use Plan

#### **List of Appendices**

Appendix 1 Chain of Title

Survey Plan

Aerial Photographs Site Photograph

Appendix 2 MECP Freedom of Information

TSSA Correspondence

HLUI Response MECP Well Records

Appendix 3 Qualifications of Assessors



#### **EXECUTIVE SUMMARY**

#### **Assessment**

Paterson Group was retained by Claridge Homes (Spratt Road) Limited Partnership to conduct a Phase I-Environmental Site Assessment (ESA) of the property addressed 4623 Spratt Road, in the City of Ottawa, Ontario. The purpose of this Phase I-ESA was to research the past and current use of the subject site and Phase I study area and to identify any environmental concerns with the potential to have impacted the Phase I property.

According to the historical research, the subject site was occupied by a farmstead from at least 1976 until 2017 and was abandoned thereafter. The site has been vacant since. Neighbouring land uses were for residential and agricultural purposes. No potential contaminating activities were identified with the historical use of the subject site or surrounding lands.

Following the historical research, a site visit was conducted. The subject site is vacant and vegetated with tall grass, shrub and trees. The neighbouring properties in the Phase I Study Area were observed from publicly accessible roadways. No potentially contaminating activities were identified on the subject site or in the Phase I Study Area. Therefore, no areas of potential environmental concern with respect to the Phase I Property were identified.

Based on the results of the assessment, in our opinion, a Phase II- Environmental Site Assessment is not required for the subject property.

#### Recommendations

Based on the approximate age of the subject buildings (pre-1976), potential ACMs may be present within the buildings. Suspected ACMs observed at the time of our site visit included drywall joint compound and exterior wall finish (stucco). It should be noted, however, that an internal review of the residential dwelling could not conducted.

Lead-based paint may be present beneath more recent non-lead-based paint products on any remaining original surfaces within the buildings. If the residence is going to be demolished, then a designated substance survey, which includes asbestos and lead-paint testing, must be conducted in accordance with Ontario Regulation 843, under the Occupational Health and Safety Act.



It is also recommended that the potable well be decommissioned I accordance with O.Reg 903, if encountered during redevelopment.



#### 1.0 INTRODUCTION

At the request of Claridge Homes (Spratt Road) Limited Partnership, Paterson Group (Paterson) conducted a Phase I-Environmental Site Assessment (Phase I-ESA) of the property addressed 4623 Spratt Road, in the City of Ottawa, Ontario. The purpose of this Phase I-ESA was to research the past and current use of the site and study area and to identify any environmental concerns with the potential to have impacted the subject property.

Paterson was engaged to conduct this Phase I-ESA by Mr. Vincent Denomme with Claridge Homes. The head office is located at 210 Gladstone Avenue, Ottawa, Ontario. Mr. Denomme can be reached by telephone at (613) 233-6030.

This report has been prepared specifically and solely for the above noted project which is described herein. It contains all of our findings and results of the environmental conditions at this site.

This Phase I-ESA report has been prepared in general accordance with the requirements of Ontario Regulation (O.Reg.) 153/04, as amended, under the Environmental Protection Act, and also complies with the requirements of CSA Z768-01. The conclusions presented herein are based on information gathered from a limited historical review and field inspection program. The findings of the Phase I-ESA are based on a review of readily available geological, historical and regulatory information and a cursory review made at the time of the field assessment. The historical research relies on information supplied by others, such as, local, provincial and federal agencies and was limited within the scope-of-work, time and budget of the project herein.



#### 2.0 PHASE I PROPERTY INFORMATION

Address: 4623 Spratt Road, Ottawa, Ontario.

Legal Description: Part of Lot 22, Concession 1 Rideau Front, in the

Township of Gloucester, in the City of Ottawa.

Property Identification

Numbers: 04330-0423 and 04330-0424

Location: The site is located on the southeast side of the Spratt

Road and Cambie Road intersection, just south of Libra Street, in the City of Ottawa (formerly Gloucester), Ontario. Refer to Figure 1 - Key Plan in

the Figures section following the text.

Latitude and Longitude: 45° 16' 6.37" N, 75° 41' 5.56" W

**Site Description:** 

Site Area: 2.7 hectares (approximate)

Configuration: Irregular.

Zoning: DR – Development Reserve Zone

Current Use: The subject site is currently unutilized. The majority of

the site is vacant land, covered with tall grass, brush and trees, although there is a residential dwelling and

associated garage structure.

Services: Older homes in the area may be serviced by private

wells and sewage systems while all new development

to the north is municipally serviced.



#### 3.0 SCOPE OF INVESTIGATION

e scope of work for this Phase I – Environmental Site Assessment was as lows:
Determine the historical activities on the subject site and study area by conducting a review of readily available records, reports, photographs, plans, mapping, databases, and regulatory agencies;
Investigate the existing conditions present at the subject site and study area by conducting site reconnaissance;
Conduct interviews with persons knowledgeable of current and historic operations on the subject property, and if warranted, neighbouring properties;
Present the results of our findings in a comprehensive report in general accordance with the requirements of O.Reg. 269/11 amended under the Environmental Protection Act and in compliance with the requirements of CSA Z768-01;
Provide a preliminary environmental site evaluation based on our findings;
Provide preliminary remediation recommendations and further investigative work if contamination is suspected or encountered.



#### 4.0 RECORDS REVIEW

#### 4.1 General

#### **Phase I-ESA Study Area Determination**

A radius of approximately 250 m was determined to be appropriate as a Phase I study area for this assignment. Properties outside the 250 m radius are not considered to have impacted the subject land, based on their significant distance from the site.

#### First Developed Use Determination

An aerial photograph from 1976 indicated that the subject site was developed with a farmstead while the rest of the site consisted of agricultural fields.

#### Fire Insurance Plans

Fire Insurance Plans (FIPs) are not available for the subject area.

#### **City of Ottawa Street Directories**

City directories are not available for the area of the subject site.

#### **Chain of Title**

A Chain of Title for the subject site was acquired from READ Abstracts Limited. The subject site has always been privately owned. The property was first registered in 1898. The property is currently owned by Mr. Nic Sala and has been since 1989. Based on the Chain of Title, no potential environmental concerns were noted with regard to the subject site. A copy of the chain of title is included in Appendix 1.

#### **Environmental Reports**

Paterson Group has conducted environmental and geotechnical investigations in the immediate vicinity of the subject site including a geotechnical investigation on site. Based on a review of our files, no potential environmental concerns were identified on the subject site or neighbouring lands.



#### **Plan of Survey**

A draft plan of subdivision prepared by Annis, O'Sullivan, Vollebekk Ltd. was reviewed as part of this assessment. The plan depicts the Phase I Property in its current configuration. A copy of the survey plan is included in Appendix 1.

#### 4.2 Environmental Source Information

#### **Environment Canada**

A search of the National Pollutant Release Inventory (NPRI) was conducted electronically on December 5, 2018. The subject site and adjacent properties were not listed in the NPRI database. No records of pollutant release were listed in the database for properties located within the Phase I study area.

#### **PCB Inventory**

A search of national PCB waste storage sites was conducted. No PCB waste storage sites are located within the Phase I study area.

#### Ministry of the Environment, Conservation and Parks (MECP) Instruments

A request was submitted to the MECP Freedom of Information (FOI) office for information with respect to certificates of approval, permits to take water, certificates of property use or any other similar MECP issued instruments for the site. Based on the MECP FOI response, there was no information with regardsto certificates of approvals, permits to take water, certificate of property use or any other similar MECP issued instruments for the subject site, A copy of the MECP FOI response is included in Appendix 2.

#### **MECP Submissions**

A request was submitted to the MECP FOI office for information with respect to reports related to environmental conditions for the property. Based on the MECP FOI response, no potential environmental concerns were noted with regard to the subject site. A copy of the MECP FOI response is included in Appendix 2.

#### **MECP Waste Management Records**

A request was submitted to the MECP FOI office for information with respect to waste management records. Based on the MECP FOI response, no issues were reported with regard to waste management practices on the subject site. A copy of the MECP FOI response is included in Appendix 2.



#### **MECP Incident Reports**

A request was submitted to the MECP FOI office for information with respect to records concerning environmental incidents, orders, offences, spills, discharges of contaminants or inspections maintained by the MECP for the site or adjacent properties. Based on the MECP FOI response, no records concerning environmental incidents, orders, offences, spills, discharges of contaminants or inspections maintained by the MECP for the site or adjacent properties were noted with regard to the subject site. A copy of the MECP FOI response is included in Appendix 2.

#### **MECP Coal Gasification Plant Inventory**

The MECP document titled "Municipal Coal Gasification Plant Site Inventory, 1991" was reviewed to reference the locations of former plants with respect to the site. No Municipal Coal Gasification Plant Sites are located within the Phase I study area.

#### **MECP Brownfields Environmental Site Registry**

A search of the MECP Brownfields Environmental Site Registry was conducted as part of this assessment for the site, neighbouring properties and the general area of the site. No Records of Site Condition (RSCs) were filed for the subject property or properties within the Phase I ESA study area.

#### MECP Waste Disposal Site Inventory

The Ontario Ministry of Environment document titled "Waste Disposal Site Inventory in Ontario, 1991" was reviewed as part of the historical research. This document includes all recorded active and closed waste disposal sites, industrial manufactured gas plants and coal tar distillation plants in the Province of Ontario. There are no former waste disposal sites located within 250 m of the Phase I Study Area.

#### Areas of Natural Significance

A search for areas of natural significance and features within the Phase I Study Area was conducted on the website of the Ontario Ministry of Natural Resources (MNR) on December 5, 2018. The search did not reveal areas of natural significance within the Phase I Study Area.



#### **Technical Standards and Safety Authority (TSSA)**

The TSSA, Fuels Safety Branch in Toronto was contacted electronically on December 5, 2018, to inquire about current and former underground storage tanks, spills and incidents for the site and neighbouring properties. No records are listed in the TSSA registry for the subject site or the adjacent properties. A copy of the TSSA correspondence is included in Appendix 2.

#### City of Ottawa Landfill Document

The document entitled "Old Landfill Management Strategy, Phase I -Identification of Sites, City of Ottawa", was reviewed. There are no closed landfill sites within the vicinity of the Phase I study area.

#### City of Ottawa Historical Land Use Inventory (HLUI)

A search of the City of Ottawa's Historical Land Use Inventory (HLUI) database was conducted as part of this assessment. Based on the HLUI database, no activities associated with the subject site or properties within 50 m of the subject site were identified. No potential environmental concerns were noted with regard to the Phase I Property. A copy of the HLUI request form is provided in Appendix 2.

#### 4.3 **Physical Setting Sources**

#### **Aerial Photographs**

Historical air photos from the National Air Photo Library were reviewed in approximate ten (10) year intervals. Based on the review, the following observations have been made:

1976	At this time, the subject site is occupied by a farmstead and garage on the northern portion of the property with an apparent barn structure located in the northwest corner of the site. The majority of the land is fields. Neighbouring lands are occupied with some farmsteads and agricultural fields.
1991	The subject site appears unchanged from the previous photograph.  The adjacent lands are the same except for two (2) residential

acent lands are the same except for two (2) residential dwellings/farmsteads that can be seen southwest of the site.

2002 No significant changes have been made to the subject site or neighbouring properties. At this time, a residential subdivision is



	Armstrong Road.
2011	No significant changes have been made to the subject site or surrounding properties at this time. More residential development is noticeable further to the north.
2017	The subject site remains unchanged from the previous photograph. The neighbouring lands to the north are being developed with additional residential dwellings. Lands to the west appear as a newly developed residential subdivision. The remaining lands to the south and east are vacant and/or undeveloped at this time.

being developed further to the northwest, on the north side of Earl

Laser copies of selected aerial photographs reviewed are included in Appendix 1.

#### **Topographic Maps**

Topographic maps were obtained from Natural Resources Canada – The Atlas of Canada website and from the City of Ottawa website. The topographic maps indicate that the regional topography in the general area of the site slopes down to the west in the direction of the Rideau River. The Rideau River is located to approximately 1.3 km to the west. An illustration of the referenced topographic map is presented on Figure 2 – Topographic Map, appended to this report.

#### **Physiographic Maps**

The Ontario Geological Survey publication 'The Physiography of Southern Ontario, Third Edition' was reviewed as a part of this assessment. According to the publication, the site is situated within the Ottawa Clay Plain physiographic region.

#### **Geological Maps**

The Geological Survey of Canada website on the Urban Geology of the National Capital Area was consulted as part of this assessment. Based on this information, bedrock in the area consists of sandstone and dolomite of the March Formation. The site is located in an area of both nearshore marine sediments of sand and reworked glaciofluvial silt and clay and plain till is present in the southern part and northeastern part of the site, respectively, with an overburden thickness ranging from 5 to 15 meters.



#### **Water Well Records**

A well record search was conducted on December 5, 2018 for all drilled wells within 250 m of the subject site. The well record search returned six (6) records; one on-site potable water well, four (4) domestic wells off-site, approximately within 200 m of the search radius, and an abandoned well approximately 190 m north of the subject site. No potential environmental concerns regrading the well records were identified with respect to the subject site. A copy of the well records has been included in Appendix 2.

#### **Water Bodies and Areas of Natural Significance**

No water bodies or areas of natural significance are known to exist on the subject site and in the Phase I study area.

#### **Geotechnical Investigation**

Paterson conducted a Geotechnical Investigation at the subject property (Report: PG4730-1) in December 2018. The subsurface profile of the site (BH8 and BH9) generally consisted of a thin topsoil layer, underlain by silty sand to clayey silt and extended to depths ranging from 5.30 to 6.40 m below the existing grade.

Groundwater flow is interpreted to be in a westerly-northwesterly direction.

#### 5.0 INTERVIEWS

#### **Property Owner Representative**

The current property owner was unavailable to interview as part of this assessment. Mr. Vincent Denomme with Claridge Homes was interviewed via email as part of this assessment. Very little is known about the subject property other than the property was a farmstead and had been abandoned for some time. According to Mr. Denomme, there are no above ground storage tanks (ASTs) on the property. The former barn was demolished in January 2018. Claridge Homes is currently under agreement to purchase the subject property. Mr. Denomme is not aware of any potential environmental concerns with respect to the subject or adjacent properties.



#### **6.0 SITE RECONNAISSANCE**

#### 6.1 General Requirements

The site visit was conducted on December 5, 2018. Weather conditions were snowy and overcast with a temperature of approximately -5°C. Ms. Mandy Witteman from the Environmental Department of Paterson conducted the site assessment. In addition to the site use, neighbouring land use within the Phase I study area was also assessed at the time of the site visit.

#### 6.2 Specific Observations at Phase I Property

#### **Buildings and Structures**

Two (2) abandoned structures were present on the subject site, a single storey residential dwelling and a detached garage. The residential structure was constructed with a poured concrete foundation and a sloped shingled roof with an exterior finished in red brick. Windows and doors were barricaded and locked. The exterior of the dwelling showed signs of a furnace vent and possibly a former AST in the basement of the building, which consisted of parged holes possibly for vent and fill pipes.

Remnants of an old barn on-site were noted, such as wood and sheet metal wreckage on the north eastern part of the site. Structure materials and home furnishing debris were observed along the west and south sides of the abandoned residential structure and garage.

#### Site Features

The subject property is largely vacant land covered in tall grass, brush and trees. The residential dwelling and associated structures were situated on the northern portion of the property fronting Libra Street.

The site topography is above grade, which is likely caused by the presence of left-over fill material from the newly developed residential subdivision, on the side of Libra Street, as well as, debris from the demolished barn that previously occupied the site. The site generally slopes down towards Spratt Road. The regional topography slopes down towards the west in the direction of the Rideau River, approximately 1.3 km from the subject site. Site drainage consists of infiltration.



No underground utilities were noted on-site. No drains or private sewage systems were observed at the subject property at the time of the site visit. However, the site is suspected to have been originally serviced by a private sewage system. No evidence of current or former railway or spur lines on the subject property was observed at the time of the site visit. No areas of stained snow or unidentified substances were observed on-site at this time.

#### Interior

An interior inspection of the residence was not conducted as part of the Phase I – ESA. There was no access to the abandoned dwelling. Both building structures were deemed to structurally unsound to conduct an interior inspection at the time of the site visit.

The interior of the private garage was assessed from an opened door. The floor throughout consisted of concrete. The walls and ceiling were finished with drywall and ceiling tiles, and while the lighting consisted of fluorescent fixtures.

#### **Hazardous Building Materials**

Based on the approximate age of the buildings (pre-1976) potential ACMs may be present within these structures. Suspected ACMs observed include exterior parging and drywall joint compound (garage).

Based on the approximate age of the buildings (at least 1976), lead-based paint may be present on originally painted surfaces within the building.

#### Other Potential Environmental Concerns

No signs indicating the presence of an above ground storage tank (AST) were observed on the interior of the building.

Four (4), 20-litre pails of engine oil, which appeared to be empty, were noted inside the private garage. No visual or unusual olfactory observations were noted at the that time. A 20-litre pail, labelled as anti-freeze was also noted on the property exterior, west of the garage.

No floor drain was observed in the garage at time of the site assessment.

No mould growth was observed on the surfaces (walls and ceilings) of the garage.



#### **Neighbouring Properties**

An inspection of the neighbouring properties was conducted from publicly accessible roadways at the time of the site inspection. Land use adjacent to the subject site was as follows:

☐ North -	Libra Street, followed by a residential development;
☐ South -	Vacant and undeveloped land;
□ East -	Vacant land, followed by Serenade Crescent;
■ West -	Vacant land, followed by Spratt Road.

The current use of the adjacent properties are not considered to pose an environmental concern to the subject site. No properties within the Phase I study area are occupied by potentially contaminating activities. Current land use in the Phase I Study area is illustrated on Drawing PE4509-2 – Surrounding Land Use Plan in the Figures section of this report.

#### 7.0 REVIEW AND EVALUATION OF INFORMATION

#### 7.1 Land Use History

The following table indicates the current and past uses of the site as well as any associated potentially contaminating activities dating back to the first developed use of the site.

Table 1 - Land Use History – 4623 Spratt Road								
Time Period	Land Use	Potentially Contaminating Activities (PCAs)	Areas of Potential Environmental Concern (APECs)					
1976 – 2017	Agricultural land with a residence and barn-like buildings	None	None					
2017 - Present	Vacant	None	None					



## Potentially Contaminating Activities and Areas of Potential Environmental Concern

No potentially contaminating activities (PCAs) were identified at the Phase I property or within the Phase I study area. Therefore, no Areas of Potential Environmental Concern (APECs) were identified on the subject site.

#### **Contaminants of Potential Concern**

No Contaminants of Potential Concern (CPCs) were identified on the subject site.

#### 7.2 Conceptual Site Model

#### Geological and Hydrogeological Setting

Based on information from the Geological Survey of Canada, drift thickness in the area of the subject site is estimated to be on the order of 5 to 15 m. The overburden on the southeastern part is comprised of nearshore marine sediments of sand and reworked glaciofluvial silt and clay and plain till on the northern and eastern parts of the subject site. Bedrock in the area is comprised of sandstone and dolomite from the March Formation.

Groundwater flow is interpreted to be in a westerly-northwesterly direction towards the Rideau River.

#### **Existing Buildings and Structures**

Two (2) abandoned structures, a former residential home and a detached garage exist on the subject site.

#### **Water Bodies and Areas of Natural Significance**

No water bodies or areas of natural significance were identified on the subject site or in the Phase I study area.

#### **Drinking Water Wells**

One potable water well record was identified on the subject site, however it was not located at the time of the site visit. No potential environmental concern has been identified with respect to the Phase I property.

#### **Neighbouring Land Use**

Neighbouring land use in the Phase I study area consists of vacant, undeveloped land and/or residential dwellings.



## Potentially Contaminating Activities and Areas of Potential Environmental Concern

As per Section 7.1 of this report, PCAs were not identified on the subject property or within the Phase I study area. Therefore, no APECs are present on the Phase I property.

#### **Contaminants of Potential Concern**

As per Section 7.1 of this report, no Contaminants of Potential Concern (CPCs) were identified on the subject site.

#### Assessment of Uncertainty and/or Absence of Information

The information available for review as part of the preparation of this Phase I-ESA is considered to be sufficient to conclude that there are no APECs on the subject site. A variety of independent sources were consulted as part of this assessment, and as such, the conclusions of this report are not affected by uncertainty which may be present with respect to the individual sources.



#### 8.0 CONCLUSIONS

#### Assessment

Paterson Group was retained by Claridge Homes (Spratt Road) Limited Partnership to conduct a Phase I-Environmental Site Assessment (ESA) of the property addressed 4623 Spratt Road, in the City of Ottawa, Ontario. The purpose of this Phase I-ESA was to research the past and current use of the subject site and Phase I study area and to identify any environmental concerns with the potential to have impacted the Phase I property.

According to the historical research, the subject site was occupied by a farmstead from at least 1976 until 2017 and was abandoned thereafter. The site has been vacant since. Neighbouring land uses were for residential and agricultural purposes. No potential contaminating activities were identified with the historical use of the subject site or surrounding lands.

Following the historical research, a site visit was conducted. The subject site is vacant and vegetated with tall grass, shrub and trees. The neighbouring properties in the Phase I Study Area were observed from publicly accessible roadways. No potentially contaminating activities were identified on the subject site or in the Phase I Study Area. Therefore, no areas of potential environmental concern with respect to the Phase I Property were identified.

Based on the results of the assessment, in our opinion, a Phase II-Environmental Site Assessment is not required for the subject property.

#### Recommendations

Based on the approximate age of the subject buildings (pre-1976), potential ACMs may be present within the buildings. Suspected ACMs observed at the time of our site visit included drywall joint compound and exterior wall finish (stucco). It should be noted, however, that an internal review of the residential dwelling could not conducted.

Lead-based paint may be present beneath more recent non-lead-based paint products on any remaining original surfaces within the buildings. If the residence is going to be demolished, then a designated substance survey, which includes asbestos and lead-paint testing, must be conducted in accordance with Ontario Regulation 843, under the Occupational Health and Safety Act.



It is also recommended that the potable well be decommissioned I accordance with O.Reg 903, if encountered during redevelopment.



#### 9.0 STATEMENT OF LIMITATIONS

This Phase I - Environmental Site Assessment report has been prepared in general accordance with O.Reg. 153/04 as amended and meets the requirements of CSA Z768-01. The conclusions presented herein are based on information gathered from a limited historical review and field inspection program. The findings of the Phase I - ESA are based on a review of readily available geological, historical and regulatory information and a cursory review made at the time of the field assessment. The historical research relies on information supplied by others, such as, local, provincial and federal agencies and was limited within the scope-of-work, time and budget of the project herein.

Should any conditions be encountered at the subject site and/or historical information that differ from our findings, we request that we be notified immediately in order to allow for a reassessment.

This report was prepared for the sole use of Claridge Homes (Spratt Road) Limited Partnership. Permission and notification from Claridge Homes (Spratt Road) Limited Partnership and Paterson will be required to release this report to any other party.

Paterson Group Inc.

Mandy Witteman, M.A.Sc.

Mark S. D'Arcy, P.Eng.

# M.S. D'ARCY 90377839

#### **Report Distribution:**

- ☐ Claridge Homes (Spratt Road) Limited Partnership
- Paterson Group



#### 10.0 REFERENCES

#### **Federal Records**

Air photos at the Energy Mines and Resources Air Photo Library.

National Archives.

Maps and photographs (Geological Survey of Canada surficial and subsurface mapping).

Natural Resources Canada – The Atlas of Canada.

Environment Canada, National Pollutant Release Inventory.

PCB Waste Storage Site Inventory.

#### **Provincial Records**

MECP Freedom of Information and Privacy Office.

MECP Municipal Coal Gasification Plant Site Inventory, 1991.

MECP document titled "Waste Disposal Site Inventory in Ontario".

MECP Brownfields Environmental Site Registry.

Office of Technical Standards and Safety Authority, Fuels Safety Branch.

MNR Areas of Natural Significance.

MECP Water Well Record Inventory.

Chapman, L.J., and Putnam, D.F., 1984: 'The Physiography of Southern Ontario, Third Edition', Ontario Geological Survey Special Volume 2.

#### **Municipal Records**

City of Ottawa Document "Old Landfill Management Strategy, Phase I -

Identification of Sites.", prepared by Golder Associates, 2004.

Intera Technologies Limited Report "Mapping and Assessment of Former Industrial Sites, City of Ottawa", 1988.

geoOttawa: City of Ottawa electronic mapping website.

City of Ottawa Historical Land Use Inventory (HLUI) Database

#### **Local Information Sources**

Personal Interviews.

Previous Engineering Reports.

#### **Public Information Sources**

Google Earth.

Google Maps/Street View.


### **FIGURES**

FIGURE 1 – KEY PLAN

FIGURE 2 - TOPOGRAPHIC MAP

**DRAWING PE4509-1 - SITE PLAN** 

DRAWING PE4509-2 - SURROUNDING LAND USE PLAN

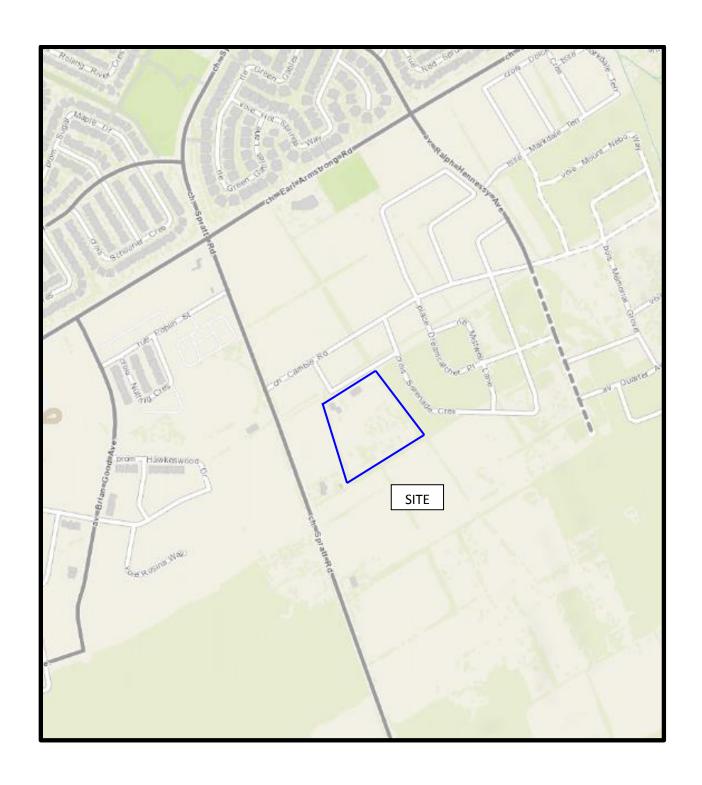

## FIGURE 1 KEY PLAN

patersongroup.



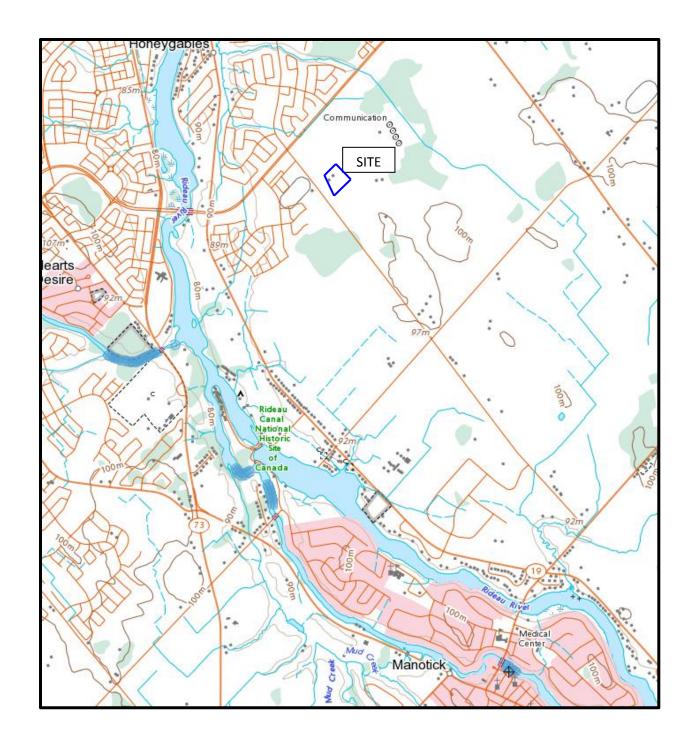


FIGURE 2
TOPOGRAPHIC MAP

patersongroup \_

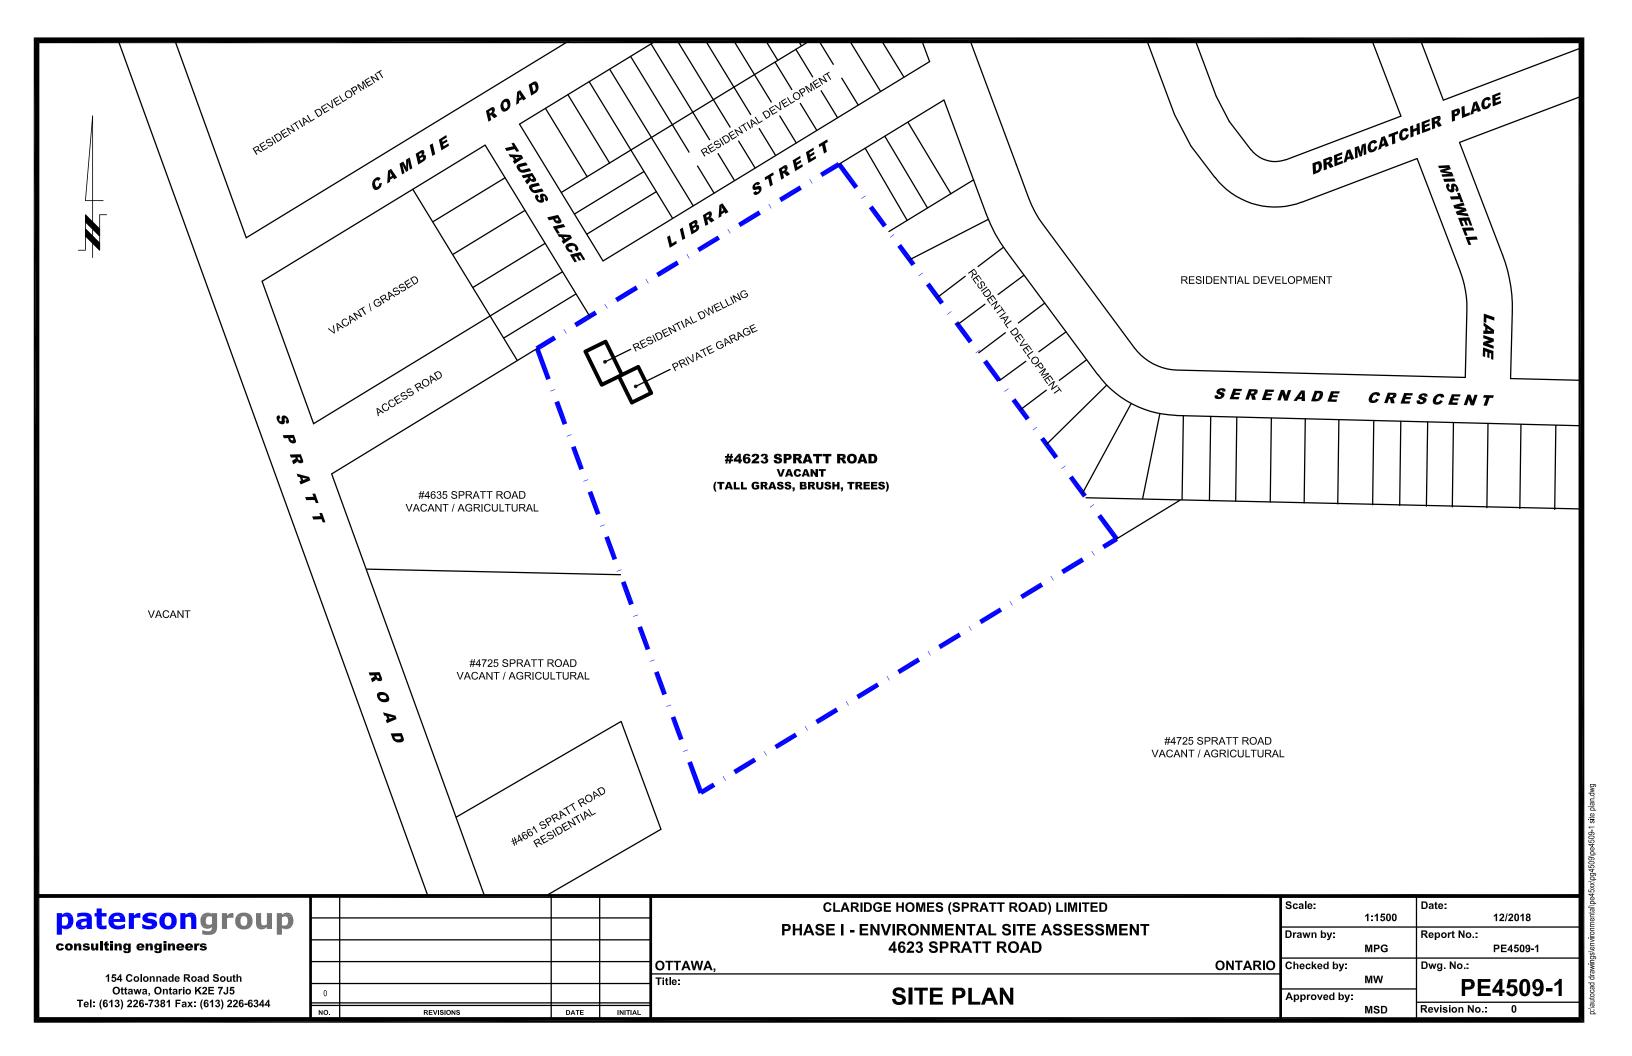

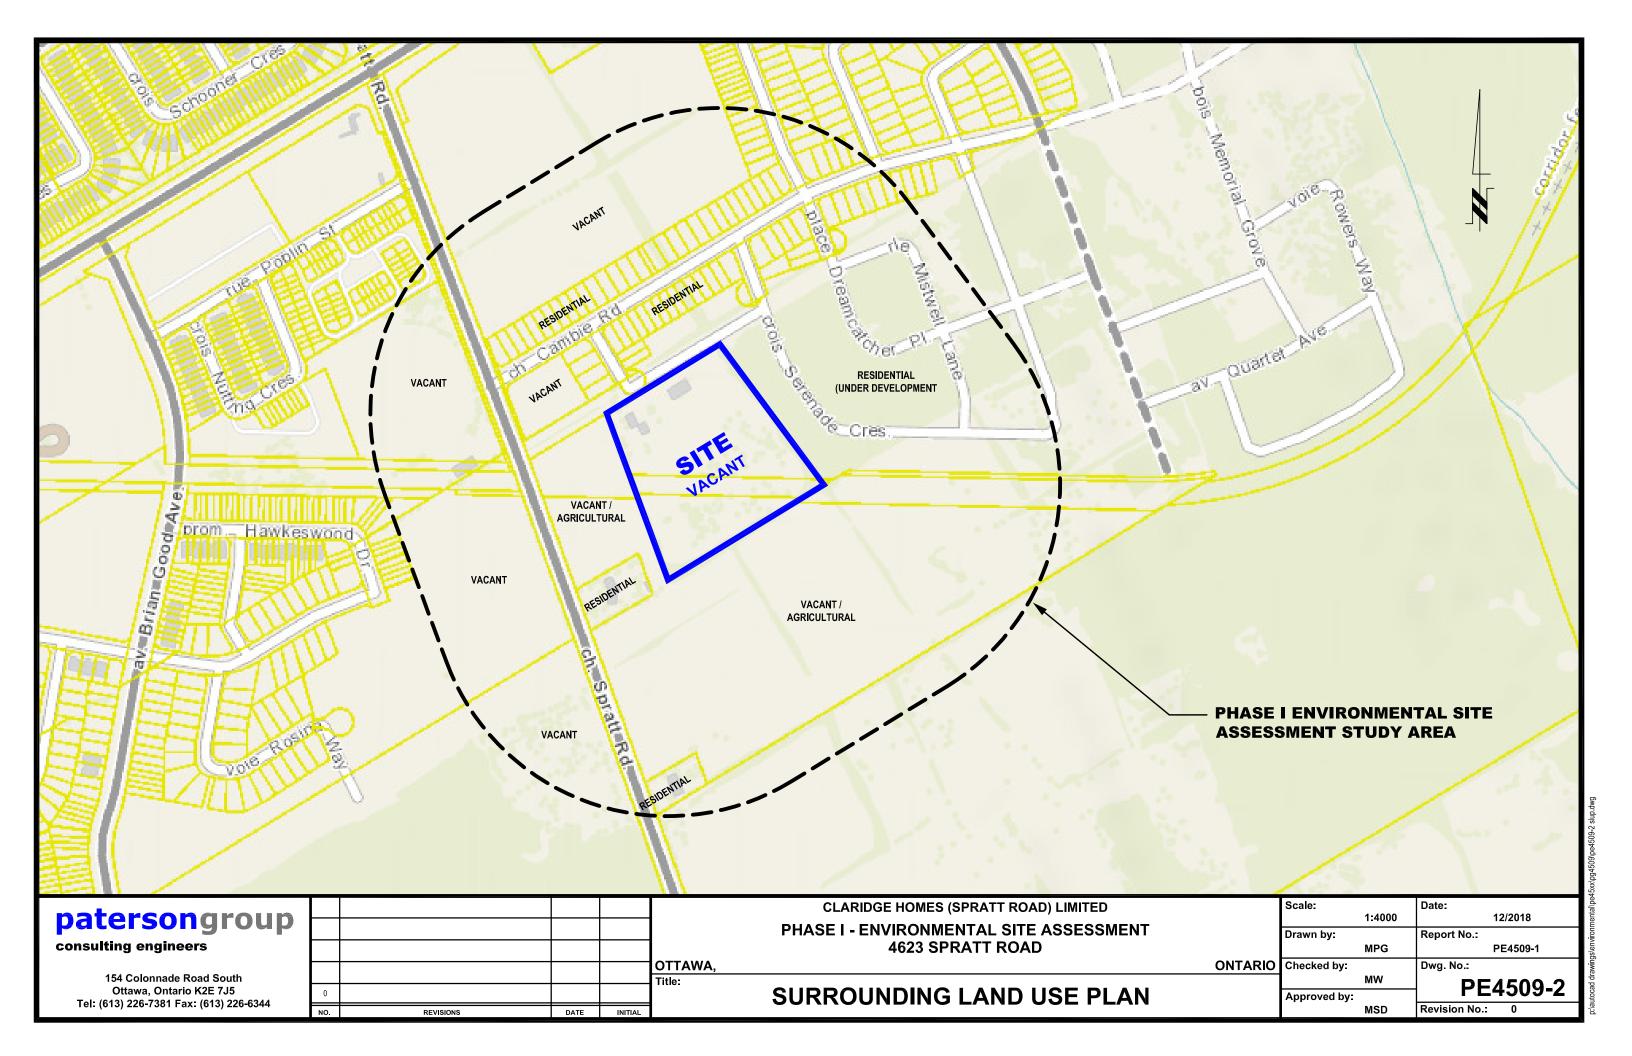

## **APPENDIX 1**

**CHAIN OF TITLE** 

**SURVEY PLAN** 

**AERIAL PHOTOGRAPHS** 

**SITE PHOTOGRAPHS** 



#### **READ Abstracts Limited**

331 Cooper Street, Suite 300, Ottawa, Ontario K2P 0A4 Email: search@readsearch.com

Tel.: 613-236-0664 Fax: 613-236-3677

#### **ENVIRONMENTAL SEARCH**

Patersongroup

Attn: Mandy Witteman

#### BRIEF DESCRIPTION OF LAND:

4623 Spratt Road., Ottawa Part of Lot 22, Concession 1 RF Gloucester, as in N508683, lying north of Part 1 on 4R21491 and lying south of Part 1 on 4R21491

PIN: 04330-0423

04330-0424

LAST REGISTERED OWNER: SALA, Nic

#### CHAIN OF TITLE:

Plan 190 registered Sep 14, 1898 By T. W. McDermott and R. P. Robinson

Deed RO11486 registered Sep 26, 1852 From John Dawson to Edmund O'Connell

Deed GL464 registered Jun 27, 1870

From Edmund O'Connell to Thomas O'Connell

Deed GL12477 registered Feb 24, 1892

From Jane Landers, James Landers, and Mary O'Connell (estate of Thomas O'Connell) to William Kennedy

Deed GL29868 registered Jun 17, 1919

From Estate of William F. Kennedy to John T. Brownrigg

Deed GL53450 registered May 30, 1955

From John T. Brownrigg to Joseph Stephen Brownrigg

Deed NS83540 registered Apr 11, 1980


From estate of Stephen Joseph Brownrigg (aka Joseph Stephen) to Joan E. Brownrigg

Deed N414040 registered October 30, 1987

From Joan E. Brownrigg to Dennis Stephen Brownrigg and Kimberly Ann Brownrigg

Deed N508683 registered Oct 20, 1989


From Dennis Stephen Brownrigg and Kimberly Ann Brownrigg to Nic Sala

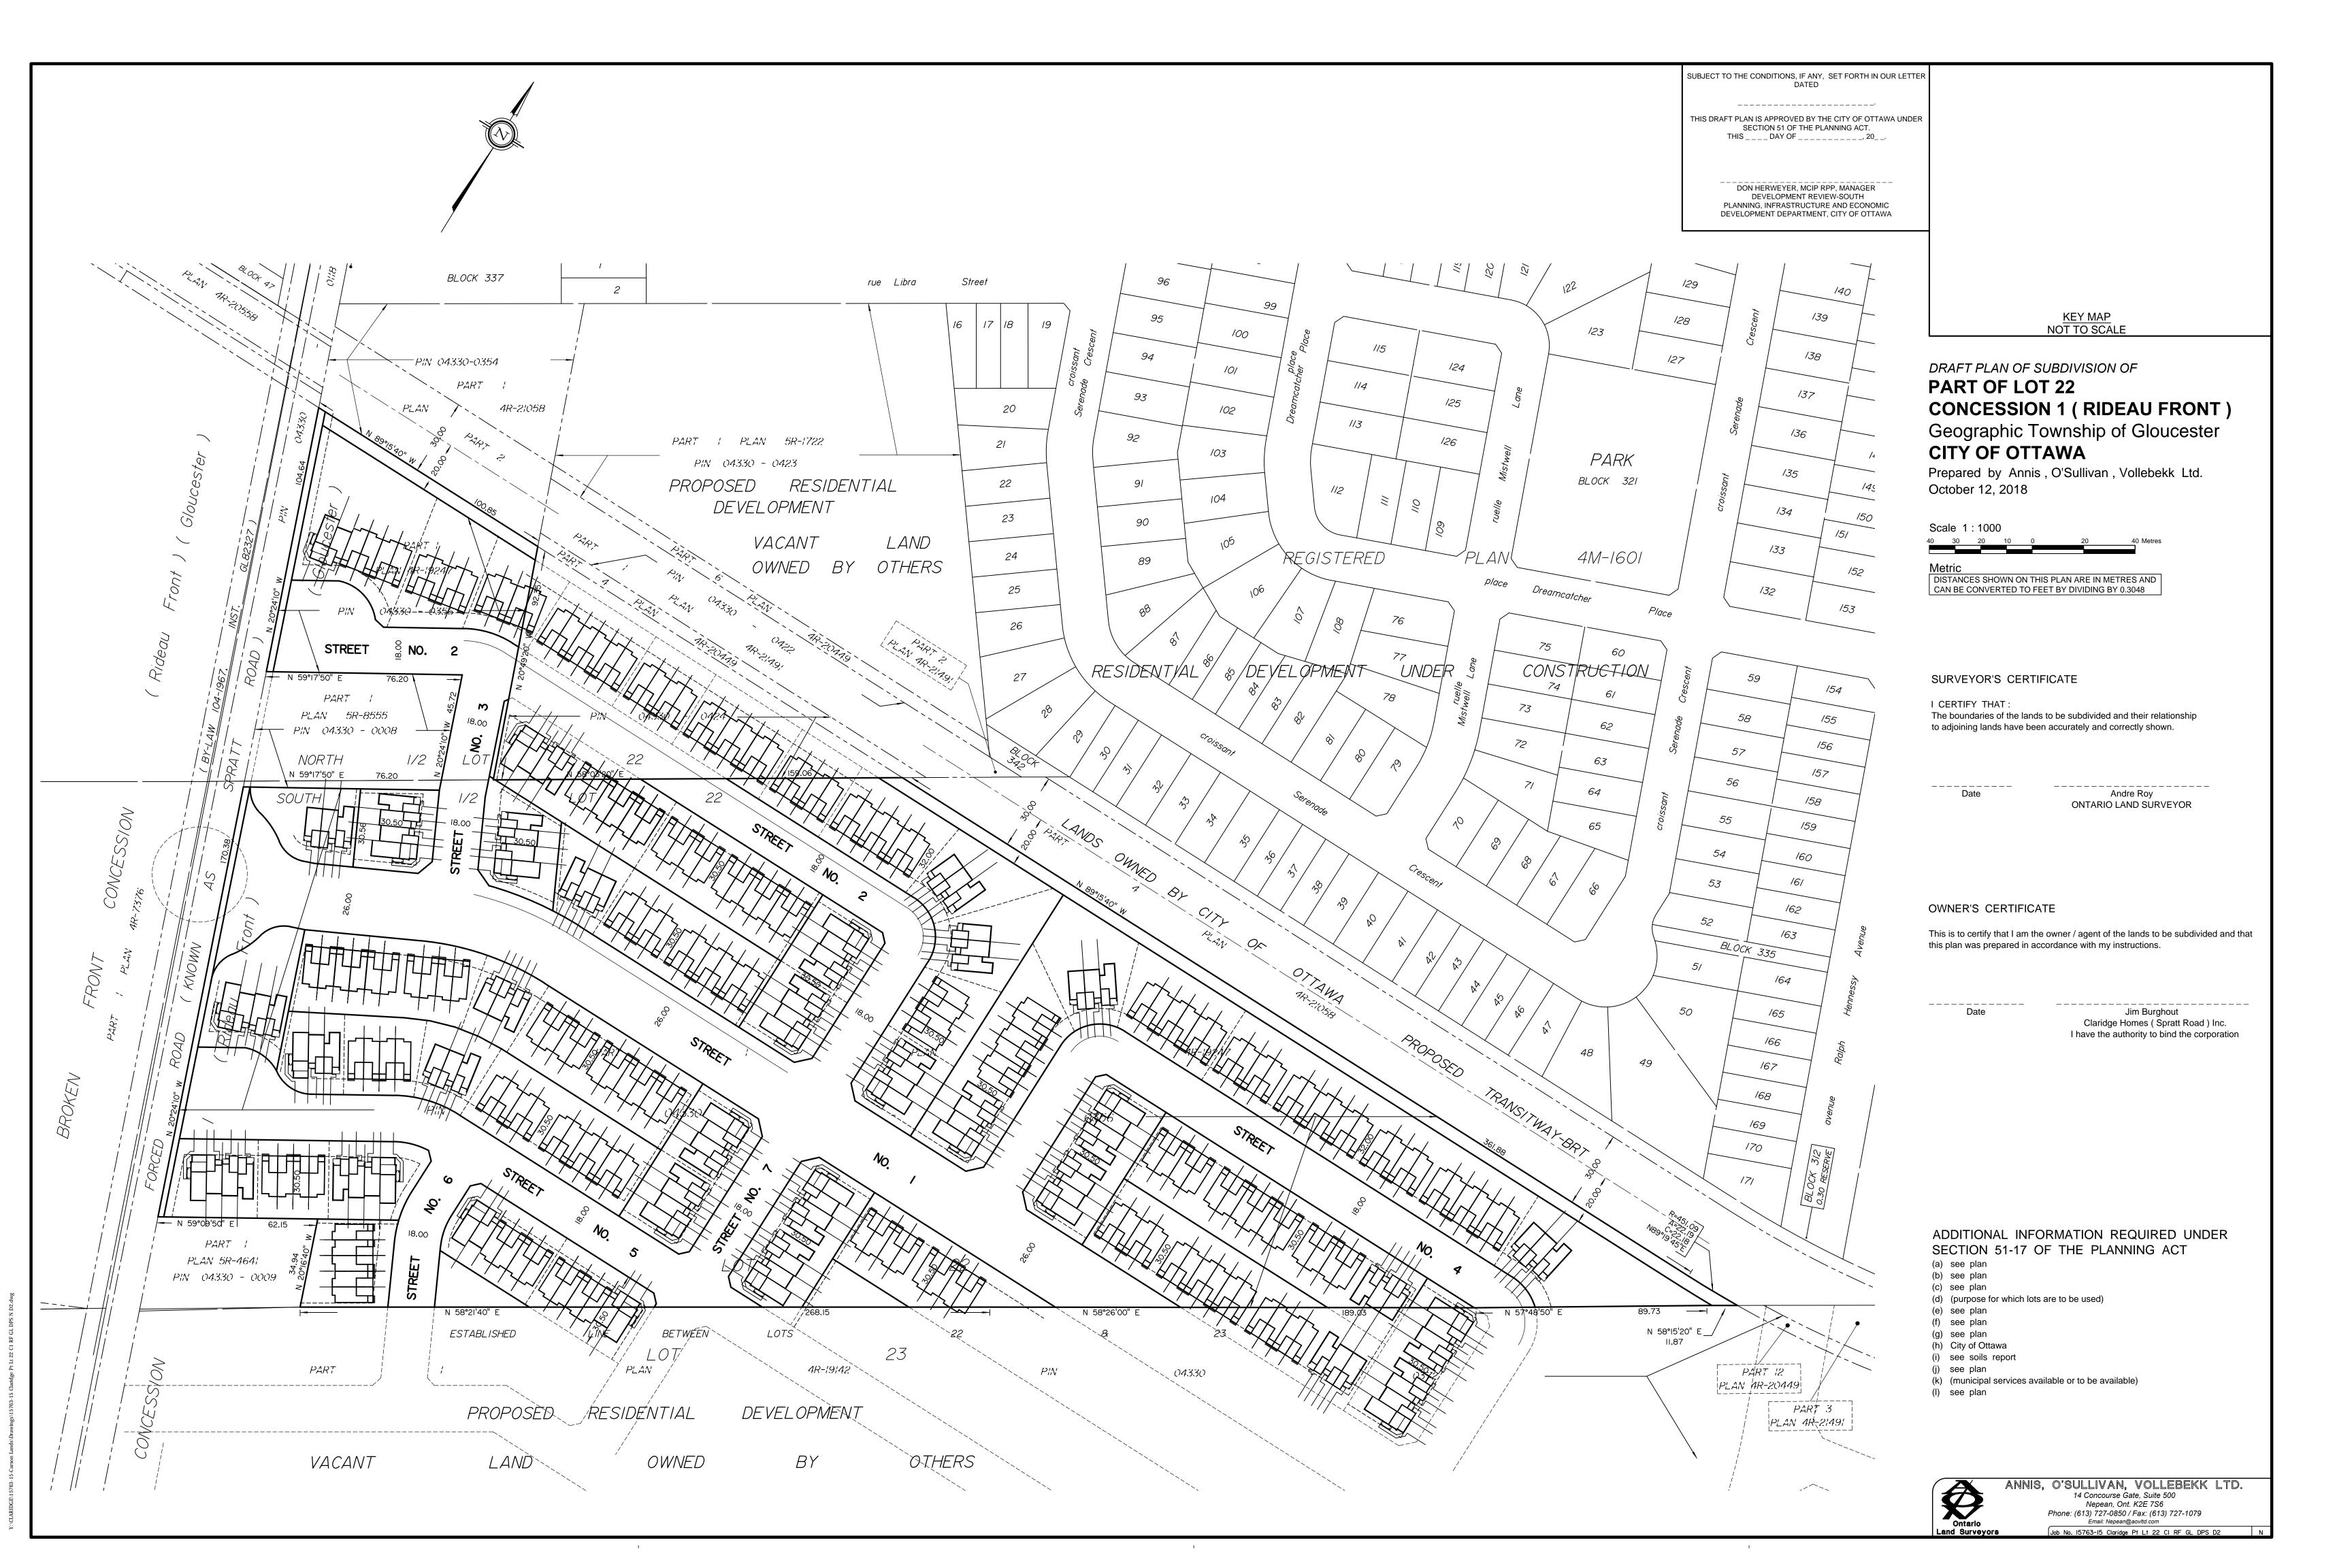



AERIAL PHOTOGRAPH 1976

patersongroup \_\_\_\_

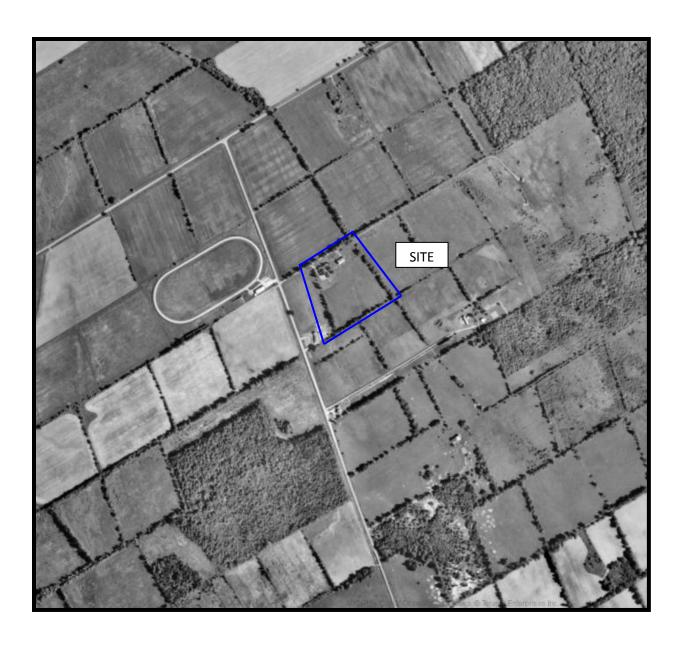

AERIAL PHOTOGRAPH 1991

patersongroup \_\_\_\_\_



AERIAL PHOTOGRAPH 2002



AERIAL PHOTOGRAPH 2011



AERIAL PHOTOGRAPH 2017



Photograph 1: View of the abandoned residential dwelling and detached garage, taken from Libra Street looking southwest.



Photograph 2: Central view of the subject site, looking southeast.

# **Site Photographs**

PE4509

4623 Spratt Road, Ottawa, ON

December 5, 2018



Photograph 3: Central view of the of the subject site, looking south.



Photograph 4: Southwest view of the subject site, taken from the south side of the garage, looking onto Spratt Road.

# **APPENDIX 2**

MECP FREEDOM OF INFORMATION

TSSA CORRESPONDENCE

MECP WELL RECORDS

HLUI RESPONSE

Ministry of the Environment, Conservation and Parks

Access and Privacy Office

40 St. Clair Avenue West

Toronto ON M4V 1M2

Tel: (416) 314-4075

Fax: (416) 314-4285

12th Floor

Ministère de l'Environnement, de la Protection de la nature et des Parcs

Bureau de l'accès à l'information et de la protection de la vie privée

12° étage

40, avenue St. Clair ouest Toronto ON M4V 1M2

Tél.: (416) 314-4075



January 4, 2019

Mandy Witteman Paterson Group Inc. 154 Colonnade Road Ottawa, ON K2E 7J5

Dear Mandy Witteman:

RE: Freedom of Information and Protection of Privacy Act Request Our File #: A-2018-08093, Your Reference #: PE4509

This letter is in response to your request made pursuant to the *Freedom of Information and Protection of Privacy Act* relating to 4623 Spratt Road, Ottawa.

After a thorough search of the Ministry's Ottawa District Office, Investigations and Enforcement Branch, Environmental Assessment and Permissions Branch, Environmental Monitoring and Reporting Branch, Sector Compliance Branch and Safe Drinking Water Branch, records were located in response to your request. It is my decision to provide full access to the attached information.

In accordance with Section 57 of the *Freedom of Information and Protection of Privacy Act*, detailed below are our charges:

<ul> <li>Search Time 1 hour @ \$30/hour</li> </ul>	\$30.00
Copying 13 pages @ \$0.20/page	\$2.60
Delivery	3.00
• Total	\$ 35.60
Deposit Received	- 30.00
BALANCE WAIVED (NOT REQUIRED)	\$ 5.60

You may request a review of my decision by contacting the Information and Privacy Commissioner/Ontario, 2 Bloor Street East, Suite 1400, Toronto, ON M4W 1A8 (800-387-0073 or 416-326-3333). Please note that there is a \$25.00 fee and you only have 30 days from receipt of this letter to request a review.

If you have any questions regarding this matter, please contact Daniel Gouthro at daniel.gouthro@ontario.ca.

Yours truly.

Janet Dadufalza

Manager, Access and Privacy

Attachments



Ministry of the Environment and Climate Change Ministère de l'Environnement et de l'Action en matière de changement climatique

# **ENVIRONMENTAL COMPLIANCE APPROVAL**

NUMBER 4644-AQBJRW Issue Date: August 22, 2017

Urbandale Corporation 2192 Arch Street Ottawa, Ontario K1G 2H5

Site Location:

Riverside South Phase 13

4623 and 4721 Spratt Road, 980 Earl Armstrong Road

Part of Lots 21, 22, and 23, Concession 1

City of Ottawa, Ontario

You have applied under section 20.2 of Part II.1 of the <u>Environmental Protection Act</u>, R.S.O. 1990, c. E. 19 (Environmental Protection Act) for approval of:

the establishment of stormwater management Works to serve the Riverside Phase 13 subdivision in the City of Ottawa, to attenuate post-development peak flows to allowable peak flows for a total catchment area of approximately 43 hectares, for all storm events up to and including the 100-year storm event, discharging to storm sewers, comprising of:

one (1) dry pond, located on Mount Nebo Way adjacent to the Thomas Gamble Municipal Drain serving a total drainage area of 15.23 hectares, having a maximum available storage volume of 420 cubic metres and a maximum depth of 0.65 metre, one (1) outlet structure, consisting of a 200 mm diameter storm outlet pipe equipped with an 83 mm diameter orifice, allowing a maximum discharge of 12.4 litres per second under the 100-year storm event to storm sewers on Mount Nebo Way;

# **Interim Works:**

one (1) temporary dry pond, located south of Ralph Hennessey Avenue serving a total drainage area of 19.6 hectares, having a maximum available storage volume of 4900 cubic metres and a maximum depth of 1.5 metre, one (1) outlet structure, consisting of a 300 mm diameter storm outlet pipe equipped with a 109 mm diameter orifice, allowing a maximum discharge of 40 litres per second under the 100-year storm event to storm sewers on Ralph Hennessey Avenue;

including erosion/sedimentation control measures during construction and all other controls and appurtenances essential for the proper operation of the aforementioned Works;

all in accordance with the submitted application and all supporting documents listed in Schedule "A",

- 3. Where there is a conflict between a provision of any document in the schedule referred to in this *Approval* and the conditions of this *Approval*, the conditions in this *Approval* shall take precedence, and where there is a conflict between the documents in the schedule, the document bearing the most recent date shall prevail.
- 4. Where there is a conflict between the documents listed in Schedule 'A' and the application, the application shall take precedence unless it is clear that the purpose of the document was to amend the application.
- 5. The conditions of this Approval are severable. If any condition of this Approval, or the application of any requirement of this Approval to any circumstance, is held invalid or unenforceable, the application of such condition to other circumstances and the remainder of this Approval shall not be affected thereby.

## 2. EXPIRY OF APPROVAL

- 1. This Approval will cease to apply to those parts of the Work which have not been constructed within five (5) years of the date of this Approval.
- 2. In the event that completion and commissioning of any portion of the Works is anticipated to be delayed beyond the specified expiry period, the Owner shall submit an application of extension to the expiry period, at least twelve (12) months prior to the end of the period. The application for extension shall include the reason(s) for the delay, whether there is any design change(s) and a review of whether the standards applicable at the time of Approval of the Works are still applicable at the time of request for extension, to ensure the ongoing protection of the environment.
- 3. This Approval to the Interim Works shall expire and become null and void on August 30, 2022.

# 3. CHANGE OF OWNER

- 1. The Owner shall notify the District Manager and the Director, in writing, of any of the following changes within thirty (30) days of the change occurring:
  - a. change of Owner;
  - b. change of address of the Owner;
  - c. change of partners where the *Owner* is or at any time becomes a partnership, and a copy of the most recent declaration filed under the <u>Business Names Act</u>, R.S.O. 1990, c.B17 shall be included in the notification to the *District Manager*; or
  - d. change of name of the corporation where the Owner is or at any time becomes a corporation, and a copy of the most current information filed under the Corporations
     Information Act, R.S.O. 1990, c. C39 shall be included in the notification to the District Manager.
- 2. In the event of any change in ownership of the *Works*, other than a change to a successor municipality, the *Owner* shall notify in writing the succeeding owner of the existence of this *Approval*, and a copy of such notice shall be forwarded to the *District Manager* and the *Director*.

recording any follow-up actions taken.

7. The Owner shall maintain the operations manual current and retain a copy at the location of the Works for the operational life of the Works. Upon request, the Owner shall make the manual available to Ministry staff.

# 5. TEMPORARY EROSION AND SEDIMENT CONTROL

- The Owner shall install and maintain temporary sediment and erosion control measures
  during construction and conduct inspections once every two (2) weeks and after each
  significant storm event (a significant storm event is defined as a minimum of 25 mm of rain
  in any 24 hours period). The inspections and maintenance of the temporary sediment and
  erosion control measures shall continue until they are no longer required and at which time
  they shall be removed and all disturbed areas reinstated properly.
- 2. The Owner shall maintain records of inspections and maintenance which shall be made available for inspection by the Ministry, upon request. The record shall include the name of the inspector, date of inspection, and the remedial measures, if any, undertaken to maintain the temporary sediment and erosion control measures.

## 6. REPORTING

- 1. One (1) week prior to the start-up of the operation of the *Works*, the *Owner* shall notify the *District Manager* (in writing) of the pending start-up date.
- 2. The Owner shall, upon request, make all manuals, plans, records, data, procedures and supporting documentation available to Ministry staff.
- 3. The Owner shall prepare and submit a performance report to the District Manager on an annual basis, within ninety (90) days following the end of the period being reported upon. The first such report shall cover the first annual period following the commencement of operation of the Works and subsequent reports shall be submitted to cover successive annual periods following thereafter. The reports shall contain, but shall not be limited to, the following information:
  - a. a description of any operating problems encountered and corrective actions taken;
  - b. a summary of all maintenance carried out on any major structure, equipment, apparatus, mechanism or thing forming part of the *Works*, including an estimate of the quantity of any materials removed from the *Works*;
  - a summary of any complaints received during the reporting period and any steps taken to address the complaints;
  - d. a summary of all spill or abnormal discharge events; and
  - e. any other information the District Manager requires from time to time.

## 7. SOURCE WATER PROTECTION

 The Owner shall ensure, if applicable, that the design, construction and operation of the Works conforms to any Significant Threat Policies in any Source Protection Plan that applies to the location of the Works. The reasons for the imposition of these terms and conditions are as follows:

- Condition 1 is imposed to ensure that the Works are constructed and operated in the manner in
  which they were described and upon which approval was granted. This condition is also
  included to emphasize the precedence of conditions in the Approval and the practice that the
  Approval is based on the most current document, if several conflicting documents are submitted
  for review.
- 2. Condition 2 is included to ensure that, when the *Works* are constructed, the *Works* will meet the standards that apply at the time of construction to ensure the ongoing protection of the environment.
- 3. Condition 3 is included to ensure that the *Ministry* records are kept accurate and current with respect to approved *Works* and to ensure that subsequent owners of the *Works* are made aware of the *Approval* and continue to operate the *Works* in compliance with it.
- 4. Condition 4 is included as regular inspection and necessary removal of sediment and excessive decaying vegetation from the *Works* are required to mitigate the impact of sediment, debris and/or decaying vegetation on the treatment capacity of the *Works*. The Condition also ensures that adequate storage is maintained in the *Works* at all times as required by the design. Furthermore, this Condition is included to ensure that the *Works* are operated and maintained to function as designed.
- 5. Condition 5 is included as installation, regular inspection and maintenance of the temporary sediment and erosion control measures is required to mitigate the impact on the downstream receiving watercourse during construction until they are no longer required.
- 6. Condition 6 is included to provide a performance record for future references, to ensure that the *Ministry* is made aware of problems as they arise, and to provide a compliance record for all the terms and conditions outlined in this *Approval*, so that the *Ministry* can work with the *Owner* in resolving any problems in a timely manner.
- 7. Condition 7 is included to ensure that the Works conform to the policies of the local Source Water Protection Plan.

In accordance with Section 139 of the Environmental Protection Act, you may by written Notice served upon me and the Environmental Review Tribunal within 15 days after receipt of this Notice, require a hearing by the Tribunal. Section 142 of the Environmental Protection Act provides that the Notice requiring the hearing shall state:

- a. The portions of the environmental compliance approval or each term or condition in the environmental compliance approval in respect of which the hearing is required, and;
- b. The grounds on which you intend to rely at the hearing in relation to each portion appealed.

The Notice should also include:

- 1. The name of the appellant;
- 2. The address of the appellant;
- 3. The environmental compliance approval number;



# Ministry of the Environment and Climate Change Ministère de l'Environnement et de l'Action en matière de changement climatique

# **ENVIRONMENTAL COMPLIANCE APPROVAL**

NUMBER 9695-APNR4V Issue Date: August 8, 2017

Urbandale Corporation 2193 Arch Street Ottawa, Ontario K1G 2H5

Site Location:

Riverside Phase 13

Part of Lots 21, 22, and 23, Concession 1, Gloucester

City of Ottawa, Ontario

You have applied under section 20.2 of Part II.1 of the <u>Environmental Protection Act</u>, R.S.O. 1990, c. E. 19 (Environmental Protection Act) for approval of:

sanitary and storm sewers to be constructed in the City of Ottawa, as follows:

- sanitary sewers on Libra Street (from Station 0+000.6 to Station 0+176.6), Serenade Crescent (from Station 0+001.5 to Station 0+678.2), Mistwell Lane (from Station 0+009.0 to Station 0+250.5), Dreamcatcher Place (from Station 0+001.0 to Station 0+187.5), Ralph Hennessey Avenue (from 0+024.5 to Station 0+406.1), Octave Grove (from Station 0+027.7 to Station 0+184.0), Rowers Way (from Station 0+009.0 to Station 0+587.9), Quartet Avenue (from Station 0+029.4 to Station 0+266.0), Mount Nebo Way (from Station 0+105.0 to Station 0+738.6), Memorial Grove (from Station 0+050.0 to Station 0+544.2), and Pathfinder Way (from 0+009.0 to Station 0+240.0), discharging to existing sanitary sewers located within the Riverside Phase 8 Subdivision; and
- storm sewers on Libra Street (from Station 0+000.6 to Station 0+174.6), Serenade Crescent (from 0+001.8 to Station 0+664.6), Mistwell Lane (from Station 0+007.5 to Station 0+252.2), Dreamcatcher Place (from 0+001.3 to Station 0+316.3), Ralph Hennessey Avenue (from Station 0+024.5 to Station 0+405.5), Octave Grove (from Station 0+031.3 to Station 0+182.4), Rowers Way (from Station 0+007.5 to Station 0+589.1), Quartet Avenue (from Station 0+011.5 to Station 0+264.5), Mount Nebo Way (from 0+063.9 to Station 0+740.1), Memorial Grove (from Station 0+048.5 to Station 0+542.7), and Pathfinder Way (from Station 0+011.8 to Station 0+178.5), discharging to existing storm sewers located within the Riverside Phase 8 Subdivision;

all in accordance with the submitted application and supporting documents listed in Schedule 'A' forming part of this Approval.

For the purpose of this environmental compliance approval, the following definitions apply:

- 1. "Approval" means this entire document and any schedules attached to it, and the application;
- 2. "Director" means a person appointed by the Minister pursuant to section 5 of the EPA for the purposes

# 2. EXPIRY OF APPROVAL

- 1. This Approval will cease to apply to those parts of the Work which have not been constructed within five (5) years of the date of this Approval.
- 2. In the event that completion and commissioning of any portion of the Works is anticipated to be delayed beyond the specified expiry period, the Owner shall submit an application of extension to the expiry period, at least twelve (12) months prior to the end of the period. The application for extension shall include the reason(s) for the delay, whether there is any design change(s) and a review of whether the standards applicable at the time of Approval of the Works are still applicable at the time of request for extension, to ensure the ongoing protection of the environment.

# 3. CHANGE OF OWNER

- 1. The Owner shall notify the District Manager and the Director, in writing, of any of the following changes within thirty (30) days of the change occurring:
  - a. change of Owner;
  - b. change of address of the Owner;
  - c. change of partners where the Owner is or at any time becomes a partnership, and a copy of the most recent declaration filed under the <u>Business Names Act</u>, R.S.O. 1990, c.B17 shall be included in the notification to the District Manager; or
  - d. change of name of the corporation where the Owner is or at any time becomes a corporation, and
    a copy of the most current information filed under the <u>Corporations Information Act</u>, R.S.O.
    1990, c. C39 shall be included in the notification to the District Manager.
- 2. In the event of any change in ownership of the Works, other than a change to a successor municipality, the Owner shall notify in writing the succeeding owner of the existence of this Approval, and a copy of such notice shall be forwarded to the District Manager and the Director.
- 3. The Owner shall ensure that all communications made pursuant to this condition refer to the number at the top of this Approval.
- 4. Notwithstanding any other requirements in this Approval, upon transfer of the ownership or assumption of the Works to a municipality if applicable, any reference to the District Manager shall be replaced with the Water Supervisor.

# 4. OPERATION AND MAINTENANCE

If applicable, any proposed storm sewers or other stormwater conveyance in this Approval can be
constructed but not operated until the proposed stormwater management facilities in this Approval
or any other Approval that are designed to service the storm sewers or other stormwater conveyance
are in operation.

The Secretary\*
Environmental Review Tribunal
655 Bay Street, Suite 1500
Toronto, Ontario
M5G 1E5

AND

The Director appointed for the purposes of Part II.1 of the Environmental Protection Act Ministry of the Environment and Chimate Change 135 St. Clair Avenue West, 1st Floor Toronto, Ontario M4V 1P5

\* Further information on the Environmental Review Tribunal's requirements for an appeal can be obtained directly from the Tribunal at: Tel: (416) 212-6349, Fax: (416) 326-5370 or www.ert.gov.on.ca

The above noted activity is approved under s.20.3 of Part II.1 of the Environmental Protection Act.

DATED AT TORONTO this 8th day of August, 2017

Christina Labarge, P.Eng.

Director

appointed for the purposes of Part II.1 of the Environmental Protection Act

C. Labaye

DN/

c: District Manager, MOECC Ottawa District Office
 Linda Carkner, Program Manager, ROW Unit, City of Ottawa
 M. Rick O'Connor, City Clerk, City of Ottawa
 Jeff Shillington, P. Eng., Project Manager, Development Review, City of Ottawa (File No. D07-16-13-0034)
 Karin Smadella, P. Eng., Stantec Consulting Ltd.

# **Mandy Witteman**

From: Public Information Services < publicinformationservices@tssa.org>

Sent: December-05-18 2:31 PM

To: Mandy Witteman

**Subject:** RE: Search Records Request (PE4509)

Good afternoon Mandy,

Thank you for your request for confirmation of public information.

We confirm that there are no records in our database of any fuel storage tanks at the subject addresses.

For a further search in our archives please complete our release of public information form found at <a href="https://www.tssa.org/en/about-tssa/release-of-public-information.aspx?">https://www.tssa.org/en/about-tssa/release-of-public-information.aspx?</a> mid =392 and email the completed form to <a href="mailto:publicinformationservices@tssa.org">publicinformationservices@tssa.org</a> or through mail along with a fee of \$56.50 (including HST) per location. The fee is payable with credit card (Visa or MasterCard) or with a Cheque made payable to TSSA.

Although TSSA believes the information provided pursuant to your request is accurate, please note that TSSA does not warrant this information in any way whatsoever.

Kind regards,

Sarah



# Sarah Quibell | Public Information Agent

Facilities 345 Carlingview Drive Toronto, Ontario M9W 6N9

Tel: +1-877-682-8772 | Fax: +1-416-231-6183 | E-Mail: squibell@tssa.org

www.tssa.org







From: Mandy Witteman < MWitteman@Patersongroup.ca>

Sent: December 5, 2018 11:38 AM

To: Public Information Services <publicinformationservices@tssa.org>

**Subject:** Search Records Request (PE4509)

Good Morning,

Could you please complete a search of your records for underground/aboveground storage tanks, historical spills or other incidents/infractions for the following addresses in Ottawa, ON:

Spratt Rd: 4623, 4661, 4624, 4725, 4729,

Cambie St: 100,

Thank you.

Best Regards,

Mandy Witteman

# patersongroup

solution oriented engineering

154 Colonnade Road South Ottawa, Ontario, K2E 7J5 Tel: (613) 226-7381 Ext. 339

Fax: (613) 226-6344

Email: mwitteman@patersongroup.ca

This electronic message and any attached documents are intended only for the named recipients. This communication from the Technical Standards and Safety Authority may contain information that is privileged, confidential or otherwise protected from disclosure and it must not be disclosed, copied, forwarded or distributed without authorization. If you have received this message in error, please notify the sender immediately and delete the original message.



File Number: D06-03-18-0091

December 20, 2018

Paterson Group 154 Colonnade Drive Ottawa, ON K2E 7J5

Sent via email [mwitteman@patersongroup.ca]

Dear Paterson Group,

Re: Information Request 4623 Spratt Road, Ottawa, Ontario ("Subject Property")

# **Internal Department Circulation**

The Planning, Infrastructure and Economic Development Department has the following information in response to your request for information regarding the Subject Property:

• No information was returned on the Subject Property from Departmental circulation.

# Search of Historical Land Use Inventory

This acknowledges receipt of the signed Disclaimer regarding your request for information from the City's Historical Land Use Inventory (HLUI 2005) database for the Subject Property.

A search of the HLUI database revealed the following information:

There are no activities associated with the Subject Property.

The HLUI database was also searched for activity associated with properties located within 50m of the Subject Property. The search revealed the following:

 There are no activities associated with the properties located within 50m of the Subject Property.

Additional information may be obtained by contacting:

Shaping our future together
Ensemble, formons notre avenir

City of Ottawa Planning, Infrastructure and Economic Development Department

110 Laurier Avenue West, 4th Floor Ottawa, ON K1P 1J1 Tel: (613) 580-2424 ext. 14743 Fax: (613) 560-6006 www.ottawa.ca Ville d'Ottawa Services de la planification, de l'infrastructure et du développement économique

110, avenue Laurier Ouest, 4e étage Ottawa (Ontario) K1P 1J1 Tél.: (613) 580-2424 ext. 14743 Téléc: (613) 560-6006 www.ottawa.ca

# **Ontario's Environmental Registry**

The Environmental Registry found at <a href="http://www.ebr.gov.on.ca/ERS-WEB-External/">http://www.ebr.gov.on.ca/ERS-WEB-External/</a> contains "public notices" about environmental matters being proposed by all government ministries covered by the Environmental Bill of Rights. The public notices may contain information about proposed new laws, regulations, policies and programs or about proposals to change or eliminate existing ones. By using keys words i.e. name of proponent/owner and the address one can ascertain if there is any information on the proponent and address under the following categories: Ministry, keywords, notice types, Notice Status, Acts, Instruments and published date (all years).

# **The Ontario Land Registry Office**

Registration of real property is recorded in the Ontario Land Registry Office through the Land Titles Act or the Registry Act. Documents relating to title and other agreements that may affect your property are available to the public for a fee. It is recommended that a property search at the Land Registry Office be included in any investigation as to the historic use of your property. The City of Ottawa cannot comment on any documents to which it is not a party.

Court House 161 Elgin Street 4th Floor Ottawa ON K2P 2K1 Tel: (613) 239-1230

Fax: (613) 239-1422

Please note, as per the HLUI Disclaimer, that the information contained in the HLUI database has been compiled from publicly available records and other sources of information. The HLUI may contain erroneous information given that the records used as sources of information may be flawed. For instance, changes in municipal addresses over time may introduce error. Accordingly, all information from the HLUI database is provided on an "as is" basis with no representation or warranty by the City with respect to the information's accuracy or exhaustiveness in responding to the request.

Furthermore, the HLUI database and the results of this search in no way confirm the presence or absence of contamination or pollution of any kind. This information is provided on the assumption that it will not be relied upon by any person for any purpose whatsoever. The City of Ottawa denies all liability to any persons attempting to rely on any information provided from the HLUI database.

Please note that in responding to your request, the City of Ottawa does not guarantee or comment on the environmental condition of the Subject Property. You may wish to contact the Ontario Ministry of Environment and Climate Change for additional information.

If you have any further questions or comments, please contact Colette Gorni at 613-580-2424 ext. 14743 or HLUI@ottawa.ca

Sincerely,

Colette Gorni


Per:

Michael Boughton, MCIP, RPP Senior Planner Development Review East Planning Services Planning, Infrastructure and Economic Development Department

MB/CG

Attach: 1

cc: File no. D06-03-18-0091

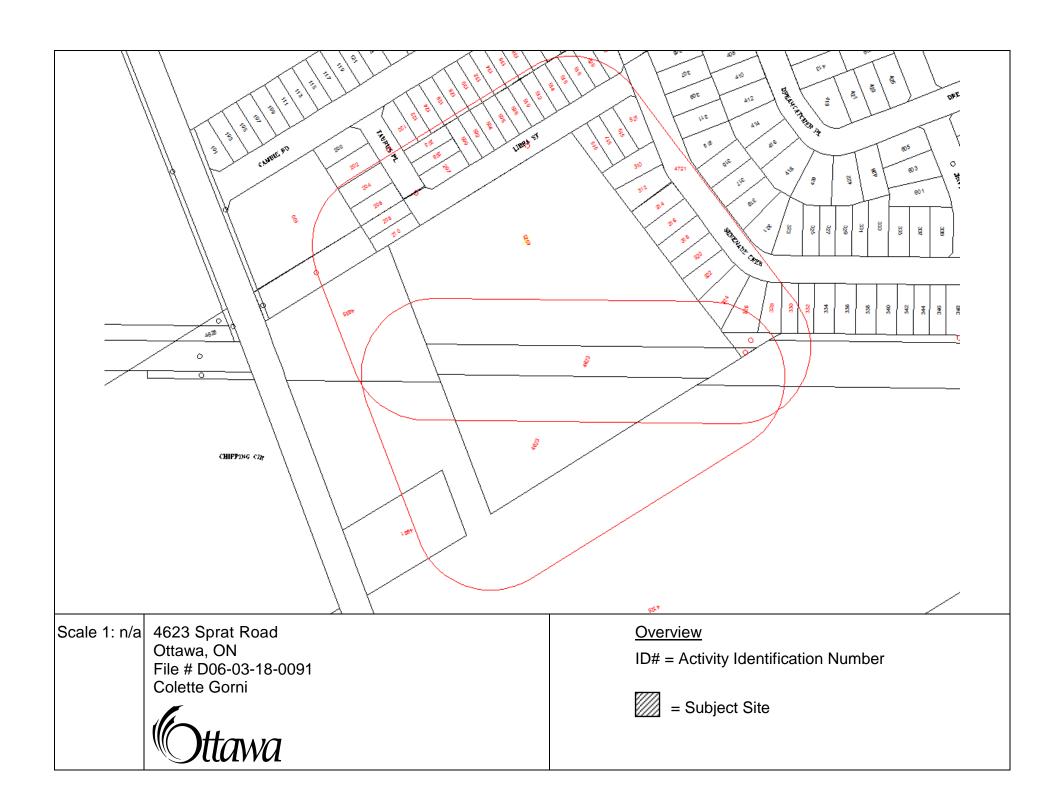

3	÷ gara	The O	ntario Water	Resources Ac	t -	<b>\</b> D		716	/ .
ひ	· WA	TER Y	WEL		ECC	JK	con	319	56
ntario	1. PRINT ONLY IN SP	PACES PROVIDED		11514951		15.00	2		22 23 24 OT 25-27
NTY OR DISTRICT	2. CHECK 🔼 CORRE	TOWNSHIP, BOROUGH, CI	TY, TOWN, VILLAGE		CON., BLC	CK. TRACT. SU	JRVEY, ETC.		022
		Clausester				_ <del>/\_</del> -f	DATE CO	71111 221	8-53 YR. <b>75</b>
		#_	1 Manotic	k, Untario	RC. BA	ASIN CODE		8, 1977	300
1514951	18 44618	84 5012	823	4 308	4 .5 (SEE INST	26	JUN 2	B	
	MOST		ATERIALS			DESCRIPTIO	N	DEPTH FROM	- FEET TO
NERAL COLOUR	COMMON MATERIAL	boulders		pack	ed			0	В
brown	sand clay	Doubles		stic	ky			8	28
grey black	limestone			medi	lum hard	<u> </u>		28	105
white	sandstone	odd limes	tone stres	ık haro	<u>i</u>			105	140 223
white	sandstone			hard	<u> </u>			140	223
	0.33								
	·					00211	0119 11		
31 000	861281379 602	<u> 48210586   101</u>	10.5815	0/40//8	<i> 15  74</i>   10 		<b>81/17</b>		1 1 2
32	14 15	51 CASING	& OPEN HOL	E RECORD	SIZE(S	OF OPENING	31-33	DIAMETER 34-38	LENGTH 39-40
WATER FOUND	ATER RECORD	DIAM MATERIA	WALL	DEPTH - FEET	]   w	RIAL AND TYPE		DEPTH TO TO OF SCREEN	FEET
_	FRESH 3 SULPHUR 14	INCHES  1000 1 STEEL  2 GALVAN	12 100	D 0030"	S				FEET
15-18 1	FRESH 3 SULPHUR 19 SALTY 4 MINERAL	CONCRE	TE	30 223	61	PLUC			EMENT GROUT
20-23 1	FRESH 3 SULPHUR 24	17-18 1 STEEL 2 GALVAN			FROM	10	MATERIA	AL AND TYPE LEAD	PACKER, ETC.)
25-28	SALTY 4 MINERAL  FRESH 3 SULPHUR	06 3 □ CONCRE 4 X OPEN H		0223		.21 22	-25		
30-33	SALTY 4 MINERAL .	2 GALVAN 3 CONCRE	ETE		26	.29 30	-33 80		
PUMPING TEST	SALTY 4 MINERAL	J ■ □ OPEN H	N OF PUMPING		L	OCATIO	ON OF V	VELL 461	2
71 1 <b>1</b> PUMI	p 2   BAILER   OO		HOURS M		DIAGRAM BEL	OW SHOW D	ISTANCES OF	WELL FROM ROA	DANP
STATIC LEVEL	WATER LEVEL 25 END OF WATER PUMPING 9-21 22-24 15 MINUT	R LEVELS DURING	PUMPING PECOVERY INUTES   60 MINUTE		LINE. INC	DICATE NORI	H BY ARROW.	*	***
۳ /) 2D		26-28 29-31 DEET 100 1	100 FEET	<del></del>				7	<b>A</b> <
IF FLOWING. GIVE RATE  RECOMMENDED	38-41 PUMP INTA		AT END OF TEST	42 DY	Щ	9	OSUM OSUM	・パン・	<b>→</b>
RECOMMENDED	PUMP	NDED 43-45 RECOMP	16	6-49 GPM		1	05~~	ile	ગ્રી
50-53		125 FEET RATE SPECIFIC CAPACITY							· 3
FINAL	1 WATER SUPPLY 2 OBSERVATION	WELL 6 ABANDONE	D, INSUFFICIENT SUPP D. POOR QUALITY	PLY	,				-
STATUS OF WEL	TEST HOLE	7 UNFINISHE	D		الر د د			三人	$\leftarrow$
	55-56 1 DOMESTIC	5 COMMERCIAL 6 MUNICIPAL	,		<u> </u>			()Com	50
WATER USE	3   IRRIGATION 4   INDUSTRIAL   OTHER	7 PUBLIC SUPPLY  COOLING OR A  9	( IR CONDITIONING □ NOT USED		<u> </u>			Dake !	<b>E</b>
	57 1 CABLE TOOL	6 [] B						•	
METHO OF	DD 2   ROTARY (CON	ERSE) 4 🔲 JI	ETTING						11
DRILLIN	NG 4 ROTARY (AIR	•		DRILLERS RE		CONTRACTOR	59.62 047	E RECEIVAD C T	O → №3-60
	Capital Water	Supply Ltd.	LICENCE NUMBER	SOURCE	1 58	155			0 75"
ADDRESS		_ ,			INSPECTION		NSPECTOR	MP/R.	Doyle
NAME OF E	Box 490 Stitts	VIIIe, Unitario	LICENCE NUMBER	R REMARKS					Р
SIGNATURE	M. Hamilton	Ó BMISSIO				Æ,	· (	788,88	WI
Ma	thexauc	NO TOUR		<u>75</u> 0			•		PRM 7 MOE 07
MINIS	STRY OF THE EN	IVIRONMENT CO	)PT						

FORM 7 MOE 07-091

-y -	The second of th	N. Coppy	and the second s				A	
	Ministry		VA/AT			ter Resourc	REC	ORD
	of the Environment	6	WAT			AUNICIP	CON.	
Ontario	1. PRINT G	NLY IN SPACES PROVIDED  CORRECT FOR WHERE APPLICA	1 11 1	15204	·	10 14	15	22 23 24
COUNTY OR I			H. CITY, TOWN, VILLAGE		CON., BLO	CK. TRACT, SURVEY	ETC	22
		<u> </u>	<u>cester</u>		2 0-	L	DAY MO_	11 YR
		i.	RC.	ELEVATION I	de ans	SIN CODE	11, 111	, , , , , , , , , , , , , , , , , , ,
21	M 10 12	LOG OF OVERBUR	DEN AND REDRO	CV MATERIAL	30 31	RUCTIONS)		47
	MOST	OTHE	R MATERIALS	CK MATERIA		DESCRIPTION	FRO	DEPTH - FEET
GENERAL	COMMON MATERI	A					0	36
an	ev limest	tones					3	6 115
<del>_ J''</del>	7 mezi							
						1.1.3	1 11 11	1 1 1 1
31						<u> </u>		
32	WATER RECORD	51 CASIN	IG & OPEN HOLE	RECORD	SIZE(S) C	DF OPENING	SI-33 DIAMETER S	75 80 34-38 LENGTH 39-40
WATER FO	DUND KIND OF WATER	INSIDE DIAM. MATEI	WALL	DEPTH - FEET	C MATERIA	L AND TYPE	DEPTH TO STREET	O TOP 41-44 30
111	10-13 1 M FRESH 3 - SULF	HUR 10-11 1 1 STEE	1 1	13-16	Š			FEET
	15-18 1 FRESH 3 SULF 2 SALTY 4 MINI	ERAL OPEN	HOLE / K	o 41	61 DEPTH SET	PLUGGIN	G & SEALING	(CEMENT GROUT.
	20-23 1  FRESH 3  SULI	17-18   STEE PHUR 24   2   GALV ERAL   3   CON-	ANIZED		FROM 10-13	TO 14-17	MATERIAL AND TITE	LEAD PACKER, ETC.)
}	25-28 1   FRESH 3   SUL	ERAL SIEE	L 26	27-30	18-21	22-25		
	30-33 1 FRESH 3 SUL 2 SALTY 4 MIN	Z ☐ GALV	CRETE		26-29	30-33 80		
			TION OF PUMPING	18156	, LO	CATION	OF WELL	
	PUMP 2 BAILER  STATIC WATER LEVEL 25	GPM	15-16 307-18 HOURS MINS	IN D	IAGRAM BELOV	SHOW DISTANC	ES OF WELL FROM	ROAD AND
TEST	LEVEL PUMPING	15 MINUTES   30 MINUTES   4	2 RECOVERY 5 MINUTES 60 MINUTES 32-34 35-37	1				10
1 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5	FLOWING. 38-41 P	10 FEET 90 FEET	FEET FEET ER AT END OF TEST 42			10	0	<b>N</b> /
AP CIAI	E RATE GPM.	FEET	CLEAR 2 CLOUDY			1	<b>&gt;</b> '	<i>J</i> /
1 [	SHALLOW DEEP S	ECOMMENDED 43.45 RECCUMP ETTING FEET RATE	PING	11			.10.	•
\$0-53			IED, INSUFFICIENT SUPPLY	J   		11.9 m	.110	
	FINAL  TATUS    WATER   DESCRIPTION   TEST	VATION WELL 6 ABANDON	ED. POOR QUALITY			ساليك		
OI	FWELL 4 RECHA			<del>-</del>		9		
V	NATER 2 STOCK	6 ☐ MUNICIPAL TION 7 ☐ PUBLIC SUPP						
	USE INDUS		NOT USED			6		
М	1 —	Y (CONVENTIONAL) 7	BORING DIAMOND		d	3		
рі	OF RILLING  3	Y (AIR)	JETTING Driving	DRILLERS REMA	ARKS:	1.		
NA	ME OF WELL CONTRACTOR		LICENCE NUMBER			NTRACTOR 59-6	2 DATE RECEIVED	06
۳	Air-Rock	DillingloL	td 1119	SOURCE DATE OF INS	SPECTION	INSPECTOR	200%	200
	RE OF DRILLER OR BORER	sper, Ont	LICENCE NUMBER	M REMARKS				· ·
CONTRAC	Wallace	Desaulaier	5 1/19 ON DATE	OFFICE				
	Mellace	and JAY	10 no 2 yrs	<b>4</b> 6			EODM	NO. 0506—4—77 FORM
MIN	STRY OF THE ENVI	RONMENT COPY					ronm	



# The Ontario Water Resources Act

# WATER WELL RECORD

FORM NO. 0506-4-77 FORM

Ontario		SPACES PROVIDED	1521467	MUNICIP CON		
COUNTY OR DISTRICT	2. CHECK ⊠ COR	TOWNSHIP, BOROUGH, CITY, TOWN, VILLAGE		BLOCK, TRACT, SURVEY, ETC.		22 23 24 LOT 25-27
Ottawa Ca	mloton	Clausester	1	R F		22
		archard Drive		4.	омреетер 6 мо6	48-53 YF <mark>87</mark>
		6 R	Fitzroy Ont k	BASIN CODE	, MO U	1V
Ι Σ	10 12	17 18 24 2	5 26 30	31	<u> </u>	47
	L Most	OG OF OVERBURDEN AND BEDR	OCK MATERIALS (SEE )	NSTRUCTIONS)		
GENERAL COLOUR	COMMON MATERIAL	OTHER MATERIALS	GENER	AL DESCRIPTION	FROM	· FEET
Brown	SandyClay				0	6
Gray	SandyClay	Boulders			-6	23
Gray	Sandstone		Hard		23	50
31						
32	14 15	32	43	54		75 80
WATER FOUND	FER RECORD	51 CASING & OPEN HOLE	RECORD  DEPTH - FEET  DEPTH - FEET	OF OPENING 31-33 DIA		ENGTH 39-40
40 10-13	FRESH 3 SULPHUR 14	DIAM. MATERIAL THICKNESS FI	ROM TO MATER	RIAL AND TYPE	DEPTH TO TOP OF SCREEN	41-44 30
70 20	SALTY 4   MINERAL		0 25 13-16			FEET
2 0	FRESH 3 SULPHUR '7	6 4 5 OPEN HOLE 2	5 50 61 DEPTH S	PLUGGING & SEA		
	FRESH 3 SULPHUR 24	2 GALVANIZED 1 CONCRETE	FROM	TO MATERIAL A	ND TYPE LEAD PAGE	CKER, ETC )
	FRESH 3 SULPHUR 29 SALTY 4 MINERAL	4  OPEN HOLE  24-25	27-30 18-		·	
30-33 ; 🗆	FRESH 3 SULPHUR 34 10	Z GALVANIZED  3 GCONCRETE	26-2	29 30-33 80		·
PUMPING TEST MET	SALTY 4 MINERAL  HOD 10 PUMPING RATE	4 OPEN HOLE			-444	-
71 : <b>X</b> PUMP		10 GPM 15-16 17-18 MINS	L	OCATION OF WE	LL	
STATIC LEVEL	WATER LEVEL 25 END OF WATER L PUMPING	EVELS DURING 1 PUMPING 2 D RECOVERY		W SHOW DISTANCES OF WEL ICATE NORTH BY ARROW.	L FROM ROAD A	<b>"</b>
LS3 19-21	22-24 15 MINUTES 26-28	30 MINUTES 45 MINUTES 60 MINUTES 32-34 35-37			1	$\supset$
	15 FEET 15 FEE 38-41 PUMP INTAKE		<u> 50</u>	ratt Kd.		
IF FLOWING. GIVE RATE  RECOMMENDED PUM	GPM  IP TYPE RECOMMENDED	15 FEET 1 CLEAR 2 CLOUDY 43-45 RECOMMENDED 46-49		8 miles		
SHALLOW	PUMP	43-45 RECOMMENDED 46-49 PUMPING GPM				
\$0-53			2	60 7	R SH	
FINAL STATUS	WATER SUPPLY Description well	5 ABANDONED, INSUFFICIENT SUPPLY L 5 ABANDONED, POOR QUALITY	4	<u> </u>		
OF WELL	3 TEST HOLE 4 RECHARGE WELL	7 UNFINISHED	4			Í
SS-	2 STOCK	5 COMMERCIAL 6 MUNICIPAL	1 2	I	ł	
WATER USE	3   IRRIGATION 4   INDUSTRIAL	7 PUBLIC SUPPLY  B COOLING OR AIR CONDITIONING	7			
	OTHER	³ □ NOT USED	W W			
METHOD OF	CABLE TOOL ROTARY (CONVENT ROTARY (REVERSE)	i				1
DRILLING	S MAIR PERCUSSION	3 DRIVING	11		04	697
NAME OF WELL CO		LICENCE NUMBER	DRILLERS REMARKS:	NTRACTOR 59-62 DATE RECEIVE	FD.	61.61.60
& Capital V	Water Supply Lt		SOURCE	J	ÜL 0 9 19	87
BOX 490			O DATE OF INSPECTION	INSPECTOR		
12	Stittsville,	LICENCE NUMBER	TEMAPKS			
$\Gamma V M = I / I$	NIRACTOR	SUBMISSION DATE	FICE			
Lyrax	wanach	/ DAY 17 NO 6 V87	ō			

# The Ontario Water Resources Act WATER WELL RECORD

Ontario		I SPACES PROVIDED RECT BOX WHERE APPLICABLE	11	1	5230	59	15002	CON.		
COUNTY OR DISTRICT		TOWNSHIP, BOROUGH CITY		GE		CON	BLOCK, TRACT, SURVEY			22 23 24 LOT 25-27
Ottawa C	RST) 28-47	Gloucest						DATE COM	1 11	22 44-53 88
Douglas 21	MacDonald Corp	oration 210 Co	olonnade	RC.	Nepean	Ontai	Cio K2E 7L5	DAY Z	<u> мо 11</u>	YR. 60
	M 10 12	OG OF OVERBURDEN	AND REI	- F	RAATEDIA	30	31			47
GENERAL COLOUR	MOST COMMON MATERIAL	OTHER MATI		, nock	IVATENIA		AL DESCRIPTION		DEPTH	
Brown	Clay				Pack	ഹ്			FROM	16
Gray	Clay				Stic				16	45
Gray	Sand				Pack				45	62
Gray	Limestone								62	190
Gray,Whi	te Sandstone								190	250
		<u> </u>						<del></del>		
		-			<del></del>					
								<del>_</del> .		
31				<u></u> L		البلب	1111111	بيا لي	<u> </u>	
32	14 15				ليللين	البل	54	ىيا لى		75 40
WATER FOUND	ER RECORD	51 CASING & C	PEN HOL		ORD	Z SIZE IS	OF OPENING	31-33 DIAME	TER 34-38 L	ENGTH 39-40
	K FRESH 3□SULPHUR 14	DIAM MATERIAL	THICKNESS INCHES	FROM	10		RIAL AND TYPE	L	DEPTH TO TOP OF SCREEN	41-44 30
245	SALTY 4   MINERALS   6   GAS   FRESH 3   SULPHUR   19	6 1/42 GALVANIZED 3 CONCRETE 4 OPEN HOLE	.188	0	65	61	DILICCING	D CEAL	INC DECO	FEET
	SALTY 4 MINERALS 6 GAS  FRESH 3 SULPHUR	5 □ PLASTIC 19		,	20-23	DEPTH S	PLUGGING	ATERIAL AND	TYPE (CEME)	NT GROUT
2 0	SALTY 4 MINERALS 6 GAS  FRESH 3 SULPHUR	6 1 2 GALVANIZED 3 CONCRETE 4 TOPEN HOLE 5 PLASTIC		65	250	FROM 10	10 14-17	<del></del>	LEAU PAI	CKER. ETC.)
2 🗆	SALTY 6 GAS	24-25 1 STEEL 2 GALVANIZED			27-30	,,	-21 22-25			
טין ו	FRESH 3 USULPHUR 3 4 UMINERALS SALTY 6 UGAS	3 ☐ CONCRETE 4 ☐ OPEN HOLE 5 ☐ PLASTIC				26	29 30-33 80			
71 PUMPING TEST METH		3.0 3 15-16	6 17	7-18		L	OCATION O	F WEL	L	
STATIC LEVEL	WATER LEVEL 25	EVELS DURING T X P	RSMI PUMPING RECOVERY	NS	IN DIAC		OW SHOW DISTANCES ICATE NORTH BY ARE		FROM ROAD AN	ND .
TEST 19-21	22-24 15 MINUTES 26-1	30 MINUTES 45 MINUTES	60 MINUTES		A			(		
	60 FEET 60 FEE		F TEST	42 42				/	12	; 
IF FLOWING, GIVE RATE  RECOMMENDED PUM	GPM P TYPE RECOMMENDED	60 FEET 1 CLEAR  43-45 RECOMMENDED	2 ☐ CLOUD	· 49				'	\	
SHALLOW	DEEP SETTING	100 RATE	5 6	PM		Riv	ER Rd.		Balmoral	
FINAL	\$4 water supply	■ ABANDONED, INSUFF	ICIENT SUPPL	-			Rd.	_	16	
FINAL STATUS	2 OBSERVATION WELL 3 TEST HOLE	L				ı	<i>t</i> :			-
OF WELL	4 ☐ RECHARGE WELL  -54 1 ☐ DOMESTIC	9 DEWATERING		-		1	28///35			
WATER USE	2 STOCK 3 IRRIGATION 4 INDUSTRIAL	MUNICIPAL PUBLIC SUPPLY				1 _				
USE	OTHER	COOLING OR AIR CONDITION					l l			
METHOD	CABLE TOOL ROTARY (CONVENT	6 ☐ BORING  TIONAL) 7 ☐ DIAMOND				1				
OF CONSTRUCTIO		DRIVING				Ho	JOSE # 3560	)	383	381
NAME OF WELL C	S AIR PERCUSSION	☐ DIGGING	CONTRACTOR		DATA	58 C	ONTRACTOR 59-62 D	ATE RECEIVED		63-64 80
	Water Supply	I	L558	N L	SOURCE DATE OF INSPEC	1	558	DEC	2 1 1988	t
انا		Ontario KOA 30	<b>3</b> 0	SE 0		, (UR	INSPECTOR	÷ ,	:	
S. Mill	er,	LICENC	TECHNICIAN CE NUMBER 0097		REMARKS					
SIGNATURE OF T	CINICIAN/CONTRACTOR	SUBMISSION DATE  DAY 2 MO.	11 28	A PERCE						
MINISTRY	OF THE ENVIRON			<u>ــا لـــ</u>	i			FOF	RM NO. 0506 (11	/86) FORM 9

# A 057062


Ministry of


Well Tag No. (Place Sticker and/or Print Below)

Well	Re	CO	rd
------	----	----	----

Measureme	ents record	ed in:	letric I	mperial	405	+002-	HRVIN			, 000 0	Page_		of
Well Owr		, L	ast Name / C	rganization	ı			E-mail Address					Constructed
Mailing Add	ress (Street	truction. Number/Nan	ne)		N	Municipality	1	Province	Postal Code		Telephone N	o. (inc.	
256 Well Loca	1010/07/07/07/07/07/07/07/07/07/07/07/07/07	20tto	<u>Au.</u>			Glou	cester	Ontario	K 1 T 3	VIF	6 1 3 8	112	1 4 4 0
Address of \	Well Locatio	in (Street Nun	nber/Name)		Ī	Township		0.00 (1.00 (	Lot		Concession		
County/Dist	Avmstv rict/Municip	ality	الم			City/Town/Villa	age	Ottawa		Provin		Postal	Code
UTM Coordi			1	rthing		Municipal Pla	n and Sublo			Other	1110		
		니시 시 6 : rock Materia				ord (see instru	ctions on the	back of this form)	240				\$
General Co		Most Comm				ner Materials			eral Description			Dept From	h ( <i>m/ft</i> ) To
					p.,					1			
		120000000000000000000000000000000000000											
									200000000000000000000000000000000000000				
Depth Se	tat ( <i>m<b>(</b>ft)</i> )		Annular Type of Sea	lant Used		Volume		After test of well yield,		Dr	aw Down		ecovery
From	To To	4.444.000000000000000000000000000000000	Material and Muliphun	d Type)		(m³,	/ft²)	☐ Clear and sand ☐ Other, <i>specify</i>	tree	(min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
	V		THE WITH THE	-4444	The Annual Print of the An			If pumping discontinu	ed, give reason:	Static Level	114004000000000000000000000000000000000		
								Pump intake set at (	m/ft)	1 2		2	
								Pumping rate (I/min /	GPM)	3		3	
Meth	od of Cor	nstruction Diamond	Pub	olic	Well Us		/ Not used			4		4	
	Conventional)	☐ Jetting ☐ Driving	☐ Dor		☐ Municip		Dewatering Monitoring		min	5		5	
☐ Boring ☐ Air percu		Digging	☐ Irrig	•	Cooling	& Air Conditio	oning	Final water level end	of pumping <i>(m/ft)</i>			10	
Other, sp		struction R		er, specify _ ina		Status	of Well	If flowing give rate (h	min / GPM)	15		20	
Inside Diameter	Open Hole	OR Material d, Fibreglass,	Wall Thickness	Depth	( <i>m/ft</i> )	☐ Water S		Recommended pur	ip depth (m/ft)	25		25	
(cm(lin))	Concrete, I	Plastic, Steel)	(cm/in) WJA	From ) 4	To O	☐ Test Ho	i	Recommended pum	p rate	30	1/////	30	
75	o pon	r wu				☐ Dewate	ring Well ation and/or	Well production (I/mi	in / GPM)	40		40	
		4.6669.9999.989999				Monitori Alteration (Constru	on	Disinfected?		50		50	
						Abando		Yes No		60	41	60	
Outside		onstruction R		12222222222222222222222222222222222222	n ( <i>m/ft</i> )	Water 0		Please provide a ma	Map of W below following			ack.	
Diametar (cm/n)		vanized, Steel)	Slot No.	From	To	specify	tructim						
48"				14	0	Other, s							
		Water De	talls			Hole Diamet	ter	And-depologramstatered					
		Kind of Wate		Untested	De <sub>l</sub> From	oth ( <i>m/ft</i> ) To	Diameter (cm/in)						
Water four	nd at Depth	Kind of Wate	r: Fresh	Untested				Management of the state of the					
		Other, spe Kind of Wate		Untested									
(п		Other, spe		Technicia									
	ame of Wel	THE RESERVE OF THE PROPERTY OF THE PARTY.				ell Contractor's	Licence No.						
Business A	ddress (Stre	eet Number/Na	ame)		M	Unicipality Offwa		Comments:		***************************************			
Province	P	ostal Code		s E-mail Add		<b>A</b> 11.		Well owner's Date	Package Deliver	ed	Minis	itrv Us	e Only
On Bus.Telepho	one No. (inc.	area code) No	ame of Well	K (V MA) Cechnigian (	va Than Last Name	frs Name)	im	information package	Y Y M M	.	Audit No		
1611 3	8 2 2 0	No. Signature	-/1/10	1441	ontractor D	ate Submitted		Yes Date	Work Completed	d	JUN 1	U 	
3 2 0506E (2007/	7	no 11h	ebb. 1	16+1		2012	<i>u</i>		011/06	0 6	Received		w ife
	,		•			4 m m m m m m mm 46.5	2 In )						

Google

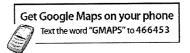

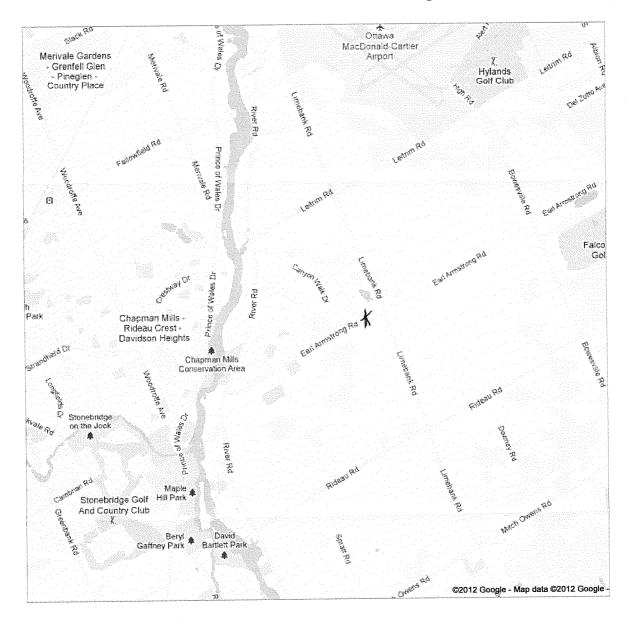

JUN 1 1 2012

C-6894 2126081



3/6/5.2

# The Ontario Water Resources Commission Act WATER WELL RECORD

County or District Carleton  Con. 1 R, FRONT. Lots 22 22 I	Fownship, Villa	age, T	own or City	Gloucester	
Owner P. E. Blais Const. (Radio C.J.R.C.) Job					
(print in block letters)  Casing and Screen Record			Pumpin		
Inside diameter of casing 51.	Static level		3'		
Total length of casing 321	Test-pump	ing ra	ite18	3	G.P.M.
Type of screen	Pumping le	evel	20	!	
Length of screen	Duration o	f test ]	oumping	2 hrs.	
Depth to top of screen				test clear	
Diameter of finished hole 5½"	Recommer	nded 1	oumping rate.	6	G.P.M
	with pump	settir	ng of 20	feet belo	w ground surface
Well Log				Water	Record
Overburden and Bedrock Record	From ft.		To ft.	Depth(s) at which water(s) found	Kind of water (fresh, salty, sulphur)
blue clay	2		29	33	fresh
grey hard limestone	2	9	33		
For what purpose(s) is the water to be used? domestic	In c			of Well distances of wellicate north by	
Is well on upland, in valley, or on hillside? valley!			, 11		
Drilling or Boring Firm					70/5
G. Charbonneau, Diamond & Cable Drilling,			5		Y
Address R. R. 1, Box 194, Orleans, Ont.		Ç	I = I	exp Stron	19 20 ROAP
Licence Number 3039		V	/ <u>/</u>	, , , , , , , , , , , , , , , , , , ,	The second of th
Address R. R. 1, Box 19x4x 194, Orleans, Ont.  Date 15 May 1968.  (Signature of Licensed Drilling or Boring Contractor)  Form 7 5M 60-20912			B.F	Trances -	LOTE
OWRC COPY				OSS	58

# **APPENDIX 3**

**QUALIFICATIONS OF ASSESSORS** 

# Mandy Witteman, E.I.T.



Geotechnical Engineering

Environmental Engineering

**Hydrogeology** 

Geological Engineering

**Materials Testing** 

**Building Science** 

Archaeological Services

# **POSITION**

**Environmental Engineer** 

## **EDUCATION**

Carleton University, M.A.Sc., Environmental Engineering, 2013 Carleton University, B.Eng., Environmental Engineering, 2008

# **MEMBERSHIPS & AWARDS**

Alberta Professional Engineers and Geoscience Association NSERC Industry R&D Scholarship

# **EXPERIENCE**

2018 - Present

Paterson Group Inc.

Consulting Engineers Geotechnical and Environmental Division Environmental Engineer

2014 - 2015

**Thurber Engineering Limited** 

Oil Sand Tailings Group Tailings Engineer

2014 - 2013

**Carleton University** 

Department of Civil & Environmental Engineering Research Engineer

2013 - 2009

**Carleton University** 

Department of Civil & Environmental Engineering Research Assistant and Teachers Assistant

2008 - 2009

**SLR Consulting Limited** 

**Contaminated Sites** 

Junior Environmental Engineer

# Mark S. D'Arcy, P. Eng.

# patersongroup

Geotechnical Engineering

Environmental Engineering

**Hydrogeology** 

Geological Engineering

**Materials Testing** 

**Building Science** 

Archaeological Services

# **POSITION**

Associate and Supervisor of the Environmental Division Senior Environmental/Geotechnical Engineer

# **EDUCATION**

Queen's University, B.A.Sc.Eng, 1991 Geotechnical / Geological Engineering

## **MEMBERSHIPS**

Ottawa Geotechnical Group Professional Engineers of Ontario

## **EXPERIENCE**

1991 to Present

Paterson Group Inc.

Associate and Senior Environmental/Geotechnical Engineer Environmental and Geotechnical Division Supervisor of the Environmental Division

# **SELECT LIST OF PROJECTS**

Mary River Exploration Mine Site - Northern Baffin Island

Agricultural Supply Facilities - Eastern Ontario

Laboratory Facility – Edmonton (Alberta)

Ottawa International Airport - Contaminant Migration Study - Ottawa

Richmond Road Reconstruction - Ottawa

Billings Hurdman Interconnect - Ottawa

Bank Street Reconstruction - Ottawa

Environmental Review - Various Laboratories across Canada - CFIA

Dwyer Hill Training Centre - Ottawa

Nortel Networks Environmental Monitoring - Carling Campus - Ottawa

Remediation Program - Block D Lands - Kingston

Investigation of former landfill sites - City of Ottawa

Record of Site Condition for Railway Lands - North Bay

Commercial Properties - Guelph and Brampton

Brownfields Remediation - Alcan Site - Kingston

Montreal Road Reconstruction - Ottawa

Appleford Street Residential Development - Ottawa

Remediation Program - Ottawa Train Yards

Remediation Program - Bayshore and Heron Gate

Gladstone Avenue Reconstruction – Ottawa

Somerset Avenue West Reconstruction - Ottawa